GATEWAY EASEMENT

Project Name: ~~Leong St~~

Date: 12/7/2012 12:57:00 AM
Asset Location:
Distance: 0
Run Number:
Pipe Size: 15

Pipe ID:
Start ID: F5 56
End ID: F5 54
Direction: Down Stream
Pipe Type: vcp

Distance	Fault Observation	Time	Picture
26.9	Cracks Position: 12 Severity: None	03:03	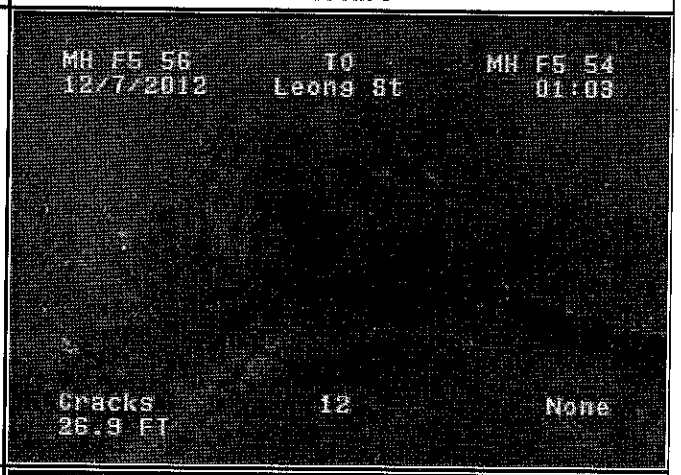
96.2	Broken Severity: None	19:58	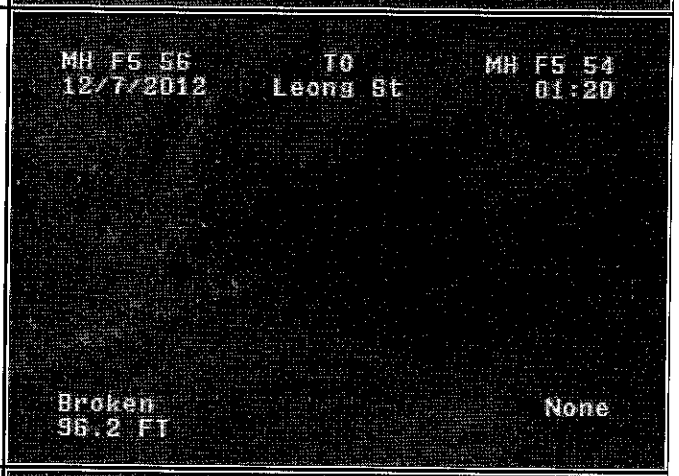
96.2	End Inspection Severity: None	20:39	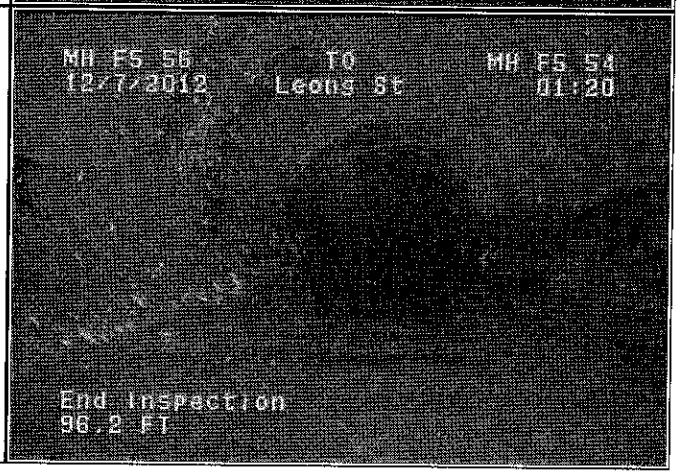

Created with the POSM report generator

Project Name: Leong St

Date:
Asset Location:
Distance: 0
Run Number:
Pipe Size: 15

Pipe ID:
Start ID: F5 56
End ID: F5 54
Direction: Down Stream
Pipe Type: vcp

Distance	Fault Observation	Time	Picture
0.0	Start Inspection Severity: None	13	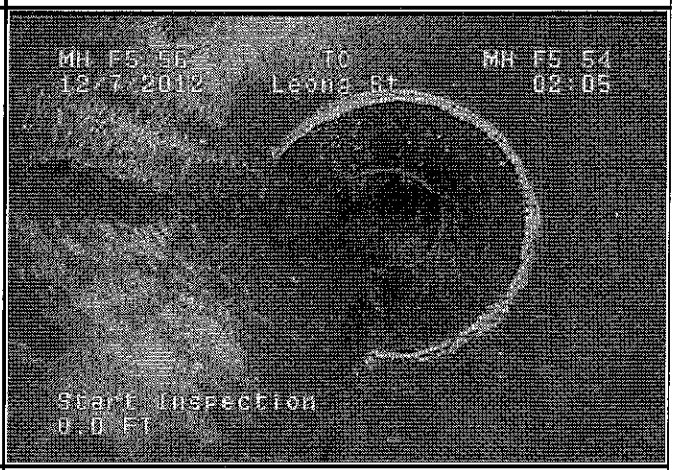
22.0	Cracks Position: 12 Severity: None	01:59	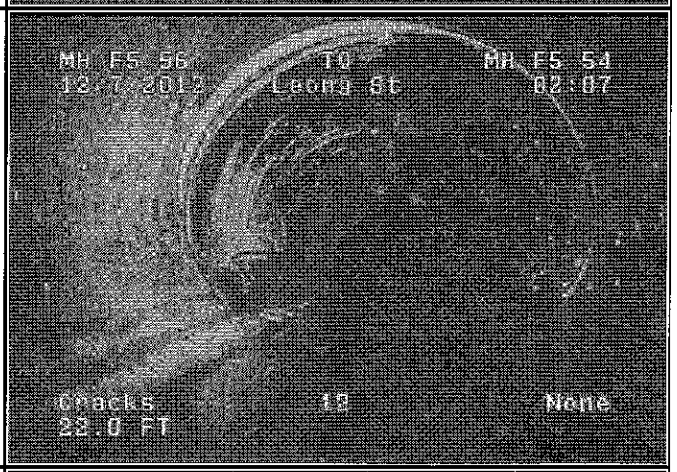
214.7	End Inspection Severity: None	09:02	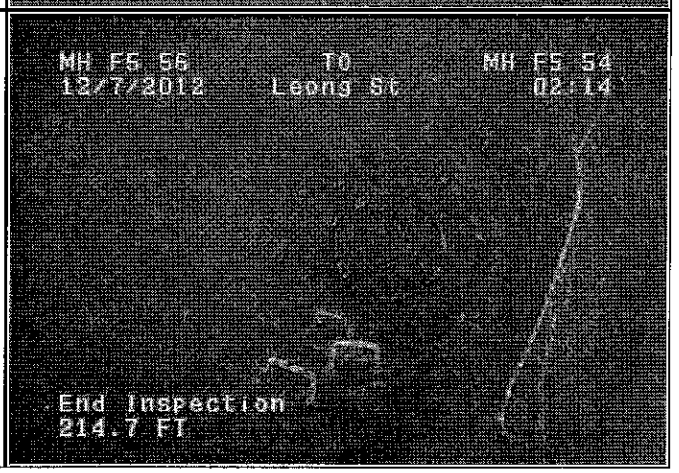

Created with the POSM report generator

Project Name: Leong St

Date: 12/7/2012 2:19:00 AM
Asset Location:
Distance: 0
Run Number:
Pipe Size: 15

Pipe ID:
Start ID: F5 54
End ID: F5 52
Direction: Down Stream
Pipe Type: vcp

Distance	Fault Observation	Time	Picture
0.0	Start Inspection Severity: None	23	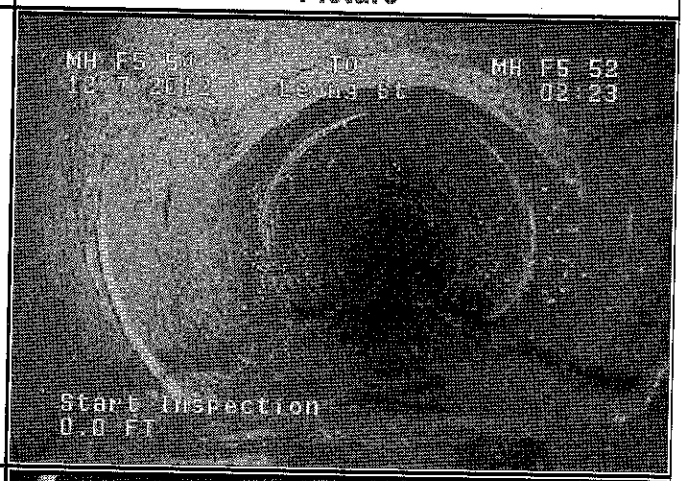
294.8	Manhole Severity: None	12:07	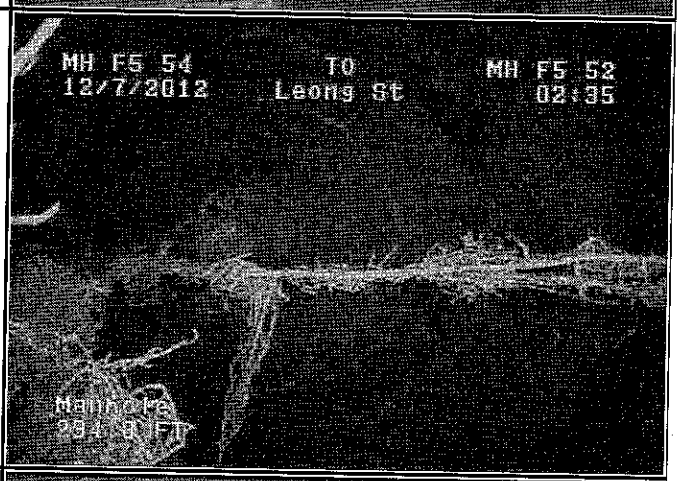
338.1	Broken Severity: None	18:27	

Distance	Fault Observation	Time	Picture
338.1	End Inspection Severity: None	18:41	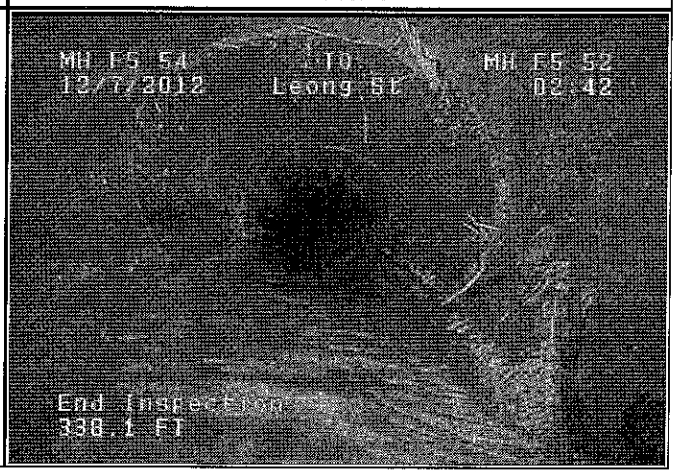

Created with the POSM report generator

Project: CITY OF MOUNTAIN VIEW

Date: 1/3/2013 4:40:00 AM
Street:
Length Surveyed: 322.6
Pacp Quick Overall Rating: 4232
Height (Diameter): 15
Street:

Pipe Segment Reference:
Upstream MH: F5-54
Downstream MH: F5-52
Direction of Survey: Upstream
Material: Vitrified Clay Pipe

Distance	Fault Observation	Time	Picture
0.0	Start Inspection Severity: None Remarks: start	31	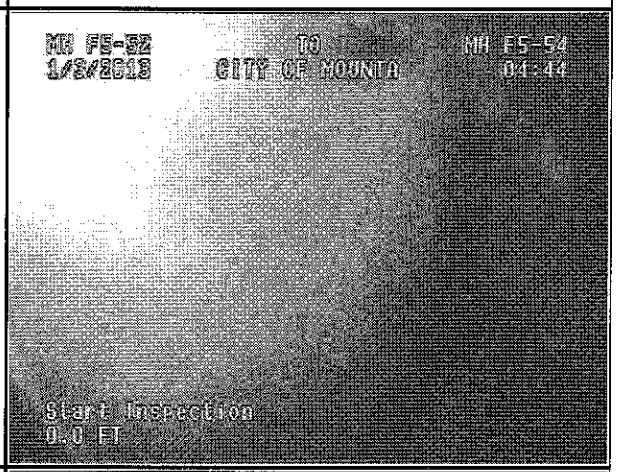
164.8	Crack Longitudinal Position: 12 Severity: None Struct Weight: 2	06:45	
167.5	Roots Fine Joint Position: 10 Severity: None Joint Maint Weight: 1	07:05	

Distance	Fault Observation	Time	Picture
173.6	Crack Longitudinal Position: 2 Severity: None Struct Weight: 2	07:33	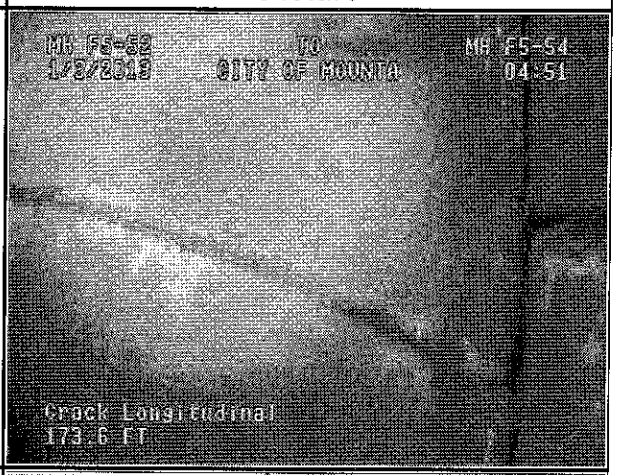
173.6	Infil Runner Position: 3 Severity: None Maint Weight: 4	07:50	
178.8	Roots Fine Joint Position: 1 Severity: None Joint Maint Weight: 1	08:14	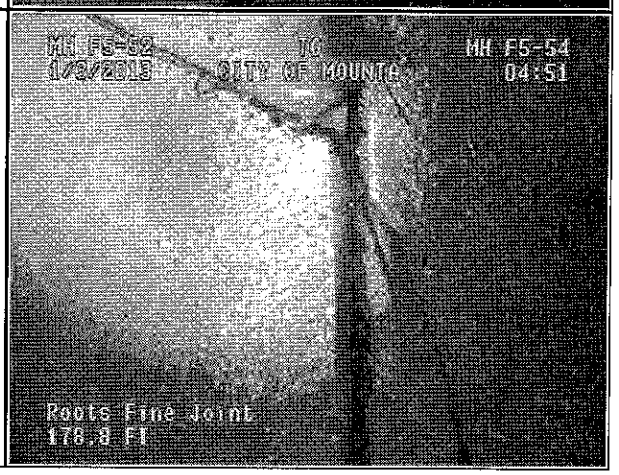

Distance	Fault Observation	Time	Picture
178.8	Crack Longitudinal Position: 1 Severity: None Struct Weight: 2	08:30	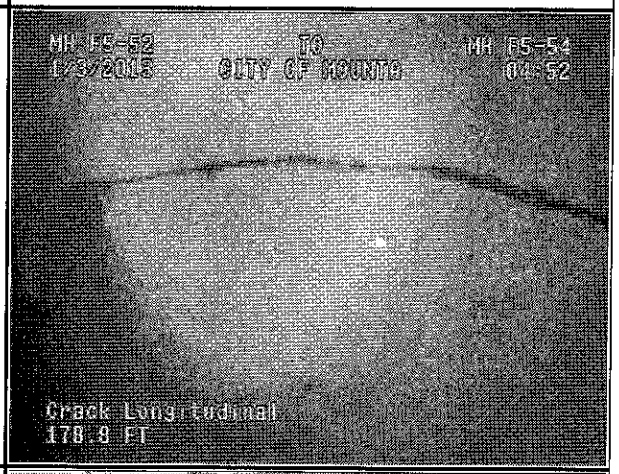
183.4	Crack Longitudinal Position: 12 Severity: None Struct Weight: 2	08:56	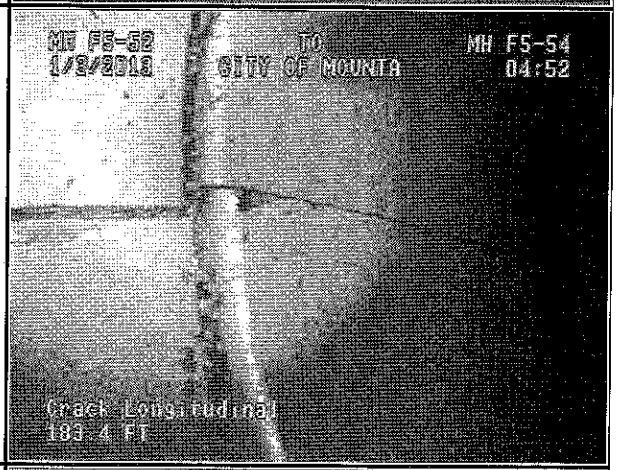
193.9	Infil Runner Position: 9 Severity: None Maint Weight: 4	09:29	

Distance	Fault Observation	Time	Picture
276.6	Crack Multiple Position: 6 To 9 Severity: None Struct Weight: 3	12:03	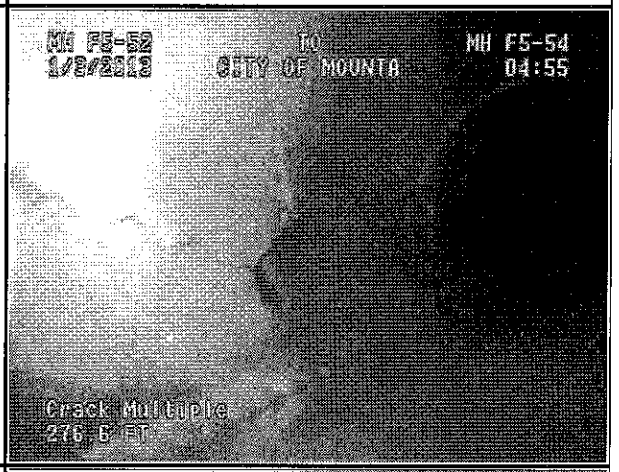
290.0	General Observation Severity: None Remarks: Pipe looks egg shaped	13:02	
321.6	Broken Position: 9 Severity: None Struct Weight: 3	14:32	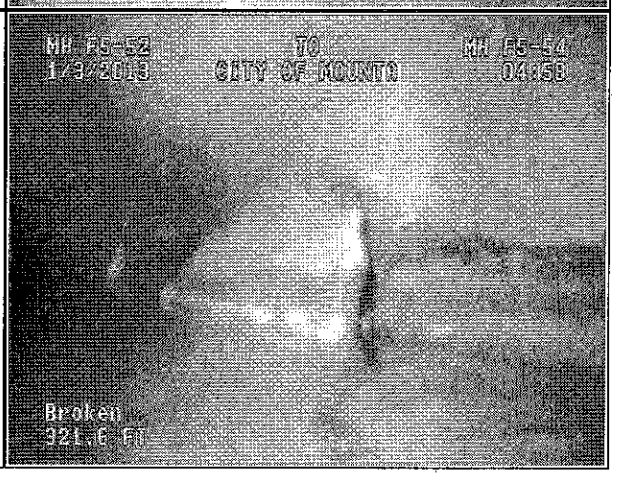

Distance	Fault Observation	Time	Picture
322.6	End Inspection Severity: None Remarks: cannot pass break at 6 ocklock.	15:21	

Created with the POSM report generator

Project: CITY OF MOUNTAIN VIEW

Date: 1/3/2013 5:12:00 AM
Street:
Length Surveyed: 170.5
Pacp Quick Overall Rating: 5142
Height (Diameter): 15
Street:

Pipe Segment Reference:
Upstream MH: F5-52
Downstream MH: F5-34
Direction of Survey: Downstream
Material: Vitrified Clay Pipe

Distance	Fault Observation	Time	Picture
0.0	**Start Inspection** **Severity: None** **Remarks: start**	26	
92.5	**Infil Dripper** **Position: 12** **Severity: None** **Maint Weight: 3**	03:25	
96.6	**Infil Runner** **Position: 9** **Severity: None** **Maint Weight: 4**	03:47	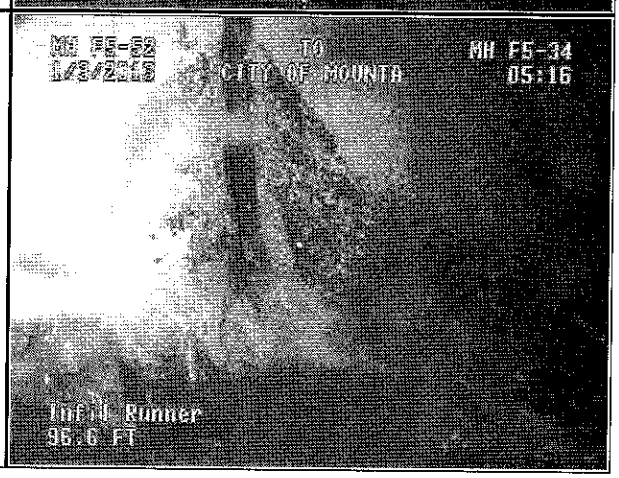

Distance	Fault Observation	Time	Picture
99.4	Infil Runner Position: 11 Severity: None Maint Weight: 4	04:05	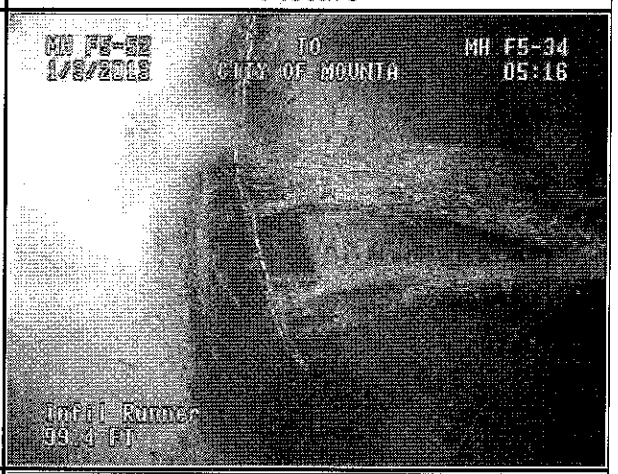
106.7	Infil Gusher Position: 10 Severity: None Maint Weight: 5	04:32	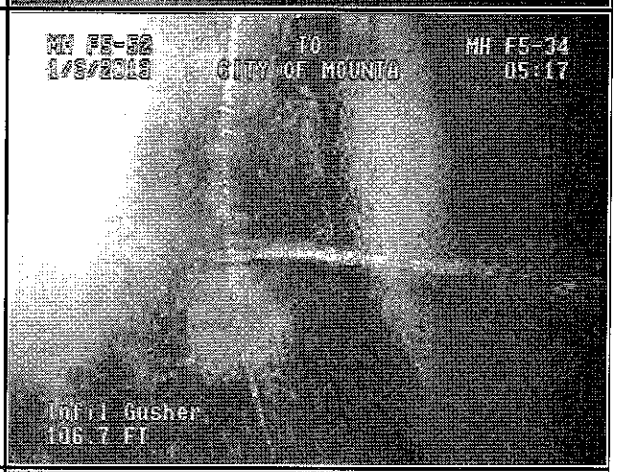
128.2	Crack Circumferential Position: 11 To 4 Severity: None Struct Weight: 1	05:14	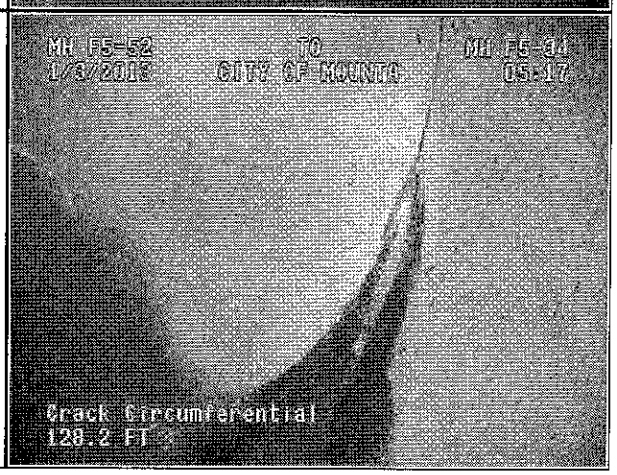

Distance	Fault Observation	Time	Picture
170.5	End Inspection Severity: None	06:27	

Created with the POSM report generator