Analytical Resources, Incorporated
Analytical Chemists and Consultants

September 22, 2009

Doug Morell
Golder Associates Inc.
18300 NE Union Hill Road, Suite 200
Redmond, WA 98052

RE: Project: Avery Landing, 073-93312
ARI Job No: PN10, PN14, PN53, & PN54

Dear Mr. Morell:

Please find enclosed the original Chain-of-Custody (COC) records, sample receipt documentation, and the data package for the project referenced above.

Sample receipt and details of these analyses are discussed in the Case Narrative.

An electronic copy of this package will remain on file with Analytical Resources, Inc. (ARI). Should you have any questions or problems, please feel free to call me at any time.

Sincerely,
ANALYTICAL RESOURCES, INC.

Cheronne Oreiro
Project Manager
-For-
Kelly Bottem
Client Services Manager
(206) 695-6211
kellyb@arilabs.com

cc: eFile: PN10

Enclosures

4611 South 134th Place, Suite 100 • Tukwila WA 98168 • **206-695-6200** • **206-695-6201** fax

Chain of Custody
Documentation

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN10, PN14, PN53, PN54

prepared
by

Analytical Resources, Inc.

PNIO

SAMPLE CHAIN OF CUSTODY

Send Report To Doug Morell
Company Golder Associates
Address 18300 NE Union Hill Road
City, State, ZIP Redmond WA 98052
Phone # 425-883-0777 Fax # 425-882-5498

SAMPLERS (signature)
PROJECT NAME/NO. Avery Landing 073-93312
PO #
REMARKS Please send Tier IV Data package (EPA CLP deliverable).

Page # 1 of 1

TURNAROUND TIME
[X] Standard (2 WEEKS)
[ ] RUSH
Rush charges authorized by:

SAMPLE DISPOSAL
[X] Dispose after 30 days
[ ] Return samples
[ ] Will call with instructions

Sample ID	Lab ID	Date	Time	Sample Type	# of containers	TPH-Diesel extended	TPH-Gasoline	BTEX by 8021B	VOCs by 8260	SVOCs by 8270	HFS	PCB (8082A low level)	PAH * (8270 SIM)	TAL Metals (Total)	TAL Metals (Diss)		Notes
G-GA35-090309		9/3/09	950	water	7	X						X	X	X	hold		* PAH analysis must include naphthalene 1-methylnaphthalene 2-methylnaphthalene
																	Hold Dissolved metals bottle pending analysis of total metals.
																	Please see project specific reporting limits.

SIGNATURE	PRINT NAME	COMPANY	DATE	TIME
Relinquished by:	K Longley	Golder Associates	9/3/09	1330
Received by:	A. Volgardsen	ARI	9/4/09	955
Relinquished by:				
Received by:				

Friedman & Bruya, Inc.
3012 16th Avenue West
Seattle, WA 98119-2029
Ph. (206) 285-8282
Fax (206) 283-5044
FORMS\COC\COC.DOC

* Please send copy of received COC

Samples received at 3.4 °C

PNIO 090903

Analytical Resources, Incorporated
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Golder Project Name: Avery Landing

COC No(s): _____ (NA) Delivered by: (Fed-Ex) UPS Courier Hand Delivered Other: _____

Assigned ARI Job No: PN10 Tracking No: 8697 3361 4340 NA

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of to cooler?	(YES)	NO
Were custody papers included with the cooler?	(YES)	NO
Were custody papers properly filled out (ink, signed, etc.)	(YES)	NO

Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry)..... 3.4

If cooler temperature is out of compliance fill out form 00070F Temp Gun ID#: 1018816

Cooler Accepted by: AV Date: 9/4/09 Time: 955

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler?		YES	(NO)
What kind of packing material was used? ...	(Bubble Wrap) (Wet Ice) Gel Packs (Baggies) Foam Block Paper Other: _____		
Was sufficient ice used (if appropriate)?	NA	(YES)	NO
Were all bottles sealed in individual plastic bags?		(YES)	NO
Did all bottles arrive in good condition (unbroken)?		(YES)	NO
Were all bottle labels complete and legible?		(YES)	NO
Did the number of containers listed on COC match with the number of containers received?		(YES)	NO
Did all bottle labels and tags agree with custody papers?		(YES)	NO
Were all bottles used correct for the requested analyses?		(YES)	NO
Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs)...	NA	(YES)	NO
Were all VOC vials free of air bubbles?	(NA)	YES	NO
Was sufficient amount of sample sent in each bottle?		(YES)	NO

Samples Logged by: AV Date: 9/4/09 Time: 1046

***** Notify Project Manager of discrepancies or concerns *****

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: Date:

Small Air Bubbles ~2 mm	Peabubbles 2-4 mm	LARGE Air Bubbles > 4 mm

Small → "sm"
Peabubbles → "pb"
Large → "lg"
Headspace → "hs"

PRESERVATION VERIFICATION 09/04/09
Page 1 of 1

ANALYTICAL RESOURCES INCORPORATED

ARI Job No: **PN10**

Inquiry Number: NONE
Analysis Requested: 09/04/09
Contact: Morell, Douglas
Client: Golder Associates
Logged by: AV
Sample Set Used: Yes-481
Validatable Package: Lv4
Deliverables:

PC: Kelly
VTSR: 09/04/09

Project #: 073-93312
Project: Avery Landing
Sample Site:
SDG No:
Analytical Protocol: In-house

LOGNUM ARI ID	CLIENT ID	CN >12	WAD >12	NH3 <2	COD <2	FOG <2	MET <2	PHEN <2	PHOS <2	TKN <2	NO23 <2	TOC <2	S2 >9	AK102 <2	Fe2+ <2	DMET FLT	DOC FLT	PARAMETER	ADJUSTED TO	LOT NUMBER	AMOUNT ADDED	DATE/BY
09-20720 **PN10A**	G-GA3[illegible]-090309						TOT															

Checked By AV Date 9/4/09

DNLS 0955

Analytical Resources, Incorporated
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Golder
Project Name: Avery Landing
COC No(s): NA
Delivered by: Fed-Ex UPS Courier Hand Delivered Other:
Assigned ARI Job No: PN10
Tracking No: 8097 3361 4340 NA

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of to cooler?	YES	NO
Were custody papers included with the cooler?	YES	NO
Were custody papers properly filled out (ink, signed, etc.)	YES	NO

Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry)..... 3.4
If cooler temperature is out of compliance fill out form 00070F
Temp Gun ID#: 101886

Cooler Accepted by: AV Date: 9/4/09 Time: 955

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler?		YES	NO
What kind of packing material was used? ... Bubble Wrap Wet Ice Gel Packs Baggies Foam Block Paper Other:			
Was sufficient ice used (if appropriate)?	NA	YES	NO
Were all bottles sealed in individual plastic bags?		YES	NO
Did all bottles arrive in good condition (unbroken)?		YES	NO
Were all bottle labels complete and legible?		YES	NO
Did the number of containers listed on COC match with the number of containers received?		YES	NO
Did all bottle labels and tags agree with custody papers?		YES	NO
Were all bottles used correct for the requested analyses?		YES	NO
Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs)...	NA	YES	NO
Were all VOC vials free of air bubbles?	NA	YES	NO
Was sufficient amount of sample sent in each bottle?		YES	NO

Samples Logged by: AV Date: 9/4/09 Time: 1046

***** Notify Project Manager of discrepancies or concerns *****

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: Date:

Small → "sm"
Peabubbles → "pb"
Large → "lg"
Headspace → "hs"

PRESERVATION VERIFICATION 09/04/09
Page 1 of 1

ANALYTICAL RESOURCES INCORPORATED

ARI Job No: **PN14**

Inquiry Number: NONE
Analysis Requested: 09/04/09
Contact: Morell, Douglas
Client: Golder Associates
Logged by: AV
Sample Set Used: Yes-481
Validatable Package: No
Deliverables:

PC: Kelly
VTSR: 09/04/09

Project #: 073-93312
Project: Avery Landing
Sample Site:
SDG No:
Analytical Protocol: In-house

LOGNUM ARI ID	CLIENT ID	CN >12	WAD >12	NH3 <2	COD <2	FOG <2	MET <2	PHEN <2	PHOS <2	TKN <2	NO23 <2	TOC <2	S2 >9	AK102 <2	Fe2+ <2	DMET FLT	DOC FLT	PARAMETER	ADJUSTED TO	LOT NUMBER	AMOUNT ADDED	DATE/BY
09-20749 **PN14A**	G-GA3S-090309						TOT															

PN14 : 50007

Checked By AV Date 9/21/09

PN53

SAMPLE CHAIN OF CUSTODY

Send Report To Doug Morrell & Kirsi Longley
Company Golder Associates
Address 18300 NE Union Hill Road
City, State, ZIP Redmond, WA 98052
Phone # 425-883-0777 Fax #

SAMPLERS (signature)
PROJECT NAME/NO. Avery Landing 073-93312-03
PO #
REMARKS Please use project specific reporting limits. VOC's & SVOC's must be Target Compound List. Metals must be

Page # 1 of 1

TURNAROUND TIME
- [X] Standard (2 Weeks)
- [ ] RUSH
Rush charges authorized by:

SAMPLE DISPOSAL
- [X] Dispose after 30 days
- [ ] Return samples
- [ ] Will call with instructions

Sample ID	Lab ID	Date	Time	Sample Type	# of containers	ANALYSES REQUESTED: NWTPH-Diesel extended	~~TPH-Gasoline~~	~~BTEX by 8021B~~	TCL VOC (8260B) ~~VOCs by 8260~~ low level	TCL SVOC (8270 ~~SVOCs by 8270~~ low level	~~HFS~~	PCB (8082A) low level	PAH (8270 SIM)	TAL metals (Total)	TAL metals (dissolved)		Notes
G-RS3SSW-090609		9/6/09	1145	W	7	X						X	X	X	Hold		Hold dissolved metals bottle pending analysis.
G-RS5SSED-0-090809		9/8/09	840	S	5	X			X	X		X	X	X			

SIGNATURE	PRINT NAME	COMPANY	DATE	TIME
Relinquished by:	Kirsi Longley	Golder Associates	9/8/09	1430
Received by:	Tikka Mukumba	ARI	9/10/09	950
Relinquished by:				
Received by:				

Samples received at 4.0 °C

Friedman & Bruya, Inc.
3012 16th Avenue West
Seattle, WA 98119-2029
Ph. (206) 285-8282
Fax (206) 283-5044
FORMS\COC\COC.DOC

PN53 : 090905

Analytical Resources, Incorporated
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Golder Associates
COC No(s): _____ (NA)
Assigned ARI Job No: PN53

Project Name: Avery landing
Delivered by: Fed-Ex UPS Courier Hand Delivered Other: _____
Tracking No: 839682281475 NA

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of to cooler?	(YES)	NO
Were custody papers included with the cooler?	(YES)	NO
Were custody papers properly filled out (ink, signed, etc.)	(YES)	NO

Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry)..... 4.0

If cooler temperature is out of compliance fill out form 00070F Temp Gun ID#: 101886

Cooler Accepted by: MM Date: 9/10/09 Time: 950

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler?		YES	(NO)
What kind of packing material was used? ...	(Bubble Wrap) (Wet Ice) Gel Packs (Baggies) Foam Block Paper Other: _____		
Was sufficient ice used (if appropriate)?	NA	(YES)	NO
Were all bottles sealed in individual plastic bags?		(YES)	NO
Did all bottles arrive in good condition (unbroken)?		(YES)	NO
Were all bottle labels complete and legible?		(YES)	NO
Did the number of containers listed on COC match with the number of containers received?		(YES)	NO
Did all bottle labels and tags agree with custody papers?		(YES)	NO
Were all bottles used correct for the requested analyses?		(YES)	NO
Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs)...	NA	(YES)	NO
Were all VOC vials free of air bubbles?	(NA)	YES	NO
Was sufficient amount of sample sent in each bottle?		(YES)	NO

Samples Logged by: AV Date: 9/10/09 Time: 1143

** ***Notify Project Manager of discrepancies or concerns*** **

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: Date:

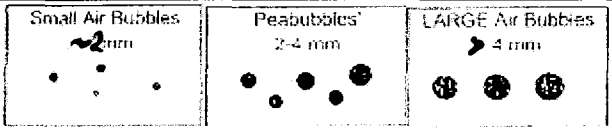

Small → "sm"
Peabubbles → "pb"
Large → "lg"
Headspace → "hs"

PRESERVATION VERIFICATION 09/10/09
Page 1 of 1

ANALYTICAL RESOURCES INCORPORATED

ARI Job No: **PN53**

Inquiry Number: NONE
Analysis Requested: 09/10/09
Contact: Morell, Douglas
Client: Golder Associates
Logged by: AV
Sample Set Used: Yes-481
Validatable Package: Lv4
Deliverables:

PC: Kelly
VTSR: 09/10/09

Project #: 073-93312-03
Project: Avery Landing
Sample Site:
SDG No:
Analytical Protocol: In-house

LOGNUM ARI ID	CLIENT ID	CN >12	WAD >12	NH3 <2	COD <2	FOG <2	MET <2	PHEN <2	PHOS <2	TKN <2	NO23 <2	TOC <2	S2 >9	AK102 <2	Fe2+ <2	DMET FLT	DOC FLT	PARAMETER	ADJUSTED TO	LOT NUMBER	AMOUNT ADDED	DATE/BY
09-20948 **PN53A**	G-RS3SSW-090609						TOT															

Checked By AV Date 9/10/09

Analytical Resources, Incorporated
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Golder Associates
COC No(s): _____ (NA)
Assigned ARI Job No: PN54

Project Name: Avery landing
Delivered by: Fed-Ex UPS Courier Hand Delivered Other: _____
Tracking No: 8396822814 75 NA

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of to cooler?	(YES)	NO
Were custody papers included with the cooler?	(YES)	NO
Were custody papers properly filled out (ink, signed, etc.)	(YES)	NO

Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry)..... 4.0

If cooler temperature is out of compliance fill out form 00070F — Temp Gun ID#: 101886

Cooler Accepted by: MM Date: 9/10/09 Time: 950

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler?		YES	(NO)
What kind of packing material was used? ...	(Bubble Wrap) (Wet Ice) Gel Packs (Baggies) Foam Block Paper Other: _____		
Was sufficient ice used (if appropriate)?	NA	(YES)	NO
Were all bottles sealed in individual plastic bags?		(YES)	NO
Did all bottles arrive in good condition (unbroken)?		(YES)	NO
Were all bottle labels complete and legible?		(YES)	NO
Did the number of containers listed on COC match with the number of containers received?		(YES)	NO
Did all bottle labels and tags agree with custody papers?		(YES)	NO
Were all bottles used correct for the requested analyses?		(YES)	NO
Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs)...	NA	(YES)	NO
Were all VOC vials free of air bubbles?	(NA)	YES	NO
Was sufficient amount of sample sent in each bottle?		(YES)	NO

Samples Logged by: AV Date: 9/10/09 Time: 1147

*** Notify Project Manager of discrepancies or concerns ***

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: Date:

Small Air Bubbles ~2 mm	Peabubbles 2-4 mm	LARGE Air Bubbles > 4 mm
		

Small → "sm"
Peabubbles → "pb"
Large → "lg"
Headspace → "hs"

PRESERVATION VERIFICATION 09/10/09
Page 1 of 1

ANALYTICAL RESOURCES INCORPORATED

ARI Job No: **PN54**

Inquiry Number: NONE
Analysis Requested: 09/10/09
Contact: Morell, Douglas
Client: Golder Associates
Logged by: AV
Sample Set Used: Yes 481
Validatable Package: Lv4
Deliverables:

Yes
C/P Package

PC: Kelly
VTSR: 09/10/09

Project #: 073-93312-03
Project: Avery Landing
Sample Site:
SDG No:
Analytical Protocol: In-house

LOGNUM ARI ID	CLIENT ID	CN >12	WAD >12	NH3 <2	COD <2	FOG <2	MET <2	PHEN <2	PHOS <2	TKN <2	NO23 <2	TOC <2	S2 >9	AK102 <2	Fe2+ <2	DMET FLT	DOC FLT	PARAMETER	ADJUSTED TO	LOT NUMBER	AMOUNT ADDED	DATE/BY
09-20950 **PN54A**	G-RS3SSW-090609						TOT OK															

PN54 : SDG 2

Checked By AV Date 9/10/09

Case Narrative

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN10, PN14, PN53, PN54

prepared
by

Analytical Resources, Inc.

Case Narrative

Client: Golder
Project: Avery Landing, 073-93312
ARI Job No.: PN10, PN14, PN53, & PN54
Date: September 22, 2009

Sample Receipt:

Analytical Resources Inc, (ARI) accepted one water sample on September 4, 2009 under ARI jobs PN10 and PN14. The sample was received with a cooler temperature of 3.4°C. For further details regarding sample receipt, please refer to the Cooler Receipt Form.

Analytical Resources Inc, (ARI) accepted one water sample on September 10, 2009 under ARI jobs PN53 and PN54. The sample was received with a cooler temperature of 4.0°C. For further details regarding sample receipt, please refer to the Cooler Receipt Form.

The samples were analyzed for SIM PAH, Low-Level PCBs, NWTPH-Dx, and Total Metals, as requested.

SIM PAHs by SW8270:

The samples were extracted on 9/7/09 and 9/10/09 and the extracts were analyzed on 9/9/09 and 9/15/09, within the method recommended holding times.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): The continuing calibration of Benzo(g,h,i)perylene was outside the control limits high for the 9/9/09 analysis. All detected results for this compound on the date of analysis have been flagged with a "Q" qualifier. No further corrective action was required.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blanks were free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

Low-Level PCBs by SW8082:

The samples were extracted on 9/8/09 and 9/11/09 and the extracts were analyzed on 9/11/09 and 9/14/09, within the method recommended holding times.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blanks were free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

NWTPH-Dx

The samples were extracted on 9/7/09 and 9/10/09 and the extracts were analyzed on 9/7/09 and 9/11/09, within the method recommended holding times.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Method Blank (s): The method blanks were free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: Please note that both samples were received in one liter amber glass bottles and only five-hundred milliliters is required for extraction. As noted by the extraction analyst, five-hundred milliliters was measured out for both samples and the method recommended bottle rinse was not performed for either sample.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

Total Metals Analysis By SW6010 and 200.8:

The samples were digested between 9/4/09 and 9/11/09 and analyzed between 9/10/09 and 9/18/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Method Blank (s): The method blanks were free of contamination

Samples: There were no anomalies associated with the analyses.

LCS (s): All LCS percent recoveries were within control limits.

Matrix Spike/ Sample Duplicate/ RPDs(s): All matrix spike percent recoveries and duplicate RPDs were within control limits.

Low-Level Mercury by SW7470A:

The samples were digested between 9/4/09 and 9/11/09 and analyzed between 9/8/09 and 9/11/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Method Blank (s): The method blanks were free of contamination

Samples: There were no anomalies associated with the analyses.

LCS (s): All LCS percent recoveries were within control limits.

Matrix Spike/ Sample Duplicate/ RPDs(s): The matrix spike percent recovery and duplicate RPD was within control limits.

Data Reporting Qualifiers

Effective 7/10/2009

Inorganic Data

U Indicates that the target analyte was not detected at the reported concentration

* Duplicate RPD is not within established control limits

B Reported value is less than the CRDL but ≥ the Reporting Limit

N Matrix Spike recovery not within established control limits

NA Not Applicable, analyte not spiked

H The natural concentration of the spiked element is so much greater than the concentration spiked that an accurate determination of spike recovery is not possible

L Analyte concentration is ≤5 times the Reporting Limit and the replicate control limit defaults to ±1 RL instead of the normal 20% RPD

Organic Data

U Indicates that the target analyte was not detected at the reported concentration

* Flagged value is not within established control limits

B Analyte detected in an associated Method Blank at a concentration greater than one-half of ARI's Reporting Limit or 5% of the regulatory limit or 5% of the analyte concentration in the sample.

J Estimated concentration when the value is less than ARI's established reporting limits

D The spiked compound was not detected due to sample extract dilution

E Estimated concentration calculated for an analyte response above the valid instrument calibration range. A dilution is required to obtain an accurate quantification of the analyte.

Q Indicates a detected analyte with an initial or continuing calibration that does not meet established acceptance criteria (<20%RSD, <20%Drift or minimum RRF).

S Indicates an analyte response that has saturated the detector. The calculated concentration is not valid; a dilution is required to obtain valid quantification of the analyte

NA The flagged analyte was not analyzed for

NR Spiked compound recovery is not reported due to chromatographic interference

NS The flagged analyte was not spiked into the sample

M Estimated value for an analyte detected and confirmed by an analyst but with low spectral match parameters. *This flag is used only for GC-MS analyses*

M2 The sample contains PCB congeners that do not match any standard Aroclor pattern. The PCBs are identified and quantified as the Aroclor whose pattern most closely matches that of the sample. The reported value is an estimate.

N The analysis indicates the presence of an analyte for which there is presumptive evidence to make a "tentative identification"

Y The analyte is not detected at or above the reported concentration. The reporting limit is raised due to chromatographic interference. The Y flag is equivalent to the U flag with a raised reporting limit.

C The analyte was positively identified on only one of two chromatographic columns. Chromatographic interference prevented a positive identification on the second column

P The analyte was detected on both chromatographic columns but the quantified values differ by ≥40% RPD with no obvious chromatographic interference

Geotechnical Data

A The total of all fines fractions. This flag is used to report total fines when only sieve analysis is requested and balances total grain size with sample weight.

F Samples were frozen prior to particle size determination

SM Sample matrix was not appropriate for the requested analysis. This normally refers to samples contaminated with an organic product that interferes with the sieving process and/or moisture content, porosity and saturation calculations

SS Sample did not contain the proportion of "fines" required to perform the pipette portion of the grain size analysis

W Weight of sample in some pipette aliquots was below the level required for accurate weighting

LCS SOLUTIONS

06/16/2009

LABEL	SOLN ID	TEST	CONC. UG/ML	SOLVENT	EXP.
1	1612-4	PCB	20	ACETONE	06/08/10
2#	1472-3	BCOC PEST	10	ACETONE	NA
3	1579-3	PEST	02/04/20	ACETONE	09/23/09
4	1594-2	LOW PEST	0.2/0.4/2	ACETONE	09/23/09
5	1580-2	EPH	1500	MECL2	01/29/10
6	1559-2	PCP	12.5/125	ACETONE	11/05/09
7	1613-4	ABN	100	ACETONE	02/01/10
8	1566-1	TBT	2.5	MECL2	12/04/09
9	1567-3	PORE TBT	.125/.25	MECL2	12/04/09
10	1596-2	ABN ACID	100/200	MEOH	10/21/09
11	1591-1	TPHD	15000	ACETONE	03/26/10
12	1597-3	ABN BASE	200	ACETONE	02/05/10
13	1613-1	LOW PCB	2	ACETONE	06/08/10
14*	1547-1	LOW ABN ACID	10/20	MEOH	04/10/10
15	1591-3	SIM PNA	15/75	MEOH	08/28/09
16	1602-3	DIOXANE	100	MEOH	03/20/10
17#	1516-2	1248 PCB	20	ACETONE	NA
18	1591-4	LOW SIM PNA	1.5	ACETONE	08/28/09
19	1574-4	AK103	7500	MECL2	12/02/09
20	1572-2	PNA	100	ACETONE	12/26/09
21	1593-3	SKY/BHT	100	MEOH	03/31/10
22	1603-1	HERB	12.5/12500	MEOH	08/18/09
23*	1505-1	LW ABN BASE	20	MEOH	03/20/10
24	1613-2	LOW ABN	10	ACETONE	02/28/10
25#	1481-1	DIPHENYL	100	MEOH	NA
26*	1545-2	OP-PEST	25	MEOH	02/16/10
27#	1495-1	STEROLS	200	MEOH	NA
28	1595-1	ADD. PEST	4	ACETONE	09/15/09
29#	1496-3	DECANES	100	MEOH	NA
30	1604-2	EDB/DBCP	0.1	HEXANE	05/20/10
31	1596-1	TERPINEOL	100	MEOH	04/03/10

PN10:00019

LCS SOLUTIONS

06/16/2009

32	1598-1	GUAIACOL	50-200	ACETONE	04/30/10
33		NOT IN USE			
34	1530-2	CONGENERS	1	ACETONE	07/23/09
35	1601-2	ALKYL PNA A	10	MEOH	04/03/10
36	1601-3	ALKYL PNA B	10	MEOH	05/13/10
50	1571-1	FULL RESIN	250	ACETONE	06/10/09
51	1611-3	DDTS	2.5	ACETONE	06/04/10
52#	1613-5	1232 PCB	20	ACETONE	06/16/10
	*=REVERIFIED SOLUTION				
	#=PROJECT SPECIFIC SOLUTION				

PN10:00020

SURR SOLUTIONS

06/16/2009

LABEL	SOLN ID	TEST	CONC. UG/ML	SOLVENT	EXP.
A	1584-5	ABN	100/150	MEOH	02/18/10
B	1572-1	SIM PNA	15/75	MEOH	08/28/09
C*	1559-1	SIM ABN	25/37.5	MEOH	03/13/10
D	1612-3	LOW PCB	0.2	ACETONE	05/29/10
E*	1478-1	HERB	62.5	MEOH	09/21/09
F	1574-3	PCP	12.5	ACETONE	01/06/10
G	1602-2	1,4DIOXANE	100	MEOH	03/20/10
H	1594-1	OP-PEST	25	MEOH	04/01/10
I	1559-4	LOW S. PNA	1.5	MEOH	08/28/09
J	1566-5	TBT-PORE	0.125	MECL2	12/04/09
K	1612-1	MED PCB	20	ACETONE	05/29/10
L	1584-4	TBT	2.5	MECL2	12/04/09
M	1578-1	EPH	1500	MECL2	12/09/09
N	1612-2	PCB	2	ACETONE	05/29/10
O	1606-2	TPH	450	MECL2	01/07/10
P	1598-2	HCID	2250	MECL2	01/07/10
Q	1604-5	EDB	2	HEXANE	05/22/10
R	1521-4	RESIN ACID	250	ACETONE	06/11/09
S	1568-5	PBDE	.25	MEOH	12/11/09
T	1601-1	ALKYL PNA	10	MEOH	11/26/09
U	*=REVERIFIED SOLUTION				
V					
W					
X					
Y					
Z					

PN10:00021

Data Summary Package

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN10, PN14, PN53, PN54

prepared
by

Analytical Resources, Inc.

SIM SEMIVOLATILE ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: G-GA3S-090309**
Page 1 of 1 **SAMPLE**

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/10/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
Event: 073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

Date Extracted: 09/07/09
Date Analyzed: 09/09/09 21:02
Instrument/Analyst: NT2/PK

Sample Amount: 500 mL
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00

CAS Number	Analyte	RL	Result
91-20-3	**Naphthalene**	**0.010**	**0.045**
91-57-6	**2-Methylnaphthalene**	**0.010**	**0.015**
90-12-0	**1-Methylnaphthalene**	**0.010**	**0.018**
208-96-8	Acenaphthylene	0.010	< 0.010 U
83-32-9	**Acenaphthene**	**0.010**	**0.016**
86-73-7	Fluorene	0.010	< 0.010 U
85-01-8	Phenanthrene	0.010	< 0.010 U
120-12-7	Anthracene	0.010	< 0.010 U
206-44-0	Fluoranthene	0.010	< 0.010 U
129-00-0	Pyrene	0.010	< 0.010 U
56-55-3	Benzo(a)anthracene	0.010	< 0.010 U
218-01-9	Chrysene	0.010	< 0.010 U
205-99-2	Benzo(b)fluoranthene	0.010	< 0.010 U
207-08-9	Benzo(k)fluoranthene	0.010	< 0.010 U
50-32-8	Benzo(a)pyrene	0.010	< 0.010 U
193-39-5	Indeno(1,2,3-cd)pyrene	0.010	< 0.010 U
53-70-3	Dibenz(a,h)anthracene	0.010	< 0.010 U
191-24-2	Benzo(g,h,i)perylene	0.010	< 0.010 U
132-64-9	Dibenzofuran	0.010	< 0.010 U

Reported in µg/L (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	61.3%
d14-Dibenzo(a,h)anthracene	82.0%

ANALYTICAL RESOURCES INCORPORATED

SIM SW8270 SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312

Client ID	MNP	DBA	TOT OUT
MB-090709	70.7%	77.3%	0
LCS-090709	67.7%	86.3%	0
LCSD-090709	55.7%	81.3%	0
G-GA3S-090309	61.3%	82.0%	0

	LCS/MB LIMITS	QC LIMITS
(MNP) = d10-2-Methylnaphthalene	(42-100)	(31-109)
(DBA) = d14-Dibenzo(a,h)anthracene	(40-125)	(10-133)

Prep Method: SW3510C
Log Number Range: 09-20720 to 09-20720

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: LCS-090709**
Page 1 of 1 **LAB CONTROL SAMPLE**

Lab Sample ID: LCS-090709
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/10/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
Event: 073-93312
Date Sampled: NA
Date Received: NA

Date Extracted LCS/LCSD: 09/07/09

Date Analyzed LCS: 09/09/09 15:46
LCSD: 09/09/09 16:11
Instrument/Analyst LCS: NT2/PK
LCSD: NT2/PK

Sample Amount LCS: 500 mL
LCSD: 500 mL
Final Extract Volume LCS: 0.50 mL
LCSD: 0.50 mL
Dilution Factor LCS: 1.00
LCSD: 1.00

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Naphthalene	0.210	0.300	70.0%	0.150	0.300	50.0%	33.3%
2-Methylnaphthalene	0.205	0.300	68.3%	0.154	0.300	51.3%	28.4%
1-Methylnaphthalene	0.196	0.300	65.3%	0.162	0.300	54.0%	19.0%
Acenaphthylene	0.196	0.300	65.3%	0.165	0.300	55.0%	17.2%
Acenaphthene	0.210	0.300	70.0%	0.176	0.300	58.7%	17.6%
Fluorene	0.223	0.300	74.3%	0.198	0.300	66.0%	11.9%
Phenanthrene	0.204	0.300	68.0%	0.197	0.300	65.7%	3.5%
Anthracene	0.202	0.300	67.3%	0.191	0.300	63.7%	5.6%
Fluoranthene	0.223	0.300	74.3%	0.220	0.300	73.3%	1.4%
Pyrene	0.222	0.300	74.0%	0.221	0.300	73.7%	0.5%
Benzo(a)anthracene	0.248	0.300	82.7%	0.235	0.300	78.3%	5.4%
Chrysene	0.244	0.300	81.3%	0.228	0.300	76.0%	6.8%
Benzo(b)fluoranthene	0.255	0.300	85.0%	0.234	0.300	78.0%	8.6%
Benzo(k)fluoranthene	0.210	0.300	70.0%	0.205	0.300	68.3%	2.4%
Benzo(a)pyrene	0.216	0.300	72.0%	0.210	0.300	70.0%	2.8%
Indeno(1,2,3-cd)pyrene	0.235	0.300	78.3%	0.221	0.300	73.7%	6.1%
Dibenz(a,h)anthracene	0.251	0.300	83.7%	0.235	0.300	78.3%	6.6%
Benzo(g,h,i)perylene	0.255 Q	0.300	85.0%	0.237 Q	0.300	79.0%	7.3%
Dibenzofuran	0.203	0.300	67.7%	0.181	0.300	60.3%	11.5%

Reported in µg/L (ppb)

RPD calculated using sample concentrations per SW846.

SIM Semivolatile Surrogate Recovery

	LCS	LCSD
d10-2-Methylnaphthalene	67.7%	55.7%
d14-Dibenzo(a,h)anthracene	86.3%	81.3%

4B
SEMIVOLATILE METHOD BLANK SUMMARY

BLANK NO.

PN10MBW1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOCIATES

ARI Job No: PN10
Project: AVERY LANDING

Lab File ID: 090910
Date Extracted: 09/07/09

Instrument ID: NT2
Date Analyzed: 09/09/09

Matrix: LIQUID
Time Analyzed: 1522

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	LAB FILE ID	DATE ANALYZED
01	PN10LCSW1	PN10LCSW1	090911	09/09/09
02	PN10LCSDW1	PN10LCSDW1	090912	09/09/09
03	G-GA3S-090309	PN10A	090924	09/09/09
04				
05				
06				
07				
08				
09				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

COMMENTS:

FORM IV SV

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: MB-090709**
Page 1 of 1 **METHOD BLANK**

Lab Sample ID: MB-090709
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/10/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
Event: 073-93312
Date Sampled: NA
Date Received: NA

Date Extracted: 09/07/09
Date Analyzed: 09/09/09 15:22
Instrument/Analyst: NT2/PK

Sample Amount: 500 mL
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	0.010	< 0.010 U
91-57-6	2-Methylnaphthalene	0.010	< 0.010 U
90-12-0	1-Methylnaphthalene	0.010	< 0.010 U
208-96-8	Acenaphthylene	0.010	< 0.010 U
83-32-9	Acenaphthene	0.010	< 0.010 U
86-73-7	Fluorene	0.010	< 0.010 U
85-01-8	Phenanthrene	0.010	< 0.010 U
120-12-7	Anthracene	0.010	< 0.010 U
206-44-0	Fluoranthene	0.010	< 0.010 U
129-00-0	Pyrene	0.010	< 0.010 U
56-55-3	Benzo(a)anthracene	0.010	< 0.010 U
218-01-9	Chrysene	0.010	< 0.010 U
205-99-2	Benzo(b)fluoranthene	0.010	< 0.010 U
207-08-9	Benzo(k)fluoranthene	0.010	< 0.010 U
50-32-8	Benzo(a)pyrene	0.010	< 0.010 U
193-39-5	Indeno(1,2,3-cd)pyrene	0.010	< 0.010 U
53-70-3	Dibenz(a,h)anthracene	0.010	< 0.010 U
191-24-2	Benzo(g,h,i)perylene	0.010	< 0.010 U
132-64-9	Dibenzofuran	0.010	< 0.010 U

Reported in µg/L (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	70.7%
d14-Dibenzo(a,h)anthracene	77.3%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: G-RS3SSW-090609**
Page 1 of 1 **SAMPLE**

Lab Sample ID: PN53A
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

Date Extracted: 09/10/09
Date Analyzed: 09/15/09 16:19
Instrument/Analyst: NT2/PK

Sample Amount: 500 mL
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	0.010	< 0.010 U
91-57-6	2-Methylnaphthalene	0.010	< 0.010 U
90-12-0	1-Methylnaphthalene	0.010	< 0.010 U
208-96-8	Acenaphthylene	0.010	< 0.010 U
83-32-9	Acenaphthene	0.010	< 0.010 U
86-73-7	Fluorene	0.010	< 0.010 U
85-01-8	Phenanthrene	0.010	< 0.010 U
120-12-7	Anthracene	0.010	< 0.010 U
206-44-0	Fluoranthene	0.010	< 0.010 U
129-00-0	Pyrene	0.010	< 0.010 U
56-55-3	Benzo(a)anthracene	0.010	< 0.010 U
218-01-9	Chrysene	0.010	< 0.010 U
205-99-2	Benzo(b)fluoranthene	0.010	< 0.010 U
207-08-9	Benzo(k)fluoranthene	0.010	< 0.010 U
50-32-8	Benzo(a)pyrene	0.010	< 0.010 U
193-39-5	Indeno(1,2,3-cd)pyrene	0.010	< 0.010 U
53-70-3	Dibenz(a,h)anthracene	0.010	< 0.010 U
191-24-2	Benzo(g,h,i)perylene	0.010	< 0.010 U
132-64-9	Dibenzofuran	0.010	< 0.010 U

Reported in µg/L (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	64.3%
d14-Dibenzo(a,h)anthracene	61.7%

ANALYTICAL RESOURCES INCORPORATED

SIM SW8270 SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	MNP	DBA	TOT OUT
MB-091009	63.3%	67.0%	0
LCS-091009	63.3%	70.7%	0
LCSD-091009	64.3%	64.0%	0
G-RS3SSW-090609	64.3%	61.7%	0

	LCS/MB LIMITS	QC LIMITS
(MNP) = d10-2-Methylnaphthalene	(42-100)	(31-109)
(DBA) = d14-Dibenzo(a,h)anthracene	(40-125)	(10-133)

Prep Method: SW3510C
Log Number Range: 09-20948 to 09-20948

FORM-II SIM SW8270

PN10:00030

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: LCS-091009**
Page 1 of 1 **LAB CONTROL SAMPLE**

Lab Sample ID: LCS-091009
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted LCS/LCSD: 09/10/09

Date Analyzed LCS: 09/15/09 15:31
LCSD: 09/15/09 15:55
Instrument/Analyst LCS: NT2/PK
LCSD: NT2/PK

Sample Amount LCS: 500 mL
LCSD: 500 mL
Final Extract Volume LCS: 0.50 mL
LCSD: 0.50 mL
Dilution Factor LCS: 1.00
LCSD: 1.00

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Naphthalene	0.202	0.300	67.3%	0.209	0.300	69.7%	3.4%
2-Methylnaphthalene	0.200	0.300	66.7%	0.196	0.300	65.3%	2.0%
1-Methylnaphthalene	0.192	0.300	64.0%	0.197	0.300	65.7%	2.6%
Acenaphthylene	0.189	0.300	63.0%	0.191	0.300	63.7%	1.1%
Acenaphthene	0.190	0.300	63.3%	0.195	0.300	65.0%	2.6%
Fluorene	0.198	0.300	66.0%	0.204	0.300	68.0%	3.0%
Phenanthrene	0.200	0.300	66.7%	0.223	0.300	74.3%	10.9%
Anthracene	0.204	0.300	68.0%	0.208	0.300	69.3%	1.9%
Fluoranthene	0.213	0.300	71.0%	0.212	0.300	70.7%	0.5%
Pyrene	0.216	0.300	72.0%	0.220	0.300	73.3%	1.8%
Benzo(a)anthracene	0.222	0.300	74.0%	0.221	0.300	73.7%	0.5%
Chrysene	0.213	0.300	71.0%	0.213	0.300	71.0%	0.0%
Benzo(b)fluoranthene	0.240	0.300	80.0%	0.229	0.300	76.3%	4.7%
Benzo(k)fluoranthene	0.195	0.300	65.0%	0.188	0.300	62.7%	3.7%
Benzo(a)pyrene	0.207	0.300	69.0%	0.197	0.300	65.7%	5.0%
Indeno(1,2,3-cd)pyrene	0.198	0.300	66.0%	0.174	0.300	58.0%	12.9%
Dibenz(a,h)anthracene	0.202	0.300	67.3%	0.185	0.300	61.7%	8.8%
Benzo(g,h,i)perylene	0.197	0.300	65.7%	0.167	0.300	55.7%	16.5%
Dibenzofuran	0.197	0.300	65.7%	0.204	0.300	68.0%	3.5%

Reported in µg/L (ppb)

RPD calculated using sample concentrations per SW846.

SIM Semivolatile Surrogate Recovery

	LCS	LCSD
d10-2-Methylnaphthalene	63.3%	64.3%
d14-Dibenzo(a,h)anthracene	70.7%	64.0%

4B
SEMIVOLATILE METHOD BLANK SUMMARY

BLANK NO.

PN53MBW1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOCIATES

ARI Job No: PN53
Project: AVERY LANDING

Lab File ID: 091501
Date Extracted: 09/10/09

Instrument ID: NT2
Date Analyzed: 09/15/09

Matrix: LIQUID
Time Analyzed: 1506

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	LAB FILE ID	DATE ANALYZED
01	PN53LCSW1	PN53LCSW1	091502	09/15/09
02	PN53LCSDW1	PN53LCSDW1	091503	09/15/09
03	G-RS3SSW-090609	PN53A	091504	09/15/09
04				
05				
06				
07				
08				
09				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

COMMENTS:

FORM IV SV

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: MB-091009**
Page 1 of 1 **METHOD BLANK**

Lab Sample ID: MB-091009
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/10/09
Date Analyzed: 09/15/09 15:06
Instrument/Analyst: NT2/PK

Sample Amount: 500 mL
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	0.010	< 0.010 U
91-57-6	2-Methylnaphthalene	0.010	< 0.010 U
90-12-0	1-Methylnaphthalene	0.010	< 0.010 U
208-96-8	Acenaphthylene	0.010	< 0.010 U
83-32-9	Acenaphthene	0.010	< 0.010 U
86-73-7	Fluorene	0.010	< 0.010 U
85-01-8	Phenanthrene	0.010	< 0.010 U
120-12-7	Anthracene	0.010	< 0.010 U
206-44-0	Fluoranthene	0.010	< 0.010 U
129-00-0	Pyrene	0.010	< 0.010 U
56-55-3	Benzo(a)anthracene	0.010	< 0.010 U
218-01-9	Chrysene	0.010	< 0.010 U
205-99-2	Benzo(b)fluoranthene	0.010	< 0.010 U
207-08-9	Benzo(k)fluoranthene	0.010	< 0.010 U
50-32-8	Benzo(a)pyrene	0.010	< 0.010 U
193-39-5	Indeno(1,2,3-cd)pyrene	0.010	< 0.010 U
53-70-3	Dibenz(a,h)anthracene	0.010	< 0.010 U
191-24-2	Benzo(g,h,i)perylene	0.010	< 0.010 U
132-64-9	Dibenzofuran	0.010	< 0.010 U

Reported in µg/L (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	63.3%
d14-Dibenzo(a,h)anthracene	67.0%

PCB ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-GA3S-090309
SAMPLE

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

Date Extracted: 09/08/09
Date Analyzed: 09/11/09 21:12
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount: 1000 mL
Final Extract Volume: 0.50 mL
Dilution Factor: 1.00
Silica Gel: No
Acid Cleanup: Yes

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	0.010	< 0.010 U
53469-21-9	Aroclor 1242	0.010	< 0.010 U
12672-29-6	Aroclor 1248	0.010	< 0.010 U
11097-69-1	Aroclor 1254	0.010	< 0.010 U
11096-82-5	Aroclor 1260	0.010	< 0.010 U
11104-28-2	Aroclor 1221	0.010	< 0.010 U
11141-16-5	Aroclor 1232	0.010	< 0.010 U
37324-23-5	Aroclor 1262	0.010	< 0.010 U
11100-14-4	Aroclor 1268	0.010	< 0.010 U

Reported in µg/L (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	59.8%
Tetrachlorometaxylene	51.8%

ANALYTICAL RESOURCES INCORPORATED

SW8082/PCB WATER SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312

Client ID	DCBP % REC	DCBP LCL-UCL	TCMX % REC	TCMX LCL-UCL	TOT OUT
MB-090809	67.2%	32-108	40.2%	31-100	0
LCS-090809	73.2%	32-108	47.5%	31-100	0
LCSD-090809	74.0%	32-108	41.5%	31-100	0
G-GA3S-090309	59.8%	19-111	51.8%	21-100	0

Prep Method: SW3510C
Log Number Range: 09-20720 to 09-20720

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: LCS-090809
LCS/LCSD

Lab Sample ID: LCS-090809
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: NA
Date Received: NA

Date Extracted LCS/LCSD: 09/08/09

Date Analyzed LCS: 09/11/09 14:20
LCSD: 09/11/09 14:42
Instrument/Analyst LCS: ECD5/JGR
LCSD: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount LCS: 1000 mL
LCSD: 1000 mL
Final Extract Volume LCS: 0.50 mL
LCSD: 0.50 mL
Dilution Factor LCS: 1.00
LCSD: 1.00
Silica Gel: No
Acid Cleanup: Yes

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Aroclor 1016	0.036	0.050	72.0%	0.034	0.050	68.0%	5.7%
Aroclor 1260	0.045	0.050	90.0%	0.040	0.050	80.0%	11.8%

PCB Surrogate Recovery

	LCS	LCSD
Decachlorobiphenyl	73.2%	74.0%
Tetrachlorometaxylene	47.5%	41.5%

Results reported in µg/L
RPD calculated using sample concentrations per SW846.

PCB METHOD BLANK SUMMARY

BLANK NO.

PN04MBW1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOC

ARI Job No.: PN10
Project: AVERY LANDING

Lab Sample ID: PN04MBW1
Lab File ID: 0911B016

Date Extracted: 09/08/09
Matrix: LIQUID

Date Analyzed: 09/11/09
Instrument ID: ECD5

Time Analyzed: 1357
GC Columns: ZB5/ZB35

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN04LCSW1	PN04LCSW1	09/11/09
02	PN04LCSDW1	PN04LCSDW1	09/11/09
03	G-GA3S-090309	PN10A	09/11/09

ALL RUNS ARE DUAL COLUMN

FORM IV PCB

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: MB-090809
METHOD BLANK

Lab Sample ID: MB-090809
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: NA
Date Received: NA

Date Extracted: 09/08/09
Date Analyzed: 09/11/09 13:57
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount: 1000 mL
Final Extract Volume: 0.50 mL
Dilution Factor: 1.00
Silica Gel: No
Acid Cleanup: Yes

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	0.010	< 0.010 U
53469-21-9	Aroclor 1242	0.010	< 0.010 U
12672-29-6	Aroclor 1248	0.010	< 0.010 U
11097-69-1	Aroclor 1254	0.010	< 0.010 U
11096-82-5	Aroclor 1260	0.010	< 0.010 U
11104-28-2	Aroclor 1221	0.010	< 0.010 U
11141-16-5	Aroclor 1232	0.010	< 0.010 U
37324-23-5	Aroclor 1262	0.010	< 0.010 U
11100-14-4	Aroclor 1268	0.010	< 0.010 U

Reported in µg/L (ppb)

PCB Surrogate Recovery	
Decachlorobiphenyl	67.2%
Tetrachlorometaxylene	40.2%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-RS3SSW-090609
SAMPLE

Lab Sample ID: PN53A
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

Date Extracted: 09/11/09
Date Analyzed: 09/14/09 17:13
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount: 1000 mL
Final Extract Volume: 0.50 mL
Dilution Factor: 1.00
Silica Gel: No
Acid Cleanup: Yes

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	0.010	< 0.010 U
53469-21-9	Aroclor 1242	0.010	< 0.010 U
12672-29-6	Aroclor 1248	0.010	< 0.010 U
11097-69-1	Aroclor 1254	0.010	< 0.010 U
11096-82-5	Aroclor 1260	0.010	< 0.010 U
11104-28-2	Aroclor 1221	0.010	< 0.010 U
11141-16-5	Aroclor 1232	0.010	< 0.010 U
37324-23-5	Aroclor 1262	0.010	< 0.010 U
11100-14-4	Aroclor 1268	0.010	< 0.010 U

Reported in µg/L (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	74.5%
Tetrachlorometaxylene	60.2%

FORM I

ANALYTICAL RESOURCES INCORPORATED

SW8082/PCB WATER SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	DCBP % REC	DCBP LCL-UCL	TCMX % REC	TCMX LCL-UCL	TOT OUT
MB-091109	81.2%	32-108	65.0%	31-100	0
LCS-091109	77.8%	32-108	57.0%	31-100	0
LCSD-091109	76.2%	32-108	54.0%	31-100	0
G-RS3SSW-090609	74.5%	19-111	60.2%	21-100	0

Prep Method: SW3510C
Log Number Range: 09-20948 to 09-20948

FORM-II SW8082

PN10:00041

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: LCS-091109
LCS/LCSD

Lab Sample ID: LCS-091109
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted LCS/LCSD: 09/11/09

Date Analyzed LCS: 09/14/09 14:33
LCSD: 09/14/09 14:56
Instrument/Analyst LCS: ECD5/JGR
LCSD: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount LCS: 1000 mL
LCSD: 1000 mL
Final Extract Volume LCS: 0.50 mL
LCSD: 0.50 mL
Dilution Factor LCS: 1.00
LCSD: 1.00
Silica Gel: No
Acid Cleanup: Yes

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Aroclor 1016	0.041	0.050	82.0%	0.040	0.050	80.0%	2.5%
Aroclor 1260	0.047	0.050	94.0%	0.045	0.050	90.0%	4.3%

PCB Surrogate Recovery

	LCS	LCSD
Decachlorobiphenyl	77.8%	76.2%
Tetrachlorometaxylene	57.0%	54.0%

Results reported in µg/L
RPD calculated using sample concentrations per SW846.

PCB METHOD BLANK SUMMARY

BLANK NO.

PN39MBW1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOC

ARI Job No.: PN53
Project: AVERY LANDING

Lab Sample ID: PN39MBW1
Lab File ID: 0914B010

Date Extracted: 09/11/09
Matrix: LIQUID

Date Analyzed: 09/14/09
Instrument ID: ECD5

Time Analyzed: 1410
GC Columns: ZB5/ZB35

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN39LCSW1	PN39LCSW1	09/14/09
02	PN39LCSDW1	PN39LCSDW1	09/14/09
03	G-RS3SSW-090609	PN53A	09/14/09

ALL RUNS ARE DUAL COLUMN

FORM IV PCB

PN10:00043

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: MB-091109
METHOD BLANK

Lab Sample ID: MB-091109
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/16/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/11/09
Date Analyzed: 09/14/09 14:10
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes

Sample Amount: 1000 mL
Final Extract Volume: 0.50 mL
Dilution Factor: 1.00
Silica Gel: No
Acid Cleanup: Yes

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	0.010	< 0.010 U
53469-21-9	Aroclor 1242	0.010	< 0.010 U
12672-29-6	Aroclor 1248	0.010	< 0.010 U
11097-69-1	Aroclor 1254	0.010	< 0.010 U
11096-82-5	Aroclor 1260	0.010	< 0.010 U
11104-28-2	Aroclor 1221	0.010	< 0.010 U
11141-16-5	Aroclor 1232	0.010	< 0.010 U
37324-23-5	Aroclor 1262	0.010	< 0.010 U
11100-14-4	Aroclor 1268	0.010	< 0.010 U

Reported in µg/L (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	81.2%
Tetrachlorometaxylene	65.0%

FORM I

TPHD ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
TOTAL DIESEL RANGE HYDROCARBONS
NWTPHD by GC/FID-Silica and Acid Cleaned
Page 1 of 1
Matrix: Water

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312

Data Release Authorized:
Reported: 09/09/09

ARI ID	Sample ID	Extraction Date	Analysis Date	EFV DL	Range	RL	Result
MB-090709	Method Blank	09/07/09	09/07/09	1.00	Diesel	0.25	< 0.25 U
09-20720	HC ID: ---		FID3A	1.0	Motor Oil	0.50	< 0.50 U
					o-Terphenyl		93.2%
PN10A	G-GA3S-090309	09/07/09	09/07/09	1.00	Diesel	0.25	< 0.25 U
09-20720	HC ID: ---		FID3A	1.0	Motor Oil	0.50	< 0.50 U
					o-Terphenyl		89.4%

Reported in mg/L (ppm)

EFV-Effective Final Volume in mL.
DL-Dilution of extract prior to analysis.
RL-Reporting limit.

Diesel quantitation on total peaks in the range from C12 to C24.
Motor Oil quantitation on total peaks in the range from C24 to C38.
HC ID: DRO/RRO indicate results of organics or additional hydrocarbons in ranges are not identifiable.

ANALYTICAL RESOURCES INCORPORATED

CLEANED TPHD SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312

Client ID	OTER	TOT OUT
MB-090709	93.2%	0
LCS-090709	94.5%	0
LCSD-090709	88.7%	0
G-GA3S-090309	89.4%	0

	LCS/MB LIMITS	QC LIMITS
(OTER) = o-Terphenyl	(51-120)	(41-121)

Prep Method: SW3510C
Log Number Range: 09-20720 to 09-20720

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
NWTPHD by GC/FID-Silica and Acid Cleaned **Sample ID: LCS-090709**
Page 1 of 1 **LCS/LCSD**

Lab Sample ID: LCS-090709
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/09/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

Date Extracted LCS/LCSD: 09/07/09
Date Analyzed LCS: 09/07/09 18:10
LCSD: 09/07/09 18:29
Instrument/Analyst LCS: FID/MS
LCSD: FID/MS

Sample Amount LCS: 500 mL
LCSD: 500 mL
Final Extract Volume LCS: 1.0 mL
LCSD: 1.0 mL
Dilution Factor LCS: 1.00
LCSD: 1.00

Range	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Diesel	2.51	3.00	83.7%	2.46	3.00	82.0%	2.0%

TPHD Surrogate Recovery

	LCS	LCSD
o-Terphenyl	94.5%	88.7%

Results reported in mg/L
RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

TOTAL DIESEL RANGE HYDROCARBONS-EXTRACTION REPORT

ARI Job: PN10
Matrix: Water Project: Avery Landing
Date Received: 09/04/09 073-93312

ARI ID	Client ID	Samp Amt	Final Vol	Prep Date
09-20720-090709MB1	Method Blank	500 mL	1.00 mL	09/07/09
09-20720-090709LCS1	Lab Control	500 mL	1.00 mL	09/07/09
09-20720-090709LCSD1	Lab Control Dup	500 mL	1.00 mL	09/07/09
09-20720-PN10A	G-GA3S-090309	500 mL	1.00 mL	09/07/09

TPH METHOD BLANK SUMMARY

BLANK NO.: PN04MBW1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOCIATES

SDG No.: PN10
Project No.: AVERY LANDING

Date Extracted: 09/07/09
Matrix: LIQUID

Date Analyzed : 09/07/09
Instrument ID : FID3A

Time Analyzed : 1752

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS, and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN04LCSW1	PN04LCSW1	09/07/09
02	PN04LCSDW1	PN04LCSDW1	09/07/09
03	G-GA3S-09030	PN10A	09/07/09

FORM IV TPH

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
TOTAL DIESEL RANGE HYDROCARBONS
NWTPHD by GC/FID-Silica and Acid Cleaned
Page 1 of 1
Matrix: Water

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03

Data Release Authorized: VTS
Reported: 09/17/09

ARI ID	Sample ID	Extraction Date	Analysis Date	EFV DL	Range	RL	Result
MB-091009	Method Blank	09/10/09	09/11/09	1.00	Diesel	0.25	< 0.25 U
09-20948	HC ID: ---		FID3A	1.0	Motor Oil	0.50	< 0.50 U
					o-Terphenyl		93.4%
PN53A	G-RS3SSW-090609	09/10/09	09/11/09	1.00	Diesel	0.25	< 0.25 U
09-20948	HC ID: ---		FID3A	1.0	Motor Oil	0.50	< 0.50 U
					o-Terphenyl		97.5%

Reported in mg/L (ppm)

EFV-Effective Final Volume in mL.
DL-Dilution of extract prior to analysis.
RL-Reporting limit.

Diesel quantitation on total peaks in the range from C12 to C24.
Motor Oil quantitation on total peaks in the range from C24 to C38.
HC ID: DRO/RRO indicate results of organics or additional hydrocarbons in ranges are not identifiable.

FORM I

ANALYTICAL RESOURCES INCORPORATED

CLEANED TPHD SURROGATE RECOVERY SUMMARY

Matrix: Water

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	OTER	TOT OUT
MB-091009	93.4%	0
LCS-091009	94.8%	0
LCSD-091009	90.0%	0
G-RS3SSW-090609	97.5%	0

	LCS/MB LIMITS	QC LIMITS
(OTER) = o-Terphenyl	(51-120)	(41-121)

Prep Method: SW3510C
Log Number Range: 09-20948 to 09-20948

FORM-II TPHD

PN10:00052

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
NWTPHD by GC/FID-Silica and Acid Cleaned **Sample ID: LCS-091009**
Page 1 of 1 **LCS/LCSD**

Lab Sample ID: LCS-091009
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized: VTS
Reported: 09/17/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

Date Extracted LCS/LCSD: 09/10/09

Date Analyzed LCS: 09/11/09 17:19
LCSD: 09/11/09 17:38
Instrument/Analyst LCS: FID/MS
LCSD: FID/MS

Sample Amount LCS: 500 mL
LCSD: 500 mL
Final Extract Volume LCS: 1.0 mL
LCSD: 1.0 mL
Dilution Factor LCS: 1.00
LCSD: 1.00

Range	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Diesel	2.62	3.00	87.3%	2.45	3.00	81.7%	6.7%

TPHD Surrogate Recovery

	LCS	LCSD
o-Terphenyl	94.8%	90.0%

Results reported in mg/L
RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

TOTAL DIESEL RANGE HYDROCARBONS-EXTRACTION REPORT

ARI Job: PN53
Matrix: Water Project: Avery Landing
Date Received: 09/10/09 073-93312-03

ARI ID	Client ID	Samp Amt	Final Vol	Prep Date
09-20948-091009MB1	Method Blank	500 mL	1.00 mL	09/10/09
09-20948-091009LCS1	Lab Control	500 mL	1.00 mL	09/10/09
09-20948-091009LCSD1	Lab Control Dup	500 mL	1.00 mL	09/10/09
09-20948-PN53A	G-RS3SSW-090609	500 mL	1.00 mL	09/10/09

Diesel Extraction Report

TPH METHOD BLANK SUMMARY

BLANK NO.

PN53MBW1

Lab Name: ANALYTICAL RESOURCES, INC Client: GOLDER ASSOCIATES

SDG No.: PN53 Project No.: AVERY LANDING

Date Extracted: 09/10/09 Matrix: LIQUID

Date Analyzed : 09/11/09 Instrument ID : FID3A

Time Analyzed : 1701

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS, and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN53LCSW1	PN53LCSW1	09/11/09
02	PN53LCSDW1	PN53LCSDW1	09/11/09
03	G-RS3SSW-090	PN53A	09/11/09

FORM IV TPH

METALS ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-GA3S-090309
SAMPLE

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/16/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	µg/L	Q
3010A	09/04/09	6010B	09/14/09	7429-90-5	Aluminum	50	50	U
200.8	09/07/09	200.8	09/10/09	**7440-36-0**	**Antimony**	0.2	**0.2**	
200.8	09/07/09	200.8	09/10/09	**7440-38-2**	**Arsenic**	0.2	**2.6**	
3010A	09/04/09	6010B	09/14/09	**7440-39-3**	**Barium**	3	**31**	
3010A	09/04/09	6010B	09/14/09	7440-41-7	Beryllium	1	1	U
3010A	09/04/09	6010B	09/14/09	7440-43-9	Cadmium	2	2	U
3010A	09/04/09	6010B	09/14/09	**7440-70-2**	**Calcium**	50	**20,400**	
3010A	09/04/09	6010B	09/14/09	7440-47-3	Chromium	5	5	U
3010A	09/04/09	6010B	09/14/09	7440-48-4	Cobalt	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-50-8	Copper	2	2	U
3010A	09/04/09	6010B	09/14/09	**7439-89-6**	**Iron**	50	**150**	
200.8	09/07/09	200.8	09/10/09	7439-92-1	Lead	1	1	U
3010A	09/04/09	6010B	09/14/09	**7439-95-4**	**Magnesium**	50	**3,280**	
3010A	09/04/09	6010B	09/14/09	**7439-96-5**	**Manganese**	1	**429**	
3010A	09/04/09	6010B	09/14/09	7440-02-0	Nickel	10	10	U
3010A	09/04/09	6010B	09/14/09	**7440-09-7**	**Potassium**	500	**2,360**	
3010A	09/04/09	6010B	09/14/09	7782-49-2	Selenium	50	50	U
3010A	09/04/09	6010B	09/14/09	7440-22-4	Silver	3	3	U
3010A	09/04/09	6010B	09/14/09	**7440-23-5**	**Sodium**	500	**1,620**	
200.8	09/07/09	200.8	09/10/09	7440-28-0	Thallium	0.2	0.2	U
3010A	09/04/09	6010B	09/14/09	7440-62-2	Vanadium	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-66-6	Zinc	10	10	U

U-Analyte undetected at given RL
RL-Reporting Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS

Sample ID: G-GA3S-090309
MATRIX SPIKE

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/16/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

MATRIX SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample		Spike	Spike Added	% Recovery	Q
Aluminum	6010B	50.0	U	2,060	2,000	103%	
Antimony	200.8	0.210		26.3	25.0	104%	
Arsenic	200.8	2.63		28.6	25.0	104%	
Barium	6010B	30.5		1,940	2,000	95.5%	
Beryllium	6010B	1.00	U	501	500	100%	
Cadmium	6010B	2.00	U	495	500	99.0%	
Calcium	6010B	20,400		30,000	10,000	96.0%	
Chromium	6010B	5.00	U	489	500	97.8%	
Cobalt	6010B	3.00	U	486	500	97.2%	
Copper	6010B	2.00	U	497	500	99.4%	
Iron	6010B	152		2,220	2,000	103%	
Lead	200.8	1.00	U	25.3	25.0	101%	
Magnesium	6010B	3,280		13,400	10,000	101%	
Manganese	6010B	429		926	500	99.4%	
Nickel	6010B	10.0	U	474	500	94.8%	
Potassium	6010B	2,360		12,200	10,000	98.4%	
Selenium	6010B	50.0	U	2,000	2,000	100%	
Silver	6010B	3.00	U	525	500	105%	
Sodium	6010B	1,620		11,700	10,000	101%	
Thallium	200.8	0.200	U	24.1	25.0	96.4%	
Vanadium	6010B	3.00	U	516	500	103%	
Zinc	6010B	10.0	U	478	500	95.6%	

Reported in µg/L

N-Control Limit Not Met
H-% Recovery Not Applicable, Sample Concentration Too High
NA-Not Applicable, Analyte Not Spiked
NR-Not Recovered

Percent Recovery Limits: 75-125%

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-GA3S-090309
DUPLICATE

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/16/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

MATRIX DUPLICATE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample	Duplicate	RPD	Control Limit	Q
Aluminum	6010B	50 U	50 U	0.0%	+/- 50	L
Antimony	200.8	0.2	0.2 U	0.0%	+/- 0.2	L
Arsenic	200.8	2.6	2.5	3.9%	+/- 20%	
Barium	6010B	31	30	3.3%	+/- 20%	
Beryllium	6010B	1 U	1 U	0.0%	+/- 1	L
Cadmium	6010B	2 U	2 U	0.0%	+/- 2	L
Calcium	6010B	20,400	21,000	2.9%	+/- 20%	
Chromium	6010B	5 U	5 U	0.0%	+/- 5	L
Cobalt	6010B	3 U	3 U	0.0%	+/- 3	L
Copper	6010B	2 U	2 U	0.0%	+/- 2	L
Iron	6010B	150	150	0.0%	+/- 50	L
Lead	200.8	1 U	1 U	0.0%	+/- 1	L
Magnesium	6010B	3,280	3,320	1.2%	+/- 20%	
Manganese	6010B	429	432	0.7%	+/- 20%	
Nickel	6010B	10 U	10 U	0.0%	+/- 10	L
Potassium	6010B	2,360	2,410	2.1%	+/- 500	L
Selenium	6010B	50 U	50 U	0.0%	+/- 50	L
Silver	6010B	3 U	3 U	0.0%	+/- 3	L
Sodium	6010B	1,620	1,620	0.0%	+/- 500	L
Thallium	200.8	0.2 U	0.2 U	0.0%	+/- 0.2	L
Vanadium	6010B	3 U	3 U	0.0%	+/- 3	L
Zinc	6010B	10 U	10 U	0.0%	+/- 10	L

Reported in µg/L

*-Control Limit Not Met
L-RPD Invalid, Limit = Detection Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: LAB CONTROL**

Lab Sample ID: PN10LCS
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/16/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: NA
Date Received: NA

BLANK SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Spike Found	Spike Added	% Recovery	Q
Aluminum	6010B	2060	2000	103%	
Antimony	200.8	26.1	25.0	104%	
Arsenic	200.8	25.4	25.0	102%	
Barium	6010B	1940	2000	97.0%	
Beryllium	6010B	505	500	101%	
Cadmium	6010B	496	500	99.2%	
Calcium	6010B	9970	10000	99.7%	
Chromium	6010B	495	500	99.0%	
Cobalt	6010B	492	500	98.4%	
Copper	6010B	500	500	100%	
Iron	6010B	2110	2000	106%	
Lead	200.8	25	25	100%	
Magnesium	6010B	10400	10000	104%	
Manganese	6010B	512	500	102%	
Nickel	6010B	490	500	98.0%	
Potassium	6010B	9960	10000	99.6%	
Selenium	6010B	2000	2000	100%	
Silver	6010B	532	500	106%	
Sodium	6010B	10400	10000	104%	
Thallium	200.8	23.7	25.0	94.8%	
Vanadium	6010B	513	500	103%	
Zinc	6010B	490	500	98.0%	

Reported in µg/L

N-Control limit not met
Control Limits: 80-120%

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS

Sample ID: METHOD BLANK

Lab Sample ID: PN10MB
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/16/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: NA
Date Received: NA

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	µg/L	Q
3010A	09/04/09	6010B	09/14/09	7429-90-5	Aluminum	50	50	U
200.8	09/07/09	200.8	09/10/09	7440-36-0	Antimony	0.2	0.2	U
200.8	09/07/09	200.8	09/10/09	7440-38-2	Arsenic	0.2	0.2	U
3010A	09/04/09	6010B	09/14/09	7440-39-3	Barium	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-41-7	Beryllium	1	1	U
3010A	09/04/09	6010B	09/14/09	7440-43-9	Cadmium	2	2	U
3010A	09/04/09	6010B	09/14/09	7440-70-2	Calcium	50	50	U
3010A	09/04/09	6010B	09/14/09	7440-47-3	Chromium	5	5	U
3010A	09/04/09	6010B	09/14/09	7440-48-4	Cobalt	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-50-8	Copper	2	2	U
3010A	09/04/09	6010B	09/14/09	7439-89-6	Iron	50	50	U
200.8	09/07/09	200.8	09/10/09	7439-92-1	Lead	1	1	U
3010A	09/04/09	6010B	09/14/09	7439-95-4	Magnesium	50	50	U
3010A	09/04/09	6010B	09/14/09	7439-96-5	Manganese	1	1	U
3010A	09/04/09	6010B	09/14/09	7440-02-0	Nickel	10	10	U
3010A	09/04/09	6010B	09/14/09	7440-09-7	Potassium	500	500	U
3010A	09/04/09	6010B	09/14/09	7782-49-2	Selenium	50	50	U
3010A	09/04/09	6010B	09/14/09	7440-22-4	Silver	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-23-5	Sodium	500	500	U
200.8	09/07/09	200.8	09/10/09	7440-28-0	Thallium	0.2	0.2	U
3010A	09/04/09	6010B	09/14/09	7440-62-2	Vanadium	3	3	U
3010A	09/04/09	6010B	09/14/09	7440-66-6	Zinc	10	10	U

U-Analyte undetected at given RL
RL-Reporting Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-RS3SSW-090609
SAMPLE

Lab Sample ID: PN53A
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized:
Reported: 09/21/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	µg/L	Q
3010A	09/11/09	6010B	09/18/09	7429-90-5	Aluminum	50	50	U
200.8	09/11/09	200.8	09/14/09	7440-36-0	Antimony	0.2	0.2	U
200.8	09/11/09	200.8	09/14/09	**7440-38-2**	**Arsenic**	0.2	**0.4**	
3010A	09/11/09	6010B	09/18/09	**7440-39-3**	**Barium**	3	**6**	
3010A	09/11/09	6010B	09/18/09	7440-41-7	Beryllium	1	1	U
3010A	09/11/09	6010B	09/18/09	7440-43-9	Cadmium	2	2	U
3010A	09/11/09	6010B	09/18/09	**7440-70-2**	**Calcium**	50	**11,100**	
3010A	09/11/09	6010B	09/18/09	7440-47-3	Chromium	5	5	U
3010A	09/11/09	6010B	09/18/09	7440-48-4	Cobalt	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-50-8	Copper	2	2	U
3010A	09/11/09	6010B	09/18/09	7439-89-6	Iron	50	50	U
200.8	09/11/09	200.8	09/14/09	7439-92-1	Lead	1	1	U
3010A	09/11/09	6010B	09/18/09	**7439-95-4**	**Magnesium**	50	**2,350**	
3010A	09/11/09	6010B	09/18/09	**7439-96-5**	**Manganese**	1	**2**	
3010A	09/11/09	6010B	09/18/09	7440-02-0	Nickel	10	10	U
3010A	09/11/09	6010B	09/18/09	**7440-09-7**	**Potassium**	500	**690**	
3010A	09/11/09	6010B	09/18/09	7782-49-2	Selenium	50	50	U
3010A	09/11/09	6010B	09/18/09	7440-22-4	Silver	3	3	U
3010A	09/11/09	6010B	09/18/09	**7440-23-5**	**Sodium**	500	**1,320**	
200.8	09/11/09	200.8	09/14/09	7440-28-0	Thallium	0.2	0.2	U
3010A	09/11/09	6010B	09/18/09	7440-62-2	Vanadium	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-66-6	Zinc	10	10	U

U-Analyte undetected at given RL
RL-Reporting Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-RS3SSW-090609
MATRIX SPIKE

Lab Sample ID: PN53A
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized:
Reported: 09/21/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

MATRIX SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample	Spike	Spike Added	% Recovery	Q
Aluminum	6010B	50.0 U	2,050	2,000	102%	
Antimony	200.8	0.200 U	24.9	25.0	99.6%	
Arsenic	200.8	0.360	26.6	25.0	105%	
Barium	6010B	5.91	1,980	2,000	98.7%	
Beryllium	6010B	1.00 U	510	500	102%	
Cadmium	6010B	2.00 U	512	500	102%	
Calcium	6010B	11,100	21,200	10,000	101%	
Chromium	6010B	5.00 U	491	500	98.2%	
Cobalt	6010B	3.00 U	488	500	97.6%	
Copper	6010B	2.00 U	497	500	99.4%	
Iron	6010B	50.0 U	2,090	2,000	104%	
Lead	200.8	1.00 U	24.4	25.0	97.6%	
Magnesium	6010B	2,350	12,700	10,000	104%	
Manganese	6010B	1.53	500	500	99.7%	
Nickel	6010B	10.0 U	492	500	98.4%	
Potassium	6010B	685	11,100	10,000	104%	
Selenium	6010B	50.0 U	2,070	2,000	104%	
Silver	6010B	3.00 U	473	500	94.6%	
Sodium	6010B	1,320	11,800	10,000	105%	
Thallium	200.8	0.200 U	23.3	25.0	93.2%	
Vanadium	6010B	3.00 U	512	500	102%	
Zinc	6010B	10.0 U	492	500	98.4%	

Reported in µg/L

N-Control Limit Not Met
H-% Recovery Not Applicable, Sample Concentration Too High
NA-Not Applicable, Analyte Not Spiked
NR-Not Recovered

Percent Recovery Limits: 75-125%

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-RS3SSW-090609
DUPLICATE

Lab Sample ID: PN53A
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized:
Reported: 09/21/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

MATRIX DUPLICATE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample	Duplicate	RPD	Control Limit	Q
Aluminum	6010B	50 U	50 U	0.0%	+/- 50	L
Antimony	200.8	0.2 U	0.2 U	0.0%	+/- 0.2	L
Arsenic	200.8	0.4	0.3	28.6%	+/- 0.2	L
Barium	6010B	6	7	15.4%	+/- 3	L
Beryllium	6010B	1 U	1 U	0.0%	+/- 1	L
Cadmium	6010B	2 U	2 U	0.0%	+/- 2	L
Calcium	6010B	11,100	11,500	3.5%	+/- 20%	
Chromium	6010B	5 U	5 U	0.0%	+/- 5	L
Cobalt	6010B	3 U	3 U	0.0%	+/- 3	L
Copper	6010B	2 U	2 U	0.0%	+/- 2	L
Iron	6010B	50 U	50 U	0.0%	+/- 50	L
Lead	200.8	1 U	1 U	0.0%	+/- 1	L
Magnesium	6010B	2,350	2,440	3.8%	+/- 20%	
Manganese	6010B	2	2	0.0%	+/- 1	L
Nickel	6010B	10 U	10 U	0.0%	+/- 10	L
Potassium	6010B	690	720	4.3%	+/- 500	L
Selenium	6010B	50 U	50 U	0.0%	+/- 50	L
Silver	6010B	3 U	3 U	0.0%	+/- 3	L
Sodium	6010B	1,320	1,370	3.7%	+/- 500	L
Thallium	200.8	0.2 U	0.2 U	0.0%	+/- 0.2	L
Vanadium	6010B	3 U	3 U	0.0%	+/- 3	L
Zinc	6010B	10 U	10 U	0.0%	+/- 10	L

Reported in µg/L

*-Control Limit Not Met
L-RPD Invalid, Limit = Detection Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: LAB CONTROL**

Lab Sample ID: PN53LCS
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized:
Reported: 09/21/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

BLANK SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Spike Found	Spike Added	% Recovery	Q
Aluminum	6010B	2060	2000	103%	
Antimony	200.8	24.8	25.0	99.2%	
Arsenic	200.8	25.9	25.0	104%	
Barium	6010B	1990	2000	99.5%	
Beryllium	6010B	508	500	102%	
Cadmium	6010B	508	500	102%	
Calcium	6010B	10300	10000	103%	
Chromium	6010B	494	500	98.8%	
Cobalt	6010B	487	500	97.4%	
Copper	6010B	494	500	98.8%	
Iron	6010B	2080	2000	104%	
Lead	200.8	24	25	96.0%	
Magnesium	6010B	10500	10000	105%	
Manganese	6010B	500	500	100%	
Nickel	6010B	500	500	100%	
Potassium	6010B	10300	10000	103%	
Selenium	6010B	2020	2000	101%	
Silver	6010B	462	500	92.4%	
Sodium	6010B	10700	10000	107%	
Thallium	200.8	23.3	25.0	93.2%	
Vanadium	6010B	505	500	101%	
Zinc	6010B	510	500	102%	

Reported in µg/L

N-Control limit not met
Control Limits: 80-120%

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: METHOD BLANK**

Lab Sample ID: PN53MB
LIMS ID: 09-20948
Matrix: Water
Data Release Authorized:
Reported: 09/21/09

QC Report No: PN53-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	µg/L	Q
3010A	09/11/09	6010B	09/18/09	7429-90-5	Aluminum	50	50	U
200.8	09/11/09	200.8	09/14/09	7440-36-0	Antimony	0.2	0.2	U
200.8	09/11/09	200.8	09/14/09	7440-38-2	Arsenic	0.2	0.2	U
3010A	09/11/09	6010B	09/18/09	7440-39-3	Barium	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-41-7	Beryllium	1	1	U
3010A	09/11/09	6010B	09/18/09	7440-43-9	Cadmium	2	2	U
3010A	09/11/09	6010B	09/18/09	7440-70-2	Calcium	50	50	U
3010A	09/11/09	6010B	09/18/09	7440-47-3	Chromium	5	5	U
3010A	09/11/09	6010B	09/18/09	7440-48-4	Cobalt	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-50-8	Copper	2	2	U
3010A	09/11/09	6010B	09/18/09	7439-89-6	Iron	50	50	U
200.8	09/11/09	200.8	09/14/09	7439-92-1	Lead	1	1	U
3010A	09/11/09	6010B	09/18/09	7439-95-4	Magnesium	50	50	U
3010A	09/11/09	6010B	09/18/09	7439-96-5	Manganese	1	1	U
3010A	09/11/09	6010B	09/18/09	7440-02-0	Nickel	10	10	U
3010A	09/11/09	6010B	09/18/09	7440-09-7	Potassium	500	500	U
3010A	09/11/09	6010B	09/18/09	7782-49-2	Selenium	50	50	U
3010A	09/11/09	6010B	09/18/09	7440-22-4	Silver	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-23-5	Sodium	500	500	U
200.8	09/11/09	200.8	09/14/09	7440-28-0	Thallium	0.2	0.2	U
3010A	09/11/09	6010B	09/18/09	7440-62-2	Vanadium	3	3	U
3010A	09/11/09	6010B	09/18/09	7440-66-6	Zinc	10	10	U

U-Analyte undetected at given RL
RL-Reporting Limit

MERCURY ANALYSIS

PN10:00067

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
Total Mercury by Method SW7470A

Data Release Authorized:
Reported: 09/09/09
Date Received: 09/04/09
Page 1 of 1

QC Report No: PN14-Golder Associates
Project: Avery Landing
073-93312

Client/ ARI ID	Date Sampled	Matrix	Prep Date Anal Date	RL	Result
G-GA3S-090309 PN14A 09-20749	09/03/09	Water	09/04/09 09/08/09	20.0	20.0 U
MB-090409 Method Blank	NA	Water	09/04/09 09/08/09	20.0	20.0 U

Reported in ng/L

RL-Analytical reporting limit
U-Undetected at reported detection limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: LAB CONTROL**

Lab Sample ID: PN14LCS
LIMS ID: 09-20749
Matrix: Water
Data Release Authorized:
Reported: 09/09/09

QC Report No: PN14-Golder Associates
Project: Avery Landing
073-93312
Date Sampled: NA
Date Received: NA

BLANK SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Spike Found	Spike Added	% Recovery	Q
Mercury	7470A	166	200	83.0%	

Reported in ng/L

N-Control limit not met
Control Limits: 80-120%

PN10:00069

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
Total Mercury by Method SW7470A

Data Release Authorized:
Reported: 09/15/09
Date Received: 09/10/09
Page 1 of 1

QC Report No: PN54-Golder Associates
Project: Avery Landing
073-93312-03

Client/ ARI ID	Date Sampled	Matrix	Prep Date Anal Date	RL	Result
G-RS3SSW-090609 PN54A 09-20950	09/06/09	Water	09/11/09 09/11/09	20.0	20.0 U
MB-091109 Method Blank	NA	Water	09/11/09 09/11/09	20.0	20.0 U

Reported in ng/L

RL-Analytical reporting limit
U-Undetected at reported detection limit

PN10:00070

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-RS3SSW-090609
MATRIX SPIKE

Lab Sample ID: PN54A
LIMS ID: 09-20950
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN54-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

MATRIX SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample	Spike	Spike Added	% Recovery	Q
Mercury	7470A	20.0 U	87.5	100	87.5%	

Reported in ng/L

N-Control Limit Not Met
H-% Recovery Not Applicable, Sample Concentration Too High
NA-Not Applicable, Analyte Not Spiked

Percent Recovery Limits: 75-125%

PN10:00071

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: G-RS3SSW-090609
DUPLICATE

Lab Sample ID: PN54A
LIMS ID: 09-20950
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN54-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/06/09
Date Received: 09/10/09

MATRIX DUPLICATE QUALITY CONTROL REPORT

Analyte	Analysis Method	Sample	Duplicate	RPD	Control Limit	Q
Mercury	7470A	20.0 U	20.0 U	0.0%	+/- 20.0	L

Reported in ng/L

*-Control Limit Not Met
L-RPD Invalid, Limit = Detection Limit

PN10:00072

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS
Page 1 of 1

Sample ID: LAB CONTROL

Lab Sample ID: PN54LCS
LIMS ID: 09-20950
Matrix: Water
Data Release Authorized:
Reported: 09/15/09

QC Report No: PN54-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

BLANK SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Spike Found	Spike Added	% Recovery	Q
Mercury	7470A	169	200	84.5%	

Reported in ng/L

N-Control limit not met
Control Limits: 80-120%

ORGANIC ANALYTE - Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Analytical Resources, Inc.**	SDG: **PN-10, PN-14, PN-53 & PN-54**

	SAMPLES	Collect:	MATRIX
#	G-GA-35-090309 (PN-10)	090309	Water
#	G-RS-3SSW-090609 (PN-53)	090609	Water
*	G-RS-5SSED-0-090809 (PN-53)	090809	Soil

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA 8260	BNA 8270	Pest / PCB 8082	Chlor / Herb.	TPH Diesel-x NWTPH	OTHER * Total Solids	OTHER PAH (Sim)
1. Data Completeness	O	O	O		O	O	O
2. Holding Times	O	O	O		O	–	O
~~3. Field Blanks~~ CALIBRATN	O	O	O		O	–	X ①
4. Laboratory Blanks	O	O	O		O	–	O
5. Surrogates	O	O	O		O	–	O
6. Lab Duplicate, Field Duplicate	–	–	–		–	–	–
7. LCS, Blank Spike ②	O	O	O		O	–	X ②
8. Matrix Spike /MS Duplicate	–	O	O		–	–	O
9. Result Verify, Detection Limits ③	O	O	O		O	O	O
10. Overall Summary	O	O	O		O	O	O

O = Data had no problems Θ = Problems, but do not affect data
X = Data qualified due to minor problems [typically estimated data (J or UJ)].
M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).
Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: ① Calib. data assoc. w/ G-GA-35 out of limit for Benzo(ghi) Assoc. result Qualif. (UJ).
② RPD of LCS/LCSD out of limit; Naphthalene & 2MethNaph. qualif. (J) for Sample G-GA-35*. QUALIF. REPORT PAGE ATTACHED.

③ VOA cmpnds 123 Trichloropropane, 12Dibromo3ChloroPropan, EthyldiBrom do not meet needs of Regulatory Screen criteria – NO QUALIF.

③ SVOA cmpnds Dibenz(a,h)... & B(a)P do not meet needs of Regulat. Screen Criteria – NO QUALIF Applied.

Validated by: [signature] **Date:** Nov. 6, 2009
Reviewed by: **Date:**

ORGANIC ANALYTE - Tier I & II Data Validation Summary Checklist

Acceptable:

1. Date Package Completeness (Check if present)..... YES ☑ NO ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ Detection Limits
- ✓ GC/MS Tuning
- ✓ Initial Calibration
- ✓ Continuing Calib.
- —
- ✓ Blank Results
- ✓ Surrogate Results
- ✓ Internal Standards
- ✓ MS/MSD, LCS Results
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ Raw Data
- __Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: CALIB. WATERS: CCAL for Benzo(ghi)P8D↑. G-GA-35 (X) result qualif. (J).

SOIL: Calib limits RRF ~~Exceed~~ for V.Chloride & Bromoform below (25%) D.V. %Diff. max- NO QUALIF. Applied for VOA ; SVOA, SVOC-Sim ✓ PCB ✓, TPH ✓.

2. Holding Times (Check all that apply)..... ☑ ☐

- __Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
- ✓ BNA samples extracted within 7 days (14 day soil) of collection
- __BNA extracts analyzed within 40 days of collection
- ✓ Pest/PCBs samples extracted within 7 days (14 day soil) of collection
- __Pest/PCBs extracts analyzed within 40 days of collection

✓ TPH Diesel ext<7days + G-RS5-SSED (Soil)

Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: * Sample G-GA-35, # Sample G-RS-355W:

	Collect	Prep	Analysis	DAYS
	*9/03 #9/06	*9/07 #9/10	*9/09 #9/15	
BNA(8270)				4, 4 ✓(<7)
PCB (8082)		9/08 9/11	9/11 9/14	5, 8 ✓(<7)
NWTPH-Dx		9/07 9/10	9/07 9/11	4, 1 ✓(<7)
+ VOC (8260)	9/08	9/16	9/16	8 Days ✓(<14)
+ SVOC (8270)		9/14	9/15	6, 7 ✓(<7)
+ SVOA-Sim		9/14	9/17	6, 9 ✓(<7)
+ TPH-Dx		9/14	9/15	6, 7 ✓

3. Field Blanks, Storage Blanks (VOA only) (Check all that apply)..... ☐ ☐

__Storage Blanks; prepared upon receipt of sample set, FIELD BLANK ID:
__ Storage Blanks; Target Cmpnds <RL,
MeCl2 & cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs)
__All blanks; Non-Target Cmpnds must be < 2.0 ug/L
__ Field Blanks; Qualification is advisory, but should be called out in Report Text.

Examples:

Comments/Qualified Results: Field Blanks not available for this SDG.

Acceptable: **Yes** ☑ **NO** ☐

4. Laboratory Blanks (Check all that apply)..... ☑ ☐

✓ Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
✓ Method Blanks; Target Cmpnds <RL, MeCl2 & cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart other Contaminants: Qualif. Results <5X RLs according to Chart below
__ Instrument blanks after all high level samples, All cmpnds must be <RL
✓ All blanks; Non-Target Cmpnds must be < 2.0 ug/L

Examples:

	BLANK			SAMPLE	Q
	MDL	Result	PQL	Result	Applied
	0.3	0.45	1.0	0.8	1.0 U
	0.3	0.99	1.0	1.8	1.8 J
	0.3	1.5	1.0	1.1	1.5 U
	0.3	1.5	1.0	1.8	1.8 J
	0.3	0	1.0	0.85	0.85 J
	0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

BNA : MB-090709 ✓
VOC : MB-091009 ✓
* VOA : MB091609 ✓ Assoc G-RS55SED
SVOA : MB091409 ✓ " " .
SVOA-SIM " ✓ OK.
PCB : MB091409 ✓
TPH-Dx : " ✓

PAH-SIM 090709 ✓
PCB-090809 ✓, 091109 ✓.
TPH-090709 ✓, 091009 ✓.

5. Surrogates (Check all that apply)..... ☑ ☐

✓ Surrogates analyzed
✓ Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__ Recoveries above Method Control limits (J detects only) TPH 50-150%
__ Recoveries below Method Control limits but>20% (J/UJ)
__ Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results

* G-GA-35 : BNA ✓, PCB ✓, TPH-Dx 89% ✓
# G-RS-35SW : BNA ✓, PCB ✓, TPH-Dx 92.5 ✓
* G-RS55SED : VOA ✓, SVOC ✓, SVOA-SIM ✓, PCB ✓, TPH ✓

6. Duplicate, Field Duplicates (Check all that apply)..... ☐ ☐

__ Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__ Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__ Field duplicate RPD ≤20% (≤35% for soils)

Parent ID:
Duplicate ID:

Comments/Qualified Results F. Duplics not avail. for this SDG.

Acceptable: Yes NO

7. Lab Control Samples, Blank Spikes (Check all that apply)..... ✓ ⊗

(1) LCS %R 80-120% [Provided: LCS, LCSD, BS, BSD ?] (1) G-RS55SED*
__LCS %R 50-79% or >120%, results >IDL estimated (J) (2) G-GA35, G-RS55SW#
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: (1) LCS/LCSD ARI (5/01/09) Acceptance Limits met for: VOA(8260)✓, SVOA(8270)✓, SVOC-PAH ✓ TPH-Dx ✓, PCB ✓. (2) Naphal. & 1M-Naphth. RPD out. Assoc. w# G-GA-35 is # ⊗ Qualif. (J). PCB ✓ 090809 ✓ 091109 ✓. TPH 090709 ✓, 091609 ✓

8. MS / MSD Recovery on samples for associated Data Package... ✓ ☐

MS/MSD Recovery data is not specified in Functional Guidelines, however the following limits will be advisory.

1 MS/MSD %R 80-120% SPIKED SAMPLE IDs: G-RS55SED*
__ MS/MSD %R 50-79% or >120%, results >IDL estimated (J)
__ MS/MSD %R 50-79% and results <IDL estimated (UJ)
__ MS/MSD %R <50% and all results rejected (R/UR)

Comments/Qualified Results: 1 - Acceptance limit Criteria published by Lab is effective 5-01-09 ; ∴ Lab established criteria is met for SVOA(8270)✓, SVOC(8270 SIM)✓, PCB(8082)✓, MS/MSD - Not required for NWTPH - NO QUAL. " / " - Not provided for VOA(8260) analys. - No Qualif. applied.

9. Result Verification, Detection Limits ..... ☐ ⊗

⊗ Do Not meet QAPP Soil Screen Level criteria.

__All results supported in raw data; [Raw data provided / Not Provided]
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: ⊗ VOA(8260) - 1,2 Dibromo 3 Chlor P., 1,2,3 Trichloropropane, Ethylene Dibromide
⊗ SVOA(8270) - Diben(a,h) and B(a)P do not meet QAPP. PCB(8082) - OK✓, SVOC(SIM) PAH's - OK✓, TPH-Dx - OK✓.

10. Overall Assessment..... ☐ ☐

Comments/Qualified Results:

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by Low Level SW8270D-SIM GC/MS **Sample ID: G-GA3S-090309**
Page 1 of 1 **SAMPLE**

Lab Sample ID: PN10A
LIMS ID: 09-20720
Matrix: Water
Data Release Authorized:
Reported: 09/10/09

QC Report No: PN10-Golder Associates
Project: Avery Landing
Event: 073-93312
Date Sampled: 09/03/09
Date Received: 09/04/09

Date Extracted: 09/07/09
Date Analyzed: 09/09/09 21:02
Instrument/Analyst: NT2/PK

Sample Amount: 500 mL
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00

CAS Number	Analyte	RL	Result	
91-20-3	**Naphthalene**	**0.010**	**0.045**	J
91-57-6	**2-Methylnaphthalene**	**0.010**	**0.015**	J
90-12-0	**1-Methylnaphthalene**	**0.010**	**0.018**	
208-96-8	Acenaphthylene	0.010	< 0.010 U	
83-32-9	**Acenaphthene**	**0.010**	**0.016**	
86-73-7	Fluorene	0.010	< 0.010 U	
85-01-8	Phenanthrene	0.010	< 0.010 U	
120-12-7	Anthracene	0.010	< 0.010 U	
206-44-0	Fluoranthene	0.010	< 0.010 U	
129-00-0	Pyrene	0.010	< 0.010 U	
56-55-3	Benzo(a)anthracene	0.010	< 0.010 U	
218-01-9	Chrysene	0.010	< 0.010 U	
205-99-2	Benzo(b)fluoranthene	0.010	< 0.010 U	
207-08-9	Benzo(k)fluoranthene	0.010	< 0.010 U	
50-32-8	Benzo(a)pyrene	0.010	< 0.010 U	
193-39-5	Indeno(1,2,3-cd)pyrene	0.010	< 0.010 U	
53-70-3	Dibenz(a,h)anthracene	0.010	< 0.010 U	
191-24-2	Benzo(g,h,i)perylene	0.010	< 0.010 ~~U~~	UJ
132-64-9	Dibenzofuran	0.010	< 0.010 U	

Reported in µg/L (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	61.3%
d14-Dibenzo(a,h)anthracene	82.0%

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Analytical Resources, Inc.**	SDG: **PN-10, PN-14, PN-53 & PN-54**

SAMPLES		Collect:	MATRIX
G-GA-35-090309 (PN-10)	#	090309	Water
G-RS-3SSW-090609 (PN-53)	#	090609	Water
G-RS-5SSED-0-090809 (PN-53)	+	090809	Soil

Throughout document checklist designates water.
+ " " " " " " Soil.

DATA ASSESSMENT SUMMARY

REVIEW ITEM	ICP/ AES EPA 6010	ICP/ MS 200.8	Hg/ Se 7470A	CN	Anions	OTHER
1. Data Completeness	O	O	O			
2. Holding Times	O	O	O			
3. Calibration	O	O	O			
4. Blanks	O	O	O			
5. Lab Duplicate, ~~Field Duplicate RPD~~	O	O	O			
6. LCS, Blank Spike, MFS	O	O	O			
7. Matrix Spike, MSD	O	O	O			
8. GFAA, MSA, (Serial Dil.) (3)	O	O	O			
9. Detection Limits, Other QC (1) (2)	O	O	O			
10. Data Verification, Overall Summary	O	O	O			

O = Data had no problems Θ = Problems, but do not affect data
X = Data qualified due to minor problems [typically estimated data (J or UJ)].
M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).
Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) As report limit was above regulatory screen criteria. However Sample results above the reg. screen criteria and NO QUALIF. APPLIED.
(2) Hg does not meet Reg. Screen Limit - NO QUALIF. Applied.
(3) Ni serial Dilution exceeds 10%. Assoc. soil result Qualif. (J).

Validated by: [signature] **Date:** Nov. 3, 2009
Reviewed by: **Date:**

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ ICV/CCV Results
- ✓ Blank Results
- ✓ ICP Interference Check Results ICS/AB*
- ✓ Spike Recovery Results
- ✓ Duplicate Results
- ✓ LCS Results
- O Standard Addition Results
- ✓ ICP Serial Dilution
- ✓ Instrument Det. Limits
- ✓ ICP Correction Factors
- ✓ ICP Linear Ranges
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ ICP Raw Data
- O GFAA Raw Data
- ✓ Hg Raw Data
- O Cyanide Raw Data
- O Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: *Run # IP091821 ✓ & MS091482 ✓

2. Holding Times (Check all that apply)..... ☑ ☐

- ✓ ICP/GFAA metals completed in <6 months from collection
- ✓ Mercury analyzed in <28 days from collection
- __ Cyanide completed in 14 days from collection

- Water Samples
+ - Soil Sample.

Comments/Qualified Results: Cooler temps PN10 ✓ PN53 ✓
G-GA35 prep 9-4-09 Analys. 6010: 9/14 ✓ 200.8: 9/10 ✓ Hg: 9/08 ✓
G-RS-355 " 9-11-09 " " : 9/18 ✓ " : 9/14 ✓ Hg 9/08 ✓
+ G-RS55-SED prep. 9-11-09 " " : 9/18 ✓ 200.8; 9/14 ✓ Hg 9/12 ✓

3. Calibrations (Check all that apply)..... ☑ ☐

Water Analysis
- ✓ ICV/CCV %R for ICP/AA, 90%-110%, acceptable
- __ ICV/CCV %R for ICP/AA, 75%-89% or 111%-125%, results estimated (J/UJ)
- __ ICV/CCV %R for ICP/AA, <75% or >125%, reject positive results (R)
- __ ICV/CCV %R 80-120% for Hg, results accepted
- ✓ CRDL Check Stnd %R 70 – 130, (50-150 SbPbTl)

+ Soil Analysis
- __ ICV/CCV %R for Hg, 65%-79% or 121%-135%, results estimated (J/UJ)
- __ ICV/CCV %R 85-115% for Cyanide, results acceptable
- __ ICV/CCV %R 70-84% or 116-130%, results estimated (J/UJ)
- __ ICV/CCV %R <70% or >130%, reject pos results (R)

Comments/Qualified Results: #PN10: ICAL ✓, CCAL ✓ for 6010 & Hg. ICP interelement corr. factors 9-11-2009 ✓. Lin Range date 9/26/09
#PN53: ICAL ✓, CCAL ✓ for 6010. CRDL ✓. Lin Range date 2/3/09
+ PN69A:

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

4. Blanks (Check all that apply)..... ☑ ☐

PN10 WATER Matrix
PN53 " "
__Detects reported in ICB/CCB list:
__Detects in preparation blanks, list:
__Detects in field blanks, list ——— No Field Blank submitted.
+ PN69 SOIL Matrix

Qualified as undetected (U) all sample concentrations ≤10X any associated blank concentrations and less than the PQL, or J+ for samples greater than the PQL.

Comments/Qualified Results: # PN-10 ✓, # PN53 ✓; No detects; 6010, Hg ✓.
ICB ✓ All ND.
CCB ✓ 1-4 All ND. PN-14 Hg: ✓ ND
PN-54 Hg: ✓ ND
+ ✓ PN-69A - All ND (Soil)

5. Duplicates (Check all that apply)..... ☑ ☐

✓ Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field Duplicate ID_____

Comments/Qualified Results PN-10 ✓ ; PN-53 ✓

7. Laboratory Control Samples, Blank Spikes (Check all that apply)... ☑ ☐

#

✓ LCS %R 80-120%, [50-150% for Ag, Sb]
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: # PN-10 ✓; 6010 & Hg (7470A) ✓ (✓) = PN-14
PN-53 ✓ Hg: PN54 ✓
+ PN-69A ✓ (Soil sample associated).

8. Spike Recovery (Check all that apply)..... ☑ ☐

☑ Spike %R with 75-125%
__Spike %R 30-74%, >125%, results > IDL est. (J)
__Spike %R 30-74% results <IDL estimated (UJ)
__Spike %R <30%, results <IDL rejected (UR)
__Field blanks used for spike analysis
__Post digest spk rqrd: %R 75-125%, excpt Ag

Comments/Qualified Results: PN-10; 6010 & 7470A on Sample: G-RS35SW; G-GA3S

9. GFAA Performance, MSA, or Serial Dilutions..... ☑ ☒

__Duplicate injection RSD <20%
__Duplicate injection RSD >20%, results > CRDL estimated (J)
__Analytical spike %R 85-115%
__Analytical spike %R 40-85%, results > IDL estimated (J)
__Analytical spike %R 10-40%, results <IDL estimated (UJ)
__Analytical spike %R <10%, results <IDL rejected (R)

Comments/Qualified Results: Ser Dilon # G-GA3S %Diff. PN-10; Ser. Dilon # G-RS35SW %Diff. PN-53.
+ Ser. Dilon G-RS5S-SED: Ni out of limit. Qualif. (J).

10. Detection Limits, Other QC..... ☐ ☒

Comments/Qualified Results: PN10; (X) As regulat. Screen level @ 0.045 ug/L lab reports 0.2 ug/L

(X) PN-69A; Hg reg. limit @ 0.0051 mg/Kg, 0.020 reported RL.

11. Data Verification and Overall Assessment..... ☑ ☐

Comments/Qualified Results:

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Percent Total Solids: 70.9%

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	mg/kg-dry	Q
3050B	09/11/09	6010B	09/18/09	**7429-90-5**	**Aluminum**	7	**9,840**	
3050B	09/11/09	200.8	09/14/09	7440-36-0	Antimony	0.3	0.3	U
3050B	09/11/09	200.8	09/14/09	**7440-38-2**	**Arsenic**	0.3	**9.6**	
3050B	09/11/09	6010B	09/18/09	**7440-39-3**	**Barium**	0.4	**44.7**	
3050B	09/11/09	6010B	09/18/09	**7440-41-7**	**Beryllium**	0.1	**0.3**	
3050B	09/11/09	6010B	09/18/09	7440-43-9	Cadmium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	**7440-70-2**	**Calcium**	7	**1,690**	
3050B	09/11/09	6010B	09/18/09	**7440-47-3**	**Chromium**	0.7	**8.9**	
3050B	09/11/09	6010B	09/18/09	**7440-48-4**	**Cobalt**	0.4	**6.7**	
3050B	09/11/09	6010B	09/18/09	**7440-50-8**	**Copper**	0.3	**20.4**	
3050B	09/11/09	6010B	09/18/09	**7439-89-6**	**Iron**	7	**18,300**	
3050B	09/11/09	6010B	09/18/09	**7439-92-1**	**Lead**	3	**12**	
3050B	09/11/09	6010B	09/18/09	**7439-95-4**	**Magnesium**	7	**5,480**	
3050B	09/11/09	6010B	09/18/09	**7439-96-5**	**Manganese**	0.1	**178**	
CLP	09/11/09	7471A	09/12/09	7439-97-6	Mercury	0.03	0.03	U
3050B	09/11/09	6010B	09/18/09	**7440-02-0**	**Nickel**	1	**12**	J
3050B	09/11/09	6010B	09/18/09	**7440-09-7**	**Potassium**	70	**1,710**	
3050B	09/11/09	200.8	09/14/09	7782-49-2	Selenium	0.7	0.7	U
3050B	09/11/09	7761	09/18/09	7440-22-4	Silver	0.03	0.03	U
3050B	09/11/09	6010B	09/18/09	**7440-23-5**	**Sodium**	70	**80**	
3050B	09/11/09	200.8	09/14/09	7440-28-0	Thallium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	**7440-62-2**	**Vanadium**	0.4	**18.9**	
3050B	09/11/09	6010B	09/18/09	**7440-66-6**	**Zinc**	1	**37**	

U-Analyte undetected at given RL
RL-Reporting Limit

11-05-09

Analytical Resources, Incorporated
Analytical Chemists and Consultants

September 23, 2009

Doug Morell
Golder Associates Inc.
18300 NE Union Hill Road, Suite 200
Redmond, WA 98052

RE: Project: Avery Landing, 073-93312-03
ARI Job No: PN69

Dear Mr. Morell:

Please find enclosed the Chain-of-Custody (COC) record, sample receipt documentation, and the data package for the project referenced above.

Sample receipt and details of these analyses are discussed in the Case Narrative.

An electronic copy of this package will remain on file with Analytical Resources, Inc. (ARI). Should you have any questions or problems, please feel free to call me at any time.

Sincerely,
ANALYTICAL RESOURCES, INC.

Cheronne Oreiro
Project Manager
-For-
Kelly Bottem
Client Services Manager
(206) 695-6211
kellyb@arilabs.com

cc: eFile: PN69

Enclosures

4611 South 134th Place, Suite 100 • Tukwila WA 98168 • **206-695-6200** • **206-695-6201** fax

Chain of Custody
Documentation

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN69

prepared
by

Analytical Resources, Inc.

PN69

SAMPLE CHAIN OF CUSTODY

Send Report To Doug Morrell & Kirsi Longley
Company Golder Associates
Address 18300 NE Union Hill Road
City, State, ZIP Redmond, WA 98052
Phone # 425-883-0777 Fax #

SAMPLERS (signature)
PROJECT NAME/NO. Avery Landing 073-93312-03
PO #
REMARKS Please use project specific reporting limits. VOC's & SVOC's must be Target Compound List. Metals must be

Page # 1 of 1

TURNAROUND TIME
☒ Standard (2 Weeks)
☐ RUSH
Rush charges authorized by:

SAMPLE DISPOSAL
☒ Dispose after 30 days
☐ Return samples
☐ Will call with instructions

Sample ID	Lab ID	Date	Time	Sample Type	# of containers	NWTPH-Diesel extended	~~TPH-Gasoline~~	~~BTEX by 8021B~~	TCL VOC (8260B) ~~VOCs by 8260~~ low level	TCL SVOC (8270) ~~SVOCs by 8270~~ low level	~~HFS~~	PCB (8082A) low level	PAH (8270 SIM)	TAL metals (Total)	TAL metals (dissolved)		Notes
G-RS3SSW-090609		9/6/09	1145	W	7	X						X	X	X	Hold		Hold dissolved metals bottle pending analysis.
G-RS5SSED-0-090809		9/8/09	840	S	5	X			X	X		X	X	X			

ANALYSES REQUESTED

SIGNATURE	PRINT NAME	COMPANY	DATE	TIME
Relinquished by:	Kirsi Longley	Golder Associates	9/8/09	1430
Received by:	Mikka Mukumba	ARI	9/10/09	950
Relinquished by:				
Received by:				

Friedman & Bruya, Inc.
3012 16th Avenue West
Seattle, WA 98119-2029
Ph. (206) 285-8282
Fax (206) 283-5044
FORMS\COC\COC.DOC

PN69 : 69999

Analytical Resources, Incorporated
Analytical Chemists and Consultants

Cooler Receipt Form

ARI Client: Golder Associates
COC No(s): _____ (NA)
Assigned ARI Job No: PN69

Project Name: Avery landing
Delivered by: Fed-Ex UPS Courier Hand Delivered Other: _____
Tracking No: 839682281475 NA

Preliminary Examination Phase:

Were intact, properly signed and dated custody seals attached to the outside of to cooler?	(YES)	NO
Were custody papers included with the cooler?	(YES)	NO
Were custody papers properly filled out (ink, signed, etc.)	(YES)	NO
Temperature of Cooler(s) (°C) (recommended 2.0-6.0 °C for chemistry) 4.0		

If cooler temperature is out of compliance fill out form 00070F — Temp Gun ID#: 101886

Cooler Accepted by: MM Date: 9/10/09 Time: 950

Complete custody forms and attach all shipping documents

Log-In Phase:

Was a temperature blank included in the cooler?		YES	(NO)
What kind of packing material was used? (Bubble Wrap) (Wet Ice) Gel Packs (Baggies) Foam Block Paper Other: _____			
Was sufficient ice used (if appropriate)?	NA	(YES)	NO
Were all bottles sealed in individual plastic bags?		(YES)	NO
Did all bottles arrive in good condition (unbroken)?		(YES)	NO
Were all bottle labels complete and legible?		(YES)	NO
Did the number of containers listed on COC match with the number of containers received?		(YES)	NO
Did all bottle labels and tags agree with custody papers?		(YES)	NO
Were all bottles used correct for the requested analyses?		(YES)	NO
Do any of the analyses (bottles) require preservation? (attach preservation sheet, excluding VOCs)	(NA)	YES	NO
Were all VOC vials free of air bubbles?	(NA)	YES	NO
Was sufficient amount of sample sent in each bottle?		(YES)	NO

Samples Logged by: AV Date: 9/10/09 Time: 1431

***** Notify Project Manager of discrepancies or concerns *****

Sample ID on Bottle	Sample ID on COC	Sample ID on Bottle	Sample ID on COC

Additional Notes, Discrepancies, & Resolutions:

By: Date:

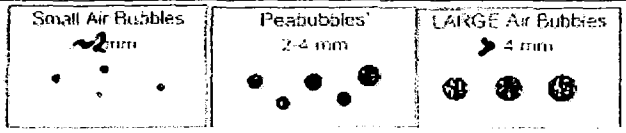

Small → "sm"
Peabubbles → "pb"
Large → "lg"
Headspace → "hs"

Case Narrative

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN69

prepared
by

Analytical Resources, Inc.

Case Narrative

Client: Golder
Project: Avery Landing, 073-93312-03
ARI Job No.: PN69
Date: September 23, 2009

Sample Receipt:

Analytical Resources Inc, (ARI) accepted one soil sample on September 10, 2009 under ARI job PN69. The sample was received with a cooler temperature of 4.0°C. For further details regarding sample receipt, please refer to the Cooler Receipt Form.

The sample was analyzed for VOCs, SVOCs, SIM PAH, PCBs, NWTPH-Dx, and Total Metals, as requested.

Volatiles by SW8260C:

The sample was analyzed on 9/16/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): The continuing calibration of Vinyl Chloride was outside the control limits high. All detected results for this compound have been flagged with a "Q" qualifier. No further corrective action was required.

The continuing calibration of Bromoform fell outside the control limits low. All detected results for this compound have been flagged with a "Q" qualifier. No further corrective action was required.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blank was free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): The LCS and LCSD percent recoveries were within control limits.

Semivolatiles by SW8270D:

The sample was extracted on 9/14/09 and analyzed on 9/15/09, within the method recommended holding time.

Initial calibration (s): The initial calibration of 2,4-Dinitrophenol was outside the control limits. All detected results for this compound have been flagged with a "Q" qualifier. No further corrective action was required.

Continuing calibration (s): The continuing calibration of Hexachlorocyclopentadiene fell outside the control limits low. All detected results have been flagged for this compound. No corrective action was required.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blank was free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): Several LCS and LCSD percent recoveries were outside the control limits high for **LCS-091409**. The associated sample was undetected for all compounds. No corrective action was required.

MS/MSD (s): Several matrix spike and matrix spike duplicate percent recoveries were outside the advisory control limits for sample **G-RS5SSED-0-090809**. No corrective action is required for matrix QC.

SIM PAHs by SW8270:

The sample was extracted on 9/14/09 and analyzed on 9/17/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blank was free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

MS/MSD (s): The matrix spike and matrix spike duplicate percent recoveries were within advisory control limits.

PCBs by SW8082:

The sample was extracted on 9/14/09 and analyzed on 9/16/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Internal Standard (s): All internal standard areas were within control limits.

Method Blank (s): The method blank was free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

MS/MSD (s): The matrix spike and matrix spike duplicate percent recoveries were within advisory control limits.

NWTPH-Dx

The sample was extracted on 9/14/09 and analyzed on 9/15/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Method Blank (s): The method blank was free of contamination

Surrogate(s): All surrogate percent recoveries were within control limits.

Samples: There were no anomalies associated with this analysis.

LCS/LCSD (s): All LCS and LCSD percent recoveries were within control limits.

MS/MSD (s): The matrix spike duplicate percent recovery of Diesel fell outside the advisory control limits for sample **G-RS5SSED-0-090809**. No corrective action is required for matrix QC.

Total Metals Analysis By SW6010B/200.8/7761/7471A:

The samples were digested on 9/11/09 and analyzed between 9/9/14/09 and 9/18/09, within the method recommended holding time.

Initial calibration (s): All analytes were within method acceptance criteria.

Continuing calibration (s): All analytes were within method acceptance criteria.

Method Blank (s): The method blanks were free of contamination

Samples: There were no anomalies associated with the analyses.

LCS (s): All LCS percent recoveries were within control limits.

Data Reporting Qualifiers

Effective 7/10/2009

Inorganic Data

U Indicates that the target analyte was not detected at the reported concentration

* Duplicate RPD is not within established control limits

B Reported value is less than the CRDL but ≥ the Reporting Limit

N Matrix Spike recovery not within established control limits

NA Not Applicable, analyte not spiked

H The natural concentration of the spiked element is so much greater than the concentration spiked that an accurate determination of spike recovery is not possible

L Analyte concentration is ≤5 times the Reporting Limit and the replicate control limit defaults to ±1 RL instead of the normal 20% RPD

Organic Data

U Indicates that the target analyte was not detected at the reported concentration

* Flagged value is not within established control limits

B Analyte detected in an associated Method Blank at a concentration greater than one-half of ARI's Reporting Limit or 5% of the regulatory limit or 5% of the analyte concentration in the sample.

J Estimated concentration when the value is less than ARI's established reporting limits

D The spiked compound was not detected due to sample extract dilution

E Estimated concentration calculated for an analyte response above the valid instrument calibration range. A dilution is required to obtain an accurate quantification of the analyte.

Q Indicates a detected analyte with an initial or continuing calibration that does not meet established acceptance criteria (<20%RSD, <20%Drift or minimum RRF).

S Indicates an analyte response that has saturated the detector. The calculated concentration is not valid; a dilution is required to obtain valid quantification of the analyte

NA The flagged analyte was not analyzed for

NR Spiked compound recovery is not reported due to chromatographic interference

NS The flagged analyte was not spiked into the sample

M Estimated value for an analyte detected and confirmed by an analyst but with low spectral match parameters. This flag is used only for GC-MS analyses

M2 The sample contains PCB congeners that do not match any standard Aroclor pattern. The PCBs are identified and quantified as the Aroclor whose pattern most closely matches that of the sample. The reported value is an estimate.

N The analysis indicates the presence of an analyte for which there is presumptive evidence to make a "tentative identification"

Y The analyte is not detected at or above the reported concentration. The reporting limit is raised due to chromatographic interference. The Y flag is equivalent to the U flag with a raised reporting limit.

C The analyte was positively identified on only one of two chromatographic columns. Chromatographic interference prevented a positive identification on the second column

P The analyte was detected on both chromatographic columns but the quantified values differ by ≥40% RPD with no obvious chromatographic interference

Geotechnical Data

A The total of all fines fractions. This flag is used to report total fines when only sieve analysis is requested and balances total grain size with sample weight.

F Samples were frozen prior to particle size determination

SM Sample matrix was not appropriate for the requested analysis. This normally refers to samples contaminated with an organic product that interferes with the sieving process and/or moisture content, porosity and saturation calculations

SS Sample did not contain the proportion of "fines" required to perform the pipette portion of the grain size analysis

W Weight of sample in some pipette aliquots was below the level required for accurate weighting

LCS SOLUTIONS

06/16/2009

LABEL	SOLN ID	TEST	CONC. UG/ML	SOLVENT	EXP.
1	1612-4	PCB	20	ACETONE	06/08/10
2#	1472-3	BCOC PEST	10	ACETONE	NA
3	1579-3	PEST	02/04/20	ACETONE	09/23/09
4	1594-2	LOW PEST	0.2/0.4/2	ACETONE	09/23/09
5	1580-2	EPH	1500	MECL2	01/29/10
6	1559-2	PCP	12.5/125	ACETONE	11/05/09
7	1613-4	ABN	100	ACETONE	02/01/10
8	1566-1	TBT	2.5	MECL2	12/04/09
9	1567-3	PORE TBT	.125/.25	MECL2	12/04/09
10	1596-2	ABN ACID	100/200	MEOH	10/21/09
11	1591-1	TPHD	15000	ACETONE	03/26/10
12	1597-3	ABN BASE	200	ACETONE	02/05/10
13	1613-1	LOW PCB	2	ACETONE	06/08/10
14*	1547-1	LOW ABN ACID	10/20	MEOH	04/10/10
15	1591-3	SIM PNA	15/75	MEOH	08/28/09
16	1602-3	DIOXANE	100	MEOH	03/20/10
17#	1516-2	1248 PCB	20	ACETONE	NA
18	1591-4	LOW SIM PNA	1.5	ACETONE	08/28/09
19	1574-4	AK103	7500	MECL2	12/02/09
20	1572-2	PNA	100	ACETONE	12/26/09
21	1593-3	SKY/BHT	100	MEOH	03/31/10
22	1603-1	HERB	12.5/12500	MEOH	08/18/09
23*	1505-1	LW ABN BASE	20	MEOH	03/20/10
24	1613-2	LOW ABN	10	ACETONE	02/28/10
25#	1481-1	DIPHENYL	100	MEOH	NA
26*	1545-2	OP-PEST	25	MEOH	02/16/10
27#	1495-1	STEROLS	200	MEOH	NA
28	1595-1	ADD. PEST	4	ACETONE	09/15/09
29#	1496-3	DECANES	100	MEOH	NA
30	1604-2	EDB/DBCP	0.1	HEXANE	05/20/10
31	1596-1	TERPINEOL	100	MEOH	04/03/10

PN69 : 00011

LCS SOLUTIONS

06/16/2009

32	1598-1	GUAIACOL	50-200	ACETONE	04/30/10
33		NOT IN USE			
34	1530-2	CONGENERS	1	ACETONE	07/23/09
35	1601-2	ALKYL PNA A	10	MEOH	04/03/10
36	1601-3	ALKYL PNA B	10	MEOH	05/13/10
50	1571-1	FULL RESIN	250	ACETONE	06/10/09
51	1611-3	DDTS	2.5	ACETONE	06/04/10
52#	1613-5	1232 PCB	20	ACETONE	06/16/10
	*=REVERIFIED SOLUTION				
	#=PROJECT SPECIFIC SOLUTION				

PN69 : 00012

SURR SOLUTIONS

06/16/2009

LABEL	SOLN ID	TEST	CONC. UG/ML	SOLVENT	EXP.
A	1584-5	ABN	100/150	MEOH	02/18/10
B	1572-1	SIM PNA	15/75	MEOH	08/28/09
C*	1559-1	SIM ABN	25/37.5	MEOH	03/13/10
D	1612-3	LOW PCB	0.2	ACETONE	05/29/10
E*	1478-1	HERB	62.5	MEOH	09/21/09
F	1574-3	PCP	12.5	ACETONE	01/06/10
G	1602-2	1,4DIOXANE	100	MEOH	03/20/10
H	1594-1	OP-PEST	25	MEOH	04/01/10
I	1559-4	LOW S. PNA	1.5	MEOH	08/28/09
J	1566-5	TBT-PORE	0.125	MECL2	12/04/09
K	1612-1	MED PCB	20	ACETONE	05/29/10
L	1584-4	TBT	2.5	MECL2	12/04/09
M	1578-1	EPH	1500	MECL2	12/09/09
N	1612-2	PCB	2	ACETONE	05/29/10
O	1606-2	TPH	450	MECL2	01/07/10
P	1598-2	HCID	2250	MECL2	01/07/10
Q	1604-5	EDB	2	HEXANE	05/22/10
R	1521-4	RESIN ACID	250	ACETONE	06/11/09
S	1568-5	PBDE	.25	MEOH	12/11/09
T	1601-1	ALKYL PNA	10	MEOH	11/26/09
U	*=REVERIFIED SOLUTION				
V					
W					
X					
Y					
Z					

PN69:00013

Data Summary Package

prepared
for

Golder Associates

Project: Avery Landing, 073-93312-03

ARI JOB NO: PN69

prepared
by

Analytical Resources, Inc.

VOLATILE ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: G-RS5SSED-0-090809**
Page 1 of 2 **SAMPLE**

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Instrument/Analyst: FINN5/PAB
Date Analyzed: 09/16/09 18:17

Sample Amount: 3.94 g-dry-wt
Purge Volume: 5.0 mL
Moisture: 29.7%

CAS Number	Analyte	RL	Result	Q
74-87-3	Chloromethane	1.3	< 1.3	U
74-83-9	Bromomethane	1.3	< 1.3	U
75-01-4	Vinyl Chloride	1.3	< 1.3	U
75-00-3	Chloroethane	1.3	< 1.3	U
75-09-2	Methylene Chloride	2.5	< 2.5	U
67-64-1	**Acetone**	**6.3**	**61**	
75-15-0	Carbon Disulfide	1.3	< 1.3	U
75-35-4	1,1-Dichloroethene	1.3	< 1.3	U
75-34-3	1,1-Dichloroethane	1.3	< 1.3	U
156-60-5	trans-1,2-Dichloroethene	1.3	< 1.3	U
156-59-2	cis-1,2-Dichloroethene	1.3	< 1.3	U
67-66-3	Chloroform	1.3	< 1.3	U
107-06-2	1,2-Dichloroethane	1.3	< 1.3	U
78-93-3	**2-Butanone**	**6.3**	**28**	
71-55-6	1,1,1-Trichloroethane	1.3	< 1.3	U
56-23-5	Carbon Tetrachloride	1.3	< 1.3	U
108-05-4	Vinyl Acetate	6.3	< 6.3	U
75-27-4	Bromodichloromethane	1.3	< 1.3	U
78-87-5	1,2-Dichloropropane	1.3	< 1.3	U
10061-01-5	cis-1,3-Dichloropropene	1.3	< 1.3	U
79-01-6	Trichloroethene	1.3	< 1.3	U
124-48-1	Dibromochloromethane	1.3	< 1.3	U
79-00-5	1,1,2-Trichloroethane	1.3	< 1.3	U
71-43-2	Benzene	1.3	< 1.3	U
10061-02-6	trans-1,3-Dichloropropene	1.3	< 1.3	U
110-75-8	2-Chloroethylvinylether	6.3	< 6.3	U
75-25-2	Bromoform	1.3	< 1.3	U
108-10-1	4-Methyl-2-Pentanone (MIBK)	6.3	< 6.3	U
591-78-6	2-Hexanone	6.3	< 6.3	U
127-18-4	Tetrachloroethene	1.3	< 1.3	U
79-34-5	1,1,2,2-Tetrachloroethane	1.3	< 1.3	U
108-88-3	Toluene	1.3	< 1.3	U
108-90-7	Chlorobenzene	1.3	< 1.3	U
100-41-4	Ethylbenzene	1.3	< 1.3	U
100-42-5	Styrene	1.3	< 1.3	U
75-69-4	Trichlorofluoromethane	1.3	< 1.3	U
76-13-1	1,1,2-Trichloro-1,2,2-trifluoroe	2.5	< 2.5	U
179601-23-1	m,p-Xylene	1.3	< 1.3	U
95-47-6	o-Xylene	1.3	< 1.3	U
95-50-1	1,2-Dichlorobenzene	1.3	< 1.3	U
541-73-1	1,3-Dichlorobenzene	1.3	< 1.3	U
106-46-7	1,4-Dichlorobenzene	1.3	< 1.3	U
107-02-8	Acrolein	63	< 63	U
74-88-4	Methyl Iodide	1.3	< 1.3	U
74-96-4	Bromoethane	2.5	< 2.5	U
107-13-1	Acrylonitrile	6.3	< 6.3	U

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: G-RS5SSED-0-090809**
 SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed: 09/16/09 18:17

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

CAS Number	Analyte	RL	Result	Q
563-58-6	1,1-Dichloropropene	1.3	< 1.3	U
74-95-3	Dibromomethane	1.3	< 1.3	U
630-20-6	1,1,1,2-Tetrachloroethane	1.3	< 1.3	U
96-12-8	1,2-Dibromo-3-chloropropane	6.3	< 6.3	U
96-18-4	1,2,3-Trichloropropane	2.5	< 2.5	U
110-57-6	trans-1,4-Dichloro-2-butene	6.3	< 6.3	U
108-67-8	1,3,5-Trimethylbenzene	1.3	< 1.3	U
95-63-6	1,2,4-Trimethylbenzene	1.3	< 1.3	U
87-68-3	Hexachlorobutadiene	6.3	< 6.3	U
106-93-4	Ethylene Dibromide	1.3	< 1.3	U
74-97-5	Bromochloromethane	1.3	< 1.3	U
594-20-7	2,2-Dichloropropane	1.3	< 1.3	U
142-28-9	1,3-Dichloropropane	1.3	< 1.3	U
98-82-8	Isopropylbenzene	1.3	< 1.3	U
103-65-1	n-Propylbenzene	1.3	< 1.3	U
108-86-1	Bromobenzene	1.3	< 1.3	U
95-49-8	2-Chlorotoluene	1.3	< 1.3	U
106-43-4	4-Chlorotoluene	1.3	< 1.3	U
98-06-6	tert-Butylbenzene	1.3	< 1.3	U
135-98-8	sec-Butylbenzene	1.3	< 1.3	U
99-87-6	4-Isopropyltoluene	1.3	< 1.3	U
104-51-8	n-Butylbenzene	1.3	< 1.3	U
120-82-1	1,2,4-Trichlorobenzene	6.3	< 6.3	U
91-20-3	Naphthalene	6.3	< 6.3	U
87-61-6	1,2,3-Trichlorobenzene	6.3	< 6.3	U

Reported in µg/kg (ppb)

Volatile Surrogate Recovery

d4-1,2-Dichloroethane	119%
d8-Toluene	106%
Bromofluorobenzene	98.5%
d4-1,2-Dichlorobenzene	101%

ANALYTICAL RESOURCES INCORPORATED

VOA SURROGATE RECOVERY SUMMARY

Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

ARI ID	Client ID	Level	DCE	TOL	BFB	DCB	TOT OUT
MB-091609	Method Blank	Low	108%	106%	98.1%	99.8%	0
LCS-091609	Lab Control	Low	106%	105%	101%	98.8%	0
LCSD-091609	Lab Control Dup	Low	105%	103%	99.0%	98.3%	0
PN69A	G-RS5SSED-0-090809	Low	119%	106%	98.5%	101%	0

	LCS/MB LIMITS		QC LIMITS	
SW8260C	Low	Med	Low	Med
(DCE) = d4-1,2-Dichloroethane	75-120	76-120	72-134	69-120
(TOL) = d8-Toluene	80-122	80-120	78-124	80-120
(BFB) = Bromofluorobenzene	79-120	80-120	66-120	76-128
(DCB) = d4-1,2-Dichlorobenzene	80-120	80-120	79-120	80-120

Log Number Range: 09-21001 to 09-21001

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: LCS-091609**
 LAB CONTROL SAMPLE

Lab Sample ID: LCS-091609
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Instrument/Analyst LCS: FINN5/PAB
LCSD: FINN5/PAB
Date Analyzed LCS: 09/16/09 16:32
LCSD: 09/16/09 16:57

Sample Amount LCS: 5.00 g-dry-wt
LCSD: 5.00 g-dry-wt
Purge Volume LCS: 5.0 mL
LCSD: 5.0 mL
Moisture: NA

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Chloromethane	52.2	50.0	104%	46.9	50.0	93.8%	10.7%
Bromomethane	47.2	50.0	94.4%	42.6	50.0	85.2%	10.2%
Vinyl Chloride	67.1 Q	50.0	134%	60.2 Q	50.0	120%	10.8%
Chloroethane	55.8	50.0	112%	49.4	50.0	98.8%	12.2%
Methylene Chloride	48.4	50.0	96.8%	45.4	50.0	90.8%	6.4%
Acetone	206	250	82.4%	202	250	80.8%	2.0%
Carbon Disulfide	44.7	50.0	89.4%	39.4	50.0	78.8%	12.6%
1,1-Dichloroethene	51.5	50.0	103%	45.1	50.0	90.2%	13.3%
1,1-Dichloroethane	49.8	50.0	99.6%	45.8	50.0	91.6%	8.4%
trans-1,2-Dichloroethene	53.6	50.0	107%	47.7	50.0	95.4%	11.6%
cis-1,2-Dichloroethene	51.6	50.0	103%	47.3	50.0	94.6%	8.7%
Chloroform	50.7	50.0	101%	46.5	50.0	93.0%	8.6%
1,2-Dichloroethane	50.3	50.0	101%	47.5	50.0	95.0%	5.7%
2-Butanone	215	250	86.0%	210	250	84.0%	2.4%
1,1,1-Trichloroethane	48.0	50.0	96.0%	42.5	50.0	85.0%	12.2%
Carbon Tetrachloride	48.9	50.0	97.8%	43.3	50.0	86.6%	12.1%
Vinyl Acetate	44.5	50.0	89.0%	43.5	50.0	87.0%	2.3%
Bromodichloromethane	47.5	50.0	95.0%	43.6	50.0	87.2%	8.6%
1,2-Dichloropropane	47.7	50.0	95.4%	44.6	50.0	89.2%	6.7%
cis-1,3-Dichloropropene	45.4	50.0	90.8%	41.9	50.0	83.8%	8.0%
Trichloroethene	50.7	50.0	101%	44.4	50.0	88.8%	13.2%
Dibromochloromethane	43.8	50.0	87.6%	41.6	50.0	83.2%	5.2%
1,1,2-Trichloroethane	48.3	50.0	96.6%	46.4	50.0	92.8%	4.0%
Benzene	52.1	50.0	104%	46.8	50.0	93.6%	10.7%
trans-1,3-Dichloropropene	44.8	50.0	89.6%	41.7	50.0	83.4%	7.2%
2-Chloroethylvinylether	55.2	50.0	110%	54.6	50.0	109%	1.1%
Bromoform	39.8 Q	50.0	79.6%	37.8 Q	50.0	75.6%	5.2%
4-Methyl-2-Pentanone (MIBK)	232	250	92.8%	225	250	90.0%	3.1%
2-Hexanone	240	250	96.0%	231	250	92.4%	3.8%
Tetrachloroethene	48.4	50.0	96.8%	43.4	50.0	86.8%	10.9%
1,1,2,2-Tetrachloroethane	49.2	50.0	98.4%	48.3	50.0	96.6%	1.8%
Toluene	51.2	50.0	102%	45.8	50.0	91.6%	11.1%
Chlorobenzene	50.8	50.0	102%	46.6	50.0	93.2%	8.6%
Ethylbenzene	54.4	50.0	109%	48.9	50.0	97.8%	10.6%
Styrene	51.9	50.0	104%	48.0	50.0	96.0%	7.8%
Trichlorofluoromethane	58.1	50.0	116%	50.5	50.0	101%	14.0%
1,1,2-Trichloro-1,2,2-trifluoroetha	52.1	50.0	104%	46.2	50.0	92.4%	12.0%
m,p-Xylene	105	100	105%	95.2	100	95.2%	9.8%
o-Xylene	49.6	50.0	99.2%	45.8	50.0	91.6%	8.0%
1,2-Dichlorobenzene	50.5	50.0	101%	47.4	50.0	94.8%	6.3%
1,3-Dichlorobenzene	50.2	50.0	100%	47.3	50.0	94.6%	5.9%
1,4-Dichlorobenzene	51.0	50.0	102%	47.4	50.0	94.8%	7.3%
Acrolein	219	250	87.6%	212	250	84.8%	3.2%
Methyl Iodide	46.4	50.0	92.8%	41.0	50.0	82.0%	12.4%
Bromoethane	50.3	50.0	101%	45.2	50.0	90.4%	10.7%
Acrylonitrile	48.7	50.0	97.4%	47.6	50.0	95.2%	2.3%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: LCS-091609**
 LAB CONTROL SAMPLE

Lab Sample ID: LCS-091609 QC Report No: PN69-Golder Associates
LIMS ID: 09-21001 Project: Avery Landing
Matrix: Soil 073-93312-03

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
1,1-Dichloropropene	49.6	50.0	99.2%	44.2	50.0	88.4%	11.5%
Dibromomethane	47.8	50.0	95.6%	45.8	50.0	91.6%	4.3%
1,1,1,2-Tetrachloroethane	45.6	50.0	91.2%	42.2	50.0	84.4%	7.7%
1,2-Dibromo-3-chloropropane	44.6	50.0	89.2%	43.3	50.0	86.6%	3.0%
1,2,3-Trichloropropane	48.9	50.0	97.8%	47.7	50.0	95.4%	2.5%
trans-1,4-Dichloro-2-butene	45.7	50.0	91.4%	44.8	50.0	89.6%	2.0%
1,3,5-Trimethylbenzene	52.6	50.0	105%	49.3	50.0	98.6%	6.5%
1,2,4-Trimethylbenzene	53.8	50.0	108%	49.1	50.0	98.2%	9.1%
Hexachlorobutadiene	46.8	50.0	93.6%	41.3	50.0	82.6%	12.5%
Ethylene Dibromide	47.4	50.0	94.8%	44.9	50.0	89.8%	5.4%
Bromochloromethane	52.1	50.0	104%	48.7	50.0	97.4%	6.7%
2,2-Dichloropropane	44.4	50.0	88.8%	39.6	50.0	79.2%	11.4%
1,3-Dichloropropane	48.5	50.0	97.0%	46.6	50.0	93.2%	4.0%
Isopropylbenzene	53.8	50.0	108%	48.9	50.0	97.8%	9.5%
n-Propylbenzene	53.2	50.0	106%	49.1	50.0	98.2%	8.0%
Bromobenzene	47.9	50.0	95.8%	45.5	50.0	91.0%	5.1%
2-Chlorotoluene	56.3	50.0	113%	51.7	50.0	103%	8.5%
4-Chlorotoluene	50.9	50.0	102%	47.1	50.0	94.2%	7.8%
tert-Butylbenzene	51.6	50.0	103%	47.6	50.0	95.2%	8.1%
sec-Butylbenzene	52.5	50.0	105%	48.0	50.0	96.0%	9.0%
4-Isopropyltoluene	53.5	50.0	107%	48.6	50.0	97.2%	9.6%
n-Butylbenzene	56.9	50.0	114%	50.9	50.0	102%	11.1%
1,2,4-Trichlorobenzene	47.6	50.0	95.2%	43.7	50.0	87.4%	8.5%
Naphthalene	49.3	50.0	98.6%	46.4	50.0	92.8%	6.1%
1,2,3-Trichlorobenzene	47.2	50.0	94.4%	43.8	50.0	87.6%	7.5%

Reported in µg/kg (ppb)

RPD calculated using sample concentrations per SW846.

Volatile Surrogate Recovery

	LCS	LCSD
d4-1,2-Dichloroethane	106%	105%
d8-Toluene	105%	103%
Bromofluorobenzene	101%	99.0%
d4-1,2-Dichlorobenzene	98.8%	98.3%

4A

VOLATILE METHOD BLANK SUMMARY

Method Blank ID.

MB0916

Lab Name: ANALYTICAL RESOURCES, INC

Client: GOLDER ASSOCIATES

ARI Job No: PN69

Project: AVERY LANDING

Lab File ID: MB0916

Lab Sample ID: MB0916

Date Analyzed: 09/16/09

Time Analyzed: 1724

Instrument ID: FINN5

Heated Purge: (Y/N) Y

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	EPA SAMPLE NO.	LAB SAMPLE ID	LAB FILE ID	TIME ANALYZED
01	LCS0916	LCS0916	LCS0916	1632
02	LCS0916	LCS0916	LCS0916A	1657
03	G-RS5SSED-0-	PN69A	PN69A	1817
04				
05				
06				
07				
08				
09				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

COMMENTS:

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: MB-091609**
 METHOD BLANK

Lab Sample ID: MB-091609
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Instrument/Analyst: FINN5/PAB
Date Analyzed: 09/16/09 17:24

Sample Amount: 5.00 g-dry-wt
Purge Volume: 5.0 mL
Moisture: NA

CAS Number	Analyte	RL	Result	Q
74-87-3	Chloromethane	1.0	< 1.0	U
74-83-9	Bromomethane	1.0	< 1.0	U
75-01-4	Vinyl Chloride	1.0	< 1.0	U
75-00-3	Chloroethane	1.0	< 1.0	U
75-09-2	Methylene Chloride	2.0	< 2.0	U
67-64-1	Acetone	5.0	< 5.0	U
75-15-0	Carbon Disulfide	1.0	< 1.0	U
75-35-4	1,1-Dichloroethene	1.0	< 1.0	U
75-34-3	1,1-Dichloroethane	1.0	< 1.0	U
156-60-5	trans-1,2-Dichloroethene	1.0	< 1.0	U
156-59-2	cis-1,2-Dichloroethene	1.0	< 1.0	U
67-66-3	Chloroform	1.0	< 1.0	U
107-06-2	1,2-Dichloroethane	1.0	< 1.0	U
78-93-3	2-Butanone	5.0	< 5.0	U
71-55-6	1,1,1-Trichloroethane	1.0	< 1.0	U
56-23-5	Carbon Tetrachloride	1.0	< 1.0	U
108-05-4	Vinyl Acetate	5.0	< 5.0	U
75-27-4	Bromodichloromethane	1.0	< 1.0	U
78-87-5	1,2-Dichloropropane	1.0	< 1.0	U
10061-01-5	cis-1,3-Dichloropropene	1.0	< 1.0	U
79-01-6	Trichloroethene	1.0	< 1.0	U
124-48-1	Dibromochloromethane	1.0	< 1.0	U
79-00-5	1,1,2-Trichloroethane	1.0	< 1.0	U
71-43-2	Benzene	1.0	< 1.0	U
10061-02-6	trans-1,3-Dichloropropene	1.0	< 1.0	U
110-75-8	2-Chloroethylvinylether	5.0	< 5.0	U
75-25-2	Bromoform	1.0	< 1.0	U
108-10-1	4-Methyl-2-Pentanone (MIBK)	5.0	< 5.0	U
591-78-6	2-Hexanone	5.0	< 5.0	U
127-18-4	Tetrachloroethene	1.0	< 1.0	U
79-34-5	1,1,2,2-Tetrachloroethane	1.0	< 1.0	U
108-88-3	Toluene	1.0	< 1.0	U
108-90-7	Chlorobenzene	1.0	< 1.0	U
100-41-4	Ethylbenzene	1.0	< 1.0	U
100-42-5	Styrene	1.0	< 1.0	U
75-69-4	Trichlorofluoromethane	1.0	< 1.0	U
76-13-1	1,1,2-Trichloro-1,2,2-trifluoroe	2.0	< 2.0	U
179601-23-1	m,p-Xylene	1.0	< 1.0	U
95-47-6	o-Xylene	1.0	< 1.0	U
95-50-1	1,2-Dichlorobenzene	1.0	< 1.0	U
541-73-1	1,3-Dichlorobenzene	1.0	< 1.0	U
106-46-7	1,4-Dichlorobenzene	1.0	< 1.0	U
107-02-8	Acrolein	50	< 50	U
74-88-4	Methyl Iodide	1.0	< 1.0	U
74-96-4	Bromoethane	2.0	< 2.0	U
107-13-1	Acrylonitrile	5.0	< 5.0	U

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Volatiles by Purge & Trap GC/MS-Method SW8260C **Sample ID: MB-091609**
 METHOD BLANK

Lab Sample ID: MB-091609 QC Report No: PN69-Golder Associates
LIMS ID: 09-21001 Project: Avery Landing
Matrix: Soil 073-93312-03
Date Analyzed: 09/16/09 17:24

CAS Number	Analyte	RL	Result	Q
563-58-6	1,1-Dichloropropene	1.0	< 1.0	U
74-95-3	Dibromomethane	1.0	< 1.0	U
630-20-6	1,1,1,2-Tetrachloroethane	1.0	< 1.0	U
96-12-8	1,2-Dibromo-3-chloropropane	5.0	< 5.0	U
96-18-4	1,2,3-Trichloropropane	2.0	< 2.0	U
110-57-6	trans-1,4-Dichloro-2-butene	5.0	< 5.0	U
108-67-8	1,3,5-Trimethylbenzene	1.0	< 1.0	U
95-63-6	1,2,4-Trimethylbenzene	1.0	< 1.0	U
87-68-3	Hexachlorobutadiene	5.0	< 5.0	U
106-93-4	Ethylene Dibromide	1.0	< 1.0	U
74-97-5	Bromochloromethane	1.0	< 1.0	U
594-20-7	2,2-Dichloropropane	1.0	< 1.0	U
142-28-9	1,3-Dichloropropane	1.0	< 1.0	U
98-82-8	Isopropylbenzene	1.0	< 1.0	U
103-65-1	n-Propylbenzene	1.0	< 1.0	U
108-86-1	Bromobenzene	1.0	< 1.0	U
95-49-8	2-Chlorotoluene	1.0	< 1.0	U
106-43-4	4-Chlorotoluene	1.0	< 1.0	U
98-06-6	tert-Butylbenzene	1.0	< 1.0	U
135-98-8	sec-Butylbenzene	1.0	< 1.0	U
99-87-6	4-Isopropyltoluene	1.0	< 1.0	U
104-51-8	n-Butylbenzene	1.0	< 1.0	U
120-82-1	1,2,4-Trichlorobenzene	5.0	< 5.0	U
91-20-3	Naphthalene	5.0	< 5.0	U
87-61-6	1,2,3-Trichlorobenzene	5.0	< 5.0	U

Reported in µg/kg (ppb)

Volatile Surrogate Recovery

d4-1,2-Dichloroethane	108%
d8-Toluene	106%
Bromofluorobenzene	98.1%
d4-1,2-Dichlorobenzene	99.8%

SEMIVOLATILE ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/18/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/15/09 12:39
Instrument/Analyst: NT6/JZ
GPC Cleanup: No

Sample Amount: 8.28 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
108-95-2	Phenol	60	< 60 U
111-44-4	Bis-(2-Chloroethyl) Ether	60	< 60 U
95-57-8	2-Chlorophenol	60	< 60 U
541-73-1	1,3-Dichlorobenzene	60	< 60 U
106-46-7	1,4-Dichlorobenzene	60	< 60 U
100-51-6	Benzyl Alcohol	300	< 300 U
95-50-1	1,2-Dichlorobenzene	60	< 60 U
95-48-7	2-Methylphenol	60	< 60 U
108-60-1	2,2'-Oxybis(1-Chloropropane)	60	< 60 U
106-44-5	4-Methylphenol	60	< 60 U
621-64-7	N-Nitroso-Di-N-Propylamine	300	< 300 U
67-72-1	Hexachloroethane	60	< 60 U
98-95-3	Nitrobenzene	60	< 60 U
78-59-1	Isophorone	60	< 60 U
88-75-5	2-Nitrophenol	60	< 60 U
105-67-9	2,4-Dimethylphenol	60	< 60 U
65-85-0	Benzoic Acid	600	< 600 U
111-91-1	bis(2-Chloroethoxy) Methane	60	< 60 U
120-83-2	2,4-Dichlorophenol	300	< 300 U
120-82-1	1,2,4-Trichlorobenzene	60	< 60 U
91-20-3	Naphthalene	60	< 60 U
106-47-8	4-Chloroaniline	300	< 300 U
87-68-3	Hexachlorobutadiene	60	< 60 U
59-50-7	4-Chloro-3-methylphenol	300	< 300 U
91-57-6	2-Methylnaphthalene	60	< 60 U
77-47-4	Hexachlorocyclopentadiene	300	< 300 U
88-06-2	2,4,6-Trichlorophenol	300	< 300 U
95-95-4	2,4,5-Trichlorophenol	300	< 300 U
91-58-7	2-Chloronaphthalene	60	< 60 U
88-74-4	2-Nitroaniline	300	< 300 U
131-11-3	Dimethylphthalate	60	< 60 U
208-96-8	Acenaphthylene	60	< 60 U
99-09-2	3-Nitroaniline	300	< 300 U
83-32-9	Acenaphthene	60	< 60 U
51-28-5	2,4-Dinitrophenol	600	< 600 U
100-02-7	4-Nitrophenol	300	< 300 U
132-64-9	Dibenzofuran	60	< 60 U
606-20-2	2,6-Dinitrotoluene	300	< 300 U
121-14-2	2,4-Dinitrotoluene	300	< 300 U
84-66-2	Diethylphthalate	60	< 60 U
7005-72-3	4-Chlorophenyl-phenylether	60	< 60 U
86-73-7	Fluorene	60	< 60 U
100-01-6	4-Nitroaniline	300	< 300 U
534-52-1	4,6-Dinitro-2-Methylphenol	600	< 600 U

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed: 09/15/09 12:39

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

CAS Number	Analyte	RL	Result
86-30-6	N-Nitrosodiphenylamine	60	< 60 U
101-55-3	4-Bromophenyl-phenylether	60	< 60 U
118-74-1	Hexachlorobenzene	60	< 60 U
87-86-5	Pentachlorophenol	300	< 300 U
85-01-8	Phenanthrene	60	< 60 U
86-74-8	Carbazole	60	< 60 U
120-12-7	Anthracene	60	< 60 U
84-74-2	Di-n-Butylphthalate	60	< 60 U
206-44-0	Fluoranthene	60	< 60 U
129-00-0	Pyrene	60	< 60 U
85-68-7	Butylbenzylphthalate	60	< 60 U
91-94-1	3,3'-Dichlorobenzidine	300	< 300 U
56-55-3	Benzo(a)anthracene	60	< 60 U
117-81-7	bis(2-Ethylhexyl)phthalate	60	< 60 U
218-01-9	Chrysene	60	< 60 U
117-84-0	Di-n-Octyl phthalate	60	< 60 U
205-99-2	Benzo(b)fluoranthene	60	< 60 U
207-08-9	Benzo(k)fluoranthene	60	< 60 U
50-32-8	Benzo(a)pyrene	60	< 60 U
193-39-5	Indeno(1,2,3-cd)pyrene	60	< 60 U
53-70-3	Dibenz(a,h)anthracene	60	< 60 U
191-24-2	Benzo(g,h,i)perylene	60	< 60 U
90-12-0	1-Methylnaphthalene	60	< 60 U

Reported in µg/kg (ppb)

Semivolatile Surrogate Recovery

d5-Nitrobenzene	67.2%	2-Fluorobiphenyl	81.2%
d14-p-Terphenyl	78.4%	d4-1,2-Dichlorobenzene	73.2%
d5-Phenol	64.5%	2-Fluorophenol	58.9%
2,4,6-Tribromophenol	82.9%	d4-2-Chlorophenol	63.7%

ANALYTICAL RESOURCES INCORPORATED

SW8270 SEMIVOLATILES SOIL/SEDIMENT SURROGATE RECOVERY SUMMARY

Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	NBZ	FBP	TPH	DCB	PHL	2FP	TBP	2CP	TOT OUT
MB-091409	76.4%	89.6%	100%	82.4%	79.5%	70.1%	97.9%	70.1%	0
LCS-091409	81.6%	88.4%	96.4%	85.6%	80.0%	70.1%	97.9%	71.7%	0
LCSD-091409	80.0%	89.6%	94.4%	84.4%	80.0%	67.7%	100%	69.9%	0
G-RS5SSED-0-090809	67.2%	81.2%	78.4%	73.2%	64.5%	58.9%	82.9%	63.7%	0
G-RS5SSED-0-090809 MS	77.6%	84.8%	77.6%	84.0%	64.5%	61.9%	92.3%	67.5%	0
G-RS5SSED-0-090809 MSD	74.0%	79.2%	74.0%	78.4%	62.9%	58.7%	91.5%	62.1%	0

	LCS/MB LIMITS	QC LIMITS
(NBZ) = d5-Nitrobenzene	(46-102)	(32-106)
(FBP) = 2-Fluorobiphenyl	(51-105)	(39-107)
(TPH) = d14-p-Terphenyl	(55-124)	(31-130)
(DCB) = d4-1,2-Dichlorobenzene	(48-104)	(38-102)
(PHL) = d5-Phenol	(44-110)	(27-112)
(2FP) = 2-Fluorophenol	(38-112)	(22-108)
(TBP) = 2,4,6-Tribromophenol	(54-120)	(31-131)
(2CP) = d4-2-Chlorophenol	(50-103)	(36-104)

Prep Method: SW3546
Log Number Range: 09-21001 to 09-21001

FORM-II SW8270

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS
Page 1 of 2

Sample ID: G-RS5SSED-0-090809
MS/MSD

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted MS/MSD: 09/14/09

Sample Amount MS: 8.31 g-dry-wt
MSD: 8.25 g-dry-wt

Date Analyzed MS: 09/15/09 13:14
MSD: 09/15/09 13:49

Final Extract Volume MS: 0.5 mL
MSD: 0.5 mL

Instrument/Analyst MS: NT6/JZ
MSD: NT6/JZ

Dilution Factor MS: 1.00
MSD: 1.00

GPC Cleanup: No

Percent Moisture: 25.1 %

Analyte	Sample	MS	Spike Added-MS	MS Recovery	MSD	Spike Added-MSD	MSD Recovery	RPD
Phenol	< 60.4 U	960	1500	64.0%	922	1520	60.7%	4.0%
Bis-(2-Chloroethyl) Ether	< 60.4 U	1090	1500	72.7%	1060	1520	69.7%	2.8%
2-Chlorophenol	< 60.4 U	1110	1500	74.0%	1080	1520	71.1%	2.7%
1,3-Dichlorobenzene	< 60.4 U	1150	1500	76.7%	1130	1520	74.3%	1.8%
1,4-Dichlorobenzene	< 60.4 U	1180	1500	78.7%	1170	1520	77.0%	0.9%
Benzyl Alcohol	< 302 U	2060	3010	68.4%	1940	3030	64.0%	6.0%
1,2-Dichlorobenzene	< 60.4 U	1170	1500	78.0%	1170	1520	77.0%	0.0%
2-Methylphenol	< 60.4 U	1040	1500	69.3%	986	1520	64.9%	5.3%
2,2'-Oxybis(1-Chloropropane	< 60.4 U	1300	1500	86.7%	1270	1520	83.6%	2.3%
4-Methylphenol	< 60.4 U	2160	3010	71.8%	2070	3030	68.3%	4.3%
N-Nitroso-Di-N-Propylamine	< 302 U	1090	1500	72.7%	1050	1520	69.1%	3.7%
Hexachloroethane	< 60.4 U	1080	1500	72.0%	1020	1520	67.1%	5.7%
Nitrobenzene	< 60.4 U	1770	1500	118%	1720	1520	113%	2.9%
Isophorone	< 60.4 U	1110	1500	74.0%	1080	1520	71.1%	2.7%
2-Nitrophenol	< 60.4 U	1030	1500	68.7%	888	1520	58.4%	14.8%
2,4-Dimethylphenol	< 60.4 U	950	1500	63.3%	939	1520	61.8%	1.2%
Benzoic Acid	< 604 U	< 602 U	4510	NA	< 606 U	4550	NA	NA
bis(2-Chloroethoxy) Methane	< 60.4 U	1090	1500	72.7%	1070	1520	70.4%	1.9%
2,4-Dichlorophenol	< 302 U	1140	1500	76.0%	1110	1520	73.0%	2.7%
1,2,4-Trichlorobenzene	< 60.4 U	1180	1500	78.7%	1170	1520	77.0%	0.9%
Naphthalene	< 60.4 U	1180	1500	78.7%	1170	1520	77.0%	0.9%
4-Chloroaniline	< 302 U	3190	3610	88.4%	3030	3640	83.2%	5.1%
Hexachlorobutadiene	< 60.4 U	1240	1500	82.7%	1220	1520	80.3%	1.6%
4-Chloro-3-methylphenol	< 302 U	1140	1500	76.0%	1100	1520	72.4%	3.6%
2-Methylnaphthalene	< 60.4 U	1270	1500	84.7%	1230	1520	80.9%	3.2%
Hexachlorocyclopentadiene	< 302 U	1790 Q	4510	39.7%	995 Q	4550	21.9%	57.1%
2,4,6-Trichlorophenol	< 302 U	1170	1500	78.0%	1160	1520	76.3%	0.9%
2,4,5-Trichlorophenol	< 302 U	1190	1500	79.3%	1170	1520	77.0%	1.7%
2-Chloronaphthalene	< 60.4 U	1180	1500	78.7%	1130	1520	74.3%	4.3%
2-Nitroaniline	< 302 U	1270	1500	84.7%	1250	1520	82.2%	1.6%
Dimethylphthalate	< 60.4 U	1190	1500	79.3%	1150	1520	75.7%	3.4%
Acenaphthylene	< 60.4 U	1200	1500	80.0%	1170	1520	77.0%	2.5%
3-Nitroaniline	< 302 U	3760	3850	97.7%	3620	3880	93.3%	3.8%
Acenaphthene	< 60.4 U	1260	1500	84.0%	1230	1520	80.9%	2.4%
2,4-Dinitrophenol	< 604 U	< 602 U	4510	NA	< 606 U	4550	NA	NA
4-Nitrophenol	< 302 U	1400	1500	93.3%	1400	1520	92.1%	0.0%
Dibenzofuran	< 60.4 U	1230	1500	82.0%	1210	1520	79.6%	1.6%
2,6-Dinitrotoluene	< 302 U	1210	1500	80.7%	1120	1520	73.7%	7.7%
2,4-Dinitrotoluene	< 302 U	1290	1500	86.0%	1170	1520	77.0%	9.8%
Diethylphthalate	< 60.4 U	1250	1500	83.3%	1220	1520	80.3%	2.4%
4-Chlorophenyl-phenylether	< 60.4 U	1290	1500	86.0%	1270	1520	83.6%	1.6%
Fluorene	< 60.4 U	1250	1500	83.3%	1220	1520	80.3%	2.4%
4-Nitroaniline	< 302 U	1240	1500	82.7%	1280	1520	84.2%	3.2%
4,6-Dinitro-2-Methylphenol	< 604 U	875	4510	19.4%	< 606 U	4550	NA	NA
N-Nitrosodiphenylamine	< 60.4 U	1170	1500	78.0%	1120	1520	73.7%	4.4%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS
Page 2 of 2

Sample ID: G-RS5SSED-0-090809
MS/MSD

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed MS: 09/15/09 13:14
MSD: 09/15/09 13:49

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Analyte	Sample	MS	Spike Added-MS	MS Recovery	MSD	Spike Added-MSD	MSD Recovery	RPD
4-Bromophenyl-phenylether	< 60.4 U	1190	1500	79.3%	1140	1520	75.0%	4.3%
Hexachlorobenzene	< 60.4 U	1230	1500	82.0%	1200	1520	78.9%	2.5%
Pentachlorophenol	< 302 U	1710	1500	114%	1810	1520	119%	5.7%
Phenanthrene	< 60.4 U	1220	1500	81.3%	1220	1520	80.3%	0.0%
Carbazole	< 60.4 U	1240	1500	82.7%	1260	1520	82.9%	1.6%
Anthracene	< 60.4 U	1190	1500	79.3%	1180	1520	77.6%	0.8%
Di-n-Butylphthalate	< 60.4 U	1290	1500	86.0%	1250	1520	82.2%	3.1%
Fluoranthene	< 60.4 U	1430	1500	95.3%	1470	1520	96.7%	2.8%
Pyrene	< 60.4 U	998	1500	66.5%	985	1520	64.8%	1.3%
Butylbenzylphthalate	< 60.4 U	1030	1500	68.7%	1000	1520	65.8%	3.0%
3,3'-Dichlorobenzidine	< 302 U	2010	3850	52.2%	1840	3880	47.4%	8.8%
Benzo(a)anthracene	< 60.4 U	1150	1500	76.7%	1120	1520	73.7%	2.6%
bis(2-Ethylhexyl)phthalate	< 60.4 U	1270	1500	84.7%	1250	1520	82.2%	1.6%
Chrysene	< 60.4 U	1180	1500	78.7%	1180	1520	77.6%	0.0%
Di-n-Octyl phthalate	< 60.4 U	1210	1500	80.7%	1190	1520	78.3%	1.7%
Benzo(b)fluoranthene	< 60.4 U	1050	1500	70.0%	1090	1520	71.7%	3.7%
Benzo(k)fluoranthene	< 60.4 U	1450	1500	96.7%	1380	1520	90.8%	4.9%
Benzo(a)pyrene	< 60.4 U	1150	1500	76.7%	1120	1520	73.7%	2.6%
Indeno(1,2,3-cd)pyrene	< 60.4 U	930	1500	62.0%	815	1520	53.6%	13.2%
Dibenz(a,h)anthracene	< 60.4 U	1140	1500	76.0%	998	1520	65.7%	13.3%
Benzo(g,h,i)perylene	< 60.4 U	1110	1500	74.0%	893	1520	58.8%	21.7%
1-Methylnaphthalene	< 60.4 U	1230	1500	82.0%	1210	1520	79.6%	1.6%

Results reported in µg/kg
RPD calculated using sample concentrations per SW846.
NA-No recovery due to high concentration of analyte in original sample and/or calculated negative recovery.

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/18/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/15/09 13:14
Instrument/Analyst: NT6/JZ
GPC Cleanup: No

Sample Amount: 8.31 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
108-95-2	Phenol	60	---
111-44-4	Bis-(2-Chloroethyl) Ether	60	---
95-57-8	2-Chlorophenol	60	---
541-73-1	1,3-Dichlorobenzene	60	---
106-46-7	1,4-Dichlorobenzene	60	---
100-51-6	Benzyl Alcohol	300	---
95-50-1	1,2-Dichlorobenzene	60	---
95-48-7	2-Methylphenol	60	---
108-60-1	2,2'-Oxybis(1-Chloropropane)	60	---
106-44-5	4-Methylphenol	60	---
621-64-7	N-Nitroso-Di-N-Propylamine	300	---
67-72-1	Hexachloroethane	60	---
98-95-3	Nitrobenzene	60	---
78-59-1	Isophorone	60	---
88-75-5	2-Nitrophenol	60	---
105-67-9	2,4-Dimethylphenol	60	---
65-85-0	Benzoic Acid	600	---
111-91-1	bis(2-Chloroethoxy) Methane	60	---
120-83-2	2,4-Dichlorophenol	300	---
120-82-1	1,2,4-Trichlorobenzene	60	---
91-20-3	Naphthalene	60	---
106-47-8	4-Chloroaniline	300	---
87-68-3	Hexachlorobutadiene	60	---
59-50-7	4-Chloro-3-methylphenol	300	---
91-57-6	2-Methylnaphthalene	60	---
77-47-4	Hexachlorocyclopentadiene	300	---
88-06-2	2,4,6-Trichlorophenol	300	---
95-95-4	2,4,5-Trichlorophenol	300	---
91-58-7	2-Chloronaphthalene	60	---
88-74-4	2-Nitroaniline	300	---
131-11-3	Dimethylphthalate	60	---
208-96-8	Acenaphthylene	60	---
99-09-2	3-Nitroaniline	300	---
83-32-9	Acenaphthene	60	---
51-28-5	2,4-Dinitrophenol	600	---
100-02-7	4-Nitrophenol	300	---
132-64-9	Dibenzofuran	60	---
606-20-2	2,6-Dinitrotoluene	300	---
121-14-2	2,4-Dinitrotoluene	300	---
84-66-2	Diethylphthalate	60	---
7005-72-3	4-Chlorophenyl-phenylether	60	---
86-73-7	Fluorene	60	---
100-01-6	4-Nitroaniline	300	---
534-52-1	4,6-Dinitro-2-Methylphenol	600	---

Lab Sample ID: PN69A QC Report No: PN69-Golder Associates
LIMS ID: 09-21001 Project: Avery Landing
Matrix: Soil 073-93312-03
Date Analyzed: 09/15/09 13:14

CAS Number	Analyte	RL	Result
86-30-6	N-Nitrosodiphenylamine	60	---
101-55-3	4-Bromophenyl-phenylether	60	---
118-74-1	Hexachlorobenzene	60	---
87-86-5	Pentachlorophenol	300	---
85-01-8	Phenanthrene	60	---
86-74-8	Carbazole	60	---
120-12-7	Anthracene	60	---
84-74-2	Di-n-Butylphthalate	60	---
206-44-0	Fluoranthene	60	---
129-00-0	Pyrene	60	---
85-68-7	Butylbenzylphthalate	60	---
91-94-1	3,3'-Dichlorobenzidine	300	---
56-55-3	Benzo(a)anthracene	60	---
117-81-7	bis(2-Ethylhexyl)phthalate	60	---
218-01-9	Chrysene	60	---
117-84-0	Di-n-Octyl phthalate	60	---
205-99-2	Benzo(b)fluoranthene	60	---
207-08-9	Benzo(k)fluoranthene	60	---
50-32-8	Benzo(a)pyrene	60	---
193-39-5	Indeno(1,2,3-cd)pyrene	60	---
53-70-3	Dibenz(a,h)anthracene	60	---
191-24-2	Benzo(g,h,i)perylene	60	---
90-12-0	1-Methylnaphthalene	60	---

Reported in µg/kg (ppb)

Semivolatile Surrogate Recovery

d5-Nitrobenzene	77.6%	2-Fluorobiphenyl	84.8%
d14-p-Terphenyl	77.6%	d4-1,2-Dichlorobenzene	84.0%
d5-Phenol	64.5%	2-Fluorophenol	61.9%
2,4,6-Tribromophenol	92.3%	d4-2-Chlorophenol	67.5%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE DUPLICATE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/18/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/15/09 13:49
Instrument/Analyst: NT6/JZ
GPC Cleanup: No

Sample Amount: 8.25 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
108-95-2	Phenol	61	---
111-44-4	Bis-(2-Chloroethyl) Ether	61	---
95-57-8	2-Chlorophenol	61	---
541-73-1	1,3-Dichlorobenzene	61	---
106-46-7	1,4-Dichlorobenzene	61	---
100-51-6	Benzyl Alcohol	300	---
95-50-1	1,2-Dichlorobenzene	61	---
95-48-7	2-Methylphenol	61	---
108-60-1	2,2'-Oxybis(1-Chloropropane)	61	---
106-44-5	4-Methylphenol	61	---
621-64-7	N-Nitroso-Di-N-Propylamine	300	---
67-72-1	Hexachloroethane	61	---
98-95-3	Nitrobenzene	61	---
78-59-1	Isophorone	61	---
88-75-5	2-Nitrophenol	61	---
105-67-9	2,4-Dimethylphenol	61	---
65-85-0	Benzoic Acid	610	---
111-91-1	bis(2-Chloroethoxy) Methane	61	---
120-83-2	2,4-Dichlorophenol	300	---
120-82-1	1,2,4-Trichlorobenzene	61	---
91-20-3	Naphthalene	61	---
106-47-8	4-Chloroaniline	300	---
87-68-3	Hexachlorobutadiene	61	---
59-50-7	4-Chloro-3-methylphenol	300	---
91-57-6	2-Methylnaphthalene	61	---
77-47-4	Hexachlorocyclopentadiene	300	---
88-06-2	2,4,6-Trichlorophenol	300	---
95-95-4	2,4,5-Trichlorophenol	300	---
91-58-7	2-Chloronaphthalene	61	---
88-74-4	2-Nitroaniline	300	---
131-11-3	Dimethylphthalate	61	---
208-96-8	Acenaphthylene	61	---
99-09-2	3-Nitroaniline	300	---
83-32-9	Acenaphthene	61	---
51-28-5	2,4-Dinitrophenol	610	---
100-02-7	4-Nitrophenol	300	---
132-64-9	Dibenzofuran	61	---
606-20-2	2,6-Dinitrotoluene	300	---
121-14-2	2,4-Dinitrotoluene	300	---
84-66-2	Diethylphthalate	61	---
7005-72-3	4-Chlorophenyl-phenylether	61	---
86-73-7	Fluorene	61	---
100-01-6	4-Nitroaniline	300	---
534-52-1	4,6-Dinitro-2-Methylphenol	610	---

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS **Sample ID: G-RS5SSED-0-090809**
 MATRIX SPIKE DUPLICATE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed: 09/15/09 13:49

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

CAS Number	Analyte	RL	Result
86-30-6	N-Nitrosodiphenylamine	61	---
101-55-3	4-Bromophenyl-phenylether	61	---
118-74-1	Hexachlorobenzene	61	---
87-86-5	Pentachlorophenol	300	---
85-01-8	Phenanthrene	61	---
86-74-8	Carbazole	61	---
120-12-7	Anthracene	61	---
84-74-2	Di-n-Butylphthalate	61	---
206-44-0	Fluoranthene	61	---
129-00-0	Pyrene	61	---
85-68-7	Butylbenzylphthalate	61	---
91-94-1	3,3'-Dichlorobenzidine	300	---
56-55-3	Benzo(a)anthracene	61	---
117-81-7	bis(2-Ethylhexyl)phthalate	61	---
218-01-9	Chrysene	61	---
117-84-0	Di-n-Octyl phthalate	61	---
205-99-2	Benzo(b)fluoranthene	61	---
207-08-9	Benzo(k)fluoranthene	61	---
50-32-8	Benzo(a)pyrene	61	---
193-39-5	Indeno(1,2,3-cd)pyrene	61	---
53-70-3	Dibenz(a,h)anthracene	61	---
191-24-2	Benzo(g,h,i)perylene	61	---
90-12-0	1-Methylnaphthalene	61	---

Reported in µg/kg (ppb)

Semivolatile Surrogate Recovery

d5-Nitrobenzene	74.0%	2-Fluorobiphenyl	79.2%
d14-p-Terphenyl	74.0%	d4-1,2-Dichlorobenzene	78.4%
d5-Phenol	62.9%	2-Fluorophenol	58.7%
2,4,6-Tribromophenol	91.5%	d4-2-Chlorophenol	62.1%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS
Page 1 of 2

Sample ID: LCS-091409
LCS/LCSD

Lab Sample ID: LCS-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted LCS/LCSD: 09/14/09

Date Analyzed LCS: 09/15/09 11:29
LCSD: 09/15/09 12:04
Instrument/Analyst LCS: NT6/JZ
LCSD: NT6/JZ
GPC Cleanup: No

Sample Amount LCS: 7.50 g
LCSD: 7.50 g
Final Extract Volume LCS: 0.5 mL
LCSD: 0.5 mL
Dilution Factor LCS: 1.00
LCSD: 1.00
Percent Moisture: NA

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Phenol	1270	1670	76.0%	1280	1670	76.6%	0.8%
Bis-(2-Chloroethyl) Ether	1200	1670	71.9%	1270	1670	76.0%	5.7%
2-Chlorophenol	1340	1670	80.2%	1310	1670	78.4%	2.3%
1,3-Dichlorobenzene	1310	1670	78.4%	1330	1670	79.6%	1.5%
1,4-Dichlorobenzene	1350	1670	80.8%	1370	1670	82.0%	1.5%
Benzyl Alcohol	2600	3330	78.1%	2610	3330	78.4%	0.4%
1,2-Dichlorobenzene	1350	1670	80.8%	1350	1670	80.8%	0.0%
2-Methylphenol	1300	1670	77.8%	1300	1670	77.8%	0.0%
2,2'-Oxybis(1-Chloropropane)	1510	1670	90.4%	1510	1670	90.4%	0.0%
4-Methylphenol	2740	3330	82.3%	2750	3330	82.6%	0.4%
N-Nitroso-Di-N-Propylamine	1300	1670	77.8%	1290	1670	77.2%	0.8%
Hexachloroethane	1250	1670	74.9%	1270	1670	76.0%	1.6%
Nitrobenzene	2080	1670	125%	2150	1670	129%	3.3%
Isophorone	1290	1670	77.2%	1330	1670	79.6%	3.1%
2-Nitrophenol	1280	1670	76.6%	1300	1670	77.8%	1.6%
2,4-Dimethylphenol	1270	1670	76.0%	1290	1670	77.2%	1.6%
Benzoic Acid	2500	5000	50.0%	2740	5000	54.8%	9.2%
bis(2-Chloroethoxy) Methane	1270	1670	76.0%	1290	1670	77.2%	1.6%
2,4-Dichlorophenol	1350	1670	80.8%	1380	1670	82.6%	2.2%
1,2,4-Trichlorobenzene	1360	1670	81.4%	1370	1670	82.0%	0.7%
Naphthalene	1370	1670	82.0%	1380	1670	82.6%	0.7%
4-Chloroaniline	4230	4000	106%	4120	4000	103%	2.6%
Hexachlorobutadiene	1410	1670	84.4%	1440	1670	86.2%	2.1%
4-Chloro-3-methylphenol	1360	1670	81.4%	1400	1670	83.8%	2.9%
2-Methylnaphthalene	1450	1670	86.8%	1480	1670	88.6%	2.0%
Hexachlorocyclopentadiene	4190 Q	5000	83.8%	4160 Q	5000	83.2%	0.7%
2,4,6-Trichlorophenol	1440	1670	86.2%	1470	1670	88.0%	2.1%
2,4,5-Trichlorophenol	1440	1670	86.2%	1530	1670	91.6%	6.1%
2-Chloronaphthalene	1370	1670	82.0%	1430	1670	85.6%	4.3%
2-Nitroaniline	1490	1670	89.2%	1580	1670	94.6%	5.9%
Dimethylphthalate	1430	1670	85.6%	1510	1670	90.4%	5.4%
Acenaphthylene	1450	1670	86.8%	1500	1670	89.8%	3.4%
3-Nitroaniline	4770	4270	112%	5040	4270	118%	5.5%
Acenaphthene	1480	1670	88.6%	1540	1670	92.2%	4.0%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: LCSD-091409
LCS/LCSD

Lab Sample ID: LCS-091409
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed LCS: 09/15/09 11:29
LCSD: 09/15/09 12:04

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
2,4-Dinitrophenol	5960 Q	5000	119%	5960 Q	5000	119%	0.0%
4-Nitrophenol	1740	1670	104%	1830	1670	110%	5.0%
Dibenzofuran	1430	1670	85.6%	1500	1670	89.8%	4.8%
2,6-Dinitrotoluene	1480	1670	88.6%	1550	1670	92.8%	4.6%
2,4-Dinitrotoluene	1580	1670	94.6%	1670	1670	100%	5.5%
Diethylphthalate	1520	1670	91.0%	1590	1670	95.2%	4.5%
4-Chlorophenyl-phenylether	1530	1670	91.6%	1590	1670	95.2%	3.8%
Fluorene	1460	1670	87.4%	1520	1670	91.0%	4.0%
4-Nitroaniline	1430	1670	85.6%	1590	1670	95.2%	10.6%
4,6-Dinitro-2-Methylphenol	4660	5000	93.2%	4760	5000	95.2%	2.1%
N-Nitrosodiphenylamine	1490	1670	89.2%	1490	1670	89.2%	0.0%
4-Bromophenyl-phenylether	1480	1670	88.6%	1510	1670	90.4%	2.0%
Hexachlorobenzene	1500	1670	89.8%	1530	1670	91.6%	2.0%
Pentachlorophenol	1850	1670	111%	1840	1670	110%	0.5%
Phenanthrene	1480	1670	88.6%	1500	1670	89.8%	1.3%
Carbazole	1470	1670	88.0%	1540	1670	92.2%	4.7%
Anthracene	1440	1670	86.2%	1460	1670	87.4%	1.4%
Di-n-Butylphthalate	1560	1670	93.4%	1580	1670	94.6%	1.3%
Fluoranthene	1590	1670	95.2%	1640	1670	98.2%	3.1%
Pyrene	1360	1670	81.4%	1370	1670	82.0%	0.7%
Butylbenzylphthalate	1390	1670	83.2%	1380	1670	82.6%	0.7%
3,3'-Dichlorobenzidine	4010	4270	93.9%	4430	4270	104%	10.0%
Benzo(a)anthracene	1380	1670	82.6%	1410	1670	84.4%	2.2%
bis(2-Ethylhexyl)phthalate	1620	1670	97.0%	1610	1670	96.4%	0.6%
Chrysene	1460	1670	87.4%	1510	1670	90.4%	3.4%
Di-n-Octyl phthalate	1460	1670	87.4%	1490	1670	89.2%	2.0%
Benzo(b)fluoranthene	1290	1670	77.2%	1300	1670	77.8%	0.8%
Benzo(k)fluoranthene	1390	1670	83.2%	1440	1670	86.2%	3.5%
Benzo(a)pyrene	1440	1670	86.2%	1480	1670	88.6%	2.7%
Indeno(1,2,3-cd)pyrene	1260	1670	75.4%	1210	1670	72.5%	4.0%
Dibenz(a,h)anthracene	1470	1670	88.0%	1490	1670	89.2%	1.4%
Benzo(g,h,i)perylene	1540	1670	92.2%	1530	1670	91.6%	0.7%
1-Methylnaphthalene	1410	1670	84.4%	1440	1670	86.2%	2.1%

Semivolatile Surrogate Recovery

	LCS	LCSD
d5-Nitrobenzene	81.6%	80.0%
2-Fluorobiphenyl	88.4%	89.6%
d14-p-Terphenyl	96.4%	94.4%
d4-1,2-Dichlorobenzene	85.6%	84.4%
d5-Phenol	80.0%	80.0%
2-Fluorophenol	70.1%	67.7%
2,4,6-Tribromophenol	97.9%	100%
d4-2-Chlorophenol	71.7%	69.9%

Results reported in µg/kg
RPD calculated using sample concentrations per SW846.

4B

SEMIVOLATILE METHOD BLANK SUMMARY

BLANK NO.

PN69MBS1

Lab Name: ANALYTICAL RESOURCES, INC Client: GOLDER ASSOCIATES

ARI Job No: PN69 Project: AVERY LANDING

Lab File ID: 09150902 Date Extracted: 09/14/09

Instrument ID: NT6 Date Analyzed: 09/15/09

Matrix: SOLID Time Analyzed: 1054

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	LAB FILE ID	DATE ANALYZED
01	PN69LCSS1	PN69LCSS1	09150903	09/15/09
02	PN69LCSDS1	PN69LCSDS1	09150904	09/15/09
03	G-RS5SSED-0-0908	PN69A	09150905	09/15/09
04	G-RS5SSED-0-090	PN69AMS	09150906	09/15/09
05	G-RS5SSED-0-090	PN69AMSD	09150907	09/15/09
06				
07				
08				
09				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

COMMENTS:

FORM IV SV

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: MB-091409
METHOD BLANK

Lab Sample ID: MB-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/18/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/14/09
Date Analyzed: 09/15/09 10:54
Instrument/Analyst: NT6/JZ
GPC Cleanup: No

Sample Amount: 7.50 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: NA

CAS Number	Analyte	RL	Result
108-95-2	Phenol	67	< 67 U
111-44-4	Bis-(2-Chloroethyl) Ether	67	< 67 U
95-57-8	2-Chlorophenol	67	< 67 U
541-73-1	1,3-Dichlorobenzene	67	< 67 U
106-46-7	1,4-Dichlorobenzene	67	< 67 U
100-51-6	Benzyl Alcohol	330	< 330 U
95-50-1	1,2-Dichlorobenzene	67	< 67 U
95-48-7	2-Methylphenol	67	< 67 U
108-60-1	2,2'-Oxybis(1-Chloropropane)	67	< 67 U
106-44-5	4-Methylphenol	67	< 67 U
621-64-7	N-Nitroso-Di-N-Propylamine	330	< 330 U
67-72-1	Hexachloroethane	67	< 67 U
98-95-3	Nitrobenzene	67	< 67 U
78-59-1	Isophorone	67	< 67 U
88-75-5	2-Nitrophenol	67	< 67 U
105-67-9	2,4-Dimethylphenol	67	< 67 U
65-85-0	Benzoic Acid	670	< 670 U
111-91-1	bis(2-Chloroethoxy) Methane	67	< 67 U
120-83-2	2,4-Dichlorophenol	330	< 330 U
120-82-1	1,2,4-Trichlorobenzene	67	< 67 U
91-20-3	Naphthalene	67	< 67 U
106-47-8	4-Chloroaniline	330	< 330 U
87-68-3	Hexachlorobutadiene	67	< 67 U
59-50-7	4-Chloro-3-methylphenol	330	< 330 U
91-57-6	2-Methylnaphthalene	67	< 67 U
77-47-4	Hexachlorocyclopentadiene	330	< 330 U
88-06-2	2,4,6-Trichlorophenol	330	< 330 U
95-95-4	2,4,5-Trichlorophenol	330	< 330 U
91-58-7	2-Chloronaphthalene	67	< 67 U
88-74-4	2-Nitroaniline	330	< 330 U
131-11-3	Dimethylphthalate	67	< 67 U
208-96-8	Acenaphthylene	67	< 67 U
99-09-2	3-Nitroaniline	330	< 330 U
83-32-9	Acenaphthene	67	< 67 U
51-28-5	2,4-Dinitrophenol	670	< 670 U
100-02-7	4-Nitrophenol	330	< 330 U
132-64-9	Dibenzofuran	67	< 67 U
606-20-2	2,6-Dinitrotoluene	330	< 330 U
121-14-2	2,4-Dinitrotoluene	330	< 330 U
84-66-2	Diethylphthalate	67	< 67 U
7005-72-3	4-Chlorophenyl-phenylether	67	< 67 U
86-73-7	Fluorene	67	< 67 U
100-01-6	4-Nitroaniline	330	< 330 U
534-52-1	4,6-Dinitro-2-Methylphenol	670	< 670 U

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
Semivolatiles by SW8270D GC/MS

Sample ID: MB-091409
METHOD BLANK

Lab Sample ID: MB-091409
LIMS ID: 09-21001
Matrix: Soil
Date Analyzed: 09/15/09 10:54

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

CAS Number	Analyte	RL	Result
86-30-6	N-Nitrosodiphenylamine	67	< 67 U
101-55-3	4-Bromophenyl-phenylether	67	< 67 U
118-74-1	Hexachlorobenzene	67	< 67 U
87-86-5	Pentachlorophenol	330	< 330 U
85-01-8	Phenanthrene	67	< 67 U
86-74-8	Carbazole	67	< 67 U
120-12-7	Anthracene	67	< 67 U
84-74-2	Di-n-Butylphthalate	67	< 67 U
206-44-0	Fluoranthene	67	< 67 U
129-00-0	Pyrene	67	< 67 U
85-68-7	Butylbenzylphthalate	67	< 67 U
91-94-1	3,3'-Dichlorobenzidine	330	< 330 U
56-55-3	Benzo(a)anthracene	67	< 67 U
117-81-7	bis(2-Ethylhexyl)phthalate	67	< 67 U
218-01-9	Chrysene	67	< 67 U
117-84-0	Di-n-Octyl phthalate	67	< 67 U
205-99-2	Benzo(b)fluoranthene	67	< 67 U
207-08-9	Benzo(k)fluoranthene	67	< 67 U
50-32-8	Benzo(a)pyrene	67	< 67 U
193-39-5	Indeno(1,2,3-cd)pyrene	67	< 67 U
53-70-3	Dibenz(a,h)anthracene	67	< 67 U
191-24-2	Benzo(g,h,i)perylene	67	< 67 U
90-12-0	1-Methylnaphthalene	67	< 67 U

Reported in µg/kg (ppb)

Semivolatile Surrogate Recovery

d5-Nitrobenzene	76.4%	2-Fluorobiphenyl	89.6%
d14-p-Terphenyl	100%	d4-1,2-Dichlorobenzene	82.4%
d5-Phenol	79.5%	2-Fluorophenol	70.1%
2,4,6-Tribromophenol	97.9%	d4-2-Chlorophenol	70.1%

SIM SEMIVOLATILE ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SIM SW8270D-SIM GC/MS
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/17/09 13:50
Instrument/Analyst: NT8/YZ
GPC Cleanup: No
Silica Gel Cleanup: Yes
Alumina Cleanup: No

Sample Amount: 10.8 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	4.6	< 4.6 U
91-57-6	**2-Methylnaphthalene**	**4.6**	**6.0**
90-12-0	1-Methylnaphthalene	4.6	< 4.6 U
208-96-8	Acenaphthylene	4.6	< 4.6 U
83-32-9	Acenaphthene	4.6	< 4.6 U
86-73-7	**Fluorene**	**4.6**	**5.1**
85-01-8	**Phenanthrene**	**4.6**	**8.3**
120-12-7	Anthracene	4.6	< 4.6 U
206-44-0	**Fluoranthene**	**4.6**	**7.9**
129-00-0	**Pyrene**	**4.6**	**59**
56-55-3	Benzo(a)anthracene	4.6	< 4.6 U
218-01-9	**Chrysene**	**4.6**	**28**
205-99-2	**Benzo(b)fluoranthene**	**4.6**	**8.3**
207-08-9	**Benzo(k)fluoranthene**	**4.6**	**8.3**
50-32-8	**Benzo(a)pyrene**	**4.6**	**18**
193-39-5	**Indeno(1,2,3-cd)pyrene**	**4.6**	**6.5**
53-70-3	Dibenz(a,h)anthracene	4.6	< 4.6 U
191-24-2	**Benzo(g,h,i)perylene**	**4.6**	**17**
132-64-9	Dibenzofuran	4.6	< 4.6 U

Reported in µg/kg (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	67.7%
d14-Dibenzo(a,h)anthracen	85.0%

ANALYTICAL RESOURCES INCORPORATED

SIM SW8270 SURROGATE RECOVERY SUMMARY

Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	MNP	DBA	TOT OUT
MB-091409	75.7%	93.7%	0
LCS-091409	63.7%	85.7%	0
LCSD-091409	63.0%	96.7%	0
G-RS5SSED-0-090809	67.7%	85.0%	0
G-RS5SSED-0-090809 MS	79.0%	99.0%	0
G-RS5SSED-0-090809 MSD	70.7%	97.7%	0

	LCS/MB LIMITS	QC LIMITS
(MNP) = d10-2-Methylnaphthalene	(35-100)	(34-100)
(DBA) = d14-Dibenzo(a,h)anthracene	(37-120)	(10-117)

Prep Method: SW3546
Log Number Range: 09-21001 to 09-21001

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SW8270D-SIM GC/MS
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted MS/MSD: 09/14/09

Date Analyzed MS: 09/17/09 14:13
MSD: 09/17/09 14:36
Instrument/Analyst MS: NT8/YZ
MSD: NT8/YZ

Sample Amount MS: 10.5 g-dry-wt
MSD: 10.6 g-dry-wt
Final Extract Volume MS: 0.50 mL
MSD: 0.50 mL
Dilution Factor MS: 1.00
MSD: 1.00

Analyte	Sample	MS	Spike Added-MS	MS Recovery	MSD	Spike Added-MSD	MSD Recovery	RPD
Naphthalene	< 4.6 U	112	143	78.3%	93.4	142	65.8%	18.1%
2-Methylnaphthalene	6.0	112	143	74.1%	114	142	76.1%	1.8%
1-Methylnaphthalene	< 4.6 U	101	143	70.6%	107	142	75.4%	5.8%
Acenaphthylene	< 4.6 U	125	143	87.4%	116	142	81.7%	7.5%
Acenaphthene	< 4.6 U	125	143	87.4%	117	142	82.4%	6.6%
Fluorene	5.1	130	143	87.3%	127	142	85.8%	2.3%
Phenanthrene	8.3	136	143	89.3%	136	142	89.9%	0.0%
Anthracene	< 4.6 U	140	143	97.9%	130	142	91.5%	7.4%
Fluoranthene	7.9	164	143	109%	131	142	86.7%	22.4%
Pyrene	59.3	160	143	70.4%	157	142	68.8%	1.9%
Benzo(a)anthracene	< 4.6 U	147	143	103%	137	142	96.5%	7.0%
Chrysene	27.8	136	143	75.7%	130	142	72.0%	4.5%
Benzo(b)fluoranthene	8.3	148	143	97.7%	129	142	85.0%	13.7%
Benzo(k)fluoranthene	8.3	131	143	85.8%	132	142	87.1%	0.8%
Benzo(a)pyrene	18.5	139	143	84.3%	131	142	79.2%	5.9%
Indeno(1,2,3-cd)pyrene	6.5	142	143	94.8%	140	142	94.0%	1.4%
Dibenz(a,h)anthracene	< 4.6 U	141	143	98.6%	139	142	97.9%	1.4%
Benzo(g,h,i)perylene	17.1	150	143	92.9%	155	142	97.1%	3.3%
Dibenzofuran	< 4.6 U	118	143	82.5%	114	142	80.3%	3.4%

Reported in µg/kg (ppb)

RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SIM SW8270D-SIM GC/MS
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/17/09 14:13
Instrument/Analyst: NT8/YZ
GPC Cleanup: No
Silica Gel Cleanup: Yes
Alumina Cleanup: No

Sample Amount: 10.5 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	4.8	---
91-57-6	2-Methylnaphthalene	4.8	---
90-12-0	1-Methylnaphthalene	4.8	---
208-96-8	Acenaphthylene	4.8	---
83-32-9	Acenaphthene	4.8	---
86-73-7	Fluorene	4.8	---
85-01-8	Phenanthrene	4.8	---
120-12-7	Anthracene	4.8	---
206-44-0	Fluoranthene	4.8	---
129-00-0	Pyrene	4.8	---
56-55-3	Benzo(a)anthracene	4.8	---
218-01-9	Chrysene	4.8	---
205-99-2	Benzo(b)fluoranthene	4.8	---
207-08-9	Benzo(k)fluoranthene	4.8	---
50-32-8	Benzo(a)pyrene	4.8	---
193-39-5	Indeno(1,2,3-cd)pyrene	4.8	---
53-70-3	Dibenz(a,h)anthracene	4.8	---
191-24-2	Benzo(g,h,i)perylene	4.8	---
132-64-9	Dibenzofuran	4.8	---

Reported in µg/kg (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	79.0%
d14-Dibenzo(a,h)anthracen	99.0%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SIM SW8270D-SIM GC/MS
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE DUPLICATE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/17/09 14:36
Instrument/Analyst: NT8/YZ
GPC Cleanup: No
Silica Gel Cleanup: Yes
Alumina Cleanup: No

Sample Amount: 10.6 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	4.7	---
91-57-6	2-Methylnaphthalene	4.7	---
90-12-0	1-Methylnaphthalene	4.7	---
208-96-8	Acenaphthylene	4.7	---
83-32-9	Acenaphthene	4.7	---
86-73-7	Fluorene	4.7	---
85-01-8	Phenanthrene	4.7	---
120-12-7	Anthracene	4.7	---
206-44-0	Fluoranthene	4.7	---
129-00-0	Pyrene	4.7	---
56-55-3	Benzo(a)anthracene	4.7	---
218-01-9	Chrysene	4.7	---
205-99-2	Benzo(b)fluoranthene	4.7	---
207-08-9	Benzo(k)fluoranthene	4.7	---
50-32-8	Benzo(a)pyrene	4.7	---
193-39-5	Indeno(1,2,3-cd)pyrene	4.7	---
53-70-3	Dibenz(a,h)anthracene	4.7	---
191-24-2	Benzo(g,h,i)perylene	4.7	---
132-64-9	Dibenzofuran	4.7	---

Reported in µg/kg (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	70.7%
d14-Dibenzo(a,h)anthracen	97.7%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SW8270D-SIM GC/MS

Sample ID: LCS-091409
LAB CONTROL SAMPLE

Lab Sample ID: LCS-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/14/09

Date Analyzed LCS: 09/17/09 13:04
LCSD: 09/17/09 13:27
Instrument/Analyst LCS: NT8/YZ
LCSD: NT8/YZ

Sample Amount LCS: 10.0 g-dry-wt
LCSD: 10.0 g-dry-wt
Final Extract Volume LCS: 0.50 mL
LCSD: 0.50 mL
Dilution Factor LCS: 1.00
LCSD: 1.00

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Naphthalene	106	150	70.7%	106	150	70.7%	0.0%
2-Methylnaphthalene	97.5	150	65.0%	96.5	150	64.3%	1.0%
1-Methylnaphthalene	106	150	70.7%	96.5	150	64.3%	9.4%
Acenaphthylene	133	150	88.7%	122	150	81.3%	8.6%
Acenaphthene	121	150	80.7%	118	150	78.7%	2.5%
Fluorene	131	150	87.3%	142	150	94.7%	8.1%
Phenanthrene	129	150	86.0%	129	150	86.0%	0.0%
Anthracene	138	150	92.0%	136	150	90.7%	1.5%
Fluoranthene	141	150	94.0%	146	150	97.3%	3.5%
Pyrene	132	150	88.0%	156	150	104%	16.7%
Benzo(a)anthracene	150	150	100%	152	150	101%	1.3%
Chrysene	141	150	94.0%	142	150	94.7%	0.7%
Benzo(b)fluoranthene	150	150	100%	156	150	104%	3.9%
Benzo(k)fluoranthene	148	150	98.7%	144	150	96.0%	2.7%
Benzo(a)pyrene	148	150	98.7%	150	150	100%	1.3%
Indeno(1,2,3-cd)pyrene	130	150	86.7%	150	150	100%	14.3%
Dibenz(a,h)anthracene	136	150	90.7%	150	150	100%	9.8%
Benzo(g,h,i)perylene	136	150	90.7%	150	150	100%	9.8%
Dibenzofuran	116	150	77.3%	132	150	88.0%	12.9%

Reported in µg/kg (ppb)

RPD calculated using sample concentrations per SW846.

SIM Semivolatile Surrogate Recovery

	LCS	LCSD
d10-2-Methylnaphthalene	63.7%	63.0%
d14-Dibenzo(a,h)anthracen	85.7%	96.7%

4B
SEMIVOLATILE METHOD BLANK SUMMARY

BLANK NO.

PN69MBS1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOCIATES

ARI Job No: PN69
Project: AVERY LANDING

Lab File ID: 091701
Date Extracted: 09/14/09

Instrument ID: NT8
Date Analyzed: 09/17/09

Matrix: SOLID
Time Analyzed: 1242

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	LAB FILE ID	DATE ANALYZED
01	PN69LCSS1	PN69LCSS1	091702	09/17/09
02	PN69LCSDS1	PN69LCSDS1	091703	09/17/09
03	G-RS5SSED-0-0908	PN69A	091704	09/17/09
04	G-RS5SSED-0-090	PN69AMS	091705	09/17/09
05	G-RS5SSED-0-090	PN69AMSD	091706	09/17/09
06				
07				
08				
09				
10				
11				
12				
13				
14				
15				
16				
17				
18				
19				
20				
21				
22				
23				
24				
25				
26				
27				
28				
29				
30				

COMMENTS:

FORM IV SV

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PNAs by SIM SW8270D-SIM GC/MS

Sample ID: MB-091409
METHOD BLANK

Lab Sample ID: MB-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
Event: 073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/14/09
Date Analyzed: 09/17/09 12:42
Instrument/Analyst: NT8/YZ
GPC Cleanup: No
Silica Gel Cleanup: Yes
Alumina Cleanup: No

Sample Amount: 10.0 g-dry-wt
Final Extract Volume: 0.5 mL
Dilution Factor: 1.00
Percent Moisture: NA

CAS Number	Analyte	RL	Result
91-20-3	Naphthalene	5.0	< 5.0 U
91-57-6	2-Methylnaphthalene	5.0	< 5.0 U
90-12-0	1-Methylnaphthalene	5.0	< 5.0 U
208-96-8	Acenaphthylene	5.0	< 5.0 U
83-32-9	Acenaphthene	5.0	< 5.0 U
86-73-7	Fluorene	5.0	< 5.0 U
85-01-8	Phenanthrene	5.0	< 5.0 U
120-12-7	Anthracene	5.0	< 5.0 U
206-44-0	Fluoranthene	5.0	< 5.0 U
129-00-0	Pyrene	5.0	< 5.0 U
56-55-3	Benzo(a)anthracene	5.0	< 5.0 U
218-01-9	Chrysene	5.0	< 5.0 U
205-99-2	Benzo(b)fluoranthene	5.0	< 5.0 U
207-08-9	Benzo(k)fluoranthene	5.0	< 5.0 U
50-32-8	Benzo(a)pyrene	5.0	< 5.0 U
193-39-5	Indeno(1,2,3-cd)pyrene	5.0	< 5.0 U
53-70-3	Dibenz(a,h)anthracene	5.0	< 5.0 U
191-24-2	Benzo(g,h,i)perylene	5.0	< 5.0 U
132-64-9	Dibenzofuran	5.0	< 5.0 U

Reported in µg/kg (ppb)

SIM Semivolatile Surrogate Recovery

d10-2-Methylnaphthalene	75.7%
d14-Dibenzo(a,h)anthracen	93.7%

PCB ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/16/09 21:28
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount: 12.8 g-dry-wt
Final Extract Volume: 4.0 mL
Dilution Factor: 1.00
Silica Gel: No

Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	31	< 31 U
53469-21-9	Aroclor 1242	31	< 31 U
12672-29-6	Aroclor 1248	31	< 31 U
11097-69-1	Aroclor 1254	31	< 31 U
11096-82-5	Aroclor 1260	31	< 31 U
11104-28-2	Aroclor 1221	31	< 31 U
11141-16-5	Aroclor 1232	31	< 31 U

Reported in µg/kg (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	82.8%
Tetrachlorometaxylene	75.8%

ANALYTICAL RESOURCES INCORPORATED

SW8082/PCB SOIL/SEDIMENT SURROGATE RECOVERY SUMMARY

Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	DCBP % REC	DCBP LCL-UCL	TCMX % REC	TCMX LCL-UCL	TOT OUT
MB-091409	83.0%	30-160	75.0%	30-160	0
LCS-091409	88.0%	30-160	79.8%	30-160	0
LCSD-091409	84.0%	30-160	74.8%	30-160	0
G-RS5SSED-0-090809	82.8%	30-160	75.8%	30-160	0
G-RS5SSED-0-090809 MS	87.0%	30-160	77.5%	30-160	0
G-RS5SSED-0-090809 MSD	91.0%	30-160	81.8%	30-160	0

Microwave (MARS) Control Limits
Prep Method: SW3546
Log Number Range: 09-21001 to 09-21001

FORM-II SW8082

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MS/MSD

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted MS/MSD: 09/14/09

Date Analyzed MS: 09/16/09 21:51
MSD: 09/16/09 22:14
Instrument/Analyst MS: ECD5/JGR
MSD: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount MS: 12.8 g-dry-wt
MSD: 12.8 g-dry-wt
Final Extract Volume MS: 4.0 mL
MSD: 4.0 mL
Dilution Factor MS: 1.00
MSD: 1.00
Silica Gel: No

Percent Moisture: 25.1%

Analyte	Sample	MS	Spike Added-MS	MS Recovery	MSD	Spike Added-MSD	MSD Recovery	RPD
Aroclor 1016	< 31.3 U	105	156	67.3%	113	157	72.0%	7.3%
Aroclor 1260	< 31.3 U	138	156	88.5%	147	157	93.6%	6.3%

Results reported in µg/kg (ppb)
RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/16/09 21:51
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount: 12.8 g-dry-wt
Final Extract Volume: 4.0 mL
Dilution Factor: 1.00
Silica Gel: No

Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	31	---
53469-21-9	Aroclor 1242	31	< 31 U
12672-29-6	Aroclor 1248	31	< 31 U
11097-69-1	Aroclor 1254	31	< 31 U
11096-82-5	Aroclor 1260	31	---
11104-28-2	Aroclor 1221	31	< 31 U
11141-16-5	Aroclor 1232	31	< 31 U

Reported in µg/kg (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	87.0%
Tetrachlorometaxylene	77.5%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: G-RS5SSED-0-090809
MATRIX SPIKE DUP

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted: 09/14/09
Date Analyzed: 09/16/09 22:14
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount: 12.8 g-dry-wt
Final Extract Volume: 4.0 mL
Dilution Factor: 1.00
Silica Gel: No

Percent Moisture: 25.1%

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	31	---
53469-21-9	Aroclor 1242	31	< 31 U
12672-29-6	Aroclor 1248	31	< 31 U
11097-69-1	Aroclor 1254	31	< 31 U
11096-82-5	Aroclor 1260	31	---
11104-28-2	Aroclor 1221	31	< 31 U
11141-16-5	Aroclor 1232	31	< 31 U

Reported in µg/kg (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	91.0%
Tetrachlorometaxylene	81.8%

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: LCS-091409
LCS/LCSD

Lab Sample ID: LCS-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted LCS/LCSD: 09/14/09

Date Analyzed LCS: 09/16/09 12:18
LCSD: 09/16/09 21:05
Instrument/Analyst LCS: ECD5/JGR
LCSD: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount LCS: 12.0 g-dry-wt
LCSD: 12.0 g-dry-wt
Final Extract Volume LCS: 4.0 mL
LCSD: 4.0 mL
Dilution Factor LCS: 1.00
LCSD: 1.00
Silica Gel: No

Percent Moisture: NA

Analyte	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Aroclor 1016	136	167	81.6%	129	167	77.4%	5.3%
Aroclor 1260	146	167	87.6%	147	167	88.2%	0.7%

PCB Surrogate Recovery

	LCS	LCSD
Decachlorobiphenyl	88.0%	84.0%
Tetrachlorometaxylene	79.8%	74.8%

Results reported in µg/kg (ppb)
RPD calculated using sample concentrations per SW846.

4

PCB METHOD BLANK SUMMARY

BLANK NO.

PN69MBS1

Lab Name: ANALYTICAL RESOURCES, INC
Client: GOLDER ASSOCIATES

ARI Job No.: PN69
Project: AVERY LANDING

Lab Sample ID: PN69MBS1
Lab File ID: 0916B006

Date Extracted: 09/14/09
Matrix: SOLID

Date Analyzed: 09/16/09
Instrument ID: ECD5

Time Analyzed: 1155
GC Columns: ZB5/ZB35

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN69LCSS1	PN69LCSS1	09/16/09
02	PN69LCSDS1	PN69LCSDS1	09/16/09
03	G-RS5SSED-0-090809	PN69A	09/16/09
04	G-RS5SSED-0-090 MS	PN69AMS	09/16/09
05	G-RS5SSED-0-090 MSD	PN69AMSD	09/16/09

ALL RUNS ARE DUAL COLUMN

FORM IV PCB

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
PCB by GC/ECD Method SW8082
Page 1 of 1

Sample ID: MB-091409
METHOD BLANK

Lab Sample ID: MB-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Date Extracted: 09/14/09
Date Analyzed: 09/16/09 11:55
Instrument/Analyst: ECD5/JGR
GPC Cleanup: No
Sulfur Cleanup: Yes
Acid Cleanup: Yes
Florisil Cleanup: No

Sample Amount: 12.0 g
Final Extract Volume: 4.0 mL
Dilution Factor: 1.00
Silica Gel: No

Percent Moisture: NA

CAS Number	Analyte	RL	Result
12674-11-2	Aroclor 1016	33	< 33 U
53469-21-9	Aroclor 1242	33	< 33 U
12672-29-6	Aroclor 1248	33	< 33 U
11097-69-1	Aroclor 1254	33	< 33 U
11096-82-5	Aroclor 1260	33	< 33 U
11104-28-2	Aroclor 1221	33	< 33 U
11141-16-5	Aroclor 1232	33	< 33 U

Reported in µg/kg (ppb)

PCB Surrogate Recovery

Decachlorobiphenyl	83.0%
Tetrachlorometaxylene	75.0%

TPHD ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
TOTAL DIESEL RANGE HYDROCARBONS
NWTPHD by GC/FID-Silica and Acid Cleaned
Page 1 of 1
Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Data Release Authorized: VTS
Reported: 09/17/09

ARI ID	Sample ID	Extraction Date	Analysis Date	EFV DL	Range	RL	Result
MB-091409	Method Blank	09/14/09	09/15/09	1.00	Diesel	5.0	< 5.0 U
09-21001	HC ID: ---		FID3A	1.0	Motor Oil	10	< 10 U
					o-Terphenyl		97.7%
PN69A	G-RS5SSED-0-090809	09/14/09	09/15/09	1.00	**Diesel**	**6.7**	**63**
09-21001	HC ID: **DIESEL/MOTOR OIL**		FID3A	1.0	**Motor Oil**	**13**	**79**
					o-Terphenyl		85.2%

Reported in mg/kg (ppm)

EFV-Effective Final Volume in mL.
DL-Dilution of extract prior to analysis.
RL-Reporting limit.

Diesel quantitation on total peaks in the range from C12 to C24.
Motor Oil quantitation on total peaks in the range from C24 to C38.
HC ID: DRO/RRO indicate results of organics or additional hydrocarbons in ranges are not identifiable.

FORM I

ANALYTICAL RESOURCES INCORPORATED

CLEANED TPHD SURROGATE RECOVERY SUMMARY

Matrix: Soil

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03

Client ID	OTER	TOT OUT
MB-091409	97.7%	0
LCS-091409	88.1%	0
LCSD-091409	85.9%	0
G-RS5SSED-0-090809	85.2%	0
G-RS5SSED-0-090809 MS	84.6%	0
G-RS5SSED-0-090809 MSD	85.6%	0

	LCS/MB LIMITS	QC LIMITS
(OTER) = o-Terphenyl	(63-115)	(49-120)

Prep Method: SW3546
Log Number Range: 09-21001 to 09-21001

FORM-II TPHD

PN69:00059

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
NWTPHD by GC/FID-Silica and Acid Cleaned **Sample ID: G-RS5SSED-0-090809**
Page 1 of 1 **MS/MSD**

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized: VTS
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted MS/MSD: 09/14/09

Date Analyzed MS: 09/15/09 09:47
MSD: 09/15/09 10:05
Instrument/Analyst MS: FID/MS
MSD: FID/MS

Sample Amount MS: 7.53 g-dry-wt
MSD: 7.53 g-dry-wt
Final Extract Volume MS: 1.0 mL
MSD: 1.0 mL
Dilution Factor MS: 1.0
MSD: 1.0
Percent Moisture: 25.1%

Range	Sample	MS	Spike Added-MS	MS Recovery	MSD	Spike Added-MSD	MSD Recovery	RPD
Diesel	62.7	171	199	54.4%	165	199	51.4%	3.6%

TPHD Surrogate Recovery

	MS	MSD
o-Terphenyl	84.6%	85.6%

Results reported in mg/kg
RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

ORGANICS ANALYSIS DATA SHEET
NWTPHD by GC/FID-Silica and Acid Cleaned **Sample ID: LCS-091409**
Page 1 of 1 **LCS/LCSD**

Lab Sample ID: LCS-091409
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized: VT
Reported: 09/17/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Date Extracted LCS/LCSD: 09/14/09
Date Analyzed LCS: 09/15/09 08:52
LCSD: 09/15/09 09:10
Instrument/Analyst LCS: FID/MS
LCSD: FID/MS

Sample Amount LCS: 10.0 g
LCSD: 10.0 g
Final Extract Volume LCS: 1.0 mL
LCSD: 1.0 mL
Dilution Factor LCS: 1.0
LCSD: 1.0

Range	LCS	Spike Added-LCS	LCS Recovery	LCSD	Spike Added-LCSD	LCSD Recovery	RPD
Diesel	118	150	78.7%	115	150	76.7%	2.6%

TPHD Surrogate Recovery

	LCS	LCSD
o-Terphenyl	88.1%	85.9%

Results reported in mg/kg
RPD calculated using sample concentrations per SW846.

ANALYTICAL RESOURCES INCORPORATED

TOTAL DIESEL RANGE HYDROCARBONS-EXTRACTION REPORT

Matrix: Soil
Date Received: 09/10/09

ARI Job: PN69
Project: Avery Landing
073-93312-03

ARI ID	Client ID	Client Amt	Final Vol	Basis	Prep Date
09-21001-091409MB1	Method Blank	10.0 g	1.00 mL	-	09/14/09
09-21001-091409LCS1	Lab Control	10.0 g	1.00 mL	-	09/14/09
09-21001-091409LCSD1	Lab Control Dup	10.0 g	1.00 mL	-	09/14/09
09-21001-PN69A	G-RS5SSED-0-090809	7.50 g	1.00 mL	D	09/14/09
09-21001-PN69AMS	G-RS5SSED-0-090809	7.53 g	1.00 mL	D	09/14/09
09-21001-PN69AMSD	G-RS5SSED-0-090809	7.53 g	1.00 mL	D	09/14/09

Basis: D=Dry Weight W=As Received

Diesel Extraction Report

4

TPH METHOD BLANK SUMMARY

BLANK NO.

PN69MBS1

Lab Name: ANALYTICAL RESOURCES, INC Client: GOLDER ASSOCIATES

SDG No.: PN69 Project No.: AVERY LANDING

Date Extracted: 09/14/09 Matrix: SOLID

Date Analyzed : 09/15/09 Instrument ID : FID3A

Time Analyzed : 0834

THIS METHOD BLANK APPLIES TO THE FOLLOWING SAMPLES, MS, and MSD:

	CLIENT SAMPLE NO.	LAB SAMPLE ID	DATE ANALYZED
01	PN69LCSS1	PN69LCSS1	09/15/09
02	PN69LCSDS1	PN69LCSDS1	09/15/09
03	G-RS5SSED-0-	PN69A	09/15/09
04	G-RS5SSED-0-	PN69AMS	09/15/09
05	G-RS5SSED-0-	PN69AMSD	09/15/09

FORM IV TPH

METALS ANALYSIS

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS

Sample ID: G-RS5SSED-0-090809
SAMPLE

Lab Sample ID: PN69A
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: 09/08/09
Date Received: 09/10/09

Percent Total Solids: 70.9%

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	mg/kg-dry	Q
3050B	09/11/09	6010B	09/18/09	**7429-90-5**	**Aluminum**	7	**9,840**	
3050B	09/11/09	200.8	09/14/09	7440-36-0	Antimony	0.3	0.3	U
3050B	09/11/09	200.8	09/14/09	**7440-38-2**	**Arsenic**	0.3	**9.6**	
3050B	09/11/09	6010B	09/18/09	**7440-39-3**	**Barium**	0.4	**44.7**	
3050B	09/11/09	6010B	09/18/09	**7440-41-7**	**Beryllium**	0.1	**0.3**	
3050B	09/11/09	6010B	09/18/09	7440-43-9	Cadmium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	**7440-70-2**	**Calcium**	7	**1,690**	
3050B	09/11/09	6010B	09/18/09	**7440-47-3**	**Chromium**	0.7	**8.9**	
3050B	09/11/09	6010B	09/18/09	**7440-48-4**	**Cobalt**	0.4	**6.7**	
3050B	09/11/09	6010B	09/18/09	**7440-50-8**	**Copper**	0.3	**20.4**	
3050B	09/11/09	6010B	09/18/09	**7439-89-6**	**Iron**	7	**18,300**	
3050B	09/11/09	6010B	09/18/09	**7439-92-1**	**Lead**	3	**12**	
3050B	09/11/09	6010B	09/18/09	**7439-95-4**	**Magnesium**	7	**5,480**	
3050B	09/11/09	6010B	09/18/09	**7439-96-5**	**Manganese**	0.1	**178**	
CLP	09/11/09	7471A	09/12/09	7439-97-6	Mercury	0.03	0.03	U
3050B	09/11/09	6010B	09/18/09	**7440-02-0**	**Nickel**	1	**12**	
3050B	09/11/09	6010B	09/18/09	**7440-09-7**	**Potassium**	70	**1,710**	
3050B	09/11/09	200.8	09/14/09	7782-49-2	Selenium	0.7	0.7	U
3050B	09/11/09	7761	09/18/09	7440-22-4	Silver	0.03	0.03	U
3050B	09/11/09	6010B	09/18/09	**7440-23-5**	**Sodium**	70	**80**	
3050B	09/11/09	200.8	09/14/09	7440-28-0	Thallium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	**7440-62-2**	**Vanadium**	0.4	**18.9**	
3050B	09/11/09	6010B	09/18/09	**7440-66-6**	**Zinc**	1	**37**	

U-Analyte undetected at given RL
RL-Reporting Limit

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: LAB CONTROL**

Lab Sample ID: PN69LCS
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

BLANK SPIKE QUALITY CONTROL REPORT

Analyte	Analysis Method	Spike Found	Spike Added	% Recovery	Q
Aluminum	6010B	212	200	106%	
Antimony	200.8	24.5	25.0	98.0%	
Arsenic	200.8	26.0	25.0	104%	
Barium	6010B	203	200	102%	
Beryllium	6010B	52.5	50.0	105%	
Cadmium	6010B	52.2	50.0	104%	
Calcium	6010B	1050	1000	105%	
Chromium	6010B	50.6	50.0	101%	
Cobalt	6010B	49.8	50.0	99.6%	
Copper	6010B	50.8	50.0	102%	
Iron	6010B	212	200	106%	
Lead	6010B	202	200	101%	
Magnesium	6010B	1070	1000	107%	
Manganese	6010B	50.6	50.0	101%	
Mercury	7471A	0.52	0.50	104%	
Nickel	6010B	51	50	102%	
Potassium	6010B	1070	1000	107%	
Selenium	200.8	79.7	80.0	99.6%	
Silver	7761	27	25	108%	
Sodium	6010B	1080	1000	108%	
Thallium	200.8	22.8	25.0	91.2%	
Vanadium	6010B	51.2	50.0	102%	
Zinc	6010B	51	50	102%	

Reported in mg/kg-dry

N-Control limit not met
NA-Not Applicable, Analyte Not Spiked
Control Limits: 80-120%

ANALYTICAL RESOURCES INCORPORATED

INORGANICS ANALYSIS DATA SHEET
TOTAL METALS **Sample ID: METHOD BLANK**

Lab Sample ID: PN69MB
LIMS ID: 09-21001
Matrix: Soil
Data Release Authorized:
Reported: 09/22/09

QC Report No: PN69-Golder Associates
Project: Avery Landing
073-93312-03
Date Sampled: NA
Date Received: NA

Percent Total Solids: NA

Prep Meth	Prep Date	Analysis Method	Analysis Date	CAS Number	Analyte	RL	mg/kg-dry	Q
3050B	09/11/09	6010B	09/18/09	7429-90-5	Aluminum	5	5	U
3050B	09/11/09	200.8	09/14/09	7440-36-0	Antimony	0.2	0.2	U
3050B	09/11/09	200.8	09/14/09	7440-38-2	Arsenic	0.2	0.2	U
3050B	09/11/09	6010B	09/18/09	7440-39-3	Barium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	7440-41-7	Beryllium	0.1	0.1	U
3050B	09/11/09	6010B	09/18/09	7440-43-9	Cadmium	0.2	0.2	U
3050B	09/11/09	6010B	09/18/09	7440-70-2	Calcium	5	5	U
3050B	09/11/09	6010B	09/18/09	7440-47-3	Chromium	0.5	0.5	U
3050B	09/11/09	6010B	09/18/09	7440-48-4	Cobalt	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	7440-50-8	Copper	0.2	0.2	U
3050B	09/11/09	6010B	09/18/09	7439-89-6	Iron	5	5	U
3050B	09/11/09	6010B	09/18/09	7439-92-1	Lead	2	2	U
3050B	09/11/09	6010B	09/18/09	7439-95-4	Magnesium	5	5	U
3050B	09/11/09	6010B	09/18/09	7439-96-5	Manganese	0.1	0.1	U
CLP	09/11/09	7471A	09/12/09	7439-97-6	Mercury	0.02	0.02	U
3050B	09/11/09	6010B	09/18/09	7440-02-0	Nickel	1	1	U
3050B	09/11/09	6010B	09/18/09	7440-09-7	Potassium	50	50	U
3050B	09/11/09	200.8	09/14/09	7782-49-2	Selenium	0.5	0.5	U
3050B	09/11/09	7761	09/18/09	7440-22-4	Silver	0.02	0.02	U
3050B	09/11/09	6010B	09/18/09	7440-23-5	Sodium	50	50	U
3050B	09/11/09	200.8	09/14/09	7440-28-0	Thallium	0.2	0.2	U
3050B	09/11/09	6010B	09/18/09	7440-62-2	Vanadium	0.3	0.3	U
3050B	09/11/09	6010B	09/18/09	7440-66-6	Zinc	1	1	U

U-Analyte undetected at given RL
RL-Reporting Limit

TOTAL SOLIDS

Volatiles Total Solids-voats
Data By: Pat Basilio
Created: 9/18/09

Worklist: 3269
Analyst: PAB
Comments:

ARI ID	Tare Wt (g)	Wet Wt (g)	Dry Wt (g)	% Solids
1. PN69A 09-21001				% 70.28

Worklist ID: 3269 Page: 1
* - VOA TS Copied From BETX TS
% - VOA TS Copied From Metals TS
$ - VOA TS Copied From Extraction TS

Extractions Total Solids-extts
Data By: Nguyen C. Trinh
Created: 9/12/09

Worklist: 511
Analyst: RVR
Comments:

	ARI ID CLIENT ID	Tare Wt (g)	Wet Wt (g)	Dry Wt (g)	% Solids	pH
1.	PN69A 09-21001 G-RS5SSED-0-090809	1.18	15.62	11.99	74.9	NR

PN69:00070

Extractions Total Solids-extts
Data By: Nguyen C. Trinh
Created: 9/12/09

Worklist: 511
Analyst: NTC
Comments:

	ARI ID / CLIENT ID	Tare Wt (g)	Wet Wt (g)	Dry Wt (g)	% Solids	pH
1.	PN69A 09-21001 G-RS5SSED-0-090809	1.18	15.62		11.99	NR

PN69:00071

Solids Data Entry Report Checked by: MH Date: 9/14/09
Date: 09/12/09 Data Analyst: KM

Solids Determination performed on 09/11/09 by MH

JOB	SAMPLE	CLIENTID	TAREWEIGHT	SAMPDISH	DRYWEIGHT	SOLIDS
PN69	A	G-RS5SSED-0-090809	0.986	10.333	7.555	70.28

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

January 11, 2010

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 08/29/09 09:05. The following list is a summary of the Work Orders contained in this report, generated on 01/11/10 11:25.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSH0166	Avery Landing	073-93312-03

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-BH1-Surf-082809	SSH0166-01	Soil	08/28/09 11:35	08/29/09 09:05
G-BH1-7.5-082809	SSH0166-02	Soil	08/28/09 12:10	08/29/09 09:05
G-BH1-16-082809	SSH0166-03	Soil	08/28/09 12:30	08/29/09 09:05
G-BH2-7.5-082809	SSH0166-04	Soil	08/28/09 09:50	08/29/09 09:05
G-BH2-Surf-082809	SSH0166-05	Soil	08/28/09 09:15	08/29/09 09:05
G-BH2-15-082809	SSH0166-06	Soil	08/28/09 10:10	08/29/09 09:05
G-BH3-Surf-082709	SSH0166-07	Soil	08/27/09 16:10	08/29/09 09:05
G-BH3-7.5-082709	SSH0166-08	Soil	08/27/09 16:45	08/29/09 09:05
G-BH3-15-082709	SSH0166-09	Soil	08/27/09 17:15	08/29/09 09:05
G-BH4-Surf-082709	SSH0166-10	Soil	08/27/09 09:50	08/29/09 09:05
G-BH4-7.5-082709	SSH0166-11	Soil	08/27/09 10:20	08/29/09 09:05
G-BH4-15-082709	SSH0166-12	Soil	08/27/09 10:15	08/29/09 09:05
G-BH5-Surf-082709	SSH0166-13	Soil	08/27/09 12:40	08/29/09 09:05
G-BH5-7.5-082709	SSH0166-14	Soil	08/27/09 13:20	08/29/09 09:05
G-BH5-15-082709	SSH0166-15	Soil	08/27/09 13:45	08/29/09 09:05

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Analytical Case Narrative

TestAmerica - Spokane, WA

SSH0166

The original NWTPH-Dx result reported for sample SSH0166-06 was ND. The 8270 PAH results for the same sample indicated the sample should have hydrocarbons present. The extracts for this sample were examined from the NWTPH-Dx, 8270 and 8082 analyses. Both the 8270 and 8082 extracts were black indicating the presence of hydrocarbons while the Dx extract remained clear. As a result of this discrepancy, sample SSH0166-06 was re-extracted and is being reported as sample SSH0166-06RE1. This amended report replaces the final report generated on 09/18/09 at 3:17pm.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**37.8**	-----	10.3	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 20:23	
Heavy Oil Range Hydrocarbons	"	**349**	-----	25.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.4%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*103%*		*50 - 150 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	113	mg/kg dry	10x	9090006	09/01/09 13:16	09/11/09 20:46	
Heavy Oil Range Hydrocarbons	"	**201**	-----	170	"	"	"	"	"	
Surrogate(s): 2-FBP			*104%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*123%*		*50 - 150 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	**262**	-----	14.6	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:10	
Heavy Oil Range Hydrocarbons	"	**96.4**	-----	36.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*114%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*110%*		*50 - 150 %*	"			"	
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	11.5	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:33	
Heavy Oil Range Hydrocarbons	"	ND	-----	28.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*113%*		*50 - 150 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	11.0	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:57	
Heavy Oil Range Hydrocarbons	"	**60.1**	-----	27.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*97.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSH0166-06RE1 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					**N1**
Diesel Range Hydrocarbons	NWTPH-Dx	**20.7**	-----	13.7	mg/kg dry	1x	9090170	09/01/09 13:16	09/28/09 11:52	
Heavy Oil Range Hydrocarbons	"	**50.7**	-----	34.2	"	"	"	"	"	
Surrogate(s): 2-FBP			*88.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*129%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**				**Sampled: 08/27/09 16:10**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	21.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 22:44	
Heavy Oil Range Hydrocarbons	"	**91.1**	-----	53.0	"	"	"	"	"	
Surrogate(s): 2-FBP		*97.0%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*116%*			*50 - 150 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**				**Sampled: 08/27/09 16:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	**12.2**	-----	11.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 23:07	
Heavy Oil Range Hydrocarbons	"	**37.5**	-----	28.0	"	"	"	"	"	
Surrogate(s): 2-FBP		*97.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*119%*			*50 - 150 %*	"			"	
SSH0166-09 (G-BH3-15-082709)		**Soil**				**Sampled: 08/27/09 17:15**				
Diesel Range Hydrocarbons	NWTPH-Dx	**601**	-----	26.0	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 00:17	
Heavy Oil Range Hydrocarbons	"	**345**	-----	64.9	"	"	"	"	"	
Surrogate(s): 2-FBP		*113%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*116%*			*50 - 150 %*	"			"	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**				**Sampled: 08/27/09 09:50**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	21.4	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 00:41	
Heavy Oil Range Hydrocarbons	"	**68.6**	-----	53.6	"	"	"	"	"	
Surrogate(s): 2-FBP		*95.3%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*117%*			*50 - 150 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**				**Sampled: 08/27/09 10:20**				
Diesel Range Hydrocarbons	NWTPH-Dx	**2380**	-----	108	mg/kg dry	5x	9090006	09/01/09 13:16	09/12/09 01:04	
Heavy Oil Range Hydrocarbons	"	**1360**	-----	270	"	"	"	"	"	
Surrogate(s): 2-FBP		*108%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*64.2%*			*50 - 150 %*	"			"	
SSH0166-12 (G-BH4-15-082709)		**Soil**				**Sampled: 08/27/09 10:15**				
Diesel Range Hydrocarbons	NWTPH-Dx	**19.2**	-----	12.5	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 01:28	
Heavy Oil Range Hydrocarbons	"	ND	-----	31.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*98.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*119%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**30.1**	-----	21.4	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 01:51	
Heavy Oil Range Hydrocarbons	"	**201**	-----	53.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*106%*		*50 - 150 %*	"			"	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1060**	-----	45.4	mg/kg dry	2x	9090006	09/01/09 13:16	09/12/09 02:15	
Heavy Oil Range Hydrocarbons	"	**703**	-----	113	"	"	"	"	"	
Surrogate(s): 2-FBP			*117%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*107%*		*50 - 150 %*	"			"	
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	**109**	-----	12.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 02:38	
Heavy Oil Range Hydrocarbons	"	**170**	-----	30.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*102%*		*50 - 150 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
PCB-1016	EPA 8082	ND	-----	9.87	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 21:58	
PCB-1221	"	ND	-----	9.87	"	"	"	"	09/11/09 21:36	
PCB-1232	"	ND	-----	9.87	"	"	"	"	"	
PCB-1242	"	ND	-----	9.87	"	"	"	"	"	
PCB-1248	"	ND	-----	9.87	"	"	"	"	"	
PCB-1254	"	ND	-----	9.87	"	"	"	"	"	
PCB-1260	"	ND	-----	9.87	"	"	"	"	09/11/09 21:58	
Surrogate(s): TCX		*65.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*57.2%*			*35 - 157 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
PCB-1016	EPA 8082	ND	-----	9.95	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 22:21	
PCB-1221	"	ND	-----	9.95	"	"	"	"	09/11/09 21:58	
PCB-1232	"	ND	-----	9.95	"	"	"	"	"	
PCB-1242	"	ND	-----	9.95	"	"	"	"	"	
PCB-1248	"	ND	-----	9.95	"	"	"	"	"	
PCB-1254	"	ND	-----	9.95	"	"	"	"	"	
PCB-1260	"	ND	-----	9.95	"	"	"	"	09/11/09 22:21	
Surrogate(s): TCX		*96.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*93.6%*			*35 - 157 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
PCB-1016	EPA 8082	ND	-----	9.93	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 22:44	
PCB-1221	"	ND	-----	9.93	"	"	"	"	09/11/09 22:21	
PCB-1232	"	ND	-----	9.93	"	"	"	"	"	
PCB-1242	"	ND	-----	9.93	"	"	"	"	"	
PCB-1248	"	ND	-----	9.93	"	"	"	"	"	
PCB-1254	"	ND	-----	9.93	"	"	"	"	"	
PCB-1260	"	ND	-----	9.93	"	"	"	"	09/11/09 22:44	
Surrogate(s): TCX		*74.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*76.8%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
PCB-1016	EPA 8082	ND	-----	9.68	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:06	
PCB-1221	"	ND	-----	9.68	"	"	"	"	09/11/09 22:44	
PCB-1232	"	ND	-----	9.68	"	"	"	"	"	
PCB-1242	"	ND	-----	9.68	"	"	"	"	"	
PCB-1248	"	ND	-----	9.68	"	"	"	"	"	
PCB-1254	"	ND	-----	9.68	"	"	"	"	"	
PCB-1260	"	ND	-----	9.68	"	"	"	"	09/11/09 23:06	
Surrogate(s): *TCX*		*81.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*78.1%*			*35 - 157 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
PCB-1016	EPA 8082	ND	-----	9.66	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:29	
PCB-1221	"	ND	-----	9.66	"	"	"	"	09/11/09 23:06	
PCB-1232	"	ND	-----	9.66	"	"	"	"	"	
PCB-1242	"	ND	-----	9.66	"	"	"	"	"	
PCB-1248	"	ND	-----	9.66	"	"	"	"	"	
PCB-1254	"	ND	-----	9.66	"	"	"	"	"	
PCB-1260	"	ND	-----	9.66	"	"	"	"	09/11/09 23:29	
Surrogate(s): *TCX*		*96.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*69.6%*			*35 - 157 %*	"			"	
SSH0166-06 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
PCB-1016	EPA 8082	ND	-----	9.85	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:51	
PCB-1221	"	ND	-----	9.85	"	"	"	"	09/11/09 23:29	
PCB-1232	"	ND	-----	9.85	"	"	"	"	"	
PCB-1242	"	ND	-----	9.85	"	"	"	"	"	
PCB-1248	"	ND	-----	9.85	"	"	"	"	"	
PCB-1254	"	ND	-----	9.85	"	"	"	"	"	
PCB-1260	"	ND	-----	9.85	"	"	"	"	09/11/09 23:51	
Surrogate(s): *TCX*		*76.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*39.8%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					
PCB-1016	EPA 8082	ND	-----	9.76	ug/kg dry	1x	9090048	09/09/09 09:20	09/14/09 23:29	
PCB-1221	"	ND	-----	9.76	"	"	"	"	09/14/09 23:06	
PCB-1232	"	ND	-----	9.76	"	"	"	"	"	
PCB-1242	"	ND	-----	9.76	"	"	"	"	"	
PCB-1248	"	ND	-----	9.76	"	"	"	"	"	
PCB-1254	"	ND	-----	9.76	"	"	"	"	"	
PCB-1260	"	ND	-----	9.76	"	"	"	"	09/14/09 23:29	
Surrogate(s): TCX		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*61.2%*			*35 - 157 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
PCB-1016	EPA 8082	ND	-----	9.84	ug/kg dry	1x	9090048	09/09/09 09:20	09/14/09 23:52	
PCB-1221	"	ND	-----	9.84	"	"	"	"	09/14/09 23:29	
PCB-1232	"	ND	-----	9.84	"	"	"	"	"	
PCB-1242	"	ND	-----	9.84	"	"	"	"	"	
PCB-1248	"	ND	-----	9.84	"	"	"	"	"	
PCB-1254	"	ND	-----	9.84	"	"	"	"	"	
PCB-1260	"	ND	-----	9.84	"	"	"	"	09/14/09 23:52	
Surrogate(s): TCX		*73.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*63.9%*			*35 - 157 %*	"			"	
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					
PCB-1016	EPA 8082	ND	-----	9.87	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:14	
PCB-1221	"	ND	-----	9.87	"	"	"	"	09/14/09 23:52	
PCB-1232	"	ND	-----	9.87	"	"	"	"	"	
PCB-1242	"	ND	-----	9.87	"	"	"	"	"	
PCB-1248	"	ND	-----	9.87	"	"	"	"	"	
PCB-1254	"	ND	-----	9.87	"	"	"	"	"	
PCB-1260	"	ND	-----	9.87	"	"	"	"	09/15/09 00:14	
Surrogate(s): TCX		*70.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*67.9%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
PCB-1016	EPA 8082	ND	-----	9.86	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:37	
PCB-1221	"	ND	-----	9.86	"	"	"	"	09/15/09 00:14	
PCB-1232	"	ND	-----	9.86	"	"	"	"	"	
PCB-1242	"	ND	-----	9.86	"	"	"	"	"	
PCB-1248	"	ND	-----	9.86	"	"	"	"	"	
PCB-1254	"	ND	-----	9.86	"	"	"	"	"	
PCB-1260	"	ND	-----	9.86	"	"	"	"	09/15/09 00:37	
Surrogate(s): TCX		*88.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*65.2%*			*35 - 157 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					
PCB-1016	EPA 8082	ND	-----	9.95	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 07:17	
PCB-1221	"	ND	-----	9.95	"	"	"	"	"	
PCB-1232	"	ND	-----	9.95	"	"	"	"	"	
PCB-1242	"	ND	-----	9.95	"	"	"	"	"	
PCB-1248	"	ND	-----	9.95	"	"	"	"	"	
PCB-1254	"	ND	-----	9.95	"	"	"	"	"	
PCB-1260	"	ND	-----	9.95	"	"	"	"	"	
Surrogate(s): TCX		*102%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*21.0%*			*35 - 157 %*	"			"	*Z*
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
PCB-1016	EPA 8082	ND	-----	9.52	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:59	
PCB-1221	"	ND	-----	9.52	"	"	"	"	09/15/09 00:37	
PCB-1232	"	ND	-----	9.52	"	"	"	"	"	
PCB-1242	"	ND	-----	9.52	"	"	"	"	"	
PCB-1248	"	ND	-----	9.52	"	"	"	"	"	
PCB-1254	"	ND	-----	9.52	"	"	"	"	"	
PCB-1260	"	ND	-----	9.52	"	"	"	"	09/15/09 00:59	
Surrogate(s): TCX		*32.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*34.8%*			*35 - 157 %*	"			"	*Z*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					
PCB-1016	EPA 8082	ND	-----	9.85	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 01:22	
PCB-1221	"	ND	-----	9.85	"	"	"	"	09/15/09 00:59	
PCB-1232	"	ND	-----	9.85	"	"	"	"	"	
PCB-1242	"	ND	-----	9.85	"	"	"	"	"	
PCB-1248	"	ND	-----	9.85	"	"	"	"	"	
PCB-1254	"	ND	-----	9.85	"	"	"	"	"	
PCB-1260	"	ND	-----	9.85	"	"	"	"	09/15/09 01:22	
Surrogate(s): TCX		*85.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*58.8%*			*35 - 157 %*	"			"	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
PCB-1016	EPA 8082	ND	-----	9.98	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 07:40	
PCB-1221	"	ND	-----	9.98	"	"	"	"	"	
PCB-1232	"	ND	-----	9.98	"	"	"	"	"	
PCB-1242	"	ND	-----	9.98	"	"	"	"	"	
PCB-1248	"	ND	-----	9.98	"	"	"	"	"	
PCB-1254	"	ND	-----	9.98	"	"	"	"	"	
PCB-1260	"	ND	-----	9.98	"	"	"	"	"	
Surrogate(s): TCX		*60.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*23.0%*			*35 - 157 %*	"			"	***Z***
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
PCB-1016	EPA 8082	ND	-----	9.74	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:30	
PCB-1221	"	ND	-----	9.74	"	"	"	"	09/15/09 01:22	
PCB-1232	"	ND	-----	9.74	"	"	"	"	"	
PCB-1242	"	ND	-----	9.74	"	"	"	"	"	
PCB-1248	"	ND	-----	9.74	"	"	"	"	"	
PCB-1254	"	ND	-----	9.74	"	"	"	"	"	
PCB-1260	"	ND	-----	9.74	"	"	"	"	09/15/09 02:30	
Surrogate(s): TCX		*61.3%*			*27.9 - 154 %*	"			*09/15/09 01:45*	
Decachlorobiphenyl		*49.2%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000685*	0.00480	mg/kg dry	1x	9080204	08/31/09 13:00	08/31/09 19:34	
2-Methylnaphthalene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Acenaphthene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Anthracene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00183**	*0.00137*	0.00480	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.00206*	0.00480	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.00183**	*0.000685*	0.00480	"	"	"	"	"	**J**
Chrysene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00137*	0.00480	"	"	"	"	"	
Fluoranthene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Fluorene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00206*	0.00480	"	"	"	"	"	
Naphthalene	"	ND	*0.00137*	0.00480	"	"	"	"	"	
Phenanthrene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Pyrene	"	ND	*0.000685*	0.00480	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*69.8%*		*38.8 - 139 %*	"			"	
2-FBP			*66.6%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*99.6%*		*31.7 - 179 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000754*	0.00452	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:11	
2-Methylnaphthalene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Acenaphthene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Anthracene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00151*	0.00452	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	*0.00226*	0.00452	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Chrysene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00151*	0.00452	"	"	"	"	"	
Fluoranthene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Fluorene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00226*	0.00452	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-02 (G-BH1-7.5-082809)		**Soil**				**Sampled: 08/28/09 12:10**				
Naphthalene	EPA 8270 mod.	ND	*0.00151*	0.00452	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:11	
Phenanthrene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Pyrene	"	ND	*0.000754*	0.00452	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*74.6%*			*38.8 - 139 %*	"			"	
2-FBP		*63.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*120%*			*31.7 - 179 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**				**Sampled: 08/28/09 12:30**				
1-Methylnapthalene	EPA 8270 mod.	**0.0279**	*0.000973*	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:32	
2-Methylnaphthalene	"	**0.00779**	*0.000973*	0.00487	"	"	"	"	"	
Acenaphthene	"	**0.00584**	*0.000973*	0.00487	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Anthracene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00195*	0.00487	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	*0.00292*	0.00487	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Chrysene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00195*	0.00487	"	"	"	"	"	
Fluoranthene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Fluorene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00292*	0.00487	"	"	"	"	"	
Naphthalene	"	**0.00908**	*0.00195*	0.00487	"	"	"	"	"	
Phenanthrene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Pyrene	"	ND	*0.000973*	0.00487	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*52.0%*			*38.8 - 139 %*	"			"	
2-FBP		*49.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*65.4%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
1-Methylnapthalene	EPA 8270 mod.	**0.00973**	*0.000768*	0.00461	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:15	
2-Methylnaphthalene	"	**0.0159**	*0.000768*	0.00461	"	"	"	"	"	
Acenaphthene	"	ND	*0.000768*	0.00461	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000768*	0.00461	"	"	"	"	"	
Anthracene	"	**0.00307**	*0.000768*	0.00461	"	"	"	"	"	J
Benzo (a) anthracene	"	**0.00461**	*0.000768*	0.00461	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00512**	*0.000768*	0.00461	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0138**	*0.00154*	0.00461	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00563**	*0.00230*	0.00461	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000768*	0.00461	"	"	"	"	"	
Chrysene	"	**0.0102**	*0.000768*	0.00461	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00154*	0.00461	"	"	"	"	"	
Fluoranthene	"	**0.00922**	*0.000768*	0.00461	"	"	"	"	"	
Fluorene	"	**0.00256**	*0.000768*	0.00461	"	"	"	"	"	J
Indeno (1,2,3-cd) pyrene	"	**0.00410**	*0.00230*	0.00461	"	"	"	"	"	J
Naphthalene	"	**0.00768**	*0.00154*	0.00461	"	"	"	"	"	
Phenanthrene	"	**0.00973**	*0.000768*	0.00461	"	"	"	"	"	
Pyrene	"	**0.0164**	*0.000768*	0.00461	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*59.8%*			*38.8 - 139 %*	"			"	
2-FBP		*65.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*85.0%*			*31.7 - 179 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000732*	0.00476	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 18:31	
2-Methylnaphthalene	"	ND	*0.000732*	0.00476	"	"	"	"	"	
Acenaphthene	"	ND	*0.000732*	0.00476	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000732*	0.00476	"	"	"	"	"	
Anthracene	"	**0.00439**	*0.000732*	0.00476	"	"	"	"	"	J
Benzo (a) anthracene	"	**0.00585**	*0.000732*	0.00476	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00732**	*0.000732*	0.00476	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0102**	*0.00146*	0.00476	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0107**	*0.00220*	0.00476	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000732*	0.00476	"	"	"	"	"	
Chrysene	"	**0.00634**	*0.000732*	0.00476	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00927**	*0.00146*	0.00476	"	"	"	"	"	
Fluoranthene	"	**0.00439**	*0.000732*	0.00476	"	"	"	"	"	J
Fluorene	"	**0.00293**	*0.000732*	0.00476	"	"	"	"	"	J
Indeno (1,2,3-cd) pyrene	"	**0.00829**	*0.00220*	0.00476	"	"	"	"	"	
Naphthalene	"	ND	*0.00146*	0.00476	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
Phenanthrene	EPA 8270 mod.	**0.00439**	*0.000732*	0.00476	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 18:31	**J**
Pyrene	"	**0.00781**	*0.000732*	0.00476	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*67.4%*		*38.8 - 139 %*	"			"	
2-FBP			*63.8%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*107%*		*31.7 - 179 %*	"			"	
SSH0166-06 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.811**	*0.00182*	0.0109	mg/kg dry	2x	9080204	08/31/09 13:00	09/01/09 13:33	
2-Methylnaphthalene	"	**0.570**	*0.00182*	0.0109	"	"	"	"	"	
Acenaphthene	"	**0.368**	*0.00182*	0.0109	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00182*	0.0109	"	"	"	"	"	
Anthracene	"	ND	*0.00182*	0.0109	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0426**	*0.00182*	0.0109	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0146**	*0.00182*	0.0109	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00365*	0.0109	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0243**	*0.00547*	0.0109	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00182*	0.0109	"	"	"	"	"	
Chrysene	"	**0.0839**	*0.00182*	0.0109	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00365*	0.0109	"	"	"	"	"	
Fluoranthene	"	**0.0511**	*0.00182*	0.0109	"	"	"	"	"	
Fluorene	"	**0.512**	*0.00182*	0.0109	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0109**	*0.00547*	0.0109	"	"	"	"	"	
Naphthalene	"	**0.260**	*0.00365*	0.0109	"	"	"	"	"	
Phenanthrene	"	**0.786**	*0.00182*	0.0109	"	"	"	"	"	
Pyrene	"	**0.440**	*0.00182*	0.0109	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*134%*		*38.8 - 139 %*	"			"	
2-FBP			*72.0%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*211%*		*31.7 - 179 %*	"			"	***ZX***
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	*0.00141*	0.00848	mg/kg dry	2x	9080204	08/31/09 13:00	09/02/09 18:18	
2-Methylnaphthalene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Acenaphthene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Anthracene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00283*	0.00848	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0160**	*0.00424*	0.00848	mg/kg dry	2x	9080204	08/31/09 13:00	09/02/09 18:18	
Benzo (k) fluoranthene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Chrysene	"	**0.00471**	*0.00141*	0.00848	"	"	"	"	"	**J**
Dibenzo (a,h) anthracene	"	**0.00471**	*0.00283*	0.00848	"	"	"	"	"	**J**
Fluoranthene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Fluorene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00566**	*0.00424*	0.00848	"	"	"	"	"	**J**
Naphthalene	"	ND	*0.00283*	0.00848	"	"	"	"	"	
Phenanthrene	"	ND	*0.00141*	0.00848	"	"	"	"	"	
Pyrene	"	**0.00377**	*0.00141*	0.00848	"	"	"	"	"	**J**
Surrogate(s): *Nitrobenzene-d5*			*53.6%*		*38.8 - 139 %*	"			"	
2-FBP			*53.6%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*81.6%*		*31.7 - 179 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.00547**	*0.000746*	0.00485	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:58	
2-Methylnaphthalene	"	**0.00795**	*0.000746*	0.00485	"	"	"	"	"	
Acenaphthene	"	ND	*0.000746*	0.00485	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000746*	0.00485	"	"	"	"	"	
Anthracene	"	**0.00199**	*0.000746*	0.00485	"	"	"	"	"	**J**
Benzo (a) anthracene	"	**0.00447**	*0.000746*	0.00485	"	"	"	"	"	**J**
Benzo (a) pyrene	"	**0.00497**	*0.000746*	0.00485	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00646**	*0.00149*	0.00485	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00597**	*0.00224*	0.00485	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.00249**	*0.000746*	0.00485	"	"	"	"	"	**J**
Chrysene	"	**0.00895**	*0.000746*	0.00485	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00149*	0.00485	"	"	"	"	"	
Fluoranthene	"	**0.00994**	*0.000746*	0.00485	"	"	"	"	"	
Fluorene	"	**0.00199**	*0.000746*	0.00485	"	"	"	"	"	**J**
Indeno (1,2,3-cd) pyrene	"	**0.00298**	*0.00224*	0.00485	"	"	"	"	"	**J**
Naphthalene	"	**0.00447**	*0.00149*	0.00485	"	"	"	"	"	**J**
Phenanthrene	"	**0.0104**	*0.000746*	0.00485	"	"	"	"	"	
Pyrene	"	**0.00994**	*0.000746*	0.00485	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*52.6%*		*38.8 - 139 %*	"			"	
2-FBP			*52.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*86.4%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.149**	*0.000866*	0.00519	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 17:05	
2-Methylnaphthalene	"	**0.0358**	*0.000866*	0.00519	"	"	"	"	"	
Acenaphthene	"	**0.0381**	*0.000866*	0.00519	"	"	"	"	"	**A-01**
Acenaphthylene	"	ND	*0.000866*	0.00519	"	"	"	"	"	**A-01**
Anthracene	"	**0.108**	*0.000866*	0.00519	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0306**	*0.000866*	0.00519	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0139**	*0.000866*	0.00519	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00173*	0.00519	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00981**	*0.00260*	0.00519	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.0208**	*0.000866*	0.00519	"	"	"	"	"	
Chrysene	"	**0.0491**	*0.000866*	0.00519	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00808**	*0.00173*	0.00519	"	"	"	"	"	
Fluoranthene	"	**0.0294**	*0.000866*	0.00519	"	"	"	"	"	
Fluorene	"	**0.0531**	*0.000866*	0.00519	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	**0.00750**	*0.00260*	0.00519	"	"	"	"	"	
Naphthalene	"	ND	*0.00173*	0.00519	"	"	"	"	"	
Phenanthrene	"	**0.231**	*0.000866*	0.00519	"	"	"	"	"	
Pyrene	"	**0.107**	*0.000866*	0.00519	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*83.6%*		*38.8 - 139 %*	"			"	
2-FBP			*36.0%*		*40 - 132 %*	"			"	***A-01, Z***
p-Terphenyl-d14			*64.2%*		*31.7 - 179 %*	"			"	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000715*	0.00429	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 07:03	
2-Methylnaphthalene	"	ND	*0.000715*	0.00429	"	"	"	"	"	
Acenaphthene	"	ND	*0.000715*	0.00429	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000715*	0.00429	"	"	"	"	"	
Anthracene	"	ND	*0.000715*	0.00429	"	"	"	"	"	**A-01a**
Benzo (a) anthracene	"	**0.0114**	*0.000715*	0.00429	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0129**	*0.000715*	0.00429	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0324**	*0.00143*	0.00429	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00905**	*0.00214*	0.00429	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000715*	0.00429	"	"	"	"	"	
Chrysene	"	**0.0100**	*0.000715*	0.00429	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00476**	*0.00143*	0.00429	"	"	"	"	"	
Fluoranthene	"	**0.00762**	*0.000715*	0.00429	"	"	"	"	"	**A-01a**
Fluorene	"	ND	*0.000715*	0.00429	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00667**	*0.00214*	0.00429	"	"	"	"	"	
Naphthalene	"	ND	*0.00143*	0.00429	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
Phenanthrene	EPA 8270 mod.	**0.00286**	*0.000715*	0.00429	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 07:03	**A-01a, J**
Pyrene	"	**0.0224**	*0.000715*	0.00429	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*60.0%*		*38.8 - 139 %*	"			"	
2-FBP			*67.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*110%*		*31.7 - 179 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**1.74**	*0.00144*	0.00865	mg/kg dry	2x	9080204	08/31/09 13:00	09/15/09 17:48	
2-Methylnaphthalene	"	**1.60**	*0.00144*	0.00865	"	"	"	"	"	
Acenaphthene	"	**0.168**	*0.00144*	0.00865	"	"	"	"	"	**I**
Acenaphthylene	"	ND	*0.00144*	0.00865	"	"	"	"	"	**I**
Anthracene	"	**0.615**	*0.00144*	0.00865	"	"	"	"	"	**I**
Benzo (a) anthracene	"	**0.0778**	*0.00144*	0.00865	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0413**	*0.00144*	0.00865	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0471**	*0.00288*	0.00865	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0211**	*0.00432*	0.00865	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00144*	0.00865	"	"	"	"	"	
Chrysene	"	**0.196**	*0.00144*	0.00865	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00673**	*0.00288*	0.00865	"	"	"	"	"	**J**
Fluoranthene	"	**0.153**	*0.00144*	0.00865	"	"	"	"	"	**I**
Fluorene	"	**0.280**	*0.00144*	0.00865	"	"	"	"	"	**I**
Indeno (1,2,3-cd) pyrene	"	**0.00865**	*0.00432*	0.00865	"	"	"	"	"	
Naphthalene	"	ND	*0.00288*	0.00865	"	"	"	"	"	
Phenanthrene	"	**1.64**	*0.00144*	0.00865	"	"	"	"	"	**I**
Pyrene	"	**0.146**	*0.00144*	0.00865	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*236%*		*38.8 - 139 %*	"			"	***ZX***
2-FBP			*21.2%*		*40 - 132 %*	"			"	***I***
p-Terphenyl-d14			*98.4%*		*31.7 - 179 %*	"			"	***ZX***
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000835*	0.00459	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:36	
2-Methylnaphthalene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Acenaphthene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Anthracene	"	**0.00446**	*0.000835*	0.00459	"	"	"	"	"	**J**
Benzo (a) anthracene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00167*	0.00459	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	*0.00251*	0.00459	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
Benzo (k) fluoranthene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Chrysene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00167*	0.00459	"	"	"	"	"	
Fluoranthene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Fluorene	"	ND	*0.000835*	0.00459	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00251*	0.00459	"	"	"	"	"	
Naphthalene	"	ND	*0.00167*	0.00459	"	"	"	"	"	
Phenanthrene	"	**0.00501**	*0.000835*	0.00459	"	"	"	"	"	
Pyrene	"	**0.00334**	*0.000835*	0.00459	"	"	"	"	"	**J**
Surrogate(s): *Nitrobenzene-d5*		*58.8%*			*38.8 - 139 %*	"			"	
2-FBP		*57.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*70.4%*			*31.7 - 179 %*	"			"	
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	*0.00143*	0.00999	mg/kg dry	2x	9080204	08/31/09 13:00	09/01/09 12:50	
2-Methylnaphthalene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Acenaphthene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Anthracene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00571**	*0.00143*	0.00999	"	"	"	"	"	**J**
Benzo (a) pyrene	"	**0.0133**	*0.00143*	0.00999	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0257**	*0.00286*	0.00999	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0200**	*0.00428*	0.00999	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Chrysene	"	**0.0114**	*0.00143*	0.00999	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00571**	*0.00286*	0.00999	"	"	"	"	"	**J**
Fluoranthene	"	**0.00857**	*0.00143*	0.00999	"	"	"	"	"	**J**
Fluorene	"	ND	*0.00143*	0.00999	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0124**	*0.00428*	0.00999	"	"	"	"	"	
Naphthalene	"	ND	*0.00286*	0.00999	"	"	"	"	"	
Phenanthrene	"	**0.00476**	*0.00143*	0.00999	"	"	"	"	"	**J**
Pyrene	"	**0.0238**	*0.00143*	0.00999	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*65.6%*			*38.8 - 139 %*	"			"	
2-FBP		*61.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*178%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
1-Methylnapthalene	EPA 8270 mod.	**4.04**	*0.00756*	0.0529	mg/kg dry	10x	9080204	08/31/09 13:00	09/01/09 16:54	
2-Methylnaphthalene	"	**5.21**	*0.00756*	0.0529	"	"	"	"	"	
Acenaphthene	"	**0.347**	*0.00151*	0.0106	"	2x	"	"	09/01/09 14:37	**I02**
Acenaphthylene	"	ND	*0.00151*	0.0106	"	"	"	"	"	**I02**
Anthracene	"	**0.315**	*0.00151*	0.0106	"	"	"	"	"	**I02**
Benzo (a) anthracene	"	**0.0413**	*0.00151*	0.0106	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0171**	*0.00151*	0.0106	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00302*	0.0106	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0151**	*0.00454*	0.0106	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00151*	0.0106	"	"	"	"	"	
Chrysene	"	**0.0816**	*0.00151*	0.0106	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00705**	*0.00302*	0.0106	"	"	"	"	"	**J**
Fluoranthene	"	**0.0826**	*0.00151*	0.0106	"	"	"	"	"	**I02**
Fluorene	"	**0.545**	*0.00151*	0.0106	"	"	"	"	"	**I02**
Indeno (1,2,3-cd) pyrene	"	**0.00806**	*0.00454*	0.0106	"	"	"	"	"	**J**
Naphthalene	"	**0.504**	*0.00302*	0.0106	"	"	"	"	"	
Phenanthrene	"	**0.802**	*0.00151*	0.0106	"	"	"	"	"	**I02**
Pyrene	"	**0.494**	*0.00151*	0.0106	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*107%*		*38.8 - 139 %*	"			"	
2-FBP			*44.8%*		*40 - 132 %*	"			"	***I02***
p-Terphenyl-d14			*223%*		*31.7 - 179 %*	"			"	***ZX***
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.0769**	*0.000812*	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 13:12	
2-Methylnaphthalene	"	**0.0628**	*0.000812*	0.00487	"	"	"	"	"	
Acenaphthene	"	**0.0271**	*0.000812*	0.00487	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000812*	0.00487	"	"	"	"	"	
Anthracene	"	**0.0173**	*0.000812*	0.00487	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00595**	*0.000812*	0.00487	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00271**	*0.000812*	0.00487	"	"	"	"	"	**J**
Benzo (b) fluoranthene	"	ND	*0.00162*	0.00487	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00487**	*0.00244*	0.00487	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000812*	0.00487	"	"	"	"	"	
Chrysene	"	**0.0146**	*0.000812*	0.00487	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00217**	*0.00162*	0.00487	"	"	"	"	"	**J**
Fluoranthene	"	**0.0146**	*0.000812*	0.00487	"	"	"	"	"	
Fluorene	"	**0.0401**	*0.000812*	0.00487	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00325**	*0.00244*	0.00487	"	"	"	"	"	**J**
Naphthalene	"	**0.0541**	*0.00162*	0.00487	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
Phenanthrene	EPA 8270 mod.	**0.0487**	*0.000812*	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 13:12	
Pyrene	"	**0.0514**	*0.000812*	0.00487	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*19.8%*			*38.8 - 139 %*	"			"	*Z*
2-FBP		*25.6%*			*40 - 132 %*	"			"	*Z*
p-Terphenyl-d14		*75.2%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**				**Sampled: 08/28/09 11:35**				
% Solids	TA SOP	**97.3**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**				**Sampled: 08/28/09 12:10**				
% Solids	TA SOP	**88.4**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-03 (G-BH1-16-082809)		**Soil**				**Sampled: 08/28/09 12:30**				
% Solids	TA SOP	**68.5**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-04 (G-BH2-7.5-082809)		**Soil**				**Sampled: 08/28/09 09:50**				
% Solids	TA SOP	**86.8**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**				**Sampled: 08/28/09 09:15**				
% Solids	TA SOP	**91.1**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-06 (G-BH2-15-082809)		**Soil**				**Sampled: 08/28/09 10:10**				
% Solids	TA SOP	**73.1**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-07 (G-BH3-Surf-082709)		**Soil**				**Sampled: 08/27/09 16:10**				
% Solids	TA SOP	**94.3**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**				**Sampled: 08/27/09 16:45**				
% Solids	TA SOP	**89.4**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-09 (G-BH3-15-082709)		**Soil**				**Sampled: 08/27/09 17:15**				
% Solids	TA SOP	**77.0**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**				**Sampled: 08/27/09 09:50**				
% Solids	TA SOP	**93.3**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**				**Sampled: 08/27/09 10:20**				

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:25

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-11 (G-BH4-7.5-082709)		**Soil**				**Sampled: 08/27/09 10:20**				
% Solids	TA SOP	**92.5**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-12 (G-BH4-15-082709)		**Soil**				**Sampled: 08/27/09 10:15**				
% Solids	TA SOP	**79.8**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-13 (G-BH5-Surf-082709)		**Soil**				**Sampled: 08/27/09 12:40**				
% Solids	TA SOP	**93.4**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**				**Sampled: 08/27/09 13:20**				
% Solids	TA SOP	**88.2**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-15 (G-BH5-15-082709)		**Soil**				**Sampled: 08/27/09 13:45**				
% Solids	TA SOP	**82.1**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090006 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090006-BLK1)									**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/11/09 19:36	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 94.3%*			*Limits: 50-150%*	"							*09/11/09 19:36*	
p-Terphenyl-d14		*119%*			*50-150%*	"							*"*	
LCS (9090006-BS1)									**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	68.2	---	10.0	mg/kg wet	1x	--	83.3	81.8%	(73-133)	--	--	09/11/09 19:59	
Surrogate(s): 2-FBP		*Recovery: 106%*			*Limits: 50-150%*	"							*09/11/09 19:59*	
p-Terphenyl-d14		*118%*			*50-150%*	"							*"*	
Duplicate (9090006-DUP1)					**QC Source: SSH0166-12**				**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	18.1	---	12.5	mg/kg dry	1x	19.2	--	--	--	5.64%	(40)	09/16/09 20:13	
Heavy Oil Range Hydrocarbons	"	ND	---	31.3	"	"	ND	--	--	--	NR	"	"	
Surrogate(s): 2-FBP		*Recovery: 95.9%*			*Limits: 50-150%*	"							*09/16/09 20:13*	
p-Terphenyl-d14		*115%*			*50-150%*	"							*"*	
Matrix Spike (9090006-MS1)					**QC Source: SSH0166-12**				**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	99.5	---	12.5	mg/kg dry	1x	19.2	104	76.9%	(70.1-139)	--	--	09/16/09 20:36	
Surrogate(s): 2-FBP		*Recovery: 97.7%*			*Limits: 50-150%*	"							*09/16/09 20:36*	
p-Terphenyl-d14		*109%*			*50-150%*	"							*"*	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090170 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090170-BLK1)								**Extracted: 09/25/09 14:05**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/28/09 11:04	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 118%*			*Limits: 50-150%*	"							*09/28/09 11:04*	
p-Terphenyl-d14		*138%*			*50-150%*	"							"	
LCS (9090170-BS1)								**Extracted: 09/25/09 14:05**						
Diesel Range Hydrocarbons	NWTPH-Dx	80.0	---	10.0	mg/kg wet	1x	--	83.3	96.0%	(73-133)	--	--	09/28/09 11:28	
Surrogate(s): 2-FBP		*Recovery: 114%*			*Limits: 50-150%*	"							*09/28/09 11:28*	
p-Terphenyl-d14		*138%*			*50-150%*	"							"	
Duplicate (9090170-DUP1)							**QC Source: SSI0135-01**						**Extracted: 09/25/09 14:05**	
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.9	mg/kg dry	1x	ND	--	--	--	NR	(40)	09/28/09 12:40	
Heavy Oil Range Hydrocarbons	"	ND	---	27.3	"	"	ND	--	--	--	NR	"	"	
Surrogate(s): 2-FBP		*Recovery: 120%*			*Limits: 50-150%*	"							*09/28/09 12:40*	
p-Terphenyl-d14		*143%*			*50-150%*	"							"	
Matrix Spike (9090170-MS1)							**QC Source: SSI0135-01**						**Extracted: 09/25/09 14:05**	
Diesel Range Hydrocarbons	NWTPH-Dx	93.8	---	10.9	mg/kg dry	1x	ND	91.1	103%	(70.1-139)	--	--	09/28/09 13:04	
Surrogate(s): 2-FBP		*Recovery: 122%*			*Limits: 50-150%*	"							*09/28/09 13:04*	
p-Terphenyl-d14		*146%*			*50-150%*	"							"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090048 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090048-BLK1)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/11/09 20:50	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:05	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:28	
Surrogate(s): TCX		*Recovery: 85.9%*			*Limits: 27.9-154%*	"							*09/11/09 20:28*	
Decachlorobiphenyl		*90.4%*			*35-157%*	"							"	
Blank (9090048-BLK2)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/11/09 20:50	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:28	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:50	
Surrogate(s): TCX		*Recovery: 54.4%*			*Limits: 27.9-154%*	"							*09/11/09 20:50*	
Decachlorobiphenyl		*60.6%*			*35-157%*	"							"	
LCS (9090048-BS1)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	160	---	10.0	ug/kg wet	1x	--	167	95.9%	(63.1-147)	--	--	09/11/09 21:13	
PCB-1260	"	171	---	10.0	"	"	--	"	103%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 88.3%*			*Limits: 27.9-154%*	"							*09/11/09 21:13*	
Decachlorobiphenyl		*99.8%*			*35-157%*	"							"	
LCS (9090048-BS2)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	110	---	10.0	ug/kg wet	1x	--	167	65.9%	(63.1-147)	--	--	09/11/09 21:36	
PCB-1260	"	127	---	10.0	"	"	--	"	76.4%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 65.7%*			*Limits: 27.9-154%*	"							*09/11/09 21:36*	
Decachlorobiphenyl		*79.5%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090048 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090048-MS1)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	92.8	---	12.9	ug/kg dry	1x	ND	216	43.0%	(50.6-145)	--	--	09/16/09 14:01	M8
PCB-1260	"	90.6	---	12.9	"	"	ND	"	42.0%	(57.6-120)	--	--	"	M8
Surrogate(s): TCX		*Recovery: 81.0%*			*Limits: 27.9-154%*	"							*09/16/09 14:01*	
Decachlorobiphenyl		*70.1%*			*35-157%*	"							"	
Matrix Spike (9090048-MS2)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	91.6	---	12.9	ug/kg dry	1x	ND	216	42.5%	(50.6-145)	--	--	09/16/09 14:24	M8
PCB-1260	"	100	---	12.9	"	"	ND	"	46.5%	(57.6-120)	--	--	"	M8
Surrogate(s): TCX		*Recovery: 57.7%*			*Limits: 27.9-154%*	"							*09/16/09 14:24*	
Decachlorobiphenyl		*57.4%*			*35-157%*	"							"	
Matrix Spike Dup (9090048-MSD1)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	88.7	---	12.9	ug/kg dry	1x	ND	216	41.1%	(50.6-145)	4.56%	(40)	09/16/09 14:46	M8
PCB-1260	"	83.9	---	12.9	"	"	ND	"	38.9%	(57.6-120)	7.71%	(27.4)	"	M8
Surrogate(s): TCX		*Recovery: 75.5%*			*Limits: 27.9-154%*	"							*09/16/09 14:46*	
Decachlorobiphenyl		*66.5%*			*35-157%*	"							"	
Matrix Spike Dup (9090048-MSD2)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	74.0	---	12.9	ug/kg dry	1x	ND	216	34.3%	(50.6-145)	21.2%	(40)	09/16/09 15:09	M8
PCB-1260	"	77.0	---	12.9	"	"	ND	"	35.7%	(57.6-120)	26.4%	(27.4)	"	M8
Surrogate(s): TCX		*Recovery: 72.2%*			*Limits: 27.9-154%*	"							*09/16/09 15:09*	
Decachlorobiphenyl		*66.7%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9080204 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9080204-BLK1)							**Extracted: 08/31/09 13:00**							
1-Methylnapthalene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	08/31/09 18:30	
2-Methylnaphthalene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	0.00178	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (a) pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	0.00311	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (ghi) perylene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	0.00311	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Chrysene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 63.4%*			*Limits: 38.8-139%*	"							*08/31/09 18:30*	
2-FBP		*75.8%*			*40-132%*	"							"	
p-Terphenyl-d14		*125%*			*31.7-179%*	"							"	
LCS (9080204-BS1)							**Extracted: 08/31/09 13:00**							
Chrysene	EPA 8270 mod.	0.338	0.000667	0.00667	mg/kg wet	1x	--	0.444	76.1%	(47.8-120)	--	--	08/31/09 18:51	
Fluorene	"	0.316	0.000667	0.00667	"	"	--	"	71.0%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.410	0.00200	0.00667	"	"	--	"	92.3%	(39.5-120)	--	--	"	
Naphthalene	"	0.288	0.00133	0.00667	"	"	--	"	64.7%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 59.8%*			*Limits: 38.8-139%*	"							*08/31/09 18:51*	
2-FBP		*61.2%*			*40-132%*	"							"	
p-Terphenyl-d14		*84.8%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9080204 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9080204-MS1)					**QC Source: SSH0166-01**				**Extracted: 08/31/09 13:00**					
Chrysene	EPA 8270 mod.	0.298	0.000685	0.00685	mg/kg dry	1x	ND	0.457	65.2%	(31.6-132)	--	--	08/31/09 19:56	
Fluorene	"	0.325	0.000685	0.00685	"	"	ND	"	71.1%	(43.4-123)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.374	0.00206	0.00685	"	"	ND	"	81.9%	(28.3-147)	--	--	"	
Naphthalene	"	0.302	0.00137	0.00685	"	"	ND	"	66.2%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 63.4%*			*Limits: 38.8-139%*	"							*08/31/09 19:56*	
2-FBP		*64.0%*			*40-132%*	"							"	
p-Terphenyl-d14		*75.2%*			*31.7-179%*	"							"	
Matrix Spike Dup (9080204-MSD1)					**QC Source: SSH0166-01**				**Extracted: 08/31/09 13:00**					
Chrysene	EPA 8270 mod.	0.346	0.000685	0.00685	mg/kg dry	1x	ND	0.457	75.8%	(31.6-132)	15.0%	(30.2)	08/31/09 20:17	
Fluorene	"	0.365	0.000685	0.00685	"	"	ND	"	79.9%	(43.4-123)	11.7%	(36)	"	
Indeno (1,2,3-cd) pyrene	"	0.359	0.00206	0.00685	"	"	ND	"	78.7%	(28.3-147)	3.99%	(32.7)	"	
Naphthalene	"	0.327	0.00137	0.00685	"	"	ND	"	71.5%	(30.9-120)	7.70%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 66.6%*			*Limits: 38.8-139%*	"							*08/31/09 20:17*	
2-FBP		*76.0%*			*40-132%*	"							"	
p-Terphenyl-d14		*88.8%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Conventional Chemistry Parameters by APHA/EPA Methods - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090003 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090003-DUP1)					**QC Source: SSH0168-03**				**Extracted: 08/31/09 15:45**					
% Solids	TA SOP	92.2	---	0.0100	% by Weight	1x	92.8	--	--	--	0.649%	(5)	09/01/09 10:39	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Analysis Performed: 8260B-Volatiles 5035 Low Level

Samples: SSH0166-01, SSH0166-02, SSH0166-03, SSH0166-04, SSH0166-05, SSH0166-06, SSH0166-07, SSH0166-08, SSH0166-09, SSH0166-10, SSH0166-11, SSH0166-12, SSH0166-13, SSH0166-14, SSH0166-15

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:25

Notes and Definitions

Report Specific Notes:

A-01	-	Internal Standard recovery was above method limits due to sample matrix effects.
A-01a	-	Internal Standard recovery was below method limits due to sample matrix effects.
I	-	Internal Standard recovery was outside of method limits. Matrix interference was confirmed by reanalysis.
I02	-	Internal Standard recovery was above method limits. Matrix interference was confirmed by reanalysis. A low bias to the analyte result is indicated.
J	-	Estimated value. Analyte detected at a level less than the Reporting Limit (RL) and greater than or equal to the Method Detection Limit (MDL). The user of this data should be aware that this data is of limited reliability.
M8	-	The MS and/or MSD were below the acceptance limits. See Blank Spike (LCS).
N1	-	See case narrative.
RL3	-	Reporting limit raised due to high concentrations of non-target analytes.
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.
Reporting Limits	-	Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.
Electronic Signature	-	Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy.* Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSH0116

CLIENT: Golder Assoc. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. COTE

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE

REQUESTED ANALYSES

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	EPA 8270C SIM	NWTPH Dx	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-BH1-Surf-082809	082809/ 11:35	X	X	X							-01
G-BH1-7.5-082809	082809/ 12:10	X	X	X							-02
G-BH1-15-082809	082809/ 12:30	X	X	X							-03
G-BH2-7.5-082809	082809/ 9:50	X	X	X							-04
G-BH2-Surf-082809	082809/ 9:15	X	X	X							-05
G-BH2-15-082809	082809/ 10:10	X	X	X							-06
G-BH3-Surf-082709	082709/ 4:10	X	X	X							-07
8 G-BH3-7.5-082709	082709/ 4:45	X	X	X							-08
9 G-BH3-15-082709	082709/ 5:15	X	X	X							-09
G-BH4-Surf 950	082709/ 9:50	X	X	X							-10

RELEASED BY: Amanda Cote — DATE: 082809 — TIME: 9:05
PRINT NAME: Amanda COTE — FIRM: GAI

RECEIVED BY: Chris Williams — DATE: 8/28/09 — TIME: 9:05
PRINT NAME: Chris Williams — FIRM: TA Spokane

RELEASED BY: — DATE: — TIME:
PRINT NAME: — FIRM:

RECEIVED BY: — DATE: — TIME:
PRINT NAME: — FIRM:

ADDITIONAL REMARKS:
EPA 8270C incl: naphthalene, 1-methylnaphthalene, 2-methylnaphthalene
PAHs all SIM

TEMP: 5.0°C

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 330701661

CLIENT: GOLDER ASSOC INC

REPORT TO: Douglas Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. COTE

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH-Dx	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-BH4-7.5-082709	082709/10:20		X	X	X							-11
2 G-BH4-15-082709	082709/10:18		X	X	X							-12
3 G-BH5-Surf-082709	082709/12:40		X	X	X							-13
4 G-BH5-7.5-082709	082709/1:20		X	X	X							-14
G-BH5-15-082709	082709/1:45		X	X	X							-15
GBH5-5-082709	082709/1:00		X	X	X							-16
7												
8												
9												
10												

RELEASED BY: [signature] DATE: 082909
PRINT NAME: Amanda Cote FIRM: GAI TIME: 9:05

RECEIVED BY: [signature] DATE: 8/29/09
PRINT NAME: Chris Williams FIRM: TA Spokane TIME: 9:05

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS:
EPA 8270C. inc. naphthalene, 1-methylnaphthalene, 2-methylnathalene
PAHs all SIM

TEMP: 5.6°C

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSH0166 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 8/29/09 905 Cooler signed for by: C. Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☐ same as date received *or* 8/31/09

Cooler opened by (print) C. Hanson (sign)

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☒ CLIENT ☐ Other:

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 0 Signed by _____ Date __/__/__

   Were custody seals unbroken and intact on arrival? ☐ Yes ☒ No

3. Were custody papers sealed in a plastic bag? ☐ Yes ☒ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: frozen

   Temperature by IR Gun 5.6 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: _____

8. Did samples arrive in plastic bags? ☒ Yes ☐ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☒ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 8/31/09

Samples logged in by (print) C. Hanson (sign)

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **#SSH0166**

SAMPLES	Collect:	MATRIX
G-BH1-Surf & 7.5, 16	8-27, 28-09	SOIL BORINGS
BH2- 7.5, Surf, 15		
BH3 -Surf, 7.5, 15		
BH4 -Surf, 7.5, 15		
BH5 -Surf, 7.5, 15		

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA	BNA	Pest / PCB	TPH-Dx	PAH - SIM	OTHER	OTHER
1. Data Completeness							
2. Preservation, Holding Times							
3.GC/MS Tune, Inst. Performance							
4. Calibrations							
5. Surrogates					X (1)		
6. Internal Standards							
7. Lab Blanks, Field Blanks							
8. Lab Duplicates, Field Duplicates							
9. LCS, Blank Spike, MS/MSD							
10.Compound Identification, TICs							
11. Result Verification, D.Limits							
12. Overall Summary							

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Surrog. recoveries x 2 ↓ Assoc. results for ~15 qualif. (J/UJ)

Validated by: [signature] **Date:** Nov. 10, 2009

Reviewed by: **Date:**

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

YES ☑ NO ☐

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ Detection Limits
- ✓ GC/MS Tuning
- ✓ Initial Calibration
- ✓ Continuing Calib.
- ✓ Blank Results
- ✓ Surrogate Results
- ✓ Internal Standards
- ✓ MS/MSD, LCS Results
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ Raw Data
- __Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: _____

2. Holding Times (Check all that apply)..... ☑ ☐

__Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
__BNA samples extracted within 7 days (14 day soil) of collection
__BNA extracts analyzed within 40 days of collection
__Pest/PCBs samples extracted within 7 days (14 day soil) of collection
__Pest/PCBs extracts analyzed within 40 days of collection
Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: Collected: 8/27-28
TPH-Dx Analysis: 9/01 prep < 14 Day ✓
PAHs prep 8/31 < 7 Day ✓
PCB prep 9/09 < 14 Day ✓

3. GC Instrument Tune, Performance Check ..... ☑ ☐

__GC/MS Tuning performed
__GC/MS Tuning within control limits
__GC/MS Tuning out of control limits, (qualify R/UR)
__Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
__PEM resolution <90% adj pks, (J for detects, UR other)
__DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
__Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results: See Calib Section

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☐ ☐

GC/MS Data: __ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
__ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: __RSD<10% for performance checks (If no J detects)
__Stnds analyzed prior to analysis, & at proper frequency
__Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

TPH-Dx RRF✓, R^2=.998✓,
PAH tune 8/31✓, ICAL 8/31 ~~PCP %RSD=75~~ ⊗, ~~Benzo(ghi)perylene 29%~~ ⊗
~~assoc. detects qualif. (J).~~ NO Qual. CCAL ✓ 9/01, Tune ✓, ~~Pebut1~~;
9/02 Tune ✓, RRF ✓ or R^2 ✓, CCAL %D <25 ✓; 9/14 Tune ✓, RRF ✓,
CCAL <25% ✓;

5. Surrogates (Check all that apply)..... ☐ ⊗

__Surrogates analyzed
__Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__Recoveries above Method Control limits (J detects only)
__Recoveries below Method Control limits but>20% (J/UJ)
__Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results SVOA: 9/11 ✓, 9/12 ✓, 9/28 ✓
PCB: 9/11 ✓, 9/14 ✓, 9/15 Low recov for -12, 9/17 Low recov. for -11 and -14 — Single surrog. only NO QUALIF.
PAHs: Batch #80204 Samples -06, -09 Surrog. out of limit but single — NO QUALIF. Smple -15 Low recovery for N.Benz & 2FBP. Assoc. results Qualif. (J/UJ). -14 SAME for select analytes.

⊗

6. Internal Standards Performance..... ☐ ☐

__Internal standards added to all QC and samples
__Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
**Associated with 12 Hour CCV Stnd.*
__Internal standards out of Control limits but >10% (J/UJ)
__Internal standards zero or <10% of Control limits (J/UR)
__Internal standards RTs within +/-20 sec window (If no, J/UJ)

Comments/Qualified Results:

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☑ ☐

__Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

Examples:

	BLANK		SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

TPH-Dx: MB006 (mg/kg) ✓; MB170-

PCB MBlnk0048 ✓; ug/kg.

PAH MBlk 0204 ✓ mg/kg.

8. Duplicate, Field Duplicates (Check all that apply)..... ☑ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results

TPH-Dx #0006 ✓, #0170 ✓
PCB #0048 ✓
PAH #0204 ✓

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply).... ☑ ☐

__LCS %R 80-120%
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: TPH-Dx LCS ✓, Dup ✓, MS ✓ #0006, #0170 - LCS ✓, Dup, MS ✓
PCB - LCS/LCSZ ✓ #0048 MS/MSD (non Assoc.) ✓
PAH - LCS ✓ MS/MSD on Sample - 01 ✓ (#0204).

	Acceptable: Yes	NO
10.Compound Identification, TICs.....	☑	☐

Comments/Qualified Results: _____

11. Result Verification, Detection Limits	☑	☐

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: _____

12. Overall Assessment.....	☑	☐

Comments/Qualified Results: _____

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Data Deliverable Package

Golder Associates, Inc.
Doug Morell
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project: Avery Landing

Project Number: 073-93312-03

Laboratory Work Order: SSH0166

November 9, 2009

Total Pages
990

TestAmerica-Spokane
11922 E. 1st Avenue
Spokane, WA 99206

Phone: (509) 924-9200
Fax: (509)924-9290

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	8/28/2009 to 8/27/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	8/29/2009
Lab:	SSH0166		
NJDEP#:	PA004		

SAMPLE RECEIPT: Samples were received intact, on ice, with custody seals and chain of custody documentation. Cooler(s) were received and the sample temperature(s) were measured at 5.6° C upon receipt at the laboratory.

HOLDING TIMES: All samples were analyzed within holding times.

PROBLEMS ENCOUNTERED: The original NWTPH-Dx result reported for sample SSH0166-06 was ND. The 8270 PAH results for the same sample indicated the sample should have hydrocarbons present. The extracts for this sample were examined from the NWTPH-Dx, 8270 and 8082 analyses. Both the 8270 and 8082 extracts were black indicating the presence of hydrocarbons while the Dx extract remained clear. As a result of this discrepancy, sample SSH0166-06 was re-extracted and is being reported as sample SSH0166-06RE1.

QA/QC CRITERIA: The PCB-1016 and PCB-1260 recoveries in samples 9090048-MS1, -MS2, -MSD1 and –MSD2 were below the acceptance limits for EPA 8082 batch 9090048. See Blank Spike (LCS).

Due to sample matrix effects in samples SSH0166-11, -12, -14 and -15 the surrogate recoveries were below the acceptance limits in batch 9090048 by EPA 8082.

The reporting limit was raised for sample SSH0166-06 in batch 9080204 by EPA 8270 mod. due to high concentrations of non-target analytes.

Due to sample matrix effects in sample SSH0166-06 batch 9080204 by EPA 8270 mod., the p-Terphenyl-d14 recovery was outside the acceptance limits.

The reporting limit was raised for samples SSH0166-07, -09 and -11 in batch 9080204 by EPA 8270 mod. due to high concentrations of non-target analytes.

Due to sample matrix effects in sample SSH0166-09 and -11 the surrogate recovery was below the acceptance limits in batch 9080204 by EPA 8270 mod.

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	8/28/2009 to 8/27/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	8/29/2009
Lab:	SSH0166		
NJDEP#:	PA004		

The Internal Standard associated with 2-FBP, Acenaphthene, Acenaphthylene, Anthracene, Fluoranthene, Fluorene and Phenanthrene in sample SSH0166-11 recovered outside of method limits in batch 9080204 by EPA 8270 mod. Matrix interference was confirmed by reanalysis.

The reporting limit was raised for sample SSH0166-13 in batch SSH0166 by EPA 8270 mod. due to high concentrations of non-target analytes.

The Internal Standard recovery associated with 2-FBP, Acenaphthene, Acenaphthylene, Anthracene, Fluoranthene, Fluorene and Phenanthrene in SSH0166-14, batch 9080204, by EPA 8270 mod. were above method limits. Matrix interference was confirmed by reanalysis. A low bias to the analyte result is indicated.

The Internal Standard recovery associated with Acenaphthylene in SSH0166-14, batch 9080204, by EPA 8270 mod. was above method limits. Matrix interference was confirmed by reanalysis. A low bias to the analyte result is indicated.

OBSERVATIONS: No significant observations were made.

SUBCONTRACTED: Method EPA 8260B was subcontracted to the TestAmerica Tacoma laboratory.

TestAmerica Spokane

Randee Decker
Project Manager

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Analytical Case Narrative
TestAmerica - Spokane, WA

SSH0166

The original NWTPH-Dx result reported for sample SSH0166-06 was ND. The 8270 PAH results for the same sample indicated the sample should have hydrocarbons present. The extracts for this sample were examined from the NWTPH-Dx, 8270 and 8082 analyses. Both the 8270 and 8082 extracts were black indicating the presence of hydrocarbons while the Dx extract remained clear. As a result of this discrepancy, sample SSH0166-06 was re-extracted and is being reported as sample SSH0166-06RE1. This amended report replaces the final report generated on 09/18/09 at 3:17pm.

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Laboratory Analysis Times Report

Semivolatile Petroleum Products by NWTPH-Dx (NWTPH-Dx)

TestAmerica Spokane

SSH0166

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0166-01	G-BH1-Surf-082809	08/28/09 11:35	09/01/09 13:16	09/11/09 20:23
SSH0166-02	G-BH1-7.5-082809	08/28/09 12:10	09/01/09 13:16	09/11/09 20:46
SSH0166-03	G-BH1-16-082809	08/28/09 12:30	09/01/09 13:16	09/11/09 21:10
SSH0166-04	G-BH2-7.5-082809	08/28/09 09:50	09/01/09 13:16	09/11/09 21:33
SSH0166-05	G-BH2-Surf-082809	08/28/09 09:15	09/01/09 13:16	09/11/09 21:57
SSH0166-06RE1	G-BH2-15-082809	08/28/09 10:10	09/01/09 13:16	09/28/09 11:52
SSH0166-07	G-BH3-Surf-082709	08/27/09 16:10	09/01/09 13:16	09/11/09 22:44
SSH0166-08	G-BH3-7.5-082709	08/27/09 16:45	09/01/09 13:16	09/11/09 23:07
SSH0166-09	G-BH3-15-082709	08/27/09 17:15	09/01/09 13:16	09/12/09 00:17
SSH0166-10	G-BH4-Surf-082709	08/27/09 09:50	09/01/09 13:16	09/12/09 00:41
SSH0166-11	G-BH4-7.5-082709	08/27/09 10:20	09/01/09 13:16	09/12/09 01:04
SSH0166-12	G-BH4-15-082709	08/27/09 10:15	09/01/09 13:16	09/12/09 01:28
SSH0166-13	G-BH5-Surf-082709	08/27/09 12:40	09/01/09 13:16	09/12/09 01:51
SSH0166-14	G-BH5-7.5-082709	08/27/09 13:20	09/01/09 13:16	09/12/09 02:15
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	09/01/09 13:16	09/12/09 02:38

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Laboratory Analysis Times Report

Polychlorinated Biphenyls by EPA Method 8082 (EPA 8082)

TestAmerica Spokane

SSH0166

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0166-01	G-BH1-Surf-082809	08/28/09 11:35	09/09/09 09:20	09/11/09 21:36
SSH0166-01	G-BH1-Surf-082809	08/28/09 11:35	09/09/09 09:20	09/11/09 21:58
SSH0166-02	G-BH1-7.5-082809	08/28/09 12:10	09/09/09 09:20	09/11/09 21:58
SSH0166-02	G-BH1-7.5-082809	08/28/09 12:10	09/09/09 09:20	09/11/09 22:21
SSH0166-03	G-BH1-16-082809	08/28/09 12:30	09/09/09 09:20	09/11/09 22:21
SSH0166-03	G-BH1-16-082809	08/28/09 12:30	09/09/09 09:20	09/11/09 22:44
SSH0166-04	G-BH2-7.5-082809	08/28/09 09:50	09/09/09 09:20	09/11/09 22:44
SSH0166-04	G-BH2-7.5-082809	08/28/09 09:50	09/09/09 09:20	09/11/09 23:06
SSH0166-05	G-BH2-Surf-082809	08/28/09 09:15	09/09/09 09:20	09/11/09 23:06
SSH0166-05	G-BH2-Surf-082809	08/28/09 09:15	09/09/09 09:20	09/11/09 23:29
SSH0166-06	G-BH2-15-082809	08/28/09 10:10	09/09/09 09:20	09/11/09 23:29
SSH0166-06	G-BH2-15-082809	08/28/09 10:10	09/09/09 09:20	09/11/09 23:51
SSH0166-07	G-BH3-Surf-082709	08/27/09 16:10	09/09/09 09:20	09/14/09 23:06
SSH0166-07	G-BH3-Surf-082709	08/27/09 16:10	09/09/09 09:20	09/14/09 23:29
SSH0166-08	G-BH3-7.5-082709	08/27/09 16:45	09/09/09 09:20	09/14/09 23:29
SSH0166-08	G-BH3-7.5-082709	08/27/09 16:45	09/09/09 09:20	09/14/09 23:52
SSH0166-09	G-BH3-15-082709	08/27/09 17:15	09/09/09 09:20	09/14/09 23:52
SSH0166-09	G-BH3-15-082709	08/27/09 17:15	09/09/09 09:20	09/15/09 00:14
SSH0166-10	G-BH4-Surf-082709	08/27/09 09:50	09/09/09 09:20	09/15/09 00:14
SSH0166-10	G-BH4-Surf-082709	08/27/09 09:50	09/09/09 09:20	09/15/09 00:37
SSH0166-11	G-BH4-7.5-082709	08/27/09 10:20	09/09/09 09:20	09/17/09 07:17
SSH0166-12	G-BH4-15-082709	08/27/09 10:15	09/09/09 09:20	09/15/09 00:37
SSH0166-12	G-BH4-15-082709	08/27/09 10:15	09/09/09 09:20	09/15/09 00:59
SSH0166-13	G-BH5-Surf-082709	08/27/09 12:40	09/09/09 09:20	09/15/09 00:59
SSH0166-13	G-BH5-Surf-082709	08/27/09 12:40	09/09/09 09:20	09/15/09 01:22
SSH0166-14	G-BH5-7.5-082709	08/27/09 13:20	09/09/09 09:20	09/17/09 07:40
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	09/09/09 09:20	09/15/09 01:22
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	09/09/09 09:20	09/15/09 01:45
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	09/09/09 09:20	09/15/09 02:30

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/01/09 11:30

Laboratory Analysis Times Report

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring (EPA 8270 mod.)

TestAmerica Spokane

SSH0166

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0166-01	G-BH1-Surf-082809	08/28/09 11:35	08/31/09 13:00	08/31/09 19:34
SSH0166-02	G-BH1-7.5-082809	08/28/09 12:10	08/31/09 13:00	09/01/09 08:11
SSH0166-03	G-BH1-16-082809	08/28/09 12:30	08/31/09 13:00	09/01/09 08:32
SSH0166-04	G-BH2-7.5-082809	08/28/09 09:50	08/31/09 13:00	09/01/09 09:15
SSH0166-05	G-BH2-Surf-082809	08/28/09 09:15	08/31/09 13:00	09/15/09 18:31
SSH0166-06	G-BH2-15-082809	08/28/09 10:10	08/31/09 13:00	09/01/09 13:33
SSH0166-07	G-BH3-Surf-082709	08/27/09 16:10	08/31/09 13:00	09/02/09 18:18
SSH0166-08	G-BH3-7.5-082709	08/27/09 16:45	08/31/09 13:00	09/01/09 09:58
SSH0166-09	G-BH3-15-082709	08/27/09 17:15	08/31/09 13:00	09/15/09 17:05
SSH0166-10	G-BH4-Surf-082709	08/27/09 09:50	08/31/09 13:00	09/15/09 07:03
SSH0166-11	G-BH4-7.5-082709	08/27/09 10:20	08/31/09 13:00	09/15/09 17:48
SSH0166-12	G-BH4-15-082709	08/27/09 10:15	08/31/09 13:00	09/01/09 09:36
SSH0166-13	G-BH5-Surf-082709	08/27/09 12:40	08/31/09 13:00	09/01/09 12:50
SSH0166-14	G-BH5-7.5-082709	08/27/09 13:20	08/31/09 13:00	09/01/09 14:37
SSH0166-14	G-BH5-7.5-082709	08/27/09 13:20	08/31/09 13:00	09/01/09 16:54
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	08/31/09 13:00	09/01/09 13:12

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Laboratory Analysis Times Report

Conventional Chemistry Parameters by APHA/EPA Methods (TA SOP)

TestAmerica Spokane

SSH0166

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0166-01	G-BH1-Surf-082809	08/28/09 11:35	08/31/09 15:45	09/01/09 10:39
SSH0166-02	G-BH1-7.5-082809	08/28/09 12:10	08/31/09 15:45	09/01/09 10:39
SSH0166-03	G-BH1-16-082809	08/28/09 12:30	08/31/09 15:45	09/01/09 10:39
SSH0166-04	G-BH2-7.5-082809	08/28/09 09:50	08/31/09 15:45	09/01/09 10:39
SSH0166-05	G-BH2-Surf-082809	08/28/09 09:15	08/31/09 15:45	09/01/09 10:39
SSH0166-06	G-BH2-15-082809	08/28/09 10:10	08/31/09 15:45	09/01/09 10:39
SSH0166-07	G-BH3-Surf-082709	08/27/09 16:10	08/31/09 15:45	09/01/09 10:39
SSH0166-08	G-BH3-7.5-082709	08/27/09 16:45	08/31/09 15:45	09/01/09 10:39
SSH0166-09	G-BH3-15-082709	08/27/09 17:15	08/31/09 15:45	09/01/09 10:39
SSH0166-10	G-BH4-Surf-082709	08/27/09 09:50	08/31/09 15:45	09/01/09 10:39
SSH0166-11	G-BH4-7.5-082709	08/27/09 10:20	08/31/09 15:45	09/01/09 10:39
SSH0166-12	G-BH4-15-082709	08/27/09 10:15	08/31/09 15:45	09/01/09 10:39
SSH0166-13	G-BH5-Surf-082709	08/27/09 12:40	08/31/09 15:45	09/01/09 10:39
SSH0166-14	G-BH5-7.5-082709	08/27/09 13:20	08/31/09 15:45	09/01/09 10:39
SSH0166-15	G-BH5-15-082709	08/27/09 13:45	08/31/09 15:45	09/01/09 10:39

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-BH1-Surf-082809	SSH0166-01	Soil	08/28/09 11:35	08/29/09 09:05
G-BH1-7.5-082809	SSH0166-02	Soil	08/28/09 12:10	08/29/09 09:05
G-BH1-16-082809	SSH0166-03	Soil	08/28/09 12:30	08/29/09 09:05
G-BH2-7.5-082809	SSH0166-04	Soil	08/28/09 09:50	08/29/09 09:05
G-BH2-Surf-082809	SSH0166-05	Soil	08/28/09 09:15	08/29/09 09:05
G-BH2-15-082809	SSH0166-06	Soil	08/28/09 10:10	08/29/09 09:05
G-BH3-Surf-082709	SSH0166-07	Soil	08/27/09 16:10	08/29/09 09:05
G-BH3-7.5-082709	SSH0166-08	Soil	08/27/09 16:45	08/29/09 09:05
G-BH3-15-082709	SSH0166-09	Soil	08/27/09 17:15	08/29/09 09:05
G-BH4-Surf-082709	SSH0166-10	Soil	08/27/09 09:50	08/29/09 09:05
G-BH4-7.5-082709	SSH0166-11	Soil	08/27/09 10:20	08/29/09 09:05
G-BH4-15-082709	SSH0166-12	Soil	08/27/09 10:15	08/29/09 09:05
G-BH5-Surf-082709	SSH0166-13	Soil	08/27/09 12:40	08/29/09 09:05
G-BH5-7.5-082709	SSH0166-14	Soil	08/27/09 13:20	08/29/09 09:05
G-BH5-15-082709	SSH0166-15	Soil	08/27/09 13:45	08/29/09 09:05

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSH0116

CLIENT: Golder Assoc. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. COTE/

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: 10 STD | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH DX	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-BH1-Surf-082809	082809/ 11:35		X	X	X							-01
2 G-BH1-7.5-082809	082809/ 12:10		X	X	X							-02
3 G-BH1-15-082809	082809/ 12:30		X	X	X							-03
4 G-BH2-7.5-082809	082809/ 9:50		X	X	X							-04
5 G-BH2-Surf-082809	082809/ 9:15		X	X	X							-05
6 G-BH2-15-082809	082809/ 10:10		X	X	X							-06
7 G-BH3-Surf-082709	082709/ 4:10		X	X	X							-07
8 G-BH3-7.5-082709	082709/ 4:45		X	X	X							-08
9 G-BH3-15-082709	082709/ 5:15		X	X	X							-09
10 G-BH4-Surf-Dup	082709/ 9:50		X	X	X							-10

RELEASED BY: A. Cote
PRINT NAME: Amanda COTE FIRM: GAI DATE: 082909 TIME: 9:05

RECEIVED BY: Chris Williams
PRINT NAME: FIRM: TA-Spokane DATE: 8/29/09 TIME: 9:05

RELEASED BY:
PRINT NAME: FIRM: DATE: TIME:

RECEIVED BY:
PRINT NAME: FIRM: DATE: TIME:

ADDITIONAL REMARKS:
EPA 8270C incl: naphthalene, 1-methylnaphthalene, 2-methylnaphthalene
PAHs all SIM

TEMP: 5.0°C

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 330701661

CLIENT: GOLDER ASSOC INC

REPORT TO: Douglas Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. Cote

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: ~~10~~ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE

REQUESTED ANALYSES

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	EPA 8270C SIM	NWTPH-Dx	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	G-BH4-7.5-082709	082709/10:20	X	X	X							-11
2	G-BH4-15-082709	082709/10:15	X	X	X							-12
3	G-BH5-Surf-082709	082709/12:40	X	X	X							-13
4	G-BH5-7.5-082709	082709/1:20	X	X	X							-14
5	G-BH5-15-082709	082709/1:45	X	X	X							-15
6	G-BH5-5-082709	082709/1:50	X	X	X							-16
7												
8												
9												
10												

RELEASED BY: [signature] DATE: 082909
PRINT NAME: Amanda Cote FIRM: GAI TIME: 9:05

RECEIVED BY: [signature] DATE: 8/29/09
PRINT NAME: Chris Williams FIRM: TA-Spokane TIME: 9:05

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS:
EPA 8270C. incl. naphthalene, 1-methylnaphthalene, 2-methylnaphthalene
PAHs on SIM

TEMP: 5.6°C

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSH0166 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 8/29/09 905 Cooler signed for by: C. Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☐ same as date received *or* 8/31/09

Cooler opened by (print) C. Hanson (sign)

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☒ CLIENT ☐ Other:

Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 0 Signed by _____ Date __/__/__

Were custody seals unbroken and intact on arrival? ☐ Yes ☒ No

3. Were custody papers sealed in a plastic bag? ☐ Yes ☒ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: Frozen

Temperature by IR Gun 5.6 °C Thermometer Serial # 81500

Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: _____

8. Did samples arrive in plastic bags? ☒ Yes ☐ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☒ N/A ☐ Yes ☐ No

If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 8/31/09

Samples logged in by (print) C. Hanson (sign)

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00480	mg/kg dry	1x	9080204	08/31/09 13:00	08/31/09 19:34	
2-Methylnaphthalene	"	ND	----	0.00480	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00480	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00480	"	"	"	"	"	
Anthracene	"	ND	----	0.00480	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00480	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00480	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00480	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00480	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00480	"	"	"	"	"	
Chrysene	"	ND	----	0.00480	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00480	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00480	"	"	"	"	"	
Fluorene	"	ND	----	0.00480	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00480	"	"	"	"	"	
Naphthalene	"	ND	----	0.00480	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00480	"	"	"	"	"	
Pyrene	"	ND	----	0.00480	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*69.8%*			*38.8 - 139 %*	"			"	
2-FBP		*66.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*99.6%*			*31.7 - 179 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00452	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:11	
2-Methylnaphthalene	"	ND	----	0.00452	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00452	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00452	"	"	"	"	"	
Anthracene	"	ND	----	0.00452	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00452	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00452	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00452	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00452	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00452	"	"	"	"	"	
Chrysene	"	ND	----	0.00452	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00452	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00452	"	"	"	"	"	
Fluorene	"	ND	----	0.00452	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00452	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
Naphthalene	EPA 8270 mod.	ND	----	0.00452	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:11	
Phenanthrene	"	ND	----	0.00452	"	"	"	"	"	
Pyrene	"	ND	----	0.00452	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*74.6%*			*38.8 - 139 %*	"			"	
2-FBP		*63.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*120%*			*31.7 - 179 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
1-Methylnapthalene	EPA 8270 mod.	**0.0279**	----	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 08:32	
2-Methylnaphthalene	"	**0.00779**	----	0.00487	"	"	"	"	"	
Acenaphthene	"	**0.00584**	----	0.00487	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00487	"	"	"	"	"	
Anthracene	"	ND	----	0.00487	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00487	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00487	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00487	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00487	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00487	"	"	"	"	"	
Chrysene	"	ND	----	0.00487	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00487	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00487	"	"	"	"	"	
Fluorene	"	ND	----	0.00487	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00487	"	"	"	"	"	
Naphthalene	"	**0.00908**	----	0.00487	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00487	"	"	"	"	"	
Pyrene	"	ND	----	0.00487	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*52.0%*			*38.8 - 139 %*	"			"	
2-FBP		*49.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*65.4%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
1-Methylnapthalene	EPA 8270 mod.	**0.00973**	----	0.00461	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:15	
2-Methylnaphthalene	"	**0.0159**	----	0.00461	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00461	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00461	"	"	"	"	"	
Anthracene	"	ND	----	0.00461	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00461**	----	0.00461	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00512**	----	0.00461	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0138**	----	0.00461	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00563**	----	0.00461	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00461	"	"	"	"	"	
Chrysene	"	**0.0102**	----	0.00461	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00461	"	"	"	"	"	
Fluoranthene	"	**0.00922**	----	0.00461	"	"	"	"	"	
Fluorene	"	ND	----	0.00461	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00461	"	"	"	"	"	
Naphthalene	"	**0.00768**	----	0.00461	"	"	"	"	"	
Phenanthrene	"	**0.00973**	----	0.00461	"	"	"	"	"	
Pyrene	"	**0.0164**	----	0.00461	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*59.8%*			*38.8 - 139 %*	"			"	
2-FBP		*65.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*85.0%*			*31.7 - 179 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00476	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 18:31	
2-Methylnaphthalene	"	ND	----	0.00476	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00476	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00476	"	"	"	"	"	
Anthracene	"	ND	----	0.00476	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00585**	----	0.00476	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00732**	----	0.00476	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0102**	----	0.00476	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0107**	----	0.00476	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00476	"	"	"	"	"	
Chrysene	"	**0.00634**	----	0.00476	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00927**	----	0.00476	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00476	"	"	"	"	"	
Fluorene	"	ND	----	0.00476	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00829**	----	0.00476	"	"	"	"	"	
Naphthalene	"	ND	----	0.00476	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
Phenanthrene	EPA 8270 mod.	ND	----	0.00476	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 18:31	
Pyrene	"	**0.00781**	----	0.00476	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*67.4%*			*38.8 - 139 %*	"			"	
2-FBP		*63.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*107%*			*31.7 - 179 %*	"			"	
SSH0166-06 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.811**	----	0.0109	mg/kg dry	2x	9080204	08/31/09 13:00	09/01/09 13:33	
2-Methylnaphthalene	"	**0.570**	----	0.0109	"	"	"	"	"	
Acenaphthene	"	**0.368**	----	0.0109	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.0109	"	"	"	"	"	
Anthracene	"	ND	----	0.0109	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0426**	----	0.0109	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0146**	----	0.0109	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.0109	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0243**	----	0.0109	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0109	"	"	"	"	"	
Chrysene	"	**0.0839**	----	0.0109	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.0109	"	"	"	"	"	
Fluoranthene	"	**0.0511**	----	0.0109	"	"	"	"	"	
Fluorene	"	**0.512**	----	0.0109	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0109**	----	0.0109	"	"	"	"	"	
Naphthalene	"	**0.260**	----	0.0109	"	"	"	"	"	
Phenanthrene	"	**0.786**	----	0.0109	"	"	"	"	"	
Pyrene	"	**0.440**	----	0.0109	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*134%*			*38.8 - 139 %*	"			"	
2-FBP		*72.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*211%*			*31.7 - 179 %*	"			"	*ZX*
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00848	mg/kg dry	2x	9080204	08/31/09 13:00	09/02/09 18:18	
2-Methylnaphthalene	"	ND	----	0.00848	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00848	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00848	"	"	"	"	"	
Anthracene	"	ND	----	0.00848	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00848	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00848	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00848	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0160**	----	0.00848	mg/kg dry	2x	9080204	08/31/09 13:00	09/02/09 18:18	
Benzo (k) fluoranthene	"	ND	----	0.00848	"	"	"	"	"	
Chrysene	"	ND	----	0.00848	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00848	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00848	"	"	"	"	"	
Fluorene	"	ND	----	0.00848	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00848	"	"	"	"	"	
Naphthalene	"	ND	----	0.00848	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00848	"	"	"	"	"	
Pyrene	"	ND	----	0.00848	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*53.6%*			*38.8 - 139 %*	"			"	
2-FBP		*53.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*81.6%*			*31.7 - 179 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.00547**	----	0.00485	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:58	
2-Methylnaphthalene	"	**0.00795**	----	0.00485	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00485	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00485	"	"	"	"	"	
Anthracene	"	ND	----	0.00485	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00485	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00497**	----	0.00485	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00646**	----	0.00485	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00597**	----	0.00485	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00485	"	"	"	"	"	
Chrysene	"	**0.00895**	----	0.00485	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00485	"	"	"	"	"	
Fluoranthene	"	**0.00994**	----	0.00485	"	"	"	"	"	
Fluorene	"	ND	----	0.00485	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00485	"	"	"	"	"	
Naphthalene	"	ND	----	0.00485	"	"	"	"	"	
Phenanthrene	"	**0.0104**	----	0.00485	"	"	"	"	"	
Pyrene	"	**0.00994**	----	0.00485	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*52.6%*			*38.8 - 139 %*	"			"	
2-FBP		*52.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*86.4%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.149**	-----	0.00519	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 17:05	
2-Methylnaphthalene	"	**0.0358**	-----	0.00519	"	"	"	"	"	
Acenaphthene	"	**0.0381**	-----	0.00519	"	"	"	"	"	**A-01**
Acenaphthylene	"	ND	-----	0.00519	"	"	"	"	"	**A-01**
Anthracene	"	**0.108**	-----	0.00519	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0306**	-----	0.00519	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0139**	-----	0.00519	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00519	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00981**	-----	0.00519	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.0208**	-----	0.00519	"	"	"	"	"	
Chrysene	"	**0.0491**	-----	0.00519	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00808**	-----	0.00519	"	"	"	"	"	
Fluoranthene	"	**0.0294**	-----	0.00519	"	"	"	"	"	
Fluorene	"	**0.0531**	-----	0.00519	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	**0.00750**	-----	0.00519	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00519	"	"	"	"	"	
Phenanthrene	"	**0.231**	-----	0.00519	"	"	"	"	"	
Pyrene	"	**0.107**	-----	0.00519	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*83.6%*			*38.8 - 139 %*	"			"	
2-FBP		*36.0%*			*40 - 132 %*	"			"	*A-01, Z*
p-Terphenyl-d14		*64.2%*			*31.7 - 179 %*	"			"	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00429	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 07:03	
2-Methylnaphthalene	"	ND	-----	0.00429	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00429	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00429	"	"	"	"	"	
Anthracene	"	ND	-----	0.00429	"	"	"	"	"	**A-01a**
Benzo (a) anthracene	"	**0.0114**	-----	0.00429	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0129**	-----	0.00429	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0324**	-----	0.00429	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00905**	-----	0.00429	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00429	"	"	"	"	"	
Chrysene	"	**0.0100**	-----	0.00429	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00476**	-----	0.00429	"	"	"	"	"	
Fluoranthene	"	**0.00762**	-----	0.00429	"	"	"	"	"	**A-01a**
Fluorene	"	ND	-----	0.00429	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00667**	-----	0.00429	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00429	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
Phenanthrene	EPA 8270 mod.	ND	----	0.00429	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 07:03	**A-01a**
Pyrene	"	**0.0224**	----	0.00429	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*60.0%*			*38.8 - 139 %*	"			"	
2-FBP		*67.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*110%*			*31.7 - 179 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**1.74**	----	0.00865	mg/kg dry	2x	9080204	08/31/09 13:00	09/15/09 17:48	
2-Methylnaphthalene	"	**1.60**	----	0.00865	"	"	"	"	"	
Acenaphthene	"	**0.168**	----	0.00865	"	"	"	"	"	I
Acenaphthylene	"	ND	----	0.00865	"	"	"	"	"	I
Anthracene	"	**0.615**	----	0.00865	"	"	"	"	"	I
Benzo (a) anthracene	"	**0.0778**	----	0.00865	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0413**	----	0.00865	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0471**	----	0.00865	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0211**	----	0.00865	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00865	"	"	"	"	"	
Chrysene	"	**0.196**	----	0.00865	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00865	"	"	"	"	"	
Fluoranthene	"	**0.153**	----	0.00865	"	"	"	"	"	I
Fluorene	"	**0.280**	----	0.00865	"	"	"	"	"	I
Indeno (1,2,3-cd) pyrene	"	**0.00865**	----	0.00865	"	"	"	"	"	
Naphthalene	"	ND	----	0.00865	"	"	"	"	"	
Phenanthrene	"	**1.64**	----	0.00865	"	"	"	"	"	I
Pyrene	"	**0.146**	----	0.00865	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*236%*			*38.8 - 139 %*	"			"	*ZX*
2-FBP		*21.2%*			*40 - 132 %*	"			"	*I*
p-Terphenyl-d14		*98.4%*			*31.7 - 179 %*	"			"	*ZX*
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00459	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:36	
2-Methylnaphthalene	"	ND	----	0.00459	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00459	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00459	"	"	"	"	"	
Anthracene	"	ND	----	0.00459	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00459	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00459	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00459	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
Benzo (ghi) perylene	EPA 8270 mod.	ND	----	0.00459	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 09:36	
Benzo (k) fluoranthene	"	ND	----	0.00459	"	"	"	"	"	
Chrysene	"	ND	----	0.00459	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00459	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00459	"	"	"	"	"	
Fluorene	"	ND	----	0.00459	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00459	"	"	"	"	"	
Naphthalene	"	ND	----	0.00459	"	"	"	"	"	
Phenanthrene	"	**0.00501**	----	0.00459	"	"	"	"	"	
Pyrene	"	ND	----	0.00459	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*58.8%*			*38.8 - 139 %*	"			"	
2-FBP		*57.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*70.4%*			*31.7 - 179 %*	"			"	
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00999	mg/kg dry	2x	9080204	08/31/09 13:00	09/01/09 12:50	
2-Methylnaphthalene	"	ND	----	0.00999	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00999	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00999	"	"	"	"	"	
Anthracene	"	ND	----	0.00999	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00999	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0133**	----	0.00999	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0257**	----	0.00999	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0200**	----	0.00999	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00999	"	"	"	"	"	
Chrysene	"	**0.0114**	----	0.00999	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00999	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00999	"	"	"	"	"	
Fluorene	"	ND	----	0.00999	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0124**	----	0.00999	"	"	"	"	"	
Naphthalene	"	ND	----	0.00999	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00999	"	"	"	"	"	
Pyrene	"	**0.0238**	----	0.00999	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*65.6%*			*38.8 - 139 %*	"			"	
2-FBP		*61.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*178%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
1-Methylnapthalene	EPA 8270 mod.	**4.04**	----	0.0529	mg/kg dry	10x	9080204	08/31/09 13:00	09/01/09 16:54	
2-Methylnaphthalene	"	**5.21**	----	0.0529	"	"	"	"	"	
Acenaphthene	"	**0.347** J	----	0.0106	"	2x	"	"	09/01/09 14:37	I02
Acenaphthylene	"	ND UJ	----	0.0106	"	"	"	"	"	I02
Anthracene	"	**0.315** J	----	0.0106	"	"	"	"	"	I02
Benzo (a) anthracene	"	**0.0413**	----	0.0106	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0171**	----	0.0106	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.0106	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0151**	----	0.0106	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0106	"	"	"	"	"	
Chrysene	"	**0.0816**	----	0.0106	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.0106	"	"	"	"	"	
Fluoranthene	"	**0.0826**	----	0.0106	"	"	"	"	"	I02
Fluorene	"	**0.545**	----	0.0106	"	"	"	"	"	I02
Indeno (1,2,3-cd) pyrene	"	ND	----	0.0106	"	"	"	"	"	
Naphthalene	"	**0.504**	----	0.0106	"	"	"	"	"	
Phenanthrene	"	**0.802**	----	0.0106	"	"	"	"	"	I02
Pyrene	"	**0.494**	----	0.0106	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*107%*			*38.8 - 139 %*	"			"	
2-FBP		*44.8%*			*40 - 132 %*	"			"	*I02*
p-Terphenyl-d14		*223%*			*31.7 - 179 %*	"			"	*ZX*
SSH0166-15 (G-BH5-15-082709)		**Soil** G			**Sampled: 08/27/09 13:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.0769** J	----	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 13:12	
2-Methylnaphthalene	"	**0.0628** ↓	----	0.00487	"	"	"	"	"	
Acenaphthene	"	**0.0271**	----	0.00487	"	"	"	"	"	
Acenaphthylene	"	ND UJ	----	0.00487	"	"	"	"	"	
Anthracene	"	**0.0173** J	----	0.00487	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00595** J	----	0.00487	"	"	"	"	"	
Benzo (a) pyrene	"	ND UJ	----	0.00487	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND UJ	----	0.00487	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00487** J	----	0.00487	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND UJ	----	0.00487	"	"	"	"	"	
Chrysene	"	**0.0146** J	----	0.00487	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND UJ	----	0.00487	"	"	"	"	"	
Fluoranthene	"	**0.0146** J	----	0.00487	"	"	"	"	"	
Fluorene	"	**0.0401** J	----	0.00487	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND UJ	----	0.00487	"	"	"	"	"	
Naphthalene	"	**0.0541** J	----	0.00487	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-15 (G-BH5-15-082709)		**Soil**				**Sampled: 08/27/09 13:45**				
Phenanthrene	EPA 8270 mod.	**0.0487** J	----	0.00487	mg/kg dry	1x	9080204	08/31/09 13:00	09/01/09 13:12	
Pyrene	"	**0.0514** J	----	0.00487	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*19.8%*			*38.8 - 139 %*	"			"	Z
2-FBP		*25.6%*			*40 - 132 %*	"			"	Z
p-Terphenyl-d14		*75.2%*			*31.7 - 179 %*	"			"	

11-10-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
% Solids	TA SOP	**97.3**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
% Solids	TA SOP	**88.4**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
% Solids	TA SOP	**68.5**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
% Solids	TA SOP	**86.8**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
% Solids	TA SOP	**91.1**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-06 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
% Solids	TA SOP	**73.1**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					
% Solids	TA SOP	**94.3**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
% Solids	TA SOP	**89.4**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					
% Solids	TA SOP	**77.0**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
% Solids	TA SOP	**93.3**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-11 (G-BH4-7.5-082709)		**Soil**				**Sampled: 08/27/09 10:20**				
% Solids	TA SOP	**92.5**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-12 (G-BH4-15-082709)		**Soil**				**Sampled: 08/27/09 10:15**				
% Solids	TA SOP	**79.8**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-13 (G-BH5-Surf-082709)		**Soil**				**Sampled: 08/27/09 12:40**				
% Solids	TA SOP	**93.4**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**				**Sampled: 08/27/09 13:20**				
% Solids	TA SOP	**88.2**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0166-15 (G-BH5-15-082709)		**Soil**				**Sampled: 08/27/09 13:45**				
% Solids	TA SOP	**82.1**	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
PCB-1016	EPA 8082	ND	----	9.87	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 21:58	
PCB-1221	"	ND	----	9.87	"	"	"	"	09/11/09 21:36	
PCB-1232	"	ND	----	9.87	"	"	"	"	"	
PCB-1242	"	ND	----	9.87	"	"	"	"	"	
PCB-1248	"	ND	----	9.87	"	"	"	"	"	
PCB-1254	"	ND	----	9.87	"	"	"	"	"	
PCB-1260	"	ND	----	9.87	"	"	"	"	09/11/09 21:58	
Surrogate(s): *TCX*		*65.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*57.2%*			*35 - 157 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
PCB-1016	EPA 8082	ND	----	9.95	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 22:21	
PCB-1221	"	ND	----	9.95	"	"	"	"	09/11/09 21:58	
PCB-1232	"	ND	----	9.95	"	"	"	"	"	
PCB-1242	"	ND	----	9.95	"	"	"	"	"	
PCB-1248	"	ND	----	9.95	"	"	"	"	"	
PCB-1254	"	ND	----	9.95	"	"	"	"	"	
PCB-1260	"	ND	----	9.95	"	"	"	"	09/11/09 22:21	
Surrogate(s): *TCX*		*96.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*93.6%*			*35 - 157 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
PCB-1016	EPA 8082	ND	----	9.93	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 22:44	
PCB-1221	"	ND	----	9.93	"	"	"	"	09/11/09 22:21	
PCB-1232	"	ND	----	9.93	"	"	"	"	"	
PCB-1242	"	ND	----	9.93	"	"	"	"	"	
PCB-1248	"	ND	----	9.93	"	"	"	"	"	
PCB-1254	"	ND	----	9.93	"	"	"	"	"	
PCB-1260	"	ND	----	9.93	"	"	"	"	09/11/09 22:44	
Surrogate(s): *TCX*		*74.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*76.8%*			*35 - 157 %*	"			"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
PCB-1016	EPA 8082	ND	----	9.68	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:06	
PCB-1221	"	ND	----	9.68	"	"	"	"	09/11/09 22:44	
PCB-1232	"	ND	----	9.68	"	"	"	"	"	
PCB-1242	"	ND	----	9.68	"	"	"	"	"	
PCB-1248	"	ND	----	9.68	"	"	"	"	"	
PCB-1254	"	ND	----	9.68	"	"	"	"	"	
PCB-1260	"	ND	----	9.68	"	"	"	"	09/11/09 23:06	
Surrogate(s): TCX		*81.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*78.1%*			*35 - 157 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
PCB-1016	EPA 8082	ND	----	9.66	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:29	
PCB-1221	"	ND	----	9.66	"	"	"	"	09/11/09 23:06	
PCB-1232	"	ND	----	9.66	"	"	"	"	"	
PCB-1242	"	ND	----	9.66	"	"	"	"	"	
PCB-1248	"	ND	----	9.66	"	"	"	"	"	
PCB-1254	"	ND	----	9.66	"	"	"	"	"	
PCB-1260	"	ND	----	9.66	"	"	"	"	09/11/09 23:29	
Surrogate(s): TCX		*96.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*69.6%*			*35 - 157 %*	"			"	
SSH0166-06 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
PCB-1016	EPA 8082	ND	----	9.85	ug/kg dry	1x	9090048	09/09/09 09:20	09/11/09 23:51	
PCB-1221	"	ND	----	9.85	"	"	"	"	09/11/09 23:29	
PCB-1232	"	ND	----	9.85	"	"	"	"	"	
PCB-1242	"	ND	----	9.85	"	"	"	"	"	
PCB-1248	"	ND	----	9.85	"	"	"	"	"	
PCB-1254	"	ND	----	9.85	"	"	"	"	"	
PCB-1260	"	ND	----	9.85	"	"	"	"	09/11/09 23:51	
Surrogate(s): TCX		*76.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*39.8%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					
PCB-1016	EPA 8082	ND	----	9.76	ug/kg dry	1x	9090048	09/09/09 09:20	09/14/09 23:29	
PCB-1221	"	ND	----	9.76	"	"	"	"	09/14/09 23:06	
PCB-1232	"	ND	----	9.76	"	"	"	"	"	
PCB-1242	"	ND	----	9.76	"	"	"	"	"	
PCB-1248	"	ND	----	9.76	"	"	"	"	"	
PCB-1254	"	ND	----	9.76	"	"	"	"	"	
PCB-1260	"	ND	----	9.76	"	"	"	"	09/14/09 23:29	
Surrogate(s): *TCX*		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*61.2%*			*35 - 157 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
PCB-1016	EPA 8082	ND	----	9.84	ug/kg dry	1x	9090048	09/09/09 09:20	09/14/09 23:52	
PCB-1221	"	ND	----	9.84	"	"	"	"	09/14/09 23:29	
PCB-1232	"	ND	----	9.84	"	"	"	"	"	
PCB-1242	"	ND	----	9.84	"	"	"	"	"	
PCB-1248	"	ND	----	9.84	"	"	"	"	"	
PCB-1254	"	ND	----	9.84	"	"	"	"	"	
PCB-1260	"	ND	----	9.84	"	"	"	"	09/14/09 23:52	
Surrogate(s): *TCX*		*73.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*63.9%*			*35 - 157 %*	"			"	
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					
PCB-1016	EPA 8082	ND	----	9.87	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:14	
PCB-1221	"	ND	----	9.87	"	"	"	"	09/14/09 23:52	
PCB-1232	"	ND	----	9.87	"	"	"	"	"	
PCB-1242	"	ND	----	9.87	"	"	"	"	"	
PCB-1248	"	ND	----	9.87	"	"	"	"	"	
PCB-1254	"	ND	----	9.87	"	"	"	"	"	
PCB-1260	"	ND	----	9.87	"	"	"	"	09/15/09 00:14	
Surrogate(s): *TCX*		*70.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*67.9%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 11:30

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
PCB-1016	EPA 8082	ND	----	9.86	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:37	
PCB-1221	"	ND	----	9.86	"	"	"	"	09/15/09 00:14	
PCB-1232	"	ND	----	9.86	"	"	"	"	"	
PCB-1242	"	ND	----	9.86	"	"	"	"	"	
PCB-1248	"	ND	----	9.86	"	"	"	"	"	
PCB-1254	"	ND	----	9.86	"	"	"	"	"	
PCB-1260	"	ND	----	9.86	"	"	"	"	09/15/09 00:37	
Surrogate(s): *TCX*		*88.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*65.2%*			*35 - 157 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					
PCB-1016	EPA 8082	ND	----	9.95	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 07:17	
PCB-1221	"	ND	----	9.95	"	"	"	"	"	
PCB-1232	"	ND	----	9.95	"	"	"	"	"	
PCB-1242	"	ND	----	9.95	"	"	"	"	"	
PCB-1248	"	ND	----	9.95	"	"	"	"	"	
PCB-1254	"	ND	----	9.95	"	"	"	"	"	
PCB-1260	"	ND	----	9.95	"	"	"	"	"	
Surrogate(s): *TCX*		*102%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*21.0%*			*35 - 157 %*	"			"	Z
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
PCB-1016	EPA 8082	ND	----	9.52	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 00:59	
PCB-1221	"	ND	----	9.52	"	"	"	"	09/15/09 00:37	
PCB-1232	"	ND	----	9.52	"	"	"	"	"	
PCB-1242	"	ND	----	9.52	"	"	"	"	"	
PCB-1248	"	ND	----	9.52	"	"	"	"	"	
PCB-1254	"	ND	----	9.52	"	"	"	"	"	
PCB-1260	"	ND	----	9.52	"	"	"	"	09/15/09 00:59	
Surrogate(s): *TCX*		*32.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*34.8%*			*35 - 157 %*	"			"	Z

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					
PCB-1016	EPA 8082	ND	----	9.85	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 01:22	
PCB-1221	"	ND	----	9.85	"	"	"	"	09/15/09 00:59	
PCB-1232	"	ND	----	9.85	"	"	"	"	"	
PCB-1242	"	ND	----	9.85	"	"	"	"	"	
PCB-1248	"	ND	----	9.85	"	"	"	"	"	
PCB-1254	"	ND	----	9.85	"	"	"	"	"	
PCB-1260	"	ND	----	9.85	"	"	"	"	09/15/09 01:22	
Surrogate(s): *TCX*		*85.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*58.8%*			*35 - 157 %*	"			"	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
PCB-1016	EPA 8082	ND	----	9.98	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 07:40	
PCB-1221	"	ND	----	9.98	"	"	"	"	"	
PCB-1232	"	ND	----	9.98	"	"	"	"	"	
PCB-1242	"	ND	----	9.98	"	"	"	"	"	
PCB-1248	"	ND	----	9.98	"	"	"	"	"	
PCB-1254	"	ND	----	9.98	"	"	"	"	"	
PCB-1260	"	ND	----	9.98	"	"	"	"	"	
Surrogate(s): *TCX*		*60.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*23.0%*			*35 - 157 %*	"			"	Z
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
PCB-1016	EPA 8082	ND	----	9.74	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:30	
PCB-1221	"	ND	----	9.74	"	"	"	"	09/15/09 01:22	
PCB-1232	"	ND	----	9.74	"	"	"	"	"	
PCB-1242	"	ND	----	9.74	"	"	"	"	"	
PCB-1248	"	ND	----	9.74	"	"	"	"	"	
PCB-1254	"	ND	----	9.74	"	"	"	"	"	
PCB-1260	"	ND	----	9.74	"	"	"	"	09/15/09 02:30	
Surrogate(s): *TCX*		*61.3%*			*27.9 - 154 %*	"			*09/15/09 01:45*	
Decachlorobiphenyl		*49.2%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-01 (G-BH1-Surf-082809)		**Soil**			**Sampled: 08/28/09 11:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**37.8**	----	10.3	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 20:23	
Heavy Oil Range Hydrocarbons	"	**349**	----	25.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.4%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*103%*		*50 - 150 %*	"			"	
SSH0166-02 (G-BH1-7.5-082809)		**Soil**			**Sampled: 08/28/09 12:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	113	mg/kg dry	10x	9090006	09/01/09 13:16	09/11/09 20:46	
Heavy Oil Range Hydrocarbons	"	**201**	----	170	"	"	"	"	"	
Surrogate(s): 2-FBP			*104%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*123%*		*50 - 150 %*	"			"	
SSH0166-03 (G-BH1-16-082809)		**Soil**			**Sampled: 08/28/09 12:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	**262**	----	14.6	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:10	
Heavy Oil Range Hydrocarbons	"	**96.4**	----	36.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*114%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*110%*		*50 - 150 %*	"			"	
SSH0166-04 (G-BH2-7.5-082809)		**Soil**			**Sampled: 08/28/09 09:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	11.5	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:33	
Heavy Oil Range Hydrocarbons	"	ND	----	28.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*113%*		*50 - 150 %*	"			"	
SSH0166-05 (G-BH2-Surf-082809)		**Soil**			**Sampled: 08/28/09 09:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	11.0	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 21:57	
Heavy Oil Range Hydrocarbons	"	**60.1**	----	27.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*97.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSH0166-06RE1 (G-BH2-15-082809)		**Soil**			**Sampled: 08/28/09 10:10**					**N1**
Diesel Range Hydrocarbons	NWTPH-Dx	**20.7**	----	13.7	mg/kg dry	1x	9090170	09/01/09 13:16	09/28/09 11:52	
Heavy Oil Range Hydrocarbons	"	**50.7**	----	34.2	"	"	"	"	"	
Surrogate(s): 2-FBP			*88.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*129%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-07 (G-BH3-Surf-082709)		**Soil**			**Sampled: 08/27/09 16:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	21.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 22:44	
Heavy Oil Range Hydrocarbons	"	**91.1**	-----	53.0	"	"	"	"	"	
Surrogate(s): 2-FBP		*97.0%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*116%*			*50 - 150 %*	"			"	
SSH0166-08 (G-BH3-7.5-082709)		**Soil**			**Sampled: 08/27/09 16:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	**12.2**	-----	11.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/11/09 23:07	
Heavy Oil Range Hydrocarbons	"	**37.5**	-----	28.0	"	"	"	"	"	
Surrogate(s): 2-FBP		*97.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*119%*			*50 - 150 %*	"			"	
SSH0166-09 (G-BH3-15-082709)		**Soil**			**Sampled: 08/27/09 17:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**601**	-----	26.0	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 00:17	
Heavy Oil Range Hydrocarbons	"	**345**	-----	64.9	"	"	"	"	"	
Surrogate(s): 2-FBP		*113%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*116%*			*50 - 150 %*	"			"	
SSH0166-10 (G-BH4-Surf-082709)		**Soil**			**Sampled: 08/27/09 09:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	21.4	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 00:41	
Heavy Oil Range Hydrocarbons	"	**68.6**	-----	53.6	"	"	"	"	"	
Surrogate(s): 2-FBP		*95.3%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*117%*			*50 - 150 %*	"			"	
SSH0166-11 (G-BH4-7.5-082709)		**Soil**			**Sampled: 08/27/09 10:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**2380**	-----	108	mg/kg dry	5x	9090006	09/01/09 13:16	09/12/09 01:04	
Heavy Oil Range Hydrocarbons	"	**1360**	-----	270	"	"	"	"	"	
Surrogate(s): 2-FBP		*108%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*64.2%*			*50 - 150 %*	"			"	
SSH0166-12 (G-BH4-15-082709)		**Soil**			**Sampled: 08/27/09 10:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**19.2**	-----	12.5	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 01:28	
Heavy Oil Range Hydrocarbons	"	ND	-----	31.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*98.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*119%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Amended Report

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 11:30

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0166-13 (G-BH5-Surf-082709)		**Soil**			**Sampled: 08/27/09 12:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**30.1**	----	21.4	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 01:51	
Heavy Oil Range Hydrocarbons	"	**201**	----	53.5	"	"	"	"	"	
Surrogate(s): *2-FBP*			*89.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*106%*		*50 - 150 %*	"			"	
SSH0166-14 (G-BH5-7.5-082709)		**Soil**			**Sampled: 08/27/09 13:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1060**	----	45.4	mg/kg dry	2x	9090006	09/01/09 13:16	09/12/09 02:15	
Heavy Oil Range Hydrocarbons	"	**703**	----	113	"	"	"	"	"	
Surrogate(s): *2-FBP*			*117%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*107%*		*50 - 150 %*	"			"	
SSH0166-15 (G-BH5-15-082709)		**Soil**			**Sampled: 08/27/09 13:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	**109**	----	12.2	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 02:38	
Heavy Oil Range Hydrocarbons	"	**170**	----	30.5	"	"	"	"	"	
Surrogate(s): *2-FBP*			*90.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*102%*		*50 - 150 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Amended Report

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

January 11, 2010

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 08/29/09 09:05. The following list is a summary of the Work Orders contained in this report, generated on 01/11/10 11:27.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSH0168	Avery Landing	073-93312-03

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
GTP1-10.5-082709	SSH0168-01	Soil	08/27/09 09:40	08/29/09 09:05
GTP1-13.5-082709	SSH0168-02	Soil	08/27/09 10:10	08/29/09 09:05
GTP3-3.5-082709	SSH0168-03	Soil	08/27/09 14:15	08/29/09 09:05
GTP3-5-082709	SSH0168-04	Soil	08/27/09 14:35	08/29/09 09:05
GTP3-13.5-082709	SSH0168-05	Soil	08/27/09 14:49	08/29/09 09:05
GTP4-2.5-082709	SSH0168-06	Soil	08/27/09 15:40	08/29/09 09:05
GTP4-8.0-082709	SSH0168-07	Soil	08/27/09 15:59	08/29/09 09:05
GTP5-3.0-082709	SSH0168-09	Soil	08/27/09 16:40	08/29/09 09:05
GTP5-7.0-082709	SSH0168-10	Soil	08/27/09 16:53	08/29/09 09:05
GTP6-10-082809	SSH0168-11	Soil	08/28/09 10:36	08/29/09 09:05
GTP6-2.5-082809	SSH0168-12	Soil	08/28/09 10:10	08/29/09 09:05
GTP6-17-082809	SSH0168-13	Soil	08/28/09 11:11	08/29/09 09:05
GTP7-2.5-082809	SSH0168-14	Soil	08/28/09 12:50	08/29/09 09:05
GTP7-10.0-082809	SSH0168-15	Soil	08/28/09 13:27	08/29/09 09:05
GTP7-18-082809	SSH0168-16	Soil	08/28/09 13:58	08/29/09 09:05
GTP2-2.5-082709	SSH0168-17	Soil	08/27/09 11:40	08/29/09 09:05
GTP2-8-082709	SSH0168-18	Soil	08/27/09 11:58	08/29/09 09:05
GTP2-13-082709	SSH0168-19	Soil	08/27/09 17:28	08/29/09 09:05
GTP1-2.5-082709	SSH0168-20	Soil	08/27/09 09:20	08/29/09 09:05
GTP5-11-082809	SSH0168-21	Soil	08/28/09 09:37	08/29/09 09:05
TS-COMP-1	SSH0168-22	Soil	08/27/09 18:10	08/29/09 09:05
TS-COMP-2	SSH0168-23	Soil	08/27/09 18:28	08/29/09 09:05
TS-COMP-3	SSH0168-24	Soil	08/27/09 16:40	08/29/09 09:05
GTP4-6.0-082709	SSH0168-25	Soil	08/27/09 15:49	08/29/09 09:05

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**8670**	-----	316	mg/kg dry	10x	9090006	09/01/09 13:16	09/12/09 03:02	
Heavy Oil Range Hydrocarbons	"	**12800**	-----	791	"	"	"	"	"	
Surrogate(s): 2-FBP			*175%*		*50 - 150 %*	"			"	***Z3***
p-Terphenyl-d14			*99.7%*		*50 - 150 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1630**	-----	229	mg/kg dry	10x	9090006	09/01/09 13:16	09/12/09 03:25	
Heavy Oil Range Hydrocarbons	"	**2900**	-----	571	"	"	"	"	"	
Surrogate(s): 2-FBP			*101%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*96.7%*		*50 - 150 %*	"			"	
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**44.2**	-----	10.8	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 03:49	
Heavy Oil Range Hydrocarbons	"	**209**	-----	26.9	"	"	"	"	"	
Surrogate(s): 2-FBP			*93.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*111%*		*50 - 150 %*	"			"	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**770**	-----	69.2	mg/kg dry	5x	9090006	09/01/09 13:16	09/16/09 20:13	
Heavy Oil Range Hydrocarbons	"	**999**	-----	173	"	"	"	"	"	
Surrogate(s): 2-FBP			*75.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*117%*		*50 - 150 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Diesel Range Hydrocarbons	NWTPH-Dx	**23.7**	-----	12.9	mg/kg dry	1x	9090006	09/01/09 13:16	09/16/09 12:14	
Heavy Oil Range Hydrocarbons	"	**61.4**	-----	32.3	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*106%*		*50 - 150 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**25.6**	-----	10.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 20:46	
Heavy Oil Range Hydrocarbons	"	**145**	-----	26.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*94.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*101%*		*50 - 150 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	16.1	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:10	
Heavy Oil Range Hydrocarbons	"	ND	-----	40.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*84.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*97.5%*		*50 - 150 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	16.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:33	
Heavy Oil Range Hydrocarbons	"	ND	-----	41.9	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*105%*		*50 - 150 %*	"			"	
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Diesel Range Hydrocarbons	NWTPH-Dx	**774**	-----	31.0	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:57	
Heavy Oil Range Hydrocarbons	"	**1090**	-----	77.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*87.7%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*184%*		*50 - 150 %*	"			"	***ZX***
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Diesel Range Hydrocarbons	NWTPH-Dx	**9660**	-----	471	mg/kg dry	20x	9090027	09/04/09 10:38	09/11/09 22:20	
Heavy Oil Range Hydrocarbons	"	**3150**	-----	1180	"	"	"	"	"	
Surrogate(s): 2-FBP			*453%*		*50 - 150 %*	"			"	***Z3***
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	11.4	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 22:44	
Heavy Oil Range Hydrocarbons	"	ND	-----	28.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*86.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*102%*		*50 - 150 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Diesel Range Hydrocarbons	NWTPH-Dx	**431**	-----	46.3	mg/kg dry	2x	9090027	09/04/09 10:38	09/11/09 23:07	
Heavy Oil Range Hydrocarbons	"	**1200**	-----	116	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.7%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*259%*		*50 - 150 %*	"			"	***ZX***

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	15.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 23:31	
Heavy Oil Range Hydrocarbons	"	**42.2**	-----	39.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*107%*		*50 - 150 %*	"			"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Diesel Range Hydrocarbons	NWTPH-Dx	**23.4**	-----	10.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 00:41	
Heavy Oil Range Hydrocarbons	"	**182**	-----	26.2	"	"	"	"	"	
Surrogate(s): 2-FBP			*88.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*98.2%*		*50 - 150 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	16.9	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:04	
Heavy Oil Range Hydrocarbons	"	ND	-----	42.3	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*105%*		*50 - 150 %*	"			"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**24.7**	-----	11.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:28	
Heavy Oil Range Hydrocarbons	"	**252**	-----	29.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*91.7%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*99.8%*		*50 - 150 %*	"			"	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	11.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:51	
Heavy Oil Range Hydrocarbons	"	ND	-----	28.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*83.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*102%*		*50 - 150 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	12.7	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 02:15	
Heavy Oil Range Hydrocarbons	"	ND	-----	31.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*78.4%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*92.1%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**452**	-----	17.2	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 02:38	
Heavy Oil Range Hydrocarbons	"	**3830**	-----	1080	"	25x	"	"	09/15/09 18:02	
Surrogate(s): 2-FBP			*77.4%*		*50 - 150 %*	*1x*			*09/12/09 02:38*	
p-Terphenyl-d14			*83.5%*		*50 - 150 %*	"			"	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Diesel Range Hydrocarbons	NWTPH-Dx	**342**	-----	43.6	mg/kg dry	4x	9090027	09/04/09 10:38	09/12/09 03:02	
Heavy Oil Range Hydrocarbons	"	**985**	-----	109	"	"	"	"	"	
Surrogate(s): 2-FBP			*12.5%*		*50 - 150 %*	"			"	*Z3*
p-Terphenyl-d14			*17.4%*		*50 - 150 %*	"			"	*Z3*
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**763**	-----	11.7	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 03:25	
Heavy Oil Range Hydrocarbons	"	**263**	-----	29.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*111%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*93.7%*		*50 - 150 %*	"			"	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	**2120**	-----	18.6	mg/kg dry	1x	9090043	09/08/09 18:28	09/13/09 13:45	
Heavy Oil Range Hydrocarbons	"	**1090**	-----	46.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*122%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*105%*		*50 - 150 %*	"			"	
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1790**	-----	34.8	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 20:36	
Heavy Oil Range Hydrocarbons	"	**2050**	-----	87.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*110%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*115%*		*50 - 150 %*	"			"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Diesel Range Hydrocarbons	NWTPH-Dx	**11.3**	-----	10.7	mg/kg dry	1x	9090043	09/08/09 18:28	09/13/09 14:10	
Heavy Oil Range Hydrocarbons	"	**41.9**	-----	26.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*79.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*105%*		*50 - 150 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
PCB-1016	EPA 8082	ND	-----	9.81	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 08:02	
PCB-1221	"	ND	-----	9.81	"	"	"	"	"	
PCB-1232	"	ND	-----	9.81	"	"	"	"	"	
PCB-1242	"	ND	-----	9.81	"	"	"	"	"	
PCB-1248	"	ND	-----	9.81	"	"	"	"	"	
PCB-1254	"	ND	-----	9.81	"	"	"	"	"	
PCB-1260	"	ND	-----	9.81	"	"	"	"	"	
Surrogate(s): TCX		*58.2%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*41.9%*			*35 - 157 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
PCB-1016	EPA 8082	ND	-----	9.60	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:07	
PCB-1221	"	ND	-----	9.60	"	"	"	"	09/15/09 01:45	
PCB-1232	"	ND	-----	9.60	"	"	"	"	"	
PCB-1242	"	ND	-----	9.60	"	"	"	"	"	
PCB-1248	"	ND	-----	9.60	"	"	"	"	"	
PCB-1254	"	ND	-----	9.60	"	"	"	"	"	
PCB-1260	"	ND	-----	9.60	"	"	"	"	09/15/09 02:07	
Surrogate(s): TCX		*78.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*18.9%*			*35 - 157 %*	"			"	***Z***
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
PCB-1016	EPA 8082	ND	-----	9.91	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:07	
PCB-1221	"	ND	-----	9.91	"	"	"	"	"	
PCB-1232	"	ND	-----	9.91	"	"	"	"	"	
PCB-1242	"	ND	-----	9.91	"	"	"	"	"	
PCB-1248	"	ND	-----	9.91	"	"	"	"	"	
PCB-1254	"	ND	-----	9.91	"	"	"	"	"	
PCB-1260	"	ND	-----	9.91	"	"	"	"	"	
Surrogate(s): TCX		*83.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*60.0%*			*35 - 157 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
PCB-1016	EPA 8082	ND	-----	9.96	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:52	
PCB-1221	"	ND	-----	9.96	"	"	"	"	09/15/09 02:30	
PCB-1232	"	ND	-----	9.96	"	"	"	"	"	
PCB-1242	"	ND	-----	9.96	"	"	"	"	"	
PCB-1248	"	ND	-----	9.96	"	"	"	"	"	
PCB-1254	"	ND	-----	9.96	"	"	"	"	"	
PCB-1260	"	ND	-----	9.96	"	"	"	"	09/15/09 02:52	
Surrogate(s): TCX		*46.8%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*31.4%*			*35 - 157 %*	"			"	*Z*
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
PCB-1016	EPA 8082	ND	-----	9.83	ug/kg dry	1x	9090048	09/09/09 09:20	09/16/09 13:15	
PCB-1221	"	ND	-----	9.83	"	"	"	"	"	
PCB-1232	"	ND	-----	9.83	"	"	"	"	"	
PCB-1242	"	ND	-----	9.83	"	"	"	"	"	
PCB-1248	"	ND	-----	9.83	"	"	"	"	"	
PCB-1254	"	ND	-----	9.83	"	"	"	"	"	
PCB-1260	"	ND	-----	9.83	"	"	"	"	09/16/09 13:38	
Surrogate(s): TCX		*71.3%*			*27.9 - 154 %*	"			*09/16/09 13:15*	
Decachlorobiphenyl		*73.3%*			*35 - 157 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
PCB-1016	EPA 8082	ND	-----	9.70	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 20:23	
PCB-1221	"	ND	-----	9.70	"	"	"	"	"	
PCB-1232	"	ND	-----	9.70	"	"	"	"	"	
PCB-1242	"	ND	-----	9.70	"	"	"	"	"	
PCB-1248	"	ND	-----	9.70	"	"	"	"	"	
PCB-1254	"	ND	-----	9.70	"	"	"	"	"	
PCB-1260	"	**18.5**	-----	9.70	"	"	"	"	"	
Surrogate(s): TCX		*103%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*101%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
PCB-1016	EPA 8082	ND	-----	9.85	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 20:46	
PCB-1221	"	ND	-----	9.85	"	"	"	"	"	
PCB-1232	"	ND	-----	9.85	"	"	"	"	"	
PCB-1242	"	ND	-----	9.85	"	"	"	"	"	
PCB-1248	"	ND	-----	9.85	"	"	"	"	"	
PCB-1254	"	ND	-----	9.85	"	"	"	"	"	
PCB-1260	"	ND	-----	9.85	"	"	"	"	"	
Surrogate(s): *TCX*		*81.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*87.4%*			*35 - 157 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
PCB-1016	EPA 8082	ND	-----	9.84	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:08	
PCB-1221	"	ND	-----	9.84	"	"	"	"	"	
PCB-1232	"	ND	-----	9.84	"	"	"	"	"	
PCB-1242	"	ND	-----	9.84	"	"	"	"	"	
PCB-1248	"	ND	-----	9.84	"	"	"	"	"	
PCB-1254	"	ND	-----	9.84	"	"	"	"	"	
PCB-1260	"	ND	-----	9.84	"	"	"	"	"	
Surrogate(s): *TCX*		*26.7%*			*27.9 - 154 %*	"			"	***Z***
Decachlorobiphenyl		*23.3%*			*35 - 157 %*	"			"	***Z***
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
PCB-1016	EPA 8082	ND	-----	12.4	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:31	
PCB-1221	"	ND	-----	12.4	"	"	"	"	"	
PCB-1232	"	ND	-----	12.4	"	"	"	"	"	
PCB-1242	"	ND	-----	12.4	"	"	"	"	"	
PCB-1248	"	ND	-----	12.4	"	"	"	"	"	
PCB-1254	"	ND	-----	12.4	"	"	"	"	"	
PCB-1260	"	ND	-----	12.4	"	"	"	"	"	
Surrogate(s): *TCX*		*68.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*61.3%*			*35 - 157 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
PCB-1016	EPA 8082	ND	-----	9.42	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:54	
PCB-1221	"	ND	-----	9.42	"	"	"	"	"	
PCB-1232	"	ND	-----	9.42	"	"	"	"	"	
PCB-1242	"	ND	-----	9.42	"	"	"	"	"	
PCB-1248	"	ND	-----	9.42	"	"	"	"	"	
PCB-1254	"	ND	-----	9.42	"	"	"	"	"	
PCB-1260	"	ND	-----	9.42	"	"	"	"	"	
Surrogate(s): TCX		*67.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*29.5%*			*35 - 157 %*	"			"	*Z*
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
PCB-1016	EPA 8082	ND	-----	9.56	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 22:16	
PCB-1221	"	ND	-----	9.56	"	"	"	"	"	
PCB-1232	"	ND	-----	9.56	"	"	"	"	"	
PCB-1242	"	ND	-----	9.56	"	"	"	"	"	
PCB-1248	"	ND	-----	9.56	"	"	"	"	"	
PCB-1254	"	ND	-----	9.56	"	"	"	"	"	
PCB-1260	"	ND	-----	9.56	"	"	"	"	"	
Surrogate(s): TCX		*78.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*85.5%*			*35 - 157 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
PCB-1016	EPA 8082	ND	-----	9.88	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 22:39	
PCB-1221	"	ND	-----	9.88	"	"	"	"	"	
PCB-1232	"	ND	-----	9.88	"	"	"	"	"	
PCB-1242	"	ND	-----	9.88	"	"	"	"	"	
PCB-1248	"	ND	-----	9.88	"	"	"	"	"	
PCB-1254	"	ND	-----	9.88	"	"	"	"	"	
PCB-1260	"	ND	-----	9.88	"	"	"	"	"	
Surrogate(s): TCX		*48.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*39.8%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
PCB-1016	EPA 8082	ND	-----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:01	
PCB-1221	"	ND	-----	9.69	"	"	"	"	"	
PCB-1232	"	ND	-----	9.69	"	"	"	"	"	
PCB-1242	"	ND	-----	9.69	"	"	"	"	"	
PCB-1248	"	ND	-----	9.69	"	"	"	"	"	
PCB-1254	"	ND	-----	9.69	"	"	"	"	"	
PCB-1260	"	ND	-----	9.69	"	"	"	"	"	
Surrogate(s): TCX		*91.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*79.5%*			*35 - 157 %*	"			"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
PCB-1016	EPA 8082	ND	-----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:23	
PCB-1221	"	ND	-----	9.63	"	"	"	"	"	
PCB-1232	"	ND	-----	9.63	"	"	"	"	"	
PCB-1242	"	ND	-----	9.63	"	"	"	"	"	
PCB-1248	"	ND	-----	9.63	"	"	"	"	"	
PCB-1254	"	ND	-----	9.63	"	"	"	"	"	
PCB-1260	"	ND	-----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*85.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*86.1%*			*35 - 157 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
PCB-1016	EPA 8082	ND	-----	9.93	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:46	
PCB-1221	"	ND	-----	9.93	"	"	"	"	"	
PCB-1232	"	ND	-----	9.93	"	"	"	"	"	
PCB-1242	"	ND	-----	9.93	"	"	"	"	"	
PCB-1248	"	ND	-----	9.93	"	"	"	"	"	
PCB-1254	"	ND	-----	9.93	"	"	"	"	"	
PCB-1260	"	ND	-----	9.93	"	"	"	"	"	
Surrogate(s): TCX		*97.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*98.7%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
PCB-1016	EPA 8082	ND	-----	9.89	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 09:56	
PCB-1221	"	ND	-----	9.89	"	"	"	"	"	
PCB-1232	"	ND	-----	9.89	"	"	"	"	"	
PCB-1242	"	ND	-----	9.89	"	"	"	"	"	
PCB-1248	"	ND	-----	9.89	"	"	"	"	"	
PCB-1254	"	ND	-----	9.89	"	"	"	"	"	
PCB-1260	"	**22.3**	-----	9.89	"	"	"	"	"	
Surrogate(s): TCX		*67.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*124%*			*35 - 157 %*	"			"	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
PCB-1016	EPA 8082	ND	-----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 10:18	
PCB-1221	"	ND	-----	9.69	"	"	"	"	"	
PCB-1232	"	ND	-----	9.69	"	"	"	"	"	
PCB-1242	"	ND	-----	9.69	"	"	"	"	"	
PCB-1248	"	ND	-----	9.69	"	"	"	"	"	
PCB-1254	"	ND	-----	9.69	"	"	"	"	"	
PCB-1260	"	ND	-----	9.69	"	"	"	"	"	
Surrogate(s): TCX		*85.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*75.4%*			*35 - 157 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
PCB-1016	EPA 8082	ND	-----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 10:41	
PCB-1221	"	ND	-----	9.63	"	"	"	"	"	
PCB-1232	"	ND	-----	9.63	"	"	"	"	"	
PCB-1242	"	ND	-----	9.63	"	"	"	"	"	
PCB-1248	"	ND	-----	9.63	"	"	"	"	"	
PCB-1254	"	ND	-----	9.63	"	"	"	"	"	
PCB-1260	"	ND	-----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*70.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*70.4%*			*35 - 157 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
PCB-1016	EPA 8082	ND	-----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 13:35	
PCB-1221	"	ND	-----	9.63	"	"	"	"	"	
PCB-1232	"	ND	-----	9.63	"	"	"	"	"	
PCB-1242	"	ND	-----	9.63	"	"	"	"	"	
PCB-1248	"	ND	-----	9.63	"	"	"	"	"	
PCB-1254	"	ND	-----	9.63	"	"	"	"	"	
PCB-1260	"	ND	-----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*55.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*28.1%*			*35 - 157 %*	"			"	*Z*
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
PCB-1016	EPA 8082	ND	-----	9.59	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 13:58	
PCB-1221	"	ND	-----	9.59	"	"	"	"	"	
PCB-1232	"	ND	-----	9.59	"	"	"	"	"	
PCB-1242	"	ND	-----	9.59	"	"	"	"	"	
PCB-1248	"	ND	-----	9.59	"	"	"	"	"	
PCB-1254	"	ND	-----	9.59	"	"	"	"	"	
PCB-1260	"	ND	-----	9.59	"	"	"	"	"	
Surrogate(s): TCX		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*50.9%*			*35 - 157 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
PCB-1016	EPA 8082	ND	-----	9.79	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 14:21	
PCB-1221	"	ND	-----	9.79	"	"	"	"	"	
PCB-1232	"	ND	-----	9.79	"	"	"	"	"	
PCB-1242	"	ND	-----	9.79	"	"	"	"	"	
PCB-1248	"	ND	-----	9.79	"	"	"	"	"	
PCB-1254	"	ND	-----	9.79	"	"	"	"	"	
PCB-1260	"	**12.8**	-----	9.79	"	"	"	"	"	
Surrogate(s): TCX		*78.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*42.5%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
PCB-1016	EPA 8082	ND	-----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 16:13	
PCB-1221	"	ND	-----	9.69	"	"	"	"	09/17/09 15:51	
PCB-1232	"	ND	-----	9.69	"	"	"	"	"	
PCB-1242	"	ND	-----	9.69	"	"	"	"	"	
PCB-1248	"	ND	-----	9.69	"	"	"	"	"	
PCB-1254	"	ND	-----	9.69	"	"	"	"	"	
PCB-1260	"	ND	-----	9.69	"	"	"	"	09/17/09 16:13	
Surrogate(s): *TCX*		*68.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*18.2%*			*35 - 157 %*	"			"	*Z*
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
PCB-1016	EPA 8082	ND	-----	9.76	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 16:36	
PCB-1221	"	ND	-----	9.76	"	"	"	"	09/17/09 16:13	
PCB-1232	"	ND	-----	9.76	"	"	"	"	"	
PCB-1242	"	ND	-----	9.76	"	"	"	"	"	
PCB-1248	"	ND	-----	9.76	"	"	"	"	"	
PCB-1254	"	ND	-----	9.76	"	"	"	"	"	
PCB-1260	"	**26.5**	-----	9.76	"	"	"	"	09/17/09 16:36	
Surrogate(s): *TCX*		*126%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*10.5%*			*35 - 157 %*	"			"	*Z*
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
PCB-1016	EPA 8082	ND	-----	9.86	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 14:43	
PCB-1221	"	ND	-----	9.86	"	"	"	"	"	
PCB-1232	"	ND	-----	9.86	"	"	"	"	"	
PCB-1242	"	ND	-----	9.86	"	"	"	"	"	
PCB-1248	"	ND	-----	9.86	"	"	"	"	"	
PCB-1254	"	ND	-----	9.86	"	"	"	"	"	
PCB-1260	"	ND	-----	9.86	"	"	"	"	"	
Surrogate(s): *TCX*		*78.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*68.4%*			*35 - 157 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	*0.0119*	0.0831	mg/kg dry	5x	9090010	09/02/09 09:02	09/02/09 17:57	
2-Methylnaphthalene	"	ND	*0.0119*	0.0831	"	"	"	"	"	
Acenaphthene	"	**0.498**	*0.0119*	0.0831	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0119*	0.0831	"	"	"	"	"	
Anthracene	"	**1.55**	*0.0119*	0.0831	"	"	"	"	"	
Benzo (a) anthracene	"	**0.348**	*0.0119*	0.0831	"	"	"	"	"	
Benzo (a) pyrene	"	**0.301**	*0.0119*	0.0831	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.0237*	0.0831	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.459**	*0.0356*	0.0831	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.0119*	0.0831	"	"	"	"	"	
Chrysene	"	**0.989**	*0.0119*	0.0831	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.245**	*0.0237*	0.0831	"	"	"	"	"	
Fluoranthene	"	**0.150**	*0.0119*	0.0831	"	"	"	"	"	
Fluorene	"	**1.41**	*0.0119*	0.0831	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.277**	*0.0356*	0.0831	"	"	"	"	"	
Naphthalene	"	**0.427**	*0.0237*	0.0831	"	"	"	"	"	
Phenanthrene	"	**0.894**	*0.0119*	0.0831	"	"	"	"	"	
Pyrene	"	**2.25**	*0.0119*	0.0831	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*68.0%*			*38.8 - 139 %*	"		"		
2-FBP		*37.0%*			*40 - 132 %*	"		"		***Z3***
p-Terphenyl-d14		*132%*			*31.7 - 179 %*	"		"		
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
1-Methylnapthalene	EPA 8270 mod.	**0.0579**	*0.000762*	0.00495	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 19:13	
2-Methylnaphthalene	"	ND	*0.000762*	0.00495	"	"	"	"	"	
Acenaphthene	"	**0.00508**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Acenaphthylene	"	ND	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Anthracene	"	**0.198**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Benzo (a) anthracene	"	**0.0737**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Benzo (a) pyrene	"	**0.0259**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Benzo (b) fluoranthene	"	**0.0518**	*0.00152*	0.00495	"	"	"	"	"	**Ia**
Benzo (ghi) perylene	"	**0.0345**	*0.00229*	0.00495	"	"	"	"	"	**Ia**
Benzo (k) fluoranthene	"	ND	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Chrysene	"	**0.168**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Dibenzo (a,h) anthracene	"	**0.0290**	*0.00152*	0.00495	"	"	"	"	"	**Ia**
Fluoranthene	"	**0.0452**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Fluorene	"	**0.0853**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Indeno (1,2,3-cd) pyrene	"	**0.0269**	*0.00229*	0.00495	"	"	"	"	"	**Ia**
Naphthalene	"	**0.0818**	*0.00152*	0.00495	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Phenanthrene	EPA 8270 mod.	**0.0635**	*0.000762*	0.00495	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 19:13	**Ia**
Pyrene	"	**0.396**	*0.000762*	0.00495	"	"	"	"	"	**Ia**
Surrogate(s): Nitrobenzene-d5			*114%*		*38.8 - 139 %*	"			"	
2-FBP			*28.0%*		*40 - 132 %*	"			"	***Ia, Z***
p-Terphenyl-d14			*151%*		*31.7 - 179 %*	"			"	***Ia***
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000718*	0.00467	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 02:47	
2-Methylnaphthalene	"	**0.00287**	*0.000718*	0.00467	"	"	"	"	"	**J**
Acenaphthene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Anthracene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00431**	*0.000718*	0.00467	"	"	"	"	"	**J**
Benzo (b) fluoranthene	"	**0.00958**	*0.00144*	0.00467	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0105**	*0.00216*	0.00467	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Chrysene	"	**0.00670**	*0.000718*	0.00467	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00287**	*0.00144*	0.00467	"	"	"	"	"	**J**
Fluoranthene	"	**0.00527**	*0.000718*	0.00467	"	"	"	"	"	
Fluorene	"	ND	*0.000718*	0.00467	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00862**	*0.00216*	0.00467	"	"	"	"	"	
Naphthalene	"	ND	*0.00144*	0.00467	"	"	"	"	"	
Phenanthrene	"	**0.00527**	*0.000718*	0.00467	"	"	"	"	"	
Pyrene	"	**0.0101**	*0.000718*	0.00467	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*74.4%*		*38.8 - 139 %*	"			"	
2-FBP			*81.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*106%*		*31.7 - 179 %*	"			"	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.0105**	*0.000922*	0.00645	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:35	
2-Methylnaphthalene	"	**0.0105**	*0.000922*	0.00645	"	"	"	"	"	
Acenaphthene	"	**0.00492**	*0.000922*	0.00645	"	"	"	"	"	**J**
Acenaphthylene	"	ND	*0.000922*	0.00645	"	"	"	"	"	
Anthracene	"	**0.805**	*0.000922*	0.00645	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0295**	*0.000922*	0.00645	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0350**	*0.000922*	0.00645	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0627**	*0.00184*	0.00645	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0541**	*0.00277*	0.00645	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:35	
Benzo (k) fluoranthene	"	ND	*0.000922*	0.00645	"	"	"	"	"	
Chrysene	"	**0.0725**	*0.000922*	0.00645	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0154**	*0.00184*	0.00645	"	"	"	"	"	
Fluoranthene	"	**0.141**	*0.000922*	0.00645	"	"	"	"	"	
Fluorene	"	**0.00984**	*0.000922*	0.00645	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0264**	*0.00277*	0.00645	"	"	"	"	"	
Naphthalene	"	**0.00430**	*0.00184*	0.00645	"	"	"	"	"	**J**
Phenanthrene	"	**0.0799**	*0.000922*	0.00645	"	"	"	"	"	
Pyrene	"	**0.168**	*0.000922*	0.00645	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*101%*		*38.8 - 139 %*	"			"	
2-FBP			*52.4%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*106%*		*31.7 - 179 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000862*	0.00474	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:14	
2-Methylnaphthalene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Acenaphthene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Anthracene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00172*	0.00474	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00402**	*0.00259*	0.00474	"	"	"	"	"	**J**
Benzo (k) fluoranthene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Chrysene	"	**0.00230**	*0.000862*	0.00474	"	"	"	"	"	**J**
Dibenzo (a,h) anthracene	"	**0.00287**	*0.00172*	0.00474	"	"	"	"	"	**J**
Fluoranthene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Fluorene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00259*	0.00474	"	"	"	"	"	
Naphthalene	"	ND	*0.00172*	0.00474	"	"	"	"	"	
Phenanthrene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Pyrene	"	ND	*0.000862*	0.00474	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*43.4%*		*38.8 - 139 %*	"			"	
2-FBP			*44.4%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*61.2%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000703*	0.00492	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:51	
2-Methylnaphthalene	"	**0.00281**	*0.000703*	0.00492	"	"	"	"	"	**J**
Acenaphthene	"	ND	*0.000703*	0.00492	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000703*	0.00492	"	"	"	"	"	
Anthracene	"	ND	*0.000703*	0.00492	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00469**	*0.000703*	0.00492	"	"	"	"	"	**J**
Benzo (a) pyrene	"	**0.00516**	*0.000703*	0.00492	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0117**	*0.00141*	0.00492	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00985**	*0.00211*	0.00492	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000703*	0.00492	"	"	"	"	"	
Chrysene	"	**0.00609**	*0.000703*	0.00492	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00234**	*0.00141*	0.00492	"	"	"	"	"	**J**
Fluoranthene	"	**0.00656**	*0.000703*	0.00492	"	"	"	"	"	
Fluorene	"	ND	*0.000703*	0.00492	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00469**	*0.00211*	0.00492	"	"	"	"	"	**J**
Naphthalene	"	ND	*0.00141*	0.00492	"	"	"	"	"	
Phenanthrene	"	**0.00375**	*0.000703*	0.00492	"	"	"	"	"	**J**
Pyrene	"	**0.0136**	*0.000703*	0.00492	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*39.8%*		*38.8 - 139 %*	"			"	
2-FBP			*47.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*95.4%*		*31.7 - 179 %*	"			"	
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000714*	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:18	
2-Methylnaphthalene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Acenaphthene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Anthracene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00143*	0.00500	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	*0.00214*	0.00500	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Chrysene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00143*	0.00500	"	"	"	"	"	
Fluoranthene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Fluorene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00214*	0.00500	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Naphthalene	EPA 8270 mod.	ND	*0.00143*	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:18	
Phenanthrene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Pyrene	"	ND	*0.000714*	0.00500	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*54.4%*		*38.8 - 139 %*	"			"	
2-FBP			*59.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*89.0%*		*31.7 - 179 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000746*	0.00447	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 02:05	
2-Methylnaphthalene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Acenaphthene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Anthracene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00249**	*0.00149*	0.00447	"	"	"	"	"	J
Benzo (ghi) perylene	"	ND	*0.00224*	0.00447	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.00298**	*0.000746*	0.00447	"	"	"	"	"	J
Chrysene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00149*	0.00447	"	"	"	"	"	
Fluoranthene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Fluorene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00224*	0.00447	"	"	"	"	"	
Naphthalene	"	ND	*0.00149*	0.00447	"	"	"	"	"	
Phenanthrene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Pyrene	"	ND	*0.000746*	0.00447	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*77.0%*		*38.8 - 139 %*	"			"	
2-FBP			*81.6%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*95.6%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.00826**	*0.00138*	0.00689	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:39	
2-Methylnaphthalene	"	**0.00459**	*0.00138*	0.00689	"	"	"	"	"	**J**
Acenaphthene	"	**0.00459**	*0.00138*	0.00689	"	"	"	"	"	**J**
Acenaphthylene	"	ND	*0.00138*	0.00689	"	"	"	"	"	
Anthracene	"	ND	*0.00138*	0.00689	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.00138*	0.00689	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.00138*	0.00689	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00275*	0.00689	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00459**	*0.00413*	0.00689	"	"	"	"	"	**J**
Benzo (k) fluoranthene	"	ND	*0.00138*	0.00689	"	"	"	"	"	
Chrysene	"	**0.00459**	*0.00138*	0.00689	"	"	"	"	"	**J**
Dibenzo (a,h) anthracene	"	ND	*0.00275*	0.00689	"	"	"	"	"	
Fluoranthene	"	**0.0579**	*0.00138*	0.00689	"	"	"	"	"	
Fluorene	"	**0.00551**	*0.00138*	0.00689	"	"	"	"	"	**J**
Indeno (1,2,3-cd) pyrene	"	ND	*0.00413*	0.00689	"	"	"	"	"	
Naphthalene	"	**0.0147**	*0.00275*	0.00689	"	"	"	"	"	
Phenanthrene	"	**0.0340**	*0.00138*	0.00689	"	"	"	"	"	
Pyrene	"	**0.295**	*0.00138*	0.00689	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*66.4%*		*38.8 - 139 %*	"			"	
2-FBP			*77.6%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*83.8%*		*31.7 - 179 %*	"			"	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
1-Methylnapthalene	EPA 8270 mod.	**20.9**	*0.0209*	0.209	mg/kg dry	20x	9090042	09/08/09 13:27	09/18/09 17:15	**A-01**
2-Methylnaphthalene	"	**39.1**	*0.0209*	0.209	"	"	"	"	"	**A-01**
Acenaphthene	"	**0.172**	*0.00105*	0.00471	"	1x	"	"	09/15/09 02:26	**A-01**
Acenaphthylene	"	ND	*0.00105*	0.00471	"	"	"	"	"	**A-01**
Anthracene	"	**0.754**	*0.00105*	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00767**	*0.00105*	0.00471	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00488**	*0.00105*	0.00471	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	*0.00209*	0.00471	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0209**	*0.00314*	0.00471	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00105*	0.00471	"	"	"	"	"	
Chrysene	"	**0.0153**	*0.00105*	0.00471	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00279**	*0.00209*	0.00471	"	"	"	"	"	**J**
Fluoranthene	"	**0.0914**	*0.00105*	0.00471	"	"	"	"	"	
Fluorene	"	**0.207**	*0.00105*	0.00471	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	**0.00419**	*0.00314*	0.00471	"	"	"	"	"	**J**
Naphthalene	"	**2.39**	*0.00209*	0.00471	"	"	"	"	"	**A-01**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Phenanthrene	EPA 8270 mod.	ND	*0.00105*	0.00471	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 02:26	
Pyrene	"	**0.112**	*0.00105*	0.00471	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*161%*		*38.8 - 139 %*	"			"	***A-01. ZX***
2-FBP			*26.0%*		*40 - 132 %*	"			"	***A-01. Z***
p-Terphenyl-d14			*93.2%*		*31.7 - 179 %*	"			"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000758*	0.00455	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 21:48	
2-Methylnaphthalene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Acenaphthene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Anthracene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00405**	*0.00152*	0.00455	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.00228*	0.00455	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Chrysene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00152*	0.00455	"	"	"	"	"	
Fluoranthene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Fluorene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00228*	0.00455	"	"	"	"	"	
Naphthalene	"	ND	*0.00152*	0.00455	"	"	"	"	"	
Phenanthrene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Pyrene	"	ND	*0.000758*	0.00455	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*69.6%*		*38.8 - 139 %*	"			"	
2-FBP			*80.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*99.4%*		*31.7 - 179 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.0412**	*0.00103*	0.00514	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:30	
2-Methylnaphthalene	"	**0.0658**	*0.00103*	0.00514	"	"	"	"	"	
Acenaphthene	"	**0.00480**	*0.00103*	0.00514	"	"	"	"	"	**J**
Acenaphthylene	"	ND	*0.00103*	0.00514	"	"	"	"	"	
Anthracene	"	**0.00823**	*0.00103*	0.00514	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0130**	*0.00103*	0.00514	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0110**	*0.00103*	0.00514	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0178**	*0.00206*	0.00514	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0103**	*0.00309*	0.00514	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:30	
Benzo (k) fluoranthene	"	ND	*0.00103*	0.00514	"	"	"	"	"	
Chrysene	"	**0.0178**	*0.00103*	0.00514	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00549**	*0.00206*	0.00514	"	"	"	"	"	
Fluoranthene	"	**0.0151**	*0.00103*	0.00514	"	"	"	"	"	
Fluorene	"	**0.00549**	*0.00103*	0.00514	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00617**	*0.00309*	0.00514	"	"	"	"	"	
Naphthalene	"	**0.0185**	*0.00206*	0.00514	"	"	"	"	"	
Phenanthrene	"	**0.0130**	*0.00103*	0.00514	"	"	"	"	"	
Pyrene	"	**0.0343**	*0.00103*	0.00514	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*35.6%*		*38.8 - 139 %*	"			"	***Z***
2-FBP			*43.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*68.4%*		*31.7 - 179 %*	"			"	
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000702*	0.00492	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:14	
2-Methylnaphthalene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Acenaphthene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Anthracene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00375**	*0.00140*	0.00492	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.00211*	0.00492	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Chrysene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00140*	0.00492	"	"	"	"	"	
Fluoranthene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Fluorene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00211*	0.00492	"	"	"	"	"	
Naphthalene	"	ND	*0.00140*	0.00492	"	"	"	"	"	
Phenanthrene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Pyrene	"	ND	*0.000702*	0.00492	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*56.4%*		*38.8 - 139 %*	"			"	
2-FBP			*63.2%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*91.2%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000698*	0.00489	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:35	
2-Methylnaphthalene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Anthracene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00465**	*0.00140*	0.00489	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.00209*	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Chrysene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00140*	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Fluorene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00209*	0.00489	"	"	"	"	"	
Naphthalene	"	ND	*0.00140*	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	*0.000698*	0.00489	"	"	"	"	"	
Pyrene	"	**0.00233**	*0.000698*	0.00489	"	"	"	"	"	**J**
Surrogate(s): *Nitrobenzene-d5*			*63.8%*		*38.8 - 139 %*	"			"	
2-FBP			*76.6%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*97.2%*		*31.7 - 179 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000752*	0.00451	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:56	
2-Methylnaphthalene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Acenaphthene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Anthracene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00201**	*0.00150*	0.00451	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.00226*	0.00451	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.00201**	*0.000752*	0.00451	"	"	"	"	"	**J**
Chrysene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00150*	0.00451	"	"	"	"	"	
Fluoranthene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Fluorene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00226*	0.00451	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Naphthalene	EPA 8270 mod.	ND	*0.00150*	0.00451	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:56	
Phenanthrene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Pyrene	"	ND	*0.000752*	0.00451	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*69.2%*		*38.8 - 139 %*	"			"	
2-FBP			*74.0%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*89.0%*		*31.7 - 179 %*	"			"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000785*	0.00471	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 18:09	
2-Methylnaphthalene	"	**0.00209**	*0.000785*	0.00471	"	"	"	"	"	**J**
Acenaphthene	"	ND	*0.000785*	0.00471	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000785*	0.00471	"	"	"	"	"	
Anthracene	"	ND	*0.000785*	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0168**	*0.000785*	0.00471	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0162**	*0.000785*	0.00471	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0335**	*0.00157*	0.00471	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0204**	*0.00236*	0.00471	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000785*	0.00471	"	"	"	"	"	
Chrysene	"	**0.0178**	*0.000785*	0.00471	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00785**	*0.00157*	0.00471	"	"	"	"	"	
Fluoranthene	"	**0.0257**	*0.000785*	0.00471	"	"	"	"	"	
Fluorene	"	ND	*0.000785*	0.00471	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0126**	*0.00236*	0.00471	"	"	"	"	"	
Naphthalene	"	ND	*0.00157*	0.00471	"	"	"	"	"	
Phenanthrene	"	**0.00628**	*0.000785*	0.00471	"	"	"	"	"	
Pyrene	"	**0.0398**	*0.000785*	0.00471	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*31.8%*		*38.8 - 139 %*	"			"	***Z***
2-FBP			*28.6%*		*40 - 132 %*	"			"	***Z***
p-Terphenyl-d14			*43.2%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000769*	0.00461	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 01:22	
2-Methylnaphthalene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Acenaphthene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Anthracene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00820**	*0.000769*	0.00461	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00769**	*0.000769*	0.00461	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0123**	*0.00154*	0.00461	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00666**	*0.00231*	0.00461	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Chrysene	"	**0.00871**	*0.000769*	0.00461	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00154*	0.00461	"	"	"	"	"	
Fluoranthene	"	**0.00820**	*0.000769*	0.00461	"	"	"	"	"	
Fluorene	"	ND	*0.000769*	0.00461	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00461**	*0.00231*	0.00461	"	"	"	"	"	
Naphthalene	"	ND	*0.00154*	0.00461	"	"	"	"	"	
Phenanthrene	"	**0.00256**	*0.000769*	0.00461	"	"	"	"	"	J
Pyrene	"	**0.0138**	*0.000769*	0.00461	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*75.2%*		*38.8 - 139 %*	"			"	
2-FBP			*81.8%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*96.4%*		*31.7 - 179 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000845*	0.00465	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:52	
2-Methylnaphthalene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Acenaphthene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Anthracene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Benzo (a) anthracene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Benzo (a) pyrene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00225**	*0.00169*	0.00465	"	"	"	"	"	J
Benzo (ghi) perylene	"	ND	*0.00253*	0.00465	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Chrysene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	*0.00169*	0.00465	"	"	"	"	"	
Fluoranthene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Fluorene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.00253*	0.00465	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Naphthalene	EPA 8270 mod.	ND	*0.00169*	0.00465	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:52	
Phenanthrene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Pyrene	"	ND	*0.000845*	0.00465	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*57.6%*		*38.8 - 139 %*	"			"	
2-FBP			*64.8%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*85.4%*		*31.7 - 179 %*	"			"	
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	*0.00382*	0.0268	mg/kg dry	5x	9090042	09/08/09 13:27	09/15/09 19:56	
2-Methylnaphthalene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Acenaphthene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Anthracene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0459**	*0.00382*	0.0268	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0561**	*0.00382*	0.0268	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0968**	*0.00765*	0.0268	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0637**	*0.0115*	0.0268	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Chrysene	"	**0.0382**	*0.00382*	0.0268	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0255**	*0.00765*	0.0268	"	"	"	"	"	**J**
Fluoranthene	"	**0.0255**	*0.00382*	0.0268	"	"	"	"	"	**J**
Fluorene	"	ND	*0.00382*	0.0268	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0510**	*0.0115*	0.0268	"	"	"	"	"	
Naphthalene	"	ND	*0.00765*	0.0268	"	"	"	"	"	
Phenanthrene	"	**0.0153**	*0.00382*	0.0268	"	"	"	"	"	**J**
Pyrene	"	**0.133**	*0.00382*	0.0268	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*19.0%*		*38.8 - 139 %*	"			"	***Z3***
2-FBP			*17.0%*		*40 - 132 %*	"			"	***Z3***
p-Terphenyl-d14			*44.0%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					**RL2**
1-Methylnapthalene	EPA 8270 mod.	ND	*0.00363*	0.0254	mg/kg dry	5x	9090042	09/08/09 13:27	09/15/09 06:42	
2-Methylnaphthalene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Acenaphthene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Anthracene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00968**	*0.00363*	0.0254	"	"	"	"	"	**J**
Benzo (a) pyrene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0145**	*0.00726*	0.0254	"	"	"	"	"	**J**
Benzo (ghi) perylene	"	ND	*0.0109*	0.0254	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.0169**	*0.00363*	0.0254	"	"	"	"	"	**J**
Chrysene	"	**0.0121**	*0.00363*	0.0254	"	"	"	"	"	**J**
Dibenzo (a,h) anthracene	"	**0.0145**	*0.00726*	0.0254	"	"	"	"	"	**J**
Fluoranthene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Fluorene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	*0.0109*	0.0254	"	"	"	"	"	
Naphthalene	"	ND	*0.00726*	0.0254	"	"	"	"	"	
Phenanthrene	"	ND	*0.00363*	0.0254	"	"	"	"	"	
Pyrene	"	**0.00968**	*0.00363*	0.0254	"	"	"	"	"	**J**
Surrogate(s): *Nitrobenzene-d5*		*51.0%*			*38.8 - 139 %*	"			"	
2-FBP		*54.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*81.0%*			*31.7 - 179 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1-Methylnapthalene	EPA 8270 mod.	**1.56**	*0.000777*	0.00466	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 06:20	
2-Methylnaphthalene	"	**1.52**	*0.000777*	0.00466	"	"	"	"	"	
Acenaphthene	"	**0.270**	*0.000777*	0.00466	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000777*	0.00466	"	"	"	"	"	
Anthracene	"	**0.206**	*0.000777*	0.00466	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0202**	*0.000777*	0.00466	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00777**	*0.000777*	0.00466	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0155**	*0.00155*	0.00466	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0104**	*0.00233*	0.00466	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	*0.000777*	0.00466	"	"	"	"	"	
Chrysene	"	**0.0394**	*0.000777*	0.00466	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00829**	*0.00155*	0.00466	"	"	"	"	"	
Fluoranthene	"	**0.0233**	*0.000777*	0.00466	"	"	"	"	"	
Fluorene	"	**0.374**	*0.000777*	0.00466	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00725**	*0.00233*	0.00466	"	"	"	"	"	
Naphthalene	"	**0.114**	*0.00155*	0.00466	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Phenanthrene	EPA 8270 mod.	**0.664**	*0.000777*	0.00466	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 06:20	
Pyrene	"	**0.110**	*0.000777*	0.00466	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*70.6%*		*38.8 - 139 %*	"			"	
2-FBP			*56.0%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*96.8%*		*31.7 - 179 %*	"			"	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
1-Methylnapthalene	EPA 8270 mod.	**10.5**	*0.00769*	0.0538	mg/kg dry	10x	9090042	09/08/09 13:27	09/15/09 04:55	
2-Methylnaphthalene	"	**14.2**	*0.00769*	0.0538	"	"	"	"	"	
Acenaphthene	"	**0.959**	*0.00769*	0.0538	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00769*	0.0538	"	"	"	"	"	
Anthracene	"	**1.24**	*0.00769*	0.0538	"	"	"	"	"	
Benzo (a) anthracene	"	**0.144**	*0.00769*	0.0538	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0461**	*0.00769*	0.0538	"	"	"	"	"	**J**
Benzo (b) fluoranthene	"	**0.108**	*0.0154*	0.0538	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0461**	*0.0231*	0.0538	"	"	"	"	"	**J**
Benzo (k) fluoranthene	"	ND	*0.00769*	0.0538	"	"	"	"	"	
Chrysene	"	**0.236**	*0.00769*	0.0538	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0359**	*0.0154*	0.0538	"	"	"	"	"	**J**
Fluoranthene	"	**0.379**	*0.00769*	0.0538	"	"	"	"	"	
Fluorene	"	**1.39**	*0.00769*	0.0538	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0359**	*0.0231*	0.0538	"	"	"	"	"	**J**
Naphthalene	"	**1.89**	*0.0154*	0.0538	"	"	"	"	"	
Phenanthrene	"	**4.21**	*0.00769*	0.0538	"	"	"	"	"	
Pyrene	"	**1.05**	*0.00769*	0.0538	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*238%*		*38.8 - 139 %*	"			"	***Z3***
2-FBP			*76.0%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*112%*		*31.7 - 179 %*	"			"	
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.759**	*0.00155*	0.0155	mg/kg dry	2x	9090060	09/10/09 09:59	09/15/09 19:34	
2-Methylnaphthalene	"	**0.459**	*0.00155*	0.0155	"	"	"	"	"	
Acenaphthene	"	**0.111**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Acenaphthylene	"	**0.0186**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Anthracene	"	**0.167**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Benzo (a) anthracene	"	**0.0258**	*0.00155*	0.0155	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0114**	*0.00155*	0.0155	"	"	"	"	"	**J**
Benzo (b) fluoranthene	"	**0.0330**	*0.00310*	0.0155	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0217**	*0.00465*	0.0155	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					**RL3**
Benzo (k) fluoranthene	EPA 8270 mod.	**0.00723**	*0.00155*	0.0155	mg/kg dry	2x	9090060	09/10/09 09:59	09/15/09 19:34	**J**
Chrysene	"	**0.0733**	*0.00155*	0.0155	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0165**	*0.00310*	0.0155	"	"	"	"	"	
Fluoranthene	"	**0.0557**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Fluorene	"	**0.184**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	**0.0155**	*0.00465*	0.0155	"	"	"	"	"	
Naphthalene	"	**0.109**	*0.00310*	0.0155	"	"	"	"	"	
Phenanthrene	"	**0.277**	*0.00155*	0.0155	"	"	"	"	"	**A-01**
Pyrene	"	**0.275**	*0.00155*	0.0155	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*84.8%*		*38.8 - 139 %*	"			"	
2-FBP			*29.6%*		*40 - 132 %*	"			"	***A-01, Z3***
p-Terphenyl-d14			*104%*		*31.7 - 179 %*	"			"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
1-Methylnapthalene	EPA 8270 mod.	ND	*0.000715*	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:31	
2-Methylnaphthalene	"	ND	*0.000715*	0.00500	"	"	"	"	"	
Acenaphthene	"	ND	*0.000715*	0.00500	"	"	"	"	"	
Acenaphthylene	"	ND	*0.000715*	0.00500	"	"	"	"	"	
Anthracene	"	**0.00191**	*0.000715*	0.00500	"	"	"	"	"	**J**
Benzo (a) anthracene	"	**0.00429**	*0.000715*	0.00500	"	"	"	"	"	**J**
Benzo (a) pyrene	"	**0.00476**	*0.000715*	0.00500	"	"	"	"	"	**J**
Benzo (b) fluoranthene	"	**0.00953**	*0.00143*	0.00500	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00381**	*0.00214*	0.00500	"	"	"	"	"	**J**
Benzo (k) fluoranthene	"	ND	*0.000715*	0.00500	"	"	"	"	"	
Chrysene	"	**0.00476**	*0.000715*	0.00500	"	"	"	"	"	**J**
Dibenzo (a,h) anthracene	"	**0.00286**	*0.00143*	0.00500	"	"	"	"	"	**J**
Fluoranthene	"	**0.00524**	*0.000715*	0.00500	"	"	"	"	"	
Fluorene	"	ND	*0.000715*	0.00500	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00381**	*0.00214*	0.00500	"	"	"	"	"	**J**
Naphthalene	"	ND	*0.00143*	0.00500	"	"	"	"	"	
Phenanthrene	"	**0.00381**	*0.000715*	0.00500	"	"	"	"	"	**J**
Pyrene	"	**0.00905**	*0.000715*	0.00500	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*63.8%*		*38.8 - 139 %*	"			"	
2-FBP			*69.8%*		*40 - 132 %*	"			"	
p-Terphenyl-d14			*90.6%*		*31.7 - 179 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**				**Sampled: 08/27/09 09:40**				
% Solids	TA SOP	**63.2**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-02 (GTP1-13.5-082709)		**Soil**				**Sampled: 08/27/09 10:10**				
% Solids	TA SOP	**87.5**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-03 (GTP3-3.5-082709)		**Soil**				**Sampled: 08/27/09 14:15**				
% Solids	TA SOP	**92.8**	-----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-04 (GTP3-5-082709)		**Soil**				**Sampled: 08/27/09 14:35**				
% Solids	TA SOP	**72.3**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-05 (GTP3-13.5-082709)		**Soil**				**Sampled: 08/27/09 14:49**				
% Solids	TA SOP	**77.3**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-06 (GTP4-2.5-082709)		**Soil**				**Sampled: 08/27/09 15:40**				
% Solids	TA SOP	**94.8**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-07 (GTP4-8.0-082709)		**Soil**				**Sampled: 08/27/09 15:59**				
% Solids	TA SOP	**93.4**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-09 (GTP5-3.0-082709)		**Soil**				**Sampled: 08/27/09 16:40**				
% Solids	TA SOP	**89.4**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-10 (GTP5-7.0-082709)		**Soil**				**Sampled: 08/27/09 16:53**				
% Solids	TA SOP	**48.4**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-11 (GTP6-10-082809)		**Soil**				**Sampled: 08/28/09 10:36**				
% Solids	TA SOP	**63.7**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-12 (GTP6-2.5-082809)		**Soil**				**Sampled: 08/28/09 10:10**				

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**				**Sampled: 08/28/09 10:10**				
% Solids	TA SOP	**87.9**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-13 (GTP6-17-082809)		**Soil**				**Sampled: 08/28/09 11:11**				
% Solids	TA SOP	**64.8**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-14 (GTP7-2.5-082809)		**Soil**				**Sampled: 08/28/09 12:50**				
% Solids	TA SOP	**94.9**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-15 (GTP7-10.0-082809)		**Soil**				**Sampled: 08/28/09 13:27**				
% Solids	TA SOP	**95.5**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-16 (GTP7-18-082809)		**Soil**				**Sampled: 08/28/09 13:58**				
% Solids	TA SOP	**88.6**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-17 (GTP2-2.5-082709)		**Soil**				**Sampled: 08/27/09 11:40**				
% Solids	TA SOP	**84.9**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-18 (GTP2-8-082709)		**Soil**				**Sampled: 08/27/09 11:58**				
% Solids	TA SOP	**86.7**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-19 (GTP2-13-082709)		**Soil**				**Sampled: 08/27/09 17:28**				
% Solids	TA SOP	**78.9**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-20 (GTP1-2.5-082709)		**Soil**				**Sampled: 08/27/09 09:20**				
% Solids	TA SOP	**87.2**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-21 (GTP5-11-082809)		**Soil**				**Sampled: 08/28/09 09:37**				
% Solids	TA SOP	**91.8**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-22 (TS-COMP-1)		**Soil**				**Sampled: 08/27/09 18:10**				

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**				**Sampled: 08/27/09 18:10**				
% Solids	TA SOP	**85.8**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-23 (TS-COMP-2)		**Soil**				**Sampled: 08/27/09 18:28**				
% Solids	TA SOP	**86.7**	-----	0.0100	% by Weight	1x	9090103	09/15/09 14:15	09/16/09 07:30	
SSH0168-24 (TS-COMP-3)		**Soil**				**Sampled: 08/27/09 16:40**				
% Solids	TA SOP	**86.1**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSH0168-25 (GTP4-6.0-082709)		**Soil**				**Sampled: 08/27/09 15:49**				
% Solids	TA SOP	**93.3**	-----	0.0100	% by Weight	1x	9090103	09/15/09 14:15	09/16/09 07:30	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**					**Sampled: 08/27/09 09:40**			
Mercury	7471A Dry	**0.015**	*0.0081*	0.026	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 15:40	**Ja**
SSH0168-02 (GTP1-13.5-082709)		**Soil**					**Sampled: 08/27/09 10:10**			
Mercury	7471A Dry	**0.013**	*0.0065*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:02	**Ja**
SSH0168-03 (GTP3-3.5-082709)		**Soil**					**Sampled: 08/27/09 14:15**			
Mercury	7471A Dry	**0.018**	*0.0061*	0.019	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:06	**Ja**
SSH0168-04 (GTP3-5-082709)		**Soil**					**Sampled: 08/27/09 14:35**			
Mercury	7471A Dry	**0.11**	*0.0078*	0.025	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:10	
SSH0168-05 (GTP3-13.5-082709)		**Soil**					**Sampled: 08/27/09 14:49**			
Mercury	7471A Dry	ND	*0.0081*	0.026	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:15	
SSH0168-06 (GTP4-2.5-082709)		**Soil**					**Sampled: 08/27/09 15:40**			
Mercury	7471A Dry	**0.016**	*0.0063*	0.020	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:20	**Ja**
SSH0168-07 (GTP4-8.0-082709)		**Soil**					**Sampled: 08/27/09 15:59**			
Mercury	7471A Dry	**0.012**	*0.0061*	0.019	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:32	**Ja**
SSH0168-09 (GTP5-3.0-082709)		**Soil**					**Sampled: 08/27/09 16:40**			
Mercury	7471A Dry	**0.025**	*0.0065*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:36	
SSH0168-10 (GTP5-7.0-082709)		**Soil**					**Sampled: 08/27/09 16:53**			
Mercury	7471A Dry	ND	*0.013*	0.040	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:41	
SSH0168-11 (GTP6-10-082809)		**Soil**					**Sampled: 08/28/09 10:36**			
Mercury	7471A Dry	**0.023**	*0.0096*	0.030	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:45	**Ja**
SSH0168-12 (GTP6-2.5-082809)		**Soil**					**Sampled: 08/28/09 10:10**			
Mercury	7471A Dry	**0.018**	*0.0066*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:49	**Ja**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**				**Sampled: 08/28/09 11:11**				
Mercury	7471A Dry	**0.017**	*0.0088*	0.028	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:53	**Ja**
SSH0168-14 (GTP7-2.5-082809)		**Soil**				**Sampled: 08/28/09 12:50**				
Mercury	7471A Dry	**0.013**	*0.0063*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:32	**Ja**
SSH0168-15 (GTP7-10.0-082809)		**Soil**				**Sampled: 08/28/09 13:27**				
Mercury	7471A Dry	**0.017**	*0.0062*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:53	**Ja**
SSH0168-16 (GTP7-18-082809)		**Soil**				**Sampled: 08/28/09 13:58**				
Mercury	7471A Dry	**0.015**	*0.0061*	0.019	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:57	**Ja**
SSH0168-17 (GTP2-2.5-082709)		**Soil**				**Sampled: 08/27/09 11:40**				
Mercury	7471A Dry	**0.027**	*0.0077*	0.024	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:01	
SSH0168-18 (GTP2-8-082709)		**Soil**				**Sampled: 08/27/09 11:58**				
Mercury	7471A Dry	**0.024**	*0.0071*	0.023	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:06	
SSH0168-19 (GTP2-13-082709)		**Soil**				**Sampled: 08/27/09 17:28**				
Mercury	7471A Dry	ND	*0.0077*	0.024	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:10	
SSH0168-20 (GTP1-2.5-082709)		**Soil**				**Sampled: 08/27/09 09:20**				
Mercury	7471A Dry	**0.0083**	*0.0069*	0.022	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:25	**Ja**
SSH0168-21 (GTP5-11-082809)		**Soil**				**Sampled: 08/28/09 09:37**				
Mercury	7471A Dry	**0.014**	*0.0068*	0.022	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:29	**Ja**
SSH0168-22 (TS-COMP-1)		**Soil**				**Sampled: 08/27/09 18:10**				
Mercury	7471A Dry	ND	*0.0071*	0.023	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:33	
SSH0168-23 (TS-COMP-2)		**Soil**				**Sampled: 08/27/09 18:28**				
Mercury	7471A Dry	ND	*0.0063*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:38	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**					**Sampled: 08/27/09 16:40**			
Mercury	7471A Dry	**0.016**	*0.0067*	0.021	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:42	**Ja**
SSH0168-25 (GTP4-6.0-082709)		**Soil**					**Sampled: 08/27/09 15:49**			
Mercury	7471A Dry	**0.022**	*0.0067*	0.021	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:46	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Calcium	6010B TMP Dry	**1600**	*2.0*	72	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 21:38	
Iron	"	**15000**	*0.61*	13	"	"	"	"	"	**B**
Magnesium	"	**5700**	*0.87*	72	"	"	"	"	"	**B**
Potassium	"	**1400**	*21*	220	"	"	"	"	"	
Silver	"	ND	*0.059*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.9*	130	"	"	"	"	"	*
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Calcium	6010B TMP Dry	**1500**	*1.5*	57	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:06	
Iron	"	**13000**	*0.48*	10	"	"	"	"	"	**B**
Magnesium	"	**3900**	*0.68*	57	"	"	"	"	"	**B**
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.046*	1.0	"	"	"	"	"	
Sodium	"	ND	*7.0*	100	"	"	"	"	"	*
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Calcium	6010B TMP Dry	**5200**	*1.6*	58	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:10	
Iron	"	**15000**	*0.49*	11	"	"	"	"	"	**B**
Magnesium	"	**9600**	*0.70*	58	"	"	"	"	"	**B**
Potassium	"	**2900**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.2*	110	"	"	"	"	"	*
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Calcium	6010B TMP Dry	**5300**	*1.9*	71	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:14	
Iron	"	**12000**	*0.59*	13	"	"	"	"	"	**B**
Magnesium	"	**5300**	*0.85*	71	"	"	"	"	"	**B**
Potassium	"	**2100**	*21*	210	"	"	"	"	"	
Silver	"	ND	*0.058*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.8*	130	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Calcium	6010B TMP Dry	**1800**	*1.9*	68	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:17	
Iron	"	**20000**	*0.57*	12	"	"	"	"	"	**B**
Magnesium	"	**6100**	*0.82*	68	"	"	"	"	"	**B**
Potassium	"	**2800**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.056*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.4*	120	"	"	"	"	"	*
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Calcium	6010B TMP Dry	**2500**	*1.5*	55	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:21	
Iron	"	**14000**	*0.46*	10	"	"	"	"	"	**B**
Magnesium	"	**3300**	*0.66*	55	"	"	"	"	"	**B**
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.045*	1.0	"	"	"	"	"	
Sodium	"	ND	*6.8*	100	"	"	"	"	"	*
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Calcium	6010B TMP Dry	**900**	*1.6*	59	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:25	
Iron	"	**12000**	*0.49*	11	"	"	"	"	"	**B**
Magnesium	"	**3200**	*0.71*	59	"	"	"	"	"	**B**
Potassium	"	**1100**	*17*	180	"	"	"	"	"	
Silver	"	ND	*0.048*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.3*	110	"	"	"	"	"	*
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Calcium	6010B TMP Dry	**2700**	*1.6*	57	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:29	
Iron	"	**18000**	*0.48*	10	"	"	"	"	"	**B**
Magnesium	"	**4400**	*0.69*	57	"	"	"	"	"	**B**
Potassium	"	**1600**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND	*7.1*	100	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Calcium	6010B TMP Dry	**5900**	*3.1*	110	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:32	
Iron	"	**7800**	*0.96*	21	"	"	"	"	"	**B**
Magnesium	"	**2800**	*1.4*	110	"	"	"	"	"	**B**
Potassium	"	**1700**	*33*	340	"	"	"	"	"	
Silver	"	ND	*0.093*	2.1	"	"	"	"	"	
Sodium	"	ND	*14*	210	"	"	"	"	"	*
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Calcium	6010B TMP Dry	**2800**	*2.4*	88	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:36	
Iron	"	**9500**	*0.73*	16	"	"	"	"	"	**B**
Magnesium	"	**2700**	*1.1*	88	"	"	"	"	"	**B**
Potassium	"	**1500**	*26*	260	"	"	"	"	"	
Silver	"	ND	*0.072*	1.6	"	"	"	"	"	
Sodium	"	ND	*11*	160	"	"	"	"	"	*
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Calcium	6010B TMP Dry	**5400**	*1.6*	60	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:53	
Iron	"	**18000**	*0.50*	11	"	"	"	"	"	**B**
Magnesium	"	**3500**	*0.72*	60	"	"	"	"	"	**B**
Potassium	"	**1400**	*17*	180	"	"	"	"	"	
Silver	"	ND	*0.049*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.4*	110	"	"	"	"	"	*
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Calcium	6010B TMP Dry	**2100**	*2.1*	76	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:57	
Iron	"	**12000**	*0.64*	14	"	"	"	"	"	**B**
Magnesium	"	**3500**	*0.91*	76	"	"	"	"	"	**B**
Potassium	"	**1200**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.062*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.4*	140	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Calcium	6010B TMP Dry	**25000**	*1.5*	56	mg/Kg dry	1x	50182	09/14/09 11:44	09/14/09 23:29	
Iron	"	**16000**	*0.47*	10	"	"	"	"	"	
Magnesium	"	**6300**	*0.67*	56	"	"	"	"	"	
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.046*	1.0	"	"	"	"	"	
Sodium	"	ND	*6.9*	100	"	"	"	"	"	*
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Calcium	6010B TMP Dry	**2000**	*1.5*	55	mg/Kg dry	1x	50182	09/14/09 11:44	09/14/09 23:57	
Iron	"	**11000**	*0.46*	10	"	"	"	"	"	
Magnesium	"	**3100**	*0.67*	55	"	"	"	"	"	
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.045*	1.0	"	"	"	"	"	
Sodium	"	ND	*6.9*	100	"	"	"	"	"	*
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Calcium	6010B TMP Dry	**1300**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:00	
Iron	"	**12000**	*0.48*	11	"	"	"	"	"	
Magnesium	"	**3500**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1400**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.2*	110	"	"	"	"	"	*
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Calcium	6010B TMP Dry	**6400**	*1.8*	65	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:04	
Iron	"	**16000**	*0.54*	12	"	"	"	"	"	
Magnesium	"	**4300**	*0.78*	65	"	"	"	"	"	
Potassium	"	**1900**	*19*	190	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	**43**	*8.0*	120	"	"	"	"	"	**Ja, ***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Calcium	6010B TMP Dry	**2100**	*1.7*	62	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:08	
Iron	"	**16000**	*0.52*	11	"	"	"	"	"	
Magnesium	"	**8800**	*0.74*	62	"	"	"	"	"	
Potassium	"	**3200**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.6*	110	"	"	"	"	"	*
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Calcium	6010B TMP Dry	**1500**	*1.9*	68	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:12	
Iron	"	**13000**	*0.57*	12	"	"	"	"	"	
Magnesium	"	**4600**	*0.82*	68	"	"	"	"	"	
Potassium	"	**1600**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.056*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.4*	120	"	"	"	"	"	*
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Calcium	6010B TMP Dry	**8800**	*1.7*	62	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:16	
Iron	"	**13000**	*0.52*	11	"	"	"	"	"	
Magnesium	"	**2700**	*0.74*	62	"	"	"	"	"	
Potassium	"	**780**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	**170**	*7.6*	110	"	"	"	"	"	*
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Calcium	6010B TMP Dry	**3200**	*1.6*	60	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:19	
Iron	"	**9000**	*0.51*	11	"	"	"	"	"	
Magnesium	"	**2900**	*0.73*	60	"	"	"	"	"	
Potassium	"	**660**	*18*	180	"	"	"	"	"	
Silver	"	ND	*0.049*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.5*	110	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Calcium	6010B TMP Dry	**1500**	*1.7*	63	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:23	
Iron	"	**13000**	*0.53*	12	"	"	"	"	"	
Magnesium	"	**5000**	*0.76*	63	"	"	"	"	"	
Potassium	"	**1700**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.052*	1.2	"	"	"	"	"	
Sodium	"	ND	*7.8*	120	"	"	"	"	"	*
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Calcium	6010B TMP Dry	**1300**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:27	
Iron	"	**12000**	*0.48*	10	"	"	"	"	"	
Magnesium	"	**4500**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND	*7.1*	100	"	"	"	"	"	*
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Calcium	6010B TMP Dry	**1100**	*1.6*	57	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:44	
Iron	"	**12000**	*0.48*	10	"	"	"	"	"	
Magnesium	"	**3900**	*0.68*	57	"	"	"	"	"	
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND	*7.0*	100	"	"	"	"	"	*
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Calcium	6010B TMP Dry	**3600**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:47	
Iron	"	**19000**	*0.48*	11	"	"	"	"	"	
Magnesium	"	**3300**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1500**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.2*	110	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Aluminum	6020 TMP Dry	**10000**	*0.39*	39	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 14:41	
Arsenic	"	**5.7**	*0.0010*	0.26	"	"	"	"	"	
Antimony	"	**0.45**	*0.0087*	0.26	"	"	"	"	"	**B**
Barium	"	**76**	*0.0020*	0.26	"	"	"	"	"	**B**
Beryllium	"	**0.37**	*0.00091*	0.26	"	"	"	"	"	**B**
Manganese	"	**130**	*0.021*	0.66	"	"	"	"	"	
Cadmium	"	**0.15**	*0.00062*	0.26	"	"	"	"	"	**Ja, B**
Nickel	"	**13**	*0.0049*	0.26	"	"	"	"	"	
Chromium	"	**11**	*0.0053*	0.26	"	"	"	"	"	
Selenium	"	**0.19**	*0.0025*	0.66	"	"	"	"	"	**Ja**
Cobalt	"	**6.8**	*0.00071*	0.26	"	"	"	"	"	**B**
Thallium	"	**0.16**	*0.0053*	0.53	"	"	"	"	"	**Ja, B**
Copper	"	**18**	*0.0042*	0.26	"	"	"	"	"	**B**
Vanadium	"	**26**	*0.0036*	0.26	"	"	"	"	"	**B**
Lead	"	**8.4**	*0.0013*	0.26	"	"	"	"	"	**B**
Zinc	"	**34**	*0.020*	0.92	"	"	"	"	"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Aluminum	6020 TMP Dry	**6800**	*0.31*	31	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:36	
Arsenic	"	**11**	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	**1.3**	*0.0068*	0.21	"	"	"	"	"	**B**
Barium	"	**64**	*0.0015*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.29**	*0.00071*	0.21	"	"	"	"	"	**B**
Manganese	"	**140**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.15**	*0.00049*	0.21	"	"	"	"	"	**Ja, B**
Nickel	"	**12**	*0.0038*	0.21	"	"	"	"	"	
Chromium	"	**7.6**	*0.0041*	0.21	"	"	"	"	"	
Selenium	"	**0.20**	*0.0019*	0.52	"	"	"	"	"	**Ja**
Cobalt	"	**8.9**	*0.00056*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.21**	*0.0041*	0.41	"	"	"	"	"	**Ja, B**
Copper	"	**31**	*0.0033*	0.21	"	"	"	"	"	**B**
Vanadium	"	**18**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**16**	*0.0010*	0.21	"	"	"	"	"	**B**
Zinc	"	**25**	*0.015*	0.72	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Aluminum	6020 TMP Dry	**13000**	*0.32*	32	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:42	
Arsenic	"	**8.5**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**0.85**	*0.0070*	0.21	"	"	"	"	"	**B**
Barium	"	**88**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.82**	*0.00073*	0.21	"	"	"	"	"	**B**
Manganese	"	**520**	*0.017*	0.53	"	"	"	"	"	
Cadmium	"	**0.27**	*0.00050*	0.21	"	"	"	"	"	**B**
Nickel	"	**13**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**12**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.10**	*0.0020*	0.53	"	"	"	"	"	**Ja**
Cobalt	"	**8.7**	*0.00057*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.23**	*0.0042*	0.42	"	"	"	"	"	**Ja, B**
Copper	"	**23**	*0.0034*	0.21	"	"	"	"	"	**B**
Vanadium	"	**19**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**20**	*0.0011*	0.21	"	"	"	"	"	**B**
Zinc	"	**72**	*0.016*	0.74	"	"	"	"	"	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Aluminum	6020 TMP Dry	**9200**	*0.39*	39	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:48	
Arsenic	"	**8.9**	*0.0010*	0.26	"	"	"	"	"	
Antimony	"	**1.1**	*0.0085*	0.26	"	"	"	"	"	**B**
Barium	"	**180**	*0.0019*	0.26	"	"	"	"	"	**B**
Beryllium	"	**0.51**	*0.00089*	0.26	"	"	"	"	"	**B**
Manganese	"	**400**	*0.021*	0.64	"	"	"	"	"	
Cadmium	"	**0.28**	*0.00060*	0.26	"	"	"	"	"	**B**
Nickel	"	**13**	*0.0048*	0.26	"	"	"	"	"	
Chromium	"	**10**	*0.0051*	0.26	"	"	"	"	"	
Selenium	"	**0.16**	*0.0024*	0.64	"	"	"	"	"	**Ja**
Cobalt	"	**5.9**	*0.00070*	0.26	"	"	"	"	"	**B**
Thallium	"	**0.20**	*0.0051*	0.51	"	"	"	"	"	**Ja, B**
Copper	"	**31**	*0.0041*	0.26	"	"	"	"	"	**B**
Vanadium	"	**19**	*0.0035*	0.26	"	"	"	"	"	**B**
Lead	"	**44**	*0.0013*	0.26	"	"	"	"	"	**B**
Zinc	"	**73**	*0.019*	0.90	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Aluminum	6020 TMP Dry	**16000**	*0.37*	37	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:54	
Arsenic	"	**45**	*0.00097*	0.25	"	"	"	"	"	
Antimony	"	**0.87**	*0.0082*	0.25	"	"	"	"	"	**B**
Barium	"	**110**	*0.0019*	0.25	"	"	"	"	"	**B**
Beryllium	"	**0.75**	*0.00085*	0.25	"	"	"	"	"	**B**
Manganese	"	**560**	*0.020*	0.62	"	"	"	"	"	
Cadmium	"	**0.32**	*0.00058*	0.25	"	"	"	"	"	**B**
Nickel	"	**19**	*0.0046*	0.25	"	"	"	"	"	
Chromium	"	**18**	*0.0049*	0.25	"	"	"	"	"	
Selenium	"	**0.15**	*0.0023*	0.62	"	"	"	"	"	**Ja**
Cobalt	"	**12**	*0.00067*	0.25	"	"	"	"	"	**B**
Thallium	"	**0.25**	*0.0049*	0.49	"	"	"	"	"	**Ja, B**
Copper	"	**29**	*0.0040*	0.25	"	"	"	"	"	**B**
Vanadium	"	**34**	*0.0033*	0.25	"	"	"	"	"	**B**
Lead	"	**11**	*0.0012*	0.25	"	"	"	"	"	**B**
Zinc	"	**40**	*0.019*	0.87	"	"	"	"	"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Aluminum	6020 TMP Dry	**9100**	*0.30*	30	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:00	
Arsenic	"	**20**	*0.00078*	0.20	"	"	"	"	"	
Antimony	"	**1.3**	*0.0066*	0.20	"	"	"	"	"	**B**
Barium	"	**87**	*0.0015*	0.20	"	"	"	"	"	**B**
Beryllium	"	**0.45**	*0.00069*	0.20	"	"	"	"	"	**B**
Manganese	"	**320**	*0.016*	0.50	"	"	"	"	"	
Cadmium	"	**0.34**	*0.00047*	0.20	"	"	"	"	"	**B**
Nickel	"	**14**	*0.0037*	0.20	"	"	"	"	"	
Chromium	"	**11**	*0.0040*	0.20	"	"	"	"	"	
Selenium	"	**0.16**	*0.0019*	0.50	"	"	"	"	"	**Ja**
Cobalt	"	**9.2**	*0.00054*	0.20	"	"	"	"	"	**B**
Thallium	"	**0.15**	*0.0040*	0.40	"	"	"	"	"	**Ja, B**
Copper	"	**49**	*0.0032*	0.20	"	"	"	"	"	**B**
Vanadium	"	**18**	*0.0027*	0.20	"	"	"	"	"	**B**
Lead	"	**53**	*0.0010*	0.20	"	"	"	"	"	**B**
Zinc	"	**66**	*0.015*	0.70	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Aluminum	6020 TMP Dry	**6000**	*0.32*	32	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:07	
Arsenic	"	**9.4**	*0.00084*	0.22	"	"	"	"	"	
Antimony	"	**0.62**	*0.0071*	0.22	"	"	"	"	"	**B**
Barium	"	**39**	*0.0016*	0.22	"	"	"	"	"	**B**
Beryllium	"	**0.20**	*0.00074*	0.22	"	"	"	"	"	**Ja, B**
Manganese	"	**260**	*0.017*	0.54	"	"	"	"	"	
Cadmium	"	**0.15**	*0.00051*	0.22	"	"	"	"	"	**Ja, B**
Nickel	"	**11**	*0.0040*	0.22	"	"	"	"	"	
Chromium	"	**7.2**	*0.0043*	0.22	"	"	"	"	"	
Selenium	"	**0.063**	*0.0020*	0.54	"	"	"	"	"	**Ja**
Cobalt	"	**5.1**	*0.00058*	0.22	"	"	"	"	"	**B**
Thallium	"	**0.12**	*0.0043*	0.43	"	"	"	"	"	**Ja, B**
Copper	"	**27**	*0.0034*	0.22	"	"	"	"	"	**B**
Vanadium	"	**13**	*0.0029*	0.22	"	"	"	"	"	**B**
Lead	"	**21**	*0.0011*	0.22	"	"	"	"	"	**B**
Zinc	"	**57**	*0.016*	0.75	"	"	"	"	"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Aluminum	6020 TMP Dry	**10000**	*0.31*	31	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:13	
Arsenic	"	**15**	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	**1.5**	*0.0069*	0.21	"	"	"	"	"	**B**
Barium	"	**63**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.55**	*0.00072*	0.21	"	"	"	"	"	**B**
Manganese	"	**540**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.31**	*0.00049*	0.21	"	"	"	"	"	**B**
Nickel	"	**17**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**8.3**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.13**	*0.0020*	0.52	"	"	"	"	"	**Ja**
Cobalt	"	**12**	*0.00056*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.17**	*0.0042*	0.42	"	"	"	"	"	**Ja, B**
Copper	"	**22**	*0.0033*	0.21	"	"	"	"	"	**B**
Vanadium	"	**16**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**9.3**	*0.0010*	0.21	"	"	"	"	"	**B**
Zinc	"	**27**	*0.016*	0.73	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Aluminum	6020 TMP Dry	**6300**	*0.62*	62	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:19	
Arsenic	"	**3.6**	*0.0016*	0.42	"	"	"	"	"	
Antimony	"	**0.39**	*0.014*	0.42	"	"	"	"	"	**Ja, B**
Barium	"	**150**	*0.0031*	0.42	"	"	"	"	"	**B**
Beryllium	"	**0.21**	*0.0014*	0.42	"	"	"	"	"	**Ja, B**
Manganese	"	**330**	*0.033*	1.0	"	"	"	"	"	
Cadmium	"	**0.22**	*0.00098*	0.42	"	"	"	"	"	**Ja, B**
Nickel	"	**6.7**	*0.0077*	0.42	"	"	"	"	"	
Chromium	"	**5.3**	*0.0083*	0.42	"	"	"	"	"	
Selenium	"	**0.063**	*0.0039*	1.0	"	"	"	"	"	**Ja**
Cobalt	"	**4.0**	*0.0011*	0.42	"	"	"	"	"	**B**
Thallium	"	**0.12**	*0.0083*	0.83	"	"	"	"	"	**Ja, B**
Copper	"	**16**	*0.0066*	0.42	"	"	"	"	"	**B**
Vanadium	"	**11**	*0.0056*	0.42	"	"	"	"	"	**B**
Lead	"	**7.4**	*0.0021*	0.42	"	"	"	"	"	**B**
Zinc	"	**49**	*0.031*	1.5	"	"	"	"	"	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Aluminum	6020 TMP Dry	**6100**	*0.48*	48	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:25	
Arsenic	"	**4.7**	*0.0012*	0.32	"	"	"	"	"	
Antimony	"	**0.64**	*0.011*	0.32	"	"	"	"	"	**B**
Barium	"	**89**	*0.0024*	0.32	"	"	"	"	"	**B**
Beryllium	"	**0.20**	*0.0011*	0.32	"	"	"	"	"	**Ja, B**
Manganese	"	**200**	*0.026*	0.80	"	"	"	"	"	
Cadmium	"	**0.20**	*0.00075*	0.32	"	"	"	"	"	**Ja, B**
Nickel	"	**7.7**	*0.0059*	0.32	"	"	"	"	"	
Chromium	"	**6.4**	*0.0064*	0.32	"	"	"	"	"	
Selenium	"	**0.023**	*0.0030*	0.80	"	"	"	"	"	**Ja**
Cobalt	"	**4.3**	*0.00086*	0.32	"	"	"	"	"	**B**
Thallium	"	**0.11**	*0.0064*	0.64	"	"	"	"	"	**Ja, B**
Copper	"	**17**	*0.0051*	0.32	"	"	"	"	"	**B**
Vanadium	"	**11**	*0.0043*	0.32	"	"	"	"	"	**B**
Lead	"	**34**	*0.0016*	0.32	"	"	"	"	"	**B**
Zinc	"	**37**	*0.024*	1.1	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Aluminum	6020 TMP Dry	**11000**	*0.33*	33	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:32	
Arsenic	"	**17**	*0.00085*	0.22	"	"	"	"	"	
Antimony	"	**0.89**	*0.0072*	0.22	"	"	"	"	"	**B**
Barium	"	**78**	*0.0016*	0.22	"	"	"	"	"	**B**
Beryllium	"	**0.52**	*0.00075*	0.22	"	"	"	"	"	**B**
Manganese	"	**500**	*0.017*	0.54	"	"	"	"	"	
Cadmium	"	**0.34**	*0.00051*	0.22	"	"	"	"	"	**B**
Nickel	"	**18**	*0.0040*	0.22	"	"	"	"	"	
Chromium	"	**9.4**	*0.0043*	0.22	"	"	"	"	"	
Selenium	"	**0.11**	*0.0020*	0.54	"	"	"	"	"	**Ja**
Cobalt	"	**11**	*0.00059*	0.22	"	"	"	"	"	**B**
Thallium	"	**0.14**	*0.0043*	0.43	"	"	"	"	"	**Ja, B**
Copper	"	**26**	*0.0035*	0.22	"	"	"	"	"	**B**
Vanadium	"	**18**	*0.0029*	0.22	"	"	"	"	"	**B**
Lead	"	**11**	*0.0011*	0.22	"	"	"	"	"	**B**
Zinc	"	**28**	*0.016*	0.76	"	"	"	"	"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Aluminum	6020 TMP Dry	**7100**	*0.41*	41	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:53	
Arsenic	"	**8.3**	*0.0011*	0.28	"	"	"	"	"	
Antimony	"	**1.8**	*0.0091*	0.28	"	"	"	"	"	**B**
Barium	"	**54**	*0.0021*	0.28	"	"	"	"	"	**B**
Beryllium	"	**0.30**	*0.00095*	0.28	"	"	"	"	"	**B**
Manganese	"	**200**	*0.022*	0.69	"	"	"	"	"	
Cadmium	"	**0.29**	*0.00065*	0.28	"	"	"	"	"	**B**
Nickel	"	**12**	*0.0051*	0.28	"	"	"	"	"	
Chromium	"	**8.8**	*0.0055*	0.28	"	"	"	"	"	
Selenium	"	**0.10**	*0.0026*	0.69	"	"	"	"	"	**Ja**
Cobalt	"	**6.2**	*0.00075*	0.28	"	"	"	"	"	**B**
Thallium	"	**0.15**	*0.0055*	0.55	"	"	"	"	"	**Ja, B**
Copper	"	**50**	*0.0044*	0.28	"	"	"	"	"	**B**
Vanadium	"	**16**	*0.0037*	0.28	"	"	"	"	"	**B**
Lead	"	**34**	*0.0014*	0.28	"	"	"	"	"	**B**
Zinc	"	**46**	*0.021*	0.97	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Aluminum	6020 TMP Dry	**6800**	*0.30*	30	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 17:36	**B**
Arsenic	"	**17**	*0.00079*	0.20	"	"	"	"	"	
Antimony	"	**0.97**	*0.0067*	0.20	"	"	"	"	"	**B**
Barium	"	**47**	*0.0015*	0.20	"	"	"	"	"	**B**
Beryllium	"	**0.36**	*0.00070*	0.20	"	"	"	"	"	
Manganese	"	**520**	*0.016*	0.51	"	"	"	"	"	
Cadmium	"	**0.13**	*0.00048*	0.20	"	"	"	"	"	**Ja**
Nickel	"	**17**	*0.0038*	0.20	"	"	"	"	"	
Chromium	"	**6.2**	*0.0041*	0.20	"	"	"	"	"	
Selenium	"	**0.068**	*0.0019*	0.51	"	"	"	"	"	**Ja**
Cobalt	"	**11**	*0.00055*	0.20	"	"	"	"	"	**B**
Thallium	"	**0.14**	*0.0041*	0.41	"	"	"	"	"	**Ja, B**
Copper	"	**23**	*0.0032*	0.20	"	"	"	"	"	
Vanadium	"	**10**	*0.0027*	0.20	"	"	"	"	"	**B**
Lead	"	**9.3**	*0.0010*	0.20	"	"	"	"	"	**B**
Zinc	"	**26**	*0.015*	0.71	"	"	"	"	"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Aluminum	6020 TMP Dry	**5500**	*0.30*	30	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:41	**B**
Arsenic	"	**6.8**	*0.00079*	0.20	"	"	"	"	"	
Antimony	"	**0.36**	*0.0067*	0.20	"	"	"	"	"	**B**
Barium	"	**34**	*0.0015*	0.20	"	"	"	"	"	**B**
Beryllium	"	**0.21**	*0.00070*	0.20	"	"	"	"	"	
Manganese	"	**270**	*0.016*	0.50	"	"	"	"	"	
Cadmium	"	**0.17**	*0.00047*	0.20	"	"	"	"	"	**Ja**
Nickel	"	**9.3**	*0.0037*	0.20	"	"	"	"	"	
Chromium	"	**7.3**	*0.0040*	0.20	"	"	"	"	"	
Selenium	"	**0.055**	*0.0019*	0.50	"	"	"	"	"	**Ja**
Cobalt	"	**6.1**	*0.00054*	0.20	"	"	"	"	"	**B**
Thallium	"	**0.17**	*0.0040*	0.40	"	"	"	"	"	**Ja, B**
Copper	"	**20**	*0.0032*	0.20	"	"	"	"	"	
Vanadium	"	**12**	*0.0027*	0.20	"	"	"	"	"	**B**
Lead	"	**7.4**	*0.0010*	0.20	"	"	"	"	"	**B**
Zinc	"	**28**	*0.015*	0.71	"	"	"	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Aluminum	6020 TMP Dry	**6200**	*0.32*	32	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:48	**B**
Arsenic	"	**7.8**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**0.49**	*0.0069*	0.21	"	"	"	"	"	**B**
Barium	"	**42**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.27**	*0.00073*	0.21	"	"	"	"	"	
Manganese	"	**200**	*0.017*	0.53	"	"	"	"	"	
Cadmium	"	**0.11**	*0.00049*	0.21	"	"	"	"	"	**Ja**
Nickel	"	**9.9**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**7.6**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.073**	*0.0020*	0.53	"	"	"	"	"	**Ja**
Cobalt	"	**7.0**	*0.00057*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.18**	*0.0042*	0.42	"	"	"	"	"	**Ja, B**
Copper	"	**21**	*0.0034*	0.21	"	"	"	"	"	
Vanadium	"	**16**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**7.3**	*0.0011*	0.21	"	"	"	"	"	**B**
Zinc	"	**29**	*0.016*	0.74	"	"	"	"	"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Aluminum	6020 TMP Dry	**14000**	*0.35*	35	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:55	**B**
Arsenic	"	**18**	*0.00092*	0.24	"	"	"	"	"	
Antimony	"	**2.1**	*0.0078*	0.24	"	"	"	"	"	**B**
Barium	"	**240**	*0.0018*	0.24	"	"	"	"	"	**B**
Beryllium	"	**1.0**	*0.00081*	0.24	"	"	"	"	"	
Manganese	"	**370**	*0.019*	0.59	"	"	"	"	"	
Cadmium	"	**0.94**	*0.00056*	0.24	"	"	"	"	"	
Nickel	"	**17**	*0.0044*	0.24	"	"	"	"	"	
Chromium	"	**13**	*0.0047*	0.24	"	"	"	"	"	
Selenium	"	**0.36**	*0.0022*	0.59	"	"	"	"	"	**Ja**
Cobalt	"	**7.5**	*0.00064*	0.24	"	"	"	"	"	**B**
Thallium	"	**0.38**	*0.0047*	0.47	"	"	"	"	"	**Ja, B**
Copper	"	**50**	*0.0038*	0.24	"	"	"	"	"	
Vanadium	"	**24**	*0.0032*	0.24	"	"	"	"	"	**B**
Lead	"	**140**	*0.0012*	0.24	"	"	"	"	"	**B**
Zinc	"	**180**	*0.018*	0.83	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Aluminum	6020 TMP Dry	**15000**	*0.34*	34	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:02	**B**
Arsenic	"	**32**	*0.00088*	0.22	"	"	"	"	"	
Antimony	"	**1.1**	*0.0074*	0.22	"	"	"	"	"	**B**
Barium	"	**100**	*0.0017*	0.22	"	"	"	"	"	**B**
Beryllium	"	**0.61**	*0.00078*	0.22	"	"	"	"	"	
Manganese	"	**490**	*0.018*	0.56	"	"	"	"	"	
Cadmium	"	**0.30**	*0.00053*	0.22	"	"	"	"	"	
Nickel	"	**15**	*0.0042*	0.22	"	"	"	"	"	
Chromium	"	**16**	*0.0045*	0.22	"	"	"	"	"	
Selenium	"	**0.094**	*0.0021*	0.56	"	"	"	"	"	**Ja**
Cobalt	"	**8.2**	*0.00061*	0.22	"	"	"	"	"	**B**
Thallium	"	**0.24**	*0.0045*	0.45	"	"	"	"	"	**Ja, B**
Copper	"	**19**	*0.0036*	0.22	"	"	"	"	"	
Vanadium	"	**24**	*0.0030*	0.22	"	"	"	"	"	**B**
Lead	"	**22**	*0.0011*	0.22	"	"	"	"	"	**B**
Zinc	"	**30**	*0.017*	0.79	"	"	"	"	"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Aluminum	6020 TMP Dry	**9400**	*0.37*	37	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:09	**B**
Arsenic	"	**21**	*0.00097*	0.25	"	"	"	"	"	
Antimony	"	**0.44**	*0.0082*	0.25	"	"	"	"	"	**B**
Barium	"	**61**	*0.0019*	0.25	"	"	"	"	"	**B**
Beryllium	"	**0.37**	*0.00085*	0.25	"	"	"	"	"	
Manganese	"	**370**	*0.020*	0.62	"	"	"	"	"	
Cadmium	"	**0.18**	*0.00058*	0.25	"	"	"	"	"	**Ja**
Nickel	"	**11**	*0.0046*	0.25	"	"	"	"	"	
Chromium	"	**11**	*0.0050*	0.25	"	"	"	"	"	
Selenium	"	**0.14**	*0.0023*	0.62	"	"	"	"	"	**Ja**
Cobalt	"	**6.5**	*0.00067*	0.25	"	"	"	"	"	**B**
Thallium	"	**0.15**	*0.0050*	0.50	"	"	"	"	"	**Ja, B**
Copper	"	**19**	*0.0040*	0.25	"	"	"	"	"	
Vanadium	"	**19**	*0.0033*	0.25	"	"	"	"	"	**B**
Lead	"	**7.2**	*0.0012*	0.25	"	"	"	"	"	**B**
Zinc	"	**31**	*0.019*	0.87	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Aluminum	6020 TMP Dry	**8200**	*0.34*	34	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:16	**B**
Arsenic	"	**8.0**	*0.00088*	0.22	"	"	"	"	"	
Antimony	"	**13**	*0.0074*	0.22	"	"	"	"	"	**B**
Barium	"	**1100**	*0.0017*	0.22	"	"	"	"	"	**B**
Beryllium	"	**1.1**	*0.00078*	0.22	"	"	"	"	"	
Manganese	"	**240**	*0.018*	0.56	"	"	"	"	"	
Cadmium	"	**0.42**	*0.00053*	0.22	"	"	"	"	"	
Nickel	"	**25**	*0.0042*	0.22	"	"	"	"	"	
Chromium	"	**8.6**	*0.0045*	0.22	"	"	"	"	"	
Selenium	"	**0.40**	*0.0021*	0.56	"	"	"	"	"	**Ja**
Cobalt	"	**7.6**	*0.00061*	0.22	"	"	"	"	"	**B**
Thallium	"	**0.12**	*0.0045*	0.45	"	"	"	"	"	**Ja, B**
Copper	"	**160**	*0.0036*	0.22	"	"	"	"	"	
Vanadium	"	**37**	*0.0030*	0.22	"	"	"	"	"	**B**
Lead	"	**410**	*0.0011*	0.22	"	"	"	"	"	**B**
Zinc	"	**70**	*0.017*	0.79	"	"	"	"	"	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Aluminum	6020 TMP Dry	**5100**	*0.33*	33	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:45	**B**
Arsenic	"	**3.7**	*0.00086*	0.22	"	"	"	"	"	
Antimony	"	**1.9**	*0.0073*	0.22	"	"	"	"	"	**B**
Barium	"	**27**	*0.0016*	0.22	"	"	"	"	"	**B**
Beryllium	"	**0.25**	*0.00076*	0.22	"	"	"	"	"	
Manganese	"	**49**	*0.018*	0.55	"	"	"	"	"	
Cadmium	"	**0.19**	*0.00052*	0.22	"	"	"	"	"	**Ja**
Nickel	"	**16**	*0.0041*	0.22	"	"	"	"	"	
Chromium	"	**6.2**	*0.0044*	0.22	"	"	"	"	"	
Selenium	"	**0.11**	*0.0021*	0.55	"	"	"	"	"	**Ja**
Cobalt	"	**4.4**	*0.00059*	0.22	"	"	"	"	"	**B**
Thallium	"	**0.13**	*0.0044*	0.44	"	"	"	"	"	**Ja, B**
Copper	"	**70**	*0.0035*	0.22	"	"	"	"	"	
Vanadium	"	**18**	*0.0030*	0.22	"	"	"	"	"	**B**
Lead	"	**41**	*0.0011*	0.22	"	"	"	"	"	**B**
Zinc	"	**65**	*0.016*	0.77	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Aluminum	6020 TMP Dry	**9000**	*0.35*	35	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:52	**B**
Arsenic	"	**9.0**	*0.00090*	0.23	"	"	"	"	"	
Antimony	"	**0.80**	*0.0076*	0.23	"	"	"	"	"	**B**
Barium	"	**90**	*0.0017*	0.23	"	"	"	"	"	**B**
Beryllium	"	**0.35**	*0.00080*	0.23	"	"	"	"	"	
Manganese	"	**170**	*0.018*	0.58	"	"	"	"	"	
Cadmium	"	**0.16**	*0.00054*	0.23	"	"	"	"	"	**Ja**
Nickel	"	**13**	*0.0043*	0.23	"	"	"	"	"	
Chromium	"	**9.9**	*0.0046*	0.23	"	"	"	"	"	
Selenium	"	**0.16**	*0.0022*	0.58	"	"	"	"	"	**Ja**
Cobalt	"	**8.0**	*0.00062*	0.23	"	"	"	"	"	**B**
Thallium	"	**0.20**	*0.0046*	0.46	"	"	"	"	"	**Ja, B**
Copper	"	**25**	*0.0037*	0.23	"	"	"	"	"	
Vanadium	"	**23**	*0.0031*	0.23	"	"	"	"	"	**B**
Lead	"	**12**	*0.0012*	0.23	"	"	"	"	"	**B**
Zinc	"	**36**	*0.017*	0.81	"	"	"	"	"	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Aluminum	6020 TMP Dry	**9200**	*0.31*	31	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:59	**B**
Arsenic	"	**7.8**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**1.4**	*0.0069*	0.21	"	"	"	"	"	**B**
Barium	"	**90**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.38**	*0.00072*	0.21	"	"	"	"	"	
Manganese	"	**160**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.14**	*0.00049*	0.21	"	"	"	"	"	**Ja**
Nickel	"	**13**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**9.8**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.14**	*0.0020*	0.52	"	"	"	"	"	**Ja**
Cobalt	"	**7.8**	*0.00057*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.18**	*0.0042*	0.42	"	"	"	"	"	**Ja, B**
Copper	"	**45**	*0.0034*	0.21	"	"	"	"	"	
Vanadium	"	**21**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**19**	*0.0010*	0.21	"	"	"	"	"	**B**
Zinc	"	**30**	*0.016*	0.73	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Aluminum	6020 TMP Dry	**6500**	*0.31*	31	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 20:06	**B**
Arsenic	"	**15**	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	**1.2**	*0.0068*	0.21	"	"	"	"	"	**B**
Barium	"	**40**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.29**	*0.00071*	0.21	"	"	"	"	"	
Manganese	"	**170**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.13**	*0.00049*	0.21	"	"	"	"	"	**Ja**
Nickel	"	**12**	*0.0038*	0.21	"	"	"	"	"	
Chromium	"	**7.4**	*0.0041*	0.21	"	"	"	"	"	
Selenium	"	**0.13**	*0.0019*	0.52	"	"	"	"	"	**Ja**
Cobalt	"	**7.9**	*0.00056*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.11**	*0.0041*	0.41	"	"	"	"	"	**Ja, B**
Copper	"	**23**	*0.0033*	0.21	"	"	"	"	"	
Vanadium	"	**17**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**15**	*0.0010*	0.21	"	"	"	"	"	**B**
Zinc	"	**23**	*0.016*	0.72	"	"	"	"	"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Aluminum	6020 TMP Dry	**14000**	*0.32*	32	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 20:14	**B**
Arsenic	"	**28**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**1.6**	*0.0069*	0.21	"	"	"	"	"	**B**
Barium	"	**130**	*0.0016*	0.21	"	"	"	"	"	**B**
Beryllium	"	**0.81**	*0.00073*	0.21	"	"	"	"	"	
Manganese	"	**500**	*0.017*	0.53	"	"	"	"	"	
Cadmium	"	**0.61**	*0.00049*	0.21	"	"	"	"	"	
Nickel	"	**25**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**14**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.19**	*0.0020*	0.53	"	"	"	"	"	**Ja**
Cobalt	"	**11**	*0.00057*	0.21	"	"	"	"	"	**B**
Thallium	"	**0.17**	*0.0042*	0.42	"	"	"	"	"	**Ja, B**
Copper	"	**63**	*0.0034*	0.21	"	"	"	"	"	
Vanadium	"	**29**	*0.0028*	0.21	"	"	"	"	"	**B**
Lead	"	**55**	*0.0011*	0.21	"	"	"	"	"	**B**
Zinc	"	**90**	*0.016*	0.74	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**				**Sampled: 08/27/09 09:40**				
Percent Solids	Moisture	**72**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**28**	*0.10*	0.10	"	"	"	"	"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**				**Sampled: 08/27/09 10:10**				
Percent Solids	Moisture	**91**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**8.9**	*0.10*	0.10	"	"	"	"	"	
SSH0168-03 (GTP3-3.5-082709)		**Soil**				**Sampled: 08/27/09 14:15**				
Percent Solids	Moisture	**91**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**8.6**	*0.10*	0.10	"	"	"	"	"	
SSH0168-04 (GTP3-5-082709)		**Soil**				**Sampled: 08/27/09 14:35**				
Percent Solids	Moisture	**73**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**27**	*0.10*	0.10	"	"	"	"	"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**				**Sampled: 08/27/09 14:49**				
Percent Solids	Moisture	**76**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**24**	*0.10*	0.10	"	"	"	"	"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**				**Sampled: 08/27/09 15:40**				
Percent Solids	Moisture	**94**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**6.0**	*0.10*	0.10	"	"	"	"	"	
SSH0168-07 (GTP4-8.0-082709)		**Soil**				**Sampled: 08/27/09 15:59**				
Percent Solids	Moisture	**88**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**12**	*0.10*	0.10	"	"	"	"	"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**				**Sampled: 08/27/09 16:40**				
Percent Solids	Moisture	**91**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**9.0**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**				**Sampled: 08/27/09 16:53**				
Percent Solids	Moisture	**48**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**52**	*0.10*	0.10	"	"	"	"	"	
SSH0168-11 (GTP6-10-082809)		**Soil**				**Sampled: 08/28/09 10:36**				
Percent Solids	Moisture	**60**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**40**	*0.10*	0.10	"	"	"	"	"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**				**Sampled: 08/28/09 10:10**				
Percent Solids	Moisture	**89**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**11**	*0.10*	0.10	"	"	"	"	"	
SSH0168-13 (GTP6-17-082809)		**Soil**				**Sampled: 08/28/09 11:11**				
Percent Solids	Moisture	**70**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**30**	*0.10*	0.10	"	"	"	"	"	
SSH0168-14 (GTP7-2.5-082809)		**Soil**				**Sampled: 08/28/09 12:50**				
Percent Solids	Moisture	**93**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**6.5**	*0.10*	0.10	"	"	"	"	"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**				**Sampled: 08/28/09 13:27**				
Percent Solids	Moisture	**92**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**7.8**	*0.10*	0.10	"	"	"	"	"	
SSH0168-16 (GTP7-18-082809)		**Soil**				**Sampled: 08/28/09 13:58**				
Percent Solids	Moisture	**90**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**9.9**	*0.10*	0.10	"	"	"	"	"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**				**Sampled: 08/27/09 11:40**				
Percent Solids	Moisture	**80**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**20**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**				**Sampled: 08/27/09 11:58**				
Percent Solids	Moisture	**85**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**15**	*0.10*	0.10	"	"	"	"	"	
SSH0168-19 (GTP2-13-082709)		**Soil**				**Sampled: 08/27/09 17:28**				
Percent Solids	Moisture	**78**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**22**	*0.10*	0.10	"	"	"	"	"	
SSH0168-20 (GTP1-2.5-082709)		**Soil**				**Sampled: 08/27/09 09:20**				
Percent Solids	Moisture	**86**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**14**	*0.10*	0.10	"	"	"	"	"	
SSH0168-21 (GTP5-11-082809)		**Soil**				**Sampled: 08/28/09 09:37**				
Percent Solids	Moisture	**89**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**11**	*0.10*	0.10	"	"	"	"	"	
SSH0168-22 (TS-COMP-1)		**Soil**				**Sampled: 08/27/09 18:10**				
Percent Solids	Moisture	**82**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**18**	*0.10*	0.10	"	"	"	"	"	
SSH0168-23 (TS-COMP-2)		**Soil**				**Sampled: 08/27/09 18:28**				
Percent Solids	Moisture	**90**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**9.7**	*0.10*	0.10	"	"	"	"	"	
SSH0168-24 (TS-COMP-3)		**Soil**				**Sampled: 08/27/09 16:40**				
Percent Solids	Moisture	**90**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**10**	*0.10*	0.10	"	"	"	"	"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**				**Sampled: 08/27/09 15:49**				
Percent Solids	Moisture	**90**	*0.10*	0.10	%	1x	49710	09/04/09 11:04	09/04/09 11:04	
Percent Moisture	"	**10**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Bromomethane	8260B STD Dry	ND	*0.00048*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 14:26	
Chloroethane	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000092*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00015*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0025	"	"	"	"	"	
Bromoform	"	ND	*0.000089*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*111%*			*85 - 115 %*	"		"		
1,2-Dichloroethane-d4 (Surr)		*176%*			*75 - 125 %*	"		"		***X. I***
4-Bromofluorobenzene (Surr)		*81%*			*85 - 120 %*	"		"		***X. I***
SSH0168-01RE1 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0069*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:18	
1,2-Dichlorobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.050*	0.15	"	"	"	"	"	
Bromomethane	"	ND	*0.096*	0.54	"	"	"	"	"	
Chloroethane	"	ND	*0.089*	1.5	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.031*	0.15	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.15	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0081*	0.15	"	"	"	"	"	
Chloromethane	"	ND	*0.23*	1.5	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.019*	0.15	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.019*	0.077	"	"	"	"	"	
sec-Butylbenzene	"	**0.41**	*0.019*	0.15	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0066*	0.031	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.15	"	"	"	"	"	
Methylene Chloride	"	**0.057**	*0.015*	0.15	"	"	"	"	"	**Ja, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01RE1 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
4-Isopropyltoluene	8260B STD Dry	**0.13**	*0.011*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:18	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0093*	0.15	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.014*	0.15	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.015*	0.15	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.046*	0.15	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.015*	0.062	"	"	"	"	"	
Benzene	"	ND	*0.0096*	0.062	"	"	"	"	"	
Chloroform	"	ND	*0.0081*	0.15	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.019*	0.15	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0085*	0.15	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.014*	0.077	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.062	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.015*	0.046	"	"	"	"	"	
Dibromomethane	"	ND	*0.015*	0.15	"	"	"	"	"	
Toluene	"	**0.057**	*0.0093*	0.15	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0069*	0.046	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0093*	0.062	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0089*	0.15	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0081*	0.077	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.019*	0.15	"	"	"	"	"	
Ethylbenzene	"	**0.081**	*0.014*	0.15	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.019*	0.15	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.031*	0.15	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.013*	0.039	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.12**	*0.030*	0.15	"	"	"	"	"	**Ja**
o-Xylene	"	**0.052**	*0.0089*	0.15	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.015*	0.15	"	"	"	"	"	
Bromoform	"	ND	*0.042*	0.15	"	"	"	"	"	
Isopropylbenzene	"	**0.10**	*0.0069*	0.15	"	"	"	"	"	**Ja**
Bromobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
N-Propylbenzene	"	**0.094**	*0.011*	0.15	"	"	"	"	"	**Ja**
1,2,3-Trichloropropane	"	ND	*0.045*	0.15	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.021*	0.15	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.016*	0.15	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.028*	0.15	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.25*	0.77	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01RE1 (GTP1-10.5-082709)		**Soil**				**Sampled: 08/27/09 09:40**				
1,2,4-Trichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.022*	0.15	"	"	"	"	"	
Naphthalene	"	ND	*0.023*	0.15	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*98%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*110%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*106%*		*75 - 125 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**				**Sampled: 08/27/09 10:10**				
Bromomethane	8260B STD Dry	ND	*0.00037*	0.00095	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 14:50	
Chloroethane	"	ND	*0.00026*	0.00095	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00095	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00017*	0.00095	"	"	"	"	"	
Chloroform	"	ND	*0.00014*	0.00095	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00095	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00015*	0.00095	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00035*	0.00095	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00095	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00016*	0.00095	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000070*	0.00095	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00011*	0.00095	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000084*	0.0019	"	"	"	"	"	
Bromoform	"	ND	*0.000069*	0.00095	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00034*	0.00095	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00017*	0.0019	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00032*	0.00095	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*120%*		*85 - 115 %*	"			"	***X. I***
1,2-Dichloroethane-d4 (Surr)			*119%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*119%*		*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02RE1 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0036*	0.080	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:42	
1,2-Dichlorobenzene	"	ND	*0.0052*	0.080	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.026*	0.080	"	"	"	"	"	
Bromomethane	"	ND	*0.050*	0.28	"	"	"	"	"	
Chloroethane	"	ND	*0.046*	0.80	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.016*	0.080	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0064*	0.080	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0042*	0.080	"	"	"	"	"	
Chloromethane	"	ND	*0.12*	0.80	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.010*	0.080	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.010*	0.040	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0034*	0.016	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0074*	0.080	"	"	"	"	"	
Methylene Chloride	"	**0.032**	*0.0076*	0.080	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0056*	0.080	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0048*	0.080	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0070*	0.080	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0076*	0.080	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.024*	0.080	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0080*	0.032	"	"	"	"	"	
Benzene	"	ND	*0.0050*	0.032	"	"	"	"	"	
Chloroform	"	ND	*0.0042*	0.080	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0064*	0.080	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.010*	0.080	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0044*	0.080	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0074*	0.040	"	"	"	"	"	
Trichloroethene	"	ND	*0.0068*	0.032	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0078*	0.024	"	"	"	"	"	
Dibromomethane	"	ND	*0.0080*	0.080	"	"	"	"	"	
Toluene	"	ND	*0.0048*	0.080	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0060*	0.080	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0036*	0.024	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0048*	0.032	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0046*	0.080	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0042*	0.040	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02RE1 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.010*	0.080	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:42	
Ethylbenzene	"	ND	*0.0074*	0.080	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0096*	0.080	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.016*	0.080	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0066*	0.020	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.016**	*0.016*	0.080	"	"	"	"	"	**Ja**
o-Xylene	"	ND	*0.0046*	0.080	"	"	"	"	"	
Styrene	"	ND	*0.0076*	0.080	"	"	"	"	"	
Bromoform	"	ND	*0.022*	0.080	"	"	"	"	"	
Isopropylbenzene	"	**0.014**	*0.0036*	0.080	"	"	"	"	"	**Ja**
Bromobenzene	"	ND	*0.0054*	0.080	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0056*	0.080	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.023*	0.080	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.011*	0.080	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0084*	0.080	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.015*	0.080	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.13*	0.40	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.011*	0.080	"	"	"	"	"	
Naphthalene	"	ND	*0.012*	0.080	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*98%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*109%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*105%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*104%*			*75 - 125 %*	"			"	
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Bromomethane	8260B STD Dry	ND	*0.00062*	0.0016	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:14	
Chloroethane	"	ND	*0.00043*	0.0016	"	"	"	"	"	
Chloromethane	"	ND	*0.00028*	0.0016	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00029*	0.0016	"	"	"	"	"	
Chloroform	"	ND	*0.00024*	0.0016	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00021*	0.0016	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00026*	0.0016	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00060*	0.0016	"	"	"	"	"	
Trichloroethene	"	ND	*0.00028*	0.0016	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00028*	0.0016	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00012*	0.0016	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00019*	0.0016	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:14	
1,1,2,2-Tetrachloroethane	"	ND	*0.00014*	0.0032	"	"	"	"	"	
Bromoform	"	ND	*0.00012*	0.0016	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00058*	0.0016	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00029*	0.0032	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00054*	0.0016	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*101%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*117%*		*85 - 120 %*	"			"	
SSH0168-03RE1 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0047*	0.10	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:06	
1,2-Dichlorobenzene	"	ND	*0.0068*	0.10	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.034*	0.10	"	"	"	"	"	
Bromomethane	"	ND	*0.066*	0.37	"	"	"	"	"	
Chloroethane	"	ND	*0.060*	1.0	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.021*	0.10	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0084*	0.10	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.017**	*0.0055*	0.10	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.16*	1.0	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.013*	0.10	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.013*	0.052	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0045*	0.021	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0097*	0.10	"	"	"	"	"	
Methylene Chloride	"	**0.51**	*0.010*	0.10	"	"	"	"	"	**B**
4-Isopropyltoluene	"	**0.028**	*0.0073*	0.10	"	"	"	"	"	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0063*	0.10	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0092*	0.10	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.010*	0.10	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.031*	0.10	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.010*	0.042	"	"	"	"	"	
Benzene	"	**0.0097**	*0.0066*	0.042	"	"	"	"	"	**Ja**
Chloroform	"	ND	*0.0055*	0.10	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0084*	0.10	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.013*	0.10	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03RE1 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0058*	0.10	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:06	
Carbon tetrachloride	"	ND	*0.0097*	0.052	"	"	"	"	"	
Trichloroethene	"	ND	*0.0089*	0.042	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.010*	0.031	"	"	"	"	"	
Dibromomethane	"	ND	*0.010*	0.10	"	"	"	"	"	
Toluene	"	**0.20**	*0.0063*	0.10	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0079*	0.10	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0047*	0.031	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0063*	0.042	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0060*	0.10	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0055*	0.052	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.013*	0.10	"	"	"	"	"	
Ethylbenzene	"	**0.012**	*0.0097*	0.10	"	"	"	"	"	Ja
1,1,1,2-Tetrachloroethane	"	ND	*0.013*	0.10	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.021*	0.10	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0087*	0.026	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.061**	*0.020*	0.10	"	"	"	"	"	Ja
o-Xylene	"	ND	*0.0060*	0.10	"	"	"	"	"	
Styrene	"	ND	*0.010*	0.10	"	"	"	"	"	
Bromoform	"	ND	*0.029*	0.10	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0047*	0.10	"	"	"	"	"	
Bromobenzene	"	ND	*0.0071*	0.10	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0073*	0.10	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.030*	0.10	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.014*	0.10	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.011*	0.10	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.019*	0.10	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.17*	0.52	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.015*	0.10	"	"	"	"	"	
Naphthalene	"	**0.067**	*0.016*	0.10	"	"	"	"	"	Ja

Surrogate(s):	*Toluene-d8 (Surr)*	*101%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*106%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*107%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*106%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Bromomethane	8260B STD Dry	ND	*0.00075*	0.0019	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:38	
Chloroethane	"	ND	*0.00052*	0.0019	"	"	"	"	"	
Chloromethane	"	ND	*0.00034*	0.0019	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00035*	0.0019	"	"	"	"	"	
Chloroform	"	ND	*0.00029*	0.0019	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00026*	0.0019	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00031*	0.0019	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00072*	0.0019	"	"	"	"	"	
Trichloroethene	"	ND	*0.00034*	0.0019	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00033*	0.0019	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00014*	0.0019	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00023*	0.0019	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00017*	0.0039	"	"	"	"	"	
Bromoform	"	ND	*0.00014*	0.0019	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00070*	0.0019	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00035*	0.0039	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00065*	0.0019	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*115%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*99%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*118%*			*85 - 120 %*	"			"	
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0039*	0.088	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:29	
1,2-Dichlorobenzene	"	ND	*0.0057*	0.088	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.028*	0.088	"	"	"	"	"	
Bromomethane	"	ND	*0.055*	0.31	"	"	"	"	"	
Chloroethane	"	ND	*0.050*	0.88	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.018*	0.088	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0070*	0.088	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.021**	*0.0046*	0.088	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.13*	0.88	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.011*	0.088	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.011*	0.044	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0037*	0.018	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0081*	0.088	"	"	"	"	"	
Methylene Chloride	"	**0.032**	*0.0083*	0.088	"	"	"	"	"	**Ja, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
4-Isopropyltoluene	8260B STD Dry	**18**	*0.061*	0.88	mg/Kg dry	10x	49928	09/09/09 15:36	09/10/09 23:36	
cis-1,2-Dichloroethene	"	ND	*0.0053*	0.088	"	1x	"	"	09/09/09 18:29	
trans-1,2-Dichloroethene	"	ND	*0.0077*	0.088	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0083*	0.088	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.026*	0.088	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0088*	0.035	"	"	"	"	"	
Benzene	"	ND	*0.0055*	0.035	"	"	"	"	"	
Chloroform	"	ND	*0.0046*	0.088	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0070*	0.088	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.011*	0.088	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0048*	0.088	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0081*	0.044	"	"	"	"	"	
Trichloroethene	"	ND	*0.0074*	0.035	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0085*	0.026	"	"	"	"	"	
Dibromomethane	"	ND	*0.0088*	0.088	"	"	"	"	"	
Toluene	"	**0.081**	*0.0053*	0.088	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0066*	0.088	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0039*	0.026	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0053*	0.035	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0050*	0.088	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0046*	0.044	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.011*	0.088	"	"	"	"	"	
Ethylbenzene	"	**0.072**	*0.0081*	0.088	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.011*	0.088	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.018*	0.088	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0072*	0.022	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.025**	*0.017*	0.088	"	"	"	"	"	**Ja**
o-Xylene	"	**0.010**	*0.0050*	0.088	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.0083*	0.088	"	"	"	"	"	
Bromoform	"	ND	*0.024*	0.088	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0039*	0.088	"	"	"	"	"	
Bromobenzene	"	ND	*0.0059*	0.088	"	"	"	"	"	
N-Propylbenzene	"	**0.056**	*0.0061*	0.088	"	"	"	"	"	**Ja**
1,2,3-Trichloropropane	"	ND	*0.025*	0.088	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.012*	0.088	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0092*	0.088	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.016*	0.088	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.14*	0.44	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:29	
1,2,4-Trichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.012*	0.088	"	"	"	"	"	
Naphthalene	"	**0.050**	*0.013*	0.088	"	"	"	"	"	**Ja**
Surrogate(s): Toluene-d8 (Surr)			*98%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*114%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*101%*		*75 - 125 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Bromomethane	8260B STD Dry	ND	*0.00038*	0.00099	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:02	
Chloroethane	"	ND	*0.00026*	0.00099	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00099	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00018*	0.00099	"	"	"	"	"	
Chloroform	"	ND	*0.00015*	0.00099	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00099	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00016*	0.00099	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00037*	0.00099	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00099	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00017*	0.00099	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000073*	0.00099	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00012*	0.00099	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000087*	0.0020	"	"	"	"	"	
Bromoform	"	ND	*0.000071*	0.00099	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00036*	0.00099	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00018*	0.0020	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00033*	0.00099	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*98%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*100%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*108%*		*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05RE1 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0032*	0.070	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:53	
1,2-Dichlorobenzene	"	ND	*0.0046*	0.070	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.023*	0.070	"	"	"	"	"	
Bromomethane	"	ND	*0.044*	0.25	"	"	"	"	"	
Chloroethane	"	ND	*0.040*	0.70	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.014*	0.070	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0056*	0.070	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0037*	0.070	"	"	"	"	"	
Chloromethane	"	ND	*0.11*	0.70	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0088*	0.035	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0030*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0065*	0.070	"	"	"	"	"	
Methylene Chloride	"	**0.13**	*0.0067*	0.070	"	"	"	"	"	**B**
4-Isopropyltoluene	"	**0.10**	*0.0049*	0.070	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0042*	0.070	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0062*	0.070	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0067*	0.070	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.021*	0.070	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0070*	0.028	"	"	"	"	"	
Benzene	"	ND	*0.0044*	0.028	"	"	"	"	"	
Chloroform	"	ND	*0.0037*	0.070	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0056*	0.070	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0039*	0.070	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0065*	0.035	"	"	"	"	"	
Trichloroethene	"	ND	*0.0060*	0.028	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0069*	0.021	"	"	"	"	"	
Dibromomethane	"	ND	*0.0070*	0.070	"	"	"	"	"	
Toluene	"	**0.010**	*0.0042*	0.070	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0053*	0.070	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0032*	0.021	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0042*	0.028	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0040*	0.070	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0037*	0.035	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05RE1 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0088*	0.070	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:53	
Ethylbenzene	"	ND	*0.0065*	0.070	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0084*	0.070	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.014*	0.070	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0058*	0.018	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.014**	*0.014*	0.070	"	"	"	"	"	**Ja**
o-Xylene	"	**0.0067**	*0.0040*	0.070	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.0067*	0.070	"	"	"	"	"	
Bromoform	"	ND	*0.019*	0.070	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0032*	0.070	"	"	"	"	"	
Bromobenzene	"	ND	*0.0047*	0.070	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0049*	0.070	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.020*	0.070	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0095*	0.070	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0074*	0.070	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.013*	0.070	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.12*	0.35	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0098*	0.070	"	"	"	"	"	
Naphthalene	"	ND	*0.011*	0.070	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*	*100%*			*85 - 115 %*	"			"	
	Ethylbenzene-d10	*113%*			*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)	*106%*			*85 - 120 %*	"			"	
	Fluorobenzene (Surr)	*107%*			*75 - 125 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Bromomethane	8260B STD Dry	ND	*0.00046*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:26	
Chloroethane	"	ND	*0.00032*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00044*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000088*	0.0012	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00014*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:26	
1,1,2,2-Tetrachloroethane	"	ND	*0.00010*	0.0024	"	"	"	"	"	
Bromoform	"	ND	*0.000085*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00043*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00022*	0.0024	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*99%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*101%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*108%*		*85 - 120 %*	"			"	
SSH0168-06RE1 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0020*	0.044	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:18	
1,2-Dichlorobenzene	"	ND	*0.0029*	0.044	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.014*	0.044	"	"	"	"	"	
Bromomethane	"	ND	*0.028*	0.16	"	"	"	"	"	
Chloroethane	"	ND	*0.026*	0.44	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0089*	0.044	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0036*	0.044	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.41**	*0.0023*	0.044	"	"	"	"	"	
Chloromethane	"	ND	*0.067*	0.44	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0055*	0.044	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0055*	0.022	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0019*	0.0089	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0041*	0.044	"	"	"	"	"	
Methylene Chloride	"	**0.016**	*0.0042*	0.044	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	**0.022**	*0.0031*	0.044	"	"	"	"	"	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0027*	0.044	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0039*	0.044	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0042*	0.044	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.013*	0.044	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0044*	0.018	"	"	"	"	"	
Benzene	"	**0.026**	*0.0028*	0.018	"	"	"	"	"	
Chloroform	"	ND	*0.0023*	0.044	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0036*	0.044	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0055*	0.044	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06RE1 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0024*	0.044	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:18	
Carbon tetrachloride	"	ND	*0.0041*	0.022	"	"	"	"	"	
Trichloroethene	"	ND	*0.0038*	0.018	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0043*	0.013	"	"	"	"	"	
Dibromomethane	"	ND	*0.0044*	0.044	"	"	"	"	"	
Toluene	"	**0.21**	*0.0027*	0.044	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0033*	0.044	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0020*	0.013	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0027*	0.018	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0026*	0.044	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0023*	0.022	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0055*	0.044	"	"	"	"	"	
Ethylbenzene	"	**0.039**	*0.0041*	0.044	"	"	"	"	"	Ja
1,1,1,2-Tetrachloroethane	"	ND	*0.0053*	0.044	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0089*	0.044	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0037*	0.011	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.59**	*0.0087*	0.044	"	"	"	"	"	
o-Xylene	"	**0.41**	*0.0026*	0.044	"	"	"	"	"	
Styrene	"	ND	*0.0042*	0.044	"	"	"	"	"	
Bromoform	"	ND	*0.012*	0.044	"	"	"	"	"	
Isopropylbenzene	"	**0.0066**	*0.0020*	0.044	"	"	"	"	"	Ja
Bromobenzene	"	ND	*0.0030*	0.044	"	"	"	"	"	
N-Propylbenzene	"	**0.019**	*0.0031*	0.044	"	"	"	"	"	Ja
1,2,3-Trichloropropane	"	ND	*0.013*	0.044	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0060*	0.044	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.27**	*0.0047*	0.044	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0081*	0.044	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.073*	0.22	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0062*	0.044	"	"	"	"	"	
Naphthalene	"	**0.14**	*0.0067*	0.044	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*99%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*114%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*103%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Bromomethane	8260B STD Dry	ND	*0.00046*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:49	
Chloroethane	"	ND	*0.00032*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000089*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0024	"	"	"	"	"	
Bromoform	"	ND	*0.000086*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00043*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00022*	0.0024	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*102%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*102%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*106%*			*85 - 120 %*	"			"	
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0022*	0.048	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	
1,2-Dichlorobenzene	"	ND	*0.0031*	0.048	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.016*	0.048	"	"	"	"	"	
Bromomethane	"	ND	*0.030*	0.17	"	"	"	"	"	
Chloroethane	"	ND	*0.028*	0.48	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0096*	0.048	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0039*	0.048	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0025*	0.048	"	"	"	"	"	
Chloromethane	"	ND	*0.072*	0.48	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0060*	0.024	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0020*	0.0096	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0045*	0.048	"	"	"	"	"	
Methylene Chloride	"	**0.019**	*0.0046*	0.048	"	"	"	"	"	**Ja, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
4-Isopropyltoluene	8260B STD Dry	**0.014**	*0.0034*	0.048	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0029*	0.048	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0042*	0.048	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0046*	0.048	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.014*	0.048	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0048*	0.019	"	"	"	"	"	
Benzene	"	ND	*0.0030*	0.019	"	"	"	"	"	
Chloroform	"	ND	*0.0025*	0.048	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0039*	0.048	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0026*	0.048	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0045*	0.024	"	"	"	"	"	
Trichloroethene	"	ND	*0.0041*	0.019	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0047*	0.014	"	"	"	"	"	
Dibromomethane	"	ND	*0.0048*	0.048	"	"	"	"	"	
Toluene	"	ND	*0.0029*	0.048	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0036*	0.048	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0022*	0.014	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0029*	0.019	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0028*	0.048	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0025*	0.024	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0060*	0.048	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0045*	0.048	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0058*	0.048	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0096*	0.048	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0040*	0.012	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.012**	*0.0094*	0.048	"	"	"	"	"	**Ja**
o-Xylene	"	ND	*0.0028*	0.048	"	"	"	"	"	
Styrene	"	ND	*0.0046*	0.048	"	"	"	"	"	
Bromoform	"	ND	*0.013*	0.048	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0022*	0.048	"	"	"	"	"	
Bromobenzene	"	ND	*0.0033*	0.048	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0034*	0.048	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.014*	0.048	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0065*	0.048	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0051*	0.048	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0088*	0.048	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.079*	0.24	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	
1,2,4-Trichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0067*	0.048	"	"	"	"	"	
Naphthalene	"	ND	*0.0072*	0.048	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*98%*		*85 - 115 %*	"			"	
	Ethylbenzene-d10		*105%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*102%*		*85 - 120 %*	"			"	
	Fluorobenzene (Surr)		*106%*		*75 - 125 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Bromomethane	8260B STD Dry	ND	*0.00043*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:13	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00020*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000083*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000099*	0.0023	"	"	"	"	"	
Bromoform	"	ND	*0.000081*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0023	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00038*	0.0011	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*99%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*103%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*105%*		*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09RE1 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0027*	0.060	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:06	
1,2-Dichlorobenzene	"	ND	*0.0039*	0.060	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.019*	0.060	"	"	"	"	"	
Bromomethane	"	ND	*0.037*	0.21	"	"	"	"	"	
Chloroethane	"	ND	*0.034*	0.60	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.060	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0048*	0.060	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0031*	0.060	"	"	"	"	"	
Chloromethane	"	ND	*0.090*	0.60	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0075*	0.030	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0025*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0055*	0.060	"	"	"	"	"	
Methylene Chloride	"	**0.047**	*0.0057*	0.060	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0042*	0.060	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0036*	0.060	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0052*	0.060	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0057*	0.060	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.060	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0060*	0.024	"	"	"	"	"	
Benzene	"	ND	*0.0037*	0.024	"	"	"	"	"	
Chloroform	"	ND	*0.0031*	0.060	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0048*	0.060	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0033*	0.060	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0055*	0.030	"	"	"	"	"	
Trichloroethene	"	ND	*0.0051*	0.024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0058*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0060*	0.060	"	"	"	"	"	
Toluene	"	ND	*0.0036*	0.060	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0045*	0.060	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0027*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0036*	0.024	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0034*	0.060	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0031*	0.030	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09RE1 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0075*	0.060	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:06	
Ethylbenzene	"	ND	*0.0055*	0.060	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0072*	0.060	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.060	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0049*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.012*	0.060	"	"	"	"	"	
o-Xylene	"	ND	*0.0034*	0.060	"	"	"	"	"	
Styrene	"	ND	*0.0057*	0.060	"	"	"	"	"	
Bromoform	"	ND	*0.016*	0.060	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0027*	0.060	"	"	"	"	"	
Bromobenzene	"	ND	*0.0040*	0.060	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0042*	0.060	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.017*	0.060	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0081*	0.060	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0063*	0.060	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.011*	0.060	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.099*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0084*	0.060	"	"	"	"	"	
Naphthalene	"	ND	*0.0090*	0.060	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*97%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*104%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*97%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*103%*		*75 - 125 %*	"			"	
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Bromomethane	8260B STD Dry	ND	*0.0013*	0.0035	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:37	
Chloroethane	"	ND	*0.00093*	0.0035	"	"	"	"	"	
Chloromethane	"	ND	*0.00061*	0.0035	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00061*	0.0035	"	"	"	"	"	
Chloroform	"	ND	*0.00051*	0.0035	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00046*	0.0035	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00055*	0.0035	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0013*	0.0035	"	"	"	"	"	
Trichloroethene	"	ND	*0.00061*	0.0035	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00059*	0.0035	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00026*	0.0035	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00040*	0.0035	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:37	
1,1,2,2-Tetrachloroethane	"	ND	*0.00030*	0.0069	"	"	"	"	"	
Bromoform	"	ND	*0.00025*	0.0035	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0012*	0.0035	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00063*	0.0069	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0012*	0.0035	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*116%*			*85 - 115 %*	"			"	***X. I***
1,2-Dichloroethane-d4 (Surr)		*105%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*133%*			*85 - 120 %*	"			"	***X. I***
SSH0168-10RE1 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0070*	0.16	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:30	
1,2-Dichlorobenzene	"	ND	*0.010*	0.16	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.051*	0.16	"	"	"	"	"	
Bromomethane	"	ND	*0.097*	0.54	"	"	"	"	"	
Chloroethane	"	ND	*0.089*	1.6	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.031*	0.16	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.16	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.12**	*0.0082*	0.16	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.23*	1.6	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.019*	0.16	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.019*	0.078	"	"	"	"	"	
sec-Butylbenzene	"	**0.036**	*0.019*	0.16	"	"	"	"	"	**Ja**
Vinyl chloride	"	ND	*0.0066*	0.031	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.16	"	"	"	"	"	
Methylene Chloride	"	**0.054**	*0.015*	0.16	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	**0.15**	*0.011*	0.16	"	"	"	"	"	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0093*	0.16	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.014*	0.16	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.015*	0.16	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.047*	0.16	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.016*	0.062	"	"	"	"	"	
Benzene	"	ND	*0.0097*	0.062	"	"	"	"	"	
Chloroform	"	ND	*0.0082*	0.16	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.16	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.019*	0.16	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10RE1 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0086*	0.16	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:30	
Carbon tetrachloride	"	ND	*0.014*	0.078	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.062	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.015*	0.047	"	"	"	"	"	
Dibromomethane	"	ND	*0.016*	0.16	"	"	"	"	"	
Toluene	"	**0.095**	*0.0093*	0.16	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.012*	0.16	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0070*	0.047	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0093*	0.062	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0089*	0.16	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0082*	0.078	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.019*	0.16	"	"	"	"	"	
Ethylbenzene	"	**0.088**	*0.014*	0.16	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.019*	0.16	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.031*	0.16	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.013*	0.039	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.030*	0.16	"	"	"	"	"	
o-Xylene	"	**0.012**	*0.0089*	0.16	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.015*	0.16	"	"	"	"	"	
Bromoform	"	ND	*0.043*	0.16	"	"	"	"	"	
Isopropylbenzene	"	**0.030**	*0.0070*	0.16	"	"	"	"	"	**Ja**
Bromobenzene	"	ND	*0.010*	0.16	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.011*	0.16	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.045*	0.16	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.021*	0.16	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.058**	*0.016*	0.16	"	"	"	"	"	**Ja**
n-Butylbenzene	"	ND	*0.028*	0.16	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.26*	0.78	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.022*	0.16	"	"	"	"	"	
Naphthalene	"	**0.090**	*0.023*	0.16	"	"	"	"	"	**Ja**

Surrogate(s):	*Toluene-d8 (Surr)*	*97%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*111%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*103%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Bromomethane	8260B STD Dry	ND	*0.0011*	0.0028	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:36	
Chloroethane	"	ND	*0.00076*	0.0028	"	"	"	"	"	
Chloromethane	"	ND	*0.00050*	0.0028	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00051*	0.0028	"	"	"	"	"	
Chloroform	"	ND	*0.00042*	0.0028	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00038*	0.0028	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00046*	0.0028	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0011*	0.0028	"	"	"	"	"	
Trichloroethene	"	ND	*0.00050*	0.0028	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00049*	0.0028	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00021*	0.0028	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00033*	0.0028	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00025*	0.0057	"	"	"	"	"	
Bromoform	"	ND	*0.00021*	0.0028	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0010*	0.0028	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00052*	0.0057	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00096*	0.0028	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*	*117%*			*85 - 115 %*	"		"		***X. I***
	1,2-Dichloroethane-d4 (Surr)	*106%*			*75 - 125 %*	"		"		
	4-Bromofluorobenzene (Surr)	*128%*			*85 - 120 %*	"		"		***X. I***
SSH0168-11RE1 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0064*	0.14	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:56	
1,2-Dichlorobenzene	"	ND	*0.0093*	0.14	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.047*	0.14	"	"	"	"	"	
Bromomethane	"	ND	*0.090*	0.50	"	"	"	"	"	
Chloroethane	"	ND	*0.082*	1.4	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.029*	0.14	"	"	"	"	"	
tert-Butylbenzene	"	**0.16**	*0.011*	0.14	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**53**	*0.075*	1.4	"	10x	"	"	09/11/09 00:00	
Chloromethane	"	ND	*0.21*	1.4	"	1x	"	"	09/10/09 00:56	
Trichlorofluoromethane	"	ND	*0.018*	0.14	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.018*	0.072	"	"	"	"	"	
sec-Butylbenzene	"	**4.5**	*0.018*	0.14	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0061*	0.029	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.013*	0.14	"	"	"	"	"	
Methylene Chloride	"	**0.40**	*0.014*	0.14	"	"	"	"	"	**B**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.



Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11RE1 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
4-Isopropyltoluene	8260B STD Dry	**27**	*0.010*	0.14	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:56	
cis-1,2-Dichloroethene	"	ND	*0.0086*	0.14	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.013*	0.14	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.014*	0.14	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.043*	0.14	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.014*	0.057	"	"	"	"	"	
Benzene	"	**0.045**	*0.0090*	0.057	"	"	"	"	"	**Ja**
Chloroform	"	ND	*0.0075*	0.14	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.011*	0.14	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.018*	0.14	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0079*	0.14	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.013*	0.072	"	"	"	"	"	
Trichloroethene	"	ND	*0.012*	0.057	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.014*	0.043	"	"	"	"	"	
Dibromomethane	"	ND	*0.014*	0.14	"	"	"	"	"	
Toluene	"	**0.12**	*0.0086*	0.14	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.011*	0.14	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0064*	0.043	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0086*	0.057	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0082*	0.14	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0075*	0.072	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.018*	0.14	"	"	"	"	"	
Ethylbenzene	"	**3.2**	*0.013*	0.14	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.017*	0.14	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.029*	0.14	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.012*	0.036	"	"	"	"	"	
m-Xylene & p-Xylene	"	**9.0**	*0.028*	0.14	"	"	"	"	"	
o-Xylene	"	**5.5**	*0.0082*	0.14	"	"	"	"	"	
Styrene	"	ND	*0.014*	0.14	"	"	"	"	"	
Bromoform	"	ND	*0.039*	0.14	"	"	"	"	"	
Isopropylbenzene	"	**1.6**	*0.0064*	0.14	"	"	"	"	"	
Bromobenzene	"	ND	*0.0097*	0.14	"	"	"	"	"	
N-Propylbenzene	"	**4.3**	*0.010*	0.14	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.042*	0.14	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.019*	0.14	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**13**	*0.015*	0.14	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.026*	0.14	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.24*	0.72	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11RE1 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
1,2,4-Trichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.020*	0.14	"	"	"	"	"	
Naphthalene	"	**38**	*0.21*	1.4	"	10x	"	"	09/11/09 00:00	
Surrogate(s): Toluene-d8 (Surr)			*100%*			*85 - 115 %*	*1x*		*09/10/09 00:56*	
Ethylbenzene-d10			*110%*			*75 - 125 %*	"		"	
4-Bromofluorobenzene (Surr)			*102%*			*85 - 120 %*	"		"	
Fluorobenzene (Surr)			*106%*			*75 - 125 %*	"		"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Bromomethane	8260B STD Dry	ND	*0.00044*	0.0011	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 17:54	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00020*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000084*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00010*	0.0023	"	"	"	"	"	
Bromoform	"	ND	*0.000082*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00021*	0.0023	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00038*	0.0011	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*100%*			*85 - 115 %*	"		"	
1,2-Dichloroethane-d4 (Surr)			*104%*			*75 - 125 %*	"		"	
4-Bromofluorobenzene (Surr)			*109%*			*85 - 120 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12RE1 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0025*	0.056	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:55	
1,2-Dichlorobenzene	"	ND	*0.0036*	0.056	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.018*	0.056	"	"	"	"	"	
Bromomethane	"	ND	*0.035*	0.19	"	"	"	"	"	
Chloroethane	"	ND	*0.032*	0.56	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.056	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0044*	0.056	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0029*	0.056	"	"	"	"	"	
Chloromethane	"	ND	*0.083*	0.56	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0069*	0.028	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0024*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0051*	0.056	"	"	"	"	"	
Methylene Chloride	"	**0.043**	*0.0053*	0.056	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0039*	0.056	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0033*	0.056	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0049*	0.056	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0053*	0.056	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.017*	0.056	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0056*	0.022	"	"	"	"	"	
Benzene	"	ND	*0.0035*	0.022	"	"	"	"	"	
Chloroform	"	ND	*0.0029*	0.056	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0044*	0.056	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0031*	0.056	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0051*	0.028	"	"	"	"	"	
Trichloroethene	"	ND	*0.0047*	0.022	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0054*	0.017	"	"	"	"	"	
Dibromomethane	"	ND	*0.0056*	0.056	"	"	"	"	"	
Toluene	"	ND	*0.0033*	0.056	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0042*	0.056	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0025*	0.017	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0033*	0.022	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0032*	0.056	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0029*	0.028	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12RE1 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0069*	0.056	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:55	
Ethylbenzene	"	ND	*0.0051*	0.056	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0067*	0.056	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.056	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0046*	0.014	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.011*	0.056	"	"	"	"	"	
o-Xylene	"	ND	*0.0032*	0.056	"	"	"	"	"	
Styrene	"	ND	*0.0053*	0.056	"	"	"	"	"	
Bromoform	"	ND	*0.015*	0.056	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0025*	0.056	"	"	"	"	"	
Bromobenzene	"	ND	*0.0037*	0.056	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0039*	0.056	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.016*	0.056	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0075*	0.056	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0058*	0.056	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.010*	0.056	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.092*	0.28	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0078*	0.056	"	"	"	"	"	
Naphthalene	"	ND	*0.0083*	0.056	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*97%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*107%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*98%*			*85 - 120 %*	"			"	
Trifluorotoluene (Surr)		*94%*			*75 - 125 %*	"			"	
Fluorobenzene (Surr)		*104%*			*75 - 125 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Bromomethane	8260B STD Dry	ND	*0.00058*	0.0015	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:18	
Chloroethane	"	ND	*0.00041*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00027*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00022*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00024*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00056*	0.0015	"	"	"	"	"	
Trichloroethene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00026*	0.0015	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Dichlorobromomethane	8260B STD Dry	ND	*0.00011*	0.0015	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:18	
cis-1,3-Dichloropropene	"	ND	*0.00018*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00013*	0.0030	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00055*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00028*	0.0030	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00051*	0.0015	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*103%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*101%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*120%*			*85 - 120 %*	"			"	
SSH0168-13RE1 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0040*	0.089	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:18	
1,2-Dichlorobenzene	"	ND	*0.0058*	0.089	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.029*	0.089	"	"	"	"	"	
Bromomethane	"	ND	*0.055*	0.31	"	"	"	"	"	
Chloroethane	"	ND	*0.051*	0.89	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.018*	0.089	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0071*	0.089	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.42**	*0.0047*	0.089	"	"	"	"	"	
Chloromethane	"	ND	*0.13*	0.89	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.011*	0.089	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.011*	0.044	"	"	"	"	"	
sec-Butylbenzene	"	**0.051**	*0.011*	0.089	"	"	"	"	"	**Ja**
Vinyl chloride	"	ND	*0.0038*	0.018	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0082*	0.089	"	"	"	"	"	
Methylene Chloride	"	**0.30**	*0.0084*	0.089	"	"	"	"	"	**B**
4-Isopropyltoluene	"	**0.55**	*0.0062*	0.089	"	"	"	"	"	
cis-1,2-Dichloroethene	"	**0.095**	*0.0053*	0.089	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0078*	0.089	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0084*	0.089	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.027*	0.089	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0089*	0.036	"	"	"	"	"	
Benzene	"	ND	*0.0055*	0.036	"	"	"	"	"	
Chloroform	"	ND	*0.0047*	0.089	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0071*	0.089	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13RE1 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.011*	0.089	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:18	
1,2-Dichloroethane	"	ND	*0.0049*	0.089	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0082*	0.044	"	"	"	"	"	
Trichloroethene	"	**0.023**	*0.0075*	0.036	"	"	"	"	"	**Ja**
1,2-Dichloropropane	"	ND	*0.0087*	0.027	"	"	"	"	"	
Dibromomethane	"	ND	*0.0089*	0.089	"	"	"	"	"	
Toluene	"	**0.018**	*0.0053*	0.089	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0067*	0.089	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0040*	0.027	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0053*	0.036	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0051*	0.089	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0047*	0.044	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.011*	0.089	"	"	"	"	"	
Ethylbenzene	"	**0.072**	*0.0082*	0.089	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.011*	0.089	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.018*	0.089	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0073*	0.022	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.16**	*0.017*	0.089	"	"	"	"	"	
o-Xylene	"	**0.088**	*0.0051*	0.089	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.0084*	0.089	"	"	"	"	"	
Bromoform	"	ND	*0.024*	0.089	"	"	"	"	"	
Isopropylbenzene	"	**0.031**	*0.0040*	0.089	"	"	"	"	"	**Ja**
Bromobenzene	"	ND	*0.0060*	0.089	"	"	"	"	"	
N-Propylbenzene	"	**0.053**	*0.0062*	0.089	"	"	"	"	"	**Ja**
1,2,3-Trichloropropane	"	ND	*0.026*	0.089	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.012*	0.089	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.12**	*0.0093*	0.089	"	"	"	"	"	
n-Butylbenzene	"	**0.35**	*0.016*	0.089	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.15*	0.44	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.012*	0.089	"	"	"	"	"	
Naphthalene	"	**0.36**	*0.013*	0.089	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*100%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*107%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*102%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*105%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Bromomethane	8260B STD Dry	ND	*0.00048*	0.0012	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:41	
Chloroethane	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000092*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0025	"	"	"	"	"	
Bromoform	"	ND	*0.000089*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*101%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*100%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*104%*		*85 - 120 %*	"			"	
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0022*	0.049	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	
1,2-Dichlorobenzene	"	ND	*0.0032*	0.049	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.016*	0.049	"	"	"	"	"	
Bromomethane	"	ND	*0.031*	0.17	"	"	"	"	"	
Chloroethane	"	ND	*0.028*	0.49	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0098*	0.049	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0039*	0.049	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0026*	0.049	"	"	"	"	"	
Chloromethane	"	ND	*0.073*	0.49	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0061*	0.024	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0021*	0.0098	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0045*	0.049	"	"	"	"	"	
Methylene Chloride	"	**0.030**	*0.0047*	0.049	"	"	"	"	"	**Ja, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
4-Isopropyltoluene	8260B STD Dry	**0.0049**	*0.0034*	0.049	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0029*	0.049	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0043*	0.049	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0047*	0.049	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.015*	0.049	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0049*	0.020	"	"	"	"	"	
Benzene	"	ND	*0.0031*	0.020	"	"	"	"	"	
Chloroform	"	ND	*0.0026*	0.049	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0039*	0.049	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0027*	0.049	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0045*	0.024	"	"	"	"	"	
Trichloroethene	"	ND	*0.0042*	0.020	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0048*	0.015	"	"	"	"	"	
Dibromomethane	"	ND	*0.0049*	0.049	"	"	"	"	"	
Toluene	"	ND	*0.0029*	0.049	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0037*	0.049	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0022*	0.015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0029*	0.020	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0028*	0.049	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0026*	0.024	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0061*	0.049	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0045*	0.049	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0059*	0.049	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0098*	0.049	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0040*	0.012	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0095*	0.049	"	"	"	"	"	
o-Xylene	"	ND	*0.0028*	0.049	"	"	"	"	"	
Styrene	"	ND	*0.0047*	0.049	"	"	"	"	"	
Bromoform	"	ND	*0.013*	0.049	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0022*	0.049	"	"	"	"	"	
Bromobenzene	"	ND	*0.0033*	0.049	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0034*	0.049	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.014*	0.049	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0066*	0.049	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0051*	0.049	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0089*	0.049	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**				**Sampled: 08/28/09 12:50**				
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.081*	0.24	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	
1,2,4-Trichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0069*	0.049	"	"	"	"	"	
Naphthalene	"	ND	*0.0073*	0.049	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*101%*			*85 - 115 %*	"		"	
Ethylbenzene-d10			*106%*			*75 - 125 %*	"		"	
4-Bromofluorobenzene (Surr)			*101%*			*85 - 120 %*	"		"	
Fluorobenzene (Surr)			*103%*			*75 - 125 %*	"		"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**				**Sampled: 08/28/09 13:27**				
Bromomethane	8260B STD Dry	ND	*0.00037*	0.00097	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:05	
Chloroethane	"	ND	*0.00026*	0.00097	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00097	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00017*	0.00097	"	"	"	"	"	
Chloroform	"	ND	*0.00014*	0.00097	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00097	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00015*	0.00097	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00036*	0.00097	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00097	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00017*	0.00097	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000072*	0.00097	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00011*	0.00097	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000085*	0.0019	"	"	"	"	"	
Bromoform	"	ND	*0.000070*	0.00097	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00035*	0.00097	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00018*	0.0019	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00033*	0.00097	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*104%*			*85 - 115 %*	"		"	
1,2-Dichloroethane-d4 (Surr)			*114%*			*75 - 125 %*	"		"	
4-Bromofluorobenzene (Surr)			*114%*			*85 - 120 %*	"		"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15RE1 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0019*	0.041	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:06	
1,2-Dichlorobenzene	"	ND	*0.0027*	0.041	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.013*	0.041	"	"	"	"	"	
Bromomethane	"	ND	*0.026*	0.15	"	"	"	"	"	
Chloroethane	"	ND	*0.024*	0.41	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0022*	0.041	"	"	"	"	"	
Chloromethane	"	ND	*0.062*	0.41	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0052*	0.021	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0018*	0.0083	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0038*	0.041	"	"	"	"	"	
Methylene Chloride	"	**0.011**	*0.0039*	0.041	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0029*	0.041	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0025*	0.041	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0036*	0.041	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0039*	0.041	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.012*	0.041	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0041*	0.017	"	"	"	"	"	
Benzene	"	ND	*0.0026*	0.017	"	"	"	"	"	
Chloroform	"	ND	*0.0022*	0.041	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0023*	0.041	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0038*	0.021	"	"	"	"	"	
Trichloroethene	"	ND	*0.0035*	0.017	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0040*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0041*	0.041	"	"	"	"	"	
Toluene	"	ND	*0.0025*	0.041	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0031*	0.041	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0019*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0025*	0.017	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0022*	0.021	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15RE1 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0052*	0.041	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:06	
Ethylbenzene	"	ND	*0.0038*	0.041	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0050*	0.041	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0034*	0.010	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0081*	0.041	"	"	"	"	"	
o-Xylene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Styrene	"	ND	*0.0039*	0.041	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.041	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0019*	0.041	"	"	"	"	"	
Bromobenzene	"	ND	*0.0028*	0.041	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0029*	0.041	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.012*	0.041	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0056*	0.041	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0044*	0.041	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0076*	0.041	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.068*	0.21	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0058*	0.041	"	"	"	"	"	
Naphthalene	"	ND	*0.0062*	0.041	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*99%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*108%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*98%*		*85 - 120 %*	"			"	
Trifluorotoluene (Surr)			*90%*		*75 - 125 %*	"			"	
Fluorobenzene (Surr)			*107%*		*75 - 125 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Bromomethane	8260B STD Dry	ND	*0.00029*	0.00074	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:29	
Chloroethane	"	ND	*0.00020*	0.00074	"	"	"	"	"	
Chloromethane	"	ND	*0.00013*	0.00074	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00013*	0.00074	"	"	"	"	"	
Chloroform	"	ND	*0.00011*	0.00074	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000098*	0.00074	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00012*	0.00074	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00028*	0.00074	"	"	"	"	"	
Trichloroethene	"	ND	*0.00013*	0.00074	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00013*	0.00074	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Dichlorobromomethane	8260B STD Dry	ND	*0.000055*	0.00074	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:29	
cis-1,3-Dichloropropene	"	ND	*0.000087*	0.00074	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000065*	0.0015	"	"	"	"	"	
Bromoform	"	ND	*0.000053*	0.00074	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00027*	0.00074	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00013*	0.0015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00025*	0.00074	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*103%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*105%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*112%*			*85 - 120 %*	"			"	
SSH0168-16RE1 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0018*	0.039	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:30	
1,2-Dichlorobenzene	"	ND	*0.0025*	0.039	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.013*	0.039	"	"	"	"	"	
Bromomethane	"	ND	*0.024*	0.14	"	"	"	"	"	
Chloroethane	"	ND	*0.022*	0.39	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0078*	0.039	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0031*	0.039	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0021*	0.039	"	"	"	"	"	
Chloromethane	"	ND	*0.059*	0.39	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0049*	0.039	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0049*	0.020	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0017*	0.0078	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0036*	0.039	"	"	"	"	"	
Methylene Chloride	"	**0.017**	*0.0037*	0.039	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0027*	0.039	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0023*	0.039	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0034*	0.039	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0037*	0.039	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.012*	0.039	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0039*	0.016	"	"	"	"	"	
Benzene	"	ND	*0.0024*	0.016	"	"	"	"	"	
Chloroform	"	ND	*0.0021*	0.039	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0031*	0.039	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16RE1 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.0049*	0.039	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:30	
1,2-Dichloroethane	"	ND	*0.0021*	0.039	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0036*	0.020	"	"	"	"	"	
Trichloroethene	"	ND	*0.0033*	0.016	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0038*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0039*	0.039	"	"	"	"	"	
Toluene	"	ND	*0.0023*	0.039	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0029*	0.039	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0018*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0023*	0.016	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0022*	0.039	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0021*	0.020	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0049*	0.039	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0036*	0.039	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0047*	0.039	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0078*	0.039	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0032*	0.0098	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0076*	0.039	"	"	"	"	"	
o-Xylene	"	ND	*0.0022*	0.039	"	"	"	"	"	
Styrene	"	ND	*0.0037*	0.039	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.039	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0018*	0.039	"	"	"	"	"	
Bromobenzene	"	ND	*0.0026*	0.039	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0027*	0.039	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.011*	0.039	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0053*	0.039	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0041*	0.039	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0071*	0.039	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.064*	0.20	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0055*	0.039	"	"	"	"	"	
Naphthalene	"	ND	*0.0059*	0.039	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*96%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*107%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*96%*	*85 - 120 %*	"	"
	Trifluorotoluene (Surr)	*79%*	*75 - 125 %*	"	"
	Fluorobenzene (Surr)	*105%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Bromomethane	8260B STD Dry	ND	*0.00057*	0.0015	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:01	
Chloroethane	"	ND	*0.00039*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00022*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00019*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00055*	0.0015	"	"	"	"	"	
Trichloroethene	"	**0.060**	*0.00026*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00017*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00013*	0.0029	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00053*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00027*	0.0029	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00049*	0.0015	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*122%*			*85 - 115 %*	"		"		***X. I***
1,2-Dichloroethane-d4 (Surr)		*116%*			*75 - 125 %*	"		"		
4-Bromofluorobenzene (Surr)		*127%*			*85 - 120 %*	"		"		***X. I***
SSH0168-17RE1 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0098*	0.22	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
1,2-Dichlorobenzene	"	ND	*0.014*	0.22	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.071*	0.22	"	"	"	"	"	
Bromomethane	"	ND	*0.14*	0.77	"	"	"	"	"	
Chloroethane	"	ND	*0.13*	2.2	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.044*	0.22	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.017*	0.22	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.011*	0.22	"	"	"	"	"	
Chloromethane	"	ND	*0.33*	2.2	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.027*	0.22	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.027*	0.11	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0093*	0.044	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.020*	0.22	"	"	"	"	"	
Methylene Chloride	"	**1.6**	*0.021*	0.22	"	"	"	"	"	**B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17RE1 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
4-Isopropyltoluene	8260B STD Dry	ND	*0.015*	0.22	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
cis-1,2-Dichloroethene	"	ND	*0.013*	0.22	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.019*	0.22	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.021*	0.22	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.066*	0.22	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.022*	0.087	"	"	"	"	"	
Benzene	"	ND	*0.014*	0.087	"	"	"	"	"	
Chloroform	"	ND	*0.011*	0.22	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.017*	0.22	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.027*	0.22	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.012*	0.22	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.020*	0.11	"	"	"	"	"	
Trichloroethene	"	**0.98**	*0.019*	0.087	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.021*	0.066	"	"	"	"	"	
Dibromomethane	"	ND	*0.022*	0.22	"	"	"	"	"	
Toluene	"	**0.040**	*0.013*	0.22	"	"	"	"	"	Ja
Dichlorobromomethane	"	ND	*0.016*	0.22	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0098*	0.066	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.013*	0.087	"	"	"	"	"	
Chlorobenzene	"	ND	*0.013*	0.22	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.011*	0.11	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.027*	0.22	"	"	"	"	"	
Ethylbenzene	"	ND	*0.020*	0.22	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.026*	0.22	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.044*	0.22	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.018*	0.055	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.048**	*0.043*	0.22	"	"	"	"	"	Ja
o-Xylene	"	**0.017**	*0.013*	0.22	"	"	"	"	"	Ja
Styrene	"	ND	*0.021*	0.22	"	"	"	"	"	
Bromoform	"	ND	*0.060*	0.22	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0098*	0.22	"	"	"	"	"	
Bromobenzene	"	ND	*0.015*	0.22	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.015*	0.22	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.063*	0.22	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.030*	0.22	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.023*	0.22	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.040*	0.22	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17RE1 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.36*	1.1	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
1,2,4-Trichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.031*	0.22	"	"	"	"	"	
Naphthalene	"	ND	*0.033*	0.22	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*99%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*100%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*99%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*104%*		*75 - 125 %*	"			"	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:25	
Chloroethane	"	ND	*0.00029*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00014*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00040*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.011**	*0.00019*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000080*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000095*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000078*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00039*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00036*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*104%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*102%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*110%*		*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18RE1 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0032*	0.072	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:19	
1,2-Dichlorobenzene	"	ND	*0.0047*	0.072	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.023*	0.072	"	"	"	"	"	
Bromomethane	"	ND	*0.045*	0.25	"	"	"	"	"	
Chloroethane	"	ND	*0.041*	0.72	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.014*	0.072	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0058*	0.072	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0038*	0.072	"	"	"	"	"	
Chloromethane	"	ND	*0.11*	0.72	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0090*	0.036	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0031*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0067*	0.072	"	"	"	"	"	
Methylene Chloride	"	**0.23**	*0.0068*	0.072	"	"	"	"	"	**B**
4-Isopropyltoluene	"	ND	*0.0050*	0.072	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0043*	0.072	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0063*	0.072	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0068*	0.072	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.022*	0.072	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0072*	0.029	"	"	"	"	"	
Benzene	"	ND	*0.0045*	0.029	"	"	"	"	"	
Chloroform	"	ND	*0.0038*	0.072	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0058*	0.072	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0040*	0.072	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0067*	0.036	"	"	"	"	"	
Trichloroethene	"	**0.17**	*0.0061*	0.029	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0070*	0.022	"	"	"	"	"	
Dibromomethane	"	ND	*0.0072*	0.072	"	"	"	"	"	
Toluene	"	**0.013**	*0.0043*	0.072	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0054*	0.072	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0032*	0.022	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0043*	0.029	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0041*	0.072	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0038*	0.036	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18RE1 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0090*	0.072	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:19	
Ethylbenzene	"	ND	*0.0067*	0.072	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0086*	0.072	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.014*	0.072	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0059*	0.018	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.014*	0.072	"	"	"	"	"	
o-Xylene	"	ND	*0.0041*	0.072	"	"	"	"	"	
Styrene	"	ND	*0.0068*	0.072	"	"	"	"	"	
Bromoform	"	ND	*0.020*	0.072	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0032*	0.072	"	"	"	"	"	
Bromobenzene	"	ND	*0.0049*	0.072	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0050*	0.072	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.021*	0.072	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0097*	0.072	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0076*	0.072	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.013*	0.072	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.12*	0.36	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.010*	0.072	"	"	"	"	"	
Naphthalene	"	ND	*0.011*	0.072	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*104%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*104%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*107%*		*75 - 125 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:49	
Chloroethane	"	ND	*0.00029*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.0011**	*0.00019*	0.0011	"	"	"	"	"	Ja
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000081*	0.0011	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00013*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:49	
1,1,2,2-Tetrachloroethane	"	ND	*0.000097*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000079*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*101%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*104%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*104%*		*85 - 120 %*	"			"	
SSH0168-19RE1 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0025*	0.055	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:44	
1,2-Dichlorobenzene	"	ND	*0.0036*	0.055	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.018*	0.055	"	"	"	"	"	
Bromomethane	"	ND	*0.034*	0.19	"	"	"	"	"	
Chloroethane	"	ND	*0.032*	0.55	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.055	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0044*	0.055	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0029*	0.055	"	"	"	"	"	
Chloromethane	"	ND	*0.083*	0.55	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0069*	0.055	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0069*	0.028	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0023*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0051*	0.055	"	"	"	"	"	
Methylene Chloride	"	**0.015**	*0.0052*	0.055	"	"	"	"	"	**Ja, B**
4-Isopropyltoluene	"	ND	*0.0039*	0.055	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0033*	0.055	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0048*	0.055	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0052*	0.055	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.017*	0.055	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0055*	0.022	"	"	"	"	"	
Benzene	"	ND	*0.0034*	0.022	"	"	"	"	"	
Chloroform	"	ND	*0.0029*	0.055	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0044*	0.055	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0069*	0.055	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19RE1 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0030*	0.055	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:44	
Carbon tetrachloride	"	ND	*0.0051*	0.028	"	"	"	"	"	
Trichloroethene	"	**0.056**	*0.0047*	0.022	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0054*	0.017	"	"	"	"	"	
Dibromomethane	"	ND	*0.0055*	0.055	"	"	"	"	"	
Toluene	"	ND	*0.0033*	0.055	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0041*	0.055	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0025*	0.017	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0033*	0.022	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0032*	0.055	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0029*	0.028	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0069*	0.055	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0051*	0.055	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0066*	0.055	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.055	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0045*	0.014	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.011*	0.055	"	"	"	"	"	
o-Xylene	"	ND	*0.0032*	0.055	"	"	"	"	"	
Styrene	"	ND	*0.0052*	0.055	"	"	"	"	"	
Bromoform	"	ND	*0.015*	0.055	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0025*	0.055	"	"	"	"	"	
Bromobenzene	"	ND	*0.0037*	0.055	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0039*	0.055	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.016*	0.055	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0074*	0.055	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0058*	0.055	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.010*	0.055	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.091*	0.28	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0077*	0.055	"	"	"	"	"	
Naphthalene	"	ND	*0.0083*	0.055	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*99%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*105%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*98%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*102%*	*75 - 125 %*	"	"

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Bromomethane	8260B STD Dry	ND	*0.00059*	0.0015	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 19:13	
Chloroethane	"	ND	*0.00041*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00027*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00057*	0.0015	"	"	"	"	"	
Trichloroethene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00018*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00014*	0.0031	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00055*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00028*	0.0031	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00052*	0.0015	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*130%*			*85 - 115 %*	"		"		***X. I***
1,2-Dichloroethane-d4 (Surr)		*120%*			*75 - 125 %*	"		"		
4-Bromofluorobenzene (Surr)		*136%*			*85 - 120 %*	"		"		***X. I***
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0066*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:08	
1,2-Dichlorobenzene	"	ND	*0.0096*	0.15	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.048*	0.15	"	"	"	"	"	
Bromomethane	"	ND	*0.092*	0.52	"	"	"	"	"	
Chloroethane	"	ND	*0.085*	1.5	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.030*	0.15	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.15	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.14**	*0.0078*	0.15	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.22*	1.5	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.018*	0.15	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.018*	0.074	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0063*	0.030	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.15	"	"	"	"	"	
Methylene Chloride	"	**0.054**	*0.014*	0.15	"	"	"	"	"	**Ja, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
4-Isopropyltoluene	8260B STD Dry	**0.043**	*0.010*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:08	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0089*	0.15	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.013*	0.15	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.014*	0.15	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.044*	0.15	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.015*	0.059	"	"	"	"	"	
Benzene	"	**0.044**	*0.0092*	0.059	"	"	"	"	"	**Ja**
Chloroform	"	ND	*0.0078*	0.15	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.018*	0.15	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0081*	0.15	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.014*	0.074	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.059	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.014*	0.044	"	"	"	"	"	
Dibromomethane	"	ND	*0.015*	0.15	"	"	"	"	"	
Toluene	"	**0.40**	*0.0089*	0.15	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.011*	0.15	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0066*	0.044	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0089*	0.059	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0085*	0.15	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0078*	0.074	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.018*	0.15	"	"	"	"	"	
Ethylbenzene	"	**0.14**	*0.014*	0.15	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.018*	0.15	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.030*	0.15	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.012*	0.037	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.41**	*0.029*	0.15	"	"	"	"	"	
o-Xylene	"	**0.17**	*0.0085*	0.15	"	"	"	"	"	
Styrene	"	ND	*0.014*	0.15	"	"	"	"	"	
Bromoform	"	ND	*0.041*	0.15	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0066*	0.15	"	"	"	"	"	
Bromobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
N-Propylbenzene	"	**0.031**	*0.010*	0.15	"	"	"	"	"	**Ja**
1,2,3-Trichloropropane	"	ND	*0.043*	0.15	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.020*	0.15	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.048**	*0.016*	0.15	"	"	"	"	"	**Ja**
n-Butylbenzene	"	ND	*0.027*	0.15	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.24*	0.74	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
1,2,4-Trichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.021*	0.15	"	"	"	"	"	
Naphthalene	"	ND	*0.022*	0.15	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*101%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*108%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*98%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*102%*			*75 - 125 %*	"			"	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 19:37	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.00041**	*0.00019*	0.0011	"	"	"	"	"	**Ja**
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000082*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000097*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000079*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*104%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*105%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*109%*			*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21RE1 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0024*	0.053	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:32	
1,2-Dichlorobenzene	"	ND	*0.0034*	0.053	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.017*	0.053	"	"	"	"	"	
Bromomethane	"	ND	*0.033*	0.18	"	"	"	"	"	
Chloroethane	"	ND	*0.030*	0.53	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.053	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0042*	0.053	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0028*	0.053	"	"	"	"	"	
Chloromethane	"	ND	*0.079*	0.53	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0066*	0.026	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0022*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0049*	0.053	"	"	"	"	"	
Methylene Chloride	"	**0.061**	*0.0050*	0.053	"	"	"	"	"	**B**
4-Isopropyltoluene	"	ND	*0.0037*	0.053	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0032*	0.053	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0046*	0.053	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0050*	0.053	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.016*	0.053	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0053*	0.021	"	"	"	"	"	
Benzene	"	ND	*0.0033*	0.021	"	"	"	"	"	
Chloroform	"	ND	*0.0028*	0.053	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0042*	0.053	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0029*	0.053	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0049*	0.026	"	"	"	"	"	
Trichloroethene	"	**0.036**	*0.0045*	0.021	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0051*	0.016	"	"	"	"	"	
Dibromomethane	"	ND	*0.0053*	0.053	"	"	"	"	"	
Toluene	"	ND	*0.0032*	0.053	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0039*	0.053	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0024*	0.016	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0032*	0.021	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0030*	0.053	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0028*	0.026	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21RE1 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0066*	0.053	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:32	
Ethylbenzene	"	ND	*0.0049*	0.053	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0063*	0.053	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.053	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0043*	0.013	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.010*	0.053	"	"	"	"	"	
o-Xylene	"	ND	*0.0030*	0.053	"	"	"	"	"	
Styrene	"	ND	*0.0050*	0.053	"	"	"	"	"	
Bromoform	"	ND	*0.014*	0.053	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0024*	0.053	"	"	"	"	"	
Bromobenzene	"	ND	*0.0036*	0.053	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0037*	0.053	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.015*	0.053	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0071*	0.053	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0055*	0.053	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0096*	0.053	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.087*	0.26	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0074*	0.053	"	"	"	"	"	
Naphthalene	"	ND	*0.0079*	0.053	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*95%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*108%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Trifluorotoluene (Surr)			*89%*		*75 - 125 %*	"			"	
Fluorobenzene (Surr)			*103%*		*75 - 125 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Bromomethane	8260B STD Dry	ND	*0.00016*	0.00042	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:00	
Chloroethane	"	ND	*0.00011*	0.00042	"	"	"	"	"	
Chloromethane	"	ND	*0.000075*	0.00042	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000075*	0.00042	"	"	"	"	"	
Chloroform	"	ND	*0.000063*	0.00042	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000056*	0.00042	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000068*	0.00042	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00016*	0.00042	"	"	"	"	"	
Trichloroethene	"	ND	*0.000075*	0.00042	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000072*	0.00042	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Dichlorobromomethane	8260B STD Dry	ND	*0.000031*	0.00042	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:00	
cis-1,3-Dichloropropene	"	ND	*0.000050*	0.00042	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000037*	0.00085	"	"	"	"	"	
Bromoform	"	ND	*0.000030*	0.00042	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00015*	0.00042	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000077*	0.00085	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00014*	0.00042	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*106%*		*85 - 115 %*	"		"		
	1,2-Dichloroethane-d4 (Surr)		*131%*		*75 - 125 %*	"		"		***X. I***
	4-Bromofluorobenzene (Surr)		*108%*		*85 - 120 %*	"		"		
SSH0168-22RE1 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0027*	0.060	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 08:57	
1,2-Dichlorobenzene	"	**0.037**	*0.0039*	0.060	"	"	"	"	"	**Ja**
4-Chlorotoluene	"	ND	*0.020*	0.060	"	"	"	"	"	
Bromomethane	"	ND	*0.038*	0.21	"	"	"	"	"	
Chloroethane	"	ND	*0.035*	0.60	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.060	"	"	"	"	"	
tert-Butylbenzene	"	**0.020**	*0.0048*	0.060	"	"	"	"	"	**Ja**
1,2,4-Trimethylbenzene	"	**0.048**	*0.0032*	0.060	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.090*	0.60	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0075*	0.030	"	"	"	"	"	
sec-Butylbenzene	"	**0.28**	*0.0075*	0.060	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0056*	0.060	"	"	"	"	"	
Methylene Chloride	"	**0.081**	*0.0057*	0.060	"	"	"	"	"	
4-Isopropyltoluene	"	**0.094**	*0.0042*	0.060	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0036*	0.060	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0053*	0.060	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0057*	0.060	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.060	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0060*	0.024	"	"	"	"	"	
Benzene	"	ND	*0.0038*	0.024	"	"	"	"	"	
Chloroform	"	ND	*0.0032*	0.060	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0048*	0.060	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22RE1 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.0075*	0.060	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 08:57	
1,2-Dichloroethane	"	ND	*0.0033*	0.060	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0056*	0.030	"	"	"	"	"	
Trichloroethene	"	ND	*0.0051*	0.024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0059*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0060*	0.060	"	"	"	"	"	
Toluene	"	**0.0096**	*0.0036*	0.060	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0045*	0.060	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0027*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0036*	0.024	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0035*	0.060	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0032*	0.030	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0075*	0.060	"	"	"	"	"	
Ethylbenzene	"	**0.070**	*0.0056*	0.060	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0072*	0.060	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.060	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0050*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.014**	*0.012*	0.060	"	"	"	"	"	**Ja**
o-Xylene	"	ND	*0.0035*	0.060	"	"	"	"	"	
Styrene	"	ND	*0.0057*	0.060	"	"	"	"	"	
Bromoform	"	ND	*0.017*	0.060	"	"	"	"	"	
Isopropylbenzene	"	**0.16**	*0.0027*	0.060	"	"	"	"	"	
Bromobenzene	"	ND	*0.0041*	0.060	"	"	"	"	"	
N-Propylbenzene	"	**0.33**	*0.0042*	0.060	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.017*	0.060	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0081*	0.060	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0063*	0.060	"	"	"	"	"	
n-Butylbenzene	"	**0.71**	*0.011*	0.060	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.099*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0084*	0.060	"	"	"	"	"	
Naphthalene	"	**1.9**	*0.0090*	0.060	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*98%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*104%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*106%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Bromomethane	8260B STD Dry	ND	*0.000093*	0.00024	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:24	
Chloroethane	"	ND	*0.000065*	0.00024	"	"	"	"	"	
Chloromethane	"	ND	*0.000043*	0.00024	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000043*	0.00024	"	"	"	"	"	
Chloroform	"	ND	*0.000036*	0.00024	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000032*	0.00024	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000039*	0.00024	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.000090*	0.00024	"	"	"	"	"	
Trichloroethene	"	ND	*0.000043*	0.00024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000041*	0.00024	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000018*	0.00024	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000028*	0.00024	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000021*	0.00048	"	"	"	"	"	
Bromoform	"	ND	*0.000017*	0.00024	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.000087*	0.00024	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000044*	0.00048	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.000081*	0.00024	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*113%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*112%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*138%*		*85 - 120 %*	"			"	***X. I***
SSH0168-23RE1 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0014*	0.030	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:21	
1,2-Dichlorobenzene	"	**0.037**	*0.0020*	0.030	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.0098*	0.030	"	"	"	"	"	
Bromomethane	"	ND	*0.019*	0.11	"	"	"	"	"	
Chloroethane	"	ND	*0.017*	0.30	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0061*	0.030	"	"	"	"	"	
tert-Butylbenzene	"	**0.014**	*0.0024*	0.030	"	"	"	"	"	**Ja**
1,2,4-Trimethylbenzene	"	**0.13**	*0.0016*	0.030	"	"	"	"	"	
Chloromethane	"	ND	*0.045*	0.30	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0038*	0.015	"	"	"	"	"	
sec-Butylbenzene	"	**0.12**	*0.0038*	0.030	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0013*	0.0061	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0028*	0.030	"	"	"	"	"	
Methylene Chloride	"	**0.066**	*0.0029*	0.030	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23RE1 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
4-Isopropyltoluene	8260B STD Dry	**0.064**	*0.0021*	0.030	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:21	
cis-1,2-Dichloroethene	"	ND	*0.0018*	0.030	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0027*	0.030	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0029*	0.030	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.0091*	0.030	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0030*	0.012	"	"	"	"	"	
Benzene	"	ND	*0.0019*	0.012	"	"	"	"	"	
Chloroform	"	ND	*0.0016*	0.030	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0024*	0.030	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0017*	0.030	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0028*	0.015	"	"	"	"	"	
Trichloroethene	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0030*	0.0091	"	"	"	"	"	
Dibromomethane	"	ND	*0.0030*	0.030	"	"	"	"	"	
Toluene	"	**0.0053**	*0.0018*	0.030	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0023*	0.030	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0014*	0.0091	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0018*	0.012	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0017*	0.030	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0016*	0.015	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0038*	0.030	"	"	"	"	"	
Ethylbenzene	"	**0.044**	*0.0028*	0.030	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0036*	0.030	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0061*	0.030	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0025*	0.0076	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.017**	*0.0059*	0.030	"	"	"	"	"	**Ja**
o-Xylene	"	**0.020**	*0.0017*	0.030	"	"	"	"	"	**Ja**
Styrene	"	ND	*0.0029*	0.030	"	"	"	"	"	
Bromoform	"	ND	*0.0083*	0.030	"	"	"	"	"	
Isopropylbenzene	"	**0.082**	*0.0014*	0.030	"	"	"	"	"	
Bromobenzene	"	ND	*0.0020*	0.030	"	"	"	"	"	
N-Propylbenzene	"	**0.14**	*0.0021*	0.030	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0088*	0.030	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0041*	0.030	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.0075**	*0.0032*	0.030	"	"	"	"	"	**Ja**
n-Butylbenzene	"	ND	*0.0055*	0.030	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.050*	0.15	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23RE1 (TS-COMP-2)		**Soil**				**Sampled: 08/27/09 18:28**				
1,2,4-Trichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0042*	0.030	"	"	"	"	"	
Naphthalene	"	**2.0**	*0.0045*	0.030	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*101%*			*85 - 115 %*	"		"	
Ethylbenzene-d10			*104%*			*75 - 125 %*	"		"	
4-Bromofluorobenzene (Surr)			*102%*			*85 - 120 %*	"		"	
Fluorobenzene (Surr)			*102%*			*75 - 125 %*	"		"	
SSH0168-24 (TS-COMP-3)		**Soil**				**Sampled: 08/27/09 16:40**				
Bromomethane	8260B STD Dry	ND	*0.00021*	0.00054	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:48	
Chloroethane	"	ND	*0.00014*	0.00054	"	"	"	"	"	
Chloromethane	"	ND	*0.000095*	0.00054	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000096*	0.00054	"	"	"	"	"	
Chloroform	"	ND	*0.000080*	0.00054	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000071*	0.00054	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000086*	0.00054	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00020*	0.00054	"	"	"	"	"	
Trichloroethene	"	ND	*0.000095*	0.00054	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000092*	0.00054	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000040*	0.00054	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000063*	0.00054	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000047*	0.0011	"	"	"	"	"	
Bromoform	"	ND	*0.000039*	0.00054	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00019*	0.00054	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000098*	0.0011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00018*	0.00054	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*110%*			*85 - 115 %*	"		"	
1,2-Dichloroethane-d4 (Surr)			*129%*			*75 - 125 %*	"		"	***X. I***
4-Bromofluorobenzene (Surr)			*102%*			*85 - 120 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24RE1 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0019*	0.041	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:45	
1,2-Dichlorobenzene	"	**0.015**	*0.0027*	0.041	"	"	"	"	"	**Ja**
4-Chlorotoluene	"	ND	*0.013*	0.041	"	"	"	"	"	
Bromomethane	"	ND	*0.026*	0.14	"	"	"	"	"	
Chloroethane	"	ND	*0.024*	0.41	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
tert-Butylbenzene	"	**0.015**	*0.0033*	0.041	"	"	"	"	"	**Ja**
1,2,4-Trimethylbenzene	"	ND	*0.0022*	0.041	"	"	"	"	"	
Chloromethane	"	ND	*0.062*	0.41	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0052*	0.021	"	"	"	"	"	
sec-Butylbenzene	"	**0.29**	*0.0052*	0.041	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0018*	0.0083	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0038*	0.041	"	"	"	"	"	
Methylene Chloride	"	ND	*0.0039*	0.041	"	"	"	"	"	
4-Isopropyltoluene	"	**0.014**	*0.0029*	0.041	"	"	"	"	"	**Ja**
cis-1,2-Dichloroethene	"	ND	*0.0025*	0.041	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0036*	0.041	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0039*	0.041	"	"	"	"	"	
1,4-Dichlorobenzene	"	**0.0064**	*0.0052*	0.041	"	"	"	"	"	**Ja**
Chlorobromomethane	"	ND	*0.012*	0.041	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0041*	0.017	"	"	"	"	"	
Benzene	"	ND	*0.0026*	0.017	"	"	"	"	"	
Chloroform	"	ND	*0.0022*	0.041	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0023*	0.041	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0038*	0.021	"	"	"	"	"	
Trichloroethene	"	ND	*0.0035*	0.017	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0040*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0041*	0.041	"	"	"	"	"	
Toluene	"	ND	*0.0025*	0.041	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0031*	0.041	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0019*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0025*	0.017	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0022*	0.021	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24RE1 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0052*	0.041	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:45	
Ethylbenzene	"	ND	*0.0038*	0.041	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0050*	0.041	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0034*	0.010	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.010**	*0.0081*	0.041	"	"	"	"	"	**Ja**
o-Xylene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Styrene	"	ND	*0.0039*	0.041	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.041	"	"	"	"	"	
Isopropylbenzene	"	**0.069**	*0.0019*	0.041	"	"	"	"	"	
Bromobenzene	"	ND	*0.0028*	0.041	"	"	"	"	"	
N-Propylbenzene	"	**0.11**	*0.0029*	0.041	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.012*	0.041	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0056*	0.041	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0043*	0.041	"	"	"	"	"	
n-Butylbenzene	"	**0.61**	*0.0075*	0.041	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.068*	0.21	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0058*	0.041	"	"	"	"	"	
Naphthalene	"	**0.37**	*0.0062*	0.041	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*108%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*101%*		*75 - 125 %*	"			"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Bromomethane	8260B STD Dry	ND	*0.00053*	0.0014	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:12	
Chloroethane	"	ND	*0.00037*	0.0014	"	"	"	"	"	
Chloromethane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00025*	0.0014	"	"	"	"	"	
Chloroform	"	ND	*0.00020*	0.0014	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00018*	0.0014	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00022*	0.0014	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00051*	0.0014	"	"	"	"	"	
Trichloroethene	"	ND	*0.00024*	0.0014	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00010*	0.0014	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00016*	0.0014	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:12	
1,1,2,2-Tetrachloroethane	"	ND	*0.00012*	0.0028	"	"	"	"	"	
Bromoform	"	ND	*0.000099*	0.0014	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00050*	0.0014	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00025*	0.0028	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00046*	0.0014	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)		*108%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*98%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*114%*			*85 - 120 %*	"			"	
SSH0168-25RE1 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0028*	0.061	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 10:09	
1,2-Dichlorobenzene	"	ND	*0.0040*	0.061	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.020*	0.061	"	"	"	"	"	
Bromomethane	"	ND	*0.038*	0.22	"	"	"	"	"	
Chloroethane	"	ND	*0.035*	0.61	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.061	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0049*	0.061	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.054**	*0.0032*	0.061	"	"	"	"	"	**Ja**
Chloromethane	"	ND	*0.092*	0.61	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0077*	0.061	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0077*	0.031	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0057*	0.061	"	"	"	"	"	
Methylene Chloride	"	**0.014**	*0.0058*	0.061	"	"	"	"	"	**Ja**
4-Isopropyltoluene	"	ND	*0.0043*	0.061	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0037*	0.061	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0054*	0.061	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0058*	0.061	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.061	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0061*	0.025	"	"	"	"	"	
Benzene	"	ND	*0.0038*	0.025	"	"	"	"	"	
Chloroform	"	ND	*0.0032*	0.061	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0049*	0.061	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0077*	0.061	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25RE1 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0034*	0.061	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 10:09	
Carbon tetrachloride	"	ND	*0.0057*	0.031	"	"	"	"	"	
Trichloroethene	"	ND	*0.0052*	0.025	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0060*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0061*	0.061	"	"	"	"	"	
Toluene	"	**0.031**	*0.0037*	0.061	"	"	"	"	"	**Ja**
Dichlorobromomethane	"	ND	*0.0046*	0.061	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0028*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0037*	0.025	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0035*	0.061	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0032*	0.031	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0077*	0.061	"	"	"	"	"	
Ethylbenzene	"	**0.0068**	*0.0057*	0.061	"	"	"	"	"	**Ja**
1,1,1,2-Tetrachloroethane	"	ND	*0.0074*	0.061	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.061	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0051*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.087**	*0.012*	0.061	"	"	"	"	"	
o-Xylene	"	**0.081**	*0.0035*	0.061	"	"	"	"	"	
Styrene	"	ND	*0.0058*	0.061	"	"	"	"	"	
Bromoform	"	ND	*0.017*	0.061	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0028*	0.061	"	"	"	"	"	
Bromobenzene	"	ND	*0.0042*	0.061	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0043*	0.061	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.018*	0.061	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0083*	0.061	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.022**	*0.0065*	0.061	"	"	"	"	"	**Ja**
n-Butylbenzene	"	ND	*0.011*	0.061	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.10*	0.31	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0086*	0.061	"	"	"	"	"	
Naphthalene	"	ND	*0.0092*	0.061	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*102%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*107%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*101%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*104%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090006 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090006-BLK1)									**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/11/09 19:36	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 94.3%*			*Limits: 50-150%*	"							*09/11/09 19:36*	
p-Terphenyl-d14		*119%*			*50-150%*	"							"	
LCS (9090006-BS1)									**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	68.2	---	10.0	mg/kg wet	1x	--	83.3	81.8%	(73-133)	--	--	09/11/09 19:59	
Surrogate(s): 2-FBP		*Recovery: 106%*			*Limits: 50-150%*	"							*09/11/09 19:59*	
p-Terphenyl-d14		*118%*			*50-150%*	"							"	
Duplicate (9090006-DUP1)					**QC Source: SSH0166-12**				**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	18.1	---	12.5	mg/kg dry	1x	19.2	--	--	--	5.64%	(40)	09/16/09 20:13	
Heavy Oil Range Hydrocarbons	"	ND	---	31.3	"	"	ND	--	--	--	NR	"	"	
Surrogate(s): 2-FBP		*Recovery: 95.9%*			*Limits: 50-150%*	"							*09/16/09 20:13*	
p-Terphenyl-d14		*115%*			*50-150%*	"							"	
Matrix Spike (9090006-MS1)					**QC Source: SSH0166-12**				**Extracted: 09/01/09 13:16**					
Diesel Range Hydrocarbons	NWTPH-Dx	99.5	---	12.5	mg/kg dry	1x	19.2	104	76.9%	(70.1-139)	--	--	09/16/09 20:36	
Surrogate(s): 2-FBP		*Recovery: 97.7%*			*Limits: 50-150%*	"							*09/16/09 20:36*	
p-Terphenyl-d14		*109%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090027 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090027-BLK1)									**Extracted: 09/04/09 10:38**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/11/09 19:59	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 81.9%*			*Limits: 50-150%*	"							*09/11/09 19:59*	
p-Terphenyl-d14		*95.5%*			*50-150%*	"							"	
LCS (9090027-BS1)									**Extracted: 09/04/09 10:38**					
Diesel Range Hydrocarbons	NWTPH-Dx	66.7	---	10.0	mg/kg wet	1x	--	83.3	80.1%	(73-133)	--	--	09/11/09 20:23	
Surrogate(s): 2-FBP		*Recovery: 98.4%*			*Limits: 50-150%*	"							*09/11/09 20:23*	
p-Terphenyl-d14		*105%*			*50-150%*	"							"	
Duplicate (9090027-DUP1)					**QC Source: SSI0027-02**				**Extracted: 09/04/09 10:38**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.6	mg/kg dry	1x	ND	--	--	--	NR	(40)	09/12/09 03:49	
Heavy Oil Range Hydrocarbons	"	ND	---	26.6	"	"	ND	--	--	--		"	"	
Surrogate(s): 2-FBP		*Recovery: 86.7%*			*Limits: 50-150%*	"							*09/12/09 03:49*	
p-Terphenyl-d14		*102%*			*50-150%*	"							"	
Matrix Spike (9090027-MS1)					**QC Source: SSI0027-02**				**Extracted: 09/04/09 10:38**					
Diesel Range Hydrocarbons	NWTPH-Dx	68.9	---	10.6	mg/kg dry	1x	ND	88.6	77.8%	(70.1-139)	--	--	09/12/09 04:12	
Surrogate(s): 2-FBP		*Recovery: 93.6%*			*Limits: 50-150%*	"							*09/12/09 04:12*	
p-Terphenyl-d14		*102%*			*50-150%*	"							"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090043 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090043-BLK1)									**Extracted: 09/08/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/13/09 12:57	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 97.4%*			*Limits: 50-150%*	"							*09/13/09 12:57*	
p-Terphenyl-d14		*111%*			*50-150%*	"							"	
LCS (9090043-BS1)									**Extracted: 09/08/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	62.3	---	10.0	mg/kg wet	1x	--	83.3	74.8%	(73-133)	--	--	09/13/09 13:21	
Surrogate(s): 2-FBP		*Recovery: 93.5%*			*Limits: 50-150%*	"							*09/13/09 13:21*	
p-Terphenyl-d14		*106%*			*50-150%*	"							"	
Duplicate (9090043-DUP1)					**QC Source: SSH0168-23**				**Extracted: 09/08/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	1630	---	17.5	mg/kg dry	1x	2120	--	--	--	26.4%	(40)	09/13/09 14:34	
Heavy Oil Range Hydrocarbons	"	836	---	43.6	"	"	1090	--	--	--	26.0%	"	"	
Surrogate(s): 2-FBP		*Recovery: 122%*			*Limits: 50-150%*	"							*09/13/09 14:34*	
p-Terphenyl-d14		*109%*			*50-150%*	"							"	
Matrix Spike (9090043-MS1)					**QC Source: SSH0168-23**				**Extracted: 09/08/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	3230	---	21.5	mg/kg dry	1x	2120	179	618%	(70.1-139)	--	--	09/13/09 14:58	MHA
Surrogate(s): 2-FBP		*Recovery: 129%*			*Limits: 50-150%*	"							*09/13/09 14:58*	
p-Terphenyl-d14		*104%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090070 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090070-BLK1)									**Extracted: 09/10/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/16/09 11:26	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 88.1%*			*Limits: 50-150%*	"							*09/16/09 11:26*	
p-Terphenyl-d14		*110%*			*50-150%*	"							"	
LCS (9090070-BS1)									**Extracted: 09/10/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	61.1	---	10.0	mg/kg wet	1x	--	83.3	73.4%	(73-133)	--	--	09/16/09 11:50	
Surrogate(s): 2-FBP		*Recovery: 94.5%*			*Limits: 50-150%*	"							*09/16/09 11:50*	
p-Terphenyl-d14		*107%*			*50-150%*	"							"	
Duplicate (9090070-DUP1)					**QC Source: SSH0168-24**				**Extracted: 09/10/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	1820	---	34.8	mg/kg dry	1x	1790	--	--	--	1.21%	(40)	09/16/09 22:34	
Heavy Oil Range Hydrocarbons	"	2050	---	87.1	"	"	2050	--	--	--	0.0467%	"	"	
Surrogate(s): 2-FBP		*Recovery: 111%*			*Limits: 50-150%*	"							*09/16/09 22:34*	
p-Terphenyl-d14		*117%*			*50-150%*	"							"	
Matrix Spike (9090070-MS1)					**QC Source: SSH0168-24**				**Extracted: 09/10/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	2470	---	34.8	mg/kg dry	1x	1790	290	235%	(70.1-139)	--	--	09/16/09 22:57	MHA
Surrogate(s): 2-FBP		*Recovery: 118%*			*Limits: 50-150%*	"							*09/16/09 22:57*	
p-Terphenyl-d14		*118%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090048 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090048-BLK1)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/11/09 20:50	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:05	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:28	
Surrogate(s): TCX		*Recovery: 85.9%*			*Limits: 27.9-154%*	"							*09/11/09 20:28*	
Decachlorobiphenyl		*90.4%*			*35-157%*	"							"	
Blank (9090048-BLK2)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/11/09 20:50	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:28	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	09/11/09 20:50	
Surrogate(s): TCX		*Recovery: 54.4%*			*Limits: 27.9-154%*	"							*09/11/09 20:50*	
Decachlorobiphenyl		*60.6%*			*35-157%*	"							"	
LCS (9090048-BS1)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	160	---	10.0	ug/kg wet	1x	--	167	95.9%	(63.1-147)	--	--	09/11/09 21:13	
PCB-1260	"	171	---	10.0	"	"	--	"	103%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 88.3%*			*Limits: 27.9-154%*	"							*09/11/09 21:13*	
Decachlorobiphenyl		*99.8%*			*35-157%*	"							"	
LCS (9090048-BS2)									**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	110	---	10.0	ug/kg wet	1x	--	167	65.9%	(63.1-147)	--	--	09/11/09 21:36	
PCB-1260	"	127	---	10.0	"	"	--	"	76.4%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 65.7%*			*Limits: 27.9-154%*	"							*09/11/09 21:36*	
Decachlorobiphenyl		*79.5%*			*35-157%*	"							"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090048 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090048-MS1)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	92.8	---	12.9	ug/kg dry	1x	ND	216	43.0%	(50.6-145)	--	--	09/16/09 14:01	M8
PCB-1260	"	90.6	---	12.9	"	"	ND	"	42.0%	(57.6-120)	--	--	"	M8
Surrogate(s): TCX		*Recovery: 81.0%*			*Limits: 27.9-154%*	"							*09/16/09 14:01*	
Decachlorobiphenyl		*70.1%*			*35-157%*	"							"	
Matrix Spike (9090048-MS2)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	91.6	---	12.9	ug/kg dry	1x	ND	216	42.5%	(50.6-145)	--	--	09/16/09 14:24	M8
PCB-1260	"	100	---	12.9	"	"	ND	"	46.5%	(57.6-120)	--	--	"	M8
Surrogate(s): TCX		*Recovery: 57.7%*			*Limits: 27.9-154%*	"							*09/16/09 14:24*	
Decachlorobiphenyl		*57.4%*			*35-157%*	"							"	
Matrix Spike Dup (9090048-MSD1)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	88.7	---	12.9	ug/kg dry	1x	ND	216	41.1%	(50.6-145)	4.56%	(40)	09/16/09 14:46	M8
PCB-1260	"	83.9	---	12.9	"	"	ND	"	38.9%	(57.6-120)	7.71%	(27.4)	"	M8
Surrogate(s): TCX		*Recovery: 75.5%*			*Limits: 27.9-154%*	"							*09/16/09 14:46*	
Decachlorobiphenyl		*66.5%*			*35-157%*	"							"	
Matrix Spike Dup (9090048-MSD2)					**QC Source: SSH0168-05**				**Extracted: 09/09/09 09:20**					
PCB-1016	EPA 8082	74.0	---	12.9	ug/kg dry	1x	ND	216	34.3%	(50.6-145)	21.2%	(40)	09/16/09 15:09	M8
PCB-1260	"	77.0	---	12.9	"	"	ND	"	35.7%	(57.6-120)	26.4%	(27.4)	"	M8
Surrogate(s): TCX		*Recovery: 72.2%*			*Limits: 27.9-154%*	"							*09/16/09 15:09*	
Decachlorobiphenyl		*66.7%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090086 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090086-BLK1)							**Extracted: 09/14/09 07:36**							
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/16/09 15:32	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): TCX		*Recovery: 65.9%*			*Limits: 27.9-154%*	"							*09/16/09 15:32*	
Decachlorobiphenyl		*62.2%*			*35-157%*	"							"	
Blank (9090086-BLK2)							**Extracted: 09/14/09 07:36**							
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/16/09 18:29	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): TCX		*Recovery: 28.3%*			*Limits: 27.9-154%*	"							*09/16/09 18:29*	
Decachlorobiphenyl		*52.6%*			*35-157%*	"							"	
LCS (9090086-BS1)							**Extracted: 09/14/09 07:36**							
PCB-1016	EPA 8082	105	---	10.0	ug/kg wet	1x	--	167	63.2%	(63.1-147)	--	--	09/16/09 16:30	
PCB-1260	"	128	---	10.0	"	"	--	"	76.8%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 58.0%*			*Limits: 27.9-154%*	"							*09/16/09 16:30*	
Decachlorobiphenyl		*71.2%*			*35-157%*	"							"	
LCS (9090086-BS2)							**Extracted: 09/14/09 07:36**							
PCB-1016	EPA 8082	106	---	20.0	ug/kg wet	1x	--	167	63.6%	(63.1-147)	--	--	09/18/09 14:47	
PCB-1260	"	141	---	20.0	"	"	--	"	84.5%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 58.2%*			*Limits: 27.9-154%*	"							*09/18/09 14:47*	
Decachlorobiphenyl		*80.0%*			*35-157%*	"							"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090086 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090086-MS1)					**QC Source: SSH0168-07**				**Extracted: 09/14/09 07:36**					
PCB-1016	EPA 8082	135	---	10.7	ug/kg dry	1x	ND	178	75.9%	(50.6-145)	--	--	09/17/09 08:25	
PCB-1260	"	124	---	10.7	"	"	4.76	"	66.9%	(57.6-120)	--	--	"	
Surrogate(s): TCX		*Recovery: 83.0%*			*Limits: 27.9-154%*	"							*09/17/09 08:25*	
Decachlorobiphenyl		*68.1%*			*35-157%*	"							"	
Matrix Spike (9090086-MS2)					**QC Source: SSH0168-07**				**Extracted: 09/14/09 07:36**					
PCB-1016	EPA 8082	97.3	---	10.7	ug/kg dry	1x	ND	178	54.5%	(50.6-145)	--	--	09/17/09 08:48	
PCB-1260	"	95.6	---	10.7	"	"	4.76	"	50.9%	(57.6-120)	--	--	"	M8
Surrogate(s): TCX		*Recovery: 67.4%*			*Limits: 27.9-154%*	"							*09/17/09 08:48*	
Decachlorobiphenyl		*55.2%*			*35-157%*	"							"	
Matrix Spike Dup (9090086-MSD1)					**QC Source: SSH0168-07**				**Extracted: 09/14/09 07:36**					
PCB-1016	EPA 8082	139	---	10.7	ug/kg dry	1x	ND	178	77.7%	(50.6-145)	2.33%	(40)	09/17/09 09:10	
PCB-1260	"	129	---	10.7	"	"	4.76	"	69.8%	(57.6-120)	4.12%	(27.4)	"	
Surrogate(s): TCX		*Recovery: 78.9%*			*Limits: 27.9-154%*	"							*09/17/09 09:10*	
Decachlorobiphenyl		*69.9%*			*35-157%*	"							"	
Matrix Spike Dup (9090086-MSD2)					**QC Source: SSH0168-07**				**Extracted: 09/14/09 07:36**					
PCB-1016	EPA 8082	103	---	10.7	ug/kg dry	1x	ND	178	57.5%	(50.6-145)	5.37%	(40)	09/17/09 09:33	
PCB-1260	"	109	---	10.7	"	"	4.76	"	58.4%	(57.6-120)	13.0%	(27.4)	"	
Surrogate(s): TCX		*Recovery: 56.7%*			*Limits: 27.9-154%*	"							*09/17/09 09:33*	
Decachlorobiphenyl		*61.1%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9080204 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9080204-BLK1)							**Extracted: 08/31/09 13:00**							
1-Methylnapthalene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	08/31/09 18:30	
2-Methylnaphthalene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	0.00178	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (a) pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	0.00311	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (ghi) perylene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	0.00311	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Chrysene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 63.4%*			*Limits: 38.8-139%*	"							*08/31/09 18:30*	
2-FBP		*75.8%*			*40-132%*	"							"	
p-Terphenyl-d14		*125%*			*31.7-179%*	"							"	
LCS (9080204-BS1)							**Extracted: 08/31/09 13:00**							
Chrysene	EPA 8270 mod.	0.338	0.000667	0.00667	mg/kg wet	1x	--	0.444	76.1%	(47.8-120)	--	--	08/31/09 18:51	
Fluorene	"	0.316	0.000667	0.00667	"	"	--	"	71.0%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.410	0.00200	0.00667	"	"	--	"	92.3%	(39.5-120)	--	--	"	
Naphthalene	"	0.288	0.00133	0.00667	"	"	--	"	64.7%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 59.8%*			*Limits: 38.8-139%*	"							*08/31/09 18:51*	
2-FBP		*61.2%*			*40-132%*	"							"	
p-Terphenyl-d14		*84.8%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9080204 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9080204-MS1)					QC Source: SSH0166-01				Extracted: 08/31/09 13:00					
Chrysene	EPA 8270 mod.	0.298	0.000685	0.00685	mg/kg dry	1x	ND	0.457	65.2%	(31.6-132)	--	--	08/31/09 19:56	
Fluorene	"	0.325	0.000685	0.00685	"	"	ND	"	71.1%	(43.4-123)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.374	0.00206	0.00685	"	"	ND	"	81.9%	(28.3-147)	--	--	"	
Naphthalene	"	0.302	0.00137	0.00685	"	"	ND	"	66.2%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 63.4%*			*Limits: 38.8-139%*	"							*08/31/09 19:56*	
2-FBP		*64.0%*			*40-132%*	"							"	
p-Terphenyl-d14		*75.2%*			*31.7-179%*	"							"	
Matrix Spike Dup (9080204-MSD1)					QC Source: SSH0166-01				Extracted: 08/31/09 13:00					
Chrysene	EPA 8270 mod.	0.346	0.000685	0.00685	mg/kg dry	1x	ND	0.457	75.8%	(31.6-132)	15.0%	(30.2)	08/31/09 20:17	
Fluorene	"	0.365	0.000685	0.00685	"	"	ND	"	79.9%	(43.4-123)	11.7%	(36)	"	
Indeno (1,2,3-cd) pyrene	"	0.359	0.00206	0.00685	"	"	ND	"	78.7%	(28.3-147)	3.99%	(32.7)	"	
Naphthalene	"	0.327	0.00137	0.00685	"	"	ND	"	71.5%	(30.9-120)	7.70%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 66.6%*			*Limits: 38.8-139%*	"							*08/31/09 20:17*	
2-FBP		*76.0%*			*40-132%*	"							"	
p-Terphenyl-d14		*88.8%*			*31.7-179%*	"							"	

QC Batch: 9090010 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090010-BLK1)									Extracted: 09/02/09 09:02					
1-Methylnapthalene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/02/09 16:52	
2-Methylnaphthalene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	0.00311	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (b) fluoranthene	"	0.00178	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (ghi) perylene	"	0.00444	0.00200	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (k) fluoranthene	"	0.00178	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Chrysene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	0.00356	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.00267	0.00200	0.00467	"	"	--	--	--	--	--	--	"	J
Naphthalene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090010 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090010-BLK1)									**Extracted: 09/02/09 09:02**					
Phenanthrene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/02/09 16:52	
Pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 77.2%*			*Limits: 38.8-139%*	"							*09/02/09 16:52*	
2-FBP		*74.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*87.8%*			*31.7-179%*	"							"	
LCS (9090010-BS1)									**Extracted: 09/02/09 09:02**					
Chrysene	EPA 8270 mod.	0.313	0.000667	0.00667	mg/kg wet	1x	--	0.444	70.4%	(47.8-120)	--	--	09/02/09 15:27	
Fluorene	"	0.292	0.000667	0.00667	"	"	--	"	65.6%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.321	0.00200	0.00667	"	"	--	"	72.3%	(39.5-120)	--	--	"	
Naphthalene	"	0.275	0.00133	0.00667	"	"	--	"	61.8%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 69.4%*			*Limits: 38.8-139%*	"							*09/02/09 15:27*	
2-FBP		*66.4%*			*40-132%*	"							"	
p-Terphenyl-d14		*76.2%*			*31.7-179%*	"							"	
Matrix Spike (9090010-MS1)					**QC Source: SSI0008-02**				**Extracted: 09/02/09 09:02**					
Chrysene	EPA 8270 mod.	0.600	0.00119	0.0119	mg/kg dry	1x	ND	0.791	75.9%	(31.6-132)	--	--	09/02/09 16:09	
Fluorene	"	0.453	0.00119	0.0119	"	"	ND	"	57.3%	(43.4-123)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.664	0.00356	0.0119	"	"	0.0103	"	82.7%	(28.3-147)	--	--	"	
Naphthalene	"	0.408	0.00237	0.0119	"	"	ND	"	51.6%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 61.0%*			*Limits: 38.8-139%*	"							*09/02/09 16:09*	
2-FBP		*58.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*79.6%*			*31.7-179%*	"							"	
Matrix Spike Dup (9090010-MSD1)					**QC Source: SSI0008-02**				**Extracted: 09/02/09 09:02**					
Chrysene	EPA 8270 mod.	0.528	0.00119	0.0119	mg/kg dry	1x	ND	0.791	66.8%	(31.6-132)	12.8%	(30.2)	09/02/09 16:31	
Fluorene	"	0.492	0.00119	0.0119	"	"	ND	"	62.2%	(43.4-123)	8.20%	(36)	"	
Indeno (1,2,3-cd) pyrene	"	0.592	0.00356	0.0119	"	"	0.0103	"	73.6%	(28.3-147)	11.5%	(32.7)	"	
Naphthalene	"	0.500	0.00237	0.0119	"	"	ND	"	63.2%	(30.9-120)	20.2%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 67.4%*			*Limits: 38.8-139%*	"							*09/02/09 16:31*	
2-FBP		*59.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*69.4%*			*31.7-179%*	"							"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090042 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090042-BLK1)							**Extracted: 09/08/09 13:27**							
1-Methylnapthalene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/14/09 15:45	
2-Methylnaphthalene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	0.00222	0.000667	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (b) fluoranthene	"	0.00356	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (ghi) perylene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	0.00267	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.00222	0.00200	0.00467	"	"	--	--	--	--	--	--	"	J
Naphthalene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 73.0%*			*Limits: 38.8-139%*	"							*09/14/09 15:45*	
2-FBP		*76.8%*			*40-132%*	"							"	
p-Terphenyl-d14		*81.2%*			*31.7-179%*	"							"	
LCS (9090042-BS1)							**Extracted: 09/08/09 13:27**							
Chrysene	EPA 8270 mod.	0.359	0.000667	0.00467	mg/kg wet	1x	--	0.444	80.7%	(47.8-120)	--	--	09/14/09 18:19	
Fluorene	"	0.268	0.000667	0.00467	"	"	--	"	60.3%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.340	0.00200	0.00467	"	"	--	"	76.6%	(39.5-120)	--	--	"	
Naphthalene	"	0.255	0.00133	0.00467	"	"	--	"	57.4%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 59.6%*			*Limits: 38.8-139%*	"							*09/14/09 18:19*	
2-FBP		*63.8%*			*40-132%*	"							"	
p-Terphenyl-d14		*84.8%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090042 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090042-MS1)					**QC Source: SSH0168-06**				**Extracted: 09/08/09 13:27**					
Chrysene	EPA 8270 mod.	0.299	0.000703	0.00492	mg/kg dry	1x	0.00609	0.469	62.5%	(31.6-132)	--	--	09/15/09 04:13	
Fluorene	"	0.302	0.000703	0.00492	"	"	ND	"	64.5%	(43.4-123)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.282	0.00211	0.00492	"	"	0.00469	"	59.1%	(28.3-147)	--	--	"	A-01a
Naphthalene	"	0.301	0.00141	0.00492	"	"	ND	"	64.2%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 65.6%*			*Limits: 38.8-139%*	"							*09/15/09 04:13*	
2-FBP		*75.0%*			*40-132%*	"							"	
p-Terphenyl-d14		*95.4%*			*31.7-179%*	"							"	
Matrix Spike Dup (9090042-MSD1)					**QC Source: SSH0168-06**				**Extracted: 09/08/09 13:27**					
Chrysene	EPA 8270 mod.	0.301	0.000703	0.00492	mg/kg dry	1x	0.00609	0.469	62.9%	(31.6-132)	0.625%	(30.2)	09/15/09 04:34	
Fluorene	"	0.308	0.000703	0.00492	"	"	ND	"	65.8%	(43.4-123)	2.00%	(36)	"	
Indeno (1,2,3-cd) pyrene	"	0.281	0.00211	0.00492	"	"	0.00469	"	59.0%	(28.3-147)	0.167%	(32.7)	"	
Naphthalene	"	0.302	0.00141	0.00492	"	"	ND	"	64.4%	(30.9-120)	0.311%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 62.0%*			*Limits: 38.8-139%*	"							*09/15/09 04:34*	
2-FBP		*65.2%*			*40-132%*	"							"	
p-Terphenyl-d14		*90.2%*			*31.7-179%*	"							"	

QC Batch: 9090060 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090060-BLK1)									**Extracted: 09/10/09 09:59**					
1-Methylnapthalene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/14/09 16:07	
2-Methylnaphthalene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	0.00222	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Benzo (ghi) perylene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	0.00178	0.00133	0.00467	"	"	--	--	--	--	--	--	"	J
Fluoranthene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	0.00200	0.00467	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00133	0.00467	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090060 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090060-BLK1)									**Extracted: 09/10/09 09:59**					
Phenanthrene	EPA 8270 mod.	ND	0.000667	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/14/09 16:07	
Pyrene	"	ND	0.000667	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 49.6%*			*Limits: 38.8-139%*	"							*09/14/09 16:07*	
2-FBP		*56.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*72.4%*			*31.7-179%*	"							"	
LCS (9090060-BS1)									**Extracted: 09/10/09 09:59**					
Chrysene	EPA 8270 mod.	0.352	0.000667	0.00667	mg/kg wet	1x	--	0.444	79.1%	(47.8-120)	--	--	09/14/09 18:40	
Fluorene	"	0.292	0.000667	0.00667	"	"	--	"	65.7%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.336	0.00200	0.00667	"	"	--	"	75.6%	(39.5-120)	--	--	"	
Naphthalene	"	0.260	0.00133	0.00667	"	"	--	"	58.6%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 64.8%*			*Limits: 38.8-139%*	"							*09/14/09 18:40*	
2-FBP		*69.4%*			*40-132%*	"							"	
p-Terphenyl-d14		*84.6%*			*31.7-179%*	"							"	
Matrix Spike (9090060-MS1)					**QC Source: SSH0168-24**				**Extracted: 09/10/09 09:59**					
Chrysene	EPA 8270 mod.	0.369	0.000774	0.00774	mg/kg dry	1x	0.0733	0.516	57.2%	(31.6-132)	--	--	09/15/09 20:17	
Fluorene	"	0.222	0.000774	0.00774	"	"	0.184	"	7.40%	(43.4-123)	--	--	"	M8
Indeno (1,2,3-cd) pyrene	"	0.292	0.00232	0.00774	"	"	0.0155	"	53.5%	(28.3-147)	--	--	"	
Naphthalene	"	0.490	0.00155	0.00774	"	"	0.109	"	73.8%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 104%*			*Limits: 38.8-139%*	"							*09/15/09 20:17*	
2-FBP		*20.6%*			*40-132%*	"							"	*Z*
p-Terphenyl-d14		*116%*			*31.7-179%*	"							"	
Matrix Spike Dup (9090060-MSD1)					**QC Source: SSH0168-24**				**Extracted: 09/10/09 09:59**					
Chrysene	EPA 8270 mod.	0.370	0.000774	0.00774	mg/kg dry	1x	0.0733	0.516	57.4%	(31.6-132)	0.280%	(30.2)	09/15/09 20:39	
Fluorene	"	0.470	0.000774	0.00774	"	"	0.184	"	55.4%	(43.4-123)	71.6%	(36)	"	R
Indeno (1,2,3-cd) pyrene	"	0.294	0.00232	0.00774	"	"	0.0155	"	53.9%	(28.3-147)	0.705%	(32.7)	"	
Naphthalene	"	0.426	0.00155	0.00774	"	"	0.109	"	61.3%	(30.9-120)	14.1%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 148%*			*Limits: 38.8-139%*	"							*09/15/09 20:39*	*ZX*
2-FBP		*40.2%*			*40-132%*	"							"	
p-Terphenyl-d14		*110%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Conventional Chemistry Parameters by APHA/EPA Methods - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090003 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090003-DUP1)					**QC Source: SSH0168-03**				**Extracted: 08/31/09 15:45**					
% Solids	TA SOP	92.2	---	0.0100	% by Weight	1x	92.8	--	--	--	0.649%	(5)	09/01/09 10:39	

QC Batch: 9090016 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090016-DUP1)					**QC Source: SSH0168-22**				**Extracted: 09/01/09 11:15**					
% Solids	TA SOP	87.6	---	0.0100	% by Weight	1x	85.8	--	--	--	2.08%	(5)	09/02/09 10:30	

QC Batch: 9090098 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090098-DUP1)					**QC Source: SSI0046-05**				**Extracted: 09/10/09 10:10**					
% Solids	TA SOP	89.3	---	0.0100	% by Weight	1x	89.0	--	--	--	0.337%	(5)	09/10/09 15:00	

QC Batch: 9090103 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090103-DUP1)					**QC Source: SSI0062-05**				**Extracted: 09/15/09 14:15**					
% Solids	TA SOP	97.5	---	0.0100	% by Weight	1x	97.6	--	--	--	0.103%	(5)	09/16/09 07:30	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49654 **Soil Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (152451D)					**QC Source: SSH0168-01**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	0.254	0.0082	0.026	mg/Kg dry	1x	0.015	0.261	92%	(75-125)	9%	(35)	09/03/09 15:58	
Matrix Spike (152451S)					**QC Source: SSH0168-01**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	0.232	0.0078	0.025	mg/Kg dry	1x	0.015	0.249	88%	(75-125)	--	--	09/03/09 15:54	
Duplicate (152451X)					**QC Source: SSH0168-01**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	ND	0.0079	0.025	mg/Kg dry	1x	0.015	--	--	--	NC%	(35)	09/03/09 15:45	
Blank (580-49689-52)					**QC Source:**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	ND	0.0063	0.020	mg/Kg dry	1x	--	--	--	--	--	--	09/03/09 15:15	
LCS (580-49689-53)					**QC Source:**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	0.205	0.0063	0.020	mg/Kg dry	1x	--	0.200	102%	(75-125)	--	--	09/03/09 15:19	
LCS Dup (580-49689-54)					**QC Source:**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	0.223	0.0063	0.020	mg/Kg dry	1x	--	0.200	112%	(75-125)	8%	(25)	09/03/09 15:23	
LCS (580-49689-55)					**QC Source:**				**Extracted: 09/03/09 13:44**					
Mercury	7471A Dry	5.10	0.035	0.11	mg/Kg dry	1x	--	4.47	114%	(80-120)	--	--	09/03/09 15:27	

QC Batch: 49657 **Soil Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524513D)					**QC Source: SSH0168-14**				**Extracted: 09/03/09 14:24**					
Mercury	7471A Dry	0.203	0.0062	0.020	mg/Kg dry	1x	0.013	0.195	97%	(75-125)	13%	(35)	09/03/09 17:48	
Matrix Spike (1524513S)					**QC Source: SSH0168-14**				**Extracted: 09/03/09 14:24**					
Mercury	7471A Dry	0.231	0.0065	0.021	mg/Kg dry	1x	0.013	0.206	106%	(75-125)	--	--	09/03/09 17:44	
Duplicate (1524513X)					**QC Source: SSH0168-14**				**Extracted: 09/03/09 14:24**					
Mercury	7471A Dry	0.0134	0.0063	0.020	mg/Kg dry	1x	0.013	--	--	--	2%	(35)	09/03/09 17:40	Ja
Blank (580-49689-103)					**QC Source:**				**Extracted: 09/03/09 14:24**					
Mercury	7471A Dry	ND	0.0063	0.020	mg/Kg dry	1x	--	--	--	--	--	--	09/04/09 07:10	
LCS (580-49689-77)					**QC Source:**				**Extracted: 09/03/09 14:24**					
Mercury	7471A Dry	0.200	0.0063	0.020	mg/Kg dry	1x	--	0.200	100%	(75-125)	--	--	09/03/09 17:10	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49657 **Soil Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-49689-78)					**QC Source:**					**Extracted: 09/03/09 14:24**				
Mercury	7471A Dry	0.210	0.0063	0.020	mg/Kg dry	1x	--	0.200	105%	(75-125)	5%	(25)	09/03/09 17:14	
LCS (580-49689-79)					**QC Source:**					**Extracted: 09/03/09 14:24**				
Mercury	7471A Dry	4.94	0.035	0.11	mg/Kg dry	1x	--	4.47	111%	(80-120)	--	--	09/03/09 17:18	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (152451D)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Calcium	6010B TMP Dry	2810	2.0	74	mg/Kg dry	1x	1600	1340	91%	(75-125)	3%	(35)	09/14/09 21:50	
Iron	"	15400	0.62	13	"	"	15000	1470	61%	"	3%	"	"	4
Magnesium	"	7030	0.88	74	"	"	5700	1340	100%	"	4%	"	"	4
Potassium	"	2550	21	220	"	"	1400	"	88%	"	0%	"	"	
Silver	"	34.6	0.060	1.3	"	"	ND	40.2	86%	"	2%	"	"	
Sodium	"	994	9.1	130	"	"	ND	1340	74%	"	3%	"	"	F
Matrix Spike (152451S)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Calcium	6010B TMP Dry	2720	2.0	74	mg/Kg dry	1x	1600	1350	84%	(75-125)	--	--	09/14/09 21:46	
Iron	"	15900	0.62	14	"	"	15000	1490	91%	"	--	--	"	4
Magnesium	"	6790	0.89	74	"	"	5700	1350	81%	"	--	--	"	4
Silver	"	35.4	0.061	1.4	"	"	ND	40.6	87%	"	--	--	"	
Potassium	"	2540	22	220	"	"	1400	1350	87%	"	--	--	"	
Sodium	"	1020	9.2	140	"	"	ND	"	75%	"	--	--	"	
Duplicate (152451X)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Calcium	6010B TMP Dry	1560	1.9	70	mg/Kg dry	1x	1600	--	--	--	2%	(35)	09/14/09 21:42	
Iron	"	14700	0.59	13	"	"	15000	--	--	--	1%	"	"	
Magnesium	"	5600	0.84	70	"	"	5700	--	--	--	1%	"	"	
Potassium	"	1370	20	210	"	"	1400	--	--	--	0%	"	"	
Silver	"	ND	0.057	1.3	"	"	ND	--	--	--	NC%	"	"	
Sodium	"	ND	8.7	130	"	"	ND	--	--	--	NC%	"	"	
Blank (580-50241-13)					**QC Source:**				**Extracted: 09/14/09 11:16**					
Calcium	6010B TMP Dry	ND	1.5	55	mg/Kg dry	1x	--	--	--	--	--	--	09/14/09 21:17	
Iron	"	3.06	0.46	10	"	"	--	--	--	--	--	--	"	Ja
Magnesium	"	0.686	0.66	55	"	"	--	--	--	--	--	--	"	Ja
Potassium	"	ND	16	160	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.045	1.0	"	"	--	--	--	--	--	--	"	
Sodium	"	ND	6.8	100	"	"	--	--	--	--	--	--	"	
LCS (580-50241-14)					**QC Source:**				**Extracted: 09/14/09 11:16**					
Calcium	6010B TMP Dry	965	1.5	55	mg/Kg dry	1x	--	1000	97%	(80-120)	--	--	09/14/09 21:22	
Iron	"	1070	0.46	10	"	"	--	1100	97%	"	--	--	"	
Magnesium	"	968	0.66	55	"	"	--	1000	97%	"	--	--	"	
Silver	"	28.0	0.045	1.0	"	"	--	30.0	93%	"	--	--	"	
Potassium	"	947	16	160	"	"	--	1000	95%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50241-14)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Sodium	6010B TMP Dry	818	6.8	100	mg/Kg dry	1x	--	1000	82%	(80-120)	--	--	09/14/09 21:22	
LCS Dup (580-50241-15)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Calcium	6010B TMP Dry	956	1.5	55	mg/Kg dry	1x	--	1000	96%	(80-120)	1%	(35)	09/14/09 21:26	
Iron	"	1060	0.46	10	"	"	--	1100	97%	"	0%	"	"	
Magnesium	"	962	0.66	55	"	"	--	1000	96%	"	1%	"	"	
Silver	"	28.0	0.045	1.0	"	"	--	30.0	93%	"	0%	"	"	
Potassium	"	935	16	160	"	"	--	1000	93%	"	1%	"	"	
Sodium	"	825	6.8	100	"	"	--	"	83%	"	1%	"	"	
LCS (580-50241-16)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Calcium	6010B TMP Dry	7110	3.0	110	mg/Kg dry	1x	--	7470	95%	(80.6-119.	--	--	09/14/09 21:30	
Iron	"	15200	0.93	20	"	"	--	14600	104%	(30.1-169.	--	--	"	
Magnesium	"	2720	1.3	110	"	"	--	2880	94%	(73.8-126.	--	--	"	
Potassium	"	2500	32	330	"	"	--	2580	97%	(73.3-127.	--	--	"	
Silver	"	75.4	0.091	2.0	"	"	--	83.8	90%	(46.6-153.	--	--	"	
Sodium	"	203	14	200	"	"	--	413	49%	(70.1-129.	--	--	"	*

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524513D)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Calcium	6010B TMP Dry	39800	1.6	58	mg/Kg dry	1x	25000	1050	1450%	(75-125)	48%	(35)	09/14/09 23:41	4, F
Iron	"	17300	0.48	11	"	"	16000	1160	148%	"	3%	"	"	4
Magnesium	"	11400	0.69	58	"	"	6300	1050	481%	"	33%	"	"	4
Silver	"	26.0	0.047	1.1	"	"	ND	31.6	82%	"	1%	"	"	
Potassium	"	2120	17	170	"	"	1200	1050	85%	"	16%	"	"	
Sodium	"	817	7.2	110	"	"	ND	"	78%	"	6%	"	"	
Matrix Spike (1524513S)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Calcium	6010B TMP Dry	24300	1.6	57	mg/Kg dry	1x	25000	1040	-26%	(75-125)	--	--	09/14/09 23:37	4
Iron	"	17900	0.48	10	"	"	16000	1140	198%	"	--	--	"	4
Magnesium	"	8160	0.68	57	"	"	6300	1040	177%	"	--	--	"	4
Potassium	"	2500	17	170	"	"	1200	"	123%	"	--	--	"	
Silver	"	25.8	0.047	1.0	"	"	ND	31.1	83%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1524513S)					**QC Source: SSH0168-14**				**Extracted: 09/14/09 11:44**					
Sodium	6010B TMP Dry	766	7.0	100	mg/Kg dry	1x	ND	1040	74%	(75-125)	--	--	09/14/09 23:37	F
Duplicate (1524513X)					**QC Source: SSH0168-14**				**Extracted: 09/14/09 11:44**					
Calcium	6010B TMP Dry	20100	1.5	56	mg/Kg dry	1x	25000	--	--	--	20%	(35)	09/14/09 23:33	
Iron	"	15400	0.47	10	"	"	16000	--	--	--	1%	"	"	
Magnesium	"	6980	0.67	56	"	"	6300	--	--	--	10%	"	"	
Silver	"	ND	0.046	1.0	"	"	ND	--	--	--	NC%	"	"	
Potassium	"	1180	16	170	"	"	1200	--	--	--	4%	"	"	
Sodium	"	ND	6.9	100	"	"	ND	--	--	--	NC%	"	"	
Blank (580-50240-13)					**QC Source:**				**Extracted: 09/14/09 11:44**					
Calcium	6010B TMP Dry	ND	1.5	55	mg/Kg dry	1x	--	--	--	--	--	--	09/14/09 23:09	
Iron	"	ND	0.46	10	"	"	--	--	--	--	--	--	"	
Magnesium	"	ND	0.66	55	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	16	160	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.045	1.0	"	"	--	--	--	--	--	--	"	
Sodium	"	ND	6.8	100	"	"	--	--	--	--	--	--	"	
LCS (580-50240-14)					**QC Source:**				**Extracted: 09/14/09 11:44**					
Calcium	6010B TMP Dry	981	1.5	55	mg/Kg dry	1x	--	1000	98%	(80-120)	--	--	09/14/09 23:13	
Iron	"	1090	0.46	10	"	"	--	1100	99%	"	--	--	"	
Magnesium	"	985	0.66	55	"	"	--	1000	99%	"	--	--	"	
Silver	"	27.8	0.045	1.0	"	"	--	30.0	93%	"	--	--	"	
Potassium	"	980	16	160	"	"	--	1000	98%	"	--	--	"	
Sodium	"	832	6.8	100	"	"	--	"	83%	"	--	--	"	
LCS Dup (580-50240-15)					**QC Source:**				**Extracted: 09/14/09 11:44**					
Calcium	6010B TMP Dry	976	1.5	55	mg/Kg dry	1x	--	1000	98%	(80-120)	1%	(35)	09/14/09 23:17	
Iron	"	1060	0.46	10	"	"	--	1100	96%	"	3%	"	"	
Magnesium	"	980	0.66	55	"	"	--	1000	98%	"	1%	"	"	
Potassium	"	962	16	160	"	"	--	"	96%	"	2%	"	"	
Silver	"	27.4	0.045	1.0	"	"	--	30.0	91%	"	1%	"	"	
Sodium	"	807	6.8	100	"	"	--	1000	81%	"	3%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50240-16)			**QC Source:**										**Extracted: 09/14/09 11:44**	
Calcium	6010B TMP Dry	7230	3.1	110	mg/Kg dry	1x	--	7470	97%	(80.6-119.	--	--	09/14/09 23:21	
Iron	"	14700	0.94	20	"	"	--	14600	101%	(30.1-169.	--	--	"	
Magnesium	"	2750	1.3	110	"	"	--	2880	96%	(73.8-126.	--	--	"	
Silver	"	76.1	0.092	2.0	"	"	--	83.8	91%	(46.6-153.	--	--	"	
Potassium	"	2590	33	340	"	"	--	2580	100%	(73.3-127.	--	--	"	
Sodium	"	201	14	200	"	"	--	413	49%	(70.1-129.	--	--	"	Ja, *

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (152451D)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Aluminum	6020 TMP Dry	11600	2.0	200	mg/Kg dry	50x	10000	268	551%	(75-125)	3%	(35)	09/14/09 14:59	4
Arsenic	"	325	0.0052	1.3	"	"	5.7	"	119%	"	6%	"	"	
Antimony	"	207	0.044	1.3	"	"	0.45	201	103%	"	6%	"	"	
Barium	"	382	0.010	1.3	"	"	76	268	114%	"	5%	"	"	
Beryllium	"	7.87	0.0046	1.3	"	"	0.37	6.70	112%	"	2%	"	"	
Manganese	"	205	0.11	3.3	"	"	130	67.0	117%	"	3%	"	"	
Nickel	"	91.3	0.025	1.3	"	"	13	"	117%	"	4%	"	"	
Cadmium	"	7.78	0.0031	1.3	"	"	0.15	6.70	114%	"	8%	"	"	
Selenium	"	330	0.013	3.3	"	"	0.19	268	123%	"	3%	"	"	
Chromium	"	40.5	0.027	1.3	"	"	11	26.8	112%	"	3%	"	"	
Thallium	"	306	0.027	2.7	"	"	0.16	268	114%	"	3%	"	"	
Cobalt	"	82.8	0.0036	1.3	"	"	6.8	67.0	113%	"	3%	"	"	
Vanadium	"	102	0.018	1.3	"	"	26	"	114%	"	3%	"	"	
Copper	"	56.7	0.021	1.3	"	"	18	33.5	117%	"	1%	"	"	
Zinc	"	115	0.10	4.7	"	"	34	67.0	121%	"	2%	"	"	
Lead	"	84.4	0.0067	1.3	"	"	8.4	"	114%	"	4%	"	"	
Matrix Spike (152451S)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Arsenic	6020 TMP Dry	305	0.0053	1.4	mg/Kg dry	50x	5.7	271	110%	(75-125)	--	--	09/14/09 14:53	
Aluminum	"	11300	2.0	200	"	"	10000	"	417%	"	--	--	"	4
Barium	"	364	0.010	1.4	"	"	76	"	106%	"	--	--	"	
Antimony	"	195	0.045	1.4	"	"	0.45	203	96%	"	--	--	"	
Beryllium	"	7.70	0.0047	1.4	"	"	0.37	6.77	108%	"	--	--	"	
Manganese	"	200	0.11	3.4	"	"	130	67.7	107%	"	--	--	"	
Nickel	"	87.8	0.025	1.4	"	"	13	"	111%	"	--	--	"	
Cadmium	"	7.16	0.0032	1.4	"	"	0.15	6.77	104%	"	--	--	"	
Selenium	"	321	0.013	3.4	"	"	0.19	271	118%	"	--	--	"	
Chromium	"	39.3	0.027	1.4	"	"	11	27.1	106%	"	--	--	"	
Thallium	"	295	0.027	2.7	"	"	0.16	271	109%	"	--	--	"	
Cobalt	"	80.7	0.0037	1.4	"	"	6.8	67.7	109%	"	--	--	"	
Copper	"	56.1	0.022	1.4	"	"	18	33.8	114%	"	--	--	"	
Vanadium	"	98.5	0.018	1.4	"	"	26	67.7	107%	"	--	--	"	
Zinc	"	113	0.10	4.7	"	"	34	"	117%	"	--	--	"	
Lead	"	81.1	0.0068	1.4	"	"	8.4	"	107%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (152451X)					**QC Source: SSH0168-01**				**Extracted: 09/14/09 11:16**					
Arsenic	6020 TMP Dry	5.97	0.0010	0.26	mg/Kg dry	10x	5.7	--	--	--	4%	(35)	09/14/09 14:47	
Aluminum	"	10500	0.38	38	"	"	10000	--	--	--	4%	"	"	
Antimony	"	0.471	0.0084	0.26	"	"	0.45	--	--	--	5%	"	"	
Barium	"	73.8	0.0019	0.26	"	"	76	--	--	--	3%	"	"	
Manganese	"	130	0.020	0.64	"	"	130	--	--	--	2%	"	"	
Beryllium	"	0.377	0.00088	0.26	"	"	0.37	--	--	--	2%	"	"	
Cadmium	"	0.110	0.00060	0.26	"	"	0.15	--	--	--	33%	"	"	Ja
Nickel	"	13.8	0.0047	0.26	"	"	13	--	--	--	5%	"	"	
Chromium	"	10.9	0.0051	0.26	"	"	11	--	--	--	2%	"	"	
Selenium	"	0.210	0.0024	0.64	"	"	0.19	--	--	--	8%	"	"	Ja
Cobalt	"	7.07	0.00069	0.26	"	"	6.8	--	--	--	3%	"	"	
Thallium	"	0.157	0.0051	0.51	"	"	0.16	--	--	--	3%	"	"	Ja
Vanadium	"	26.4	0.0034	0.26	"	"	26	--	--	--	2%	"	"	
Copper	"	18.0	0.0041	0.26	"	"	18	--	--	--	2%	"	"	
Lead	"	8.25	0.0013	0.26	"	"	8.4	--	--	--	1%	"	"	
Zinc	"	34.8	0.019	0.89	"	"	34	--	--	--	2%	"	"	
Blank (580-50224-14)					**QC Source:**				**Extracted: 09/14/09 11:16**					
Aluminum	6020 TMP Dry	ND	0.30	30	mg/Kg dry	10x	--	--	--	--	--	--	09/14/09 14:28	
Arsenic	"	ND	0.00078	0.20	"	"	--	--	--	--	--	--	"	
Antimony	"	0.0138	0.0066	0.20	"	"	--	--	--	--	--	--	"	Ja
Barium	"	0.0298	0.0015	0.20	"	"	--	--	--	--	--	--	"	Ja
Beryllium	"	0.0170	0.00069	0.20	"	"	--	--	--	--	--	--	"	Ja
Manganese	"	ND	0.016	0.50	"	"	--	--	--	--	--	--	"	
Cadmium	"	0.0206	0.00047	0.20	"	"	--	--	--	--	--	--	"	Ja
Nickel	"	ND	0.0037	0.20	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.0040	0.20	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.0019	0.50	"	"	--	--	--	--	--	--	"	
Cobalt	"	0.000957	0.00054	0.20	"	"	--	--	--	--	--	--	"	Ja
Thallium	"	0.0654	0.0040	0.40	"	"	--	--	--	--	--	--	"	Ja
Vanadium	"	0.0291	0.0027	0.20	"	"	--	--	--	--	--	--	"	Ja
Copper	"	0.00498	0.0032	0.20	"	"	--	--	--	--	--	--	"	Ja
Zinc	"	ND	0.015	0.70	"	"	--	--	--	--	--	--	"	
Lead	"	0.0154	0.0010	0.20	"	"	--	--	--	--	--	--	"	Ja

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50224-21)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Arsenic	6020 TMP Dry	201	0.0039	1.0	mg/Kg dry	50x	--	200	100%	(80-120)	--	--	09/14/09 15:11	
Aluminum	"	199	1.5	150	"	"	--	"	99%	"	--	--	"	
Antimony	"	148	0.033	1.0	"	"	--	150	99%	"	--	--	"	
Barium	"	199	0.0075	1.0	"	"	--	200	99%	"	--	--	"	
Manganese	"	49.0	0.080	2.5	"	"	--	50.0	98%	"	--	--	"	
Beryllium	"	4.91	0.0034	1.0	"	"	--	5.00	98%	"	--	--	"	
Cadmium	"	5.04	0.0024	1.0	"	"	--	"	101%	"	--	--	"	
Nickel	"	49.9	0.018	1.0	"	"	--	50.0	100%	"	--	--	"	
Selenium	"	200	0.0094	2.5	"	"	--	200	100%	"	--	--	"	
Chromium	"	19.8	0.020	1.0	"	"	--	20.0	99%	"	--	--	"	
Thallium	"	203	0.020	2.0	"	"	--	200	102%	"	--	--	"	
Cobalt	"	50.3	0.0027	1.0	"	"	--	50.0	101%	"	--	--	"	
Vanadium	"	51.0	0.014	1.0	"	"	--	"	102%	"	--	--	"	
Copper	"	25.4	0.016	1.0	"	"	--	25.0	102%	"	--	--	"	
Zinc	"	48.6	0.075	3.5	"	"	--	50.0	97%	"	--	--	"	
Lead	"	50.6	0.0050	1.0	"	"	--	"	101%	"	--	--	"	
LCS Dup (580-50224-22)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Aluminum	6020 TMP Dry	201	1.5	150	mg/Kg dry	50x	--	200	101%	(80-120)	1%	(35)	09/14/09 15:18	
Arsenic	"	202	0.0039	1.0	"	"	--	"	101%	"	1%	"	"	
Antimony	"	146	0.033	1.0	"	"	--	150	97%	"	2%	"	"	
Barium	"	198	0.0075	1.0	"	"	--	200	99%	"	0%	"	"	
Manganese	"	49.5	0.080	2.5	"	"	--	50.0	99%	"	1%	"	"	
Beryllium	"	4.82	0.0034	1.0	"	"	--	5.00	96%	"	2%	"	"	
Cadmium	"	4.78	0.0024	1.0	"	"	--	"	96%	"	5%	"	"	
Nickel	"	50.6	0.018	1.0	"	"	--	50.0	101%	"	1%	"	"	
Selenium	"	199	0.0094	2.5	"	"	--	200	100%	"	0%	"	"	
Chromium	"	19.6	0.020	1.0	"	"	--	20.0	98%	"	1%	"	"	
Cobalt	"	50.6	0.0027	1.0	"	"	--	50.0	101%	"	1%	"	"	
Thallium	"	204	0.020	2.0	"	"	--	200	102%	"	0%	"	"	
Copper	"	25.9	0.016	1.0	"	"	--	25.0	104%	"	2%	"	"	
Vanadium	"	50.6	0.014	1.0	"	"	--	50.0	101%	"	1%	"	"	
Zinc	"	51.0	0.075	3.5	"	"	--	"	102%	"	5%	"	"	
Lead	"	50.6	0.0050	1.0	"	"	--	"	101%	"	0%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50177 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50224-38)					**QC Source:**								**Extracted: 09/14/09 11:16**	
Arsenic	6020 TMP Dry	83.4	0.0079	2.0	mg/Kg dry	50x	--	95.5	87%	(79.2-121.	--	--	09/14/09 17:01	
Aluminum	"	9070	3.0	300	"	"	--	7010	129%	(51.1-148.	--	--	"	
Barium	"	417	0.015	2.0	"	"	--	426	98%	(81.5-118.	--	--	"	
Antimony	"	208	0.067	2.0	"	"	--	204	102%	(0.0-263.2	--	--	"	
Manganese	"	263	0.16	5.1	"	"	--	292	90%	(76.7-123.	--	--	"	
Beryllium	"	58.8	0.0070	2.0	"	"	--	62.6	94%	(79.6-120.	--	--	"	
Cadmium	"	58.9	0.0048	2.0	"	"	--	63.0	93%	(81.2-118.	--	--	"	
Nickel	"	115	0.037	2.0	"	"	--	118	98%	(78.5-122.	--	--	"	
Chromium	"	95.4	0.041	2.0	"	"	--	99.0	96%	(80.1-119.	--	--	"	
Selenium	"	153	0.019	5.1	"	"	--	161	95%	(76.7-123.	--	--	"	
Thallium	"	131	0.041	4.1	"	"	--	128	102%	(78.1-121.	--	--	"	
Cobalt	"	72.3	0.0055	2.0	"	"	--	76.2	95%	(81.0-119.	--	--	"	
Copper	"	84.6	0.032	2.0	"	"	--	87.8	96%	(78.4-122.	--	--	"	
Vanadium	"	106	0.027	2.0	"	"	--	106	100%	(77.1-123.	--	--	"	
Lead	"	102	0.010	2.0	"	"	--	92.4	111%	(81.5-118.	--	--	"	
Zinc	"	217	0.15	7.1	"	"	--	232	94%	(80.4-119.	--	--	"	

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524513D)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Aluminum	6020 TMP Dry	7560	1.6	160	mg/Kg dry	50x	6800	210	380%	(75-125)	11%	(35)	09/14/09 17:58	4
Arsenic	"	272	0.0041	1.1	"	"	17	"	121%	"	10%	"	"	
Antimony	"	155	0.035	1.1	"	"	0.97	158	97%	"	11%	"	"	
Barium	"	284	0.0079	1.1	"	"	47	210	113%	"	13%	"	"	
Beryllium	"	6.29	0.0036	1.1	"	"	0.36	5.26	113%	"	12%	"	"	
Manganese	"	595	0.084	2.6	"	"	520	52.6	148%	"	9%	"	"	4
Cadmium	"	6.41	0.0025	1.1	"	"	0.13	5.26	119%	"	10%	"	"	
Nickel	"	77.9	0.019	1.1	"	"	17	52.6	115%	"	7%	"	"	
Selenium	"	262	0.0099	2.6	"	"	0.068	210	125%	"	5%	"	"	
Chromium	"	29.7	0.021	1.1	"	"	6.2	21.0	112%	"	10%	"	"	
Thallium	"	242	0.021	2.1	"	"	0.14	210	115%	"	13%	"	"	
Cobalt	"	71.3	0.0028	1.1	"	"	11	52.6	115%	"	10%	"	"	
Copper	"	54.5	0.017	1.1	"	"	23	26.3	121%	"	8%	"	"	
Vanadium	"	71.8	0.014	1.1	"	"	10	52.6	117%	"	9%	"	"	
Lead	"	68.5	0.0053	1.1	"	"	9.3	"	112%	"	12%	"	"	
Zinc	"	89.7	0.079	3.7	"	"	26	"	122%	"	10%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524513D)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Matrix Spike (1524513S)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Arsenic	6020 TMP Dry	246	0.0040	1.0	mg/Kg dry	50x	17	207	111%	(75-125)	--	--	09/14/09 17:51	
Aluminum	"	6790	1.6	160	"	"	6800	"	13%	"	--	--	"	4
Antimony	"	139	0.034	1.0	"	"	0.97	155	89%	"	--	--	"	
Barium	"	251	0.0078	1.0	"	"	47	207	98%	"	--	--	"	
Manganese	"	543	0.083	2.6	"	"	520	51.8	49%	"	--	--	"	4
Beryllium	"	5.56	0.0036	1.0	"	"	0.36	5.18	100%	"	--	--	"	
Cadmium	"	5.80	0.0024	1.0	"	"	0.13	"	109%	"	--	--	"	
Nickel	"	72.7	0.019	1.0	"	"	17	51.8	107%	"	--	--	"	
Selenium	"	248	0.0097	2.6	"	"	0.068	207	120%	"	--	--	"	
Chromium	"	26.9	0.021	1.0	"	"	6.2	20.7	100%	"	--	--	"	
Cobalt	"	64.5	0.0028	1.0	"	"	11	51.8	103%	"	--	--	"	
Thallium	"	213	0.021	2.1	"	"	0.14	207	103%	"	--	--	"	
Vanadium	"	65.9	0.014	1.0	"	"	10	51.8	107%	"	--	--	"	
Copper	"	50.2	0.017	1.0	"	"	23	25.9	106%	"	--	--	"	
Lead	"	61.0	0.0052	1.0	"	"	9.3	51.8	100%	"	--	--	"	
Zinc	"	81.4	0.078	3.6	"	"	26	"	108%	"	--	--	"	
Duplicate (1524513X)					**QC Source: SSH0168-14**								**Extracted: 09/14/09 11:44**	
Arsenic	6020 TMP Dry	15.9	0.00079	0.20	mg/Kg dry	10x	17	--	--	--	4%	(35)	09/14/09 17:44	
Aluminum	"	6600	0.30	30	"	"	6800	--	--	--	2%	"	"	
Barium	"	46.6	0.0015	0.20	"	"	47	--	--	--	1%	"	"	
Antimony	"	0.928	0.0067	0.20	"	"	0.97	--	--	--	5%	"	"	
Manganese	"	505	0.016	0.51	"	"	520	--	--	--	2%	"	"	
Beryllium	"	0.345	0.00070	0.20	"	"	0.36	--	--	--	4%	"	"	
Cadmium	"	0.291	0.00048	0.20	"	"	0.13	--	--	--	76%	"	"	
Nickel	"	16.8	0.0037	0.20	"	"	17	--	--	--	3%	"	"	
Chromium	"	5.97	0.0041	0.20	"	"	6.2	--	--	--	3%	"	"	
Selenium	"	0.0907	0.0019	0.51	"	"	0.068	--	--	--	28%	"	"	Ja
Cobalt	"	10.8	0.00055	0.20	"	"	11	--	--	--	2%	"	"	
Thallium	"	0.119	0.0041	0.41	"	"	0.14	--	--	--	17%	"	"	Ja
Copper	"	22.1	0.0032	0.20	"	"	23	--	--	--	2%	"	"	
Vanadium	"	10.3	0.0027	0.20	"	"	10	--	--	--	1%	"	"	
Lead	"	9.08	0.0010	0.20	"	"	9.3	--	--	--	3%	"	"	
Zinc	"	24.8	0.015	0.71	"	"	26	--	--	--	3%	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50224-41)					**QC Source:**								**Extracted: 09/14/09 11:44**	
Aluminum	6020 TMP Dry	0.772	0.30	30	mg/Kg dry	10x	--	--	--	--	--	--	09/14/09 17:22	Ja
Arsenic	"	ND	0.00078	0.20	"	"	--	--	--	--	--	--	"	
Antimony	"	0.00720	0.0066	0.20	"	"	--	--	--	--	--	--	"	Ja
Barium	"	0.0159	0.0015	0.20	"	"	--	--	--	--	--	--	"	Ja
Manganese	"	ND	0.016	0.50	"	"	--	--	--	--	--	--	"	
Beryllium	"	ND	0.00069	0.20	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.0037	0.20	"	"	--	--	--	--	--	--	"	
Cadmium	"	ND	0.00047	0.20	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.0040	0.20	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.0019	0.50	"	"	--	--	--	--	--	--	"	
Cobalt	"	0.00225	0.00054	0.20	"	"	--	--	--	--	--	--	"	Ja
Thallium	"	0.0480	0.0040	0.40	"	"	--	--	--	--	--	--	"	Ja
Copper	"	ND	0.0032	0.20	"	"	--	--	--	--	--	--	"	
Vanadium	"	0.106	0.0027	0.20	"	"	--	--	--	--	--	--	"	Ja
Lead	"	0.00692	0.0010	0.20	"	"	--	--	--	--	--	--	"	Ja
Zinc	"	ND	0.015	0.70	"	"	--	--	--	--	--	--	"	
LCS (580-50224-48)					**QC Source:**								**Extracted: 09/14/09 11:44**	
Arsenic	6020 TMP Dry	202	0.0039	1.0	mg/Kg dry	50x	--	200	101%	(80-120)	--	--	09/14/09 18:12	
Aluminum	"	205	1.5	150	"	"	--	"	103%	"	--	--	"	
Barium	"	196	0.0075	1.0	"	"	--	"	98%	"	--	--	"	
Antimony	"	146	0.033	1.0	"	"	--	150	97%	"	--	--	"	
Beryllium	"	4.79	0.0034	1.0	"	"	--	5.00	96%	"	--	--	"	
Manganese	"	49.6	0.080	2.5	"	"	--	50.0	99%	"	--	--	"	
Cadmium	"	5.28	0.0024	1.0	"	"	--	5.00	106%	"	--	--	"	
Nickel	"	51.1	0.018	1.0	"	"	--	50.0	102%	"	--	--	"	
Chromium	"	19.9	0.020	1.0	"	"	--	20.0	100%	"	--	--	"	
Selenium	"	198	0.0094	2.5	"	"	--	200	99%	"	--	--	"	
Cobalt	"	50.8	0.0027	1.0	"	"	--	50.0	102%	"	--	--	"	
Thallium	"	199	0.020	2.0	"	"	--	200	100%	"	--	--	"	
Copper	"	26.2	0.016	1.0	"	"	--	25.0	105%	"	--	--	"	
Vanadium	"	51.4	0.014	1.0	"	"	--	50.0	103%	"	--	--	"	
Lead	"	50.0	0.0050	1.0	"	"	--	"	100%	"	--	--	"	
Zinc	"	50.6	0.075	3.5	"	"	--	"	101%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50182 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50224-49)					**QC Source:**								**Extracted: 09/14/09 11:44**	
Aluminum	6020 TMP Dry	199	1.5	150	mg/Kg dry	50x	--	200	99%	(80-120)	3%	(35)	09/14/09 18:19	
Arsenic	"	202	0.0039	1.0	"	"	--	"	101%	"	0%	"	"	
Barium	"	198	0.0075	1.0	"	"	--	"	99%	"	1%	"	"	
Antimony	"	146	0.033	1.0	"	"	--	150	98%	"	0%	"	"	
Manganese	"	49.1	0.080	2.5	"	"	--	50.0	98%	"	1%	"	"	
Beryllium	"	4.85	0.0034	1.0	"	"	--	5.00	97%	"	1%	"	"	
Nickel	"	49.9	0.018	1.0	"	"	--	50.0	100%	"	2%	"	"	
Cadmium	"	4.90	0.0024	1.0	"	"	--	5.00	98%	"	7%	"	"	
Chromium	"	19.6	0.020	1.0	"	"	--	20.0	98%	"	2%	"	"	
Selenium	"	202	0.0094	2.5	"	"	--	200	101%	"	2%	"	"	
Cobalt	"	49.9	0.0027	1.0	"	"	--	50.0	100%	"	2%	"	"	
Thallium	"	203	0.020	2.0	"	"	--	200	102%	"	2%	"	"	
Copper	"	25.5	0.016	1.0	"	"	--	25.0	102%	"	3%	"	"	
Vanadium	"	51.0	0.014	1.0	"	"	--	50.0	102%	"	1%	"	"	
Lead	"	50.0	0.0050	1.0	"	"	--	"	100%	"	0%	"	"	
Zinc	"	47.4	0.075	3.5	"	"	--	"	95%	"	6%	"	"	
LCS (580-50224-65)					**QC Source:**								**Extracted: 09/14/09 11:44**	
Aluminum	6020 TMP Dry	8910	3.1	310	mg/Kg dry	50x	--	7010	127%	(51.1-148.	--	--	09/14/09 20:21	
Arsenic	"	84.9	0.0080	2.0	"	"	--	95.5	89%	(79.2-121.	--	--	"	
Barium	"	410	0.015	2.0	"	"	--	426	96%	(81.5-118.	--	--	"	
Antimony	"	205	0.067	2.0	"	"	--	204	100%	(0.0-263.2	--	--	"	
Beryllium	"	56.5	0.0070	2.0	"	"	--	62.6	90%	(79.6-120.	--	--	"	
Manganese	"	259	0.16	5.1	"	"	--	292	89%	(76.7-123.	--	--	"	
Nickel	"	114	0.038	2.0	"	"	--	118	97%	(78.5-122.	--	--	"	
Cadmium	"	56.6	0.0048	2.0	"	"	--	63.0	90%	(81.2-118.	--	--	"	
Selenium	"	151	0.019	5.1	"	"	--	161	94%	(76.7-123.	--	--	"	
Chromium	"	95.0	0.041	2.0	"	"	--	99.0	96%	(80.1-119.	--	--	"	
Cobalt	"	72.0	0.0055	2.0	"	"	--	76.2	95%	(81.0-119.	--	--	"	
Thallium	"	128	0.041	4.1	"	"	--	128	100%	(78.1-121.	--	--	"	
Vanadium	"	108	0.028	2.0	"	"	--	106	102%	(77.1-123.	--	--	"	
Copper	"	85.3	0.033	2.0	"	"	--	87.8	97%	(78.4-122.	--	--	"	
Zinc	"	219	0.15	7.1	"	"	--	232	95%	(80.4-119.	--	--	"	
Lead	"	101	0.010	2.0	"	"	--	92.4	109%	(81.5-118.	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Percent Moisture - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49710 **Soil Preparation Method: NA**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (1524520X)				**QC Source: SSH0168-21**					**Extracted: 09/04/09 11:04**					
Percent Solids	Moisture	91	0.10	0.10	%	1x	89	--	--	--	2%	(20)	09/04/09 11:04	
Percent Moisture	"	9.4	0.10	0.10	"	"	11	--	--	--	17%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49722 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49727-3)				**QC Source:**					**Extracted: 09/04/09 12:30**					
Bromomethane	8260B STD Dry	ND	0.00038	0.0010	mg/Kg dry	1x	--	--	--	--	--	--	09/04/09 12:51	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.00012	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	0.000088	0.0020	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.000072	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	0.00036	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 98%*			*Limits: 85-115%*	"							*09/04/09 12:51*	
1,2-Dichloroethane-d4 (Surr)		*116%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*101%*			*85-120%*	"							"	
LCS (580-49727-4)				**QC Source:**					**Extracted: 09/04/09 12:30**					
Bromomethane	8260B STD Dry	0.0431	0.00038	0.0010	mg/Kg dry	1x	--	0.0500	86%	(30-160)	--	--	09/04/09 13:14	
Chloroethane	"	0.0358	0.00027	0.0010	"	"	--	"	72%	(40-155)	--	--	"	
Chloromethane	"	0.0375	0.00018	0.0010	"	"	--	"	75%	(50-130)	--	--	"	
trans-1,3-Dichloropropene	"	0.0414	0.00018	0.0010	"	"	--	"	83%	(65-125)	--	--	"	
Chloroform	"	0.0434	0.00015	0.0010	"	"	--	"	87%	(70-125)	--	--	"	
Ethylene Dibromide	"	0.0466	0.00013	0.0010	"	"	--	"	93%	"	--	--	"	
1,2-Dichloroethane	"	0.0446	0.00016	0.0010	"	"	--	"	89%	(70-135)	--	--	"	
Trichloroethene	"	0.0425	0.00018	0.0010	"	"	--	"	85%	(75-125)	--	--	"	
Carbon tetrachloride	"	0.0420	0.00037	0.0010	"	"	--	"	84%	(65-135)	--	--	"	
1,2-Dichloropropane	"	0.0437	0.00017	0.0010	"	"	--	"	87%	(70-120)	--	--	"	
Dichlorobromomethane	"	0.0434	0.000074	0.0010	"	"	--	"	87%	(70-130)	--	--	"	
cis-1,3-Dichloropropene	"	0.0427	0.00012	0.0010	"	"	--	"	85%	(70-125)	--	--	"	
1,1,2,2-Tetrachloroethane	"	0.0496	0.000088	0.0020	"	"	--	"	99%	(55-130)	--	--	"	
Bromoform	"	0.0490	0.000072	0.0010	"	"	--	"	98%	(55-135)	--	--	"	
1,2,3-Trichloropropane	"	0.0494	0.00036	0.0010	"	"	--	"	99%	(65-130)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	0.0528	0.00018	0.0020	"	"	--	"	106%	(40-135)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49722 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-49727-4)					**QC Source:**				**Extracted: 09/04/09 12:30**					
Hexachlorobutadiene	8260B STD Dry	0.0423	0.00034	0.0010	mg/Kg dry	1x	--	0.0500	85%	(55-140)	--	--	09/04/09 13:14	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 99%*			*Limits: 85-115%*	"							*09/04/09 13:14*	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*102%*			*75-125%*	"							"	
LCS Dup (580-49727-5)					**QC Source:**				**Extracted: 09/04/09 12:30**					
Bromomethane	8260B STD Dry	0.0466	0.00038	0.0010	mg/Kg dry	1x	--	0.0500	93%	(30-160)	8%	(30)	09/04/09 13:38	
Chloroethane	"	0.0396	0.00027	0.0010	"	"	--	"	79%	(40-155)	10%	"	"	
Chloromethane	"	0.0407	0.00018	0.0010	"	"	--	"	81%	(50-130)	8%	"	"	
trans-1,3-Dichloropropene	"	0.0447	0.00018	0.0010	"	"	--	"	89%	(65-125)	8%	"	"	
Ethylene Dibromide	"	0.0485	0.00013	0.0010	"	"	--	"	97%	(70-125)	4%	"	"	
Chloroform	"	0.0468	0.00015	0.0010	"	"	--	"	94%	"	8%	"	"	
1,2-Dichloroethane	"	0.0472	0.00016	0.0010	"	"	--	"	94%	(70-135)	6%	"	"	
Trichloroethene	"	0.0471	0.00018	0.0010	"	"	--	"	94%	(75-125)	10%	"	"	
Carbon tetrachloride	"	0.0446	0.00037	0.0010	"	"	--	"	89%	(65-135)	6%	"	"	
1,2-Dichloropropane	"	0.0471	0.00017	0.0010	"	"	--	"	94%	(70-120)	7%	"	"	
Dichlorobromomethane	"	0.0472	0.000074	0.0010	"	"	--	"	94%	(70-130)	8%	"	"	
cis-1,3-Dichloropropene	"	0.0459	0.00012	0.0010	"	"	--	"	92%	(70-125)	7%	"	"	
1,1,2,2-Tetrachloroethane	"	0.0479	0.000088	0.0020	"	"	--	"	96%	(55-130)	3%	"	"	
Bromoform	"	0.0487	0.000072	0.0010	"	"	--	"	97%	(55-135)	1%	"	"	
1,2,3-Trichloropropane	"	0.0475	0.00036	0.0010	"	"	--	"	95%	(65-130)	4%	"	"	
1,2-Dibromo-3-Chloropropane	"	0.0470	0.00018	0.0020	"	"	--	"	94%	(40-135)	12%	"	"	
Hexachlorobutadiene	"	0.0449	0.00034	0.0010	"	"	--	"	90%	(55-140)	6%	"	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/04/09 13:38*	
1,2-Dichloroethane-d4 (Surr)		*101%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*99%*			*85-120%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49810 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49831-3)				**QC Source:**					**Extracted: 09/08/09 11:31**					
Bromomethane	8260B STD Dry	ND	0.00038	0.0010	mg/Kg dry	1x	--	--	--	--	--	--	09/08/09 15:06	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.00012	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	0.000088	0.0020	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.000072	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	0.00036	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s):	*Toluene-d8 (Surr)*	*Recovery:*	*99%*		*Limits:*	*85-115%*	*"*						*09/08/09 15:06*	
	1,2-Dichloroethane-d4 (Surr)		*105%*			*75-125%*	*"*						*"*	
	4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	*"*						*"*	
LCS (580-49831-4)				**QC Source:**					**Extracted: 09/08/09 11:31**					
Bromomethane	8260B STD Dry	0.0426	0.00038	0.0010	mg/Kg dry	1x	--	0.0500	85%	(30-160)	--	--	09/08/09 15:30	
Chloroethane	"	0.0375	0.00027	0.0010	"	"	--	"	75%	(40-155)	--	--	"	
Chloromethane	"	0.0414	0.00018	0.0010	"	"	--	"	83%	(50-130)	--	--	"	
trans-1,3-Dichloropropene	"	0.0432	0.00018	0.0010	"	"	--	"	86%	(65-125)	--	--	"	
Ethylene Dibromide	"	0.0483	0.00013	0.0010	"	"	--	"	97%	(70-125)	--	--	"	
Chloroform	"	0.0428	0.00015	0.0010	"	"	--	"	86%	"	--	--	"	
1,2-Dichloroethane	"	0.0426	0.00016	0.0010	"	"	--	"	85%	(70-135)	--	--	"	
Carbon tetrachloride	"	0.0406	0.00037	0.0010	"	"	--	"	81%	(65-135)	--	--	"	
Trichloroethene	"	0.0452	0.00018	0.0010	"	"	--	"	90%	(75-125)	--	--	"	
1,2-Dichloropropane	"	0.0469	0.00017	0.0010	"	"	--	"	94%	(70-120)	--	--	"	
Dichlorobromomethane	"	0.0433	0.000074	0.0010	"	"	--	"	87%	(70-130)	--	--	"	
cis-1,3-Dichloropropene	"	0.0449	0.00012	0.0010	"	"	--	"	90%	(70-125)	--	--	"	
1,1,2,2-Tetrachloroethane	"	0.0499	0.000088	0.0020	"	"	--	"	100%	(55-130)	--	--	"	
Bromoform	"	0.0472	0.000072	0.0010	"	"	--	"	94%	(55-135)	--	--	"	
1,2,3-Trichloropropane	"	0.0482	0.00036	0.0010	"	"	--	"	96%	(65-130)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	0.0504	0.00018	0.0020	"	"	--	"	101%	(40-135)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49810 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-49831-4)					**QC Source:**				**Extracted: 09/08/09 11:31**					
Hexachlorobutadiene	8260B STD Dry	0.0430	0.00034	0.0010	mg/Kg dry	1x	--	0.0500	86%	(55-140)	--	--	09/08/09 15:30	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 98%*			*Limits: 85-115%*	"							*09/08/09 15:30*	
4-Bromofluorobenzene (Surr)		*101%*			*85-120%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*97%*			*75-125%*	"							"	
LCS Dup (580-49831-5)					**QC Source:**				**Extracted: 09/08/09 11:31**					
Bromomethane	8260B STD Dry	0.0484	0.00038	0.0010	mg/Kg dry	1x	--	0.0500	97%	(30-160)	13%	(30)	09/08/09 15:54	
Chloroethane	"	0.0465	0.00027	0.0010	"	"	--	"	93%	(40-155)	21%	"	"	
Chloromethane	"	0.0463	0.00018	0.0010	"	"	--	"	93%	(50-130)	11%	"	"	
trans-1,3-Dichloropropene	"	0.0474	0.00018	0.0010	"	"	--	"	95%	(65-125)	9%	"	"	
Ethylene Dibromide	"	0.0534	0.00013	0.0010	"	"	--	"	107%	(70-125)	10%	"	"	
Chloroform	"	0.0477	0.00015	0.0010	"	"	--	"	95%	"	11%	"	"	
1,2-Dichloroethane	"	0.0479	0.00016	0.0010	"	"	--	"	96%	(70-135)	12%	"	"	
Carbon tetrachloride	"	0.0449	0.00037	0.0010	"	"	--	"	90%	(65-135)	10%	"	"	
Trichloroethene	"	0.0493	0.00018	0.0010	"	"	--	"	99%	(75-125)	9%	"	"	
1,2-Dichloropropane	"	0.0504	0.00017	0.0010	"	"	--	"	101%	(70-120)	7%	"	"	
Dichlorobromomethane	"	0.0469	0.000074	0.0010	"	"	--	"	94%	(70-130)	8%	"	"	
cis-1,3-Dichloropropene	"	0.0499	0.00012	0.0010	"	"	--	"	100%	(70-125)	11%	"	"	
1,1,2,2-Tetrachloroethane	"	0.0558	0.000088	0.0020	"	"	--	"	112%	(55-130)	11%	"	"	
Bromoform	"	0.0543	0.000072	0.0010	"	"	--	"	109%	(55-135)	14%	"	"	
1,2,3-Trichloropropane	"	0.0547	0.00036	0.0010	"	"	--	"	109%	(65-130)	13%	"	"	
1,2-Dibromo-3-Chloropropane	"	0.0587	0.00018	0.0020	"	"	--	"	117%	(40-135)	15%	"	"	
Hexachlorobutadiene	"	0.0479	0.00034	0.0010	"	"	--	"	96%	(55-140)	11%	"	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/08/09 15:54*	
4-Bromofluorobenzene (Surr)		*102%*			*85-120%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*96%*			*75-125%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49928 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524520D)					**QC Source: SSH0168-21**				**Extracted: 09/09/09 15:36**					
1,1-Dichloroethene	8260B STD Dry	1.04	0.0066	0.026	mg/Kg dry	1x	ND	1.06	98%	(65-135)	3%	(30)	09/09/09 16:53	
Benzene	"	1.03	0.0033	0.021	"	"	ND	"	98%	(75-125)	1%	"	"	
Trichloroethene	"	0.979	0.0045	0.021	"	"	0.036	"	89%	"	0%	"	"	
Toluene	"	0.996	0.0032	0.053	"	"	ND	"	94%	(70-125)	1%	"	"	
Chlorobenzene	"	0.976	0.0030	0.053	"	"	ND	"	92%	(75-125)	0%	"	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/09/09 16:53*	
Ethylbenzene-d10		*105%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*98%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*91%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*103%*			*75-125%*	"							"	
Matrix Spike (1524520S)					**QC Source: SSH0168-21**				**Extracted: 09/09/09 15:36**					
1,1-Dichloroethene	8260B STD Dry	1.07	0.0066	0.026	mg/Kg dry	1x	ND	1.06	101%	(65-135)	--	--	09/09/09 16:29	
Benzene	"	1.04	0.0033	0.021	"	"	ND	"	99%	(75-125)	--	--	"	
Trichloroethene	"	0.979	0.0045	0.021	"	"	0.036	"	89%	"	--	--	"	
Toluene	"	1.01	0.0032	0.053	"	"	ND	"	95%	(70-125)	--	--	"	
Chlorobenzene	"	0.979	0.0030	0.053	"	"	ND	"	93%	(75-125)	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 100%*			*Limits: 85-115%*	"							*09/09/09 16:29*	
Ethylbenzene-d10		*110%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*90%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*103%*			*75-125%*	"							"	
Blank (580-49922-3)					**QC Source:**				**Extracted: 09/09/09 15:36**					
1,1-Dichloropropene	8260B STD Dry	ND	0.0018	0.040	mg/Kg dry	1x	--	--	--	--	--	--	09/09/09 15:41	
Bromomethane	"	0.0870	0.025	0.14	"	"	--	--	--	--	--	--	"	Ja
4-Chlorotoluene	"	ND	0.013	0.040	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.0026	0.040	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.023	0.40	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.0032	0.040	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.0080	0.040	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.0021	0.040	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.060	0.40	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.0017	0.0080	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.0050	0.020	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
1,3-Dichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.0037	0.040	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49928 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49922-3)				**QC Source:**									**Extracted: 09/09/09 15:36**	
Methylene Chloride	8260B STD Dry	0.00958	0.0038	0.040	mg/Kg dry	1x	--	--	--	--	--	--	09/09/09 15:41	Ja
4-Isopropyltoluene	"	ND	0.0028	0.040	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	0.0024	0.040	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	0.0035	0.040	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	0.012	0.040	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.0038	0.040	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.0040	0.016	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.0032	0.040	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	0.0025	0.016	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.0021	0.040	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.0022	0.040	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.0037	0.020	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.0034	0.016	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.0039	0.012	"	"	--	--	--	--	--	--	"	
Toluene	"	ND	0.0024	0.040	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.0040	0.040	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.0030	0.040	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.0018	0.012	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.0024	0.016	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.0021	0.020	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	ND	0.0023	0.040	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.0037	0.040	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.0048	0.040	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.0080	0.040	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	0.0033	0.010	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	0.0078	0.040	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	0.0023	0.040	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.0038	0.040	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.011	0.040	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.0018	0.040	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	0.0027	0.040	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.0028	0.040	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	0.012	0.040	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	0.0054	0.040	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.0042	0.040	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.0073	0.040	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49928 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49922-3)					**QC Source:**								**Extracted: 09/09/09 15:36**	
1,2-Dibromo-3-Chloropropane	"	ND	0.066	0.20	"	"	--	--	--	--	--	--	"	
1,2,4-Trichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.0056	0.040	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.0060	0.040	"	"	--	--	--	--	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/09/09 15:41*	
Ethylbenzene-d10		*103%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*99%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*94%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*102%*			*75-125%*	"							"	
LCS (580-49922-4)					**QC Source:**								**Extracted: 09/09/09 15:36**	
1,1-Dichloroethene	8260B STD Dry	0.830	0.0050	0.020	mg/Kg dry	1x	--	0.800	104%	(65-135)	--	--	09/09/09 16:05	
Benzene	"	0.805	0.0025	0.016	"	"	--	"	101%	(75-125)	--	--	"	
Trichloroethene	"	0.699	0.0034	0.016	"	"	--	"	87%	"	--	--	"	
Toluene	"	0.747	0.0024	0.040	"	"	--	"	93%	(70-125)	--	--	"	
Chlorobenzene	"	0.760	0.0023	0.040	"	"	--	"	95%	(75-125)	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 98%*			*Limits: 85-115%*	"							*09/09/09 16:05*	
Ethylbenzene-d10		*109%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*93%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*104%*			*75-125%*	"							"	
Blank (580-50037-3)					**QC Source:**								**Extracted: 09/09/09 15:36**	
1,2,4-Trimethylbenzene	8260B STD Dry	ND	0.0021	0.040	mg/Kg dry	1x	--	--	--	--	--	--	09/10/09 17:59	
4-Isopropyltoluene	"	ND	0.0028	0.040	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.0060	0.040	"	"	--	--	--	--	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 102%*			*Limits: 85-115%*	"							*09/10/09 17:59*	
Ethylbenzene-d10		*106%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*99%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*97%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*105%*			*75-125%*	"							"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49942 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1524524D)					**QC Source: SSH0168-25**					**Extracted: 09/09/09 17:34**				
1,1-Dichloroethene	8260B STD Dry	1.21	0.0077	0.031	mg/Kg dry	1x	ND	1.23	98%	(65-135)	5%	(30)	09/10/09 07:21	
Benzene	"	1.22	0.0038	0.025	"	"	ND	"	99%	(75-125)	0%	"	"	
Trichloroethene	"	1.12	0.0052	0.025	"	"	ND	"	91%	"	6%	"	"	
Toluene	"	1.19	0.0037	0.061	"	"	0.031	"	94%	(70-125)	3%	"	"	
Chlorobenzene	"	1.12	0.0035	0.061	"	"	ND	"	91%	(75-125)	0%	"	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 101%*			*Limits: 85-115%*	"							*09/10/09 07:21*	
Ethylbenzene-d10		*105%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Fluorobenzene (Surr)		*102%*			*75-125%*	"							"	
Matrix Spike (1524524S)					**QC Source: SSH0168-25**					**Extracted: 09/09/09 17:34**				
1,1-Dichloroethene	8260B STD Dry	1.28	0.0077	0.031	mg/Kg dry	1x	ND	1.23	104%	(65-135)	--	--	09/10/09 06:57	
Benzene	"	1.22	0.0038	0.025	"	"	ND	"	99%	(75-125)	--	--	"	
Trichloroethene	"	1.05	0.0052	0.025	"	"	ND	"	85%	"	--	--	"	
Toluene	"	1.16	0.0037	0.061	"	"	0.031	"	91%	(70-125)	--	--	"	
Chlorobenzene	"	1.12	0.0035	0.061	"	"	ND	"	91%	(75-125)	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/10/09 06:57*	
Ethylbenzene-d10		*104%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Fluorobenzene (Surr)		*103%*			*75-125%*	"							"	
Blank (580-49949-4)					**QC Source:**					**Extracted: 09/09/09 17:34**				
4-Chlorotoluene	8260B STD Dry	ND	0.013	0.040	mg/Kg dry	1x	--	--	--	--	--	--	09/10/09 04:57	
1,1-Dichloropropene	"	ND	0.0018	0.040	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.0026	0.040	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	0.025	0.14	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.0032	0.040	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.023	0.40	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.0080	0.040	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.0021	0.040	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.060	0.40	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.0050	0.020	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.0017	0.0080	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	0.0038	0.040	"	"	--	--	--	--	--	--	"	
1,3-Dichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.0037	0.040	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	0.0024	0.040	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49942 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49949-4)				**QC Source:**									**Extracted: 09/09/09 17:34**	
4-Isopropyltoluene	8260B STD Dry	ND	0.0028	0.040	mg/Kg dry	1x	--	--	--	--	--	--	09/10/09 04:57	
trans-1,2-Dichloroethene	"	ND	0.0035	0.040	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	0.012	0.040	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.0040	0.016	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.0038	0.040	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	0.0025	0.016	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.0032	0.040	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.0021	0.040	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.0022	0.040	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.0034	0.016	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.0037	0.020	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.0039	0.012	"	"	--	--	--	--	--	--	"	
Toluene	"	ND	0.0024	0.040	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.0040	0.040	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.0030	0.040	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.0018	0.012	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.0024	0.016	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	ND	0.0023	0.040	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.0021	0.020	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.0037	0.040	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.0080	0.040	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.0048	0.040	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	0.0033	0.010	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	0.0078	0.040	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	0.0023	0.040	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.0038	0.040	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.011	0.040	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.0018	0.040	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	0.0027	0.040	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.0028	0.040	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	0.012	0.040	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	0.0054	0.040	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.0042	0.040	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.0073	0.040	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.066	0.20	"	"	--	--	--	--	--	--	"	
1,2,4-Trichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	01/11/10 11:27

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49942 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-49949-4)				**QC Source:**					**Extracted: 09/09/09 17:34**					
1,2,3-Trichlorobenzene	"	ND	0.0050	0.040	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.0056	0.040	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.0060	0.040	"	"	--	--	--	--	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 97%*			*Limits: 85-115%*	"							*09/10/09 04:57*	
Ethylbenzene-d10		*105%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*96%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*93%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*105%*			*75-125%*	"							"	
LCS (580-49949-6)				**QC Source:**					**Extracted: 09/09/09 17:34**					
1,1-Dichloroethene	8260B STD Dry	0.826	0.0050	0.020	mg/Kg dry	1x	--	0.800	103%	(65-135)	--	--	09/10/09 05:45	
Benzene	"	0.836	0.0025	0.016	"	"	--	"	104%	(75-125)	--	--	"	
Trichloroethene	"	0.726	0.0034	0.016	"	"	--	"	91%	"	--	--	"	
Toluene	"	0.761	0.0024	0.040	"	"	--	"	95%	(70-125)	--	--	"	
Chlorobenzene	"	0.747	0.0023	0.040	"	"	--	"	93%	(75-125)	--	--	"	
Surrogate(s): Toluene-d8 (Surr)		*Recovery: 99%*			*Limits: 85-115%*	"							*09/10/09 05:45*	
Ethylbenzene-d10		*103%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*101%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*90%*			*75-125%*	"							"	
Fluorobenzene (Surr)		*105%*			*75-125%*	"							"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Method Performed: 6010B TMP Dry

Samples: SSH0168-01, SSH0168-02, SSH0168-03, SSH0168-04, SSH0168-05, SSH0168-06, SSH0168-07, SSH0168-09, SSH0168-10, SSH0168-11, SSH0168-12, SSH0168-13, SSH0168-14, SSH0168-15, SSH0168-16, SSH0168-17, SSH0168-18, SSH0168-19, SSH0168-20, SSH0168-21, SSH0168-22, SSH0168-23, SSH0168-24, SSH0168-25

Method Performed: 6020 TMP Dry

Samples: SSH0168-01, SSH0168-02, SSH0168-03, SSH0168-04, SSH0168-05, SSH0168-06, SSH0168-07, SSH0168-09, SSH0168-10, SSH0168-11, SSH0168-12, SSH0168-13, SSH0168-14, SSH0168-15, SSH0168-16, SSH0168-17, SSH0168-18, SSH0168-19, SSH0168-20, SSH0168-21, SSH0168-22, SSH0168-23, SSH0168-24, SSH0168-25

Method Performed: 7471A Dry

Samples: SSH0168-01, SSH0168-02, SSH0168-03, SSH0168-04, SSH0168-05, SSH0168-06, SSH0168-07, SSH0168-09, SSH0168-10, SSH0168-11, SSH0168-12, SSH0168-13, SSH0168-14, SSH0168-15, SSH0168-16, SSH0168-17, SSH0168-18, SSH0168-19, SSH0168-20, SSH0168-21, SSH0168-22, SSH0168-23, SSH0168-24, SSH0168-25

Method Performed: 8260B STD Dry

Samples: SSH0168-01, SSH0168-01RE1, SSH0168-02, SSH0168-02RE1, SSH0168-03, SSH0168-03RE1, SSH0168-04, SSH0168-04RE1, SSH0168-05, SSH0168-05RE1, SSH0168-06, SSH0168-06RE1, SSH0168-07, SSH0168-07RE1, SSH0168-09, SSH0168-09RE1, SSH0168-10, SSH0168-10RE1, SSH0168-11, SSH0168-11RE1, SSH0168-12, SSH0168-12RE1, SSH0168-13, SSH0168-13RE1, SSH0168-14, SSH0168-14RE1, SSH0168-15, SSH0168-15RE1, SSH0168-16, SSH0168-16RE1, SSH0168-17, SSH0168-17RE1, SSH0168-18, SSH0168-18RE1, SSH0168-19, SSH0168-19RE1, SSH0168-20, SSH0168-20RE1, SSH0168-21, SSH0168-21RE1, SSH0168-22, SSH0168-22RE1, SSH0168-23, SSH0168-23RE1, SSH0168-24, SSH0168-24RE1, SSH0168-25, SSH0168-25RE1

Method Performed: Moisture

Samples: SSH0168-01, SSH0168-02, SSH0168-03, SSH0168-04, SSH0168-05, SSH0168-06, SSH0168-07, SSH0168-09, SSH0168-10, SSH0168-11, SSH0168-12, SSH0168-13, SSH0168-14, SSH0168-15, SSH0168-16, SSH0168-17, SSH0168-18, SSH0168-19, SSH0168-20, SSH0168-21, SSH0168-22, SSH0168-23, SSH0168-24, SSH0168-25

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

Notes and Definitions

Report Specific Notes:

*	-	LCS or LCSD exceeds the control limits
4	-	MS, MSD: The analyte present in the original sample is 4 times greater than the matrix spike concentration; therefore, control limits are not applicable.
A-01	-	Internal standard was above recovery limits due to sample matrix effects.
A-01a	-	Internal standard was below recovery limits due to sample matrix effects.
B	-	Compound was found in the blank and sample.
F	-	MS or MSD exceeds the control limits
I	-	Indicates the presence of an interference, recovery is not calculated.
Ia	-	Internal Standard recovery was outside of method limits. Matrix interference was confirmed by reanalysis.
J	-	Estimated value. Analyte detected at a level less than the Reporting Limit (RL) and greater than or equal to the Method Detection Limit (MDL). The user of this data should be aware that this data is of limited reliability.
Ja	-	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
M8	-	The MS and/or MSD were below the acceptance limits. See Blank Spike (LCS).
MHA	-	Due to high levels of analyte in the sample, the MS/MSD calculation does not provide useful spike recovery information. See Blank Spike (LCS).
R	-	The RPD exceeded the method control limit due to sample matrix effects. The individual analyte QA/QC recoveries, however, were within acceptance limits.
RL2	-	Reporting limit raised due to high concentrations of hydrocarbons.
RL3	-	Reporting limit raised due to high concentrations of non-target analytes.
X	-	Surrogate exceeds the control limits
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
Z3	-	The sample required a dilution due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	01/11/10 11:27

MDL* - METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.

Dil - Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.

Reporting Limits - Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.

Electronic Signature - Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy.* Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 580168

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. COTE /

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: 10 STD | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: X STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:

* *Turnaround Requests less than standard may incur Rush Charges.*

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH-Dx	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 GTP1-10.5-082709	082709/9:40		X	X	X	X	X	X				-01
2 GTP1-13.5-082709	082709/10:10		X	X	X	X	X	X				-02
GTP3-3.5-082709	082709/14:15		X	X	X	X	X	X				-03
4 GTP3-5-082709	082709/14:35		X	X	X	X	X	X				-04
GTP3-13.5-082709	082709/14:49		X	X	X	X	X	X				-05
6 GTP4-2.5-082709	082709/15:40		X	X	X	X	X	X				-06
GTP4-6.0-082709	082709/15:59		X	X	X	X	X	X				-07
GTP4-11.0-082809	082809/9:37		X	X	X	X	X	X				-08
GTP5-3.0-082709	082709/16:40		X	X	X	X	X	X				-09
GTP5-7.0-082709	082709/16:53		X	X	X	X	X	X				-10

RELEASED BY: Amanda Cote — PRINT NAME: Amanda Cote — FIRM: GAI — DATE: 082909 — TIME: 9:05
RECEIVED BY: Chris Williams — PRINT NAME: Chris Williams — FIRM: TAS Spokane — DATE: 8/29/09 — TIME: 9:05
RELEASED BY: — PRINT NAME: — FIRM: — DATE: — TIME:
RECEIVED BY: — PRINT NAME: — FIRM: — DATE: — TIME:

ADDITIONAL REMARKS:
EPA 8270C incl: naphthalene, 1-methylnaphthalene, 2-methylnaphthlene

TEMP: 5.6°C

TAL-1000(0408)

PAHs all SIM

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SST10168

CLIENT: Golder Assoc. Inc

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing

PROJECT NUMBER:

SAMPLED BY:

TURNAROUND REQUEST

in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* *Turnaround Requests less than standard may incur Rush Charges.*

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8260B TCL VOC	EPA 8270C TCL SVOC	EPA 6010/6020A	EPA 7471B	EPA 8082	NWTPH-Dx	EPA 8270C SIM	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 GTP6-10-082809	082809/10:36		X	X	X	X	X	X	X				-11
2 GTP6-2.5-082809	082809/10:10		X	X	X	X	X	X	X				-12
3 GTP6-17-082809	082809/11:11		X	X	X	X	X	X	X				-13
GTP7-2.5-082809	082809/12:50		X	X	X	X	X	X	X				-14
GTP7-10-082809	082809/13:27		X	X	X	X	X	X	X				-15
GTP7-18-082809	082809/13:58		X	X	X	X	X	X	X				-16
GTP2-2.5-082709	082709/11:40		X	X	X	X	X	X	X				-17
GTP2-8-082709	082709/11:58		X	X	X	X	X	X	X				-18
GTP2-13-082709	082709/17:29		X	X	X	X	X	X	X				-19
GTP1-2.5-082709	082709/9:20		X	X	X	X	X	X	X				-20

RELEASED BY: Amanda Cote — PRINT NAME: Amanda Cote — FIRM: GAI — DATE: 082909 — TIME: 9:05

RECEIVED BY: Chris Williams — PRINT NAME: Chris Williams — FIRM: TA Spokane — DATE: 8/29/09 — TIME: 9:05

RELEASED BY: — PRINT NAME: — FIRM: — DATE: — TIME:

RECEIVED BY: — PRINT NAME: — FIRM: — DATE: — TIME:

ADDITIONAL REMARKS:
EPA 8270C inc. naphthalene, 1-methylnaphthalene & 2-methylnaphthalene.
PAH's all SIM

TEMP: 5.6°C

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSH0168

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY:

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: ~~10~~ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH-DX	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	GTPS-11-082809	082809/9:37		X	X	X	X	X	X				-21
2	TS-Comp-1	082709/18:10		X	X	X	X	X	X				-22
3	TS-Comp 2	082709/18:28		X	X	X	X	X	X				-23
4	TS-Comp3	082709/16:40		X	X	X	X	X	X				-24
5													
6													
7													
8													
9													
10													

RELEASED BY: [signature] DATE: 082909
PRINT NAME: Amanda Cote FIRM: GAI TIME: 9:05

RECEIVED BY: [signature] DATE: 8/26/09
PRINT NAME: Chris Williams FIRM: TA-Spokane TIME: 9105

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS:
EPA 8270C inc: naphthalene, 1-methyl naphthalene 2-methyl naphthalene

TEMP: 5.6°C

PAGE 5 OF 5

PAH's all SIM

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSH0168 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 8/29/09 905 Cooler signed for by: C. Williams
(Print name)

Preliminary Examination Phase:

Date cooler opened: ☑ same as date received *or* 8/31/09

Cooler opened by (print) C. Hanson (sign)

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☑ CLIENT ☐ Other:

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 2 Signed by _____ Date __/__/__

   Were custody seals unbroken and intact on arrival? ☐ Yes ☑ No

3. Were custody papers sealed in a plastic bag? ☐ Yes ☑ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☑ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☑ Yes ☐ No

6. Was ice used? ☑ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☑ real ice ☐ dry ice Condition of Ice: Melted

   Temperature by IR Gun 5.6 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☑ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: _____

8. Did samples arrive in plastic bags? ☑ Yes ☐ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☑ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☑ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☑ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☑ Yes ☐ No

13. Is there adequate volume for the tests requested? ☑ Yes ☐ No

14. Were VOA vials free of bubbles? ☐ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 8/31/09

Samples logged in by (print) C. Hanson (sign)

1. Was project identifiable from custody papers? ☑ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☑ Yes ☐ No

3. Was the Project Manager notified of status? ☑ Yes ☐ No

4. Was the Lab notified of status? ☑ Yes ☐ No

5. Was the COC scanned and copied? ☑ Yes ☐ No

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **SSH0168**

SAMPLES	Collect	MATRIX
SSH0168-01	8/27/09 and SSH0168-14	8-28-09 SOIL
SSH0168-02	-15	
SSH0168-03	-16	
SSH0168-04	-17	8-27-09
SSH0168-05	-18	
SSH0168-06	-19	
SSH0168-07	-20	
SSH0168-09	-21	8-28-09
SSH0168-10	-22	8-27-09
SSH0168-11	8-28-09 -23	
SSH0168-12	-24	
SSH0168-13	-25	

DATA ASSESSMENT SUMMARY

REVIEW ITEM	ICP/ AES 6010	ICP/ MS 6020	Hg/ Se 7074	CN	Anions	OTHER
1. Data Completeness	O	O	O			
2. Holding Times	O	O	O			
3. Calibration	O	O	O			
4. Blanks →	O	X 1	O			
5. Lab Duplicate, Field Duplicate RPD	O	O	O			
6. LCS, Blank Spike, MFS →	X 2	O	O			
7. Matrix Spike, MSD →	O	O	O			
8. GFAA, MSA, (Serial Dil.)	X (3)	X (3)	O			
9. Detection Limits, Other QC	Θ 4	O	O			
10. Data Verification, Overall Summary	O	O	O			

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Cd & Th detected in prep blank; Multiple Sample detects qualified as 'U'.

(2) Na recovery in LCS ↓ & assoc. results qual. (J/UJ).

(3) Sample -01 & -13 qualif. (J/UJ) due to Ser. Dilut^n > 10%.

(4) Fe & Ag do not meet Regulatory Screen Level @ the RL.

Validated by: [signature] Date: Nov. 10, 2009

Reviewed by: Date:

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ ICV/CCV Results
- ✓ Blank Results
- ✓ ICP Interference Check Results
- ✓ Spike Recovery Results
- ✓ Duplicate Results
- ✓ LCS Results
- o Standard Addition Results
- ✓ ICP Serial Dilution
- ✓ Instrument Det. Limits
- ✓ ICP Correction Factors
- ✓ ICP Linear Ranges
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ ICP Raw Data
- o GFAA Raw Data
- ✓ Hg Raw Data
- o Cyanide Raw Data
- o Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: _____

2. Holding Times (Check all that apply)..... ☑ ☐

__ICP/GFAA metals completed in <6 months from collection
__Mercury analyzed in <28 days from collection
__Cyanide completed in 14 days from collection

Comments/Qualified Results: See Summary page - No Quals.

3. Calibrations (Check all that apply)..... ☑ ☐

__ICV/CCV %R for ICP/AA, 90%-110%, acceptable
__ICV/CCV %R for ICP/AA, 75%-89% or 111%-125%, results estimated (J/UJ)
__ICV/CCV %R for ICP/AA, <75% or >125%, reject positive results (R)
__ICV/CCV %R 80-120% for Hg, results accepted
__CRDL Check Stnd %R 70 – 130, (50-150 SbPbTl)
__ICV/CCV %R for Hg, 65%-79% or 121%-135%, results estimated (J/UJ)
__ICV/CCV %R 85-115% for Cyanide, results acceptable
__ICV/CCV %R 70-84% or 116-130%, results estimated (J/UJ)
__ICV/CCV %R <70% or >130%, reject pos results (R)

Comments/Qualified Results: Associated Samples tested with 9/14 – 9/16 batch – NO QUALIF Applied.

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

4. Blanks (Check all that apply)..... ☐ ☒

__Detects reported in ICB/CCB list:
__Detects in preparation blanks, list:
__Detects in field blanks, list

Qualified as undetected (U) all sample concentrations ≤10X any associated blank concentrations and less than the PQL, or J+ for samples greater than the PQL.

Comments/Qualified Results: 6010 – No qualif.

9/14 6020: #177/16A x10 results 182/16A 7074 Hg #49654✓ 49657✓

Sb	.138 mg/KG	Al	7.72
→ Ba	.298	Sb	.072
Be	.170	Ba	.159
⊗ → Cd	.206	Co	.022
Co	.0096	Pb	.069
Cu	.050	⊗ Th	.480
Pb	.154	V	1.66
⊗ → Th	.65		
→ V	.29		

5. Duplicates (Check all that apply)..... ☑ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field Duplicate ID_____

Comments/Qualified Results 6010: #50177✓, 50182✓

6020 #50224✓ 50177✓

Hg 49654✓

7. Laboratory Control Samples, Blank Spikes (Check all that apply)... ☐ ☒

✓LCS %R 80-120%, [50-150% for Ag, Sb]
✗LCS %R 50-79% or >120%, results >IDL estimated (J)
✗LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: 6010: LCS 177/16A ⊗ Na ↑ recovery (J/UJ) All Smpls. Batch 50241) 177/17-A✓ 6020: Batch 50224✓, 50177✓, 50182✓. MS✓

Hg #49654✓ MS✓

8. Spike Recovery (Check all that apply)..... ☑ ☐

__Spike %R with 75-125%
__Spike %R 30-74%, >125%, results > IDL est. (J)
__Spike %R 30-74% results <IDL estimated (UJ)
__Spike %R <30%, results <IDL rejected (UR)
__Field blanks used for spike analysis
__Post digest spk rqrd: %R 75-125%, excpt Ag

Comments/Qualified Results: See section (7). No Quals.

9. GFAA Performance, MSA, or Serial Dilutions..... ☐ ☒

__Duplicate injection RSD <20%
__Duplicate injection RSD >20%, results > CRDL estimated (J)
__Analytical spike %R 85-115%
__Analytical spike %R 40-85%, results > IDL estimated (J)
__Analytical spike %R 10-40%, results <IDL estimated (UJ)
__Analytical spike %R <10%, results <IDL rejected (R)

Comments/Qualified Results: ⊗ Serial Dilutn on Sample -01 qualify Fe, Al, Co, Zn assoc. results Qual (J/UJ).
⊗ Sample -13 qualify Fe, Mg, Al, Cu, Ni, Zn (J/UJ)

10. Detection Limits, Other QC..... ☑ ☐

Comments/Qualified Results: ICS - ✓
Ag @ 1mg/Kg for RL does not meet Req Screen Level.
Fe @ 10 " " " " " " " " "

11. Data Verification and Overall Assessment..... ☑ ☐

Comments/Qualified Results:

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
GTP1-10.5-082709	SSH0168-01	Soil	08/27/09 09:40	08/29/09 09:05
GTP1-13.5-082709	SSH0168-02	Soil	08/27/09 10:10	08/29/09 09:05
GTP3-3.5-082709	SSH0168-03	Soil	08/27/09 14:15	08/29/09 09:05
GTP3-5-082709	SSH0168-04	Soil	08/27/09 14:35	08/29/09 09:05
GTP3-13.5-082709	SSH0168-05	Soil	08/27/09 14:49	08/29/09 09:05
GTP4-2.5-082709	SSH0168-06	Soil	08/27/09 15:40	08/29/09 09:05
GTP4-8.0-082709	SSH0168-07	Soil	08/27/09 15:59	08/29/09 09:05
GTP5-3.0-082709	SSH0168-09	Soil	08/27/09 16:40	08/29/09 09:05
GTP5-7.0-082709	SSH0168-10	Soil	08/27/09 16:53	08/29/09 09:05
GTP6-10-082809	SSH0168-11	Soil	08/28/09 10:36	08/29/09 09:05
GTP6-2.5-082809	SSH0168-12	Soil	08/28/09 10:10	08/29/09 09:05
GTP6-17-082809	SSH0168-13	Soil	08/28/09 11:11	08/29/09 09:05
GTP7-2.5-082809	SSH0168-14	Soil	08/28/09 12:50	08/29/09 09:05
GTP7-10.0-082809	SSH0168-15	Soil	08/28/09 13:27	08/29/09 09:05
GTP7-18-082809	SSH0168-16	Soil	08/28/09 13:58	08/29/09 09:05
GTP2-2.5-082709	SSH0168-17	Soil	08/27/09 11:40	08/29/09 09:05
GTP2-8-082709	SSH0168-18	Soil	08/27/09 11:58	08/29/09 09:05
GTP2-13-082709	SSH0168-19	Soil	08/27/09 17:28	08/29/09 09:05
GTP1-2.5-082709	SSH0168-20	Soil	08/27/09 09:20	08/29/09 09:05
GTP5-11-082809	SSH0168-21	Soil	08/28/09 09:37	08/29/09 09:05
TS-COMP-1	SSH0168-22	Soil	08/27/09 18:10	08/29/09 09:05
TS-COMP-2	SSH0168-23	Soil	08/27/09 18:28	08/29/09 09:05
TS-COMP-3	SSH0168-24	Soil	08/27/09 16:40	08/29/09 09:05
GTP4-6.0-082709	SSH0168-25	Soil	08/27/09 15:49	08/29/09 09:05

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		Soil				Sampled: 08/27/09 09:40				
Calcium	6010B TMP Dry	**1600**	*2.0*	72	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 21:38	
Iron	"	**15000** J	*0.61*	13	"	"	"	"	"	B
Magnesium	"	**5700**	*0.87*	72	"	"	"	"	"	B
Potassium	"	**1400**	*21*	220	"	"	"	"	"	
Silver	"	ND	*0.059*	1.3	"	"	"	"	"	
Sodium	"	ND UJ	*8.9*	130	"	"	"	"	"	*
SSH0168-02 (GTP1-13.5-082709)		Soil				Sampled: 08/27/09 10:10				
Calcium	6010B TMP Dry	**1500**	*1.5*	57	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:06	
Iron	"	**13000**	*0.48*	10	"	"	"	"	"	B
Magnesium	"	**3900**	*0.68*	57	"	"	"	"	"	B
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.046*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*7.0*	100	"	"	"	"	"	*
SSH0168-03 (GTP3-3.5-082709)		Soil				Sampled: 08/27/09 14:15				
Calcium	6010B TMP Dry	**5200**	*1.6*	58	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:10	
Iron	"	**15000**	*0.49*	11	"	"	"	"	"	B
Magnesium	"	**9600**	*0.70*	58	"	"	"	"	"	B
Potassium	"	**2900**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.2*	110	"	"	"	"	"	*
SSH0168-04 (GTP3-5-082709)		Soil				Sampled: 08/27/09 14:35				
Calcium	6010B TMP Dry	**5300**	*1.9*	71	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:14	
Iron	"	**12000**	*0.59*	13	"	"	"	"	"	B
Magnesium	"	**5300**	*0.85*	71	"	"	"	"	"	B
Potassium	"	**2100**	*21*	210	"	"	"	"	"	
Silver	"	ND	*0.058*	1.3	"	"	"	"	"	
Sodium	"	ND UJ	*8.8*	130	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**				**Sampled: 08/27/09 14:49**				
Calcium	6010B TMP Dry	**1800**	*1.9*	68	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:17	
Iron	"	**20000**	*0.57*	12	"	"	"	"	"	B
Magnesium	"	**6100**	*0.82*	68	"	"	"	"	"	B
Potassium	"	**2800**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.056*	1.2	"	"	"	"	"	
Sodium	"	ND UJ	*8.4*	120	"	"	"	"	"	*
SSH0168-06 (GTP4-2.5-082709)		**Soil**				**Sampled: 08/27/09 15:40**				
Calcium	6010B TMP Dry	**2500**	*1.5*	55	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:21	
Iron	"	**14000**	*0.46*	10	"	"	"	"	"	B
Magnesium	"	**3300**	*0.66*	55	"	"	"	"	"	B
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.045*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*6.8*	100	"	"	"	"	"	*
SSH0168-07 (GTP4-8.0-082709)		**Soil**				**Sampled: 08/27/09 15:59**				
Calcium	6010B TMP Dry	**900**	*1.6*	59	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:25	
Iron	"	**12000**	*0.49*	11	"	"	"	"	"	B
Magnesium	"	**3200**	*0.71*	59	"	"	"	"	"	B
Potassium	"	**1100**	*17*	180	"	"	"	"	"	
Silver	"	ND	*0.048*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.3*	110	"	"	"	"	"	*
SSH0168-09 (GTP5-3.0-082709)		**Soil**				**Sampled: 08/27/09 16:40**				
Calcium	6010B TMP Dry	**2700**	*1.6*	57	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:29	
Iron	"	**18000**	*0.48*	10	"	"	"	"	"	B
Magnesium	"	**4400**	*0.69*	57	"	"	"	"	"	B
Potassium	"	**1600**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*7.1*	100	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**					**Sampled: 08/27/09 16:53**			
Calcium	6010B TMP Dry	**5900**	*3.1*	110	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:32	
Iron	"	**7800**	*0.96*	21	"	"	"	"	"	B
Magnesium	"	**2800**	*1.4*	110	"	"	"	"	"	B
Potassium	"	**1700**	*33*	340	"	"	"	"	"	
Silver	"	ND	*0.093*	2.1	"	"	"	"	"	
Sodium	"	ND UJ	*14*	210	"	"	"	"	"	*
SSH0168-11 (GTP6-10-082809)		**Soil**					**Sampled: 08/28/09 10:36**			
Calcium	6010B TMP Dry	**2800**	*2.4*	88	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:36	
Iron	"	**9500**	*0.73*	16	"	"	"	"	"	B
Magnesium	"	**2700**	*1.1*	88	"	"	"	"	"	B
Potassium	"	**1500**	*26*	260	"	"	"	"	"	
Silver	"	ND	*0.072*	1.6	"	"	"	"	"	
Sodium	"	ND UJ	*11*	160	"	"	"	"	"	*
SSH0168-12 (GTP6-2.5-082809)		**Soil**					**Sampled: 08/28/09 10:10**			
Calcium	6010B TMP Dry	**5400**	*1.6*	60	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:53	
Iron	"	**18000**	*0.50*	11	"	"	"	"	"	B
Magnesium	"	**3500**	*0.72*	60	"	"	"	"	"	B
Potassium	"	**1400**	*17*	180	"	"	"	"	"	
Silver	"	ND	*0.049*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.4*	110	"	"	"	"	"	*
SSH0168-13 (GTP6-17-082809)		**Soil**					**Sampled: 08/28/09 11:11**			
Calcium	6010B TMP Dry	**2100**	*2.1*	76	mg/Kg dry	1x	50177	09/14/09 11:16	09/14/09 22:57	
Iron	"	**12000** J	*0.64*	14	"	"	"	"	"	B
Magnesium	"	**3500** J	*0.91*	76	"	"	"	"	"	B
Potassium	"	**1200**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.062*	1.4	"	"	"	"	"	
Sodium	"	ND UJ	*9.4*	140	"	"	"	"	"	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**					**Sampled: 08/28/09 12:50**			
Calcium	6010B TMP Dry	**25000**	*1.5*	56	mg/Kg dry	1x	50182	09/14/09 11:44	09/14/09 23:29	
Iron	"	**16000**	*0.47*	10	"	"	"	"	"	
Magnesium	"	**6300**	*0.67*	56	"	"	"	"	"	
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.046*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*6.9*	100	"	"	"	"	"	*
SSH0168-15 (GTP7-10.0-082809)		**Soil**					**Sampled: 08/28/09 13:27**			
Calcium	6010B TMP Dry	**2000**	*1.5*	55	mg/Kg dry	1x	50182	09/14/09 11:44	09/14/09 23:57	
Iron	"	**11000**	*0.46*	10	"	"	"	"	"	
Magnesium	"	**3100**	*0.67*	55	"	"	"	"	"	
Potassium	"	**1200**	*16*	170	"	"	"	"	"	
Silver	"	ND	*0.045*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*6.9*	100	"	"	"	"	"	*
SSH0168-16 (GTP7-18-082809)		**Soil**					**Sampled: 08/28/09 13:58**			
Calcium	6010B TMP Dry	**1300**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:00	
Iron	"	**12000**	*0.48*	11	"	"	"	"	"	
Magnesium	"	**3500**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1400**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.2*	110	"	"	"	"	"	*
SSH0168-17 (GTP2-2.5-082709)		**Soil**					**Sampled: 08/27/09 11:40**			
Calcium	6010B TMP Dry	**6400**	*1.8*	65	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:04	
Iron	"	**16000**	*0.54*	12	"	"	"	"	"	
Magnesium	"	**4300**	*0.78*	65	"	"	"	"	"	
Potassium	"	**1900**	*19*	190	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	**43** J	*8.0*	120	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Calcium	6010B TMP Dry	**2100**	*1.7*	62	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:08	
Iron	"	**16000**	*0.52*	11	"	"	"	"	"	
Magnesium	"	**8800**	*0.74*	62	"	"	"	"	"	
Potassium	"	**3200**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.6*	110	"	"	"	"	"	*
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Calcium	6010B TMP Dry	**1500**	*1.9*	68	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:12	
Iron	"	**13000**	*0.57*	12	"	"	"	"	"	
Magnesium	"	**4600**	*0.82*	68	"	"	"	"	"	
Potassium	"	**1600**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.056*	1.2	"	"	"	"	"	
Sodium	"	ND UJ	*8.4*	120	"	"	"	"	"	*
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Calcium	6010B TMP Dry	**8800**	*1.7*	62	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:16	
Iron	"	**13000**	*0.52*	11	"	"	"	"	"	
Magnesium	"	**2700**	*0.74*	62	"	"	"	"	"	
Potassium	"	**780**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	**170** J	*7.6*	110	"	"	"	"	"	*
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Calcium	6010B TMP Dry	**3200**	*1.6*	60	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:19	
Iron	"	**9000**	*0.51*	11	"	"	"	"	"	
Magnesium	"	**2900**	*0.73*	60	"	"	"	"	"	
Potassium	"	**660**	*18*	180	"	"	"	"	"	
Silver	"	ND	*0.049*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.5*	110	"	"	"	"	"	*

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Calcium	6010B TMP Dry	**1500**	*1.7*	63	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:23	
Iron	"	**13000**	*0.53*	12	"	"	"	"	"	
Magnesium	"	**5000**	*0.76*	63	"	"	"	"	"	
Potassium	"	**1700**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.052*	1.2	"	"	"	"	"	
Sodium	"	ND UJ	*7.8*	120	"	"	"	"	"	*
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Calcium	6010B TMP Dry	**1300**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:27	
Iron	"	**12000**	*0.48*	10	"	"	"	"	"	
Magnesium	"	**4500**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*7.1*	100	"	"	"	"	"	*
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Calcium	6010B TMP Dry	**1100**	*1.6*	57	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:44	
Iron	"	**12000**	*0.48*	10	"	"	"	"	"	
Magnesium	"	**3900**	*0.68*	57	"	"	"	"	"	
Potassium	"	**1200**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.0	"	"	"	"	"	
Sodium	"	ND UJ	*7.0*	100	"	"	"	"	"	*
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Calcium	6010B TMP Dry	**3600**	*1.6*	58	mg/Kg dry	1x	50182	09/14/09 11:44	09/15/09 00:47	
Iron	"	**19000**	*0.48*	11	"	"	"	"	"	
Magnesium	"	**3300**	*0.69*	58	"	"	"	"	"	
Potassium	"	**1500**	*17*	170	"	"	"	"	"	
Silver	"	ND	*0.047*	1.1	"	"	"	"	"	
Sodium	"	ND UJ	*7.2*	110	"	"	"	"	"	*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Mercury (CVAA)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Mercury	7471A Dry	**0.015** J	*0.0081*	0.026	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 15:40	J
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Mercury	7471A Dry	**0.013** J	*0.0065*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:02	J
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Mercury	7471A Dry	**0.018** J	*0.0061*	0.019	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:06	J
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Mercury	7471A Dry	**0.11**	*0.0078*	0.025	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:10	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Mercury	7471A Dry	ND	*0.0081*	0.026	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:15	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Mercury	7471A Dry	**0.016** J	*0.0063*	0.020	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:20	J
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Mercury	7471A Dry	**0.012** J	*0.0061*	0.019	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:32	J
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Mercury	7471A Dry	**0.025**	*0.0065*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:36	
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Mercury	7471A Dry	ND	*0.013*	0.040	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:41	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Mercury	7471A Dry	**0.023** J	*0.0096*	0.030	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:45	J
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Mercury	7471A Dry	**0.018** J	*0.0066*	0.021	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:49	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Mercury (CVAA)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**					**Sampled: 08/28/09 11:11**			
Mercury	7471A Dry	**0.017** J	*0.0088*	0.028	mg/Kg dry	1x	49654	09/03/09 13:44	09/03/09 16:53	J
SSH0168-14 (GTP7-2.5-082809)		**Soil**					**Sampled: 08/28/09 12:50**			
Mercury	7471A Dry	**0.013** J	*0.0063*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:32	J
SSH0168-15 (GTP7-10.0-082809)		**Soil**					**Sampled: 08/28/09 13:27**			
Mercury	7471A Dry	**0.017** J	*0.0062*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:53	J
SSH0168-16 (GTP7-18-082809)		**Soil**					**Sampled: 08/28/09 13:58**			
Mercury	7471A Dry	**0.015** J	*0.0061*	0.019	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 17:57	J
SSH0168-17 (GTP2-2.5-082709)		**Soil**					**Sampled: 08/27/09 11:40**			
Mercury	7471A Dry	**0.027**	*0.0077*	0.024	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:01	
SSH0168-18 (GTP2-8-082709)		**Soil**					**Sampled: 08/27/09 11:58**			
Mercury	7471A Dry	**0.024**	*0.0071*	0.023	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:06	
SSH0168-19 (GTP2-13-082709)		**Soil**					**Sampled: 08/27/09 17:28**			
Mercury	7471A Dry	ND	*0.0077*	0.024	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:10	
SSH0168-20 (GTP1-2.5-082709)		**Soil**					**Sampled: 08/27/09 09:20**			
Mercury	7471A Dry	**0.0083** J	*0.0069*	0.022	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:25	J
SSH0168-21 (GTP5-11-082809)		**Soil**					**Sampled: 08/28/09 09:37**			
Mercury	7471A Dry	**0.014** J	*0.0068*	0.022	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:29	J
SSH0168-22 (TS-COMP-1)		**Soil**					**Sampled: 08/27/09 18:10**			
Mercury	7471A Dry	ND	*0.0071*	0.023	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:33	
SSH0168-23 (TS-COMP-2)		**Soil**					**Sampled: 08/27/09 18:28**			
Mercury	7471A Dry	ND	*0.0063*	0.020	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:38	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**				**Sampled: 08/27/09 16:40**				
Mercury	7471A Dry	**0.016** J	*0.0067*	0.021	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:42	J
SSH0168-25 (GTP4-6.0-082709)		**Soil**				**Sampled: 08/27/09 15:49**				
Mercury	7471A Dry	**0.022**	*0.0067*	0.021	mg/Kg dry	1x	49657	09/03/09 14:24	09/03/09 18:46	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Aluminum	6020 TMP Dry	11000	0.33	33	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:32	
Arsenic	"	17	0.00085	0.22	"	"	"	"	"	
Antimony	"	0.89	0.0072	0.22	"	"	"	"	"	B
Barium	"	78	0.0016	0.22	"	"	"	"	"	B
Beryllium	"	0.52	0.00075	0.22	"	"	"	"	"	B
Manganese	"	500	0.017	0.54	"	"	"	"	"	
Cadmium	"	0.34	0.00051	0.22	"	"	"	"	"	B
Nickel	"	18	0.0040	0.22	"	"	"	"	"	
Chromium	"	9.4	0.0043	0.22	"	"	"	"	"	
Selenium	"	0.11 J	0.0020	0.54	"	"	"	"	"	J
Cobalt	"	11	0.00059	0.22	"	"	"	"	"	B
Thallium	"	0.14	0.0043	0.43 U	"	"	"	"	"	J,B
Copper	"	26	0.0035	0.22	"	"	"	"	"	B
Vanadium	"	18	0.0029	0.22	"	"	"	"	"	B
Lead	"	11	0.0011	0.22	"	"	"	"	"	B
Zinc	"	28	0.016	0.76	"	"	"	"	"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Aluminum	6020 TMP Dry	7100 J	0.41	41	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:53	
Arsenic	"	8.3	0.0011	0.28	"	"	"	"	"	
Antimony	"	1.8	0.0091	0.28	"	"	"	"	"	B
Barium	"	54	0.0021	0.28	"	"	"	"	"	B
Beryllium	"	0.30	0.00095	0.28	"	"	"	"	"	B
Manganese	"	200	0.022	0.69	"	"	"	"	"	
Cadmium	"	0.29	0.00065	0.28	"	"	"	"	"	B
Nickel	"	12 J	0.0051	0.28	"	"	"	"	"	
Chromium	"	8.8	0.0055	0.28	"	"	"	"	"	
Selenium	"	0.10 J	0.0026	0.69	"	"	"	"	"	J
Cobalt	"	6.2	0.00075	0.28	"	"	"	"	"	B
Thallium	"	0.15	0.0055	0.55 U	"	"	"	"	"	J,B
Copper	"	50 J	0.0044	0.28	"	"	"	"	"	B
Vanadium	"	16	0.0037	0.28	"	"	"	"	"	B
Lead	"	34	0.0014	0.28	"	"	"	"	"	B
Zinc	"	46 J	0.021	0.97	"	"	"	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Aluminum	6020 TMP Dry	6800	*0.30*	30	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 17:36	B
Arsenic	"	17	*0.00079*	0.20	"	"	"	"	"	
Antimony	"	0.97	*0.0067*	0.20	"	"	"	"	"	B
Barium	"	47	*0.0015*	0.20	"	"	"	"	"	B
Beryllium	"	0.36	*0.00070*	0.20	"	"	"	"	"	
Manganese	"	520	*0.016*	0.51	"	"	"	"	"	
Cadmium	"	0.13 J	*0.00048*	0.20	"	"	"	"	"	J
Nickel	"	17	*0.0038*	0.20	"	"	"	"	"	
Chromium	"	6.2	*0.0041*	0.20	"	"	"	"	"	
Selenium	"	0.068 J	*0.0019*	0.51	"	"	"	"	"	J
Cobalt	"	11	*0.00055*	0.20	"	"	"	"	"	B
Thallium	"	~~0.14~~	*0.0041*	0.41 U	"	"	"	"	"	J,B
Copper	"	23	*0.0032*	0.20	"	"	"	"	"	
Vanadium	"	10	*0.0027*	0.20	"	"	"	"	"	B
Lead	"	9.3	*0.0010*	0.20	"	"	"	"	"	B
Zinc	"	26	*0.015*	0.71	"	"	"	"	"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Aluminum	6020 TMP Dry	5500	*0.30*	30	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:41	B
Arsenic	"	6.8	*0.00079*	0.20	"	"	"	"	"	
Antimony	"	0.36	*0.0067*	0.20	"	"	"	"	"	B
Barium	"	34	*0.0015*	0.20	"	"	"	"	"	B
Beryllium	"	0.21	*0.00070*	0.20	"	"	"	"	"	
Manganese	"	270	*0.016*	0.50	"	"	"	"	"	
Cadmium	"	0.17 J	*0.00047*	0.20	"	"	"	"	"	J
Nickel	"	9.3	*0.0037*	0.20	"	"	"	"	"	
Chromium	"	7.3	*0.0040*	0.20	"	"	"	"	"	
Selenium	"	0.055 J	*0.0019*	0.50	"	"	"	"	"	J
Cobalt	"	6.1	*0.00054*	0.20	"	"	"	"	"	B
Thallium	"	~~0.17~~	*0.0040*	0.40 U	"	"	"	"	"	J,B
Copper	"	20	*0.0032*	0.20	"	"	"	"	"	
Vanadium	"	12	*0.0027*	0.20	"	"	"	"	"	B
Lead	"	7.4	*0.0010*	0.20	"	"	"	"	"	B
Zinc	"	28	*0.015*	0.71	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Aluminum	6020 TMP Dry	6200	0.32	32	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:48	B
Arsenic	"	7.8	0.00082	0.21	"	"	"	"	"	
Antimony	"	0.49	0.0069	0.21	"	"	"	"	"	B
Barium	"	42	0.0016	0.21	"	"	"	"	"	B
Beryllium	"	0.27	0.00073	0.21	"	"	"	"	"	
Manganese	"	200	0.017	0.53	"	"	"	"	"	
Cadmium	"	0.11 J	0.00049	0.21	"	"	"	"	"	J
Nickel	"	9.9	0.0039	0.21	"	"	"	"	"	
Chromium	"	7.6	0.0042	0.21	"	"	"	"	"	
Selenium	"	0.073 J	0.0020	0.53	"	"	"	"	"	J
Cobalt	"	7.0	0.00057	0.21	"	"	"	"	"	B
Thallium	"	0.18	0.0042	0.42 U	"	"	"	"	"	J,B
Copper	"	21	0.0034	0.21	"	"	"	"	"	
Vanadium	"	16	0.0028	0.21	"	"	"	"	"	B
Lead	"	7.3	0.0011	0.21	"	"	"	"	"	B
Zinc	"	29	0.016	0.74	"	"	"	"	"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Aluminum	6020 TMP Dry	14000	0.35	35	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 18:55	B
Arsenic	"	18	0.00092	0.24	"	"	"	"	"	
Antimony	"	2.1	0.0078	0.24	"	"	"	"	"	B
Barium	"	240	0.0018	0.24	"	"	"	"	"	B
Beryllium	"	1.0	0.00081	0.24	"	"	"	"	"	
Manganese	"	370	0.019	0.59	"	"	"	"	"	
Cadmium	"	0.94	0.00056	0.24	"	"	"	"	"	
Nickel	"	17	0.0044	0.24	"	"	"	"	"	
Chromium	"	13	0.0047	0.24	"	"	"	"	"	
Selenium	"	0.36 J	0.0022	0.59	"	"	"	"	"	J
Cobalt	"	7.5	0.00064	0.24	"	"	"	"	"	B
Thallium	"	0.38	0.0047	0.47 U	"	"	"	"	"	J,B
Copper	"	50	0.0038	0.24	"	"	"	"	"	
Vanadium	"	24	0.0032	0.24	"	"	"	"	"	B
Lead	"	140	0.0012	0.24	"	"	"	"	"	B
Zinc	"	180	0.018	0.83	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Aluminum	6020 TMP Dry	15000	0.34	34	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:02	B
Arsenic	"	32	0.00088	0.22	"	"	"	"	"	
Antimony	"	1.1	0.0074	0.22	"	"	"	"	"	B
Barium	"	100	0.0017	0.22	"	"	"	"	"	B
Beryllium	"	0.61	0.00078	0.22	"	"	"	"	"	
Manganese	"	490	0.018	0.56	"	"	"	"	"	
Cadmium	"	0.30	0.00053	0.22	"	"	"	"	"	
Nickel	"	15	0.0042	0.22	"	"	"	"	"	
Chromium	"	16	0.0045	0.22	"	"	"	"	"	
Selenium	"	0.094 J	0.0021	0.56	"	"	"	"	"	J
Cobalt	"	8.2	0.00061	0.22	"	"	"	"	"	B
Thallium	"	~~0.24~~	0.0045	0.45 U	"	"	"	"	"	J,B
Copper	"	19	0.0036	0.22	"	"	"	"	"	
Vanadium	"	24	0.0030	0.22	"	"	"	"	"	B
Lead	"	22	0.0011	0.22	"	"	"	"	"	B
Zinc	"	30	0.017	0.79	"	"	"	"	"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Aluminum	6020 TMP Dry	9400	0.37	37	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:09	B
Arsenic	"	21	0.00097	0.25	"	"	"	"	"	
Antimony	"	0.44	0.0082	0.25	"	"	"	"	"	B
Barium	"	61	0.0019	0.25	"	"	"	"	"	B
Beryllium	"	0.37	0.00085	0.25	"	"	"	"	"	
Manganese	"	370	0.020	0.62	"	"	"	"	"	
Cadmium	"	0.18 J	0.00058	0.25	"	"	"	"	"	J
Nickel	"	11	0.0046	0.25	"	"	"	"	"	
Chromium	"	11	0.0050	0.25	"	"	"	"	"	
Selenium	"	0.14 J	0.0023	0.62	"	"	"	"	"	J
Cobalt	"	6.5	0.00067	0.25	"	"	"	"	"	B
Thallium	"	~~0.15~~	0.0050	0.50 U	"	"	"	"	"	J,B
Copper	"	19	0.0040	0.25	"	"	"	"	"	
Vanadium	"	19	0.0033	0.25	"	"	"	"	"	B
Lead	"	7.2	0.0012	0.25	"	"	"	"	"	B
Zinc	"	31	0.019	0.87	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Aluminum	6020 TMP Dry	**8200**	*0.34*	34	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:16	B
Arsenic	"	**8.0**	*0.00088*	0.22	"	"	"	"	"	
Antimony	"	**13**	*0.0074*	0.22	"	"	"	"	"	B
Barium	"	**1100**	*0.0017*	0.22	"	"	"	"	"	B
Beryllium	"	**1.1**	*0.00078*	0.22	"	"	"	"	"	
Manganese	"	**240**	*0.018*	0.56	"	"	"	"	"	
Cadmium	"	**0.42**	*0.00053*	0.22	"	"	"	"	"	
Nickel	"	**25**	*0.0042*	0.22	"	"	"	"	"	
Chromium	"	**8.6**	*0.0045*	0.22	"	"	"	"	"	
Selenium	"	**0.40** J	*0.0021*	0.56	"	"	"	"	"	J
Cobalt	"	**7.6**	*0.00061*	0.22	"	"	"	"	"	B
Thallium	"	~~0.12~~	*0.0045*	0.45 U	"	"	"	"	"	J,B
Copper	"	**160**	*0.0036*	0.22	"	"	"	"	"	
Vanadium	"	**37**	*0.0030*	0.22	"	"	"	"	"	B
Lead	"	**410**	*0.0011*	0.22	"	"	"	"	"	B
Zinc	"	**70**	*0.017*	0.79	"	"	"	"	"	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Aluminum	6020 TMP Dry	**5100**	*0.33*	33	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:45	B
Arsenic	"	**3.7**	*0.00086*	0.22	"	"	"	"	"	
Antimony	"	**1.9**	*0.0073*	0.22	"	"	"	"	"	B
Barium	"	**27**	*0.0016*	0.22	"	"	"	"	"	B
Beryllium	"	**0.25**	*0.00076*	0.22	"	"	"	"	"	
Manganese	"	**49**	*0.018*	0.55	"	"	"	"	"	
Cadmium	"	**0.19** J	*0.00052*	0.22	"	"	"	"	"	J
Nickel	"	**16**	*0.0041*	0.22	"	"	"	"	"	
Chromium	"	**6.2**	*0.0044*	0.22	"	"	"	"	"	
Selenium	"	**0.11** J	*0.0021*	0.55	"	"	"	"	"	J
Cobalt	"	**4.4**	*0.00059*	0.22	"	"	"	"	"	B
Thallium	"	~~0.13~~	*0.0044*	0.44 U	"	"	"	"	"	J,B
Copper	"	**70**	*0.0035*	0.22	"	"	"	"	"	
Vanadium	"	**18**	*0.0030*	0.22	"	"	"	"	"	B
Lead	"	**41**	*0.0011*	0.22	"	"	"	"	"	B
Zinc	"	**65**	*0.016*	0.77	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Aluminum	6020 TMP Dry	**9000**	*0.35*	35	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:52	B
Arsenic	"	**9.0**	*0.00090*	0.23	"	"	"	"	"	
Antimony	"	**0.80**	*0.0076*	0.23	"	"	"	"	"	B
Barium	"	**90**	*0.0017*	0.23	"	"	"	"	"	B
Beryllium	"	**0.35**	*0.00080*	0.23	"	"	"	"	"	
Manganese	"	**170**	*0.018*	0.58	"	"	"	"	"	
Cadmium	"	**0.16** J	*0.00054*	0.23	"	"	"	"	"	J
Nickel	"	**13**	*0.0043*	0.23	"	"	"	"	"	
Chromium	"	**9.9**	*0.0046*	0.23	"	"	"	"	"	
Selenium	"	**0.16** J	*0.0022*	0.58	"	"	"	"	"	J
Cobalt	"	**8.0**	*0.00062*	0.23	"	"	"	"	"	B
Thallium	"	~~0.20~~	*0.0046*	0.46 U	"	"	"	"	"	J,B
Copper	"	**25**	*0.0037*	0.23	"	"	"	"	"	
Vanadium	"	**23**	*0.0031*	0.23	"	"	"	"	"	B
Lead	"	**12**	*0.0012*	0.23	"	"	"	"	"	B
Zinc	"	**36**	*0.017*	0.81	"	"	"	"	"	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Aluminum	6020 TMP Dry	**9200**	*0.31*	31	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 19:59	B
Arsenic	"	**7.8**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**1.4**	*0.0069*	0.21	"	"	"	"	"	B
Barium	"	**90**	*0.0016*	0.21	"	"	"	"	"	B
Beryllium	"	**0.38**	*0.00072*	0.21	"	"	"	"	"	
Manganese	"	**160**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.14** J	*0.00049*	0.21	"	"	"	"	"	J
Nickel	"	**13**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**9.8**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.14** J	*0.0020*	0.52	"	"	"	"	"	J
Cobalt	"	**7.8**	*0.00057*	0.21	"	"	"	"	"	B
Thallium	"	~~0.18~~	*0.0042*	0.42 U	"	"	"	"	"	J,B
Copper	"	**45**	*0.0034*	0.21	"	"	"	"	"	
Vanadium	"	**21**	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	**19**	*0.0010*	0.21	"	"	"	"	"	B
Zinc	"	**30**	*0.016*	0.73	"	"	"	"	"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Aluminum	6020 TMP Dry	**6500**	*0.31*	31	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 20:06	B
Arsenic	"	**15**	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	**1.2**	*0.0068*	0.21	"	"	"	"	"	B
Barium	"	**40**	*0.0016*	0.21	"	"	"	"	"	B
Beryllium	"	**0.29**	*0.00071*	0.21	"	"	"	"	"	
Manganese	"	**170**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.13** J	*0.00049*	0.21	"	"	"	"	"	J
Nickel	"	**12**	*0.0038*	0.21	"	"	"	"	"	
Chromium	"	**7.4**	*0.0041*	0.21	"	"	"	"	"	
Selenium	"	**0.13** J	*0.0019*	0.52	"	"	"	"	"	J
Cobalt	"	**7.9**	*0.00056*	0.21	"	"	"	"	"	B
Thallium	"	~~0.11~~	*0.0041*	0.41 U	"	"	"	"	"	J,B
Copper	"	**23**	*0.0033*	0.21	"	"	"	"	"	
Vanadium	"	**17**	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	**15**	*0.0010*	0.21	"	"	"	"	"	B
Zinc	"	**23**	*0.016*	0.72	"	"	"	"	"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Aluminum	6020 TMP Dry	**14000**	*0.32*	32	mg/Kg dry	10x	50182	09/14/09 11:44	09/14/09 20:14	B
Arsenic	"	**28**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**1.6**	*0.0069*	0.21	"	"	"	"	"	B
Barium	"	**130**	*0.0016*	0.21	"	"	"	"	"	B
Beryllium	"	**0.81**	*0.00073*	0.21	"	"	"	"	"	
Manganese	"	**500**	*0.017*	0.53	"	"	"	"	"	
Cadmium	"	**0.61**	*0.00049*	0.21	"	"	"	"	"	
Nickel	"	**25**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**14**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.19** J	*0.0020*	0.53	"	"	"	"	"	J
Cobalt	"	**11**	*0.00057*	0.21	"	"	"	"	"	B
Thallium	"	~~0.17~~	*0.0042*	0.42 U	"	"	"	"	"	J,B
Copper	"	**63**	*0.0034*	0.21	"	"	"	"	"	
Vanadium	"	**29**	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	**55**	*0.0011*	0.21	"	"	"	"	"	B
Zinc	"	**90**	*0.016*	0.74	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		Soil						Sampled: 08/27/09 09:40		
Aluminum	6020 TMP Dry	10000 J	*0.39*	39	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 14:41	
Arsenic	"	5.7	*0.0010*	0.26	"	"	"	"	"	
Antimony	"	0.45	*0.0087*	0.26	"	"	"	"	"	B
Barium	"	76	*0.0020*	0.26	"	"	"	"	"	B
Beryllium	"	0.37	*0.00091*	0.26	"	"	"	"	"	B
Manganese	"	130	*0.021*	0.66	"	"	"	"	"	
Cadmium	"	0.15	*0.00062*	0.26 U	"	"	"	"	"	J, B
Nickel	"	13	*0.0049*	0.26	"	"	"	"	"	
Chromium	"	11	*0.0053*	0.26	"	"	"	"	"	
Selenium	"	0.19 J	*0.0025*	0.66	"	"	"	"	"	J
Cobalt	"	6.8 J	*0.00071*	0.26	"	"	"	"	"	B
Thallium	"	0.16	*0.0053*	0.53 U	"	"	"	"	"	J, B
Copper	"	18	*0.0042*	0.26	"	"	"	"	"	B
Vanadium	"	26	*0.0036*	0.26	"	"	"	"	"	B
Lead	"	8.4	*0.0013*	0.26	"	"	"	"	"	B
Zinc	"	34 J	*0.020*	0.92	"	"	"	"	"	
SSH0168-02 (GTP1-13.5-082709)		Soil						Sampled: 08/27/09 10:10		
Aluminum	6020 TMP Dry	6800	*0.31*	31	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:36	
Arsenic	"	11	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	1.3	*0.0068*	0.21	"	"	"	"	"	B
Barium	"	64	*0.0015*	0.21	"	"	"	"	"	B
Beryllium	"	0.29	*0.00071*	0.21	"	"	"	"	"	B
Manganese	"	140	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	0.15	*0.00049*	0.21 U	"	"	"	"	"	J, B
Nickel	"	12	*0.0038*	0.21	"	"	"	"	"	
Chromium	"	7.6	*0.0041*	0.21	"	"	"	"	"	
Selenium	"	0.20 J	*0.0019*	0.52	"	"	"	"	"	J
Cobalt	"	8.9	*0.00056*	0.21	"	"	"	"	"	B
Thallium	"	0.21	*0.0041*	0.41 U	"	"	"	"	"	J, B
Copper	"	31	*0.0033*	0.21	"	"	"	"	"	B
Vanadium	"	18	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	16	*0.0010*	0.21	"	"	"	"	"	B
Zinc	"	25	*0.015*	0.72	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Aluminum	6020 TMP Dry	**13000**	*0.32*	32	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:42	
Arsenic	"	**8.5**	*0.00082*	0.21	"	"	"	"	"	
Antimony	"	**0.85**	*0.0070*	0.21	"	"	"	"	"	B
Barium	"	**88**	*0.0016*	0.21	"	"	"	"	"	B
Beryllium	"	**0.82**	*0.00073*	0.21	"	"	"	"	"	B
Manganese	"	**520**	*0.017*	0.53	"	"	"	"	"	
Cadmium	"	**0.27**	*0.00050*	0.21	"	"	"	"	"	B
Nickel	"	**13**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**12**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.10** J	*0.0020*	0.53	"	"	"	"	"	J
Cobalt	"	**8.7**	*0.00057*	0.21	"	"	"	"	"	B
Thallium	"	~~0.23~~	*0.0042*	0.42 U	"	"	"	"	"	J, B
Copper	"	**23**	*0.0034*	0.21	"	"	"	"	"	B
Vanadium	"	**19**	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	**20**	*0.0011*	0.21	"	"	"	"	"	B
Zinc	"	**72**	*0.016*	0.74	"	"	"	"	"	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Aluminum	6020 TMP Dry	**9200**	*0.39*	39	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:48	
Arsenic	"	**8.9**	*0.0010*	0.26	"	"	"	"	"	
Antimony	"	**1.1**	*0.0085*	0.26	"	"	"	"	"	B
Barium	"	**180**	*0.0019*	0.26	"	"	"	"	"	B
Beryllium	"	**0.51**	*0.00089*	0.26	"	"	"	"	"	B
Manganese	"	**400**	*0.021*	0.64	"	"	"	"	"	
Cadmium	"	**0.28**	*0.00060*	0.26	"	"	"	"	"	B
Nickel	"	**13**	*0.0048*	0.26	"	"	"	"	"	
Chromium	"	**10**	*0.0051*	0.26	"	"	"	"	"	
Selenium	"	**0.16** J	*0.0024*	0.64	"	"	"	"	"	J
Cobalt	"	**5.9**	*0.00070*	0.26	"	"	"	"	"	B
Thallium	"	~~0.28~~	*0.0051*	0.51 U	"	"	"	"	"	J, B
Copper	"	**31**	*0.0041*	0.26	"	"	"	"	"	B
Vanadium	"	**19**	*0.0035*	0.26	"	"	"	"	"	B
Lead	"	**44**	*0.0013*	0.26	"	"	"	"	"	B
Zinc	"	**73**	*0.019*	0.90	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Aluminum	6020 TMP Dry	**16000**	*0.37*	37	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 15:54	
Arsenic	"	**45**	*0.00097*	0.25	"	"	"	"	"	
Antimony	"	**0.87**	*0.0082*	0.25	"	"	"	"	"	B
Barium	"	**110**	*0.0019*	0.25	"	"	"	"	"	B
Beryllium	"	**0.75**	*0.00085*	0.25	"	"	"	"	"	B
Manganese	"	**560**	*0.020*	0.62	"	"	"	"	"	
Cadmium	"	**0.32**	*0.00058*	0.25	"	"	"	"	"	B
Nickel	"	**19**	*0.0046*	0.25	"	"	"	"	"	
Chromium	"	**18**	*0.0049*	0.25	"	"	"	"	"	
Selenium	"	**0.15** J	*0.0023*	0.62	"	"	"	"	"	J
Cobalt	"	**12**	*0.00067*	0.25	"	"	"	"	"	B
Thallium	"	~~0.25~~	*0.0049*	0.49 U	"	"	"	"	"	J,B
Copper	"	**29**	*0.0040*	0.25	"	"	"	"	"	B
Vanadium	"	**34**	*0.0033*	0.25	"	"	"	"	"	B
Lead	"	**11**	*0.0012*	0.25	"	"	"	"	"	B
Zinc	"	**40**	*0.019*	0.87	"	"	"	"	"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Aluminum	6020 TMP Dry	**9100**	*0.30*	30	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:00	
Arsenic	"	**20**	*0.00078*	0.20	"	"	"	"	"	
Antimony	"	**1.3**	*0.0066*	0.20	"	"	"	"	"	B
Barium	"	**87**	*0.0015*	0.20	"	"	"	"	"	B
Beryllium	"	**0.45**	*0.00069*	0.20	"	"	"	"	"	B
Manganese	"	**320**	*0.016*	0.50	"	"	"	"	"	
Cadmium	"	**0.34**	*0.00047*	0.20	"	"	"	"	"	B
Nickel	"	**14**	*0.0037*	0.20	"	"	"	"	"	
Chromium	"	**11**	*0.0040*	0.20	"	"	"	"	"	
Selenium	"	**0.16** J	*0.0019*	0.50	"	"	"	"	"	J
Cobalt	"	**9.2**	*0.00054*	0.20	"	"	"	"	"	B
Thallium	"	~~0.15~~	*0.0040*	0.40 U	"	"	"	"	"	J,B
Copper	"	**49**	*0.0032*	0.20	"	"	"	"	"	B
Vanadium	"	**18**	*0.0027*	0.20	"	"	"	"	"	B
Lead	"	**53**	*0.0010*	0.20	"	"	"	"	"	B
Zinc	"	**66**	*0.015*	0.70	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Aluminum	6020 TMP Dry	**6000**	*0.32*	32	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:07	
Arsenic	"	**9.4**	*0.00084*	0.22	"	"	"	"	"	
Antimony	"	**0.62**	*0.0071*	0.22	"	"	"	"	"	B
Barium	"	**39**	*0.0016*	0.22	"	"	"	"	"	B
Beryllium	"	**0.20**	*0.00074*	0.22	U	"	"	"	"	J,B
Manganese	"	**260**	*0.017*	0.54	"	"	"	"	"	
Cadmium	"	**0.15**	*0.00051*	0.22	U	"	"	"	"	J,B
Nickel	"	**11**	*0.0040*	0.22	"	"	"	"	"	
Chromium	"	**7.2**	*0.0043*	0.22	"	"	"	"	"	
Selenium	"	**0.063**	*0.0020*	0.54	J	"	"	"	"	J
Cobalt	"	**5.1**	*0.00058*	0.22	"	"	"	"	"	B
Thallium	"	**0.12**	*0.0043*	0.43	U	"	"	"	"	J,B
Copper	"	**27**	*0.0034*	0.22	"	"	"	"	"	B
Vanadium	"	**13**	*0.0029*	0.22	"	"	"	"	"	B
Lead	"	**21**	*0.0011*	0.22	"	"	"	"	"	B
Zinc	"	**57**	*0.016*	0.75	"	"	"	"	"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Aluminum	6020 TMP Dry	**10000**	*0.31*	31	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:13	
Arsenic	"	**15**	*0.00081*	0.21	"	"	"	"	"	
Antimony	"	**1.5**	*0.0069*	0.21	"	"	"	"	"	B
Barium	"	**63**	*0.0016*	0.21	"	"	"	"	"	B
Beryllium	"	**0.55**	*0.00072*	0.21	"	"	"	"	"	B
Manganese	"	**540**	*0.017*	0.52	"	"	"	"	"	
Cadmium	"	**0.31**	*0.00049*	0.21	"	"	"	"	"	B
Nickel	"	**17**	*0.0039*	0.21	"	"	"	"	"	
Chromium	"	**8.3**	*0.0042*	0.21	"	"	"	"	"	
Selenium	"	**0.13**	*0.0020*	0.52	J	"	"	"	"	J
Cobalt	"	**12**	*0.00056*	0.21	"	"	"	"	"	B
Thallium	"	**0.17**	*0.0042*	0.42	U	"	"	"	"	J,B
Copper	"	**22**	*0.0033*	0.21	"	"	"	"	"	B
Vanadium	"	**16**	*0.0028*	0.21	"	"	"	"	"	B
Lead	"	**9.3**	*0.0010*	0.21	"	"	"	"	"	B
Zinc	"	**27**	*0.016*	0.73	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Aluminum	6020 TMP Dry	**6300**	*0.62*	62	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:19	
Arsenic	"	**3.6**	*0.0016*	0.42	"	"	"	"	"	
Antimony	"	~~0.39~~	*0.014*	0.42 U	"	"	"	"	"	J, B
Barium	"	**150**	*0.0031*	0.42	"	"	"	"	"	B
Beryllium	"	~~0.21~~	*0.0014*	0.42 U	"	"	"	"	"	J, B
Manganese	"	**330**	*0.033*	1.0	"	"	"	"	"	
Cadmium	"	~~0.22~~	*0.00098*	0.42 U	"	"	"	"	"	J, B
Nickel	"	**6.7**	*0.0077*	0.42	"	"	"	"	"	
Chromium	"	**5.3**	*0.0083*	0.42	"	"	"	"	"	
Selenium	"	**0.063** J	*0.0039*	1.0	"	"	"	"	"	J
Cobalt	"	**4.0**	*0.0011*	0.42	"	"	"	"	"	B
Thallium	"	~~0.12~~	*0.0083*	0.83 U	"	"	"	"	"	J, B
Copper	"	**16**	*0.0066*	0.42	"	"	"	"	"	B
Vanadium	"	**11**	*0.0056*	0.42	"	"	"	"	"	B
Lead	"	**7.4**	*0.0021*	0.42	"	"	"	"	"	B
Zinc	"	**49**	*0.031*	1.5	"	"	"	"	"	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Aluminum	6020 TMP Dry	**6100**	*0.48*	48	mg/Kg dry	10x	50177	09/14/09 11:16	09/14/09 16:25	
Arsenic	"	**4.7**	*0.0012*	0.32	"	"	"	"	"	
Antimony	"	**0.64**	*0.011*	0.32	"	"	"	"	"	B
Barium	"	**89**	*0.0024*	0.32	"	"	"	"	"	B
Beryllium	"	~~0.20~~	*0.0011*	0.32 U	"	"	"	"	"	J, B
Manganese	"	**200**	*0.026*	0.80	"	"	"	"	"	
Cadmium	"	~~0.20~~	*0.00075*	0.32 U	"	"	"	"	"	J, B
Nickel	"	**7.7**	*0.0059*	0.32	"	"	"	"	"	
Chromium	"	**6.4**	*0.0064*	0.32	"	"	"	"	"	
Selenium	"	**0.023** J	*0.0030*	0.80	"	"	"	"	"	J
Cobalt	"	**4.3**	*0.00086*	0.32	"	"	"	"	"	B
Thallium	"	~~0.11~~	*0.0064*	0.64 U	"	"	"	"	"	J, B
Copper	"	**17**	*0.0051*	0.32	"	"	"	"	"	B
Vanadium	"	**11**	*0.0043*	0.32	"	"	"	"	"	B
Lead	"	**34**	*0.0016*	0.32	"	"	"	"	"	B
Zinc	"	**37**	*0.024*	1.1	"	"	"	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
% Solids	TA SOP	63.2	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
% Solids	TA SOP	87.5	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
% Solids	TA SOP	92.8	----	0.0100	% by Weight	1x	9090003	08/31/09 15:45	09/01/09 10:39	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
% Solids	TA SOP	72.3	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
% Solids	TA SOP	77.3	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
% Solids	TA SOP	94.8	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
% Solids	TA SOP	93.4	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
% Solids	TA SOP	89.4	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
% Solids	TA SOP	48.4	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
% Solids	TA SOP	63.7	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
% Solids	TA SOP	**87.9**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
% Solids	TA SOP	**64.8**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
% Solids	TA SOP	**94.9**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
% Solids	TA SOP	**95.5**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
% Solids	TA SOP	**88.6**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
% Solids	TA SOP	**84.9**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
% Solids	TA SOP	**86.7**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
% Solids	TA SOP	**78.9**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
% Solids	TA SOP	**87.2**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
% Solids	TA SOP	**91.8**	----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
% Solids	TA SOP	**85.8**	-----	0.0100	% by Weight	1x	9090016	09/01/09 11:15	09/02/09 10:30	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
% Solids	TA SOP	**86.7**	-----	0.0100	% by Weight	1x	9090103	09/15/09 14:15	09/16/09 07:30	
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
% Solids	TA SOP	**86.1**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
% Solids	TA SOP	**93.3**	-----	0.0100	% by Weight	1x	9090103	09/15/09 14:15	09/16/09 07:30	

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **SSH0168**
SAMPLES Collect:	MATRIX SOIL
24 Soils; See Summary Lab ID sheet attached.	
TEST PIT SOILS	

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA 8260	BNA 8270	Pest / PCB 8082	TPH-Dx	PAH-Sim	OTHER %Moistur.	OTHER
1. Data Completeness	O	O	O	O	O		
2. Preservation, Holding Times	O	O	O	O	O		
3.GC/MS Tune, Inst. Performance	O	O	–	–	O		
4. Calibrations	O	O	O	O	O		
5. Surrogates →	X[6]	O	X(2)	X(1)	O		
6. Internal Standards	O	O	–	–	Z X(3)		
7. Lab Blanks, Field Blanks →	X[7]	X[8]	O	O	O		
8. Lab Duplicates, Field Duplicates	O	O	O	O	O		
9. LCS, Blank Spike, MS/MSD →	O	X[9]	(4) X	O	(5) X		
10.Compound Identification, TICs	O	O	O	O	O		
11. Result Verification, D.Limits	O	O	O	O	O		
12. Overall Summary	O	O	O	O	O		

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Sample # -21 qualif. results (J) due to 2 Surrog. out of limit. (2) Both Surrog. ↓ for sample-09 all results qual. 'UJ' (PCB). (3) Samples for PAH -02 qualif. (J/R), #11,-24 qual. (J) for detects due to ↓ Internal Studs. (4) PCB smpl. # 5 qualif UJ for A-1016, and A-1260 only. (5) Fluorene on Smpl-24 qualif. J due to MS↓. (6) Smpl-01 'UJ' applied to Assoc. Cmpnds due to ↓ BFB. (7) MeCl2 contam. in prep. blank qualifies select samples w/ * as (J) and other samples w/ 'U' see section (7). (8) phthalate contaminants in prep. blanks affect Sample-10 as estimated (J), and other samples 'U'. (9) Dim Nitrosophenylamine & Carbazole ↓ recovery qualifies Assoc. results as J/UJ for samples tested on 9-14-09.

TMB 12-16-09

TMB 12-16-09

Validated by: Date: Nov. 20, 2009

Reviewed by: Date:

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

	YES	NO
1. Date Package Completeness (Check if present).....	☐	☐

__Case narrative
__Chain of Custody
__Sample Results
__Detection Limits
__GC/MS Tuning
__Initial Calibration
__Continuing Calib.
__

__Blank Results
__Surrogate Results
__Internal Standards
__ MS/MSD, LCS Results
__Preparation Logs
__Analysis Run Logs
__Raw Data
__Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: VOA Blank $MeCl_2$ 10X = 0.0958 mg/kg
RL = 0.100 "

2. Holding Times (Check all that apply)..... ☑ ☐

__Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
__BNA samples extracted within 7 days (14 day soil) of collection
__BNA extracts analyzed within 40 days of collection
__Pest/PCBs samples extracted within 7 days (14 day soil) of collection
__Pest/PCBs extracts analyzed within 40 days of collection
Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: See summary & Time sheet
* PCB analysis out of Hold according to D.V. guidelines, but citation from SW846 allows 1 year Hold period.
∴ NO QUALIF. Applied TPS 12-16-09.

* Cite SW-846 Methods Update IV, Chap. 4, Table 4-1, and Method Update for 8082A.

3. GC Instrument Tune, Performance Check ..... ☑ ☐

__GC/MS Tuning performed
__GC/MS Tuning within control limits
__GC/MS Tuning out of control limits, (qualify R/UR)
__Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
__PEM resolution <90% adj pks, (J for detects, UR other)
__DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
__Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results:

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☑ ☐

GC/MS Data: __ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
__ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: __RSD<10% for performance checks (If no J detects)
__Stnds analyzed prior to analysis, & at proper frequency
__Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

Associated Calibrations for this SDG apply to other SDG for samples tested in the same analytical batches – NO Qualif. applies.

5. Surrogates (Check all that apply)..... ☐ ☒

✓Surrogates analyzed
__Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__Recoveries above Method Control limits (J detects only)
__Recoveries below Method Control limits but>20% (J/UJ)
__Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results: ⊗ TPH-Dx 2-FBP↑ for Smpl -01,-11; p-Terphyn↑ for Samples -10,-13 and ⊗ Both for #-21. Results qualif. (J) for -21 only. PCB-Low for -02,-04,-11,-20,-23 & -24 single surrog. only-No Qual. ⊗ Smple #-09 both↓ - Assoc. results qualif. (UJ). PAHs - 2 FBP↓ for Smpls -01,-02,-11,-13,-17,-20 & 24 - No Qual. applied ⊗ VOA - BFB↓ for smpl.-01 assoc. NDs qualif. UJ. #17 TCE qualif. (J). SVOA Smpls diluted out surrog. for -01,-02,-11,-17,-20,-21,22,-23,-24 & -25. - NO QUAL.

6. Internal Standards Performance..... ☐ ☒

✓Internal standards added to all QC and samples
__Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
**Associated with 12 Hour CCV Stnd.*
__Internal standards out of Control limits but >10% (J/UJ)
__Internal standards zero or <10% of Control limits (J/UR)
__Internal standards RTs within +/-20 sec window (If no, J/UJ)

Comments/Qualified Results: ⊗ PAHs - Smpls -02 (J/R); #-11,-24 qualif (J) for detects only. VOA ✓; SVOA ✓

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☐ ☒

__Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

Examples:

BLANK			SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

TPH-Dx 9/11✓ Batch 0006; 9/11 Batch 0027✓; 9/13 Batch ✓; 9/16 Batch 0070✓

PCB Batch 0048 9/11✓; #0086 9/16✓. PAH Batch 204 8/31✓, #0010 9/02✓ Batch #0042 9/14✓; #0060 9/14✓

870=10× 95.8=10×

⊗ VOA - MB 722/1A✓, -810/1A✓ 928/1A detects Bromo meth, MeCl2 9/09 1524 942/1A✓ ⊗ Detects affect Smpls -02, -01, -03RE*, 04RE, -05RE*, 06RE, 07RE, 09RE, 11RE*, 12RE, 13RE*, 14RE, 15RE, 16RE, 17RE*, 18RE*, 19RE, 20RE, 21RE.

See Section 12

<SECTION 12. for SVOA BLANKS>

8. Duplicate, Field Duplicates (Check all that apply)..... ☒ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply)....☐ ☒

✓LCS %R 80-120%
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

MS on select samples qualified

Comments/Qualified Results: TPH-Dx Batch #0006✓, MS on Non Assoc #12✓, Batch #0027✓, MS non Assoc✓, Batch #0043 LCS✓, MS on #23 >4x spk. - No Qual. Batch #0070 LCS✓, MS on -024 >4x Spk-No Qual. PCB - Batch #0048 LCS✓, ⊗ MS on -05 recovery 10/6/2010 Qualifies #-05 as (J/UJ). Batch #0086 LCS✓, MS on -07✓. PAH Batch #0204✓, MS non-Assoc; Batch #010 LCS✓, MS-non Assoc; Batch #0042 LCS✓, MS on #06 recov.✓; Batch #0060 LCS✓, ⊗ MS on #-24 - Fluorene qualif. (J/UJ) on #24 only

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

	Acceptable:	Yes	NO
10.Compound Identification, TICs		☐	☐

Comments/Qualified Results: _____

11. Result Verification, Detection Limits ☐ X

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: PCB lab RL @ 0.01 mg/kg ✓. TPH-Dx ✓
⊗ PAH - Sample -20 does not meet Reg. Screen Level for Dibenzo (a,h) Anthracene - NO QUAL. Advisory. Same for -21 & -23 also.

12. Overall Assessment ☐ ☐

Comments/Qualified Results: <SVOA BLANK> 9/14 diethylphthal, di-n-butylph, di-n-octylphthal detected: 10x = 0.0203, 0.059, 0.0038 respect.
() 9/15 - di-n-butylph 0.0919 = 10x ; Affected smpls -01, -03, -05, -06, -07, -08, -10*, -11, -12, -14, -15, -16, (18), (19).
<VOA-LCS> 9/04 ✓, 9/08 ✓, 9/09 ✓, 9/10 ✓ <SVOA-LCS> 9/14 n-Nitroso-diphenylam. & carbozole ↓ assoc results (J/UJ).
<VOA> - Chronic Blank Contamination found in Lab (Prep) Blanks ~~and Field Blanks~~ and associated samples. Validator deems all detects found on 9-09-09 analysis to be subject to Lab Contamination and 5 "U" qualifier is applied to all values < 1.0 mg/kg-dry. 12-16-09.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
GTP1-10.5-082709	SSH0168-01	Soil	08/27/09 09:40	08/29/09 09:05
GTP1-13.5-082709	SSH0168-02	Soil	08/27/09 10:10	08/29/09 09:05
GTP3-3.5-082709	SSH0168-03	Soil	08/27/09 14:15	08/29/09 09:05
GTP3-5-082709	SSH0168-04	Soil	08/27/09 14:35	08/29/09 09:05
GTP3-13.5-082709	SSH0168-05	Soil	08/27/09 14:49	08/29/09 09:05
GTP4-2.5-082709	SSH0168-06	Soil	08/27/09 15:40	08/29/09 09:05
GTP4-8.0-082709	SSH0168-07	Soil	08/27/09 15:59	08/29/09 09:05
GTP5-3.0-082709	SSH0168-09	Soil	08/27/09 16:40	08/29/09 09:05
GTP5-7.0-082709	SSH0168-10	Soil	08/27/09 16:53	08/29/09 09:05
GTP6-10-082809	SSH0168-11	Soil	08/28/09 10:36	08/29/09 09:05
GTP6-2.5-082809	SSH0168-12	Soil	08/28/09 10:10	08/29/09 09:05
GTP6-17-082809	SSH0168-13	Soil	08/28/09 11:11	08/29/09 09:05
GTP7-2.5-082809	SSH0168-14	Soil	08/28/09 12:50	08/29/09 09:05
GTP7-10.0-082809	SSH0168-15	Soil	08/28/09 13:27	08/29/09 09:05
GTP7-18-082809	SSH0168-16	Soil	08/28/09 13:58	08/29/09 09:05
GTP2-2.5-082709	SSH0168-17	Soil	08/27/09 11:40	08/29/09 09:05
GTP2-8-082709	SSH0168-18	Soil	08/27/09 11:58	08/29/09 09:05
GTP2-13-082709	SSH0168-19	Soil	08/27/09 17:28	08/29/09 09:05
GTP1-2.5-082709	SSH0168-20	Soil	08/27/09 09:20	08/29/09 09:05
GTP5-11-082809	SSH0168-21	Soil	08/28/09 09:37	08/29/09 09:05
TS-COMP-1	SSH0168-22	Soil	08/27/09 18:10	08/29/09 09:05
TS-COMP-2	SSH0168-23	Soil	08/27/09 18:28	08/29/09 09:05
TS-COMP-3	SSH0168-24	Soil	08/27/09 16:40	08/29/09 09:05
GTP4-6.0-082709	SSH0168-25	Soil	08/27/09 15:49	08/29/09 09:05

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/01/09 10:07

Laboratory Analysis Times Report

Volatile Organic Compounds (GC/MS) (8260B STD Dry)

TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted (DAYS)	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/04/09 12:30 8	09/04/09 14:26
SSH0168-01RE1	GTP1-10.5-082709	08/27/09 09:40	09/09/09 15:36 13	09/09/09 17:18
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/04/09 12:30 8	09/04/09 14:50
SSH0168-02RE1	GTP1-13.5-082709	08/27/09 10:10	09/09/09 15:36 13	09/09/09 17:42
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/04/09 12:30 8	09/04/09 15:14
SSH0168-03RE1	GTP3-3.5-082709	08/27/09 14:15	09/09/09 15:36 13	09/09/09 18:06
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/04/09 12:30 8	09/04/09 15:38
SSH0168-04RE1	GTP3-5-082709	08/27/09 14:35	09/09/09 15:36 13	09/09/09 18:29
SSH0168-04RE1	GTP3-5-082709	08/27/09 14:35	09/09/09 15:36 13	09/10/09 23:36
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/04/09 12:30 8	09/04/09 16:02
SSH0168-05RE1	GTP3-13.5-082709	08/27/09 14:49	09/09/09 15:36 13	09/09/09 18:53
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/04/09 12:30 8	09/04/09 16:26
SSH0168-06RE1	GTP4-2.5-082709	08/27/09 15:40	09/09/09 15:36 13	09/09/09 19:18
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/04/09 12:30 8	09/04/09 16:49
SSH0168-07RE1	GTP4-8.0-082709	08/27/09 15:59	09/09/09 15:36 13	09/09/09 19:42
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/04/09 12:30 8	09/04/09 17:13
SSH0168-09RE1	GTP5-3.0-082709	08/27/09 16:40	09/09/09 15:36 13	09/09/09 20:06
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/04/09 12:30 8	09/04/09 17:37
SSH0168-10RE1	GTP5-7.0-082709	08/27/09 16:53	09/09/09 15:36 13	09/09/09 20:30
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/04/09 12:30 7	09/04/09 21:36
SSH0168-11RE1	GTP6-10-082809	08/28/09 10:36	09/09/09 15:36 12	09/10/09 00:56
SSH0168-11RE1	GTP6-10-082809	08/28/09 10:36	09/09/09 15:36 7	09/11/09 00:00
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/08/09 11:31 12	09/08/09 17:54
SSH0168-12RE1	GTP6-2.5-082809	08/28/09 10:10	09/09/09 15:36 12	09/09/09 20:55
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/08/09 11:31 11	09/08/09 18:18
SSH0168-13RE1	GTP6-17-082809	08/28/09 11:11	09/09/09 15:36 12	09/09/09 21:18
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/08/09 11:31 11	09/08/09 18:41
SSH0168-14RE1	GTP7-2.5-082809	08/28/09 12:50	09/09/09 15:36 12	09/09/09 21:42
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/08/09 11:31 11	09/08/09 19:05
SSH0168-15RE1	GTP7-10.0-082809	08/28/09 13:27	09/09/09 15:36 12	09/09/09 22:06
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/08/09 11:31 11	09/08/09 19:29
SSH0168-16RE1	GTP7-18-082809	08/28/09 13:58	09/09/09 15:36 12	09/09/09 22:30
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/04/09 12:30 8	09/04/09 18:01
SSH0168-17RE1	GTP2-2.5-082709	08/27/09 11:40	09/09/09 15:36 13	09/09/09 22:55
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/04/09 12:30 8	09/04/09 18:25
SSH0168-18RE1	GTP2-8-082709	08/27/09 11:58	09/09/09 15:36 13	09/09/09 23:19
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/04/09 12:30 8	09/04/09 18:49
SSH0168-19RE1	GTP2-13-082709	08/27/09 17:28	09/09/09 15:36 13	09/09/09 23:44
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/04/09 12:30 8	09/04/09 19:13
SSH0168-20RE1	GTP1-2.5-082709	08/27/09 09:20	09/09/09 15:36 13	09/10/09 00:08

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Volatile Organic Compounds (GC/MS) (8260B STD Dry)

TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/04/09 12:30 7	09/04/09 19:37
SSH0168-21RE1	GTP5-11-082809	08/28/09 09:37	09/09/09 15:36 12	09/10/09 00:32
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/04/09 12:30 8	09/04/09 20:00
SSH0168-22RE1	TS-COMP-1	08/27/09 18:10	09/09/09 17:34 13	09/10/09 08:57
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/04/09 12:30 8	09/04/09 20:24
SSH0168-23RE1	TS-COMP-2	08/27/09 18:28	09/09/09 17:34 13	09/10/09 09:21
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/04/09 12:30 8	09/04/09 20:48
SSH0168-24RE1	TS-COMP-3	08/27/09 16:40	09/09/09 17:34 13	09/10/09 09:45
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/04/09 12:30 8	09/04/09 21:12
SSH0168-25RE1	GTP4-6.0-082709	08/27/09 15:49	09/09/09 17:34 13	09/10/09 10:09

< 14 Days Soil ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Semivolatile Petroleum Products by NWTPH-Dx (NWTPH-Dx)

TestAmerica Spokane

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/01/09 13:16 5	09/12/09 03:02
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/01/09 13:16	09/12/09 03:25
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/01/09 13:16	09/12/09 03:49
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/01/09 13:16	09/16/09 20:13
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/01/09 13:16	09/16/09 12:14
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/04/09 10:38 8	09/11/09 20:46
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/04/09 10:38	09/11/09 21:10
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/04/09 10:38	09/11/09 21:33
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/04/09 10:38	09/11/09 21:57
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/04/09 10:38 7	09/11/09 22:20
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/04/09 10:38	09/11/09 22:44
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/04/09 10:38	09/11/09 23:07
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/04/09 10:38	09/11/09 23:31
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/04/09 10:38	09/12/09 00:41
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/04/09 10:38	09/12/09 01:04
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/04/09 10:38 9	09/12/09 01:28
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/04/09 10:38	09/12/09 01:51
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/04/09 10:38	09/12/09 02:15
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/04/09 10:38	09/12/09 02:38
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/04/09 10:38	09/15/09 18:02
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/04/09 10:38 7	09/12/09 03:02
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/04/09 10:38 8	09/12/09 03:25
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/08/09 18:28	09/13/09 13:45
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/10/09 14:30 14	09/16/09 20:36
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/08/09 18:28	09/13/09 14:10

Stnd 14 Day ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/01/09 10:07

Laboratory Analysis Times Report

Semivolatile Compounds by Gas Chromatography/Mass (8270C STD Dry)
TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/10/09 17:24 14	09/14/09 18:22 18
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/10/09 17:24	09/14/09 18:42
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/10/09 17:24	09/14/09 19:03
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/10/09 17:24	09/14/09 19:23
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/10/09 17:24	09/14/09 20:25
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/10/09 17:24	09/14/09 20:46
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/10/09 17:24	09/14/09 21:06
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/10/09 17:24	09/14/09 21:27
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/10/09 17:24	09/14/09 21:47
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/10/09 17:24 13	09/15/09 16:24 17
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/10/09 17:24	09/15/09 20:13
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/10/09 17:24	09/14/09 22:28
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/10/09 17:24	09/14/09 22:49
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/10/09 17:24	09/14/09 23:09
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/10/09 17:24	09/14/09 23:30
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/10/09 17:24	09/14/09 23:51
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/10/09 17:24 14	09/15/09 00:11
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/10/09 17:52	09/15/09 16:45
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/10/09 17:52	09/15/09 17:06
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/10/09 17:52	09/15/09 17:27
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/10/09 17:52 13	09/15/09 18:30
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/10/09 17:52 14	09/15/09 18:50
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/10/09 17:52	09/15/09 19:11
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/10/09 17:52	09/16/09 14:08
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/10/09 17:52	09/15/09 19:32
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/10/09 17:52	09/15/09 19:53

Stnd 14 Day ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Metals (ICP) (6010B TMP Dry)

TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/14/09 11:16	09/14/09 21:38
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/14/09 11:16	09/14/09 22:06
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/14/09 11:16	09/14/09 22:10
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/14/09 11:16	09/14/09 22:14
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/14/09 11:16	09/14/09 22:17
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/14/09 11:16	09/14/09 22:21
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/14/09 11:16	09/14/09 22:25
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/14/09 11:16	09/14/09 22:29
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/14/09 11:16	09/14/09 22:32
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/14/09 11:16	09/14/09 22:36
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/14/09 11:16	09/14/09 22:53
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/14/09 11:16	09/14/09 22:57
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/14/09 11:44	09/14/09 23:29
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/14/09 11:44	09/14/09 23:57
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/14/09 11:44	09/15/09 00:00
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/14/09 11:44	09/15/09 00:04
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/14/09 11:44	09/15/09 00:08
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/14/09 11:44	09/15/09 00:12
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/14/09 11:44	09/15/09 00:16
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/14/09 11:44	09/15/09 00:19
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/14/09 11:44	09/15/09 00:23
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/14/09 11:44	09/15/09 00:27
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/14/09 11:44	09/15/09 00:44
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/14/09 11:44	09/15/09 00:47

18
17
18
17
18

< 180 days ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Metals (ICP/MS) (6020 TMP Dry)

TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/14/09 11:16	09/14/09 14:41
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/14/09 11:16	09/14/09 15:36
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/14/09 11:16	09/14/09 15:42
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/14/09 11:16	09/14/09 15:48
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/14/09 11:16	09/14/09 15:54
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/14/09 11:16	09/14/09 16:00
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/14/09 11:16	09/14/09 16:07
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/14/09 11:16	09/14/09 16:13
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/14/09 11:16	09/14/09 16:19
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/14/09 11:16	09/14/09 16:25
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/14/09 11:16	09/14/09 16:32
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/14/09 11:16	09/14/09 16:53
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/14/09 11:44	09/14/09 17:36
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/14/09 11:44	09/14/09 18:41
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/14/09 11:44	09/14/09 18:48
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/14/09 11:44	09/14/09 18:55
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/14/09 11:44	09/14/09 19:02
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/14/09 11:44	09/14/09 19:09
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/14/09 11:44	09/14/09 19:16
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/14/09 11:44	09/14/09 19:45
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/14/09 11:44	09/14/09 19:52
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/14/09 11:44	09/14/09 19:59
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/14/09 11:44	09/14/09 20:06
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/14/09 11:44	09/14/09 20:14

2180

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Percent Moisture (Moisture)
TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/04/09 11:04	09/04/09 11:04
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/04/09 11:04	09/04/09 11:04
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/04/09 11:04	09/04/09 11:04
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/04/09 11:04	09/04/09 11:04
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/04/09 11:04	09/04/09 11:04
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/04/09 11:04	09/04/09 11:04
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/04/09 11:04	09/04/09 11:04
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/04/09 11:04	09/04/09 11:04
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/04/09 11:04	09/04/09 11:04
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/04/09 11:04	09/04/09 11:04
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/04/09 11:04	09/04/09 11:04
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/04/09 11:04	09/04/09 11:04
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/04/09 11:04	09/04/09 11:04
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/04/09 11:04	09/04/09 11:04
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/04/09 11:04	09/04/09 11:04
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/04/09 11:04	09/04/09 11:04
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/04/09 11:04	09/04/09 11:04
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/04/09 11:04	09/04/09 11:04
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/04/09 11:04	09/04/09 11:04
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/04/09 11:04	09/04/09 11:04
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/04/09 11:04	09/04/09 11:04
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/04/09 11:04	09/04/09 11:04
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/04/09 11:04	09/04/09 11:04
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/04/09 11:04	09/04/09 11:04

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date: 10/01/09 10:07

Laboratory Analysis Times Report

Polychlorinated Biphenyls by EPA Method 8082 (EPA 8082)

TestAmerica Spokane

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/09/09 09:20	09/17/09 08:02
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/09/09 09:20	09/15/09 01:45
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/09/09 09:20	09/15/09 02:07
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/09/09 09:20	09/15/09 02:07
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/09/09 09:20	09/15/09 02:30
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/09/09 09:20	09/15/09 02:52
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/09/09 09:20	09/16/09 13:15
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/09/09 09:20	09/16/09 13:38
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/14/09 07:36	09/16/09 20:23
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/14/09 07:36	09/16/09 20:46
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/14/09 07:36	09/16/09 21:08
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/14/09 07:36	09/16/09 21:31
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/14/09 07:36	09/16/09 21:54
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/14/09 07:36	09/16/09 22:16
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/14/09 07:36	09/16/09 22:39
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/14/09 07:36	09/16/09 23:01
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/14/09 07:36	09/16/09 23:23
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/14/09 07:36	09/16/09 23:46
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/14/09 07:36	09/17/09 09:56
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/14/09 07:36	09/17/09 10:18
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/14/09 07:36	09/17/09 10:41
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/14/09 07:36	09/17/09 13:35
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/14/09 07:36	09/17/09 13:58
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/14/09 07:36	09/17/09 14:21
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/14/09 07:36	09/17/09 15:51
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/14/09 07:36	09/17/09 16:13
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/14/09 07:36	09/17/09 16:13
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/14/09 07:36	09/17/09 16:36
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/14/09 07:36	09/17/09 14:43

13
18
17
18
17
18

No Qualif.

> 14 Day Soil
Not a Gross exceedance and no qualif. applied.

SW-846 cites 1 year as acceptable Hold Time; See Lab Narrative.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring (EPA 8270 mod.)

TestAmerica Spokane

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/02/09 09:02 6	09/02/09 17:57
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	08/31/09 13:00 3	09/15/09 19:13
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	08/31/09 13:00 3	09/15/09 02:47
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/02/09 09:02 6	09/02/09 17:35
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/02/09 09:02 6	09/02/09 17:14
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/08/09 13:27 12	09/15/09 03:51
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/08/09 13:27	09/15/09 00:18
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/08/09 13:27	09/15/09 02:05
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/08/09 13:27	09/15/09 00:39
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/08/09 13:27 13	09/15/09 02:26
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/08/09 13:27	09/18/09 17:15
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/08/09 13:27	09/14/09 21:48
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/08/09 13:27	09/15/09 03:30
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/08/09 13:27	09/14/09 23:14
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/08/09 13:27	09/14/09 23:35
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/08/09 13:27	09/14/09 23:56
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/08/09 13:27 12	09/15/09 18:09
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/08/09 13:27	09/15/09 01:22
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/08/09 13:27	09/14/09 22:52
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/08/09 13:27	09/15/09 19:56
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/08/09 13:27 13	09/15/09 06:42
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/08/09 13:27 12	09/15/09 06:20
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/08/09 13:27 12	09/15/09 04:55
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/10/09 09:59 14	09/15/09 19:34
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/08/09 13:27 12	09/14/09 22:31

Days 14 ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Conventional Chemistry Parameters by APHA/EPA Methods (TA SOP)

TestAmerica Spokane

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	08/31/09 15:45 3	09/01/09 10:39
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	08/31/09 15:45	09/01/09 10:39
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	08/31/09 15:45	09/01/09 10:39
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/01/09 11:15 5	09/02/09 10:30
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/01/09 11:15	09/02/09 10:30
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/01/09 11:15	09/02/09 10:30
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/01/09 11:15	09/02/09 10:30
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/01/09 11:15	09/02/09 10:30
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/01/09 11:15	09/02/09 10:30
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/01/09 11:15 4	09/02/09 10:30
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/01/09 11:15	09/02/09 10:30
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/01/09 11:15	09/02/09 10:30
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/01/09 11:15	09/02/09 10:30
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/01/09 11:15	09/02/09 10:30
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/01/09 11:15	09/02/09 10:30
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/01/09 11:15 5	09/02/09 10:30
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/01/09 11:15	09/02/09 10:30
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/01/09 11:15	09/02/09 10:30
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/01/09 11:15	09/02/09 10:30
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/01/09 11:15 4	09/02/09 10:30
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/01/09 11:15 5	09/02/09 10:30
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/15/09 14:15 19	09/16/09 07:30
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/10/09 10:00 14	09/10/09 15:00
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/15/09 14:15 19	09/16/09 07:30

7days

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Laboratory Analysis Times Report

Mercury (CVAA) (7471A Dry)

TestAmerica Tacoma

SSH0168

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSH0168-01	GTP1-10.5-082709	08/27/09 09:40	09/03/09 13:44	09/03/09 15:40
SSH0168-02	GTP1-13.5-082709	08/27/09 10:10	09/03/09 13:44	09/03/09 16:02
SSH0168-03	GTP3-3.5-082709	08/27/09 14:15	09/03/09 13:44	09/03/09 16:06
SSH0168-04	GTP3-5-082709	08/27/09 14:35	09/03/09 13:44	09/03/09 16:10
SSH0168-05	GTP3-13.5-082709	08/27/09 14:49	09/03/09 13:44	09/03/09 16:15
SSH0168-06	GTP4-2.5-082709	08/27/09 15:40	09/03/09 13:44	09/03/09 16:20
SSH0168-07	GTP4-8.0-082709	08/27/09 15:59	09/03/09 13:44	09/03/09 16:32
SSH0168-09	GTP5-3.0-082709	08/27/09 16:40	09/03/09 13:44	09/03/09 16:36
SSH0168-10	GTP5-7.0-082709	08/27/09 16:53	09/03/09 13:44	09/03/09 16:41
SSH0168-11	GTP6-10-082809	08/28/09 10:36	09/03/09 13:44	09/03/09 16:45
SSH0168-12	GTP6-2.5-082809	08/28/09 10:10	09/03/09 13:44	09/03/09 16:49
SSH0168-13	GTP6-17-082809	08/28/09 11:11	09/03/09 13:44	09/03/09 16:53
SSH0168-14	GTP7-2.5-082809	08/28/09 12:50	09/03/09 14:24	09/03/09 17:32
SSH0168-15	GTP7-10.0-082809	08/28/09 13:27	09/03/09 14:24	09/03/09 17:53
SSH0168-16	GTP7-18-082809	08/28/09 13:58	09/03/09 14:24	09/03/09 17:57
SSH0168-17	GTP2-2.5-082709	08/27/09 11:40	09/03/09 14:24	09/03/09 18:01
SSH0168-18	GTP2-8-082709	08/27/09 11:58	09/03/09 14:24	09/03/09 18:06
SSH0168-19	GTP2-13-082709	08/27/09 17:28	09/03/09 14:24	09/03/09 18:10
SSH0168-20	GTP1-2.5-082709	08/27/09 09:20	09/03/09 14:24	09/03/09 18:25
SSH0168-21	GTP5-11-082809	08/28/09 09:37	09/03/09 14:24	09/03/09 18:29
SSH0168-22	TS-COMP-1	08/27/09 18:10	09/03/09 14:24	09/03/09 18:33
SSH0168-23	TS-COMP-2	08/27/09 18:28	09/03/09 14:24	09/03/09 18:38
SSH0168-24	TS-COMP-3	08/27/09 16:40	09/03/09 14:24	09/03/09 18:42
SSH0168-25	GTP4-6.0-082709	08/27/09 15:49	09/03/09 14:24	09/03/09 18:46

< 28 ✓

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 580168

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY: A. COTE

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH-Dx	EPA 8082	EPA 8260B	EPA 6010C/ 6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 GTP1-10.5-082709	082709/9.40		X	X	X	X	X	X				-01
2 GTP1-13.5-082709	082709/10.10		X	X	X	X	X	X				-02
3 GTP3-3.5-082709	082709/14:15		X	X	X	X	X	X				-03
4 GTP3-5-082709	082709/14:35		X	X	X	X	X	X				-04
5 GTP3-13.5-082709	082709/14:49		X	X	X	X	X	X				-05
6 GTP4-2.5-082709	082709/15:40		X	X	X	X	X	X				-06
7 GTP4-6.0-082709	082709/15:57		X	X	X	X	X	X				-07
8 GTP4-11.0-082809	082809/9:37		X	X	X	X	X	X				-08
9 GTP5-3.0-082709	082709/16:40		X	X	X	X	X	X				-09
10 GTP5-7.0-082709	082709/16:53		X	X	X	X	X	X				-10

RELEASED BY: A. Cote	DATE: 082909	RECEIVED BY: Chris Williams	DATE: 8/29/09
PRINT NAME: Amanda COTE FIRM: GAI	TIME: 9:05	PRINT NAME: Chris Williams FIRM: TASpokane	TIME: 9:05
RELEASED BY:	DATE:	RECEIVED BY:	DATE:
PRINT NAME: FIRM:	TIME:	PRINT NAME: FIRM:	TIME:

ADDITIONAL REMARKS:
EPA 8270C incl. naphthalene, 1-methylnaphthalene, 2-methylnaphthlene

TEMP: 5.6°C

TAL-1000(0408)

PAHs all SIM

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SST101168

CLIENT: Golder Assoc. Inc

REPORT TO: Douglas Morell
ADDRESS: 18300 NE Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE: 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avey Landing
PROJECT NUMBER:
SAMPLED BY:

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8260B TCL VOC	EPA 8270C TCL SVOC	EPA 6010/6020A	EPA 7471B	EPA 8082	NWTPH-Dx	EPA 8270C SIM	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 GTP6-10-082809	082809/10:36		X	X	X	X	X	X	X				-11
2 GTP6-2.5-082809	082809/10:10		X	X	X	X	X	X	X				-12
3 GTP6-17-082809	082809/11:11		X	X	X	X	X	X	X				-13
GTP7-2.5-082809	082809/12:50		X	X	X	X	X	X	X				-14
GTP7-10-082809	082809/13:27		X	X	X	X	X	X	X				-15
GTP7-18-082809	082809/13:58		X	X	X	X	X	X	X				-16
GTP2-2.5-082709	082709/11:40		X	X	X	X	X	X	X				-17
GTP2-8-082709	082709/11:58		X	X	X	X	X	X	X				-18
GTP2-13-082709	08/27/09 17:25		X	X	X	X	X	X	X				-19
GTP1-2.5-082709	082709/9:20		X	X	X	X	X	X	X				-20

RELEASED BY: Amanda Cote — DATE: 082909
PRINT NAME: Amanda Cote — FIRM: GAE — TIME: 9:05

RECEIVED BY: Chris Williams — DATE: 8/29/09
PRINT NAME: Chris Williams — FIRM: TA Spokane — TIME: 9:05

RELEASED BY: — DATE:
PRINT NAME: — FIRM: — TIME:

RECEIVED BY: — DATE:
PRINT NAME: — FIRM: — TIME:

ADDITIONAL REMARKS:
EPA 8270C inc. naphthalene, 1-methylnaphthalene & 2-methylnaphthalene.
PAH's all SIM

TEMP: 5.6°C

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSH0168

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond, WA 98077
PHONE 425-883-0777 FAX:

INVOICE TO: ← Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER:
SAMPLED BY:

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ~~10~~ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: ~~5~~ STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM	NWTPH-Dx	EPA 8082	EPA 8260B	EPA 6010C/6020A	EPA 7471B	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	TP5-11-082809	082809/9:37		X	X	X	X	X	X				-21
2	TS-Comp-1	082709/18:10		X	X	X	X	X	X				-22
3	TS-Comp 2	082709/18:28		X	X	X	X	X	X				-23
4	TS-Comp3	082709/16:40		X	X	X	X	X	X				-24
5													
6													
7													
8													
9													
10													

RELEASED BY: [signature] DATE: 082909
PRINT NAME: Amanda Cote FIRM: GAI TIME: 9:05

RECEIVED BY: [signature] DATE: 8/29/09
PRINT NAME: Chris Williams FIRM: TA-Spokane TIME: 9:05

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS:
EPA 8270C inc: naphthalene, 1-methylnaphthalene, 2-methylnaphthalene

TEMP: 5.6°C

PAGE 5 OF 5

PAH's all SIM

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSH0168 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 8/29/09 905 Cooler signed for by: C. Williams (Print name)

Preliminary Examination Phase:

Date cooler opened: ☐ same as date received *or* 8/31/09

Cooler opened by (print) C. Hanson (sign)

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☒ CLIENT ☐ Other:

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 2 Signed by _____ Date ___/___/___

Were custody seals unbroken and intact on arrival?	☐ Yes	☒ No
3. Were custody papers sealed in a plastic bag?	☐ Yes	☒ No
4. Were custody papers filled out properly (ink, signed, etc.)?	☒ Yes	☐ No
5. Did you sign the custody papers in the appropriate place?	☒ Yes	☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: Good

   Temperature by IR Gun 5.6 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: _____

8. Did samples arrive in plastic bags?	☒ Yes	☐ No
9. Did all bottles arrive unbroken, and with labels in good condition?	☒ Yes	☐ No
10. Are all bottle labels complete (ID, date, time, etc.)	☒ Yes	☐ No
11. Do bottle labels and Chain of Custody agree?	☒ Yes	☐ No
12. Are the containers and preservatives correct for the tests indicated?	☒ Yes	☐ No
13. Is there adequate volume for the tests requested?	☒ Yes	☐ No
14. Were VOA vials free of bubbles? ☐ N/A	☐ Yes	☐ No

If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 8/31/09

Samples logged in by (print) C. Hanson (sign)

1. Was project identifiable from custody papers?	☒ Yes	☐ No
2. Do Turn Around Times and Due Dates agree?	☒ Yes	☐ No
3. Was the Project Manager notified of status?	☒ Yes	☐ No
4. Was the Lab notified of status?	☒ Yes	☐ No
5. Was the COC scanned and copied?	☒ Yes	☐ No

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**8670**	-----	316	mg/kg dry	10x	9090006	09/01/09 13:16	09/12/09 03:02	
Heavy Oil Range Hydrocarbons	"	**12800**	----	791	"	"	"	"	"	
Surrogate(s): 2-FBP		*175%*			*50 - 150 %*	"			"	*Z3*
p-Terphenyl-d14		*99.7%*			*50 - 150 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1630**	----	229	mg/kg dry	10x	9090006	09/01/09 13:16	09/12/09 03:25	
Heavy Oil Range Hydrocarbons	"	**2900**	----	571	"	"	"	"	"	
Surrogate(s): 2-FBP		*101%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*96.7%*			*50 - 150 %*	"			"	
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**44.2**	-----	10.8	mg/kg dry	1x	9090006	09/01/09 13:16	09/12/09 03:49	
Heavy Oil Range Hydrocarbons	"	**209**	----	26.9	"	"	"	"	"	
Surrogate(s): 2-FBP		*93.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*111%*			*50 - 150 %*	"			"	
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**770**	----	69.2	mg/kg dry	5x	9090006	09/01/09 13:16	09/16/09 20:13	
Heavy Oil Range Hydrocarbons	"	**999**	----	173	"	"	"	"	"	
Surrogate(s): 2-FBP		*75.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*117%*			*50 - 150 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Diesel Range Hydrocarbons	NWTPH-Dx	**23.7**	----	12.9	mg/kg dry	1x	9090006	09/01/09 13:16	09/16/09 12:14	
Heavy Oil Range Hydrocarbons	"	**61.4**	----	32.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*89.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*106%*			*50 - 150 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**25.6**	----	10.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 20:46	
Heavy Oil Range Hydrocarbons	"	**145**	----	26.4	"	"	"	"	"	
Surrogate(s): 2-FBP		*94.0%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*101%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	16.1	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:10	
Heavy Oil Range Hydrocarbons	"	ND	----	40.1	"	"	"	"	"	
Surrogate(s): 2-FBP		*84.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*97.5%*			*50 - 150 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	16.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:33	
Heavy Oil Range Hydrocarbons	"	ND	----	41.9	"	"	"	"	"	
Surrogate(s): 2-FBP		*90.1%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*105%*			*50 - 150 %*	"			"	
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
Diesel Range Hydrocarbons	NWTPH-Dx	**774**	----	31.0	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 21:57	
Heavy Oil Range Hydrocarbons	"	**1090**	----	77.5	"	"	"	"	"	
Surrogate(s): 2-FBP		*87.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*184%*			*50 - 150 %*	"			"	*ZX*
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Diesel Range Hydrocarbons	NWTPH-Dx	**9660**	----	471	mg/kg dry	20x	9090027	09/04/09 10:38	09/11/09 22:20	
Heavy Oil Range Hydrocarbons	"	**3150**	----	1180	"	"	"	"	"	
Surrogate(s): 2-FBP		*453%*			*50 - 150 %*	"			"	*Z3*
p-Terphenyl-d14		*114%*			*50 - 150 %*	"			"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	11.4	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 22:44	
Heavy Oil Range Hydrocarbons	"	ND	----	28.4	"	"	"	"	"	
Surrogate(s): 2-FBP		*86.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*102%*			*50 - 150 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Diesel Range Hydrocarbons	NWTPH-Dx	**431**	----	46.3	mg/kg dry	2x	9090027	09/04/09 10:38	09/11/09 23:07	
Heavy Oil Range Hydrocarbons	"	**1200**	----	116	"	"	"	"	"	
Surrogate(s): 2-FBP		*90.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*259%*			*50 - 150 %*	"			"	*ZX*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	15.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/11/09 23:31	
Heavy Oil Range Hydrocarbons	"	**42.2**	----	39.5	"	"	"	"	"	
Surrogate(s): 2-FBP		*89.1%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*107%*			*50 - 150 %*	"			"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Diesel Range Hydrocarbons	NWTPH-Dx	**23.4**	-----	10.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 00:41	
Heavy Oil Range Hydrocarbons	"	**182**	----	26.2	"	"	"	"	"	
Surrogate(s): 2-FBP		*88.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*98.2%*			*50 - 150 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	16.9	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:04	
Heavy Oil Range Hydrocarbons	"	ND	----	42.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*90.3%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*105%*			*50 - 150 %*	"			"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**24.7**	-----	11.8	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:28	
Heavy Oil Range Hydrocarbons	"	**252**	----	29.4	"	"	"	"	"	
Surrogate(s): 2-FBP		*91.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*99.8%*			*50 - 150 %*	"			"	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	11.5	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 01:51	
Heavy Oil Range Hydrocarbons	"	ND	----	28.8	"	"	"	"	"	
Surrogate(s): 2-FBP		*83.5%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*102%*			*50 - 150 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	12.7	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 02:15	
Heavy Oil Range Hydrocarbons	"	ND	----	31.7	"	"	"	"	"	
Surrogate(s): 2-FBP		*78.4%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*92.1%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**				**Sampled: 08/27/09 09:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**452**		----	17.2	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 02:38	
Heavy Oil Range Hydrocarbons	"	**3830**		----	1080	"	25x	"	"	09/15/09 18:02	
Surrogate(s): 2-FBP		*77.4%*			*50 - 150 %*		*1x*			*09/12/09 02:38*	
p-Terphenyl-d14		*83.5%*			*50 - 150 %*		"			"	
SSH0168-21 (GTP5-11-082809)		**Soil**				**Sampled: 08/28/09 09:37**					
Diesel Range Hydrocarbons	NWTPH-Dx	**342**	J	----	43.6	mg/kg dry	4x	9090027	09/04/09 10:38	09/12/09 03:02	
Heavy Oil Range Hydrocarbons	"	**985**	J	----	109	"	"	"	"	"	
Surrogate(s): 2-FBP		*12.5%*			*50 - 150 %*		"			"	*Z3*
p-Terphenyl-d14		*17.4%*			*50 - 150 %*		"			"	*Z3*
SSH0168-22 (TS-COMP-1)		**Soil**				**Sampled: 08/27/09 18:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**763**		----	11.7	mg/kg dry	1x	9090027	09/04/09 10:38	09/12/09 03:25	
Heavy Oil Range Hydrocarbons	"	**263**		----	29.1	"	"	"	"	"	
Surrogate(s): 2-FBP		*111%*			*50 - 150 %*		"			"	
p-Terphenyl-d14		*93.7%*			*50 - 150 %*		"			"	
SSH0168-23 (TS-COMP-2)		**Soil**				**Sampled: 08/27/09 18:28**					
Diesel Range Hydrocarbons	NWTPH-Dx	**2120**		----	18.6	mg/kg dry	1x	9090043	09/08/09 18:28	09/13/09 13:45	
Heavy Oil Range Hydrocarbons	"	**1090**		----	46.4	"	"	"	"	"	
Surrogate(s): 2-FBP		*122%*			*50 - 150 %*		"			"	
p-Terphenyl-d14		*105%*			*50 - 150 %*		"			"	
SSH0168-24 (TS-COMP-3)		**Soil**				**Sampled: 08/27/09 16:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1790**		----	34.8	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 20:36	
Heavy Oil Range Hydrocarbons	"	**2050**		----	87.1	"	"	"	"	"	
Surrogate(s): 2-FBP		*110%*			*50 - 150 %*		"			"	
p-Terphenyl-d14		*115%*			*50 - 150 %*		"			"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**				**Sampled: 08/27/09 15:49**					
Diesel Range Hydrocarbons	NWTPH-Dx	**11.3**		----	10.7	mg/kg dry	1x	9090043	09/08/09 18:28	09/13/09 14:10	
Heavy Oil Range Hydrocarbons	"	**41.9**		----	26.8	"	"	"	"	"	
Surrogate(s): 2-FBP		*79.3%*			*50 - 150 %*		"			"	
p-Terphenyl-d14		*105%*			*50 - 150 %*		"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.0831	mg/kg dry	5x	9090010	09/02/09 09:02	09/02/09 17:57	
2-Methylnaphthalene	"	ND	----	0.0831	"	"	"	"	"	
Acenaphthene	"	**0.498**	----	0.0831	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.0831	"	"	"	"	"	
Anthracene	"	**1.55**	----	0.0831	"	"	"	"	"	
Benzo (a) anthracene	"	**0.348**	----	0.0831	"	"	"	"	"	
Benzo (a) pyrene	"	**0.301**	----	0.0831	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.0831	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.459**	----	0.0831	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0831	"	"	"	"	"	
Chrysene	"	**0.989**	----	0.0831	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.245**	----	0.0831	"	"	"	"	"	
Fluoranthene	"	**0.150**	----	0.0831	"	"	"	"	"	
Fluorene	"	**1.41**	----	0.0831	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.277**	----	0.0831	"	"	"	"	"	
Naphthalene	"	**0.427**	----	0.0831	"	"	"	"	"	
Phenanthrene	"	**0.894**	----	0.0831	"	"	"	"	"	
Pyrene	"	**2.25**	----	0.0831	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*68.0%*			*38.8 - 139 %*	"		"		
2-FBP		*37.0%*			*40 - 132 %*	"		"		*Z3*
p-Terphenyl-d14		*132%*			*31.7 - 179 %*	"		"		
SSH0168-02 (GTP1-13.5-082709)		**Soil** Q			**Sampled: 08/27/09 10:10**					
1-Methylnapthalene	EPA 8270 mod.	**0.0579**	----	0.00495	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 19:13	
2-Methylnaphthalene	"	ND	----	0.00495	"	"	"	"	"	
Acenaphthene	"	**0.00508** J	----	0.00495	"	"	"	"	"	Ia
Acenaphthylene	"	ND R	----	0.00495	"	"	"	"	"	Ia
Anthracene	"	**0.198** J	----	0.00495	"	"	"	"	"	Ia
Benzo (a) anthracene	"	**0.0737**	----	0.00495	"	"	"	"	"	Ia
Benzo (a) pyrene	"	**0.0259**	----	0.00495	"	"	"	"	"	Ia
Benzo (b) fluoranthene	"	**0.0518**	----	0.00495	"	"	"	"	"	Ia
Benzo (ghi) perylene	"	**0.0345**	----	0.00495	"	"	"	"	"	Ia
Benzo (k) fluoranthene	"	ND R	----	0.00495	"	"	"	"	"	Ia
Chrysene	"	**0.168** J	----	0.00495	"	"	"	"	"	Ia
Dibenzo (a,h) anthracene	"	**0.0290**	----	0.00495	"	"	"	"	"	Ia
Fluoranthene	"	**0.0452**	----	0.00495	"	"	"	"	"	Ia
Fluorene	"	**0.0853**	----	0.00495	"	"	"	"	"	Ia
Indeno (1,2,3-cd) pyrene	"	**0.0269** J	----	0.00495	"	"	"	"	"	Ia
Naphthalene	"	**0.0818**	----	0.00495	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02 (GTP1-13.5-082709)		Soil				Sampled: 08/27/09 10:10					
Phenanthrene	EPA 8270 mod.	**0.0635**	J	----	0.00495	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 19:13	Ia
Pyrene	"	**0.396**	J	----	0.00495	"	"	"	"	"	Ia
Surrogate(s): Nitrobenzene-d5		*114%*				*38.8 - 139 %*	"			"	
2-FBP		*28.0%*				*40 - 132 %*	"			"	*Ia, Z*
p-Terphenyl-d14		*151%*				*31.7 - 179 %*	"			"	*Ia*
SSH0168-03 (GTP3-3.5-082709)		Soil				Sampled: 08/27/09 14:15					
1-Methylnapthalene	EPA 8270 mod.	ND		----	0.00467	mg/kg dry	1x	9080204	08/31/09 13:00	09/15/09 02:47	
2-Methylnaphthalene	"	ND		----	0.00467	"	"	"	"	"	
Acenaphthene	"	ND		----	0.00467	"	"	"	"	"	
Acenaphthylene	"	ND		----	0.00467	"	"	"	"	"	
Anthracene	"	ND		----	0.00467	"	"	"	"	"	
Benzo (a) anthracene	"	ND		----	0.00467	"	"	"	"	"	
Benzo (a) pyrene	"	ND		----	0.00467	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00958**		----	0.00467	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0105**		----	0.00467	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND		----	0.00467	"	"	"	"	"	
Chrysene	"	**0.00670**		----	0.00467	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND		----	0.00467	"	"	"	"	"	
Fluoranthene	"	**0.00527**		----	0.00467	"	"	"	"	"	
Fluorene	"	ND		----	0.00467	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00862**		----	0.00467	"	"	"	"	"	
Naphthalene	"	ND		----	0.00467	"	"	"	"	"	
Phenanthrene	"	**0.00527**		----	0.00467	"	"	"	"	"	
Pyrene	"	**0.0101**		----	0.00467	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*74.4%*				*38.8 - 139 %*	"			"	
2-FBP		*81.2%*				*40 - 132 %*	"			"	
p-Terphenyl-d14		*106%*				*31.7 - 179 %*	"			"	
SSH0168-04 (GTP3-5-082709)		Soil				Sampled: 08/27/09 14:35					RL3
1-Methylnapthalene	EPA 8270 mod.	**0.0105**		----	0.00645	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:35	
2-Methylnaphthalene	"	**0.0105**		----	0.00645	"	"	"	"	"	
Acenaphthene	"	ND		----	0.00645	"	"	"	"	"	
Acenaphthylene	"	ND		----	0.00645	"	"	"	"	"	
Anthracene	"	**0.805**		----	0.00645	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0295**		----	0.00645	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0350**		----	0.00645	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0627**		----	0.00645	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0541**	----	0.00645	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:35	
Benzo (k) fluoranthene	"	ND	----	0.00645	"	"	"	"	"	
Chrysene	"	**0.0725**	----	0.00645	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0154**	----	0.00645	"	"	"	"	"	
Fluoranthene	"	**0.141**	----	0.00645	"	"	"	"	"	
Fluorene	"	**0.00984**	----	0.00645	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0264**	----	0.00645	"	"	"	"	"	
Naphthalene	"	ND	----	0.00645	"	"	"	"	"	
Phenanthrene	"	**0.0799**	----	0.00645	"	"	"	"	"	
Pyrene	"	**0.168**	----	0.00645	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*101%*			*38.8 - 139 %*	"			"	
2-FBP		*52.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*106%*			*31.7 - 179 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00474	mg/kg dry	1x	9090010	09/02/09 09:02	09/02/09 17:14	
2-Methylnaphthalene	"	ND	----	0.00474	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00474	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00474	"	"	"	"	"	
Anthracene	"	ND	----	0.00474	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00474	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00474	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00474	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00474	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00474	"	"	"	"	"	
Chrysene	"	ND	----	0.00474	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00474	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00474	"	"	"	"	"	
Fluorene	"	ND	----	0.00474	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00474	"	"	"	"	"	
Naphthalene	"	ND	----	0.00474	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00474	"	"	"	"	"	
Pyrene	"	ND	----	0.00474	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*43.4%*			*38.8 - 139 %*	"			"	
2-FBP		*44.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*61.2%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00492	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:51	
2-Methylnaphthalene	"	ND	----	0.00492	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00492	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00492	"	"	"	"	"	
Anthracene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00516**	----	0.00492	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0117**	----	0.00492	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00985**	----	0.00492	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00492	"	"	"	"	"	
Chrysene	"	**0.00609**	----	0.00492	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00492	"	"	"	"	"	
Fluoranthene	"	**0.00656**	----	0.00492	"	"	"	"	"	
Fluorene	"	ND	----	0.00492	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00492	"	"	"	"	"	
Naphthalene	"	ND	----	0.00492	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00492	"	"	"	"	"	
Pyrene	"	**0.0136**	----	0.00492	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*39.8%*			*38.8 - 139 %*	"			"	
2-FBP		*47.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*95.4%*			*31.7 - 179 %*	"			"	
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:18	
2-Methylnaphthalene	"	ND	----	0.00500	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00500	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00500	"	"	"	"	"	
Anthracene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00500	"	"	"	"	"	
Chrysene	"	ND	----	0.00500	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00500	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00500	"	"	"	"	"	
Fluorene	"	ND	----	0.00500	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00500	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Naphthalene	EPA 8270 mod.	ND	----	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:18	
Phenanthrene	"	ND	----	0.00500	"	"	"	"	"	
Pyrene	"	ND	----	0.00500	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*54.4%*			*38.8 - 139 %*	"			"	
2-FBP		*59.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*89.0%*			*31.7 - 179 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00447	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 02:05	
2-Methylnaphthalene	"	ND	----	0.00447	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00447	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00447	"	"	"	"	"	
Anthracene	"	ND	----	0.00447	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00447	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00447	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00447	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00447	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00447	"	"	"	"	"	
Chrysene	"	ND	----	0.00447	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00447	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00447	"	"	"	"	"	
Fluorene	"	ND	----	0.00447	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00447	"	"	"	"	"	
Naphthalene	"	ND	----	0.00447	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00447	"	"	"	"	"	
Pyrene	"	ND	----	0.00447	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*77.0%*			*38.8 - 139 %*	"			"	
2-FBP		*81.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*95.6%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.00826**	-----	0.00689	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 00:39	
2-Methylnaphthalene	"	ND	----	0.00689	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00689	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00689	"	"	"	"	"	
Anthracene	"	ND	----	0.00689	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00689	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00689	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00689	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00689	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00689	"	"	"	"	"	
Chrysene	"	ND	----	0.00689	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00689	"	"	"	"	"	
Fluoranthene	"	**0.0579**	----	0.00689	"	"	"	"	"	
Fluorene	"	ND	----	0.00689	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00689	"	"	"	"	"	
Naphthalene	"	**0.0147**	----	0.00689	"	"	"	"	"	
Phenanthrene	"	**0.0340**	----	0.00689	"	"	"	"	"	
Pyrene	"	**0.295**	----	0.00689	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*66.4%*			*38.8 - 139 %*	"			"	
2-FBP		*77.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*83.8%*			*31.7 - 179 %*	"			"	
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
1-Methylnapthalene	EPA 8270 mod.	**20.9** J	-----	0.209	mg/kg dry	20x	9090042	09/08/09 13:27	09/18/09 17:15	**A-01**
2-Methylnaphthalene	"	**39.1** J	----	0.209	"	"	"	"	"	**A-01**
Acenaphthene	"	**0.172** J	----	0.00471	"	1x	"	"	09/15/09 02:26	**A-01**
Acenaphthylene	"	ND	----	0.00471	"	"	"	"	"	**A-01**
Anthracene	"	**0.754**	----	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00767**	----	0.00471	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00488**	----	0.00471	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00471	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0209**	----	0.00471	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00471	"	"	"	"	"	
Chrysene	"	**0.0153**	----	0.00471	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00471	"	"	"	"	"	
Fluoranthene	"	**0.0914**	----	0.00471	"	"	"	"	"	
Fluorene	"	**0.207** J	----	0.00471	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00471	"	"	"	"	"	
Naphthalene	"	**2.39** J	----	0.00471	"	"	"	"	"	**A-01**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Phenanthrene	EPA 8270 mod.	ND	----	0.00471	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 02:26	
Pyrene	"	**0.112**	----	0.00471	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*161%*			*38.8 - 139 %*	"			"	***A-01, ZX***
2-FBP		*26.0%*			*40 - 132 %*	"			"	***A-01, Z***
p-Terphenyl-d14		*93.2%*			*31.7 - 179 %*	"			"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00455	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 21:48	
2-Methylnaphthalene	"	ND	----	0.00455	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00455	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00455	"	"	"	"	"	
Anthracene	"	ND	----	0.00455	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00455	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00455	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00455	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00455	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00455	"	"	"	"	"	
Chrysene	"	ND	----	0.00455	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00455	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00455	"	"	"	"	"	
Fluorene	"	ND	----	0.00455	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00455	"	"	"	"	"	
Naphthalene	"	ND	----	0.00455	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00455	"	"	"	"	"	
Pyrene	"	ND	----	0.00455	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*69.6%*			*38.8 - 139 %*	"			"	
2-FBP		*80.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*99.4%*			*31.7 - 179 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.0412**	----	0.00514	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:30	
2-Methylnaphthalene	"	**0.0658**	----	0.00514	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00514	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00514	"	"	"	"	"	
Anthracene	"	**0.00823**	----	0.00514	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0130**	----	0.00514	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0110**	----	0.00514	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0178**	----	0.00514	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					**RL3**
Benzo (ghi) perylene	EPA 8270 mod.	**0.0103**	----	0.00514	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 03:30	
Benzo (k) fluoranthene	"	ND	----	0.00514	"	"	"	"	"	
Chrysene	"	**0.0178**	----	0.00514	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00549**	----	0.00514	"	"	"	"	"	
Fluoranthene	"	**0.0151**	----	0.00514	"	"	"	"	"	
Fluorene	"	**0.00549**	----	0.00514	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00617**	----	0.00514	"	"	"	"	"	
Naphthalene	"	**0.0185**	----	0.00514	"	"	"	"	"	
Phenanthrene	"	**0.0130**	----	0.00514	"	"	"	"	"	
Pyrene	"	**0.0343**	----	0.00514	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*35.6%*			*38.8 - 139 %*	"			"	*Z*
2-FBP		*43.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*68.4%*			*31.7 - 179 %*	"			"	
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00492	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:14	
2-Methylnaphthalene	"	ND	----	0.00492	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00492	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00492	"	"	"	"	"	
Anthracene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00492	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00492	"	"	"	"	"	
Chrysene	"	ND	----	0.00492	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00492	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00492	"	"	"	"	"	
Fluorene	"	ND	----	0.00492	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00492	"	"	"	"	"	
Naphthalene	"	ND	----	0.00492	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00492	"	"	"	"	"	
Pyrene	"	ND	----	0.00492	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*56.4%*			*38.8 - 139 %*	"			"	
2-FBP		*63.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*91.2%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00489	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:35	
2-Methylnaphthalene	"	ND	----	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00489	"	"	"	"	"	
Anthracene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Chrysene	"	ND	----	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Fluorene	"	ND	----	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00489	"	"	"	"	"	
Naphthalene	"	ND	----	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00489	"	"	"	"	"	
Pyrene	"	ND	----	0.00489	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*63.8%*			*38.8 - 139 %*	"			"	
2-FBP		*76.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*97.2%*			*31.7 - 179 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00451	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:56	
2-Methylnaphthalene	"	ND	----	0.00451	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00451	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00451	"	"	"	"	"	
Anthracene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Chrysene	"	ND	----	0.00451	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00451	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Fluorene	"	ND	----	0.00451	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00451	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Naphthalene	EPA 8270 mod.	ND	----	0.00451	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 23:56	
Phenanthrene	"	ND	----	0.00451	"	"	"	"	"	
Pyrene	"	ND	----	0.00451	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*69.2%*			*38.8 - 139 %*	"			"	
2-FBP		*74.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*89.0%*			*31.7 - 179 %*	"			"	
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00471	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 18:09	
2-Methylnaphthalene	"	ND	----	0.00471	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00471	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00471	"	"	"	"	"	
Anthracene	"	ND	----	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0168**	----	0.00471	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0162**	----	0.00471	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0335**	----	0.00471	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0204**	----	0.00471	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00471	"	"	"	"	"	
Chrysene	"	**0.0178**	----	0.00471	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00785**	----	0.00471	"	"	"	"	"	
Fluoranthene	"	**0.0257**	----	0.00471	"	"	"	"	"	
Fluorene	"	ND	----	0.00471	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0126**	----	0.00471	"	"	"	"	"	
Naphthalene	"	ND	----	0.00471	"	"	"	"	"	
Phenanthrene	"	**0.00628**	----	0.00471	"	"	"	"	"	
Pyrene	"	**0.0398**	----	0.00471	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*31.8%*			*38.8 - 139 %*	"			"	*Z*
2-FBP		*28.6%*			*40 - 132 %*	"			"	*Z*
p-Terphenyl-d14		*43.2%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00461	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 01:22	
2-Methylnaphthalene	"	ND	----	0.00461	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00461	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00461	"	"	"	"	"	
Anthracene	"	ND	----	0.00461	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00820**	----	0.00461	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00769**	----	0.00461	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0123**	----	0.00461	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00666**	----	0.00461	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00461	"	"	"	"	"	
Chrysene	"	**0.00871**	----	0.00461	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00461	"	"	"	"	"	
Fluoranthene	"	**0.00820**	----	0.00461	"	"	"	"	"	
Fluorene	"	ND	----	0.00461	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00461**	----	0.00461	"	"	"	"	"	
Naphthalene	"	ND	----	0.00461	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00461	"	"	"	"	"	
Pyrene	"	**0.0138**	----	0.00461	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*75.2%*			*38.8 - 139 %*	"			"	
2-FBP		*81.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*96.4%*			*31.7 - 179 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00465	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:52	
2-Methylnaphthalene	"	ND	----	0.00465	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00465	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00465	"	"	"	"	"	
Anthracene	"	ND	----	0.00465	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00465	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00465	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00465	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00465	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00465	"	"	"	"	"	
Chrysene	"	ND	----	0.00465	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00465	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00465	"	"	"	"	"	
Fluorene	"	ND	----	0.00465	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00465	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Naphthalene	EPA 8270 mod.	ND	----	0.00465	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:52	
Phenanthrene	"	ND	----	0.00465	"	"	"	"	"	
Pyrene	"	ND	----	0.00465	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*57.6%*			*38.8 - 139 %*	"			"	
2-FBP		*64.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*85.4%*			*31.7 - 179 %*	"			"	
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.0268	mg/kg dry	5x	9090042	09/08/09 13:27	09/15/09 19:56	
2-Methylnaphthalene	"	ND	----	0.0268	"	"	"	"	"	
Acenaphthene	"	ND	----	0.0268	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.0268	"	"	"	"	"	
Anthracene	"	ND	----	0.0268	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0459**	----	0.0268	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0561**	----	0.0268	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0968**	----	0.0268	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0637**	----	0.0268	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0268	"	"	"	"	"	
Chrysene	"	**0.0382**	----	0.0268	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.0268	"	"	"	"	"	
Fluoranthene	"	ND	----	0.0268	"	"	"	"	"	
Fluorene	"	ND	----	0.0268	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0510**	----	0.0268	"	"	"	"	"	
Naphthalene	"	ND	----	0.0268	"	"	"	"	"	
Phenanthrene	"	ND	----	0.0268	"	"	"	"	"	
Pyrene	"	**0.133**	----	0.0268	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*19.0%*			*38.8 - 139 %*	"			"	*Z3*
2-FBP		*17.0%*			*40 - 132 %*	"			"	*Z3*
p-Terphenyl-d14		*44.0%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					**RL2**
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.0254	mg/kg dry	5x	9090042	09/08/09 13:27	09/15/09 06:42	
2-Methylnaphthalene	"	ND	----	0.0254	"	"	"	"	"	
Acenaphthene	"	ND	----	0.0254	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.0254	"	"	"	"	"	
Anthracene	"	ND	----	0.0254	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.0254	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.0254	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.0254	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.0254	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0254	"	"	"	"	"	
Chrysene	"	ND	----	0.0254	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.0254	"	"	"	"	"	
Fluoranthene	"	ND	----	0.0254	"	"	"	"	"	
Fluorene	"	ND	----	0.0254	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.0254	"	"	"	"	"	
Naphthalene	"	ND	----	0.0254	"	"	"	"	"	
Phenanthrene	"	ND	----	0.0254	"	"	"	"	"	
Pyrene	"	ND	----	0.0254	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*51.0%*			*38.8 - 139 %*	"			"	
2-FBP		*54.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*81.0%*			*31.7 - 179 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1-Methylnapthalene	EPA 8270 mod.	**1.56**	----	0.00466	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 06:20	
2-Methylnaphthalene	"	**1.52**	----	0.00466	"	"	"	"	"	
Acenaphthene	"	**0.270**	----	0.00466	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00466	"	"	"	"	"	
Anthracene	"	**0.206**	----	0.00466	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0202**	----	0.00466	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00777**	----	0.00466	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0155**	----	0.00466	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0104**	----	0.00466	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00466	"	"	"	"	"	
Chrysene	"	**0.0394**	----	0.00466	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00829**	----	0.00466	"	"	"	"	"	
Fluoranthene	"	**0.0233**	----	0.00466	"	"	"	"	"	
Fluorene	"	**0.374**	----	0.00466	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00725**	----	0.00466	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Naphthalene	EPA 8270 mod.	**0.114**	----	0.00466	mg/kg dry	1x	9090042	09/08/09 13:27	09/15/09 06:20	
Phenanthrene	"	**0.664**	----	0.00466	"	"	"	"	"	
Pyrene	"	**0.110**	----	0.00466	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*70.6%*			*38.8 - 139 %*	"			"	
2-FBP		*56.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*96.8%*			*31.7 - 179 %*	"			"	
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
1-Methylnapthalene	EPA 8270 mod.	**10.5**	----	0.0538	mg/kg dry	10x	9090042	09/08/09 13:27	09/15/09 04:55	
2-Methylnaphthalene	"	**14.2**	----	0.0538	"	"	"	"	"	
Acenaphthene	"	**0.959**	----	0.0538	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.0538	"	"	"	"	"	
Anthracene	"	**1.24**	----	0.0538	"	"	"	"	"	
Benzo (a) anthracene	"	**0.144**	----	0.0538	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.0538	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.108**	----	0.0538	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.0538	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0538	"	"	"	"	"	
Chrysene	"	**0.236**	----	0.0538	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.0538	"	"	"	"	"	
Fluoranthene	"	**0.379**	----	0.0538	"	"	"	"	"	
Fluorene	"	**1.39**	----	0.0538	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.0538	"	"	"	"	"	
Naphthalene	"	**1.89**	----	0.0538	"	"	"	"	"	
Phenanthrene	"	**4.21**	----	0.0538	"	"	"	"	"	
Pyrene	"	**1.05**	----	0.0538	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*238%*			*38.8 - 139 %*	"			"	*Z3*
2-FBP		*76.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*112%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					**RL3**
1-Methylnapthalene	EPA 8270 mod.	**0.759**	----	0.0155	mg/kg dry	2x	9090060	09/10/09 09:59	09/15/09 19:34	
2-Methylnaphthalene	"	**0.459**	----	0.0155	"	"	"	"	"	
Acenaphthene	"	**0.111** J	----	0.0155	"	"	"	"	"	**A-01**
Acenaphthylene	"	**0.0186** J	----	0.0155	"	"	"	"	"	**A-01**
Anthracene	"	**0.167** J	----	0.0155	"	"	"	"	"	**A-01**
Benzo (a) anthracene	"	**0.0258**	----	0.0155	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.0155	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0330**	----	0.0155	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0217**	----	0.0155	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.0155	"	"	"	"	"	
Chrysene	"	**0.0733**	----	0.0155	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0165**	----	0.0155	"	"	"	"	"	
Fluoranthene	"	**0.0557** J	----	0.0155	"	"	"	"	"	**A-01**
Fluorene	"	**0.184** J	----	0.0155	"	"	"	"	"	**A-01**
Indeno (1,2,3-cd) pyrene	"	**0.0155**	----	0.0155	"	"	"	"	"	
Naphthalene	"	**0.109**	----	0.0155	"	"	"	"	"	
Phenanthrene	"	**0.277** J	----	0.0155	"	"	"	"	"	**A-01**
Pyrene	"	**0.275**	----	0.0155	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*84.8%*			*38.8 - 139 %*	"		"		
2-FBP		*29.6%*			*40 - 132 %*	"		"		*A-01, Z3*
p-Terphenyl-d14		*104%*			*31.7 - 179 %*	"		"		
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:31	
2-Methylnaphthalene	"	ND	----	0.00500	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00500	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00500	"	"	"	"	"	
Anthracene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00953**	----	0.00500	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00500	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00500	"	"	"	"	"	
Chrysene	"	ND	----	0.00500	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00500	"	"	"	"	"	
Fluoranthene	"	**0.00524**	----	0.00500	"	"	"	"	"	
Fluorene	"	ND	----	0.00500	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00500	"	"	"	"	"	
Naphthalene	"	ND	----	0.00500	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Phenanthrene	EPA 8270 mod.	ND	----	0.00500	mg/kg dry	1x	9090042	09/08/09 13:27	09/14/09 22:31	
Pyrene	"	**0.00905**	----	0.00500	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*63.8%*			*38.8 - 139 %*	"			"	
2-FBP		*69.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*90.6%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
PCB-1016	EPA 8082	ND	----	9.81	ug/kg dry	1x	9090048	09/09/09 09:20	09/17/09 08:02	
PCB-1221	"	ND	----	9.81	"	"	"	"	"	
PCB-1232	"	ND	----	9.81	"	"	"	"	"	
PCB-1242	"	ND	----	9.81	"	"	"	"	"	
PCB-1248	"	ND	----	9.81	"	"	"	"	"	
PCB-1254	"	ND	----	9.81	"	"	"	"	"	
PCB-1260	"	ND	----	9.81	"	"	"	"	"	
Surrogate(s): *TCX*		*58.2%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*41.9%*			*35 - 157 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
PCB-1016	EPA 8082	ND	----	9.60	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:07	
PCB-1221	"	ND	----	9.60	"	"	"	"	09/15/09 01:45	
PCB-1232	"	ND	----	9.60	"	"	"	"	"	
PCB-1242	"	ND	----	9.60	"	"	"	"	"	
PCB-1248	"	ND	----	9.60	"	"	"	"	"	
PCB-1254	"	ND	----	9.60	"	"	"	"	"	
PCB-1260	"	ND	----	9.60	"	"	"	"	09/15/09 02:07	
Surrogate(s): *TCX*		*78.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*18.9%*			*35 - 157 %*	"			"	Z
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
PCB-1016	EPA 8082	ND	----	9.91	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:07	
PCB-1221	"	ND	----	9.91	"	"	"	"	"	
PCB-1232	"	ND	----	9.91	"	"	"	"	"	
PCB-1242	"	ND	----	9.91	"	"	"	"	"	
PCB-1248	"	ND	----	9.91	"	"	"	"	"	
PCB-1254	"	ND	----	9.91	"	"	"	"	"	
PCB-1260	"	ND	----	9.91	"	"	"	"	"	
Surrogate(s): *TCX*		*83.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*60.0%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
PCB-1016	EPA 8082	ND	----	9.96	ug/kg dry	1x	9090048	09/09/09 09:20	09/15/09 02:52	
PCB-1221	"	ND	----	9.96	"	"	"	"	09/15/09 02:30	
PCB-1232	"	ND	----	9.96	"	"	"	"	"	
PCB-1242	"	ND	----	9.96	"	"	"	"	"	
PCB-1248	"	ND	----	9.96	"	"	"	"	"	
PCB-1254	"	ND	----	9.96	"	"	"	"	"	
PCB-1260	"	ND	----	9.96	"	"	"	"	09/15/09 02:52	
Surrogate(s): TCX		*46.8%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*31.4%*			*35 - 157 %*	"			"	Z
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
PCB-1016	EPA 8082	ND UJ	----	9.83	ug/kg dry	1x	9090048	09/09/09 09:20	09/16/09 13:15	
PCB-1221	"	ND	----	9.83	"	"	"	"	"	
PCB-1232	"	ND	----	9.83	"	"	"	"	"	
PCB-1242	"	ND	----	9.83	"	"	"	"	"	
PCB-1248	"	ND	----	9.83	"	"	"	"	"	
PCB-1254	"	ND	----	9.83	"	"	"	"	"	
PCB-1260	"	ND UJ	----	9.83	"	"	"	"	09/16/09 13:38	
Surrogate(s): TCX		*71.3%*			*27.9 - 154 %*	"			*09/16/09 13:15*	
Decachlorobiphenyl		*73.3%*			*35 - 157 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
PCB-1016	EPA 8082	ND	----	9.70	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 20:23	
PCB-1221	"	ND	----	9.70	"	"	"	"	"	
PCB-1232	"	ND	----	9.70	"	"	"	"	"	
PCB-1242	"	ND	----	9.70	"	"	"	"	"	
PCB-1248	"	ND	----	9.70	"	"	"	"	"	
PCB-1254	"	ND	----	9.70	"	"	"	"	"	
PCB-1260	"	**18.5**	----	9.70	"	"	"	"	"	
Surrogate(s): TCX		*103%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*101%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
PCB-1016	EPA 8082	ND	----	9.85	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 20:46	
PCB-1221	"	ND	----	9.85	"	"	"	"	"	
PCB-1232	"	ND	----	9.85	"	"	"	"	"	
PCB-1242	"	ND	----	9.85	"	"	"	"	"	
PCB-1248	"	ND	----	9.85	"	"	"	"	"	
PCB-1254	"	ND	----	9.85	"	"	"	"	"	
PCB-1260	"	ND	----	9.85	"	"	"	"	"	
Surrogate(s): TCX		*81.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*87.4%*			*35 - 157 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
PCB-1016	EPA 8082	ND	----	9.84	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:08	
PCB-1221	"	ND	----	9.84	"	"	"	"	"	
PCB-1232	"	ND	----	9.84	"	"	"	"	"	
PCB-1242	"	ND	----	9.84	"	"	"	"	"	
PCB-1248	"	ND	----	9.84	"	"	"	"	"	
PCB-1254	"	ND	----	9.84	"	"	"	"	"	
PCB-1260	"	ND	----	9.84	"	"	"	"	"	
Surrogate(s): TCX		*26.7%*			*27.9 - 154 %*	"			"	*Z*
Decachlorobiphenyl		*23.3%*			*35 - 157 %*	"			"	*Z*
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
PCB-1016	EPA 8082	ND	----	12.4	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:31	
PCB-1221	"	ND	----	12.4	"	"	"	"	"	
PCB-1232	"	ND	----	12.4	"	"	"	"	"	
PCB-1242	"	ND	----	12.4	"	"	"	"	"	
PCB-1248	"	ND	----	12.4	"	"	"	"	"	
PCB-1254	"	ND	----	12.4	"	"	"	"	"	
PCB-1260	"	ND	----	12.4	"	"	"	"	"	
Surrogate(s): TCX		*68.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*61.3%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
PCB-1016	EPA 8082	ND	----	9.42	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 21:54	
PCB-1221	"	ND	----	9.42	"	"	"	"	"	
PCB-1232	"	ND	----	9.42	"	"	"	"	"	
PCB-1242	"	ND	----	9.42	"	"	"	"	"	
PCB-1248	"	ND	----	9.42	"	"	"	"	"	
PCB-1254	"	ND	----	9.42	"	"	"	"	"	
PCB-1260	"	ND	----	9.42	"	"	"	"	"	
Surrogate(s): *TCX*		*67.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*29.5%*			*35 - 157 %*	"			"	Z
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
PCB-1016	EPA 8082	ND	----	9.56	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 22:16	
PCB-1221	"	ND	----	9.56	"	"	"	"	"	
PCB-1232	"	ND	----	9.56	"	"	"	"	"	
PCB-1242	"	ND	----	9.56	"	"	"	"	"	
PCB-1248	"	ND	----	9.56	"	"	"	"	"	
PCB-1254	"	ND	----	9.56	"	"	"	"	"	
PCB-1260	"	ND	----	9.56	"	"	"	"	"	
Surrogate(s): *TCX*		*78.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*85.5%*			*35 - 157 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
PCB-1016	EPA 8082	ND	----	9.88	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 22:39	
PCB-1221	"	ND	----	9.88	"	"	"	"	"	
PCB-1232	"	ND	----	9.88	"	"	"	"	"	
PCB-1242	"	ND	----	9.88	"	"	"	"	"	
PCB-1248	"	ND	----	9.88	"	"	"	"	"	
PCB-1254	"	ND	----	9.88	"	"	"	"	"	
PCB-1260	"	ND	----	9.88	"	"	"	"	"	
Surrogate(s): *TCX*		*48.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*39.8%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
PCB-1016	EPA 8082	ND	----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:01	
PCB-1221	"	ND	----	9.69	"	"	"	"	"	
PCB-1232	"	ND	----	9.69	"	"	"	"	"	
PCB-1242	"	ND	----	9.69	"	"	"	"	"	
PCB-1248	"	ND	----	9.69	"	"	"	"	"	
PCB-1254	"	ND	----	9.69	"	"	"	"	"	
PCB-1260	"	ND	----	9.69	"	"	"	"	"	
Surrogate(s): TCX		*91.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*79.5%*			*35 - 157 %*	"			"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
PCB-1016	EPA 8082	ND	----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:23	
PCB-1221	"	ND	----	9.63	"	"	"	"	"	
PCB-1232	"	ND	----	9.63	"	"	"	"	"	
PCB-1242	"	ND	----	9.63	"	"	"	"	"	
PCB-1248	"	ND	----	9.63	"	"	"	"	"	
PCB-1254	"	ND	----	9.63	"	"	"	"	"	
PCB-1260	"	ND	----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*85.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*86.1%*			*35 - 157 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
PCB-1016	EPA 8082	ND	----	9.93	ug/kg dry	1x	9090086	09/14/09 07:36	09/16/09 23:46	
PCB-1221	"	ND	----	9.93	"	"	"	"	"	
PCB-1232	"	ND	----	9.93	"	"	"	"	"	
PCB-1242	"	ND	----	9.93	"	"	"	"	"	
PCB-1248	"	ND	----	9.93	"	"	"	"	"	
PCB-1254	"	ND	----	9.93	"	"	"	"	"	
PCB-1260	"	ND	----	9.93	"	"	"	"	"	
Surrogate(s): TCX		*97.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*98.7%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
PCB-1016	EPA 8082	ND	----	9.89	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 09:56	
PCB-1221	"	ND	----	9.89	"	"	"	"	"	
PCB-1232	"	ND	----	9.89	"	"	"	"	"	
PCB-1242	"	ND	----	9.89	"	"	"	"	"	
PCB-1248	"	ND	----	9.89	"	"	"	"	"	
PCB-1254	"	ND	----	9.89	"	"	"	"	"	
PCB-1260	"	**22.3**	----	9.89	"	"	"	"	"	
Surrogate(s): TCX		*67.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*124%*			*35 - 157 %*	"			"	
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
PCB-1016	EPA 8082	ND	----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 10:18	
PCB-1221	"	ND	----	9.69	"	"	"	"	"	
PCB-1232	"	ND	----	9.69	"	"	"	"	"	
PCB-1242	"	ND	----	9.69	"	"	"	"	"	
PCB-1248	"	ND	----	9.69	"	"	"	"	"	
PCB-1254	"	ND	----	9.69	"	"	"	"	"	
PCB-1260	"	ND	----	9.69	"	"	"	"	"	
Surrogate(s): TCX		*85.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*75.4%*			*35 - 157 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
PCB-1016	EPA 8082	ND	----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 10:41	
PCB-1221	"	ND	----	9.63	"	"	"	"	"	
PCB-1232	"	ND	----	9.63	"	"	"	"	"	
PCB-1242	"	ND	----	9.63	"	"	"	"	"	
PCB-1248	"	ND	----	9.63	"	"	"	"	"	
PCB-1254	"	ND	----	9.63	"	"	"	"	"	
PCB-1260	"	ND	----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*70.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*70.4%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
PCB-1016	EPA 8082	ND	----	9.63	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 13:35	
PCB-1221	"	ND	----	9.63	"	"	"	"	"	
PCB-1232	"	ND	----	9.63	"	"	"	"	"	
PCB-1242	"	ND	----	9.63	"	"	"	"	"	
PCB-1248	"	ND	----	9.63	"	"	"	"	"	
PCB-1254	"	ND	----	9.63	"	"	"	"	"	
PCB-1260	"	ND	----	9.63	"	"	"	"	"	
Surrogate(s): TCX		*55.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*28.1%*			*35 - 157 %*	"			"	Z
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
PCB-1016	EPA 8082	ND	----	9.59	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 13:58	
PCB-1221	"	ND	----	9.59	"	"	"	"	"	
PCB-1232	"	ND	----	9.59	"	"	"	"	"	
PCB-1242	"	ND	----	9.59	"	"	"	"	"	
PCB-1248	"	ND	----	9.59	"	"	"	"	"	
PCB-1254	"	ND	----	9.59	"	"	"	"	"	
PCB-1260	"	ND	----	9.59	"	"	"	"	"	
Surrogate(s): TCX		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*50.9%*			*35 - 157 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
PCB-1016	EPA 8082	ND	----	9.79	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 14:21	
PCB-1221	"	ND	----	9.79	"	"	"	"	"	
PCB-1232	"	ND	----	9.79	"	"	"	"	"	
PCB-1242	"	ND	----	9.79	"	"	"	"	"	
PCB-1248	"	ND	----	9.79	"	"	"	"	"	
PCB-1254	"	ND	----	9.79	"	"	"	"	"	
PCB-1260	"	**12.8**	----	9.79	"	"	"	"	"	
Surrogate(s): TCX		*78.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*42.5%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
PCB-1016	EPA 8082	ND	----	9.69	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 16:13	
PCB-1221	"	ND	----	9.69	"	"	"	"	09/17/09 15:51	
PCB-1232	"	ND	----	9.69	"	"	"	"	"	
PCB-1242	"	ND	----	9.69	"	"	"	"	"	
PCB-1248	"	ND	----	9.69	"	"	"	"	"	
PCB-1254	"	ND	----	9.69	"	"	"	"	"	
PCB-1260	"	ND	----	9.69	"	"	"	"	09/17/09 16:13	
Surrogate(s): TCX		*68.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*18.2%*			*35 - 157 %*	"			"	*Z*
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
PCB-1016	EPA 8082	ND	----	9.76	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 16:36	
PCB-1221	"	ND	----	9.76	"	"	"	"	09/17/09 16:13	
PCB-1232	"	ND	----	9.76	"	"	"	"	"	
PCB-1242	"	ND	----	9.76	"	"	"	"	"	
PCB-1248	"	ND	----	9.76	"	"	"	"	"	
PCB-1254	"	ND	----	9.76	"	"	"	"	"	
PCB-1260	"	**26.5**	----	9.76	"	"	"	"	09/17/09 16:36	
Surrogate(s): TCX		*126%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*10.5%*			*35 - 157 %*	"			"	*Z*
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
PCB-1016	EPA 8082	ND	----	9.86	ug/kg dry	1x	9090086	09/14/09 07:36	09/17/09 14:43	
PCB-1221	"	ND	----	9.86	"	"	"	"	"	
PCB-1232	"	ND	----	9.86	"	"	"	"	"	
PCB-1242	"	ND	----	9.86	"	"	"	"	"	
PCB-1248	"	ND	----	9.86	"	"	"	"	"	
PCB-1254	"	ND	----	9.86	"	"	"	"	"	
PCB-1260	"	ND	----	9.86	"	"	"	"	"	
Surrogate(s): TCX		*78.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*68.4%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.13*	1.4	mg/Kg dry	10x	50040	09/10/09 17:24	09/14/09 18:22	
Phenol	"	ND	*0.10*	1.4	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.10*	1.4	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.076*	2.7	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.097*	0.68	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.13*	1.4	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.043*	0.68	"	"	"	"	"	
Hexachloroethane	"	ND	*0.15*	1.4	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.13*	1.4	"	"	"	"	"	
Dibenzofuran	"	**0.56** J	*0.020*	1.4	"	"	"	"	"	J
Nitrobenzene	"	ND	*0.39*	1.4	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.087*	0.68	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.034*	1.4	"	"	"	"	"	
Isophorone	"	ND	*0.055*	1.4	"	"	"	"	"	
2-Methylphenol	"	ND	*0.096*	1.4	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.058*	1.4	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.20*	1.4	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.028*	1.4	"	"	"	"	"	
Benzoic acid	"	ND	*8.8*	34	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.096*	1.4	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.041*	1.4	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.041*	1.4	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.031*	0.27	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.16*	0.68	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.035*	1.4	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.054*	2.0	"	"	"	"	"	
Fluoranthene	"	**1.0**	*0.016*	0.27	"	"	"	"	"	
Naphthalene	"	ND	*0.030*	0.27	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.058*	1.4	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.15*	1.4	"	"	"	"	"	
Pyrene	"	**1.5**	*0.019*	0.27	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.024*	0.27	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.42*	1.4	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.12*	0.68	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.057*	1.4	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.057*	1.4	"	"	"	"	"	
Acenaphthylene	"	ND	*0.022*	0.27	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.055*	1.4	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
3-Nitroaniline	8270C STD Dry	ND	*0.078*	1.4	mg/Kg dry	10x	50040	09/10/09 17:24	09/14/09 18:22	
4-Chlorophenyl phenyl ether	"	ND	*0.077*	1.4	"	"	"	"	"	
Acenaphthene	"	**1.6**	*0.022*	0.27	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.19*	14	"	"	"	"	"	
Fluorene	"	**4.5**	*0.016*	0.27	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.19*	1.4	"	"	"	"	"	
4-Nitrophenol	"	ND	*2.3*	14	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.24*	14	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.030*	0.68	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.045*	1.4	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.051*	0.68	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.16*	1.4	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.11*	2.7	"	"	"	"	"	
Phenanthrene	"	ND	*0.028*	0.27	"	"	"	"	"	
Anthracene	"	ND	*0.019*	0.27	"	"	"	"	"	
Benzo[a]anthracene	"	**0.36**	*0.023*	0.34	"	"	"	"	"	
Chrysene	"	**1.9**	*0.019*	0.34	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.35*	2.7	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.57*	20	"	"	"	"	"	
Di-n-octyl phthalate	"	~~0.80~~	*0.018*	2.7 U	"	"	"	"	"	J, B
Benzo[a]pyrene	"	**0.59**	*0.028*	0.41	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.057*	0.54	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.030*	0.54	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.020*	0.34	"	"	"	"	"	
Carbazole	"	ND UJ	*0.058*	2.0	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.024*	0.41	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.055*	0.27	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.018*	0.34	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.091*	2.0	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*0%*	*36 - 145 %*	"	"	X
	Phenol-d5	*0%*	*38 - 149 %*	"	"	X
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	X
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	X
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	X
	Terphenyl-d14	*0%*	*42 - 151 %*	"	"	X

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.11*	1.1	mg/Kg dry	10x	50040	09/10/09 17:24	09/14/09 18:42	
Phenol	"	ND	*0.079*	1.1	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.079*	1.1	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.060*	2.1	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.077*	0.54	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.10*	1.1	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.034*	0.54	"	"	"	"	"	
Hexachloroethane	"	ND	*0.12*	1.1	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.10*	1.1	"	"	"	"	"	
Dibenzofuran	"	ND	*0.016*	1.1	"	"	"	"	"	
Nitrobenzene	"	ND	*0.31*	1.1	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.069*	0.54	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.027*	1.1	"	"	"	"	"	
Isophorone	"	ND	*0.044*	1.1	"	"	"	"	"	
2-Methylphenol	"	ND	*0.076*	1.1	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.046*	1.1	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.16*	1.1	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.023*	1.1	"	"	"	"	"	
Benzoic acid	"	ND	*7.0*	27	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.076*	1.1	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.032*	1.1	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.032*	1.1	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.025*	0.21	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.13*	0.54	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.028*	1.1	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.043*	1.6	"	"	"	"	"	
Fluoranthene	"	**0.13** J	*0.013*	0.21	"	"	"	"	"	J
Naphthalene	"	ND	*0.024*	0.21	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.046*	1.1	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.12*	1.1	"	"	"	"	"	
Pyrene	"	**0.19** J	*0.015*	0.21	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.019*	0.21	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.33*	1.1	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.098*	0.54	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.045*	1.1	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.045*	1.1	"	"	"	"	"	
Acenaphthylene	"	ND	*0.017*	0.21	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.044*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02 (GTP1-13.5-082709)		**Soil**				**Sampled: 08/27/09 10:10**				
3-Nitroaniline	8270C STD Dry	ND	*0.062*	1.1	mg/Kg dry	10x	50040	09/10/09 17:24	09/14/09 18:42	
4-Chlorophenyl phenyl ether	"	ND	*0.061*	1.1	"	"	"	"	"	
Acenaphthene	"	ND	*0.017*	0.21	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.15*	11	"	"	"	"	"	
Fluorene	"	**0.38**	*0.013*	0.21	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.15*	1.1	"	"	"	"	"	
4-Nitrophenol	"	ND	*1.8*	11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.19*	11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.024*	0.54	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.035*	1.1	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.041*	0.54	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.13*	1.1	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.085*	2.1	"	"	"	"	"	
Phenanthrene	"	ND	*0.023*	0.21	"	"	"	"	"	
Anthracene	"	ND	*0.015*	0.21	"	"	"	"	"	
Benzo[a]anthracene	"	**0.062** J	*0.018*	0.27	"	"	"	"	"	J
Chrysene	"	**0.34**	*0.015*	0.27	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.28*	2.1	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.45*	16	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.014*	2.1	"	"	"	"	"	
Benzo[a]pyrene	"	**0.057** J	*0.023*	0.32	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.045*	0.43	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.024*	0.43	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.016*	0.27	"	"	"	"	"	
Carbazole	"	ND UJ	*0.046*	1.6	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.019*	0.32	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.044*	0.21	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.014*	0.27	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.072*	1.6	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*0%*	*36 - 145 %*	"	"	X
	Phenol-d5	*0%*	*38 - 149 %*	"	"	X
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	X
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	X
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	X
	Terphenyl-d14	*0%*	*42 - 151 %*	"	"	X

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0022*	0.022	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 19:03	
Phenol	"	ND	*0.0016*	0.022	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0016*	0.022	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0012*	0.044	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0016*	0.011	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0021*	0.022	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00070*	0.011	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0024*	0.022	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0021*	0.022	"	"	"	"	"	
Dibenzofuran	"	**0.00085**	*0.00033*	0.022	"	"	"	"	"	J
Nitrobenzene	"	ND	*0.0063*	0.022	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0014*	0.011	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00055*	0.022	"	"	"	"	"	
Isophorone	"	ND	*0.00089*	0.022	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0015*	0.022	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00094*	0.022	"	"	"	"	"	
Diethyl phthalate	"	~~0.0036~~	*0.0033*	0.022 U	"	"	"	"	"	J, B
2,4-Dimethylphenol	"	ND	*0.00046*	0.022	"	"	"	"	"	
Benzoic acid	"	ND	*0.14*	0.55	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0015*	0.022	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00065*	0.022	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00065*	0.022	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0023**	*0.00050*	0.0044	"	"	"	"	"	J
1,2,4-Trichlorobenzene	"	ND	*0.0026*	0.011	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00057*	0.022	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00087*	0.033	"	"	"	"	"	
Fluoranthene	"	**0.015**	*0.00026*	0.0044	"	"	"	"	"	
Naphthalene	"	**0.0012**	*0.00048*	0.0044	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00094*	0.022	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0024*	0.022	"	"	"	"	"	
Pyrene	"	**0.013**	*0.00031*	0.0044	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00039*	0.0044	"	"	"	"	"	
Butyl benzyl phthalate	"	**0.014**	*0.0068*	0.022	"	"	"	"	"	J
Hexachlorobutadiene	"	ND	*0.0020*	0.011	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00092*	0.022	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00092*	0.022	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00035*	0.0044	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00089*	0.022	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
3-Nitroaniline	8270C STD Dry	ND	*0.0013*	0.022	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 19:03	
4-Chlorophenyl phenyl ether	"	ND	*0.0012*	0.022	"	"	"	"	"	
Acenaphthene	"	**0.00082**	*0.00035*	0.0044	"	"	"	"	"	J
2,4-Dinitrophenol	"	ND	*0.0031*	0.22	"	"	"	"	"	
Fluorene	"	**0.0014**	*0.00026*	0.0044	"	"	"	"	"	J
4-Nitroaniline	"	ND	*0.0031*	0.022	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.037*	0.22	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0039*	0.22	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00048*	0.011	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00072*	0.022	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00083*	0.011	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0026*	0.022	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0017*	0.044	"	"	"	"	"	
Phenanthrene	"	**0.0092**	*0.00046*	0.0044	"	"	"	"	"	
Anthracene	"	**0.0016**	*0.00031*	0.0044	"	"	"	"	"	J
Benzo[a]anthracene	"	**0.0073**	*0.00037*	0.0055	"	"	"	"	"	
Chrysene	"	**0.010**	*0.00031*	0.0055	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0080~~	*0.0057*	0.044 UL	"	"	"	"	"	J-13
Bis(2-ethylhexyl) phthalate	"	0.12	*0.0092*	0.33	"	"	"	"	"	J
Di-n-octyl phthalate	"	ND	*0.00028*	0.044	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0065**	*0.00046*	0.0065	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.0041**	*0.00092*	0.0087	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	**0.0014**	*0.00048*	0.0087	"	"	"	"	"	J
Benzo[g,h,i]perylene	"	**0.0066**	*0.00033*	0.0055	"	"	"	"	"	
Carbazole	"	**0.0015** J	*0.00094*	0.033	"	"	"	"	"	J, *
1-Methylnaphthalene	"	**0.0010**	*0.00039*	0.0065	"	"	"	"	"	J
Benzo[b]fluoranthene	"	**0.0099**	*0.00089*	0.0044	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.0028**	*0.00028*	0.0055	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.0015*	0.033	"	"	"	"	"	

Surrogate(s):					
2-Fluorophenol	*84%*	*36 - 145 %*	"	"	
Phenol-d5	*71%*	*38 - 149 %*	"	"	
Nitrobenzene-d5	*84%*	*38 - 141 %*	"	"	
2-Fluorobiphenyl	*79%*	*42 - 140 %*	"	"	
2,4,6-Tribromophenol	*94%*	*28 - 143 %*	"	"	
Terphenyl-d14	*82%*	*42 - 151 %*	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0027*	0.027	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 19:23	
Phenol	"	ND	*0.0020*	0.027	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0020*	0.027	"	"	"	"	"	
3 & 4 Methylphenol	"	**0.066**	*0.0015*	0.055	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0020*	0.014	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0026*	0.027	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00087*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0030*	0.027	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0026*	0.027	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00041*	0.027	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0079*	0.027	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0017*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00068*	0.027	"	"	"	"	"	
Isophorone	"	ND	*0.0011*	0.027	"	"	"	"	"	
2-Methylphenol	"	**0.0050**	*0.0019*	0.027	"	"	"	"	"	J
2-Nitrophenol	"	ND	*0.0012*	0.027	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.0041*	0.027	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00057*	0.027	"	"	"	"	"	
Benzoic acid	"	ND	*0.18*	0.68	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0019*	0.027	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00082*	0.027	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00082*	0.027	"	"	"	"	"	
2-Methylnaphthalene	"	**0.013**	*0.00063*	0.0055	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0033*	0.014	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00071*	0.027	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0011*	0.041	"	"	"	"	"	
Fluoranthene	"	**0.077**	*0.00033*	0.0055	"	"	"	"	"	
Naphthalene	"	**0.0065**	*0.00060*	0.0055	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0012*	0.027	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0030*	0.027	"	"	"	"	"	
Pyrene	"	**0.094**	*0.00038*	0.0055	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00049*	0.0055	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0085*	0.027	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0025*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0011*	0.027	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0011*	0.027	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00044*	0.0055	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0011*	0.027	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
3-Nitroaniline	8270C STD Dry	ND	*0.0016*	0.027	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 19:23	
4-Chlorophenyl phenyl ether	"	ND	*0.0016*	0.027	"	"	"	"	"	
Acenaphthene	"	ND	*0.00044*	0.0055	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0038*	0.27	"	"	"	"	"	
Fluorene	"	**0.012**	*0.00033*	0.0055	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0038*	0.027	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.046*	0.27	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0049*	0.27	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00060*	0.014	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00090*	0.027	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0010*	0.014	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0033*	0.027	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0022*	0.055	"	"	"	"	"	
Phenanthrene	"	**0.083**	*0.00057*	0.0055	"	"	"	"	"	
Anthracene	"	ND	*0.00038*	0.0055	"	"	"	"	"	
Benzo[a]anthracene	"	**0.049**	*0.00046*	0.0068	"	"	"	"	"	
Chrysene	"	**0.10**	*0.00038*	0.0068	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.0071*	0.055	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	**0.30**	*0.011*	0.41	"	"	"	"	"	J
Di-n-octyl phthalate	"	ND	*0.00035*	0.055	"	"	"	"	"	
Benzo[a]pyrene	"	**0.037**	*0.00057*	0.0082	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.018**	*0.0011*	0.011	"	"	"	"	"	
Dibenz(a,h)anthracene	"	**0.0081**	*0.00060*	0.011	"	"	"	"	"	J
Benzo[g,h,i]perylene	"	**0.021**	*0.00041*	0.0068	"	"	"	"	"	
Carbazole	"	ND UJ	*0.0012*	0.041	"	"	"	"	"	*
1-Methylnaphthalene	"	**0.012**	*0.00049*	0.0082	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.054**	*0.0011*	0.0055	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.011**	*0.00035*	0.0068	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0018*	0.041	"	"	"	"	"	

Surrogate(s):					
2-Fluorophenol	*88%*	*36 - 145 %*	"		"
Phenol-d5	*75%*	*38 - 149 %*	"		"
Nitrobenzene-d5	*82%*	*38 - 141 %*	"		"
2-Fluorobiphenyl	*70%*	*42 - 140 %*	"		"
2,4,6-Tribromophenol	*99%*	*28 - 143 %*	"		"
Terphenyl-d14	*91%*	*42 - 151 %*	"		"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0026*	0.026	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 20:25	
Phenol	"	ND	*0.0019*	0.026	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0019*	0.026	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0015*	0.052	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0019*	0.013	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0025*	0.026	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00083*	0.013	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0029*	0.026	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0025*	0.026	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00039*	0.026	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0075*	0.026	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0017*	0.013	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00065*	0.026	"	"	"	"	"	
Isophorone	"	ND	*0.0011*	0.026	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0018*	0.026	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0011*	0.026	"	"	"	"	"	
Diethyl phthalate	"	~~0.0069~~	*0.0039*	0.026 U	"	"	"	"	"	J, B
2,4-Dimethylphenol	"	ND	*0.00055*	0.026	"	"	"	"	"	
Benzoic acid	"	ND	*0.17*	0.65	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0018*	0.026	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00078*	0.026	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00078*	0.026	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00060*	0.0052	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0031*	0.013	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00068*	0.026	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0010*	0.039	"	"	"	"	"	
Fluoranthene	"	**0.0021**	*0.00031*	0.0052	"	"	"	"	"	J
Naphthalene	"	ND	*0.00057*	0.0052	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0011*	0.026	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0029*	0.026	"	"	"	"	"	
Pyrene	"	**0.0046**	*0.00036*	0.0052	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.00047*	0.0052	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0081*	0.026	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0024*	0.013	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0011*	0.026	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0011*	0.026	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00042*	0.0052	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0011*	0.026	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
3-Nitroaniline	8270C STD Dry	ND	*0.0015*	0.026	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 20:25	
4-Chlorophenyl phenyl ether	"	ND	*0.0015*	0.026	"	"	"	"	"	
Acenaphthene	"	ND	*0.00042*	0.0052	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0036*	0.26	"	"	"	"	"	
Fluorene	"	ND	*0.00031*	0.0052	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0036*	0.026	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.044*	0.26	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0047*	0.26	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00057*	0.013	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00086*	0.026	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00099*	0.013	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0031*	0.026	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0021*	0.052	"	"	"	"	"	
Phenanthrene	"	ND	*0.00055*	0.0052	"	"	"	"	"	
Anthracene	"	ND	*0.00036*	0.0052	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00044*	0.0065	"	"	"	"	"	
Chrysene	"	**0.012**	*0.00036*	0.0065	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0091~~	*0.0068*	0.052 U	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.011*	0.39	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00034*	0.052	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.00055*	0.0078	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0011*	0.010	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00057*	0.010	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00039*	0.0065	"	"	"	"	"	
Carbazole	"	ND UJ	*0.0011*	0.039	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.00047*	0.0078	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0011*	0.0052	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00034*	0.0065	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0017*	0.039	"	"	"	"	"	
Surrogate(s):	*2-Fluorophenol*		*81%*		*36 - 145 %*	"			"	
	Phenol-d5		*81%*		*38 - 149 %*	"			"	
	Nitrobenzene-d5		*82%*		*38 - 141 %*	"			"	
	2-Fluorobiphenyl		*79%*		*42 - 140 %*	"			"	
	2,4,6-Tribromophenol		*98%*		*28 - 143 %*	"			"	
	Terphenyl-d14		*81%*		*42 - 151 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0021*	0.021	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 20:46	
Phenol	"	ND	*0.0015*	0.021	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0015*	0.021	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0012*	0.042	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0015*	0.010	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0020*	0.021	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00067*	0.010	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0023*	0.021	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0020*	0.021	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00031*	0.021	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0061*	0.021	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0013*	0.010	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00052*	0.021	"	"	"	"	"	
Isophorone	"	ND	*0.00086*	0.021	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0015*	0.021	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00090*	0.021	"	"	"	"	"	
Diethyl phthalate	"	~~0.0036~~	*0.0031*	0.021	"	"	"	"	"	~~J~~
2,4-Dimethylphenol	"	ND	*0.00044*	0.021	"	"	"	"	"	
Benzoic acid	"	**0.15**	*0.14*	0.52	"	"	"	"	"	J
4-Chloro-3-methylphenol	"	ND	*0.0015*	0.021	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00063*	0.021	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00063*	0.021	"	"	"	"	"	
2-Methylnaphthalene	"	**0.015**	*0.00048*	0.0042	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0025*	0.010	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00054*	0.021	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00084*	0.031	"	"	"	"	"	
Fluoranthene	"	**0.0082**	*0.00025*	0.0042	"	"	"	"	"	
Naphthalene	"	**0.0076**	*0.00046*	0.0042	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00090*	0.021	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0023*	0.021	"	"	"	"	"	
Pyrene	"	**0.0099**	*0.00029*	0.0042	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00038*	0.0042	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0065*	0.021	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0019*	0.010	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00088*	0.021	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00088*	0.021	"	"	"	"	"	
Acenaphthylene	"	**0.0025**	*0.00033*	0.0042	"	"	"	"	"	J
2,6-Dinitrotoluene	"	ND	*0.00086*	0.021	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
3-Nitroaniline	8270C STD Dry	ND	*0.0012*	0.021	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 20:46	
4-Chlorophenyl phenyl ether	"	ND	*0.0012*	0.021	"	"	"	"	"	
Acenaphthene	"	ND	*0.00033*	0.0042	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0029*	0.21	"	"	"	"	"	
Fluorene	"	ND	*0.00025*	0.0042	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0029*	0.021	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.036*	0.21	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0038*	0.21	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00046*	0.010	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00069*	0.021	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00079*	0.010	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0025*	0.021	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0017*	0.042	"	"	"	"	"	
Phenanthrene	"	**0.0064**	*0.00044*	0.0042	"	"	"	"	"	
Anthracene	"	**0.0031**	*0.00029*	0.0042	"	"	"	"	"	J
Benzo[a]anthracene	"	**0.0055**	*0.00036*	0.0052	"	"	"	"	"	
Chrysene	"	**0.0081**	*0.00029*	0.0052	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.010**	*0.0054*	0.042	"	"	"	"	"	J, B
Bis(2-ethylhexyl) phthalate	"	ND	*0.0088*	0.31	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00027*	0.042	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0071**	*0.00044*	0.0063	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0073**	*0.00088*	0.0084	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00046*	0.0084	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.016**	*0.00031*	0.0052	"	"	"	"	"	
Carbazole	"	**0.0018**	*0.00090*	0.031	"	"	"	"	"	J, *
1-Methylnaphthalene	"	**0.0086**	*0.00038*	0.0063	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0099**	*0.00086*	0.0042	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.0023**	*0.00027*	0.0052	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.0014*	0.031	"	"	"	"	"	
Surrogate(s):	*2-Fluorophenol*		*63%*		*36 - 145 %*	"		"		
	Phenol-d5		*70%*		*38 - 149 %*	"		"		
	Nitrobenzene-d5		*85%*		*38 - 141 %*	"		"		
	2-Fluorobiphenyl		*78%*		*42 - 140 %*	"		"		
	2,4,6-Tribromophenol		*101%*		*28 - 143 %*	"		"		
	Terphenyl-d14		*87%*		*42 - 151 %*	"		"		

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		Soil			Sampled: 08/27/09 15:59					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:06	
Phenol	"	ND	*0.00084*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00084*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00064*	0.023	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00082*	0.0057	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0011*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00036*	0.0057	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00017*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0033*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00073*	0.0057	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00028*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00047*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00081*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00049*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0020~~	*0.0017*	0.011 U	"	"	"	"	"	~~J~~
2,4-Dimethylphenol	"	ND	*0.00024*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.074*	0.28	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00081*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00034*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00034*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00031**	*0.00026*	0.0023	"	"	"	"	"	J
1,2,4-Trichlorobenzene	"	ND	*0.0014*	0.0057	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00029*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00045*	0.017	"	"	"	"	"	
Fluoranthene	"	ND	*0.00014*	0.0023	"	"	"	"	"	
Naphthalene	"	**0.00027**	*0.00025*	0.0023	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00049*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	ND	*0.00016*	0.0023	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00020*	0.0023	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0035*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0010*	0.0057	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00048*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00048*	0.011	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00018*	0.0023	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00047*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		Soil			Sampled: 08/27/09 15:59					
3-Nitroaniline	8270C STD Dry	ND	*0.00066*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:06	
4-Chlorophenyl phenyl ether	"	ND	*0.00065*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00018*	0.0023	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0016*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00014*	0.0023	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0016*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.019*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0020*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00025*	0.0057	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00037*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00043*	0.0057	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0014*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00090*	0.023	"	"	"	"	"	
Phenanthrene	"	ND	*0.00024*	0.0023	"	"	"	"	"	
Anthracene	"	ND	*0.00016*	0.0023	"	"	"	"	"	
Benzo[a]anthracene	"	**0.00068**	*0.00019*	0.0028	"	"	"	"	"	J
Chrysene	"	**0.00045**	*0.00016*	0.0028	"	"	"	"	"	J
Di-n-butyl phthalate	"	~~0.0061~~	*0.0029*	0.023 U	"	"	"	"	"	~~J~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0048*	0.17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00015*	0.023	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0013**	*0.00024*	0.0034	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.00060**	*0.00048*	0.0045	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00025*	0.0045	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00017*	0.0028	"	"	"	"	"	
Carbazole	"	ND UJ	*0.00049*	0.017	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.00020*	0.0034	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.00082**	*0.00047*	0.0023	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.00019**	*0.00015*	0.0028	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00076*	0.017	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*71%*	*36 - 145 %*	"	"
	Phenol-d5	*80%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*80%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*80%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*99%*	*28 - 143 %*	"	"
	Terphenyl-d14	*84%*	*42 - 151 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09 (GTP5-3.0-082709)		Soil			Sampled: 08/27/09 16:40					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:27	
Phenol	"	ND	*0.00080*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00080*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00060*	0.022	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00078*	0.0054	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0010*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00034*	0.0054	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0010*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00016*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0031*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00069*	0.0054	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00027*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00044*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00076*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00046*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0023~~	*0.0016*	0.011 U	"	"	"	"	"	J-B
2,4-Dimethylphenol	"	ND	*0.00023*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.070*	0.27	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00076*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00032*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00032*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00025*	0.0022	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0013*	0.0054	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00028*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00043*	0.016	"	"	"	"	"	
Fluoranthene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
Naphthalene	"	ND	*0.00024*	0.0022	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00046*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	ND	*0.00015*	0.0022	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00019*	0.0022	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0033*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00098*	0.0054	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00045*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00045*	0.011	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00017*	0.0022	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00044*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09 (GTP5-3.0-082709)		Soil			Sampled: 08/27/09 16:40					
3-Nitroaniline	8270C STD Dry	ND	*0.00062*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:27	
4-Chlorophenyl phenyl ether	"	ND	*0.00061*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00017*	0.0022	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0015*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0015*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.018*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0019*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00024*	0.0054	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00036*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00041*	0.0054	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0013*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00085*	0.022	"	"	"	"	"	
Phenanthrene	"	ND	*0.00023*	0.0022	"	"	"	"	"	
Anthracene	"	ND	*0.00015*	0.0022	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00018*	0.0027	"	"	"	"	"	
Chrysene	"	ND	*0.00015*	0.0027	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0087~~	*0.0028*	0.022 U	"	"	"	"	"	~~J, B~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0045*	0.16	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00014*	0.022	"	"	"	"	"	
Benzo[a]pyrene	"	**0.00080**	*0.00023*	0.0032	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.00065**	*0.00045*	0.0043	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00024*	0.0043	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.00086**	*0.00016*	0.0027	"	"	"	"	"	J
Carbazole	"	ND UJ	*0.00046*	0.016	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.00019*	0.0032	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.00091**	*0.00044*	0.0022	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.00016**	*0.00014*	0.0027	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00072*	0.016	"	"	"	"	"	

Surrogate(s):				
2-Fluorophenol	*92%*	*36 - 145 %*	"	"
Phenol-d5	*83%*	*38 - 149 %*	"	"
Nitrobenzene-d5	*85%*	*38 - 141 %*	"	"
2-Fluorobiphenyl	*84%*	*42 - 140 %*	"	"
2,4,6-Tribromophenol	*101%*	*28 - 143 %*	"	"
Terphenyl-d14	*87%*	*42 - 151 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		Soil			Sampled: 08/27/09 16:53					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0020*	0.020	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:47	
Phenol	"	ND	*0.0015*	0.020	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0015*	0.020	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0011*	0.041	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0015*	0.010	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0020*	0.020	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00066*	0.010	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0023*	0.020	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0020*	0.020	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00031*	0.020	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0059*	0.020	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0013*	0.010	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00051*	0.020	"	"	"	"	"	
Isophorone	"	ND	*0.00084*	0.020	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0015*	0.020	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00088*	0.020	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.0031*	0.020	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00043*	0.020	"	"	"	"	"	
Benzoic acid	"	ND	*0.13*	0.51	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0015*	0.020	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00061*	0.020	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00061*	0.020	"	"	"	"	"	
2-Methylnaphthalene	"	**0.010**	*0.00047*	0.0041	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0025*	0.010	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00053*	0.020	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00082*	0.031	"	"	"	"	"	
Fluoranthene	"	ND	*0.00025*	0.0041	"	"	"	"	"	
Naphthalene	"	**0.031**	*0.00045*	0.0041	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00088*	0.020	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0023*	0.020	"	"	"	"	"	
Pyrene	"	ND	*0.00029*	0.0041	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00037*	0.0041	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0064*	0.020	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0019*	0.010	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00086*	0.020	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00086*	0.020	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00033*	0.0041	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00084*	0.020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
3-Nitroaniline	8270C STD Dry	ND	*0.0012*	0.020	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 21:47	
4-Chlorophenyl phenyl ether	"	ND	*0.0012*	0.020	"	"	"	"	"	
Acenaphthene	"	ND	*0.00033*	0.0041	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0029*	0.20	"	"	"	"	"	
Fluorene	"	**0.0082**	*0.00025*	0.0041	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0029*	0.020	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.035*	0.20	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0037*	0.20	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00045*	0.010	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00068*	0.020	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00078*	0.010	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0025*	0.020	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0016*	0.041	"	"	"	"	"	
Phenanthrene	"	**0.062**	*0.00043*	0.0041	"	"	"	"	"	
Anthracene	"	ND	*0.00029*	0.0041	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00035*	0.0051	"	"	"	"	"	
Chrysene	"	ND	*0.00029*	0.0051	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.20** J	*0.0053*	0.041	"	"	"	"	"	B
Bis(2-ethylhexyl) phthalate	"	ND	*0.0086*	0.31	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00027*	0.041	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.00043*	0.0061	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00086*	0.0082	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00045*	0.0082	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00031*	0.0051	"	"	"	"	"	
Carbazole	"	ND UJ	*0.00088*	0.031	"	"	"	"	"	*
1-Methylnaphthalene	"	**0.016**	*0.00037*	0.0061	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.00084*	0.0041	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00027*	0.0051	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0014*	0.031	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*91%*	*36 - 145 %*	"	"
	Phenol-d5	*87%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*93%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*78%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*102%*	*28 - 143 %*	"	"
	Terphenyl-d14	*48%*	*42 - 151 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.016*	0.16	mg/Kg dry	10x	50040	09/10/09 17:24	09/15/09 16:24	
Phenol	"	ND	*0.012*	0.16	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.012*	0.16	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0092*	0.33	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.012*	0.082	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.016*	0.16	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0052*	0.082	"	"	"	"	"	
Hexachloroethane	"	ND	*0.018*	0.16	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.016*	0.16	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0025*	0.16	"	"	"	"	"	
Nitrobenzene	"	ND	*0.047*	0.16	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.010*	0.082	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0041*	0.16	"	"	"	"	"	
Isophorone	"	ND	*0.0067*	0.16	"	"	"	"	"	
2-Methylphenol	"	ND	*0.012*	0.16	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0070*	0.16	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.025*	0.16	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0034*	0.16	"	"	"	"	"	
Benzoic acid	"	ND	*1.1*	4.1	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.012*	0.16	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0049*	0.16	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0049*	0.16	"	"	"	"	"	
2-Methylnaphthalene	"	**78**	*0.19*	1.6	"	500x	"	"	09/15/09 20:13	
1,2,4-Trichlorobenzene	"	ND	*0.020*	0.082	"	10x	"	"	09/15/09 16:24	
Hexachlorocyclopentadiene	"	ND	*0.0043*	0.16	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0065*	0.25	"	"	"	"	"	
Fluoranthene	"	**0.15**	*0.0020*	0.033	"	"	"	"	"	
Naphthalene	"	**27**	*0.18*	1.6	"	500x	"	"	09/15/09 20:13	
2,4,5-Trichlorophenol	"	ND	*0.0070*	0.16	"	10x	"	"	09/15/09 16:24	
4-Chloroaniline	"	ND	*0.018*	0.16	"	"	"	"	"	
Pyrene	"	**0.12**	*0.0023*	0.033	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0029*	0.033	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.051*	0.16	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.015*	0.082	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0069*	0.16	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0069*	0.16	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0026*	0.033	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0067*	0.16	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
3-Nitroaniline	8270C STD Dry	ND	*0.0095*	0.16	mg/Kg dry	10x	50040	09/10/09 17:24	09/15/09 16:24	
4-Chlorophenyl phenyl ether	"	ND	*0.0093*	0.16	"	"	"	"	"	
Acenaphthene	"	**1.2**	*0.0026*	0.033	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.023*	1.6	"	"	"	"	"	
Fluorene	"	**2.1**	*0.0020*	0.033	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.023*	0.16	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.28*	1.6	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.029*	1.6	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0036*	0.082	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.0054*	0.16	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0062*	0.082	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.020*	0.16	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.013*	0.33	"	"	"	"	"	
Phenanthrene	"	**2.4**	*0.0034*	0.033	"	"	"	"	"	
Anthracene	"	ND	*0.0023*	0.033	"	"	"	"	"	
Benzo[a]anthracene	"	**0.026**	*0.0028*	0.041	"	"	"	"	"	J
Chrysene	"	**0.047**	*0.0023*	0.041	"	"	"	"	"	
Di-n-butyl phthalate	"	0.12	*0.043*	0.33 U	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.069*	2.5	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0021*	0.33	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0034*	0.049	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0069*	0.065	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0036*	0.065	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0025*	0.041	"	"	"	"	"	
Carbazole	"	ND	*0.0070*	0.25	"	"	"	"	"	*
1-Methylnaphthalene	"	**45**	*0.15*	2.5	"	500x	"	"	09/15/09 20:13	
Benzo[b]fluoranthene	"	ND	*0.0067*	0.033	"	10x	"	"	09/15/09 16:24	
Benzo[k]fluoranthene	"	ND	*0.0021*	0.041	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.011*	0.25	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*0%*	*36 - 145 %*	"	"	*D. X*
	Phenol-d5	*0%*	*38 - 149 %*	"	"	*D. X*
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	*D. X*
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	*D. X*
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	*D. X*
	Terphenyl-d14	*0%*	*42 - 151 %*	"	"	*D. X*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 22:28	
Phenol	"	ND	*0.00082*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00082*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00062*	0.022	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00080*	0.0056	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0011*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00036*	0.0056	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00017*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0032*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00071*	0.0056	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00028*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00046*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00048*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0023~~	*0.0017*	0.011 U	"	"	"	"	"	J, B
2,4-Dimethylphenol	"	ND	*0.00023*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.072*	0.28	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00033*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00033*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0020**	*0.00026*	0.0022	"	"	"	"	"	J
1,2,4-Trichlorobenzene	"	ND	*0.0013*	0.0056	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00029*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00045*	0.017	"	"	"	"	"	
Fluoranthene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
Naphthalene	"	**0.0011**	*0.00024*	0.0022	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00048*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	ND	*0.00016*	0.0022	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0034*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0010*	0.0056	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00047*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00047*	0.011	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00018*	0.0022	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00046*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
3-Nitroaniline	8270C STD Dry	ND	*0.00065*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 22:28	
4-Chlorophenyl phenyl ether	"	ND	*0.00063*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00018*	0.0022	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0016*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0016*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.019*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0020*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00024*	0.0056	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00037*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00042*	0.0056	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0013*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00088*	0.022	"	"	"	"	"	
Phenanthrene	"	ND	*0.00023*	0.0022	"	"	"	"	"	
Anthracene	"	ND	*0.00016*	0.0022	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00019*	0.0028	"	"	"	"	"	
Chrysene	"	ND	*0.00016*	0.0028	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0075~~	*0.0029*	0.022 U	"	"	"	"	"	J-B
Bis(2-ethylhexyl) phthalate	"	ND	*0.0047*	0.17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00014*	0.022	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0016**	*0.00023*	0.0033	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.00070**	*0.00047*	0.0045	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00024*	0.0045	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0011**	*0.00017*	0.0028	"	"	"	"	"	J
Carbazole	"	ND UJ	*0.00048*	0.017	"	"	"	"	"	*
1-Methylnaphthalene	"	**0.0016**	*0.00020*	0.0033	"	"	"	"	"	J
Benzo[b]fluoranthene	"	**0.00098**	*0.00046*	0.0022	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.00038**	*0.00014*	0.0028	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00075*	0.017	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*81%*	*36 - 145 %*	"	"
	Phenol-d5	*78%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*86%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*75%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*98%*	*28 - 143 %*	"	"
	Terphenyl-d14	*84%*	*42 - 151 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0028*	0.028	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 22:49	
Phenol	"	**0.0095**	*0.0021*	0.028	"	"	"	"	"	J
2-Chlorophenol	"	ND	*0.0021*	0.028	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0016*	0.056	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0020*	0.014	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0027*	0.028	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00090*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0031*	0.028	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0027*	0.028	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00042*	0.028	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0081*	0.028	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0018*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00070*	0.028	"	"	"	"	"	
Isophorone	"	ND	*0.0011*	0.028	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0020*	0.028	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0012*	0.028	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.0042*	0.028	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00059*	0.028	"	"	"	"	"	
Benzoic acid	"	ND	*0.18*	0.70	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0020*	0.028	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00084*	0.028	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00084*	0.028	"	"	"	"	"	
2-Methylnaphthalene	"	**0.48**	*0.00064*	0.0056	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0034*	0.014	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00073*	0.028	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0011*	0.042	"	"	"	"	"	
Fluoranthene	"	**0.040**	*0.00034*	0.0056	"	"	"	"	"	
Naphthalene	"	**0.096**	*0.00062*	0.0056	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0012*	0.028	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0031*	0.028	"	"	"	"	"	
Pyrene	"	**0.083**	*0.00039*	0.0056	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00050*	0.0056	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0087*	0.028	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0025*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0012*	0.028	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0012*	0.028	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00045*	0.0056	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0011*	0.028	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
3-Nitroaniline	8270C STD Dry	ND	*0.0016*	0.028	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 22:49	
4-Chlorophenyl phenyl ether	"	ND	*0.0016*	0.028	"	"	"	"	"	
Acenaphthene	"	**0.029**	*0.00045*	0.0056	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0039*	0.28	"	"	"	"	"	
Fluorene	"	**0.032**	*0.00034*	0.0056	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0039*	0.028	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.048*	0.28	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0050*	0.28	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00062*	0.014	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00092*	0.028	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0011*	0.014	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0034*	0.028	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0022*	0.056	"	"	"	"	"	
Phenanthrene	"	**0.051**	*0.00059*	0.0056	"	"	"	"	"	
Anthracene	"	**0.0088**	*0.00039*	0.0056	"	"	"	"	"	
Benzo[a]anthracene	"	**0.051**	*0.00048*	0.0070	"	"	"	"	"	
Chrysene	"	**0.069**	*0.00039*	0.0070	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.0073*	0.056	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.012*	0.42	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00036*	0.056	"	"	"	"	"	
Benzo[a]pyrene	"	**0.041**	*0.00059*	0.0084	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.013**	*0.0012*	0.011	"	"	"	"	"	
Dibenz(a,h)anthracene	"	**0.0079**	*0.00062*	0.011	"	"	"	"	"	J
Benzo[g,h,i]perylene	"	**0.024**	*0.00042*	0.0070	"	"	"	"	"	
Carbazole	"	ND UJ	*0.0012*	0.042	"	"	"	"	"	*
1-Methylnaphthalene	"	0.33	*0.00050*	0.0084	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.049**	*0.0011*	0.0056	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.012**	*0.00036*	0.0070	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0019*	0.042	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*83%*	*36 - 145 %*	"	"
	Phenol-d5	*73%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*75%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*80%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*98%*	*28 - 143 %*	"	"
	Terphenyl-d14	*88%*	*42 - 151 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:09	
Phenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00060*	0.021	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00077*	0.0053	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0010*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00034*	0.0053	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0010*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00016*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0031*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00068*	0.0053	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00027*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00044*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00076*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00046*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0026~~	*0.0016*	0.011	"	"	"	"	"	J-B
2,4-Dimethylphenol	"	ND	*0.00022*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.069*	0.27	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00076*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00032*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00032*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00024*	0.0021	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0013*	0.0053	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00028*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00043*	0.016	"	"	"	"	"	
Fluoranthene	"	**0.0012**	*0.00013*	0.0021	"	"	"	"	"	J
Naphthalene	"	**0.00040**	*0.00023*	0.0021	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00046*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	**0.0015**	*0.00015*	0.0021	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.00019*	0.0021	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0033*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00097*	0.0053	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00043*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00045*	0.011	"	"	"	"	"	
Acenaphthylene	"	**0.00076**	*0.00017*	0.0021	"	"	"	"	"	J
2,6-Dinitrotoluene	"	ND	*0.00044*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
3-Nitroaniline	8270C STD Dry	ND	*0.00062*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:09	
4-Chlorophenyl phenyl ether	"	ND	*0.00061*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00017*	0.0021	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0015*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00013*	0.0021	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0015*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.018*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0019*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00023*	0.0053	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00035*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00040*	0.0053	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0013*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00084*	0.021	"	"	"	"	"	
Phenanthrene	"	ND	*0.00022*	0.0021	"	"	"	"	"	
Anthracene	"	ND	*0.00015*	0.0021	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00018*	0.0027	"	"	"	"	"	
Chrysene	"	ND	*0.00015*	0.0027	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0084~~	*0.0028*	0.021 U	"	"	"	"	"	~~J, B~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0045*	0.16	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00014*	0.021	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0016**	*0.00022*	0.0032	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.0014**	*0.00045*	0.0043	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00023*	0.0043	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0017**	*0.00016*	0.0027	"	"	"	"	"	J
Carbazole	"	**0.00059** J	*0.00046*	0.016	"	"	"	"	"	J, *
1-Methylnaphthalene	"	ND	*0.00019*	0.0032	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0021**	*0.00044*	0.0021	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.00052**	*0.00014*	0.0027	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00071*	0.016	"	"	"	"	"	

Surrogate(s):					
2-Fluorophenol	*63%*	*36 - 145 %*	"	"	
Phenol-d5	*71%*	*38 - 149 %*	"	"	
Nitrobenzene-d5	*77%*	*38 - 141 %*	"	"	
2-Fluorobiphenyl	*75%*	*42 - 140 %*	"	"	
2,4,6-Tribromophenol	*100%*	*28 - 143 %*	"	"	
Terphenyl-d14	*84%*	*42 - 151 %*	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:30	
Phenol	"	ND	*0.00080*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00080*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00061*	0.022	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00078*	0.0054	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0010*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00035*	0.0054	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0010*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00016*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0031*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00069*	0.0054	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00027*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00044*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00077*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00047*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0027~~	*0.0016*	0.011 U	"	"	"	"	"	~~J B~~
2,4-Dimethylphenol	"	ND	*0.00023*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.070*	0.27	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00077*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00032*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00032*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00067**	*0.00025*	0.0022	"	"	"	"	"	J
1,2,4-Trichlorobenzene	"	ND	*0.0013*	0.0054	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00028*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00043*	0.016	"	"	"	"	"	
Fluoranthene	"	**0.0034**	*0.00013*	0.0022	"	"	"	"	"	
Naphthalene	"	**0.00048**	*0.00024*	0.0022	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00047*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	**0.0037**	*0.00015*	0.0022	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00019*	0.0022	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0034*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00098*	0.0054	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00045*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00045*	0.011	"	"	"	"	"	
Acenaphthylene	"	**0.00083**	*0.00017*	0.0022	"	"	"	"	"	J
2,6-Dinitrotoluene	"	ND	*0.00044*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
3-Nitroaniline	8270C STD Dry	ND	*0.00063*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:30	
4-Chlorophenyl phenyl ether	"	ND	*0.00062*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00017*	0.0022	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0015*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0015*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.018*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0019*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00024*	0.0054	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00036*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00041*	0.0054	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0013*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00085*	0.022	"	"	"	"	"	
Phenanthrene	"	**0.00087**	*0.00023*	0.0022	"	"	"	"	"	J
Anthracene	"	**0.0016**	*0.00015*	0.0022	"	"	"	"	"	J
Benzo[a]anthracene	"	**0.0021**	*0.00018*	0.0027	"	"	"	"	"	J
Chrysene	"	**0.0038**	*0.00015*	0.0027	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0088~~	*0.0028*	0.022 U	"	"	"	"	"	~~J, B~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0045*	0.16	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00014*	0.022	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0035**	*0.00023*	0.0032	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0025**	*0.00045*	0.0043	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	**0.00079**	*0.00024*	0.0043	"	"	"	"	"	J
Benzo[g,h,i]perylene	"	**0.0033**	*0.00016*	0.0027	"	"	"	"	"	
Carbazole	"	**0.0010** UJ	*0.00047*	0.016	"	"	"	"	"	J, *
1-Methylnaphthalene	"	**0.00056**	*0.00019*	0.0032	"	"	"	"	"	J
Benzo[b]fluoranthene	"	**0.0050**	*0.00044*	0.0022	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.0018**	*0.00014*	0.0027	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00073*	0.016	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*74%*	*36 - 145 %*	"	"
	Phenol-d5	*73%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*82%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*78%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*102%*	*28 - 143 %*	"	"
	Terphenyl-d14	*91%*	*42 - 151 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:51	
Phenol	"	ND	*0.00082*	0.011	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00082*	0.011	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00062*	0.022	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00080*	0.0055	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0011*	0.011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00035*	0.0055	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0012*	0.011	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.011	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00017*	0.011	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0032*	0.011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00071*	0.0055	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00028*	0.011	"	"	"	"	"	
Isophorone	"	ND	*0.00045*	0.011	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00048*	0.011	"	"	"	"	"	
Diethyl phthalate	"	~~0.0025~~	*0.0017*	0.011 U	"	"	"	"	"	J-B
2,4-Dimethylphenol	"	ND	*0.00023*	0.011	"	"	"	"	"	
Benzoic acid	"	ND	*0.072*	0.28	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00079*	0.011	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00033*	0.011	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00033*	0.011	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00046**	*0.00026*	0.0022	"	"	"	"	"	J
1,2,4-Trichlorobenzene	"	ND	*0.0013*	0.0055	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00029*	0.011	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00044*	0.017	"	"	"	"	"	
Fluoranthene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
Naphthalene	"	**0.00039**	*0.00024*	0.0022	"	"	"	"	"	J
2,4,5-Trichlorophenol	"	ND	*0.00048*	0.011	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0012*	0.011	"	"	"	"	"	
Pyrene	"	**0.00039**	*0.00016*	0.0022	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0034*	0.011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0010*	0.0055	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00047*	0.011	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00047*	0.011	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00018*	0.0022	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00045*	0.011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
3-Nitroaniline	8270C STD Dry	ND	*0.00064*	0.011	mg/Kg dry	1x	50040	09/10/09 17:24	09/14/09 23:51	
4-Chlorophenyl phenyl ether	"	ND	*0.00063*	0.011	"	"	"	"	"	
Acenaphthene	"	ND	*0.00018*	0.0022	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0016*	0.11	"	"	"	"	"	
Fluorene	"	ND	*0.00013*	0.0022	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0016*	0.011	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.019*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0020*	0.11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.00024*	0.0055	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.00037*	0.011	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00042*	0.0055	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0013*	0.011	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00088*	0.022	"	"	"	"	"	
Phenanthrene	"	ND	*0.00023*	0.0022	"	"	"	"	"	
Anthracene	"	ND	*0.00016*	0.0022	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00019*	0.0028	"	"	"	"	"	
Chrysene	"	ND	*0.00016*	0.0028	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0080~~	*0.0029*	0.022 U	"	"	"	"	"	~~J~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0047*	0.17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00074*	0.022	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.00023*	0.0033	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00047*	0.0044	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00024*	0.0044	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00017*	0.0028	"	"	"	"	"	
Carbazole	"	ND UJ	*0.00048*	0.017	"	"	"	"	"	*
1-Methylnaphthalene	"	**0.00031**	*0.00020*	0.0033	"	"	"	"	"	J
Benzo[b]fluoranthene	"	ND	*0.00045*	0.0022	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00014*	0.0028	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00074*	0.017	"	"	"	"	"	

Surrogate(s):					
2-Fluorophenol	*75%*	*36 - 145 %*	"		"
Phenol-d5	*78%*	*38 - 149 %*	"		"
Nitrobenzene-d5	*81%*	*38 - 141 %*	"		"
2-Fluorobiphenyl	*76%*	*42 - 140 %*	"		"
2,4,6-Tribromophenol	*98%*	*28 - 143 %*	"		"
Terphenyl-d14	*86%*	*42 - 151 %*	"		"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.12*	1.2	mg/Kg dry	10x	50040	09/10/09 17:24	09/15/09 00:11	
Phenol	"	ND	*0.090*	1.2	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.090*	1.2	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.068*	2.4	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.087*	0.61	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.12*	1.2	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.039*	0.61	"	"	"	"	"	
Hexachloroethane	"	ND	*0.13*	1.2	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.12*	1.2	"	"	"	"	"	
Dibenzofuran	"	ND	*0.018*	1.2	"	"	"	"	"	
Nitrobenzene	"	ND	*0.35*	1.2	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.078*	0.61	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.030*	1.2	"	"	"	"	"	
Isophorone	"	ND	*0.050*	1.2	"	"	"	"	"	
2-Methylphenol	"	ND	*0.086*	1.2	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.052*	1.2	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.18*	1.2	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.025*	1.2	"	"	"	"	"	
Benzoic acid	"	ND	*7.9*	30	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.086*	1.2	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.036*	1.2	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.036*	1.2	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.028*	0.24	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.15*	0.61	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.032*	1.2	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.049*	1.8	"	"	"	"	"	
Fluoranthene	"	**0.089**	*0.015*	0.24	"	"	"	"	"	J
Naphthalene	"	ND	*0.027*	0.24	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.052*	1.2	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.13*	1.2	"	"	"	"	"	
Pyrene	"	**0.081**	*0.017*	0.24	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.022*	0.24	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.38*	1.2	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.11*	0.61	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.051*	1.2	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.051*	1.2	"	"	"	"	"	
Acenaphthylene	"	ND	*0.019*	0.24	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.050*	1.2	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
3-Nitroaniline	8270C STD Dry	ND	*0.070*	1.2	mg/Kg dry	10x	50040	09/10/09 17:24	09/15/09 00:11	
4-Chlorophenyl phenyl ether	"	ND	*0.069*	1.2	"	"	"	"	"	
Acenaphthene	"	ND	*0.019*	0.24	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.17*	12	"	"	"	"	"	
Fluorene	"	ND	*0.015*	0.24	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.17*	1.2	"	"	"	"	"	
4-Nitrophenol	"	ND	*2.1*	12	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.22*	12	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND UJ	*0.027*	0.61	"	"	"	"	"	*
4-Bromophenyl phenyl ether	"	ND	*0.040*	1.2	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.046*	0.61	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.15*	1.2	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.096*	2.4	"	"	"	"	"	
Phenanthrene	"	ND	*0.025*	0.24	"	"	"	"	"	
Anthracene	"	ND	*0.017*	0.24	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.021*	0.30	"	"	"	"	"	
Chrysene	"	ND	*0.017*	0.30	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.32*	2.4	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.51*	18	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.016*	2.4	"	"	"	"	"	
Benzo[a]pyrene	"	**0.072**	*0.025*	0.36	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.051*	0.49	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.027*	0.49	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.018*	0.30	"	"	"	"	"	
Carbazole	"	ND UJ	*0.052*	1.8	"	"	"	"	"	*
1-Methylnaphthalene	"	ND	*0.022*	0.36	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.050*	0.24	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.016*	0.30	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.081*	1.8	"	"	"	"	"	
Surrogate(s):	*2-Fluorophenol*		*0%*		*36 - 145 %*	"			"	X
	Phenol-d5		*0%*		*38 - 149 %*	"			"	X
	Nitrobenzene-d5		*0%*		*38 - 141 %*	"			"	X
	2-Fluorobiphenyl		*0%*		*42 - 140 %*	"			"	X
	2,4,6-Tribromophenol		*0%*		*28 - 143 %*	"			"	X
	Terphenyl-d14		*0%*		*42 - 151 %*	"			"	X

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0011*	0.012	mg/Kg dry	1x	50042	09/10/09 17:52	09/15/09 16:45	
Phenol	"	ND	*0.00086*	0.012	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00086*	0.012	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00065*	0.023	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00083*	0.0058	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0011*	0.012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00037*	0.0058	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0013*	0.012	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.012	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00017*	0.012	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0034*	0.012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00074*	0.0058	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00029*	0.012	"	"	"	"	"	
Isophorone	"	ND	*0.00047*	0.012	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00082*	0.012	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00050*	0.012	"	"	"	"	"	
Diethyl phthalate	" Stet	~~0.0019~~	*0.0017*	0.012	~~"~~ "	"	"	"	"	J
2,4-Dimethylphenol	"	ND	*0.00024*	0.012	"	"	"	"	"	
Benzoic acid	"	ND	*0.075*	0.29	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00082*	0.012	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00035*	0.012	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00035*	0.012	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00027*	0.0023	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0014*	0.0058	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00030*	0.012	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00046*	0.017	"	"	"	"	"	
Fluoranthene	"	**0.0078**	*0.00014*	0.0023	"	"	"	"	"	
Naphthalene	"	ND	*0.00025*	0.0023	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00050*	0.012	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0013*	0.012	"	"	"	"	"	
Pyrene	"	**0.0087**	*0.00016*	0.0023	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00021*	0.0023	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0036*	0.012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0011*	0.0058	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00049*	0.012	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00049*	0.012	"	"	"	"	"	
Acenaphthylene	"	**0.00072**	*0.00019*	0.0023	"	"	"	"	"	J
2,6-Dinitrotoluene	"	ND	*0.00047*	0.012	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
3-Nitroaniline	8270C STD Dry	ND	*0.00067*	0.012	mg/Kg dry	1x	50042	09/10/09 17:52	09/15/09 16:45	
4-Chlorophenyl phenyl ether	"	ND	*0.00066*	0.012	"	"	"	"	"	
Acenaphthene	"	ND	*0.00019*	0.0023	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0016*	0.12	"	"	"	"	"	
Fluorene	"	ND	*0.00014*	0.0023	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0016*	0.012	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.020*	0.12	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0021*	0.12	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND U5	*0.00025*	0.0058	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00038*	0.012	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00044*	0.0058	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0014*	0.012	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00091*	0.023	"	"	"	"	"	
Phenanthrene	"	**0.0029**	*0.00024*	0.0023	"	"	"	"	"	
Anthracene	"	**0.00084**	*0.00016*	0.0023	"	"	"	"	"	J
Benzo[a]anthracene	"	**0.0057**	*0.00020*	0.0029	"	"	"	"	"	
Chrysene	"	**0.0068**	*0.00016*	0.0029	"	"	"	"	"	
Di-n-butyl phthalate	"	~~0.0071~~	*0.0030*	0.023 U	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0049*	0.17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00015*	0.023	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0047**	*0.00024*	0.0035	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0024**	*0.00049*	0.0046	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.00025*	0.0046	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0020**	*0.00017*	0.0029	"	"	"	"	"	J
Carbazole	"	ND U5	*0.00050*	0.017	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.00021*	0.0035	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0057**	*0.00047*	0.0023	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.0018**	*0.00015*	0.0029	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.00077*	0.017	"	"	"	"	"	

Surrogate(s):					
2-Fluorophenol	*91%*	*36 - 145 %*	"		"
Phenol-d5	*78%*	*38 - 149 %*	"		"
Nitrobenzene-d5	*77%*	*38 - 141 %*	"		"
2-Fluorobiphenyl	*80%*	*42 - 140 %*	"		"
2,4,6-Tribromophenol	*98%*	*28 - 143 %*	"		"
Terphenyl-d14	*96%*	*42 - 151 %*	"		"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.0013*	0.013	mg/Kg dry	1x	50042	09/10/09 17:52	09/15/09 17:06	
Phenol	"	ND	*0.00094*	0.013	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.00094*	0.013	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00071*	0.025	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00091*	0.0063	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0012*	0.013	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00040*	0.0063	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0014*	0.013	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0012*	0.013	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00019*	0.013	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0037*	0.013	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00081*	0.0063	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00032*	0.013	"	"	"	"	"	
Isophorone	"	ND	*0.00052*	0.013	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00090*	0.013	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00054*	0.013	"	"	"	"	"	
Diethyl phthalate	"	**0.0020**	*0.0019*	0.013	"	"	"	"	"	J
2,4-Dimethylphenol	"	ND	*0.00027*	0.013	"	"	"	"	"	
Benzoic acid	"	ND	*0.082*	0.32	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00090*	0.013	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00038*	0.013	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00038*	0.013	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00029*	0.0025	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0015*	0.0063	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00033*	0.013	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00051*	0.019	"	"	"	"	"	
Fluoranthene	"	**0.0010**	*0.00015*	0.0025	"	"	"	"	"	J
Naphthalene	"	ND	*0.00028*	0.0025	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00054*	0.013	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0014*	0.013	"	"	"	"	"	
Pyrene	"	**0.0012**	*0.00018*	0.0025	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0039*	0.013	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0012*	0.0063	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00053*	0.013	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00053*	0.013	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00020*	0.0025	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00052*	0.013	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
3-Nitroaniline	8270C STD Dry	ND	*0.00073*	0.013	mg/Kg dry	1x	50042	09/10/09 17:52	09/15/09 17:06	
4-Chlorophenyl phenyl ether	"	ND	*0.00072*	0.013	"	"	"	"	"	
Acenaphthene	"	ND	*0.00020*	0.0025	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0018*	0.13	"	"	"	"	"	
Fluorene	"	ND	*0.00015*	0.0025	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0018*	0.013	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.022*	0.13	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0023*	0.13	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00028*	0.0063	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00042*	0.013	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00048*	0.0063	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0015*	0.013	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0010*	0.025	"	"	"	"	"	
Phenanthrene	"	ND	*0.00027*	0.0025	"	"	"	"	"	
Anthracene	"	ND	*0.00018*	0.0025	"	"	"	"	"	
Benzo[a]anthracene	"	**0.0010**	*0.00022*	0.0032	"	"	"	"	"	J
Chrysene	"	**0.0017**	*0.00018*	0.0032	"	"	"	"	"	J
Di-n-butyl phthalate	"	~~0.0067~~	*0.0033*	0.025 U	"	"	"	"	"	~~J,B~~
Bis(2-ethylhexyl) phthalate	"	ND	*0.0053*	0.19	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00016*	0.025	"	"	"	"	"	
Benzo[a]pyrene	"	**0.00086**	*0.00027*	0.0038	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.00053*	0.0051	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00028*	0.0051	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00019*	0.0032	"	"	"	"	"	
Carbazole	"	ND	*0.00054*	0.019	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.00023*	0.0038	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.00052*	0.0025	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00016*	0.0032	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00085*	0.019	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*66%*	*36 - 145 %*	"	"
	Phenol-d5	*58%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*59%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*59%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*70%*	*28 - 143 %*	"	"
	Terphenyl-d14	*62%*	*42 - 151 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.11*	1.1	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 17:27	
Phenol	"	ND	*0.083*	1.1	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.083*	1.1	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.063*	2.3	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.081*	0.56	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.11*	1.1	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.036*	0.56	"	"	"	"	"	
Hexachloroethane	"	ND	*0.12*	1.1	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.11*	1.1	"	"	"	"	"	
Dibenzofuran	"	ND	*0.017*	1.1	"	"	"	"	"	
Nitrobenzene	"	ND	*0.33*	1.1	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.072*	0.56	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.028*	1.1	"	"	"	"	"	
Isophorone	"	ND	*0.046*	1.1	"	"	"	"	"	
2-Methylphenol	"	ND	*0.080*	1.1	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.048*	1.1	"	"	"	"	"	
Diethyl phthalate	"	**0.20**	*0.17*	1.1	"	"	"	"	"	J
2,4-Dimethylphenol	"	ND	*0.024*	1.1	"	"	"	"	"	
Benzoic acid	"	ND	*7.3*	28	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.080*	1.1	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.034*	1.1	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.034*	1.1	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.026*	0.23	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.14*	0.56	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.029*	1.1	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.045*	1.7	"	"	"	"	"	
Fluoranthene	"	ND	*0.014*	0.23	"	"	"	"	"	
Naphthalene	"	ND	*0.025*	0.23	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.048*	1.1	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.12*	1.1	"	"	"	"	"	
Pyrene	"	**0.089**	*0.016*	0.23	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.020*	0.23	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.35*	1.1	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.10*	0.56	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.047*	1.1	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.047*	1.1	"	"	"	"	"	
Acenaphthylene	"	ND	*0.018*	0.23	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.046*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		Soil			Sampled: 08/27/09 09:20					
3-Nitroaniline	8270C STD Dry	ND	*0.065*	1.1	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 17:27	
4-Chlorophenyl phenyl ether	"	ND	*0.064*	1.1	"	"	"	"	"	
Acenaphthene	"	ND	*0.018*	0.23	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.16*	11	"	"	"	"	"	
Fluorene	"	ND	*0.014*	0.23	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.16*	1.1	"	"	"	"	"	
4-Nitrophenol	"	ND	*1.9*	11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.20*	11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.025*	0.56	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.037*	1.1	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.043*	0.56	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.14*	1.1	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.089*	2.3	"	"	"	"	"	
Phenanthrene	"	ND	*0.024*	0.23	"	"	"	"	"	
Anthracene	"	ND	*0.016*	0.23	"	"	"	"	"	
Benzo[a]anthracene	"	**0.10**	*0.019*	0.28	"	"	"	"	"	J
Chrysene	"	**0.11**	*0.016*	0.28	"	"	"	"	"	J
Di-n-butyl phthalate	"	ND	*0.29*	2.3	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.47*	17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.015*	2.3	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.024*	0.34	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.060**	*0.047*	0.45	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.025*	0.45	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.18**	*0.017*	0.28	"	"	"	"	"	J
Carbazole	"	ND	*0.048*	1.7	"	"	"	"	"	
1-Methylnaphthalene	"	**0.023**	*0.020*	0.34	"	"	"	"	"	J
Benzo[b]fluoranthene	"	ND	*0.046*	0.23	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.015*	0.28	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.076*	1.7	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*0%*	*36 - 145 %*	"	"	*D, X*
	Phenol-d5	*0%*	*38 - 149 %*	"	"	*D, X*
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	*D, X*
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	*D, X*
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	*D, X*
	Terphenyl-d14	*0%*	*42 - 151 %*	"	"	*D, X*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.022*	0.22	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 18:30	
Phenol	"	ND	*0.016*	0.22	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.016*	0.22	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.012*	0.44	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.016*	0.11	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.021*	0.22	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0070*	0.11	"	"	"	"	"	
Hexachloroethane	"	ND	*0.024*	0.22	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.021*	0.22	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0033*	0.22	"	"	"	"	"	
Nitrobenzene	"	ND	*0.064*	0.22	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.014*	0.11	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0055*	0.22	"	"	"	"	"	
Isophorone	"	ND	*0.0090*	0.22	"	"	"	"	"	
2-Methylphenol	"	ND	*0.016*	0.22	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0094*	0.22	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.033*	0.22	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0046*	0.22	"	"	"	"	"	
Benzoic acid	"	ND	*1.4*	5.5	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.016*	0.22	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0066*	0.22	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0066*	0.22	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.0050*	0.044	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.026*	0.11	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.0057*	0.22	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0088*	0.33	"	"	"	"	"	
Fluoranthene	"	ND	*0.0026*	0.044	"	"	"	"	"	
Naphthalene	"	ND	*0.0048*	0.044	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0094*	0.22	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.024*	0.22	"	"	"	"	"	
Pyrene	"	**0.012**	*0.0031*	0.044	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.0039*	0.044	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.068*	0.22	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.020*	0.11	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0092*	0.22	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0092*	0.22	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0035*	0.044	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0090*	0.22	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
3-Nitroaniline	8270C STD Dry	ND	*0.013*	0.22	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 18:30	
4-Chlorophenyl phenyl ether	"	ND	*0.013*	0.22	"	"	"	"	"	
Acenaphthene	"	ND	*0.0035*	0.044	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.031*	2.2	"	"	"	"	"	
Fluorene	"	ND	*0.0026*	0.044	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.031*	0.22	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.37*	2.2	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.039*	2.2	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0048*	0.11	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0072*	0.22	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0083*	0.11	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.026*	0.22	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.017*	0.44	"	"	"	"	"	
Phenanthrene	"	ND	*0.0046*	0.044	"	"	"	"	"	
Anthracene	"	ND	*0.0031*	0.044	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0037*	0.055	"	"	"	"	"	
Chrysene	"	ND	*0.0031*	0.055	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.057*	0.44	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.092*	3.3	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0029*	0.44	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0046*	0.066	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0092*	0.088	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0048*	0.088	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0033*	0.055	"	"	"	"	"	
Carbazole	"	ND	*0.0094*	0.33	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.0039*	0.066	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0090*	0.044	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0029*	0.055	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.015*	0.33	"	"	"	"	"	
Surrogate(s):	*2-Fluorophenol*		*0%*		*36 - 145 %*	"		"		*D. X*
	Phenol-d5		*0%*		*38 - 149 %*	"		"		*D. X*
	Nitrobenzene-d5		*0%*		*38 - 141 %*	"		"		*D. X*
	2-Fluorobiphenyl		*0%*		*42 - 140 %*	"		"		*D. X*
	2,4,6-Tribromophenol		*0%*		*28 - 143 %*	"		"		*D. X*
	Terphenyl-d14		*0%*		*42 - 151 %*	"		"		*D. X*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		Soil			Sampled: 08/27/09 18:10					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.023*	0.24	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 18:50	
Phenol	"	ND	*0.018*	0.24	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.018*	0.24	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.013*	0.47	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.017*	0.12	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.023*	0.24	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0076*	0.12	"	"	"	"	"	
Hexachloroethane	"	ND	*0.026*	0.24	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.023*	0.24	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0035*	0.24	"	"	"	"	"	
Nitrobenzene	"	ND	*0.069*	0.24	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.015*	0.12	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0059*	0.24	"	"	"	"	"	
Isophorone	"	ND	*0.0097*	0.24	"	"	"	"	"	
2-Methylphenol	"	ND	*0.017*	0.24	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.010*	0.24	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.035*	0.24	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0050*	0.24	"	"	"	"	"	
Benzoic acid	"	ND	*1.5*	5.9	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.017*	0.24	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0071*	0.24	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0071*	0.24	"	"	"	"	"	
2-Methylnaphthalene	"	**4.6**	*0.0054*	0.047	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.028*	0.12	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.0062*	0.24	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0095*	0.35	"	"	"	"	"	
Fluoranthene	"	**0.072**	*0.0028*	0.047	"	"	"	"	"	
Naphthalene	"	**0.19**	*0.0052*	0.047	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.010*	0.24	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.026*	0.24	"	"	"	"	"	
Pyrene	"	**0.13**	*0.0033*	0.047	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0043*	0.047	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.073*	0.24	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.022*	0.12	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0099*	0.24	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0099*	0.24	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0038*	0.047	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0097*	0.24	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
3-Nitroaniline	8270C STD Dry	ND	*0.014*	0.24	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 18:50	
4-Chlorophenyl phenyl ether	"	ND	*0.013*	0.24	"	"	"	"	"	
Acenaphthene	"	**0.81**	*0.0038*	0.047	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.033*	2.4	"	"	"	"	"	
Fluorene	"	**1.2**	*0.0028*	0.047	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.033*	0.24	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.40*	2.4	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.043*	2.4	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0052*	0.12	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0078*	0.24	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0090*	0.12	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.028*	0.24	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.019*	0.47	"	"	"	"	"	
Phenanthrene	"	**1.6**	*0.0050*	0.047	"	"	"	"	"	
Anthracene	"	**0.11**	*0.0033*	0.047	"	"	"	"	"	
Benzo[a]anthracene	"	**0.049** J	*0.0040*	0.059	"	"	"	"	"	J
Chrysene	"	**0.088**	*0.0033*	0.059	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.062*	0.47	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.099*	3.5	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0031*	0.47	"	"	"	"	"	
Benzo[a]pyrene	"	**0.021**	*0.0050*	0.071	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0099*	0.095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0052*	0.095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0035*	0.059	"	"	"	"	"	
Carbazole	"	ND	*0.010*	0.35	"	"	"	"	"	
1-Methylnaphthalene	"	**5.5**	*0.0043*	0.071	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0097*	0.047	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0031*	0.059	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.016*	0.35	"	"	"	"	"	
Surrogate(s): *2-Fluorophenol*			*0%*		*36 - 145 %*	"		"		*D. X*
Phenol-d5			*0%*		*38 - 149 %*	"		"		*D. X*
Nitrobenzene-d5			*0%*		*38 - 141 %*	"		"		*D. X*
2-Fluorobiphenyl			*0%*		*42 - 140 %*	"		"		*D. X*
2,4,6-Tribromophenol			*0%*		*28 - 143 %*	"		"		*D. X*
Terphenyl-d14			*0%*		*42 - 151 %*	"		"		*D. X*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.022*	0.22	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:11	
Phenol	"	ND	*0.016*	0.22	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.016*	0.22	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.012*	0.44	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.016*	0.11	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.021*	0.22	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0070*	0.11	"	"	"	"	"	
Hexachloroethane	"	ND	*0.024*	0.22	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.021*	0.22	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0033*	0.22	"	"	"	"	"	
Nitrobenzene	"	ND	*0.063*	0.22	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.014*	0.11	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0055*	0.22	"	"	"	"	"	
Isophorone	"	ND	*0.0090*	0.22	"	"	"	"	"	
2-Methylphenol	"	ND	*0.016*	0.22	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0094*	0.22	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.033*	0.22	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0046*	0.22	"	"	"	"	"	
Benzoic acid	"	ND	*1.4*	5.5	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.016*	0.22	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0066*	0.22	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0066*	0.22	"	"	"	"	"	
2-Methylnaphthalene	"	**9.5**	*0.0050*	0.044	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.026*	0.11	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.0057*	0.22	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0087*	0.33	"	"	"	"	"	
Fluoranthene	"	**0.54**	*0.0026*	0.044	"	"	"	"	"	
Naphthalene	"	**0.83**	*0.0048*	0.044	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0094*	0.22	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.024*	0.22	"	"	"	"	"	
Pyrene	"	**0.57**	*0.0031*	0.044	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0039*	0.044	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.068*	0.22	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.020*	0.11	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0092*	0.22	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0092*	0.22	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0035*	0.044	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0090*	0.22	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
3-Nitroaniline	8270C STD Dry	ND	*0.013*	0.22	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:11	
4-Chlorophenyl phenyl ether	"	ND	*0.012*	0.22	"	"	"	"	"	
Acenaphthene	"	**1.5**	*0.0035*	0.044	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.031*	2.2	"	"	"	"	"	
Fluorene	"	**2.6**	*0.0026*	0.044	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.031*	0.22	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.37*	2.2	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.039*	2.2	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0048*	0.11	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0072*	0.22	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0083*	0.11	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.026*	0.22	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.017*	0.44	"	"	"	"	"	
Phenanthrene	"	**4.7**	*0.0046*	0.044	"	"	"	"	"	
Anthracene	"	**0.28**	*0.0031*	0.044	"	"	"	"	"	
Benzo[a]anthracene	"	**0.10**	*0.0037*	0.055	"	"	"	"	"	
Chrysene	"	**0.26**	*0.0031*	0.055	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.057*	0.44	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.092*	3.3	"	"	"	"	"	
Di-n-octyl phthalate	"	**0.054**	*0.0028*	0.44	"	"	"	"	"	J
Benzo[a]pyrene	"	**0.077**	*0.0046*	0.066	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0092*	0.087	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0048*	0.087	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.036**	*0.0033*	0.055	"	"	"	"	"	J
Carbazole	"	ND	*0.0094*	0.33	"	"	"	"	"	
1-Methylnaphthalene	"	**10**	*0.020*	0.33	"	50x	"	"	09/16/09 14:08	
Benzo[b]fluoranthene	"	ND	*0.0090*	0.044	"	10x	"	"	09/15/09 19:11	
Benzo[k]fluoranthene	"	ND	*0.0028*	0.055	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.015*	0.33	"	"	"	"	"	
Surrogate(s):	*2-Fluorophenol*		*0%*		*36 - 145 %*	"		"		*D. X*
	Phenol-d5		*0%*		*38 - 149 %*	"		"		*D. X*
	Nitrobenzene-d5		*0%*		*38 - 141 %*	"		"		*D. X*
	2-Fluorobiphenyl		*0%*		*42 - 140 %*	"		"		*D. X*
	2,4,6-Tribromophenol		*0%*		*28 - 143 %*	"		"		*D. X*
	Terphenyl-d14		*0%*		*42 - 151 %*	"		"		*D. X*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.11*	1.1	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:32	
Phenol	"	ND	*0.081*	1.1	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.081*	1.1	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.061*	2.2	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.079*	0.55	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.11*	1.1	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.035*	0.55	"	"	"	"	"	
Hexachloroethane	"	ND	*0.12*	1.1	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.11*	1.1	"	"	"	"	"	
Dibenzofuran	"	ND	*0.016*	1.1	"	"	"	"	"	
Nitrobenzene	"	ND	*0.32*	1.1	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.070*	0.55	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.027*	1.1	"	"	"	"	"	
Isophorone	"	ND	*0.045*	1.1	"	"	"	"	"	
2-Methylphenol	"	ND	*0.078*	1.1	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.047*	1.1	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.16*	1.1	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.023*	1.1	"	"	"	"	"	
Benzoic acid	"	ND	*7.1*	27	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.078*	1.1	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.033*	1.1	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.033*	1.1	"	"	"	"	"	
2-Methylnaphthalene	"	**0.38**	*0.025*	0.22	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.13*	0.55	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.029*	1.1	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.044*	1.6	"	"	"	"	"	
Fluoranthene	"	ND	*0.013*	0.22	"	"	"	"	"	
Naphthalene	"	ND	*0.024*	0.22	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.047*	1.1	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.12*	1.1	"	"	"	"	"	
Pyrene	"	**0.19**	*0.015*	0.22	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.020*	0.22	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.34*	1.1	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.10*	0.55	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.046*	1.1	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.046*	1.1	"	"	"	"	"	
Acenaphthylene	"	ND	*0.018*	0.22	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.045*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24 (TS-COMP-3)		Soil			Sampled: 08/27/09 16:40					
3-Nitroaniline	8270C STD Dry	ND	*0.064*	1.1	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:32	
4-Chlorophenyl phenyl ether	"	ND	*0.063*	1.1	"	"	"	"	"	
Acenaphthene	"	**0.20**	*0.018*	0.22	"	"	"	"	"	J
2,4-Dinitrophenol	"	ND	*0.15*	11	"	"	"	"	"	
Fluorene	"	**0.52**	*0.013*	0.22	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.15*	1.1	"	"	"	"	"	
4-Nitrophenol	"	ND	*1.9*	11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.20*	11	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.024*	0.55	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.036*	1.1	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.042*	0.55	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.13*	1.1	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.087*	2.2	"	"	"	"	"	
Phenanthrene	"	**0.47**	*0.023*	0.22	"	"	"	"	"	
Anthracene	"	**0.068**	*0.015*	0.22	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.019*	0.27	"	"	"	"	"	
Chrysene	"	ND	*0.015*	0.27	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.29*	2.2	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.46*	16	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.014*	2.2	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.023*	0.33	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.046*	0.44	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.024*	0.44	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.016*	0.27	"	"	"	"	"	
Carbazole	"	ND	*0.047*	1.6	"	"	"	"	"	
1-Methylnaphthalene	"	**0.78**	*0.020*	0.33	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.045*	0.22	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.014*	0.27	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.073*	1.6	"	"	"	"	"	
Surrogate(s): *2-Fluorophenol*			*0%*		*36 - 145 %*	"		"		*D. X*
Phenol-d5			*0%*		*38 - 149 %*	"		"		*D. X*
Nitrobenzene-d5			*0%*		*38 - 141 %*	"		"		*D. X*
2-Fluorobiphenyl			*0%*		*42 - 140 %*	"		"		*D. X*
2,4,6-Tribromophenol			*0%*		*28 - 143 %*	"		"		*D. X*
Terphenyl-d14			*0%*		*42 - 151 %*	"		"		*D. X*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
3-Nitroaniline	8270C STD Dry	ND	*0.0064*	0.11	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:53	
4-Chlorophenyl phenyl ether	"	ND	*0.0063*	0.11	"	"	"	"	"	
Acenaphthene	"	ND	*0.0018*	0.022	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.015*	1.1	"	"	"	"	"	
Fluorene	"	ND	*0.0013*	0.022	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.015*	0.11	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.19*	1.1	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.020*	1.1	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0024*	0.055	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0036*	0.11	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0042*	0.055	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.013*	0.11	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0087*	0.22	"	"	"	"	"	
Phenanthrene	"	**0.0077**	*0.0023*	0.022	"	"	"	"	"	J
Anthracene	"	**0.0052**	*0.0015*	0.022	"	"	"	"	"	J
Benzo[a]anthracene	"	**0.010**	*0.0019*	0.027	"	"	"	"	"	J
Chrysene	"	**0.014**	*0.0015*	0.027	"	"	"	"	"	J
Di-n-butyl phthalate	"	ND	*0.029*	0.22	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.046*	1.6	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0014*	0.22	"	"	"	"	"	
Benzo[a]pyrene	"	**0.010**	*0.0023*	0.033	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	**0.0047**	*0.0046*	0.044	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.0024*	0.044	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0060**	*0.0016*	0.027	"	"	"	"	"	J
Carbazole	"	ND	*0.0047*	0.16	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.0020*	0.033	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0076**	*0.0045*	0.022	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.0058**	*0.0014*	0.027	"	"	"	"	"	J
2,2'-oxybis[1-chloropropane]	"	ND	*0.0074*	0.16	"	"	"	"	"	

Surrogate(s):	*2-Fluorophenol*	*0%*	*36 - 145 %*	"	"	*D, X*
	Phenol-d5	*0%*	*38 - 149 %*	"	"	*D, X*
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	*D, X*
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	*D, X*
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	*D, X*
	Terphenyl-d14	*0%*	*42 - 151 %*	"	"	*D, X*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Bis(2-chloroethyl)ether	8270C STD Dry	ND	*0.011*	0.11	mg/Kg dry	10x	50042	09/10/09 17:52	09/15/09 19:53	
Phenol	"	ND	*0.0081*	0.11	"	"	"	"	"	
2-Chlorophenol	"	ND	*0.0081*	0.11	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0061*	0.22	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0079*	0.055	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.011*	0.11	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0035*	0.055	"	"	"	"	"	
Hexachloroethane	"	ND	*0.012*	0.11	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.011*	0.11	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0016*	0.11	"	"	"	"	"	
Nitrobenzene	"	ND	*0.032*	0.11	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0070*	0.055	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0027*	0.11	"	"	"	"	"	
Isophorone	"	ND	*0.0045*	0.11	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0078*	0.11	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0047*	0.11	"	"	"	"	"	
Diethyl phthalate	"	**0.019**	*0.016*	0.11	"	"	"	"	"	J
2,4-Dimethylphenol	"	ND	*0.0023*	0.11	"	"	"	"	"	
Benzoic acid	"	ND	*0.71*	2.7	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0078*	0.11	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0033*	0.11	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0033*	0.11	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.0025*	0.022	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.013*	0.055	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.0029*	0.11	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0044*	0.16	"	"	"	"	"	
Fluoranthene	"	**0.017**	*0.0013*	0.022	"	"	"	"	"	J
Naphthalene	"	ND	*0.0024*	0.022	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0047*	0.11	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.012*	0.11	"	"	"	"	"	
Pyrene	"	**0.015**	*0.0015*	0.022	"	"	"	"	"	J
2-Chloronaphthalene	"	ND	*0.0020*	0.022	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.034*	0.11	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.010*	0.055	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0046*	0.11	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0046*	0.11	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0018*	0.022	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0045*	0.11	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01 (GTP1-10.5-082709)		Soil				Sampled: 08/27/09 09:40				
Bromomethane	8260B STD Dry	ND	*0.00048*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 14:26	
Chloroethane	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND UJ	*0.00022*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000092*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00015*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0025	"	"	"	"	"	
Bromoform	"	ND	*0.000089*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*111%*		*85 - 115 %*	"		"		
	1,2-Dichloroethane-d4 (Surr)		*176%*		*75 - 125 %*	"		"		*X. I*
	4-Bromofluorobenzene (Surr)		*81%*		*85 - 120 %*	"		"		*X. I*
SSH0168-01RE1 (GTP1-10.5-082709)		Soil				Sampled: 08/27/09 09:40				
1,1-Dichloropropene	8260B STD Dry	ND	*0.0069*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:18	
1,2-Dichlorobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.050*	0.15	"	"	"	"	"	
Bromomethane	"	ND	*0.096*	0.54	"	"	"	"	"	
Chloroethane	"	ND	*0.089*	1.5	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.031*	0.15	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.15	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0081*	0.15	"	"	"	"	"	
Chloromethane	"	ND	*0.23*	1.5	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.019*	0.15	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.019*	0.077	"	"	"	"	"	
sec-Butylbenzene	"	**0.41**	*0.019*	0.15	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0066*	0.031	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.15	"	"	"	"	"	
Methylene Chloride	"	~~0.057~~	*0.015*	0.15 UL	"	"	"	"	"	J, B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01RE1 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
4-Isopropyltoluene	8260B STD Dry	**0.13**	*0.011*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:18	J
cis-1,2-Dichloroethene	"	ND	*0.0093*	0.15	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.014*	0.15	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.015*	0.15	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.046*	0.15	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.015*	0.062	"	"	"	"	"	
Benzene	"	ND	*0.0096*	0.062	"	"	"	"	"	
Chloroform	"	ND	*0.0081*	0.15	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.019*	0.15	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0085*	0.15	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.014*	0.077	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.062	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.015*	0.046	"	"	"	"	"	
Dibromomethane	"	ND	*0.015*	0.15	"	"	"	"	"	
Toluene	"	**0.057**	*0.0093*	0.15	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0069*	0.046	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0093*	0.062	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0089*	0.15	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0081*	0.077	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.019*	0.15	"	"	"	"	"	
Ethylbenzene	"	**0.081**	*0.014*	0.15	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.019*	0.15	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.031*	0.15	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.013*	0.039	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.12**	*0.030*	0.15	"	"	"	"	"	J
o-Xylene	"	**0.052**	*0.0089*	0.15	"	"	"	"	"	J
Styrene	"	ND	*0.015*	0.15	"	"	"	"	"	
Bromoform	"	ND	*0.042*	0.15	"	"	"	"	"	
Isopropylbenzene	"	**0.10**	*0.0069*	0.15	"	"	"	"	"	J
Bromobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
N-Propylbenzene	"	**0.094**	*0.011*	0.15	"	"	"	"	"	J
1,2,3-Trichloropropane	"	ND	*0.045*	0.15	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.021*	0.15	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.016*	0.15	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.028*	0.15	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.25*	0.77	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-01RE1 (GTP1-10.5-082709)		**Soil**			**Sampled: 08/27/09 09:40**					
1,2,4-Trichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.019*	0.15	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.022*	0.15	"	"	"	"	"	
Naphthalene	"	ND	*0.023*	0.15	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*98%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*110%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*100%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*106%*			*75 - 125 %*	"			"	
SSH0168-02 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
Bromomethane	8260B STD Dry	ND	*0.00037*	0.00095	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 14:50	
Chloroethane	"	ND	*0.00026*	0.00095	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00095	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00017*	0.00095	"	"	"	"	"	
Chloroform	"	ND	*0.00014*	0.00095	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00095	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00015*	0.00095	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00035*	0.00095	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00095	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00016*	0.00095	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000070*	0.00095	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00011*	0.00095	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000084*	0.0019	"	"	"	"	"	
Bromoform	"	ND	*0.000069*	0.00095	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00034*	0.00095	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00017*	0.0019	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00032*	0.00095	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*120%*			*85 - 115 %*	"			"	*X.1*
1,2-Dichloroethane-d4 (Surr)		*119%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*119%*			*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02RE1 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0036*	0.080	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:42	
1,2-Dichlorobenzene	"	ND	*0.0052*	0.080	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.026*	0.080	"	"	"	"	"	
Bromomethane	"	ND	*0.050*	0.28	"	"	"	"	"	
Chloroethane	"	ND	*0.046*	0.80	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.016*	0.080	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0064*	0.080	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0042*	0.080	"	"	"	"	"	
Chloromethane	"	ND	*0.12*	0.80	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.010*	0.080	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.010*	0.040	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0034*	0.016	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0074*	0.080	"	"	"	"	"	
Methylene Chloride	"	~~0.032~~	*0.0076*	0.080	U	"	"	"	"	"	J-B
4-Isopropyltoluene	"	ND	*0.0056*	0.080	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0048*	0.080	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0070*	0.080	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0076*	0.080	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.024*	0.080	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0080*	0.032	"	"	"	"	"	
Benzene	"	ND	*0.0050*	0.032	"	"	"	"	"	
Chloroform	"	ND	*0.0042*	0.080	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0064*	0.080	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.010*	0.080	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0044*	0.080	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0074*	0.040	"	"	"	"	"	
Trichloroethene	"	ND	*0.0068*	0.032	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0078*	0.024	"	"	"	"	"	
Dibromomethane	"	ND	*0.0080*	0.080	"	"	"	"	"	
Toluene	"	ND	*0.0048*	0.080	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0060*	0.080	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0036*	0.024	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0048*	0.032	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0046*	0.080	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0042*	0.040	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-02RE1 (GTP1-13.5-082709)		**Soil**			**Sampled: 08/27/09 10:10**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.010*	0.080	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 17:42	
Ethylbenzene	"	ND	*0.0074*	0.080	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0096*	0.080	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.016*	0.080	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0066*	0.020	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.016**	*0.016*	0.080	"	"	"	"	"	J
o-Xylene	"	ND	*0.0046*	0.080	"	"	"	"	"	
Styrene	"	ND	*0.0076*	0.080	"	"	"	"	"	
Bromoform	"	ND	*0.022*	0.080	"	"	"	"	"	
Isopropylbenzene	"	**0.014**	*0.0036*	0.080	"	"	"	"	"	J
Bromobenzene	"	ND	*0.0054*	0.080	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0056*	0.080	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.023*	0.080	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.011*	0.080	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0084*	0.080	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.015*	0.080	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.13*	0.40	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.010*	0.080	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.011*	0.080	"	"	"	"	"	
Naphthalene	"	ND	*0.012*	0.080	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*98%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*109%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*105%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*104%*		*75 - 125 %*	"			"	
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
Bromomethane	8260B STD Dry	ND	*0.00062*	0.0016	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:14	
Chloroethane	"	ND	*0.00043*	0.0016	"	"	"	"	"	
Chloromethane	"	ND	*0.00028*	0.0016	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00029*	0.0016	"	"	"	"	"	
Chloroform	"	ND	*0.00024*	0.0016	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00021*	0.0016	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00026*	0.0016	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00060*	0.0016	"	"	"	"	"	
Trichloroethene	"	ND	*0.00028*	0.0016	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00028*	0.0016	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00012*	0.0016	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00019*	0.0016	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:14	
1,1,2,2-Tetrachloroethane	"	ND	*0.00014*	0.0032	"	"	"	"	"	
Bromoform	"	ND	*0.00012*	0.0016	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00058*	0.0016	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00029*	0.0032	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00054*	0.0016	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*101%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*117%*		*85 - 120 %*	"			"	
SSH0168-03RE1 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0047*	0.10	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:06	
1,2-Dichlorobenzene	"	ND	*0.0068*	0.10	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.034*	0.10	"	"	"	"	"	
Bromomethane	"	ND	*0.066*	0.37	"	"	"	"	"	
Chloroethane	"	ND	*0.060*	1.0	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.021*	0.10	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0084*	0.10	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.017**	*0.0055*	0.10	"	"	"	"	"	J
Chloromethane	"	ND	*0.16*	1.0	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.013*	0.10	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.013*	0.052	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0045*	0.021	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0097*	0.10	"	"	"	"	"	
Methylene Chloride	"	**0.51** J	*0.010*	0.10	"	"	"	"	"	B
4-Isopropyltoluene	"	**0.028**	*0.0073*	0.10	"	"	"	"	"	J
cis-1,2-Dichloroethene	"	ND	*0.0063*	0.10	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0092*	0.10	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.010*	0.10	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.031*	0.10	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.010*	0.042	"	"	"	"	"	
Benzene	"	**0.0097**	*0.0066*	0.042	"	"	"	"	"	J
Chloroform	"	ND	*0.0055*	0.10	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0084*	0.10	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.013*	0.10	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-03RE1 (GTP3-3.5-082709)		**Soil**			**Sampled: 08/27/09 14:15**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0058*	0.10	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:06	
Carbon tetrachloride	"	ND	*0.0097*	0.052	"	"	"	"	"	
Trichloroethene	"	ND	*0.0089*	0.042	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.010*	0.031	"	"	"	"	"	
Dibromomethane	"	ND	*0.010*	0.10	"	"	"	"	"	
Toluene	"	**0.20**	*0.0063*	0.10	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0079*	0.10	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0047*	0.031	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0063*	0.042	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0060*	0.10	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0055*	0.052	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.013*	0.10	"	"	"	"	"	
Ethylbenzene	"	**0.012**	*0.0097*	0.10	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.013*	0.10	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.021*	0.10	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0087*	0.026	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.061**	*0.020*	0.10	"	"	"	"	"	J
o-Xylene	"	ND	*0.0060*	0.10	"	"	"	"	"	
Styrene	"	ND	*0.010*	0.10	"	"	"	"	"	
Bromoform	"	ND	*0.029*	0.10	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0047*	0.10	"	"	"	"	"	
Bromobenzene	"	ND	*0.0071*	0.10	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0073*	0.10	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.030*	0.10	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.014*	0.10	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.011*	0.10	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.019*	0.10	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.17*	0.52	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.013*	0.10	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.015*	0.10	"	"	"	"	"	
Naphthalene	"	**0.067**	*0.016*	0.10	"	"	"	"	"	J

Surrogate(s):	*Toluene-d8 (Surr)*	*101%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*106%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*107%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*106%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
Bromomethane	8260B STD Dry	ND	*0.00075*	0.0019	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 15:38	
Chloroethane	"	ND	*0.00052*	0.0019	"	"	"	"	"	
Chloromethane	"	ND	*0.00034*	0.0019	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00035*	0.0019	"	"	"	"	"	
Chloroform	"	ND	*0.00029*	0.0019	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00026*	0.0019	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00031*	0.0019	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00072*	0.0019	"	"	"	"	"	
Trichloroethene	"	ND	*0.00034*	0.0019	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00033*	0.0019	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00014*	0.0019	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00023*	0.0019	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00017*	0.0039	"	"	"	"	"	
Bromoform	"	ND	*0.00014*	0.0019	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00070*	0.0019	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00035*	0.0039	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00065*	0.0019	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*	*115%*			*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)	*99%*			*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)	*118%*			*85 - 120 %*	"			"	
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0039*	0.088	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:29	
1,2-Dichlorobenzene	"	ND	*0.0057*	0.088	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.028*	0.088	"	"	"	"	"	
Bromomethane	"	ND	*0.055*	0.31	"	"	"	"	"	
Chloroethane	"	ND	*0.050*	0.88	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.018*	0.088	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0070*	0.088	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.021**	*0.0046*	0.088	"	"	"	"	"	J
Chloromethane	"	ND	*0.13*	0.88	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.011*	0.088	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.011*	0.044	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0037*	0.018	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0081*	0.088	"	"	"	"	"	
Methylene Chloride	"	~~0.032~~	*0.0083*	0.088 U	"	"	"	"	"	J,B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
4-Isopropyltoluene	8260B STD Dry	**18**	*0.061*	0.88	mg/Kg dry	10x	49928	09/09/09 15:36	09/10/09 23:36	
cis-1,2-Dichloroethene	"	ND	*0.0053*	0.088	"	1x	"	"	09/09/09 18:29	
trans-1,2-Dichloroethene	"	ND	*0.0077*	0.088	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0083*	0.088	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.026*	0.088	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0088*	0.035	"	"	"	"	"	
Benzene	"	ND	*0.0055*	0.035	"	"	"	"	"	
Chloroform	"	ND	*0.0046*	0.088	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0070*	0.088	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.011*	0.088	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0048*	0.088	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0081*	0.044	"	"	"	"	"	
Trichloroethene	"	ND	*0.0074*	0.035	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0085*	0.026	"	"	"	"	"	
Dibromomethane	"	ND	*0.0088*	0.088	"	"	"	"	"	
Toluene	"	**0.081**	*0.0053*	0.088	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0066*	0.088	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0039*	0.026	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0053*	0.035	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0050*	0.088	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0046*	0.044	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.011*	0.088	"	"	"	"	"	
Ethylbenzene	"	**0.072**	*0.0081*	0.088	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.011*	0.088	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.018*	0.088	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0072*	0.022	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.025**	*0.017*	0.088	"	"	"	"	"	J
o-Xylene	"	**0.010**	*0.0050*	0.088	"	"	"	"	"	J
Styrene	"	ND	*0.0083*	0.088	"	"	"	"	"	
Bromoform	"	ND	*0.024*	0.088	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0039*	0.088	"	"	"	"	"	
Bromobenzene	"	ND	*0.0059*	0.088	"	"	"	"	"	
N-Propylbenzene	"	**0.056**	*0.0061*	0.088	"	"	"	"	"	J
1,2,3-Trichloropropane	"	ND	*0.025*	0.088	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.012*	0.088	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0092*	0.088	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.016*	0.088	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-04RE1 (GTP3-5-082709)		**Soil**			**Sampled: 08/27/09 14:35**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.14*	0.44	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:29	
1,2,4-Trichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.011*	0.088	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.012*	0.088	"	"	"	"	"	
Naphthalene	"	**0.050**	*0.013*	0.088	"	"	"	"	"	J
Surrogate(s): Toluene-d8 (Surr)			*98%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*114%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*101%*		*75 - 125 %*	"			"	
SSH0168-05 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
Bromomethane	8260B STD Dry	ND	*0.00038*	0.00099	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:02	
Chloroethane	"	ND	*0.00026*	0.00099	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00099	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00018*	0.00099	"	"	"	"	"	
Chloroform	"	ND	*0.00015*	0.00099	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00099	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00016*	0.00099	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00037*	0.00099	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00099	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00017*	0.00099	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000073*	0.00099	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00012*	0.00099	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000087*	0.0020	"	"	"	"	"	
Bromoform	"	ND	*0.000071*	0.00099	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00036*	0.00099	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00018*	0.0020	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00033*	0.00099	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*98%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*100%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*108%*		*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05RE1 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0032*	0.070	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:53	
1,2-Dichlorobenzene	"	ND	*0.0046*	0.070	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.023*	0.070	"	"	"	"	"	
Bromomethane	"	ND	*0.044*	0.25	"	"	"	"	"	
Chloroethane	"	ND	*0.040*	0.70	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.014*	0.070	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0056*	0.070	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0037*	0.070	"	"	"	"	"	
Chloromethane	"	ND	*0.11*	0.70	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0088*	0.035	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0030*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0065*	0.070	"	"	"	"	"	
Methylene Chloride	"	**0.13** J	*0.0067*	0.070	"	"	"	"	"	B
4-Isopropyltoluene	"	**0.10**	*0.0049*	0.070	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0042*	0.070	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0062*	0.070	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0067*	0.070	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.021*	0.070	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0070*	0.028	"	"	"	"	"	
Benzene	"	ND	*0.0044*	0.028	"	"	"	"	"	
Chloroform	"	ND	*0.0037*	0.070	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0056*	0.070	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0039*	0.070	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0065*	0.035	"	"	"	"	"	
Trichloroethene	"	ND	*0.0060*	0.028	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0069*	0.021	"	"	"	"	"	
Dibromomethane	"	ND	*0.0070*	0.070	"	"	"	"	"	
Toluene	"	**0.010**	*0.0042*	0.070	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0053*	0.070	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0032*	0.021	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0042*	0.028	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0040*	0.070	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0037*	0.035	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-05RE1 (GTP3-13.5-082709)		**Soil**			**Sampled: 08/27/09 14:49**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0088*	0.070	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 18:53	
Ethylbenzene	"	ND	*0.0065*	0.070	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0084*	0.070	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.014*	0.070	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0058*	0.018	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.014**	*0.014*	0.070	"	"	"	"	"	J
o-Xylene	"	**0.0067**	*0.0040*	0.070	"	"	"	"	"	J
Styrene	"	ND	*0.0067*	0.070	"	"	"	"	"	
Bromoform	"	ND	*0.019*	0.070	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0032*	0.070	"	"	"	"	"	
Bromobenzene	"	ND	*0.0047*	0.070	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0049*	0.070	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.020*	0.070	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0095*	0.070	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0074*	0.070	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.013*	0.070	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.12*	0.35	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0088*	0.070	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0098*	0.070	"	"	"	"	"	
Naphthalene	"	ND	*0.011*	0.070	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*100%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*113%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*106%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*107%*			*75 - 125 %*	"			"	
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
Bromomethane	8260B STD Dry	ND	*0.00046*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:26	
Chloroethane	"	ND	*0.00032*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00044*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000088*	0.0012	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00014*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:26	
1,1,2,2-Tetrachloroethane	"	ND	*0.000110*	0.0024	"	"	"	"	"	
Bromoform	"	ND	*0.000085*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00043*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00022*	0.0024	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*99%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*101%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*108%*			*85 - 120 %*	"			"	
SSH0168-06RE1 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0020*	0.044	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:18	
1,2-Dichlorobenzene	"	ND	*0.0029*	0.044	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.014*	0.044	"	"	"	"	"	
Bromomethane	"	ND	*0.028*	0.16	"	"	"	"	"	
Chloroethane	"	ND	*0.026*	0.44	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0089*	0.044	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0036*	0.044	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.41**	*0.0023*	0.044	"	"	"	"	"	
Chloromethane	"	ND	*0.067*	0.44	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0055*	0.044	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0055*	0.022	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0019*	0.0089	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0041*	0.044	"	"	"	"	"	
Methylene Chloride	"	~~0.016~~	*0.0042*	0.044 U	"	"	"	"	"	~~LB~~
4-Isopropyltoluene	"	**0.022**	*0.0031*	0.044	"	"	"	"	"	J
cis-1,2-Dichloroethene	"	ND	*0.0027*	0.044	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0039*	0.044	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0042*	0.044	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.013*	0.044	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0044*	0.018	"	"	"	"	"	
Benzene	"	**0.026**	*0.0028*	0.018	"	"	"	"	"	
Chloroform	"	ND	*0.0023*	0.044	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0036*	0.044	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0055*	0.044	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-06RE1 (GTP4-2.5-082709)		**Soil**			**Sampled: 08/27/09 15:40**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0024*	0.044	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:18	
Carbon tetrachloride	"	ND	*0.0041*	0.022	"	"	"	"	"	
Trichloroethene	"	ND	*0.0038*	0.018	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0043*	0.013	"	"	"	"	"	
Dibromomethane	"	ND	*0.0044*	0.044	"	"	"	"	"	
Toluene	"	**0.21**	*0.0027*	0.044	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0033*	0.044	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0020*	0.013	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0027*	0.018	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0026*	0.044	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0023*	0.022	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0055*	0.044	"	"	"	"	"	
Ethylbenzene	"	**0.039**	*0.0041*	0.044	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.0053*	0.044	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0089*	0.044	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0037*	0.011	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.59**	*0.0087*	0.044	"	"	"	"	"	
o-Xylene	"	**0.41**	*0.0026*	0.044	"	"	"	"	"	
Styrene	"	ND	*0.0042*	0.044	"	"	"	"	"	
Bromoform	"	ND	*0.012*	0.044	"	"	"	"	"	
Isopropylbenzene	"	**0.0066**	*0.0020*	0.044	"	"	"	"	"	J
Bromobenzene	"	ND	*0.0030*	0.044	"	"	"	"	"	
N-Propylbenzene	"	**0.019**	*0.0031*	0.044	"	"	"	"	"	J
1,2,3-Trichloropropane	"	ND	*0.013*	0.044	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0060*	0.044	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.27**	*0.0047*	0.044	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0081*	0.044	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.073*	0.22	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0055*	0.044	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0062*	0.044	"	"	"	"	"	
Naphthalene	"	**0.14**	*0.0067*	0.044	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*99%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*114%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*103%*	*75 - 125 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
Bromomethane	8260B STD Dry	ND	*0.00046*	0.0012	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 16:49	
Chloroethane	"	ND	*0.00032*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000089*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0024	"	"	"	"	"	
Bromoform	"	ND	*0.000086*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00043*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00022*	0.0024	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*102%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*102%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*106%*		*85 - 120 %*	"			"	
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0022*	0.048	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	
1,2-Dichlorobenzene	"	ND	*0.0031*	0.048	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.016*	0.048	"	"	"	"	"	
Bromomethane	"	ND	*0.030*	0.17	"	"	"	"	"	
Chloroethane	"	ND	*0.028*	0.48	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0096*	0.048	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0039*	0.048	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0025*	0.048	"	"	"	"	"	
Chloromethane	"	ND	*0.072*	0.48	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0060*	0.024	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0020*	0.0096	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0045*	0.048	"	"	"	"	"	
Methylene Chloride	"	~~0.019~~	*0.0046*	0.048 U	"	"	"	"	"	J,B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
4-Isopropyltoluene	8260B STD Dry	**0.014**	*0.0034*	0.048	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	J
cis-1,2-Dichloroethene	"	ND	*0.0029*	0.048	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0042*	0.048	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0046*	0.048	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.014*	0.048	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0048*	0.019	"	"	"	"	"	
Benzene	"	ND	*0.0030*	0.019	"	"	"	"	"	
Chloroform	"	ND	*0.0025*	0.048	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0039*	0.048	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0026*	0.048	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0045*	0.024	"	"	"	"	"	
Trichloroethene	"	ND	*0.0041*	0.019	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0047*	0.014	"	"	"	"	"	
Dibromomethane	"	ND	*0.0048*	0.048	"	"	"	"	"	
Toluene	"	ND	*0.0029*	0.048	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0036*	0.048	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0022*	0.014	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0029*	0.019	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0028*	0.048	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0025*	0.024	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0060*	0.048	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0045*	0.048	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0058*	0.048	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0096*	0.048	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0040*	0.012	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.012**	*0.0094*	0.048	"	"	"	"	"	J
o-Xylene	"	ND	*0.0028*	0.048	"	"	"	"	"	
Styrene	"	ND	*0.0046*	0.048	"	"	"	"	"	
Bromoform	"	ND	*0.013*	0.048	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0022*	0.048	"	"	"	"	"	
Bromobenzene	"	ND	*0.0033*	0.048	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0034*	0.048	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.014*	0.048	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0065*	0.048	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0051*	0.048	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0088*	0.048	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-07RE1 (GTP4-8.0-082709)		**Soil**			**Sampled: 08/27/09 15:59**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.079*	0.24	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 19:42	
1,2,4-Trichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0060*	0.048	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0067*	0.048	"	"	"	"	"	
Naphthalene	"	ND	*0.0072*	0.048	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*98%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*105%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*102%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*106%*		*75 - 125 %*	"			"	
SSH0168-09 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
Bromomethane	8260B STD Dry	ND	*0.00043*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:13	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00020*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000083*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000099*	0.0023	"	"	"	"	"	
Bromoform	"	ND	*0.000081*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0023	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00038*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*99%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*103%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*105%*		*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09RE1 (GTP5-3.0-082709)		**Soil**			**Sampled: 08/27/09 16:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0027*	0.060	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:06	
1,2-Dichlorobenzene	"	ND	*0.0039*	0.060	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.019*	0.060	"	"	"	"	"	
Bromomethane	"	ND	*0.037*	0.21	"	"	"	"	"	
Chloroethane	"	ND	*0.034*	0.60	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.060	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0048*	0.060	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0031*	0.060	"	"	"	"	"	
Chloromethane	"	ND	*0.090*	0.60	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0075*	0.030	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0025*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0055*	0.060	"	"	"	"	"	
Methylene Chloride	"	0.047	*0.0057*	0.060	U "	"	"	"	"	J B
4-Isopropyltoluene	"	ND	*0.0042*	0.060	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0036*	0.060	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0052*	0.060	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0057*	0.060	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.060	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0060*	0.024	"	"	"	"	"	
Benzene	"	ND	*0.0037*	0.024	"	"	"	"	"	
Chloroform	"	ND	*0.0031*	0.060	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0048*	0.060	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0033*	0.060	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0055*	0.030	"	"	"	"	"	
Trichloroethene	"	ND	*0.0051*	0.024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0058*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0060*	0.060	"	"	"	"	"	
Toluene	"	ND	*0.0036*	0.060	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0045*	0.060	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0027*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0036*	0.024	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0034*	0.060	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0031*	0.030	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-09RE1 (GTP5-3.0-082709)		**Soil**				**Sampled: 08/27/09 16:40**				
1,3-Dichloropropane	8260B STD Dry	ND	*0.0075*	0.060	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:06	
Ethylbenzene	"	ND	*0.0055*	0.060	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0072*	0.060	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.060	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0049*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.012*	0.060	"	"	"	"	"	
o-Xylene	"	ND	*0.0034*	0.060	"	"	"	"	"	
Styrene	"	ND	*0.0057*	0.060	"	"	"	"	"	
Bromoform	"	ND	*0.016*	0.060	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0027*	0.060	"	"	"	"	"	
Bromobenzene	"	ND	*0.0040*	0.060	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0042*	0.060	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.017*	0.060	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0081*	0.060	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0063*	0.060	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.011*	0.060	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.099*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0084*	0.060	"	"	"	"	"	
Naphthalene	"	ND	*0.0090*	0.060	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*97%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*104%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*97%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*103%*			*75 - 125 %*	"			"	
SSH0168-10 (GTP5-7.0-082709)		**Soil**				**Sampled: 08/27/09 16:53**				
Bromomethane	8260B STD Dry	ND	*0.0013*	0.0035	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:37	
Chloroethane	"	ND	*0.00093*	0.0035	"	"	"	"	"	
Chloromethane	"	ND	*0.00061*	0.0035	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00061*	0.0035	"	"	"	"	"	
Chloroform	"	ND	*0.00051*	0.0035	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00046*	0.0035	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00055*	0.0035	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0013*	0.0035	"	"	"	"	"	
Trichloroethene	"	ND	*0.00061*	0.0035	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00059*	0.0035	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00026*	0.0035	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00040*	0.0035	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 17:37	
1,1,2,2-Tetrachloroethane	"	ND	*0.00030*	0.0069	"	"	"	"	"	
Bromoform	"	ND	*0.00025*	0.0035	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0012*	0.0035	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00063*	0.0069	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0012*	0.0035	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*116%*			*85 - 115 %*	"		"		*X. I*
1,2-Dichloroethane-d4 (Surr)		*105%*			*75 - 125 %*	"		"		
4-Bromofluorobenzene (Surr)		*133%*			*85 - 120 %*	"		"		*X. I*
SSH0168-10RE1 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0070*	0.16	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:30	
1,2-Dichlorobenzene	"	ND	*0.010*	0.16	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.051*	0.16	"	"	"	"	"	
Bromomethane	"	ND	*0.097*	0.54	"	"	"	"	"	
Chloroethane	"	ND	*0.089*	1.6	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.031*	0.16	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.16	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.12**	*0.0082*	0.16	"	"	"	"	"	J
Chloromethane	"	ND	*0.23*	1.6	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.019*	0.16	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.019*	0.078	"	"	"	"	"	
sec-Butylbenzene	"	**0.036**	*0.019*	0.16	"	"	"	"	"	J
Vinyl chloride	"	ND	*0.0066*	0.031	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.16	"	"	"	"	"	
Methylene Chloride	"	~~0.054~~	*0.015*	0.16 U	"	"	"	"	"	~~J, B~~
4-Isopropyltoluene	"	**0.15**	*0.011*	0.16	"	"	"	"	"	J
cis-1,2-Dichloroethene	"	ND	*0.0093*	0.16	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.014*	0.16	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.015*	0.16	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.047*	0.16	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.016*	0.062	"	"	"	"	"	
Benzene	"	ND	*0.0097*	0.062	"	"	"	"	"	
Chloroform	"	ND	*0.0082*	0.16	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.16	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.019*	0.16	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-10RE1 (GTP5-7.0-082709)		**Soil**			**Sampled: 08/27/09 16:53**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0086*	0.16	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:30	
Carbon tetrachloride	"	ND	*0.014*	0.078	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.062	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.015*	0.047	"	"	"	"	"	
Dibromomethane	"	ND	*0.016*	0.16	"	"	"	"	"	
Toluene	"	**0.095**	*0.0093*	0.16	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.012*	0.16	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0070*	0.047	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0093*	0.062	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0089*	0.16	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0082*	0.078	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.019*	0.16	"	"	"	"	"	
Ethylbenzene	"	**0.088**	*0.014*	0.16	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.019*	0.16	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.031*	0.16	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.013*	0.039	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.030*	0.16	"	"	"	"	"	
o-Xylene	"	**0.012**	*0.0089*	0.16	"	"	"	"	"	J
Styrene	"	ND	*0.015*	0.16	"	"	"	"	"	
Bromoform	"	ND	*0.043*	0.16	"	"	"	"	"	
Isopropylbenzene	"	**0.030**	*0.0070*	0.16	"	"	"	"	"	J
Bromobenzene	"	ND	*0.010*	0.16	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.011*	0.16	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.045*	0.16	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.021*	0.16	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.058**	*0.016*	0.16	"	"	"	"	"	J
n-Butylbenzene	"	ND	*0.028*	0.16	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.26*	0.78	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.019*	0.16	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.022*	0.16	"	"	"	"	"	
Naphthalene	"	**0.090**	*0.023*	0.16	"	"	"	"	"	J

Surrogate(s):	*Toluene-d8 (Surr)*	*97%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*111%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*103%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11 (GTP6-10-082809)		Soil			Sampled: 08/28/09 10:36					
Bromomethane	8260B STD Dry	ND	*0.0011*	0.0028	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:36	
Chloroethane	"	ND	*0.00076*	0.0028	"	"	"	"	"	
Chloromethane	"	ND	*0.00050*	0.0028	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00051*	0.0028	"	"	"	"	"	
Chloroform	"	ND	*0.00042*	0.0028	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00038*	0.0028	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00046*	0.0028	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0011*	0.0028	"	"	"	"	"	
Trichloroethene	"	ND	*0.00050*	0.0028	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00049*	0.0028	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00021*	0.0028	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00033*	0.0028	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00025*	0.0057	"	"	"	"	"	
Bromoform	"	ND	*0.00021*	0.0028	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0010*	0.0028	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00052*	0.0057	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00096*	0.0028	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*117%*		*85 - 115 %*	"		"		*X. 1*
	1,2-Dichloroethane-d4 (Surr)		*106%*		*75 - 125 %*	"		"		
	4-Bromofluorobenzene (Surr)		*128%*		*85 - 120 %*	"		"		*X. 1*
SSH0168-11RE1 (GTP6-10-082809)		Soil			Sampled: 08/28/09 10:36					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0064*	0.14	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:56	
1,2-Dichlorobenzene	"	ND	*0.0093*	0.14	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.047*	0.14	"	"	"	"	"	
Bromomethane	"	ND	*0.090*	0.50	"	"	"	"	"	
Chloroethane	"	ND	*0.082*	1.4	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.029*	0.14	"	"	"	"	"	
tert-Butylbenzene	"	**0.16**	*0.011*	0.14	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**53**	*0.075*	1.4	"	10x	"	"	09/11/09 00:00	
Chloromethane	"	ND	*0.21*	1.4	"	1x	"	"	09/10/09 00:56	
Trichlorofluoromethane	"	ND	*0.018*	0.14	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.018*	0.072	"	"	"	"	"	
sec-Butylbenzene	"	**4.5**	*0.018*	0.14	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0061*	0.029	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.013*	0.14	"	"	"	"	"	
Methylene Chloride	"	**0.40** J	*0.014*	0.14	"	"	"	"	"	B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11RE1 (GTP6-10-082809)		**Soil**			**Sampled: 08/28/09 10:36**					
4-Isopropyltoluene	8260B STD Dry	**27**	*0.010*	0.14	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:56	
cis-1,2-Dichloroethene	"	ND	*0.0086*	0.14	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.013*	0.14	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.014*	0.14	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.043*	0.14	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.014*	0.057	"	"	"	"	"	
Benzene	"	**0.045**	*0.0090*	0.057	"	"	"	"	"	J
Chloroform	"	ND	*0.0075*	0.14	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.011*	0.14	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.018*	0.14	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0079*	0.14	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.013*	0.072	"	"	"	"	"	
Trichloroethene	"	ND	*0.012*	0.057	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.014*	0.043	"	"	"	"	"	
Dibromomethane	"	ND	*0.014*	0.14	"	"	"	"	"	
Toluene	"	**0.12**	*0.0086*	0.14	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.011*	0.14	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0064*	0.043	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0086*	0.057	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0082*	0.14	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0075*	0.072	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.018*	0.14	"	"	"	"	"	
Ethylbenzene	"	**3.2**	*0.013*	0.14	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.017*	0.14	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.029*	0.14	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.012*	0.036	"	"	"	"	"	
m-Xylene & p-Xylene	"	**9.0**	*0.028*	0.14	"	"	"	"	"	
o-Xylene	"	**5.5**	*0.0082*	0.14	"	"	"	"	"	
Styrene	"	ND	*0.014*	0.14	"	"	"	"	"	
Bromoform	"	ND	*0.039*	0.14	"	"	"	"	"	
Isopropylbenzene	"	**1.6**	*0.0064*	0.14	"	"	"	"	"	
Bromobenzene	"	ND	*0.0097*	0.14	"	"	"	"	"	
N-Propylbenzene	"	**4.3**	*0.010*	0.14	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.042*	0.14	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.019*	0.14	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**13**	*0.015*	0.14	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.026*	0.14	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.24*	0.72	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-11RE1 (GTP6-10-082809)		**Soil**				**Sampled: 08/28/09 10:36**				
1,2,4-Trichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.018*	0.14	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.020*	0.14	"	"	"	"	"	
Naphthalene	"	**38**	*0.21*	1.4	"	10x	"	"	09/11/09 00:00	
Surrogate(s): *Toluene-d8 (Surr)*		*100%*			*85 - 115 %*	*1x*			*09/10/09 00:56*	
Ethylbenzene-d10		*110%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*102%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*106%*			*75 - 125 %*	"			"	
SSH0168-12 (GTP6-2.5-082809)		**Soil**				**Sampled: 08/28/09 10:10**				
Bromomethane	8260B STD Dry	ND	*0.00044*	0.0011	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 17:54	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00020*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000084*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00010*	0.0023	"	"	"	"	"	
Bromoform	"	ND	*0.000082*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00021*	0.0023	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00038*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*100%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*104%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*109%*			*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12RE1 (GTP6-2.5-082809)		**Soil**					**Sampled: 08/28/09 10:10**			
1,1-Dichloropropene	8260B STD Dry	ND	*0.0025*	0.056	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:55	
1,2-Dichlorobenzene	"	ND	*0.0036*	0.056	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.018*	0.056	"	"	"	"	"	
Bromomethane	"	ND	*0.035*	0.19	"	"	"	"	"	
Chloroethane	"	ND	*0.032*	0.56	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.056	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0044*	0.056	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0029*	0.056	"	"	"	"	"	
Chloromethane	"	ND	*0.083*	0.56	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0069*	0.028	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0024*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0051*	0.056	"	"	"	"	"	
Methylene Chloride	"	0.043	*0.0053*	0.056	"	"	"	"	"	J,B
4-Isopropyltoluene	"	ND	*0.0039*	0.056	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0033*	0.056	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0049*	0.056	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0053*	0.056	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.017*	0.056	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0056*	0.022	"	"	"	"	"	
Benzene	"	ND	*0.0035*	0.022	"	"	"	"	"	
Chloroform	"	ND	*0.0029*	0.056	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0044*	0.056	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0031*	0.056	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0051*	0.028	"	"	"	"	"	
Trichloroethene	"	ND	*0.0047*	0.022	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0054*	0.017	"	"	"	"	"	
Dibromomethane	"	ND	*0.0056*	0.056	"	"	"	"	"	
Toluene	"	ND	*0.0033*	0.056	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0042*	0.056	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0025*	0.017	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0033*	0.022	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0032*	0.056	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0029*	0.028	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-12RE1 (GTP6-2.5-082809)		**Soil**			**Sampled: 08/28/09 10:10**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0069*	0.056	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 20:55	
Ethylbenzene	"	ND	*0.0051*	0.056	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0067*	0.056	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.056	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0046*	0.014	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.011*	0.056	"	"	"	"	"	
o-Xylene	"	ND	*0.0032*	0.056	"	"	"	"	"	
Styrene	"	ND	*0.0053*	0.056	"	"	"	"	"	
Bromoform	"	ND	*0.015*	0.056	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0025*	0.056	"	"	"	"	"	
Bromobenzene	"	ND	*0.0037*	0.056	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0039*	0.056	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.016*	0.056	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0075*	0.056	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0058*	0.056	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.010*	0.056	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.092*	0.28	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0069*	0.056	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0078*	0.056	"	"	"	"	"	
Naphthalene	"	ND	*0.0083*	0.056	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*97%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*107%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*98%*		*85 - 120 %*	"			"	
Trifluorotoluene (Surr)			*94%*		*75 - 125 %*	"			"	
Fluorobenzene (Surr)			*104%*		*75 - 125 %*	"			"	
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Bromomethane	8260B STD Dry	ND	*0.00058*	0.0015	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:18	
Chloroethane	"	ND	*0.00041*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00027*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00022*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00024*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00056*	0.0015	"	"	"	"	"	
Trichloroethene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00026*	0.0015	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
Dichlorobromomethane	8260B STD Dry	ND	*0.00011*	0.0015	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:18	
cis-1,3-Dichloropropene	"	ND	*0.00018*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00013*	0.0030	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00055*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00028*	0.0030	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00051*	0.0015	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*103%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*101%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*120%*		*85 - 120 %*	"			"	
SSH0168-13RE1 (GTP6-17-082809)		**Soil**			**Sampled: 08/28/09 11:11**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0040*	0.089	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:18	
1,2-Dichlorobenzene	"	ND	*0.0058*	0.089	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.029*	0.089	"	"	"	"	"	
Bromomethane	"	ND	*0.055*	0.31	"	"	"	"	"	
Chloroethane	"	ND	*0.051*	0.89	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.018*	0.089	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0071*	0.089	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.42**	*0.0047*	0.089	"	"	"	"	"	
Chloromethane	"	ND	*0.13*	0.89	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.011*	0.089	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.011*	0.044	"	"	"	"	"	
sec-Butylbenzene	"	**0.051**	*0.011*	0.089	"	"	"	"	"	J
Vinyl chloride	"	ND	*0.0038*	0.018	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0082*	0.089	"	"	"	"	"	
Methylene Chloride	"	**0.30** J	*0.0084*	0.089	"	"	"	"	"	B
4-Isopropyltoluene	"	**0.55**	*0.0062*	0.089	"	"	"	"	"	
cis-1,2-Dichloroethene	"	**0.095**	*0.0053*	0.089	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0078*	0.089	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0084*	0.089	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.027*	0.089	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0089*	0.036	"	"	"	"	"	
Benzene	"	ND	*0.0055*	0.036	"	"	"	"	"	
Chloroform	"	ND	*0.0047*	0.089	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0071*	0.089	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-13RE1 (GTP6-17-082809)		**Soil**				**Sampled: 08/28/09 11:11**				
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.011*	0.089	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:18	
1,2-Dichloroethane	"	ND	*0.0049*	0.089	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0082*	0.044	"	"	"	"	"	
Trichloroethene	"	**0.023**	*0.0075*	0.036	"	"	"	"	"	J
1,2-Dichloropropane	"	ND	*0.0087*	0.027	"	"	"	"	"	
Dibromomethane	"	ND	*0.0089*	0.089	"	"	"	"	"	
Toluene	"	**0.018**	*0.0053*	0.089	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0067*	0.089	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0040*	0.027	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0053*	0.036	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0051*	0.089	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0047*	0.044	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.011*	0.089	"	"	"	"	"	
Ethylbenzene	"	**0.072**	*0.0082*	0.089	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.011*	0.089	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.018*	0.089	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0073*	0.022	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.16**	*0.017*	0.089	"	"	"	"	"	
o-Xylene	"	**0.088**	*0.0051*	0.089	"	"	"	"	"	J
Styrene	"	ND	*0.0084*	0.089	"	"	"	"	"	
Bromoform	"	ND	*0.024*	0.089	"	"	"	"	"	
Isopropylbenzene	"	**0.031**	*0.0040*	0.089	"	"	"	"	"	J
Bromobenzene	"	ND	*0.0060*	0.089	"	"	"	"	"	
N-Propylbenzene	"	**0.053**	*0.0062*	0.089	"	"	"	"	"	J
1,2,3-Trichloropropane	"	ND	*0.026*	0.089	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.012*	0.089	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.12**	*0.0093*	0.089	"	"	"	"	"	
n-Butylbenzene	"	**0.35**	*0.016*	0.089	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.15*	0.44	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.011*	0.089	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.012*	0.089	"	"	"	"	"	
Naphthalene	"	**0.36**	*0.013*	0.089	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*100%*		*85 - 115 %*	"			"	
	Ethylbenzene-d10		*107%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*102%*		*85 - 120 %*	"			"	
	Fluorobenzene (Surr)		*105%*		*75 - 125 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
Bromomethane	8260B STD Dry	ND	*0.00048*	0.0012	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 18:41	
Chloroethane	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000092*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00011*	0.0025	"	"	"	"	"	
Bromoform	"	ND	*0.000089*	0.0012	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*101%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*100%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*104%*		*85 - 120 %*	"			"	
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0022*	0.049	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	
1,2-Dichlorobenzene	"	ND	*0.0032*	0.049	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.016*	0.049	"	"	"	"	"	
Bromomethane	"	ND	*0.031*	0.17	"	"	"	"	"	
Chloroethane	"	ND	*0.028*	0.49	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0098*	0.049	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0039*	0.049	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0026*	0.049	"	"	"	"	"	
Chloromethane	"	ND	*0.073*	0.49	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0061*	0.024	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0021*	0.0098	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0045*	0.049	"	"	"	"	"	
Methylene Chloride	"	~~0.030~~	*0.0047*	0.049 U	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
4-Isopropyltoluene	8260B STD Dry	**0.0049**	*0.0034*	0.049	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	J
cis-1,2-Dichloroethene	"	ND	*0.0029*	0.049	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0043*	0.049	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0047*	0.049	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.015*	0.049	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0049*	0.020	"	"	"	"	"	
Benzene	"	ND	*0.0031*	0.020	"	"	"	"	"	
Chloroform	"	ND	*0.0026*	0.049	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0039*	0.049	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0027*	0.049	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0045*	0.024	"	"	"	"	"	
Trichloroethene	"	ND	*0.0042*	0.020	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0048*	0.015	"	"	"	"	"	
Dibromomethane	"	ND	*0.0049*	0.049	"	"	"	"	"	
Toluene	"	ND	*0.0029*	0.049	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0037*	0.049	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0022*	0.015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0029*	0.020	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0028*	0.049	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0026*	0.024	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0061*	0.049	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0045*	0.049	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0059*	0.049	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0098*	0.049	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0040*	0.012	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0095*	0.049	"	"	"	"	"	
o-Xylene	"	ND	*0.0028*	0.049	"	"	"	"	"	
Styrene	"	ND	*0.0047*	0.049	"	"	"	"	"	
Bromoform	"	ND	*0.013*	0.049	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0022*	0.049	"	"	"	"	"	
Bromobenzene	"	ND	*0.0033*	0.049	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0034*	0.049	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.014*	0.049	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0066*	0.049	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0051*	0.049	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0089*	0.049	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-14RE1 (GTP7-2.5-082809)		**Soil**			**Sampled: 08/28/09 12:50**					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.081*	0.24	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 21:42	
1,2,4-Trichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0061*	0.049	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0069*	0.049	"	"	"	"	"	
Naphthalene	"	ND	*0.0073*	0.049	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*101%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*106%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*101%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*103%*		*75 - 125 %*	"			"	
SSH0168-15 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
Bromomethane	8260B STD Dry	ND	*0.00037*	0.00097	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:05	
Chloroethane	"	ND	*0.00026*	0.00097	"	"	"	"	"	
Chloromethane	"	ND	*0.00017*	0.00097	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00017*	0.00097	"	"	"	"	"	
Chloroform	"	ND	*0.00014*	0.00097	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00013*	0.00097	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00015*	0.00097	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00036*	0.00097	"	"	"	"	"	
Trichloroethene	"	ND	*0.00017*	0.00097	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00017*	0.00097	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000072*	0.00097	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00011*	0.00097	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000085*	0.0019	"	"	"	"	"	
Bromoform	"	ND	*0.000070*	0.00097	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00035*	0.00097	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00018*	0.0019	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00033*	0.00097	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*104%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*114%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*114%*		*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15RE1 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0019*	0.041	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:06	
1,2-Dichlorobenzene	"	ND	*0.0027*	0.041	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.013*	0.041	"	"	"	"	"	
Bromomethane	"	ND	*0.026*	0.15	"	"	"	"	"	
Chloroethane	"	ND	*0.024*	0.41	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0022*	0.041	"	"	"	"	"	
Chloromethane	"	ND	*0.062*	0.41	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0052*	0.021	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0018*	0.0083	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0038*	0.041	"	"	"	"	"	
Methylene Chloride	"	~~0.011~~	*0.0039*	0.041 LL	"	"	"	"	"	J,B
4-Isopropyltoluene	"	ND	*0.0029*	0.041	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0025*	0.041	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0036*	0.041	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0039*	0.041	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.012*	0.041	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0041*	0.017	"	"	"	"	"	
Benzene	"	ND	*0.0026*	0.017	"	"	"	"	"	
Chloroform	"	ND	*0.0022*	0.041	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0023*	0.041	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0038*	0.021	"	"	"	"	"	
Trichloroethene	"	ND	*0.0035*	0.017	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0040*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0041*	0.041	"	"	"	"	"	
Toluene	"	ND	*0.0025*	0.041	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0031*	0.041	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0019*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0025*	0.017	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0022*	0.021	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-15RE1 (GTP7-10.0-082809)		**Soil**			**Sampled: 08/28/09 13:27**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0052*	0.041	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:06	
Ethylbenzene	"	ND	*0.0038*	0.041	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0050*	0.041	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0034*	0.010	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0081*	0.041	"	"	"	"	"	
o-Xylene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Styrene	"	ND	*0.0039*	0.041	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.041	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0019*	0.041	"	"	"	"	"	
Bromobenzene	"	ND	*0.0028*	0.041	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0029*	0.041	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.012*	0.041	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0056*	0.041	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0044*	0.041	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0076*	0.041	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.068*	0.21	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0058*	0.041	"	"	"	"	"	
Naphthalene	"	ND	*0.0062*	0.041	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*99%*		*85 - 115 %*	"			"	
	Ethylbenzene-d10		*108%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*98%*		*85 - 120 %*	"			"	
	Trifluorotoluene (Surr)		*90%*		*75 - 125 %*	"			"	
	Fluorobenzene (Surr)		*107%*		*75 - 125 %*	"			"	
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Bromomethane	8260B STD Dry	ND	*0.00029*	0.00074	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:29	
Chloroethane	"	ND	*0.00020*	0.00074	"	"	"	"	"	
Chloromethane	"	ND	*0.00013*	0.00074	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00013*	0.00074	"	"	"	"	"	
Chloroform	"	ND	*0.00011*	0.00074	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000098*	0.00074	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00012*	0.00074	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00028*	0.00074	"	"	"	"	"	
Trichloroethene	"	ND	*0.00013*	0.00074	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00013*	0.00074	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
Dichlorobromomethane	8260B STD Dry	ND	*0.000055*	0.00074	mg/Kg dry	1x	49810	09/08/09 11:31	09/08/09 19:29	
cis-1,3-Dichloropropene	"	ND	*0.000087*	0.00074	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000065*	0.0015	"	"	"	"	"	
Bromoform	"	ND	*0.000053*	0.00074	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00027*	0.00074	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00013*	0.0015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00025*	0.00074	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*105%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*112%*		*85 - 120 %*	"			"	
SSH0168-16RE1 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0018*	0.039	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:30	
1,2-Dichlorobenzene	"	ND	*0.0025*	0.039	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.013*	0.039	"	"	"	"	"	
Bromomethane	"	ND	*0.024*	0.14	"	"	"	"	"	
Chloroethane	"	ND	*0.022*	0.39	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0078*	0.039	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0031*	0.039	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0021*	0.039	"	"	"	"	"	
Chloromethane	"	ND	*0.059*	0.39	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0049*	0.039	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0049*	0.020	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0017*	0.0078	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0036*	0.039	"	"	"	"	"	
Methylene Chloride	"	~~0.017~~	*0.0037*	0.039	U	"	"	"	"	~~1.0~~
4-Isopropyltoluene	"	ND	*0.0027*	0.039	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0023*	0.039	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0034*	0.039	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0037*	0.039	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.012*	0.039	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0039*	0.016	"	"	"	"	"	
Benzene	"	ND	*0.0024*	0.016	"	"	"	"	"	
Chloroform	"	ND	*0.0021*	0.039	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0031*	0.039	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-16RE1 (GTP7-18-082809)		**Soil**			**Sampled: 08/28/09 13:58**					
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.0049*	0.039	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:30	
1,2-Dichloroethane	"	ND	*0.0021*	0.039	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0036*	0.020	"	"	"	"	"	
Trichloroethene	"	ND	*0.0033*	0.016	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0038*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0039*	0.039	"	"	"	"	"	
Toluene	"	ND	*0.0023*	0.039	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0029*	0.039	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0018*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0023*	0.016	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0022*	0.039	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0021*	0.020	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0049*	0.039	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0036*	0.039	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0047*	0.039	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0078*	0.039	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0032*	0.0098	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.0076*	0.039	"	"	"	"	"	
o-Xylene	"	ND	*0.0022*	0.039	"	"	"	"	"	
Styrene	"	ND	*0.0037*	0.039	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.039	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0018*	0.039	"	"	"	"	"	
Bromobenzene	"	ND	*0.0026*	0.039	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0027*	0.039	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.011*	0.039	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0053*	0.039	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0041*	0.039	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0071*	0.039	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.064*	0.20	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0049*	0.039	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0055*	0.039	"	"	"	"	"	
Naphthalene	"	ND	*0.0059*	0.039	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*96%*		*85 - 115 %*	"			"	
	Ethylbenzene-d10		*107%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*96%*		*85 - 120 %*	"			"	
	Trifluorotoluene (Surr)		*79%*		*75 - 125 %*	"			"	
	Fluorobenzene (Surr)		*105%*		*75 - 125 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
Bromomethane	8260B STD Dry	ND	*0.00057*	0.0015	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:01	
Chloroethane	"	ND	*0.00039*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00022*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00019*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00055*	0.0015	"	"	"	"	"	
Trichloroethene	"	**0.060** J	*0.00026*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00017*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00013*	0.0029	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00053*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00027*	0.0029	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00049*	0.0015	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*	*122%*			*85 - 115 %*	"		"		*X. I*
	1,2-Dichloroethane-d4 (Surr)	*116%*			*75 - 125 %*	"		"		
	4-Bromofluorobenzene (Surr)	*127%*			*85 - 120 %*	"		"		*X. I*
SSH0168-17RE1 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0098*	0.22	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
1,2-Dichlorobenzene	"	ND	*0.014*	0.22	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.071*	0.22	"	"	"	"	"	
Bromomethane	"	ND	*0.14*	0.77	"	"	"	"	"	
Chloroethane	"	ND	*0.13*	2.2	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.044*	0.22	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.017*	0.22	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.011*	0.22	"	"	"	"	"	
Chloromethane	"	ND	*0.33*	2.2	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.027*	0.22	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.027*	0.11	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0093*	0.044	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.020*	0.22	"	"	"	"	"	
Methylene Chloride	"	**1.6** J	*0.021*	0.22	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17RE1 (GTP2-2.5-082709)		**Soil**			**Sampled: 08/27/09 11:40**					
4-Isopropyltoluene	8260B STD Dry	ND	*0.015*	0.22	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
cis-1,2-Dichloroethene	"	ND	*0.013*	0.22	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.019*	0.22	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.021*	0.22	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.066*	0.22	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.022*	0.087	"	"	"	"	"	
Benzene	"	ND	*0.014*	0.087	"	"	"	"	"	
Chloroform	"	ND	*0.011*	0.22	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.017*	0.22	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.027*	0.22	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.012*	0.22	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.020*	0.11	"	"	"	"	"	
Trichloroethene	"	**0.98**	*0.019*	0.087	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.021*	0.066	"	"	"	"	"	
Dibromomethane	"	ND	*0.022*	0.22	"	"	"	"	"	
Toluene	"	**0.040**	*0.013*	0.22	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.016*	0.22	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0098*	0.066	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.013*	0.087	"	"	"	"	"	
Chlorobenzene	"	ND	*0.013*	0.22	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.011*	0.11	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.027*	0.22	"	"	"	"	"	
Ethylbenzene	"	ND	*0.020*	0.22	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.026*	0.22	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.044*	0.22	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.018*	0.055	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.048**	*0.043*	0.22	"	"	"	"	"	J
o-Xylene	"	**0.017**	*0.013*	0.22	"	"	"	"	"	J
Styrene	"	ND	*0.021*	0.22	"	"	"	"	"	
Bromoform	"	ND	*0.060*	0.22	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0098*	0.22	"	"	"	"	"	
Bromobenzene	"	ND	*0.015*	0.22	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.015*	0.22	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.063*	0.22	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.030*	0.22	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.023*	0.22	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.040*	0.22	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-17RE1 (GTP2-2.5-082709)		Soil			Sampled: 08/27/09 11:40					
1,2-Dibromo-3-Chloropropane	8260B STD Dry	ND	*0.36*	1.1	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 22:55	
1,2,4-Trichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.027*	0.22	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.031*	0.22	"	"	"	"	"	
Naphthalene	"	ND	*0.033*	0.22	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*99%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*100%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*99%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*104%*		*75 - 125 %*	"			"	
SSH0168-18 (GTP2-8-082709)		Soil			Sampled: 08/27/09 11:58					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:25	
Chloroethane	"	ND	*0.00029*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00014*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00040*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.011**	*0.00019*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000080*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000095*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000078*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00039*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00036*	0.0011	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*104%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*102%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*110%*		*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18RE1 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0032*	0.072	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:19	
1,2-Dichlorobenzene	"	ND	*0.0047*	0.072	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.023*	0.072	"	"	"	"	"	
Bromomethane	"	ND	*0.045*	0.25	"	"	"	"	"	
Chloroethane	"	ND	*0.041*	0.72	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.014*	0.072	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0058*	0.072	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0038*	0.072	"	"	"	"	"	
Chloromethane	"	ND	*0.11*	0.72	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0090*	0.036	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0031*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0067*	0.072	"	"	"	"	"	
Methylene Chloride	"	**0.23** J	*0.0068*	0.072	"	"	"	"	"	B
4-Isopropyltoluene	"	ND	*0.0050*	0.072	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0043*	0.072	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0063*	0.072	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0068*	0.072	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.022*	0.072	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0072*	0.029	"	"	"	"	"	
Benzene	"	ND	*0.0045*	0.029	"	"	"	"	"	
Chloroform	"	ND	*0.0038*	0.072	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0058*	0.072	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0040*	0.072	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0067*	0.036	"	"	"	"	"	
Trichloroethene	"	**0.17**	*0.0061*	0.029	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0070*	0.022	"	"	"	"	"	
Dibromomethane	"	ND	*0.0072*	0.072	"	"	"	"	"	
Toluene	"	**0.013**	*0.0043*	0.072	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0054*	0.072	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0032*	0.022	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0043*	0.029	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0041*	0.072	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0038*	0.036	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-18RE1 (GTP2-8-082709)		**Soil**			**Sampled: 08/27/09 11:58**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0090*	0.072	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:19	
Ethylbenzene	"	ND	*0.0067*	0.072	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0086*	0.072	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.014*	0.072	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0059*	0.018	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.014*	0.072	"	"	"	"	"	
o-Xylene	"	ND	*0.0041*	0.072	"	"	"	"	"	
Styrene	"	ND	*0.0068*	0.072	"	"	"	"	"	
Bromoform	"	ND	*0.020*	0.072	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0032*	0.072	"	"	"	"	"	
Bromobenzene	"	ND	*0.0049*	0.072	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0050*	0.072	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.021*	0.072	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0097*	0.072	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0076*	0.072	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.013*	0.072	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.12*	0.36	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0090*	0.072	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.010*	0.072	"	"	"	"	"	
Naphthalene	"	ND	*0.011*	0.072	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*104%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*104%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*107%*		*75 - 125 %*	"			"	
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:49	
Chloroethane	"	ND	*0.00029*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.0011**	*0.00019*	0.0011	"	"	"	"	"	J
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000081*	0.0011	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00013*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 18:49	
1,1,2,2-Tetrachloroethane	"	ND	*0.000097*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000079*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*101%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*104%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*104%*			*85 - 120 %*	"			"	
SSH0168-19RE1 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0025*	0.055	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:44	
1,2-Dichlorobenzene	"	ND	*0.0036*	0.055	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.018*	0.055	"	"	"	"	"	
Bromomethane	"	ND	*0.034*	0.19	"	"	"	"	"	
Chloroethane	"	ND	*0.032*	0.55	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.055	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0044*	0.055	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0029*	0.055	"	"	"	"	"	
Chloromethane	"	ND	*0.083*	0.55	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0069*	0.055	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0069*	0.028	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0023*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0051*	0.055	"	"	"	"	"	
Methylene Chloride	"	~~0.015~~	*0.0052*	0.055 U	"	"	"	"	"	J,B
4-Isopropyltoluene	"	ND	*0.0039*	0.055	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0033*	0.055	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0048*	0.055	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0052*	0.055	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.017*	0.055	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0055*	0.022	"	"	"	"	"	
Benzene	"	ND	*0.0034*	0.022	"	"	"	"	"	
Chloroform	"	ND	*0.0029*	0.055	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0044*	0.055	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0069*	0.055	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-19RE1 (GTP2-13-082709)		**Soil**			**Sampled: 08/27/09 17:28**					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0030*	0.055	mg/Kg dry	1x	49928	09/09/09 15:36	09/09/09 23:44	
Carbon tetrachloride	"	ND	*0.0051*	0.028	"	"	"	"	"	
Trichloroethene	"	**0.056**	*0.0047*	0.022	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0054*	0.017	"	"	"	"	"	
Dibromomethane	"	ND	*0.0055*	0.055	"	"	"	"	"	
Toluene	"	ND	*0.0033*	0.055	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0041*	0.055	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0025*	0.017	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0033*	0.022	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0032*	0.055	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0029*	0.028	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0069*	0.055	"	"	"	"	"	
Ethylbenzene	"	ND	*0.0051*	0.055	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0066*	0.055	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.055	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0045*	0.014	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.011*	0.055	"	"	"	"	"	
o-Xylene	"	ND	*0.0032*	0.055	"	"	"	"	"	
Styrene	"	ND	*0.0052*	0.055	"	"	"	"	"	
Bromoform	"	ND	*0.015*	0.055	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0025*	0.055	"	"	"	"	"	
Bromobenzene	"	ND	*0.0037*	0.055	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0039*	0.055	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.016*	0.055	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0074*	0.055	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0058*	0.055	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.010*	0.055	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.091*	0.28	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0069*	0.055	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0077*	0.055	"	"	"	"	"	
Naphthalene	"	ND	*0.0083*	0.055	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*99%*		*85 - 115 %*	"			"	
	Ethylbenzene-d10		*105%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*98%*		*85 - 120 %*	"			"	
	Fluorobenzene (Surr)		*102%*		*75 - 125 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
Bromomethane	8260B STD Dry	ND	*0.00059*	0.0015	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 19:13	
Chloroethane	"	ND	*0.00041*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00027*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00057*	0.0015	"	"	"	"	"	
Trichloroethene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00018*	0.0015	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.00014*	0.0031	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00055*	0.0015	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00028*	0.0031	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00052*	0.0015	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*130%*		*85 - 115 %*	"		"		*X. 1*
	1,2-Dichloroethane-d4 (Surr)		*120%*		*75 - 125 %*	"		"		
	4-Bromofluorobenzene (Surr)		*136%*		*85 - 120 %*	"		"		*X. 1*
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0066*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:08	
1,2-Dichlorobenzene	"	ND	*0.0096*	0.15	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.048*	0.15	"	"	"	"	"	
Bromomethane	"	ND	*0.092*	0.52	"	"	"	"	"	
Chloroethane	"	ND	*0.085*	1.5	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.030*	0.15	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.012*	0.15	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.14**	*0.0078*	0.15	"	"	"	"	"	J
Chloromethane	"	ND	*0.22*	1.5	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.018*	0.15	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.018*	0.074	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0063*	0.030	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.014*	0.15	"	"	"	"	"	
Methylene Chloride	"	~~0.054~~	*0.014*	0.15 U	"	"	"	"	"	J, B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
4-Isopropyltoluene	8260B STD Dry	**0.043**	*0.010*	0.15	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:08	J
cis-1,2-Dichloroethene	"	ND	*0.0089*	0.15	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.013*	0.15	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.014*	0.15	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.044*	0.15	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.015*	0.059	"	"	"	"	"	
Benzene	"	**0.044**	*0.0092*	0.059	"	"	"	"	"	J
Chloroform	"	ND	*0.0078*	0.15	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.012*	0.15	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.018*	0.15	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0081*	0.15	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.014*	0.074	"	"	"	"	"	
Trichloroethene	"	ND	*0.013*	0.059	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.014*	0.044	"	"	"	"	"	
Dibromomethane	"	ND	*0.015*	0.15	"	"	"	"	"	
Toluene	"	**0.40**	*0.0089*	0.15	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.011*	0.15	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0066*	0.044	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0089*	0.059	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0085*	0.15	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0078*	0.074	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.018*	0.15	"	"	"	"	"	
Ethylbenzene	"	**0.14**	*0.014*	0.15	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.018*	0.15	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.030*	0.15	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.012*	0.037	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.41**	*0.029*	0.15	"	"	"	"	"	
o-Xylene	"	**0.17**	*0.0085*	0.15	"	"	"	"	"	
Styrene	"	ND	*0.014*	0.15	"	"	"	"	"	
Bromoform	"	ND	*0.041*	0.15	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0066*	0.15	"	"	"	"	"	
Bromobenzene	"	ND	*0.010*	0.15	"	"	"	"	"	
N-Propylbenzene	"	**0.031**	*0.010*	0.15	"	"	"	"	"	J
1,2,3-Trichloropropane	"	ND	*0.043*	0.15	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.020*	0.15	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.048**	*0.016*	0.15	"	"	"	"	"	J
n-Butylbenzene	"	ND	*0.027*	0.15	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.24*	0.74	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-20RE1 (GTP1-2.5-082709)		**Soil**			**Sampled: 08/27/09 09:20**					
1,2,4-Trichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.018*	0.15	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.021*	0.15	"	"	"	"	"	
Naphthalene	"	ND	*0.022*	0.15	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*101%*			*85 - 115 %*	"			"	
Ethylbenzene-d10		*108%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*98%*			*85 - 120 %*	"			"	
Fluorobenzene (Surr)		*102%*			*75 - 125 %*	"			"	
SSH0168-21 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
Bromomethane	8260B STD Dry	ND	*0.00042*	0.0011	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 19:37	
Chloroethane	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Trichloroethene	"	**0.00041**	*0.00019*	0.0011	"	"	"	"	"	J
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000082*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000097*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.000079*	0.0011	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*104%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*105%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*109%*			*85 - 120 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21RE1 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0024*	0.053	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:32	
1,2-Dichlorobenzene	"	ND	*0.0034*	0.053	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.017*	0.053	"	"	"	"	"	
Bromomethane	"	ND	*0.033*	0.18	"	"	"	"	"	
Chloroethane	"	ND	*0.030*	0.53	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.011*	0.053	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0042*	0.053	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.0028*	0.053	"	"	"	"	"	
Chloromethane	"	ND	*0.079*	0.53	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0066*	0.026	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0022*	0.011	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0049*	0.053	"	"	"	"	"	
Methylene Chloride	"	~~0.061~~	*0.0050*	0.053	"	"	"	"	"	B
4-Isopropyltoluene	"	ND	*0.0037*	0.053	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0032*	0.053	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0046*	0.053	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0050*	0.053	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.016*	0.053	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0053*	0.021	"	"	"	"	"	
Benzene	"	ND	*0.0033*	0.021	"	"	"	"	"	
Chloroform	"	ND	*0.0028*	0.053	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0042*	0.053	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0029*	0.053	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0049*	0.026	"	"	"	"	"	
Trichloroethene	"	**0.036**	*0.0045*	0.021	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0051*	0.016	"	"	"	"	"	
Dibromomethane	"	ND	*0.0053*	0.053	"	"	"	"	"	
Toluene	"	ND	*0.0032*	0.053	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0039*	0.053	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0024*	0.016	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0032*	0.021	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0030*	0.053	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0028*	0.026	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-21RE1 (GTP5-11-082809)		**Soil**			**Sampled: 08/28/09 09:37**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0066*	0.053	mg/Kg dry	1x	49928	09/09/09 15:36	09/10/09 00:32	
Ethylbenzene	"	ND	*0.0049*	0.053	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0063*	0.053	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.011*	0.053	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0043*	0.013	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.010*	0.053	"	"	"	"	"	
o-Xylene	"	ND	*0.0030*	0.053	"	"	"	"	"	
Styrene	"	ND	*0.0050*	0.053	"	"	"	"	"	
Bromoform	"	ND	*0.014*	0.053	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0024*	0.053	"	"	"	"	"	
Bromobenzene	"	ND	*0.0036*	0.053	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0037*	0.053	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.015*	0.053	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0071*	0.053	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0055*	0.053	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.0096*	0.053	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.087*	0.26	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0066*	0.053	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0074*	0.053	"	"	"	"	"	
Naphthalene	"	ND	*0.0079*	0.053	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*95%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*108%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Trifluorotoluene (Surr)			*89%*		*75 - 125 %*	"			"	
Fluorobenzene (Surr)			*103%*		*75 - 125 %*	"			"	
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Bromomethane	8260B STD Dry	ND	*0.00016*	0.00042	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:00	
Chloroethane	"	ND	*0.00011*	0.00042	"	"	"	"	"	
Chloromethane	"	ND	*0.000075*	0.00042	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000075*	0.00042	"	"	"	"	"	
Chloroform	"	ND	*0.000063*	0.00042	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000056*	0.00042	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000068*	0.00042	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00016*	0.00042	"	"	"	"	"	
Trichloroethene	"	ND	*0.000075*	0.00042	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000072*	0.00042	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
Dichlorobromomethane	8260B STD Dry	ND	*0.000031*	0.00042	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:00	
cis-1,3-Dichloropropene	"	ND	*0.000050*	0.00042	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000037*	0.00085	"	"	"	"	"	
Bromoform	"	ND	*0.000030*	0.00042	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00015*	0.00042	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000077*	0.00085	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00014*	0.00042	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*106%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*131%*		*75 - 125 %*	"			"	*X, I*
4-Bromofluorobenzene (Surr)			*108%*		*85 - 120 %*	"			"	
SSH0168-22RE1 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0027*	0.060	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 08:57	
1,2-Dichlorobenzene	"	**0.037**	*0.0039*	0.060	"	"	"	"	"	J
4-Chlorotoluene	"	ND	*0.020*	0.060	"	"	"	"	"	
Bromomethane	"	ND	*0.038*	0.21	"	"	"	"	"	
Chloroethane	"	ND	*0.035*	0.60	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.060	"	"	"	"	"	
tert-Butylbenzene	"	**0.020**	*0.0048*	0.060	"	"	"	"	"	J
1,2,4-Trimethylbenzene	"	**0.048**	*0.0032*	0.060	"	"	"	"	"	J
Chloromethane	"	ND	*0.090*	0.60	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0075*	0.030	"	"	"	"	"	
sec-Butylbenzene	"	**0.28**	*0.0075*	0.060	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0056*	0.060	"	"	"	"	"	
Methylene Chloride	" stet	~~0.081~~	*0.0057*	0.060	~~U~~ MS 10-10-09	"	"	"	"	
4-Isopropyltoluene	"	**0.094**	*0.0042*	0.060	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0036*	0.060	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0053*	0.060	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0057*	0.060	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.060	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0060*	0.024	"	"	"	"	"	
Benzene	"	ND	*0.0038*	0.024	"	"	"	"	"	
Chloroform	"	ND	*0.0032*	0.060	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0048*	0.060	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-22RE1 (TS-COMP-1)		**Soil**			**Sampled: 08/27/09 18:10**					
1,1,1-Trichloroethane	8260B STD Dry	ND	*0.0075*	0.060	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 08:57	
1,2-Dichloroethane	"	ND	*0.0033*	0.060	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0056*	0.030	"	"	"	"	"	
Trichloroethene	"	ND	*0.0051*	0.024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0059*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0060*	0.060	"	"	"	"	"	
Toluene	"	**0.0096**	*0.0036*	0.060	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0045*	0.060	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0027*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0036*	0.024	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0035*	0.060	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0032*	0.030	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0075*	0.060	"	"	"	"	"	
Ethylbenzene	"	**0.070**	*0.0056*	0.060	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0072*	0.060	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.060	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0050*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.014**	*0.012*	0.060	"	"	"	"	"	J
o-Xylene	"	ND	*0.0035*	0.060	"	"	"	"	"	
Styrene	"	ND	*0.0057*	0.060	"	"	"	"	"	
Bromoform	"	ND	*0.017*	0.060	"	"	"	"	"	
Isopropylbenzene	"	**0.16**	*0.0027*	0.060	"	"	"	"	"	
Bromobenzene	"	ND	*0.0041*	0.060	"	"	"	"	"	
N-Propylbenzene	"	**0.33**	*0.0042*	0.060	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.017*	0.060	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0081*	0.060	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0063*	0.060	"	"	"	"	"	
n-Butylbenzene	"	**0.71**	*0.011*	0.060	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.099*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0075*	0.060	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0084*	0.060	"	"	"	"	"	
Naphthalene	"	**1.9**	*0.0090*	0.060	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*98%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*104%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*100%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*106%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
Bromomethane	8260B STD Dry	ND	*0.000093*	0.00024	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:24	
Chloroethane	"	ND	*0.000065*	0.00024	"	"	"	"	"	
Chloromethane	"	ND	*0.000043*	0.00024	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000043*	0.00024	"	"	"	"	"	
Chloroform	"	ND	*0.000036*	0.00024	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000032*	0.00024	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000039*	0.00024	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.000090*	0.00024	"	"	"	"	"	
Trichloroethene	"	ND	*0.000043*	0.00024	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000041*	0.00024	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000018*	0.00024	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000028*	0.00024	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000021*	0.00048	"	"	"	"	"	
Bromoform	"	ND	*0.000017*	0.00024	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.000087*	0.00024	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000044*	0.00048	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.000081*	0.00024	"	"	"	"	"	
Surrogate(s):	*Toluene-d8 (Surr)*		*113%*		*85 - 115 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*112%*		*75 - 125 %*	"			"	
	4-Bromofluorobenzene (Surr)		*138%*		*85 - 120 %*	"			"	*X, I*
SSH0168-23RE1 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0014*	0.030	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:21	
1,2-Dichlorobenzene	"	**0.037**	*0.0020*	0.030	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.0098*	0.030	"	"	"	"	"	
Bromomethane	"	ND	*0.019*	0.11	"	"	"	"	"	
Chloroethane	"	ND	*0.017*	0.30	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0061*	0.030	"	"	"	"	"	
tert-Butylbenzene	"	**0.014**	*0.0024*	0.030	"	"	"	"	"	J
1,2,4-Trimethylbenzene	"	**0.13**	*0.0016*	0.030	"	"	"	"	"	
Chloromethane	"	ND	*0.045*	0.30	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0038*	0.015	"	"	"	"	"	
sec-Butylbenzene	"	**0.12**	*0.0038*	0.030	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0013*	0.0061	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0028*	0.030	"	"	"	"	"	
Methylene Chloride	"	**0.066**	*0.0029*	0.030	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23RE1 (TS-COMP-2)		**Soil**			**Sampled: 08/27/09 18:28**					
4-Isopropyltoluene	8260B STD Dry	**0.064**	*0.0021*	0.030	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:21	
cis-1,2-Dichloroethene	"	ND	*0.0018*	0.030	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0027*	0.030	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0029*	0.030	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.0091*	0.030	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0030*	0.012	"	"	"	"	"	
Benzene	"	ND	*0.0019*	0.012	"	"	"	"	"	
Chloroform	"	ND	*0.0016*	0.030	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0024*	0.030	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0017*	0.030	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0028*	0.015	"	"	"	"	"	
Trichloroethene	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0030*	0.0091	"	"	"	"	"	
Dibromomethane	"	ND	*0.0030*	0.030	"	"	"	"	"	
Toluene	"	**0.0053**	*0.0018*	0.030	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0023*	0.030	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0014*	0.0091	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0018*	0.012	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0017*	0.030	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0016*	0.015	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0038*	0.030	"	"	"	"	"	
Ethylbenzene	"	**0.044**	*0.0028*	0.030	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0036*	0.030	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0061*	0.030	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0025*	0.0076	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.017**	*0.0059*	0.030	"	"	"	"	"	J
o-Xylene	"	**0.020**	*0.0017*	0.030	"	"	"	"	"	J
Styrene	"	ND	*0.0029*	0.030	"	"	"	"	"	
Bromoform	"	ND	*0.0083*	0.030	"	"	"	"	"	
Isopropylbenzene	"	**0.082**	*0.0014*	0.030	"	"	"	"	"	
Bromobenzene	"	ND	*0.0020*	0.030	"	"	"	"	"	
N-Propylbenzene	"	**0.14**	*0.0021*	0.030	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.0088*	0.030	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0041*	0.030	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.0075**	*0.0032*	0.030	"	"	"	"	"	J
n-Butylbenzene	"	ND	*0.0055*	0.030	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.050*	0.15	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-23RE1 (TS-COMP-2)		Soil			Sampled: 08/27/09 18:28					
1,2,4-Trichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0038*	0.030	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0042*	0.030	"	"	"	"	"	
Naphthalene	"	**2.0**	*0.0045*	0.030	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*101%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*104%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*102%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*102%*		*75 - 125 %*	"			"	
SSH0168-24 (TS-COMP-3)		Soil			Sampled: 08/27/09 16:40					
Bromomethane	8260B STD Dry	ND	*0.00021*	0.00054	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 20:48	
Chloroethane	"	ND	*0.00014*	0.00054	"	"	"	"	"	
Chloromethane	"	ND	*0.000095*	0.00054	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.000096*	0.00054	"	"	"	"	"	
Chloroform	"	ND	*0.000080*	0.00054	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.000071*	0.00054	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.000086*	0.00054	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00020*	0.00054	"	"	"	"	"	
Trichloroethene	"	ND	*0.000095*	0.00054	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.000092*	0.00054	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000040*	0.00054	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000063*	0.00054	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.000047*	0.0011	"	"	"	"	"	
Bromoform	"	ND	*0.000039*	0.00054	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00019*	0.00054	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.000098*	0.0011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00018*	0.00054	"	"	"	"	"	
Surrogate(s): Toluene-d8 (Surr)			*110%*		*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)			*129%*		*75 - 125 %*	"			"	*X, I*
4-Bromofluorobenzene (Surr)			*102%*		*85 - 120 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24RE1 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0019*	0.041	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:45	
1,2-Dichlorobenzene	"	**0.015**	*0.0027*	0.041	"	"	"	"	"	J
4-Chlorotoluene	"	ND	*0.013*	0.041	"	"	"	"	"	
Bromomethane	"	ND	*0.026*	0.14	"	"	"	"	"	
Chloroethane	"	ND	*0.024*	0.41	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
tert-Butylbenzene	"	**0.015**	*0.0033*	0.041	"	"	"	"	"	J
1,2,4-Trimethylbenzene	"	ND	*0.0022*	0.041	"	"	"	"	"	
Chloromethane	"	ND	*0.062*	0.41	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0052*	0.021	"	"	"	"	"	
sec-Butylbenzene	"	**0.29**	*0.0052*	0.041	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0018*	0.0083	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0038*	0.041	"	"	"	"	"	
Methylene Chloride	"	ND	*0.0039*	0.041	"	"	"	"	"	
4-Isopropyltoluene	"	**0.014**	*0.0029*	0.041	"	"	"	"	"	J
cis-1,2-Dichloroethene	"	ND	*0.0025*	0.041	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0036*	0.041	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0039*	0.041	"	"	"	"	"	
1,4-Dichlorobenzene	"	**0.0064**	*0.0052*	0.041	"	"	"	"	"	J
Chlorobromomethane	"	ND	*0.012*	0.041	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0041*	0.017	"	"	"	"	"	
Benzene	"	ND	*0.0026*	0.017	"	"	"	"	"	
Chloroform	"	ND	*0.0022*	0.041	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0033*	0.041	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.0023*	0.041	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.0038*	0.021	"	"	"	"	"	
Trichloroethene	"	ND	*0.0035*	0.017	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0040*	0.012	"	"	"	"	"	
Dibromomethane	"	ND	*0.0041*	0.041	"	"	"	"	"	
Toluene	"	ND	*0.0025*	0.041	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.0031*	0.041	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0019*	0.012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0025*	0.017	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0022*	0.021	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-24RE1 (TS-COMP-3)		**Soil**			**Sampled: 08/27/09 16:40**					
1,3-Dichloropropane	8260B STD Dry	ND	*0.0052*	0.041	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 09:45	
Ethylbenzene	"	ND	*0.0038*	0.041	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.0050*	0.041	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.0083*	0.041	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0034*	0.010	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.010**	*0.0081*	0.041	"	"	"	"	"	J
o-Xylene	"	ND	*0.0024*	0.041	"	"	"	"	"	
Styrene	"	ND	*0.0039*	0.041	"	"	"	"	"	
Bromoform	"	ND	*0.011*	0.041	"	"	"	"	"	
Isopropylbenzene	"	**0.069**	*0.0019*	0.041	"	"	"	"	"	
Bromobenzene	"	ND	*0.0028*	0.041	"	"	"	"	"	
N-Propylbenzene	"	**0.11**	*0.0029*	0.041	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.012*	0.041	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0056*	0.041	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.0043*	0.041	"	"	"	"	"	
n-Butylbenzene	"	**0.61**	*0.0075*	0.041	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.068*	0.21	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0052*	0.041	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0058*	0.041	"	"	"	"	"	
Naphthalene	"	**0.37**	*0.0062*	0.041	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*			*103%*		*85 - 115 %*	"			"	
Ethylbenzene-d10			*108%*		*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)			*100%*		*85 - 120 %*	"			"	
Fluorobenzene (Surr)			*101%*		*75 - 125 %*	"			"	
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
Bromomethane	8260B STD Dry	ND	*0.00053*	0.0014	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:12	
Chloroethane	"	ND	*0.00037*	0.0014	"	"	"	"	"	
Chloromethane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00025*	0.0014	"	"	"	"	"	
Chloroform	"	ND	*0.00020*	0.0014	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00018*	0.0014	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00022*	0.0014	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00051*	0.0014	"	"	"	"	"	
Trichloroethene	"	ND	*0.00024*	0.0014	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00010*	0.0014	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
cis-1,3-Dichloropropene	8260B STD Dry	ND	*0.00016*	0.0014	mg/Kg dry	1x	49722	09/04/09 12:30	09/04/09 21:12	
1,1,2,2-Tetrachloroethane	"	ND	*0.00012*	0.0028	"	"	"	"	"	
Bromoform	"	ND	*0.000099*	0.0014	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.00050*	0.0014	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00025*	0.0028	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00046*	0.0014	"	"	"	"	"	
Surrogate(s): *Toluene-d8 (Surr)*		*108%*			*85 - 115 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*98%*			*75 - 125 %*	"			"	
4-Bromofluorobenzene (Surr)		*114%*			*85 - 120 %*	"			"	
SSH0168-25RE1 (GTP4-6.0-082709)		**Soil**			**Sampled: 08/27/09 15:49**					
1,1-Dichloropropene	8260B STD Dry	ND	*0.0028*	0.061	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 10:09	
1,2-Dichlorobenzene	"	ND	*0.0040*	0.061	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.020*	0.061	"	"	"	"	"	
Bromomethane	"	ND	*0.038*	0.22	"	"	"	"	"	
Chloroethane	"	ND	*0.035*	0.61	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.012*	0.061	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.0049*	0.061	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.054**	*0.0032*	0.061	"	"	"	"	"	J
Chloromethane	"	ND	*0.092*	0.61	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.0077*	0.061	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.0077*	0.031	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Vinyl chloride	"	ND	*0.0026*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.0057*	0.061	"	"	"	"	"	
Methylene Chloride	"	**0.014**	*0.0058*	0.061	"	"	"	"	"	J
4-Isopropyltoluene	"	ND	*0.0043*	0.061	"	"	"	"	"	
cis-1,2-Dichloroethene	"	ND	*0.0037*	0.061	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.0054*	0.061	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.0058*	0.061	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.018*	0.061	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.0061*	0.025	"	"	"	"	"	
Benzene	"	ND	*0.0038*	0.025	"	"	"	"	"	
Chloroform	"	ND	*0.0032*	0.061	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.0049*	0.061	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.0077*	0.061	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/01/09 10:07

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSH0168-25RE1 (GTP4-6.0-082709)		Soil			Sampled: 08/27/09 15:49					
1,2-Dichloroethane	8260B STD Dry	ND	*0.0034*	0.061	mg/Kg dry	1x	49942	09/09/09 17:34	09/10/09 10:09	
Carbon tetrachloride	"	ND	*0.0057*	0.031	"	"	"	"	"	
Trichloroethene	"	ND	*0.0052*	0.025	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.0060*	0.018	"	"	"	"	"	
Dibromomethane	"	ND	*0.0061*	0.061	"	"	"	"	"	
Toluene	"	**0.031**	*0.0037*	0.061	"	"	"	"	"	J
Dichlorobromomethane	"	ND	*0.0046*	0.061	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.0028*	0.018	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.0037*	0.025	"	"	"	"	"	
Chlorobenzene	"	ND	*0.0035*	0.061	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.0032*	0.031	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.0077*	0.061	"	"	"	"	"	
Ethylbenzene	"	**0.0068**	*0.0057*	0.061	"	"	"	"	"	J
1,1,1,2-Tetrachloroethane	"	ND	*0.0074*	0.061	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.012*	0.061	"	"	"	"	"	
1,1,2,2-Tetrachloroethane	"	ND	*0.0051*	0.015	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.087**	*0.012*	0.061	"	"	"	"	"	
o-Xylene	"	**0.081**	*0.0035*	0.061	"	"	"	"	"	
Styrene	"	ND	*0.0058*	0.061	"	"	"	"	"	
Bromoform	"	ND	*0.017*	0.061	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.0028*	0.061	"	"	"	"	"	
Bromobenzene	"	ND	*0.0042*	0.061	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.0043*	0.061	"	"	"	"	"	
1,2,3-Trichloropropane	"	ND	*0.018*	0.061	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.0083*	0.061	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.022**	*0.0065*	0.061	"	"	"	"	"	J
n-Butylbenzene	"	ND	*0.011*	0.061	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.10*	0.31	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.0077*	0.061	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0086*	0.061	"	"	"	"	"	
Naphthalene	"	ND	*0.0092*	0.061	"	"	"	"	"	

Surrogate(s):	*Toluene-d8 (Surr)*	*102%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*107%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*101%*	*85 - 120 %*	"	"
	Fluorobenzene (Surr)	*104%*	*75 - 125 %*	"	"

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

October 28, 2009

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 09/03/09 13:30. The following list is a summary of the Work Orders contained in this report, generated on 10/28/09 16:33.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSI0028	Avery Landing	073-93312-03



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-MW11FP-090109	SSI0028-01	Other (L)	09/01/09 17:10	09/03/09 13:30
G-GA2-090209	SSI0028-02	Water	09/02/09 12:15	09/03/09 13:30
G-GA4-090209	SSI0028-03	Water	09/02/09 14:30	09/03/09 13:30
G-DW01-090209	SSI0028-04	Water	09/02/09 18:50	09/03/09 13:30
G-GA3-090309	SSI0028-05	Water	09/03/09 09:40	09/03/09 13:30
G-GA3D-090309	SSI0028-06	Water	09/03/09 09:50	09/03/09 13:30
G-MW5-090309	SSI0028-07	Water	09/03/09 12:00	09/03/09 13:30

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**202000**	-----	4000	mg/kg wet	1x	9090043	09/08/09 18:28	09/13/09 17:47	
Heavy Oil Range Hydrocarbons	"	**321000**	-----	10000	"	"	"	"	"	
Surrogate(s): 2-FBP			*111%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*108%*			*50 - 150 %*	"		"	
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 19:47	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP			*79.0%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*94.6%*			*50 - 150 %*	"		"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 20:12	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP			*79.7%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*93.7%*			*50 - 150 %*	"		"	
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 20:36	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP			*78.8%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*93.4%*			*50 - 150 %*	"		"	
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 21:00	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP			*74.1%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*90.6%*			*50 - 150 %*	"		"	
SSI0028-06 (G-GA3D-090309)		**Water**			**Sampled: 09/03/09 09:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.250	mg/l	1x	9090077	09/11/09 08:00	09/13/09 21:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.500	"	"	"	"	"	C
Surrogate(s): 2-FBP			*79.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*96.8%*			*50 - 150 %*	"		"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		**Water**				**Sampled: 09/03/09 12:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	**0.484**	-----	0.312	mg/l	1x	9090094	09/15/09 07:58	09/16/09 23:44	
Heavy Oil Range Hydrocarbons	"	**0.713**	-----	0.625	"	"	"	"	"	
Surrogate(s): 2-FBP			*85.6%*			*50 - 150 %*	*"*		*"*	
p-Terphenyl-d14			*103%*			*50 - 150 %*	*"*		*"*	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)			**Other (L)**				**Sampled: 09/01/09 17:10**			
Mercury	7471A	ND	*0.0055*	0.018	mg/Kg	1x	50401	09/17/09 09:56	09/17/09 12:58	
SSI0028-02 (G-GA2-090209)			**Water**				**Sampled: 09/02/09 12:15**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:32	
SSI0028-03 (G-GA4-090209)			**Water**				**Sampled: 09/02/09 14:30**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:15	
SSI0028-04 (G-DW01-090209)			**Water**				**Sampled: 09/02/09 18:50**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:36	
SSI0028-05 (G-GA3-090309)			**Water**				**Sampled: 09/03/09 09:40**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:41	
SSI0028-06 (G-GA3D-090309)			**Water**				**Sampled: 09/03/09 09:50**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:45	
SSI0028-07 (G-MW5-090309)			**Water**				**Sampled: 09/03/09 12:00**			
Mercury	7470A	**0.000073**	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:49	**J**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Aluminum	6010B TMP	ND	*31*	110	mg/Kg	1x	50413	09/17/09 10:34	09/17/09 23:44	*
Antimony	"	ND	*0.60*	11	"	"	"	"	"	
Arsenic	"	**2.2**	*0.46*	11	"	"	"	"	"	**J**
Calcium	"	**43**	*5.3*	190	"	"	"	"	"	**J**
Iron	"	**120**	*1.6*	35	"	"	"	"	"	*
Lead	"	**15**	*0.42*	5.3	"	"	"	"	"	
Magnesium	"	**21**	*2.3*	190	"	"	"	"	"	**J, B, ***
Manganese	"	**1.6**	*0.028*	3.5	"	"	"	"	"	**J**
Potassium	"	ND	*56*	580	"	"	"	"	"	*
Selenium	"	ND	*0.42*	18	"	"	"	"	"	
Silver	"	ND	*0.16*	3.5	"	"	"	"	"	
Sodium	"	ND	*24*	350	"	"	"	"	"	
SSI0028-01RE1 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Cadmium	6010B TMP	ND	*0.28*	1.8	mg/Kg	1x	51220	10/01/09 10:41	10/01/09 18:38	
Beryllium	"	ND	*0.0042*	0.88	"	"	"	"	"	
Barium	"	**2.4**	*0.053*	1.8	"	"	"	"	"	
Thallium	"	**1.5**	*0.49*	18	"	"	"	"	"	**J, B**
Nickel	"	**31**	*0.28*	3.5	"	"	"	"	"	
Vanadium	"	**26**	*0.11*	1.8	"	"	"	"	"	
Copper	"	**38**	*0.77*	3.5	"	"	"	"	"	
Zinc	"	**6.9**	*0.70*	8.8	"	"	"	"	"	**J**
Chromium	"	**13**	*0.17*	4.6	"	"	"	"	"	
Cobalt	"	**0.48**	*0.11*	1.8	"	"	"	"	"	**J**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**				**Sampled: 09/02/09 12:15**				
Calcium	6010B Total Recoverable	**27**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 00:58	
Iron	"	**0.065**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**6.6**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**2.8**	*0.18*	2.0	"	"	"	"	"	**B**
Manganese	"	**0.25**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**2.3**	*0.41*	3.3	"	"	"	"	09/17/09 12:23	**J**
SSI0028-03 (G-GA4-090209)		**Water**				**Sampled: 09/02/09 14:30**				
Calcium	6010B Total Recoverable	**34**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:35	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**9.9**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**2.8**	*0.18*	2.0	"	"	"	"	"	**B**
Manganese	"	**0.18**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**3.2**	*0.41*	3.3	"	"	"	"	09/17/09 12:51	**J**
SSI0028-04 (G-DW01-090209)		**Water**				**Sampled: 09/02/09 18:50**				
Calcium	6010B Total Recoverable	**38**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:41	
Iron	"	**8.8**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**2.4**	*0.18*	2.0	"	"	"	"	"	**B**
Manganese	"	**0.22**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.3**	*0.41*	3.3	"	"	"	"	09/17/09 12:55	**J**
SSI0028-05 (G-GA3-090309)		**Water**				**Sampled: 09/03/09 09:40**				
Calcium	6010B Total Recoverable	**21**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:47	
Iron	"	**0.053**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**3.3**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**1.6**	*0.18*	2.0	"	"	"	"	"	**J, B**
Manganese	"	**0.44**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**2.4**	*0.41*	3.3	"	"	"	"	09/17/09 13:00	**J**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-06 (G-GA3D-090309)		**Water**				**Sampled: 09/03/09 09:50**				
Calcium	6010B Total Recoverable	**21**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:53	
Iron	"	**0.050**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**3.3**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**1.6**	*0.18*	2.0	"	"	"	"	"	**J, B**
Manganese	"	**0.45**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**2.5**	*0.41*	3.3	"	"	"	"	09/17/09 13:04	**J**
SSI0028-07 (G-MW5-090309)		**Water**				**Sampled: 09/03/09 12:00**				
Calcium	6010B Total Recoverable	**24**	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 02:00	
Iron	"	**10**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**8.0**	*0.23*	1.1	"	"	"	"	"	
Sodium	"	**2.7**	*0.18*	2.0	"	"	"	"	"	**B**
Manganese	"	**1.4**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.6**	*0.41*	3.3	"	"	"	"	09/17/09 13:09	**J**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**				**Sampled: 09/02/09 12:15**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 18:57	
Barium	"	**0.077**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00071**	*0.00037*	0.0020	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00070**	*0.00016*	0.0020	"	"	"	"	"	**J**
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0026**	*0.00015*	0.0050	"	"	"	"	"	**J**
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.00018**	*0.00017*	0.0020	"	"	"	"	"	**J**
Zinc	"	**0.0027**	*0.0020*	0.0070	"	"	"	"	"	**J**
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-02RE1 (G-GA2-090209)		**Water**				**Sampled: 09/02/09 12:15**				
Aluminum	6020 Total Recoverable	**0.099**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 19:50	**J, B**
SSI0028-03 (G-GA4-090209)		**Water**				**Sampled: 09/02/09 14:30**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:35	
Barium	"	**0.025**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0028**	*0.00040*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00062**	*0.00037*	0.0020	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.0013**	*0.00016*	0.0020	"	"	"	"	"	**J**
Thallium	"	**0.00013**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Copper	"	**0.0037**	*0.00015*	0.0050	"	"	"	"	"	**J**
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.0031**	*0.0020*	0.0070	"	"	"	"	"	**J**
Nickel	"	**0.0027**	*0.00022*	0.0020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-03RE1 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Aluminum	6020 Total Recoverable	**0.071**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:26	**J, B**
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:39	
Barium	"	**0.019**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0018**	*0.00040*	0.0020	"	"	"	"	"	**J**
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	**0.0010**	*0.00034*	0.0020	"	"	"	"	"	**J**
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Thallium	"	**0.000085**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Copper	"	**0.0020**	*0.00015*	0.0050	"	"	"	"	"	**J**
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.00030**	*0.00017*	0.0020	"	"	"	"	"	**J**
Zinc	"	**0.24**	*0.0020*	0.0070	"	"	"	"	"	
Nickel	"	**0.0014**	*0.00022*	0.0020	"	"	"	"	"	**J**
SSI0028-04RE1 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Aluminum	6020 Total Recoverable	**0.061**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:30	**J, B**
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Arsenic	6020 Total Recoverable	**0.00091**	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:43	**J**
Barium	"	**0.038**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0015**	*0.00040*	0.0020	"	"	"	"	"	**J**
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00038**	*0.00037*	0.0020	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00038**	*0.00016*	0.0020	"	"	"	"	"	**J**
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0016**	*0.00015*	0.0050	"	"	"	"	"	**J**
Vanadium	"	**0.00075**	*0.00023*	0.0020	"	"	"	"	"	**J**
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		**Water**				**Sampled: 09/03/09 09:40**				
Zinc	6020 Total Recoverable	**0.0025**	*0.0020*	0.0070	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:43	**J**
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-05RE1 (G-GA3-090309)		**Water**				**Sampled: 09/03/09 09:40**				
Aluminum	6020 Total Recoverable	**0.070**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:33	**J, B**
SSI0028-06 (G-GA3D-090309)		**Water**				**Sampled: 09/03/09 09:50**				
Arsenic	6020 Total Recoverable	**0.00072**	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:46	**J**
Barium	"	**0.038**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0012**	*0.00040*	0.0020	"	"	"	"	"	**J**
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00036**	*0.00016*	0.0020	"	"	"	"	"	**J**
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0017**	*0.00015*	0.0050	"	"	"	"	"	**J**
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.0023**	*0.0020*	0.0070	"	"	"	"	"	**J**
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-06RE1 (G-GA3D-090309)		**Water**				**Sampled: 09/03/09 09:50**				
Aluminum	6020 Total Recoverable	**0.081**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:37	**J, B**
SSI0028-07 (G-MW5-090309)		**Water**				**Sampled: 09/03/09 12:00**				
Arsenic	6020 Total Recoverable	**0.010**	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:50	
Barium	"	**0.055**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0015**	*0.00040*	0.0020	"	"	"	"	"	**J**
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.0043**	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		**Water**				**Sampled: 09/03/09 12:00**				
Cobalt	6020 Total Recoverable	**0.0032**	*0.00016*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:50	
Thallium	"	**0.000080**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Copper	"	**0.018**	*0.00015*	0.0050	"	"	"	"	"	
Vanadium	"	**0.0057**	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.012**	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.028**	*0.0020*	0.0070	"	"	"	"	"	
Nickel	"	**0.0057**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-07RE1 (G-MW5-090309)		**Water**				**Sampled: 09/03/09 12:00**				
Aluminum	6020 Total Recoverable	**3.7**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:41	**B**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Naphthalene	8270C PAH	ND	*1700*	16000	ug/Kg	10x	50178	09/14/09 11:17	09/15/09 00:32	
2-Methylnaphthalene	"	**16000**	*1800*	16000	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**52000**	*1400*	24000	"	"	"	"	"	
Acenaphthylene	"	ND	*1300*	16000	"	"	"	"	"	
Acenaphthene	"	**42000**	*1300*	16000	"	"	"	"	"	
Fluorene	"	**68000**	*950*	16000	"	"	"	"	"	
Phenanthrene	"	**140000**	*1700*	16000	"	"	"	"	"	
Anthracene	"	**26000**	*1100*	16000	"	"	"	"	"	
Fluoranthene	"	**69000**	*950*	16000	"	"	"	"	"	
Pyrene	"	**110000**	*1100*	16000	"	"	"	"	"	
Benzo[a]anthracene	"	**40000**	*1300*	20000	"	"	"	"	"	
Chrysene	"	**71000**	*1100*	20000	"	"	"	"	"	
Benzo[b]fluoranthene	"	**20000**	*3300*	16000	"	"	"	"	"	
Benzo[k]fluoranthene	"	**3000**	*1000*	20000	"	"	"	"	"	**J**
Benzo[a]pyrene	"	**25000**	*1700*	24000	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**4700**	*3300*	32000	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	ND	*1700*	32000	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**6700**	*1200*	20000	"	"	"	"	"	**J**

Surrogate(s):	*Nitrobenzene-d5*	*87%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*74%*	*42 - 140 %*	"	"
	Terphenyl-d14	*78%*	*42 - 151 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Naphthalene	8270C STD	**0.0062**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:23	**J**
2-Methylnaphthalene	"	**0.0037**	*0.0028*	0.012	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0023**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0029**	*0.00094*	0.0094	"	"	"	"	"	**J**
Fluorene	"	**0.0034**	*0.0011*	0.0094	"	"	"	"	"	**J**
Phenanthrene	"	**0.0078**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Anthracene	"	**0.0021**	*0.00075*	0.0094	"	"	"	"	"	**J**
Fluoranthene	"	**0.0032**	*0.0015*	0.0094	"	"	"	"	"	**J**
Pyrene	"	**0.0027**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*88%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*85%*		*50 - 110 %*	"			"	
Terphenyl-d14			*103%*		*50 - 135 %*	"			"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Naphthalene	8270C STD	**0.0074**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:42	**J**
2-Methylnaphthalene	"	**0.0048**	*0.0028*	0.012	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0033**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Acenaphthylene	"	**0.0016**	*0.0010*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	ND	*0.00094*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0020**	*0.0011*	0.0094	"	"	"	"	"	**J**
Phenanthrene	"	**0.0043**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Anthracene	"	**0.00083**	*0.00075*	0.0094	"	"	"	"	"	**J**
Fluoranthene	"	ND	*0.0015*	0.0094	"	"	"	"	"	
Pyrene	"	**0.0020**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:42	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*94%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*86%*		*50 - 110 %*	"			"	
Terphenyl-d14			*99%*		*50 - 135 %*	"			"	
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:02	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0016**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0011**	*0.00094*	0.0094	"	"	"	"	"	**J**
Fluorene	"	**0.0012**	*0.0011*	0.0094	"	"	"	"	"	**J**
Phenanthrene	"	**0.0026**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Anthracene	"	**0.0016**	*0.00075*	0.0094	"	"	"	"	"	**J**
Fluoranthene	"	ND	*0.0015*	0.0094	"	"	"	"	"	
Pyrene	"	ND	*0.0016*	0.0094	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*95%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*83%*		*50 - 110 %*	"			"	
Terphenyl-d14			*98%*		*50 - 135 %*	"			"	
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Naphthalene	8270C STD	**0.040**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:21	
2-Methylnaphthalene	"	**0.020**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.021**	*0.0011*	0.0094	"	"	"	"	"	**B**
Acenaphthylene	"	**0.0050**	*0.0010*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**0.025**	*0.00094*	0.0094	"	"	"	"	"	
Fluorene	"	**0.019**	*0.0011*	0.0094	"	"	"	"	"	
Phenanthrene	"	**0.020**	*0.0010*	0.0094	"	"	"	"	"	**B**
Anthracene	"	ND	*0.00075*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Fluoranthene	8270C STD	**0.0087**	*0.0015*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:21	**J**
Pyrene	"	**0.0097**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*79%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*89%*		*50 - 110 %*	"			"	
Terphenyl-d14			*104%*		*50 - 135 %*	"			"	
SSI0028-06 (G-GA3D-090309)		**Water**			**Sampled: 09/03/09 09:50**					
Naphthalene	8270C STD	**0.038**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:41	
2-Methylnaphthalene	"	**0.019**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.020**	*0.0011*	0.0094	"	"	"	"	"	**B**
Acenaphthylene	"	**0.0048**	*0.0010*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**0.025**	*0.00094*	0.0094	"	"	"	"	"	
Fluorene	"	**0.017**	*0.0011*	0.0094	"	"	"	"	"	
Phenanthrene	"	**0.019**	*0.0010*	0.0094	"	"	"	"	"	**B**
Anthracene	"	ND	*0.00075*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0049**	*0.0015*	0.0094	"	"	"	"	"	**J**
Pyrene	"	**0.0041**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*67%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*80%*		*50 - 110 %*	"			"	
Terphenyl-d14			*105%*		*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		**Water**			**Sampled: 09/03/09 12:00**					
Naphthalene	8270C STD	**0.22**	*0.0034*	0.0095	ug/L	1x	49936	09/09/09 16:54	09/12/09 02:00	
2-Methylnaphthalene	"	**0.094**	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**1.1**	*0.0011*	0.0095	"	"	"	"	"	**B**
Acenaphthylene	"	**0.081**	*0.0010*	0.0095	"	"	"	"	"	
Acenaphthene	"	**0.50**	*0.00095*	0.0095	"	"	"	"	"	
Fluorene	"	**0.47**	*0.0011*	0.0095	"	"	"	"	"	
Phenanthrene	"	**0.14**	*0.0010*	0.0095	"	"	"	"	"	**B**
Anthracene	"	**0.088**	*0.00076*	0.0095	"	"	"	"	"	
Fluoranthene	"	**0.023**	*0.0015*	0.0095	"	"	"	"	"	
Pyrene	"	**0.064**	*0.0016*	0.0095	"	"	"	"	"	**B**
Benzo[a]anthracene	"	**0.0081**	*0.0023*	0.0095	"	"	"	"	"	**J**
Chrysene	"	**0.011**	*0.0020*	0.0095	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0095	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0021**	*0.0019*	0.0095	"	"	"	"	"	**J**
Surrogate(s): *Nitrobenzene-d5*			*92%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*64%*		*50 - 110 %*	"			"	
Terphenyl-d14			*91%*		*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
PCB-1016	8082 STD	ND	*0.14*	0.43	mg/Kg	1x	50176	09/14/09 11:14	09/15/09 12:18	
PCB-1221	"	ND	*0.34*	0.43	"	"	"	"	"	
PCB-1232	"	ND	*0.30*	0.43	"	"	"	"	"	
PCB-1242	"	ND	*0.089*	0.43	"	"	"	"	"	
PCB-1248	"	ND	*0.055*	0.43	"	"	"	"	"	
PCB-1254	"	ND	*0.089*	0.43	"	"	"	"	"	
PCB-1260	"	**0.37**	*0.13*	0.43	"	"	"	"	"	**J, p**
Surrogate(s): Tetrachloro-m-xylene			*87%*			*45 - 155 %*	"		"	
DCB Decachlorobiphenyl			*110%*			*60 - 125 %*	"		"	
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 18:50	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*63%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*67%*			*40 - 135 %*	"		"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:06	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*64%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*73%*			*40 - 135 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		**Water**					**Sampled: 09/03/09 09:40**			
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:21	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*66%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*64%*			*40 - 135 %*	"		"	
SSI0028-06 (G-GA3D-090309)		**Water**					**Sampled: 09/03/09 09:50**			
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:37	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*65%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*52%*			*40 - 135 %*	"		"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090043 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090043-BLK1)								**Extracted: 09/08/09 18:28**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/13/09 12:57	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 97.4%*			*Limits: 50-150%*	"							*09/13/09 12:57*	
p-Terphenyl-d14		*111%*			*50-150%*	"							"	
LCS (9090043-BS1)								**Extracted: 09/08/09 18:28**						
Diesel Range Hydrocarbons	NWTPH-Dx	62.3	---	10.0	mg/kg wet	1x	--	83.3	74.8%	(73-133)	--	--	09/13/09 13:21	
Surrogate(s): 2-FBP		*Recovery: 93.5%*			*Limits: 50-150%*	"							*09/13/09 13:21*	
p-Terphenyl-d14		*106%*			*50-150%*	"							"	
Duplicate (9090043-DUP1)							**QC Source: SSH0168-23**						**Extracted: 09/08/09 18:28**	
Diesel Range Hydrocarbons	NWTPH-Dx	1630	---	17.5	mg/kg dry	1x	2120	--	--	--	26.4%	(40)	09/13/09 14:34	
Heavy Oil Range Hydrocarbons	"	836	---	43.6	"	"	1090	--	--	--	26.0%	"	"	
Surrogate(s): 2-FBP		*Recovery: 122%*			*Limits: 50-150%*	"							*09/13/09 14:34*	
p-Terphenyl-d14		*109%*			*50-150%*	"							"	
Matrix Spike (9090043-MS1)							**QC Source: SSH0168-23**						**Extracted: 09/08/09 18:28**	
Diesel Range Hydrocarbons	NWTPH-Dx	3230	---	21.5	mg/kg dry	1x	2120	179	618%	(70.1-139)	--	--	09/13/09 14:58	MHA
Surrogate(s): 2-FBP		*Recovery: 129%*			*Limits: 50-150%*	"							*09/13/09 14:58*	
p-Terphenyl-d14		*104%*			*50-150%*	"							"	



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090077 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090077-BLK1)							**Extracted: 09/11/09 08:00**							
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	09/11/09 16:08	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 105%*			*Limits: 50-150%*	"							*09/11/09 16:08*	
p-Terphenyl-d14		*127%*			*50-150%*	"							"	
LCS (9090077-BS1)							**Extracted: 09/11/09 08:00**							
Diesel Range Hydrocarbons	NWTPH-Dx	1.76	---	0.250	mg/l	1x	--	2.50	70.6%	(54.5-136)	--	--	09/11/09 16:32	
Surrogate(s): 2-FBP		*Recovery: 94.0%*			*Limits: 50-150%*	"							*09/11/09 16:32*	
p-Terphenyl-d14		*102%*			*50-150%*	"							"	
LCS Dup (9090077-BSD1)							**Extracted: 09/11/09 08:00**							
Diesel Range Hydrocarbons	NWTPH-Dx	1.95	---	0.250	mg/l	1x	--	2.50	78.1%	(54.5-136)	10.1%	(32.5)	09/11/09 16:32	
Surrogate(s): 2-FBP		*Recovery: 108%*			*Limits: 50-150%*	"							*09/11/09 16:32*	
p-Terphenyl-d14		*120%*			*50-150%*	"							"	

QC Batch: 9090094 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090094-BLK1)							**Extracted: 09/15/09 07:58**							
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	09/16/09 22:57	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 76.3%*			*Limits: 50-150%*	"							*09/16/09 22:57*	
p-Terphenyl-d14		*96.7%*			*50-150%*	"							"	
LCS (9090094-BS1)							**Extracted: 09/15/09 07:58**							
Diesel Range Hydrocarbons	NWTPH-Dx	1.96	---	0.250	mg/l	1x	--	2.50	78.3%	(54.5-136)	--	--	09/16/09 23:21	
Surrogate(s): 2-FBP		*Recovery: 86.4%*			*Limits: 50-150%*	"							*09/16/09 23:21*	
p-Terphenyl-d14		*99.7%*			*50-150%*	"							"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50342 **Water Preparation Method: 7470A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153253D)				**QC Source: SSI0028-03**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.00187	0.000041	0.00020	mg/L	1x	ND	0.00200	94%	(75-125)	1%	(20)	09/16/09 16:28	
Matrix Spike (153253S)				**QC Source: SSI0028-03**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.00186	0.000041	0.00020	mg/L	1x	ND	0.00200	93%	(75-125)	--	--	09/16/09 16:24	
Duplicate (153253X)				**QC Source: SSI0028-03**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.0000680	0.000041	0.00020	mg/L	1x	ND	--	--	--	NC%	(20)	09/16/09 16:19	J
Blank (580-50389-23)				**QC Source:**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	ND	0.000041	0.00020	mg/L	1x	--	--	--	--	--	--	09/16/09 15:49	
LCS (580-50389-24)				**QC Source:**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.00208	0.000041	0.00020	mg/L	1x	--	0.00200	104%	(75-125)	--	--	09/16/09 15:53	
LCS Dup (580-50389-25)				**QC Source:**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.00184	0.000041	0.00020	mg/L	1x	--	0.00200	92%	(75-125)	12%	(20)	09/16/09 15:57	
LCS (580-50389-26)				**QC Source:**				**Extracted: 09/16/09 14:15**						
Mercury	7470A	0.00199	0.000041	0.00020	mg/L	1x	--	0.00200	100%	(75-125)	--	--	09/16/09 16:01	

QC Batch: 50401 **Waste Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153251D)				**QC Source: SSI0028-01**				**Extracted: 09/17/09 09:56**						
Mercury	7471A	0.182	0.0059	0.019	mg/Kg	1x	ND	0.188	96%	(75-125)	7%	(35)	09/17/09 13:11	
Matrix Spike (153251S)				**QC Source: SSI0028-01**				**Extracted: 09/17/09 09:56**						
Mercury	7471A	0.196	0.0061	0.019	mg/Kg	1x	ND	0.194	101%	(75-125)	--	--	09/17/09 13:07	
Duplicate (153251X)				**QC Source: SSI0028-01**				**Extracted: 09/17/09 09:56**						
Mercury	7471A	0.0112	0.0062	0.020	mg/Kg	1x	ND	--	--	--	NC%	(35)	09/17/09 13:03	J
Blank (580-50438-23)				**QC Source:**				**Extracted: 09/17/09 09:56**						
Mercury	7471A	ND	0.0063	0.020	mg/Kg	1x	--	--	--	--	--	--	09/17/09 12:32	
LCS (580-50438-24)				**QC Source:**				**Extracted: 09/17/09 09:56**						
Mercury	7471A	0.201	0.0063	0.020	mg/Kg	1x	--	0.200	100%	(75-125)	--	--	09/17/09 12:36	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50401 **Waste Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50438-25)				**QC Source:**					**Extracted: 09/17/09 09:56**					
Mercury	7471A	0.192	0.0063	0.020	mg/Kg	1x	--	0.200	96%	(75-125)	5%	(25)	09/17/09 12:41	
LCS (580-50438-26)				**QC Source:**					**Extracted: 09/17/09 09:56**					
Mercury	7471A	4.67	0.032	0.10	mg/Kg	1x	--	4.47	104%	(80-120)	--	--	09/17/09 12:46	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50413 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153251D)					**QC Source: SSI0028-01**				**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	758	35	120	mg/Kg	1x	ND	792	96%	(75-125)	5%	(35)	09/18/09 00:02	
Antimony	"	535	0.67	12	"	"	ND	594	90%	"	5%	"	"	
Arsenic	"	740	0.51	12	"	"	2.2	792	93%	"	5%	"	"	
Calcium	"	3670	5.9	220	"	"	43	3960	91%	"	6%	"	"	
Iron	"	4120	1.8	40	"	"	120	4360	92%	"	5%	"	"	
Lead	"	188	0.48	5.9	"	"	15	198	88%	"	5%	"	"	
Magnesium	"	3680	2.6	220	"	"	21	3960	92%	"	7%	"	"	
Manganese	"	191	0.032	4.0	"	"	1.6	198	96%	"	5%	"	"	
Potassium	"	3710	63	650	"	"	ND	3960	94%	"	6%	"	"	
Selenium	"	698	0.48	20	"	"	ND	792	88%	"	5%	"	"	
Silver	"	95.7	0.18	4.0	"	"	ND	119	81%	"	6%	"	"	
Sodium	"	3180	27	400	"	"	ND	3960	80%	"	6%	"	"	
Matrix Spike (153251S)					**QC Source: SSI0028-01**				**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	721	33	110	mg/Kg	1x	ND	732	98%	(75-125)	--	--	09/17/09 23:57	
Antimony	"	508	0.62	11	"	"	ND	549	92%	"	--	--	"	
Arsenic	"	707	0.48	11	"	"	2.2	732	96%	"	--	--	"	
Calcium	"	3450	5.5	200	"	"	43	3660	93%	"	--	--	"	
Iron	"	3910	1.7	37	"	"	120	4030	94%	"	--	--	"	
Lead	"	180	0.44	5.5	"	"	15	183	90%	"	--	--	"	
Magnesium	"	3450	2.4	200	"	"	21	3660	94%	"	--	--	"	
Manganese	"	181	0.029	3.7	"	"	1.6	183	98%	"	--	--	"	
Potassium	"	3500	59	600	"	"	ND	3660	96%	"	--	--	"	
Selenium	"	666	0.44	18	"	"	ND	732	91%	"	--	--	"	
Silver	"	90.1	0.16	3.7	"	"	ND	110	82%	"	--	--	"	
Sodium	"	3000	25	370	"	"	ND	3660	82%	"	--	--	"	
Duplicate (153251X)					**QC Source: SSI0028-01**				**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	ND	37	120	mg/Kg	1x	ND	--	--	--	NC%	(35)	09/17/09 23:51	
Antimony	"	ND	0.71	12	"	"	ND	--	--	--	NC%	"	"	
Arsenic	"	2.16	0.54	12	"	"	2.2	--	--	--	4%	"	"	J
Calcium	"	45.0	6.2	230	"	"	43	--	--	--	4%	"	"	J
Iron	"	115	1.9	42	"	"	120	--	--	--	3%	"	"	
Lead	"	14.2	0.50	6.2	"	"	15	--	--	--	2%	"	"	
Magnesium	"	23.1	2.7	230	"	"	21	--	--	--	11%	"	"	J
Manganese	"	1.49	0.033	4.2	"	"	1.6	--	--	--	8%	"	"	J
Potassium	"	ND	66	690	"	"	ND	--	--	--	NC%	"	"	
Selenium	"	ND	0.50	21	"	"	ND	--	--	--	NC%	"	"	
Silver	"	ND	0.19	4.2	"	"	ND	--	--	--	NC%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50413 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (153251X)				**QC Source: SSI0028-01**					**Extracted: 09/17/09 10:34**					
Sodium	6010B TMP	ND	28	420	mg/Kg	1x	ND	--	--	--	NC%	(35)	09/17/09 23:51	
Blank (580-50485-13)				**QC Source:**					**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	ND	30	100	mg/Kg	1x	--	--	--	--	--	--	09/17/09 23:18	
Antimony	"	ND	0.57	10	"	"	--	--	--	--	--	--	"	
Arsenic	"	ND	0.43	10	"	"	--	--	--	--	--	--	"	
Calcium	"	ND	5.0	180	"	"	--	--	--	--	--	--	"	
Iron	"	ND	1.5	33	"	"	--	--	--	--	--	--	"	
Lead	"	ND	0.40	5.0	"	"	--	--	--	--	--	--	"	
Magnesium	"	4.93	2.2	180	"	"	--	--	--	--	--	--	"	J
Manganese	"	ND	0.027	3.3	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	53	550	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.40	17	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.15	3.3	"	"	--	--	--	--	--	--	"	
Sodium	"	ND	23	330	"	"	--	--	--	--	--	--	"	
LCS (580-50485-14)				**QC Source:**					**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	637	30	100	mg/Kg	1x	--	667	96%	(80-120)	--	--	09/17/09 23:23	
Antimony	"	458	0.57	10	"	"	--	500	92%	"	--	--	"	
Arsenic	"	628	0.43	10	"	"	--	667	94%	"	--	--	"	
Calcium	"	3110	5.0	180	"	"	--	3330	93%	"	--	--	"	
Iron	"	3540	1.5	33	"	"	--	3670	97%	"	--	--	"	
Lead	"	158	0.40	5.0	"	"	--	167	95%	"	--	--	"	
Magnesium	"	3120	2.2	180	"	"	--	3330	93%	"	--	--	"	
Manganese	"	164	0.027	3.3	"	"	--	167	98%	"	--	--	"	
Potassium	"	3180	53	550	"	"	--	3330	95%	"	--	--	"	
Selenium	"	598	0.40	17	"	"	--	667	90%	"	--	--	"	
Silver	"	90.7	0.15	3.3	"	"	--	100	91%	"	--	--	"	
Sodium	"	2690	23	330	"	"	--	3330	81%	"	--	--	"	
LCS Dup (580-50485-15)				**QC Source:**					**Extracted: 09/17/09 10:34**					
Aluminum	6010B TMP	637	30	100	mg/Kg	1x	--	667	96%	(80-120)	0%	(35)	09/17/09 23:28	
Antimony	"	463	0.57	10	"	"	--	500	93%	"	1%	"	"	
Arsenic	"	630	0.43	10	"	"	--	667	94%	"	0%	"	"	
Calcium	"	3170	5.0	180	"	"	--	3330	95%	"	2%	"	"	
Iron	"	3570	1.5	33	"	"	--	3670	97%	"	1%	"	"	
Lead	"	159	0.40	5.0	"	"	--	167	95%	"	0%	"	"	
Magnesium	"	3180	2.2	180	"	"	--	3330	95%	"	2%	"	"	
Manganese	"	164	0.027	3.3	"	"	--	167	98%	"	0%	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50413 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50485-15)				**QC Source:**						**Extracted: 09/17/09 10:34**				
Potassium	6010B TMP	3240	53	550	mg/Kg	1x	--	3330	97%	(80-120)	2%	(35)	09/17/09 23:28	
Selenium	"	601	0.40	17	"	"	--	667	90%	"	1%	"	"	
Silver	"	91.4	0.15	3.3	"	"	--	100	91%	"	1%	"	"	
Sodium	"	2730	23	330	"	"	--	3330	82%	"	1%	"	"	
LCS (580-50485-16)				**QC Source:**						**Extracted: 09/17/09 10:34**				
Aluminum	6010B TMP	2960	18	60	mg/Kg	1x	--	7010	42%	(51.5-148.	--	--	09/17/09 23:33	*
Antimony	"	23.3	0.34	6.0	"	"	--	204	11%	(0-263.2)	--	--	"	
Arsenic	"	78.1	0.26	6.0	"	"	--	95.5	82%	(79.2-121.	--	--	"	
Calcium	"	7420	3.0	110	"	"	--	7470	99%	(80.6-119.	--	--	"	
Iron	"	4280	0.92	20	"	"	--	14600	29%	(30.1-169.	--	--	"	*
Lead	"	88.6	0.24	3.0	"	"	--	92.4	96%	(81.5-118.	--	--	"	
Magnesium	"	1710	1.3	110	"	"	--	2880	59%	(73.8-126.	--	--	"	*
Manganese	"	257	0.016	2.0	"	"	--	292	88%	(76.7-123.	--	--	"	
Potassium	"	1650	32	330	"	"	--	2580	64%	(73.3-127.	--	--	"	*
Selenium	"	132	0.24	10	"	"	--	161	82%	(76.7-123.	--	--	"	
Silver	"	70.6	0.090	2.0	"	"	--	83.8	84%	(46.6-153.	--	--	"	
Sodium	"	295	14	200	"	"	--	413	71%	(70.1-129.	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51220 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153251D--RE1)					**QC Source: SSI0028-01**						**Extracted: 10/01/09 10:41**			
Cadmium	6010B TMP	17.7	0.32	2.0	mg/Kg	1x	ND	19.8	89%	(75-125)	4%	(35)	10/01/09 18:51	
Beryllium	"	17.8	0.0048	0.99	"	"	ND	"	90%	"	4%	"	"	
Barium	"	741	0.059	2.0	"	"	2.4	792	93%	"	4%	"	"	
Thallium	"	683	0.55	20	"	"	1.5	"	86%	"	4%	"	"	
Nickel	"	194	0.32	4.0	"	"	31	198	82%	"	3%	"	"	
Vanadium	"	191	0.12	2.0	"	"	26	"	84%	"	2%	"	"	
Copper	"	104	0.87	4.0	"	"	38	99.0	66%	"	0%	"	"	F
Zinc	"	184	0.79	9.9	"	"	6.9	198	89%	"	2%	"	"	
Chromium	"	77.9	0.19	5.1	"	"	13	79.2	81%	"	2%	"	"	
Cobalt	"	191	0.13	2.0	"	"	0.48	198	96%	"	4%	"	"	
Matrix Spike (153251S--RE1)					**QC Source: SSI0028-01**						**Extracted: 10/01/09 10:41**			
Cadmium	6010B TMP	17.1	0.29	1.8	mg/Kg	1x	ND	18.3	93%	(75-125)	--	--	10/01/09 18:47	
Beryllium	"	17.1	0.0044	0.92	"	"	ND	"	93%	"	--	--	"	
Barium	"	715	0.055	1.8	"	"	2.4	732	97%	"	--	--	"	
Thallium	"	657	0.51	18	"	"	1.5	"	90%	"	--	--	"	
Nickel	"	188	0.29	3.7	"	"	31	183	86%	"	--	--	"	
Vanadium	"	186	0.11	1.8	"	"	26	"	88%	"	--	--	"	
Copper	"	103	0.81	3.7	"	"	38	91.5	72%	"	--	--	"	F
Zinc	"	187	0.73	9.2	"	"	6.9	183	98%	"	--	--	"	
Chromium	"	76.2	0.17	4.8	"	"	13	73.2	86%	"	--	--	"	
Cobalt	"	183	0.12	1.8	"	"	0.48	183	100%	"	--	--	"	
Duplicate (153251X-RE1)					**QC Source: SSI0028-01**						**Extracted: 10/01/09 10:41**			
Cadmium	6010B TMP	ND	0.33	2.1	mg/Kg	1x	ND	--	--	--	NC%	(35)	10/01/09 18:43	
Beryllium	"	ND	0.0050	1.0	"	"	ND	--	--	--	NC%	"	"	
Barium	"	1.95	0.062	2.1	"	"	2.4	--	--	--	21%	"	"	J
Thallium	"	1.49	0.58	21	"	"	1.5	--	--	--	1%	"	"	J
Nickel	"	24.6	0.33	4.2	"	"	31	--	--	--	22%	"	"	
Vanadium	"	22.9	0.12	2.1	"	"	26	--	--	--	11%	"	"	
Copper	"	30.8	0.91	4.2	"	"	38	--	--	--	21%	"	"	
Zinc	"	13.6	0.83	10	"	"	6.9	--	--	--	65%	"	"	
Chromium	"	10.9	0.20	5.4	"	"	13	--	--	--	21%	"	"	
Cobalt	"	0.385	0.13	2.1	"	"	0.48	--	--	--	21%	"	"	J

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51220 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-51315-13)				**QC Source:**					**Extracted: 10/01/09 10:41**					
Cadmium	6010B TMP	ND	0.27	1.7	mg/Kg	1x	--	--	--	--	--	--	10/01/09 18:19	
Beryllium	"	ND	0.0040	0.83	"	"	--	--	--	--	--	--	"	
Barium	"	ND	0.050	1.7	"	"	--	--	--	--	--	--	"	
Thallium	"	4.61	0.47	17	"	"	--	--	--	--	--	--	"	J
Nickel	"	ND	0.27	3.3	"	"	--	--	--	--	--	--	"	
Vanadium	"	ND	0.10	1.7	"	"	--	--	--	--	--	--	"	
Copper	"	ND	0.73	3.3	"	"	--	--	--	--	--	--	"	
Zinc	"	ND	0.67	8.3	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.16	4.3	"	"	--	--	--	--	--	--	"	
Cobalt	"	ND	0.11	1.7	"	"	--	--	--	--	--	--	"	
LCS (580-51315-14)				**QC Source:**					**Extracted: 10/01/09 10:41**					
Cadmium	6010B TMP	15.1	0.27	1.7	mg/Kg	1x	--	16.7	91%	(80-120)	--	--	10/01/09 18:22	
Beryllium	"	15.3	0.0040	0.83	"	"	--	"	92%	"	--	--	"	
Barium	"	637	0.050	1.7	"	"	--	667	96%	"	--	--	"	
Thallium	"	638	0.47	17	"	"	--	"	96%	"	--	--	"	
Nickel	"	161	0.27	3.3	"	"	--	167	97%	"	--	--	"	
Vanadium	"	158	0.10	1.7	"	"	--	"	95%	"	--	--	"	
Copper	"	75.8	0.73	3.3	"	"	--	83.3	91%	"	--	--	"	
Zinc	"	154	0.67	8.3	"	"	--	167	92%	"	--	--	"	
Chromium	"	63.8	0.16	4.3	"	"	--	66.7	96%	"	--	--	"	
Cobalt	"	162	0.11	1.7	"	"	--	167	97%	"	--	--	"	
LCS Dup (580-51315-15)				**QC Source:**					**Extracted: 10/01/09 10:41**					
Cadmium	6010B TMP	15.3	0.27	1.7	mg/Kg	1x	--	16.7	92%	(80-120)	1%	(35)	10/01/09 18:26	
Beryllium	"	15.3	0.0040	0.83	"	"	--	"	92%	"	0%	"	"	
Barium	"	638	0.050	1.7	"	"	--	667	96%	"	0%	"	"	
Thallium	"	646	0.47	17	"	"	--	"	97%	"	1%	"	"	
Nickel	"	161	0.27	3.3	"	"	--	167	97%	"	0%	"	"	
Vanadium	"	158	0.10	1.7	"	"	--	"	95%	"	0%	"	"	
Copper	"	75.6	0.73	3.3	"	"	--	83.3	91%	"	0%	"	"	
Zinc	"	155	0.67	8.3	"	"	--	167	93%	"	0%	"	"	
Chromium	"	63.6	0.16	4.3	"	"	--	66.7	95%	"	0%	"	"	
Cobalt	"	162	0.11	1.7	"	"	--	167	97%	"	0%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51220 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-51315-16)					**QC Source:**								**Extracted: 10/01/09 10:41**	
Cadmium	6010B TMP	15.3	0.27	1.7	mg/Kg	1x	--	16.7	92%	(81.2-118.	--	--	10/01/09 18:31	
Beryllium	"	15.3	0.0040	0.83	"	"	--	"	92%	(79.6-120.	--	--	"	
Barium	"	639	0.050	1.7	"	"	--	667	96%	(81.5-118.	--	--	"	
Thallium	"	647	0.47	17	"	"	--	"	97%	(78.1-121.	--	--	"	
Nickel	"	162	0.27	3.3	"	"	--	167	97%	(78.5-122.	--	--	"	
Vanadium	"	158	0.10	1.7	"	"	--	"	95%	(77.1-123.	--	--	"	
Copper	"	75.9	0.73	3.3	"	"	--	83.3	91%	(78.4-122.	--	--	"	
Zinc	"	155	0.67	8.3	"	"	--	167	93%	(80.4-119.	--	--	"	
Chromium	"	64.1	0.16	4.3	"	"	--	66.7	96%	(80.1-119.	--	--	"	
Cobalt	"	163	0.11	1.7	"	"	--	167	98%	(81.0-119.	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50338 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153252D)				**QC Source: SSI0028-02**				**Extracted: 09/16/09 13:45**						
Calcium	6010B Total Recoverable	46.8	0.028	1.1	mg/L	1x	27	20.0	99%	(75-125)	2%	(20)	09/17/09 01:15	
Iron	"	21.5	0.032	0.20	"	"	0.065	22.0	97%	"	3%	"	"	
Magnesium	"	26.1	0.23	1.1	"	"	6.6	20.0	98%	"	2%	"	"	
Sodium	"	21.1	0.18	2.0	"	"	2.8	"	92%	"	3%	"	"	
Manganese	"	1.24	0.0017	0.020	"	"	0.25	1.00	99%	"	2%	"	"	
Potassium	"	22.3	0.41	3.3	"	"	2.3	20.0	100%	"	2%	"	09/17/09 12:36	
Matrix Spike (153252S)				**QC Source: SSI0028-02**				**Extracted: 09/16/09 13:45**						
Calcium	6010B Total Recoverable	45.7	0.028	1.1	mg/L	1x	27	20.0	94%	(75-125)	--	--	09/17/09 01:10	
Iron	"	20.9	0.032	0.20	"	"	0.065	22.0	95%	"	--	--	"	
Magnesium	"	25.5	0.23	1.1	"	"	6.6	20.0	95%	"	--	--	"	
Sodium	"	20.5	0.18	2.0	"	"	2.8	"	88%	"	--	--	"	
Manganese	"	1.21	0.0017	0.020	"	"	0.25	1.00	96%	"	--	--	"	
Potassium	"	21.8	0.41	3.3	"	"	2.3	20.0	97%	"	--	--	09/17/09 12:32	
Duplicate (153252X)				**QC Source: SSI0028-02**				**Extracted: 09/16/09 13:45**						
Calcium	6010B Total Recoverable	27.9	0.028	1.1	mg/L	1x	27	--	--	--	3%	(20)	09/17/09 01:04	
Iron	"	0.127	0.032	0.20	"	"	0.065	--	--	--	65%	"	"	J
Magnesium	"	6.72	0.23	1.1	"	"	6.6	--	--	--	2%	"	"	
Sodium	"	3.26	0.18	2.0	"	"	2.8	--	--	--	15%	"	"	
Manganese	"	0.267	0.0017	0.020	"	"	0.25	--	--	--	7%	"	"	
Potassium	"	2.34	0.41	3.3	"	"	2.3	--	--	--	1%	"	09/17/09 12:28	J
Blank (580-50423-13)				**QC Source:**				**Extracted: 09/16/09 13:45**						
Calcium	6010B Total Recoverable	ND	0.028	1.1	mg/L	1x	--	--	--	--	--	--	09/17/09 00:31	
Iron	"	ND	0.032	0.20	"	"	--	--	--	--	--	--	"	
Magnesium	"	ND	0.23	1.1	"	"	--	--	--	--	--	--	"	
Sodium	"	0.558	0.18	2.0	"	"	--	--	--	--	--	--	"	J
Manganese	"	ND	0.0017	0.020	"	"	--	--	--	--	--	--	"	
LCS (580-50423-14)				**QC Source:**				**Extracted: 09/16/09 13:45**						
Calcium	6010B Total Recoverable	19.5	0.028	1.1	mg/L	1x	--	20.0	98%	(80-120)	--	--	09/17/09 00:37	
Iron	"	21.3	0.032	0.20	"	"	--	22.0	97%	"	--	--	"	
Magnesium	"	19.8	0.23	1.1	"	"	--	20.0	99%	"	--	--	"	
Sodium	"	18.5	0.18	2.0	"	"	--	"	93%	"	--	--	"	
Manganese	"	0.973	0.0017	0.020	"	"	--	1.00	97%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50338 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50423-15)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Calcium	6010B Total Recoverable	19.4	0.028	1.1	mg/L	1x	--	20.0	97%	(80-120)	1%	(20)	09/17/09 00:42	
Iron	"	21.3	0.032	0.20	"	"	--	22.0	97%	"	0%	"	"	
Magnesium	"	19.5	0.23	1.1	"	"	--	20.0	97%	"	2%	"	"	
Sodium	"	18.5	0.18	2.0	"	"	--	"	93%	"	0%	"	"	
Manganese	"	0.977	0.0017	0.020	"	"	--	1.00	98%	"	0%	"	"	
LCS (580-50423-16)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Calcium	6010B Total Recoverable	19.4	0.028	1.1	mg/L	1x	--	20.0	97%	(80-120)	--	--	09/17/09 00:47	
Iron	"	21.4	0.032	0.20	"	"	--	22.0	97%	"	--	--	"	
Magnesium	"	19.5	0.23	1.1	"	"	--	20.0	98%	"	--	--	"	
Sodium	"	18.5	0.18	2.0	"	"	--	"	93%	"	--	--	"	
Manganese	"	0.973	0.0017	0.020	"	"	--	1.00	97%	"	--	--	"	
Blank (580-50445-13)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Potassium	6010B Total Recoverable	ND	0.41	3.3	mg/L	1x	--	--	--	--	--	--	09/17/09 12:04	
LCS (580-50445-14)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Potassium	6010B Total Recoverable	19.2	0.41	3.3	mg/L	1x	--	20.0	96%	(80-120)	--	--	09/17/09 12:08	
LCS Dup (580-50445-15)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Potassium	6010B Total Recoverable	19.8	0.41	3.3	mg/L	1x	--	20.0	99%	(80-120)	3%	(20)	09/17/09 12:11	
LCS (580-50445-16)				**QC Source:**						**Extracted: 09/16/09 13:45**				
Potassium	6010B Total Recoverable	19.7	0.41	3.3	mg/L	1x	--	20.0	98%	(80-120)	--	--	09/17/09 12:15	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50336 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50369-14)			**QC Source:**					**Extracted: 09/16/09 13:15**						
Barium	6020 Total Recoverable	ND	0.00027	0.0060	mg/L	5x	--	--	--	--	--	--	09/16/09 18:50	
Arsenic	"	ND	0.00024	0.0020	"	"	--	--	--	--	--	--	"	
Beryllium	"	ND	0.00026	0.0020	"	"	--	--	--	--	--	--	"	
Antimony	"	ND	0.00040	0.0020	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.00034	0.0020	"	"	--	--	--	--	--	--	"	
Cadmium	"	ND	0.00014	0.0020	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.00015	0.0020	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.00037	0.0020	"	"	--	--	--	--	--	--	"	
Cobalt	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
Thallium	"	0.000120	0.000060	0.0040	"	"	--	--	--	--	--	--	"	J
Vanadium	"	ND	0.00023	0.0020	"	"	--	--	--	--	--	--	"	
Copper	"	ND	0.00015	0.0050	"	"	--	--	--	--	--	--	"	
Lead	"	ND	0.00017	0.0020	"	"	--	--	--	--	--	--	"	
Zinc	"	ND	0.0020	0.0070	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.00022	0.0020	"	"	--	--	--	--	--	--	"	
LCS (580-50369-21)			**QC Source:**					**Extracted: 09/16/09 13:15**						
Arsenic	6020 Total Recoverable	3.60	0.0024	0.020	mg/L	50x	--	4.00	90%	(80-120)	--	--	09/16/09 19:16	
Barium	"	4.15	0.0027	0.060	"	"	--	"	104%	"	--	--	"	
Beryllium	"	0.110	0.0026	0.020	"	"	--	0.100	110%	"	--	--	"	
Antimony	"	2.98	0.0040	0.020	"	"	--	3.00	99%	"	--	--	"	
Cadmium	"	0.100	0.0014	0.020	"	"	--	0.100	100%	"	--	--	"	
Selenium	"	3.47	0.0034	0.020	"	"	--	4.00	87%	"	--	--	"	
Silver	"	0.641	0.0015	0.020	"	"	--	0.600	107%	"	--	--	"	
Chromium	"	0.369	0.0037	0.020	"	"	--	0.400	92%	"	--	--	"	
Cobalt	"	0.973	0.0016	0.020	"	"	--	1.00	97%	"	--	--	"	
Thallium	"	3.86	0.00060	0.040	"	"	--	4.00	96%	"	--	--	"	
Copper	"	0.487	0.0015	0.050	"	"	--	0.500	97%	"	--	--	"	
Vanadium	"	0.981	0.0023	0.020	"	"	--	1.00	98%	"	--	--	"	
Zinc	"	0.900	0.020	0.070	"	"	--	"	90%	"	--	--	"	
Lead	"	0.990	0.0017	0.020	"	"	--	"	99%	"	--	--	"	
Nickel	"	0.972	0.0022	0.020	"	"	--	"	97%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50336 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50369-22)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Arsenic	6020 Total Recoverable	3.54	0.0024	0.020	mg/L	50x	--	4.00	89%	(80-120)	2%	(20)	09/16/09 19:20	
Barium	"	4.02	0.0027	0.060	"	"	--	"	101%	"	3%	"	"	
Beryllium	"	0.112	0.0026	0.020	"	"	--	0.100	112%	"	2%	"	"	
Antimony	"	2.91	0.0040	0.020	"	"	--	3.00	97%	"	3%	"	"	
Selenium	"	3.58	0.0034	0.020	"	"	--	4.00	90%	"	3%	"	"	
Cadmium	"	0.101	0.0014	0.020	"	"	--	0.100	101%	"	1%	"	"	
Chromium	"	0.375	0.0037	0.020	"	"	--	0.400	94%	"	2%	"	"	
Silver	"	0.633	0.0015	0.020	"	"	--	0.600	106%	"	1%	"	"	
Thallium	"	3.90	0.00060	0.040	"	"	--	4.00	97%	"	1%	"	"	
Cobalt	"	0.945	0.0016	0.020	"	"	--	1.00	94%	"	3%	"	"	
Vanadium	"	0.950	0.0023	0.020	"	"	--	"	95%	"	3%	"	"	
Copper	"	0.474	0.0015	0.050	"	"	--	0.500	95%	"	3%	"	"	
Lead	"	0.999	0.0017	0.020	"	"	--	1.00	100%	"	1%	"	"	
Zinc	"	0.866	0.020	0.070	"	"	--	"	87%	"	4%	"	"	
Nickel	"	0.939	0.0022	0.020	"	"	--	"	94%	"	3%	"	"	
LCS (580-50369-23)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Arsenic	6020 Total Recoverable	3.61	0.0024	0.020	mg/L	50x	--	4.00	90%	(80-120)	--	--	09/16/09 19:24	
Barium	"	4.16	0.0027	0.060	"	"	--	"	104%	"	--	--	"	
Beryllium	"	0.114	0.0026	0.020	"	"	--	0.100	114%	"	--	--	"	
Antimony	"	2.98	0.0040	0.020	"	"	--	3.00	99%	"	--	--	"	
Selenium	"	3.66	0.0034	0.020	"	"	--	4.00	92%	"	--	--	"	
Cadmium	"	0.101	0.0014	0.020	"	"	--	0.100	101%	"	--	--	"	
Chromium	"	0.379	0.0037	0.020	"	"	--	0.400	95%	"	--	--	"	
Silver	"	0.642	0.0015	0.020	"	"	--	0.600	107%	"	--	--	"	
Cobalt	"	0.974	0.0016	0.020	"	"	--	1.00	97%	"	--	--	"	
Thallium	"	3.85	0.00060	0.040	"	"	--	4.00	96%	"	--	--	"	
Copper	"	0.464	0.0015	0.050	"	"	--	0.500	93%	"	--	--	"	
Vanadium	"	0.977	0.0023	0.020	"	"	--	1.00	98%	"	--	--	"	
Lead	"	0.988	0.0017	0.020	"	"	--	"	99%	"	--	--	"	
Zinc	"	0.892	0.020	0.070	"	"	--	"	89%	"	--	--	"	
Nickel	"	0.942	0.0022	0.020	"	"	--	"	94%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51212 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153252D)					**QC Source: SSI0028-02**					**Extracted: 09/16/09 13:15**				
Barium	6020 Total Recoverable	4.69	0.0027	0.060	mg/L	50x	0.077	4.00	115%	(75-125)	5%	(20)	09/16/09 19:09	
Arsenic	"	3.89	0.0024	0.020	"	"	ND	"	97%	"	4%	"	"	
Aluminum	"	4.80	0.023	4.0	"	"	0.099	"	117%	"	2%	"	09/30/09 20:01	
Antimony	"	3.27	0.0040	0.020	"	"	ND	3.00	109%	"	7%	"	09/16/09 19:09	
Beryllium	"	0.119	0.0026	0.020	"	"	ND	0.100	119%	"	1%	"	"	
Selenium	"	3.95	0.0034	0.020	"	"	ND	4.00	99%	"	3%	"	"	
Cadmium	"	0.103	0.0014	0.020	"	"	ND	0.100	103%	"	5%	"	"	
Silver	"	0.729	0.0015	0.020	"	"	ND	0.600	121%	"	6%	"	"	
Chromium	"	0.407	0.0037	0.020	"	"	0.00071	0.400	102%	"	3%	"	"	
Cobalt	"	1.05	0.0016	0.020	"	"	0.00070	1.00	105%	"	3%	"	"	
Thallium	"	4.33	0.00060	0.040	"	"	ND	4.00	108%	"	4%	"	"	
Vanadium	"	1.06	0.0023	0.020	"	"	ND	1.00	106%	"	2%	"	"	
Copper	"	0.539	0.0015	0.050	"	"	0.0026	0.500	107%	"	5%	"	"	
Lead	"	1.12	0.0017	0.020	"	"	0.00018	1.00	112%	"	5%	"	"	
Zinc	"	1.02	0.020	0.070	"	"	0.0027	"	102%	"	0%	"	"	
Nickel	"	1.06	0.0022	0.020	"	"	0.0024	"	105%	"	3%	"	"	
Matrix Spike (153252S)					**QC Source: SSI0028-02**					**Extracted: 09/16/09 13:15**				
Arsenic	6020 Total Recoverable	3.75	0.0024	0.020	mg/L	50x	ND	4.00	94%	(75-125)	--	--	09/16/09 19:05	
Barium	"	4.46	0.0027	0.060	"	"	0.077	"	110%	"	--	--	"	
Aluminum	"	4.68	0.023	4.0	"	"	0.099	"	115%	"	--	--	09/30/09 19:58	
Antimony	"	3.04	0.0040	0.020	"	"	ND	3.00	101%	"	--	--	09/16/09 19:05	
Beryllium	"	0.121	0.0026	0.020	"	"	ND	0.100	121%	"	--	--	"	
Selenium	"	3.82	0.0034	0.020	"	"	ND	4.00	96%	"	--	--	"	
Cadmium	"	0.108	0.0014	0.020	"	"	ND	0.100	108%	"	--	--	"	
Chromium	"	0.397	0.0037	0.020	"	"	0.00071	0.400	99%	"	--	--	"	
Silver	"	0.688	0.0015	0.020	"	"	ND	0.600	115%	"	--	--	"	
Cobalt	"	1.02	0.0016	0.020	"	"	0.00070	1.00	101%	"	--	--	"	
Thallium	"	4.15	0.00060	0.040	"	"	ND	4.00	104%	"	--	--	"	
Copper	"	0.512	0.0015	0.050	"	"	0.0026	0.500	102%	"	--	--	"	
Vanadium	"	1.04	0.0023	0.020	"	"	ND	1.00	104%	"	--	--	"	
Lead	"	1.06	0.0017	0.020	"	"	0.00018	"	106%	"	--	--	"	
Zinc	"	1.02	0.020	0.070	"	"	0.0027	"	101%	"	--	--	"	
Nickel	"	1.02	0.0022	0.020	"	"	0.0024	"	102%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51212 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (153252X)				**QC Source: SSI0028-02**					**Extracted: 09/16/09 13:15**					
Barium	6020 Total Recoverable	0.0800	0.00027	0.0060	mg/L	5x	0.077	--	--	--	4%	(20)	09/16/09 19:01	
Arsenic	"	ND	0.00024	0.0020	"	"	ND	--	--	--	NC%	"	"	
Aluminum	"	0.101	0.0023	0.40	"	"	0.099	--	--	--	2%	"	09/30/09 19:54	J
Antimony	"	ND	0.00040	0.0020	"	"	ND	--	--	--	NC%	"	09/16/09 19:01	
Beryllium	"	ND	0.00026	0.0020	"	"	ND	--	--	--	NC%	"	"	
Cadmium	"	ND	0.00014	0.0020	"	"	ND	--	--	--	NC%	"	"	
Selenium	"	ND	0.00034	0.0020	"	"	ND	--	--	--	NC%	"	"	
Silver	"	ND	0.00015	0.0020	"	"	ND	--	--	--	NC%	"	"	
Chromium	"	0.000670	0.00037	0.0020	"	"	0.00071	--	--	--	6%	"	"	J
Thallium	"	ND	0.000060	0.0040	"	"	ND	--	--	--	NC%	"	"	
Cobalt	"	0.000760	0.00016	0.0020	"	"	0.00070	--	--	--	8%	"	"	J
Copper	"	0.00242	0.00015	0.0050	"	"	0.0026	--	--	--	5%	"	"	J
Vanadium	"	ND	0.00023	0.0020	"	"	ND	--	--	--	NC%	"	"	
Lead	"	ND	0.00017	0.0020	"	"	0.00018	--	--	--	NC%	"	"	
Zinc	"	0.00218	0.0020	0.0070	"	"	0.0027	--	--	--	20%	"	"	J
Nickel	"	0.00252	0.00022	0.0020	"	"	0.0024	--	--	--	7%	"	"	
Blank (580-51206-26)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Aluminum	6020 Total Recoverable	0.0146	0.0023	0.40	mg/L	5x	--	--	--	--	--	--	09/30/09 19:43	J
LCS (580-51206-33)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Aluminum	6020 Total Recoverable	4.17	0.023	4.0	mg/L	50x	--	4.00	104%	(80-120)	--	--	09/30/09 20:08	
LCS Dup (580-51206-34)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Aluminum	6020 Total Recoverable	3.85	0.023	4.0	mg/L	50x	--	4.00	96%	(80-120)	8%	(20)	09/30/09 20:12	J
LCS (580-51206-35)				**QC Source:**					**Extracted: 09/16/09 13:15**					
Aluminum	6020 Total Recoverable	3.98	0.023	4.0	mg/L	50x	--	4.00	100%	(80-120)	--	--	09/30/09 20:15	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50178 **Waste Preparation Method: 3580A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50190-12)			**QC Source:**						**Extracted: 09/14/09 11:17**					
Naphthalene	8270C PAH	ND	220	2000	ug/Kg	1x	--	--	--	--	--	--	09/14/09 16:39	
2-Methylnaphthalene	"	ND	230	2000	"	"	--	--	--	--	--	--	"	
1-Methylnaphthalene	"	ND	180	3000	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	160	2000	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	160	2000	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	120	2000	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	210	2000	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	140	2000	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	120	2000	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	140	2000	"	"	--	--	--	--	--	--	"	
Benzo[a]anthracene	"	ND	170	2500	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	140	2500	"	"	--	--	--	--	--	--	"	
Benzo[b]fluoranthene	"	ND	410	2000	"	"	--	--	--	--	--	--	"	
Benzo[k]fluoranthene	"	ND	130	2500	"	"	--	--	--	--	--	--	"	
Benzo[a]pyrene	"	ND	210	3000	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	420	4000	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	220	4000	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	150	2500	"	"	--	--	--	--	--	--	"	
Surrogate(s):	*Nitrobenzene-d5*	*Recovery:*	*82%*		*Limits:*	*38-141%*	*"*						*09/14/09 16:39*	
	2-Fluorobiphenyl		*76%*			*42-140%*	*"*						*"*	
	Terphenyl-d14		*81%*			*42-151%*	*"*						*"*	
LCS (580-50190-13)			**QC Source:**						**Extracted: 09/14/09 11:17**					
Naphthalene	8270C PAH	83400	220	2000	ug/Kg	1x	--	100000	83%	(64-129)	--	--	09/14/09 17:00	
2-Methylnaphthalene	"	92600	230	2000	"	"	--	"	92%	(65-125)	--	--	"	
1-Methylnaphthalene	"	87800	180	3000	"	"	--	"	88%	(48-148)	--	--	"	
Acenaphthylene	"	83800	160	2000	"	"	--	"	84%	(69-129)	--	--	"	
Acenaphthene	"	83500	160	2000	"	"	--	"	83%	(65-130)	--	--	"	
Fluorene	"	88900	120	2000	"	"	--	"	89%	(68-128)	--	--	"	
Phenanthrene	"	78900	210	2000	"	"	--	"	79%	(65-125)	--	--	"	
Anthracene	"	79800	140	2000	"	"	--	"	80%	(73-123)	--	--	"	
Fluoranthene	"	85000	120	2000	"	"	--	"	85%	(61-121)	--	--	"	
Pyrene	"	81600	140	2000	"	"	--	"	81%	(54-134)	--	--	"	
Benzo[a]anthracene	"	80900	170	2500	"	"	--	"	81%	(64-124)	--	--	"	
Chrysene	"	82800	140	2500	"	"	--	"	83%	(71-126)	--	--	"	
Benzo[b]fluoranthene	"	90900	410	2000	"	"	--	"	91%	(66-136)	--	--	"	
Benzo[k]fluoranthene	"	78800	130	2500	"	"	--	"	79%	(63-143)	--	--	"	
Benzo[a]pyrene	"	84400	210	3000	"	"	--	"	84%	(68-128)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	83000	420	4000	"	"	--	"	83%	(59-139)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50178 **Waste Preparation Method: 3580A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50190-13)			**QC Source:**						**Extracted: 09/14/09 11:17**					
Dibenz(a,h)anthracene	8270C PAH	86800	220	4000	ug/Kg	1x	--	100000	87%	(57-142)	--	--	09/14/09 17:00	
Benzo[g,h,i]perylene	"	81600	150	2500	"	"	--	"	81%	"	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 83%*			*Limits: 38-141%*	"							*09/14/09 17:00*	
2-Fluorobiphenyl		*76%*			*42-140%*	"							*"*	
Terphenyl-d14		*81%*			*42-151%*	"							*"*	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49936 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50120-23)				QC Source:					Extracted: 09/09/09 16:54					
Naphthalene	8270C STD	ND	0.0036	0.010	ug/L	1x	--	--	--	--	--	--	09/11/09 23:44	
2-Methylnaphthalene	"	ND	0.0030	0.013	"	"	--	--	--	--	--	--	"	
1-Methylnaphthalene	"	0.00163	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Acenaphthylene	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.0010	0.010	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	0.0012	0.010	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	0.00319	0.0011	0.010	"	"	--	--	--	--	--	--	"	J
Anthracene	"	ND	0.00080	0.010	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	0.0016	0.010	"	"	--	--	--	--	--	--	"	
Pyrene	"	0.00379	0.0017	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[a]anthracene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.0021	0.010	"	"	--	--	--	--	--	--	"	
Benzo[b]fluoranthene	"	ND	0.0026	0.010	"	"	--	--	--	--	--	--	"	
Benzo[k]fluoranthene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Benzo[a]pyrene	"	ND	0.0019	0.020	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	0.0018	0.010	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 97%*		*Limits: 40-110%*	"								*09/11/09 23:44*	
2-Fluorobiphenyl		*87%*		*50-110%*	"								"	
Terphenyl-d14		*119%*		*50-135%*	"								"	
LCS (580-50120-24)				QC Source:					Extracted: 09/09/09 16:54					
Naphthalene	8270C STD	0.891	0.0036	0.010	ug/L	1x	--	1.00	89%	(40-100)	--	--	09/12/09 00:03	
2-Methylnaphthalene	"	1.05	0.0030	0.013	"	"	--	"	104%	(45-105)	--	--	"	
1-Methylnaphthalene	"	0.999	0.0012	0.010	"	"	--	"	100%	(50-150)	--	--	"	
Acenaphthylene	"	0.999	0.0011	0.010	"	"	--	"	100%	(50-105)	--	--	"	
Acenaphthene	"	0.927	0.0010	0.010	"	"	--	"	92%	(45-110)	--	--	"	
Fluorene	"	0.981	0.0012	0.010	"	"	--	"	98%	(50-110)	--	--	"	
Phenanthrene	"	0.927	0.0011	0.010	"	"	--	"	92%	(50-115)	--	--	"	
Anthracene	"	1.05	0.00080	0.010	"	"	--	"	105%	(55-110)	--	--	"	
Fluoranthene	"	1.07	0.0016	0.010	"	"	--	"	107%	(55-115)	--	--	"	
Pyrene	"	1.01	0.0017	0.010	"	"	--	"	101%	(50-130)	--	--	"	
Benzo[a]anthracene	"	1.06	0.0024	0.010	"	"	--	"	106%	(55-110)	--	--	"	
Chrysene	"	1.07	0.0021	0.010	"	"	--	"	107%	"	--	--	"	
Benzo[b]fluoranthene	"	0.791	0.0026	0.010	"	"	--	"	79%	(45-120)	--	--	"	
Benzo[k]fluoranthene	"	0.838	0.0024	0.010	"	"	--	"	84%	(45-125)	--	--	"	
Benzo[a]pyrene	"	0.895	0.0019	0.020	"	"	--	"	89%	(55-110)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	0.889	0.0020	0.010	"	"	--	"	89%	(45-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 49936 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50120-24)				**QC Source:**									**Extracted: 09/09/09 16:54**	
Dibenz(a,h)anthracene	8270C STD	0.910	0.0018	0.010	ug/L	1x	--	1.00	91%	(40-125)	--	--	09/12/09 00:03	
Benzo[g,h,i]perylene	"	0.844	0.0020	0.010	"	"	--	"	84%	"	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 92%*			*Limits: 40-110%*	"							*09/12/09 00:03*	
2-Fluorobiphenyl		*83%*			*50-110%*	"							*"*	
Terphenyl-d14		*107%*			*50-135%*	"							*"*	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50176 **Waste Preparation Method: 3580A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50247-3)				QC Source:					Extracted: 09/14/09 11:14					
PCB-1016	8082 STD	ND	0.16	0.50	mg/Kg	1x	--	--	--	--	--	--	09/15/09 11:47	
PCB-1221	"	ND	0.40	0.50	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	0.35	0.50	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	0.10	0.50	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	0.065	0.50	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	0.10	0.50	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	0.15	0.50	"	"	--	--	--	--	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 107%*			*Limits: 45-155%*	"							*09/15/09 11:47*	
DCB Decachlorobiphenyl		*126%*			*60-125%*	"							"	*X*
LCS (580-50247-4)				QC Source:					Extracted: 09/14/09 11:14					
PCB-1016	8082 STD	5.80	0.16	0.50	mg/Kg	1x	--	5.00	116%	(40-140)	--	--	09/15/09 12:02	
PCB-1260	"	6.46	0.15	0.50	"	"	--	"	129%	(60-130)	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 115%*			*Limits: 45-155%*	"							*09/15/09 12:02*	
DCB Decachlorobiphenyl		*135%*			*60-125%*	"							"	*X*

QC Batch: 52320 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-52272-29)				QC Source:					Extracted: 09/09/09 17:01					
PCB-1016	8082 STD	ND	0.0045	0.050	ug/L	1x	--	--	--	--	--	--	10/19/09 18:19	
PCB-1221	"	ND	0.0062	0.050	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	0.0071	0.050	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	0.0044	0.050	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	0.0039	0.050	"	"	--	--	--	--	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 74%*			*Limits: 60-150%*	"							*10/19/09 18:19*	
DCB Decachlorobiphenyl		*94%*			*40-135%*	"							"	
LCS (580-52272-30)				QC Source:					Extracted: 09/09/09 17:01					
PCB-1016	8082 STD	0.836	0.0045	0.050	ug/L	1x	--	1.00	84%	(25-145)	--	--	10/19/09 18:35	
PCB-1260	"	0.967	0.0039	0.050	"	"	--	"	97%	(30-145)	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 71%*			*Limits: 60-150%*	"							*10/19/09 18:35*	
DCB Decachlorobiphenyl		*94%*			*40-135%*	"							"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Method Performed: 6010B TMP
Samples: SSI0028-01, SSI0028-01RE1

Method Performed: 6010B Total Recoverable
Samples: SSI0028-02, SSI0028-03, SSI0028-04, SSI0028-05, SSI0028-06, SSI0028-07

Method Performed: 6020 Total Recoverable
Samples: SSI0028-02, SSI0028-02RE1, SSI0028-03, SSI0028-03RE1, SSI0028-04, SSI0028-04RE1, SSI0028-05, SSI0028-05RE1, SSI0028-06, SSI0028-06RE1, SSI0028-07, SSI0028-07RE1

Method Performed: 7470A
Samples: SSI0028-02, SSI0028-03, SSI0028-04, SSI0028-05, SSI0028-06, SSI0028-07

Method Performed: 7471A
Samples: SSI0028-01

Method Performed: 8082 STD
Samples: SSI0028-01, SSI0028-02, SSI0028-03, SSI0028-05, SSI0028-06

Method Performed: 8270C PAH
Samples: SSI0028-01

Method Performed: 8270C STD
Samples: SSI0028-02, SSI0028-03, SSI0028-04, SSI0028-05, SSI0028-06, SSI0028-07

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Notes and Definitions

Report Specific Notes:

*	-	LCS or LCSD exceeds the control limits
B	-	Compound was found in the blank and sample.
C	-	Calibration Verification recovery was above the method control limit for this analyte. Analyte not detected, data not impacted.
F	-	MS or MSD exceeds the control limits
J	-	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
MHA	-	Due to high levels of analyte in the sample, the MS/MSD calculation does not provide useful spike recovery information. See Blank Spike (LCS).
p	-	The %RPD between the primary and confirmation column/detector is >40%. The lower value has been reported.
X	-	Surrogate exceeds the control limits

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.
Reporting Limits	-	Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.
Electronic Signature	-	Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy.* Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSI0029

CLIENT: Golder Associates

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200
Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498

INVOICE TO: Accounting
Golder Associates
(same Address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: [X] STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: HCL | — | — | Nitric | Nitric

REQUESTED ANALYSES

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	NWTPH-Dx extended	PCB (8082A low level)	PAH * (8270 SIM)	TAL metals Total	TAL metals Dissolved	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-MW11FP-090109	9/1/09 17:10	X	X	X	X	//////	LNAPL	2	See project specific reporting limits	-01
2 G-GA2-090209	9/2/09 1215	X	X	X	X	Hold	W	7		-02
3 G-GA4-090209	9/2/09 1430	X	X	X	X	Hold	W	7		-03
4 G-DW01-090209	9/2/09 1850	X		X	X	Hold	W	5		-04
5 G-GA3-090309	9/3/09 940	X	X	X	X	Hold	W	7		-05
6 G-GA3D-090309	9/3/09 950	X	X	X	X	Hold	W	7		-06
7 G-MW5-090309	9/3/09 1200	X		X	X		W	3	low volume - sorry!	
8										
9										
10										

RELEASED BY: [signature] DATE: 9/3/09
PRINT NAME: Kirsi Longley FIRM: Golder TIME: 1330

RECEIVED BY: [signature] DATE: 9/4/09
PRINT NAME: Chris Williams FIRM: TA Spokane TIME: 1550

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier IV Data Package (EPA CLP deliverable).
*PAH analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of Total metals.

TEMP: 8C

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSC0028 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 9/3/09 1330 Cooler signed for by: C Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☒ same as date received *or* ____/____/____

Cooler opened by (print) C Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☒ Other Pickup

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 1 Signed by See Back Date __/__/__

   Were custody seals unbroken and intact on arrival? ☐ Yes ☒ No

3. Were custody papers sealed in a plastic bag? ☐ Yes ☒ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: Melted

   Temperature by IR Gun 8.9 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☐ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags? ☐ Yes ☒ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☒ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 9/3/09

Samples logged in by (print) C Hanson (sign) [signature]

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **SSI0028**

SAMPLES :	Collect :	MATRIX
G-GA2	9-02-09	WATER
G-GA4	↓	↓
G-DW01	9-03-09	
G-GA3	↓	
G-GA3D		
G-BMW5	↓	↓
G-MW11FP	9-01-09	WATER/OTHER

DATA ASSESSMENT SUMMARY

REVIEW ITEM	ICP/ AES 6010	ICP/ MS 6020	Hg/~~Se~~ 7074	CN	Anions	OTHER
1. Data Completeness	O	O	O			
2. Holding Times	O	O	O			
3. Calibration	O	O	O			
4. Blanks	(1) X	(2) X	O			
5. Lab Duplicate, Field Duplicate RPD	O	O	O			
6. LCS, Blank Spike, MFS	(3) X	(4) X	O			
7. Matrix Spike, MSD	O	↓	O			
8. GFAA, MSA, Serial Dil.	(5) X	O	O			
9. Detection Limits, Other QC	O	O	O			
10. Data Verification, Overall Summary	O	O	O			

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Tl, Mg in Smpl.-01 and Na in Water samples detect in Method Blanks. Results changed to ND or J+(Na).

(2) Tl detect in water smpl M.Blank, Al detect in Water M.Blank

(3) Al, Fe, Mg, K out of limit in ~~water~~ soil LCS/assoc. results qualif. J/UJ.

(4) Cu recovery low in MS/MSD on Soil-01. Results qual. J.

(5) Ni, V, Cr out of limit. Smpl-01 qualif. (J).

Validated by: [signature] **Date:** Nov. 11, 2009

Reviewed by: **Date:**

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ ICV/CCV Results
- ✓ Blank Results
- ✓ ICP Interference Check Results
- ✓ Spike Recovery Results
- ✓ Duplicate Results
- ✓ LCS Results
- ✓ Standard Addition Results
- ✓ ICP Serial Dilution
- ✓ Instrument Det. Limits
- ✓ ICP Correction Factors
- ✓ ICP Linear Ranges
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ ICP Raw Data
- O GFAA Raw Data
- ✓ Hg Raw Data
- O Cyanide Raw Data
- O Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results:_____

2. Holding Times (Check all that apply)..... ☑ ☐

- ✓ ICP/GFAA metals completed in <6 months from collection
- ✓ Mercury analyzed in <28 days from collection
- __ Cyanide completed in 14 days from collection

Comments/Qualified Results: 6010 WATER ✓ ; 6020 WATER ✓
Hg Water ✓
SOIL: 6010 TotRecov. ✓
6020 " " ✓
Hg 7074 " ✓

3. Calibrations (Check all that apply)..... ☑ ☐

- __ ICV/CCV %R for ICP/AA, 90%-110%, acceptable
- __ ICV/CCV %R for ICP/AA, 75%-89% or 111%-125%, results estimated (J/UJ)
- __ ICV/CCV %R for ICP/AA, <75% or >125%, reject positive results (R)
- __ ICV/CCV %R 80-120% for Hg, results accepted
- ✓ CRDL Check Stnd %R 70 – 130, (50-150 SbPbTl) #423/8 & 315/8, 369/9
- __ ICV/CCV %R for Hg, 65%-79% or 121%-135%, results estimated (J/UJ)
- __ ICV/CCV %R 85-115% for Cyanide, results acceptable
- __ ICV/CCV %R 70-84% or 116-130%, results estimated (J/UJ)
- __ ICV/CCV %R <70% or >130%, reject pos results (R)

Comments/Qualified Results: 6010 ICV, CCV 9/16 ✓ – 18, ICV 10/01, 9/16 ✓
6020 ICV 9/16 ✓ CCV ✓ ; Hg ICV 9/16 ✓ CCV ✓, 9/17 ✓.
ICS – 423/10 ✓, 485/9 ✓, 485/10 ✓, 315/10 ✓, 369/11 ✓

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

4. Blanks (Check all that apply)..... ☐ ☒

__Detects reported in ICB/CCB list:
__Detects in preparation blanks, list:
__Detects in field blanks, list

Qualified as undetected (U) all sample concentrations ≤10X any associated blank concentrations and less than the PQL, or J+ for samples greater than the PQL.

Comments/Qualified Results: 6010 (WATER) 9/16 Na detect x10 = 8.2 mg/L
Se 9/17 detect x10 = .0355 mg/L, Be x10 = .00058 (10/61),
6020 – Tl 10/61 x10 = .048 # 2R/10A: Al 10X = .146
⊗ 6010 (SOIL): MB 338/20A : Na x10 = 5.58 mg/Kgm
MB 413/5-A : Mg x10 = 49.3 mg/Kgm
: Tl x10 = 46.1 "

5. Duplicates (Check all that apply)..... ☑ ☐

✓ Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field Duplicate ID_____

Comments/Qualified Results Duplic. on Smpl-01 (Soil) ✓
Duplic on Smpl. -02 (SOIL) : ✓

7. Laboratory Control Samples, Blank Spikes (Check all that apply)... ☐ ☒

✓ LCS %R 80-120%, [50-150% for Ag, Sb]
✓ LCS %R 50-79% or >120%, results >IDL estimated (J)
✓ LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: LCSD/LCS (WATER) 6010 ✓ 338/21A ✓, 338/23A ✓
413/6A ✓ 336/21A ✓
LCS/LCSD (SOIL) 6010 413/8A ⊗ – Al, Fe, Mg, K ↓ . 220/6A ✓
" " (WATER) Hg 342/12A ✓
" " (SOIL) Hg 401/7A ✓

8. Spike Recovery (Check all that apply)..... ☐ ☒

✓ Spike %R with 75-125%
__ Spike %R 30-74%, >125%, results > IDL est. (J)
✓ Spike %R 30-74% results <IDL estimated (UJ)
__ Spike %R <30%, results <IDL rejected (UR)
__ Field blanks used for spike analysis
__ Post digest spk rqrd: %R 75-125%, excpt Ag

Comments/Qualified Results: MS/MSD on Smpl-01 (SOIL): Cu recov. ✓ (X)
MS on Smpl-02 (Water): ✓

9. GFAA Performance, MSA, or Serial Dilutions..... ☐ ☒

__ Duplicate injection RSD <20%
__ Duplicate injection RSD >20%, results > CRDL estimated (J)
__ Analytical spike %R 85-115%
__ Analytical spike %R 40-85%, results > IDL estimated (J)
__ Analytical spike %R 10-40%, results <IDL estimated (UJ)
__ Analytical spike %R <10%, results <IDL rejected (R)

Comments/Qualified Results: (X) (SOIL) Smple-01 : Ni, V, Cr exceed 10%.
(WATER) Smpl-02 ✓

10. Detection Limits, Other QC..... ☑ ☐

Comments/Qualified Results:

11. Data Verification and Overall Assessment..... ☑ ☐

Comments/Qualified Results:

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**				**Sampled: 09/01/09 17:10**				
Aluminum	6010B TMP	ND UJ	*31*	110	mg/Kg	1x	50413	09/17/09 10:34	09/17/09 23:44	*
Antimony	"	ND	*0.60*	11	"	"	"	"	"	
Arsenic	"	**2.2**	*0.46*	11	"	"	"	"	"	J
Calcium	"	**43**	*5.3*	190	"	"	"	"	"	J
Iron	"	**120** J	*1.6*	35	"	"	"	"	"	*
Lead	"	**15**	*0.42*	5.3	"	"	"	"	"	
Magnesium	"	~~21 J~~	*2.3*	190 U	"	"	"	"	"	~~J B, *~~
Manganese	"	**1.6**	*0.028*	3.5	"	"	"	"	"	J
Potassium	"	ND UJ	*56*	580	"	"	"	"	"	*
Selenium	"	ND	*0.42*	18	"	"	"	"	"	
Silver	"	ND	*0.16*	3.5	"	"	"	"	"	
Sodium	"	ND	*24*	350	"	"	"	"	"	
SSI0028-01RE1 (G-MW11FP-090109)		**Other (L)**				**Sampled: 09/01/09 17:10**				
Cadmium	6010B TMP	ND	*0.28*	1.8	mg/Kg	1x	51220	10/01/09 10:41	10/01/09 18:38	
Beryllium	"	ND	*0.0042*	0.88	"	"	"	"	"	
Barium	"	**2.4**	*0.053*	1.8	"	"	"	"	"	
Thallium	"	~~1.5~~	*0.49*	18 U	"	"	"	"	"	~~J B~~
Nickel	"	**31** J	*0.28*	3.5	"	"	"	"	"	
Vanadium	"	**26** J	*0.11*	1.8	"	"	"	"	"	
Copper	"	**38** J	*0.77*	3.5	"	"	"	"	"	
Zinc	"	**6.9**	*0.70*	8.8	"	"	"	"	"	J
Chromium	"	**13** J	*0.17*	4.6	"	"	"	"	"	
Cobalt	"	**0.48**	*0.11*	1.8	"	"	"	"	"	J

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Calcium	6010B Total Recoverable	27	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 00:58	
Iron	"	0.065	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	6.6	*0.23*	1.1	"	"	"	"	"	
Sodium	"	2.8 J+	*0.18*	2.0	"	"	"	"	"	B
Manganese	"	0.25	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	2.3	*0.41*	3.3	"	"	"	"	09/17/09 12:23	J
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Calcium	6010B Total Recoverable	34	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:35	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	9.9	*0.23*	1.1	"	"	"	"	"	
Sodium	"	2.8 J+	*0.18*	2.0	"	"	"	"	"	B
Manganese	"	0.18	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	3.2	*0.41*	3.3	"	"	"	"	09/17/09 12:51	J
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Calcium	6010B Total Recoverable	38	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:41	
Iron	"	8.8	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	11	*0.23*	1.1	"	"	"	"	"	
Sodium	"	2.4 J+	*0.18*	2.0	"	"	"	"	"	B
Manganese	"	0.22	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	1.3	*0.41*	3.3	"	"	"	"	09/17/09 12:55	J
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Calcium	6010B Total Recoverable	21	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:47	
Iron	"	0.053	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	3.3	*0.23*	1.1	"	"	"	"	"	
Sodium	"	~~1.6 J~~	*0.18*	2.0 U	"	"	"	"	"	~~J+B~~
Manganese	"	0.44	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	2.4	*0.41*	3.3	"	"	"	"	09/17/09 13:00	J

11-10-09

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-06 (G-GA3D-090309)		Water			Sampled: 09/03/09 09:50					
Calcium	6010B Total Recoverable	21	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 01:53	
Iron	"	0.050	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	3.3	*0.23*	1.1	"	"	"	"	"	
Sodium	"	~~1.6~~	*0.18*	2.0 U	"	"	"	"	"	~~J B~~
Manganese	"	0.45	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	2.5	*0.41*	3.3	"	"	"	"	09/17/09 13:04	J
SSI0028-07 (G-MW5-090309)		Water			Sampled: 09/03/09 12:00					
Calcium	6010B Total Recoverable	24	*0.028*	1.1	mg/L	1x	50338	09/16/09 13:45	09/17/09 02:00	
Iron	"	10	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	8.0	*0.23*	1.1	"	"	"	"	"	
Sodium	"	2.7 J+	*0.18*	2.0	"	"	"	"	"	~~B~~
Manganese	"	1.4	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	1.6	*0.41*	3.3	"	"	"	"	09/17/09 13:09	J

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 18:57	
Barium	"	**0.077**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00071**	*0.00037*	0.0020	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00070**	*0.00016*	0.0020	"	"	"	"	"	J
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0026**	*0.00015*	0.0050	"	"	"	"	"	J
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.00018**	*0.00017*	0.0020	"	"	"	"	"	J
Zinc	"	**0.0027**	*0.0020*	0.0070	"	"	"	"	"	J
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-02RE1 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Aluminum	6020 Total Recoverable	0.099 U	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 19:50	J-B
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:35	
Barium	"	**0.025**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0028**	*0.00040*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00062**	*0.00037*	0.0020	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.0013**	*0.00016*	0.0020	"	"	"	"	"	J
Thallium	"	0.00013	*0.000060*	0.0040 U	"	"	"	"	"	J-B
Copper	"	**0.0037**	*0.00015*	0.0050	"	"	"	"	"	J
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.0031**	*0.0020*	0.0070	"	"	"	"	"	J
Nickel	"	**0.0027**	*0.00022*	0.0020	"	"	"	"	"	

TS 11-13-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-03RE1 (G-GA4-090209)		Water			Sampled: 09/02/09 14:30					
Aluminum	6020 Total Recoverable	**0.071**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:26	J, B
SSI0028-04 (G-DW01-090209)		Water			Sampled: 09/02/09 18:50					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:39	
Barium	"	**0.019**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0018**	*0.00040*	0.0020	"	"	"	"	"	J
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	**0.0010**	*0.00034*	0.0020	"	"	"	"	"	J
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Thallium	"	~~0.000085~~	*0.000060*	0.0040 U	"	"	"	"	"	~~J, B~~
Copper	"	**0.0020**	*0.00015*	0.0050	"	"	"	"	"	J
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.00030**	*0.00017*	0.0020	"	"	"	"	"	J
Zinc	"	**0.24**	*0.0020*	0.0070	"	"	"	"	"	
Nickel	"	**0.0014**	*0.00022*	0.0020	"	"	"	"	"	J
SSI0028-04RE1 (G-DW01-090209)		Water			Sampled: 09/02/09 18:50					
Aluminum	6020 Total Recoverable	~~0.061~~	*0.0023*	0.40 U	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:30	~~J, B~~
SSI0028-05 (G-GA3-090309)		Water			Sampled: 09/03/09 09:40					
Arsenic	6020 Total Recoverable	0.00091	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:43	J
Barium	"	**0.038**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0015**	*0.00040*	0.0020	"	"	"	"	"	J
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.00038**	*0.00037*	0.0020	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00038**	*0.00016*	0.0020	"	"	"	"	"	J
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0016**	*0.00015*	0.0050	"	"	"	"	"	J
Vanadium	"	**0.00075**	*0.00023*	0.0020	"	"	"	"	"	J
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	

11-13-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		Water			Sampled: 09/03/09 09:40					
Zinc	6020 Total Recoverable	**0.0025**	*0.0020*	0.0070	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:43	J
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-05RE1 (G-GA3-090309)		Water			Sampled: 09/03/09 09:40					
Aluminum	6020 Total Recoverable	~~0.070~~	*0.0023*	0.40 U	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:33	~~J~~
SSI0028-06 (G-GA3D-090309)		Water			Sampled: 09/03/09 09:50					
Arsenic	6020 Total Recoverable	**0.00072**	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:46	J
Barium	"	**0.038**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0012**	*0.00040*	0.0020	"	"	"	"	"	J
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Cobalt	"	**0.00036**	*0.00016*	0.0020	"	"	"	"	"	J
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Copper	"	**0.0017**	*0.00015*	0.0050	"	"	"	"	"	J
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.0023**	*0.0020*	0.0070	"	"	"	"	"	J
Nickel	"	**0.0024**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-06RE1 (G-GA3D-090309)		Water			Sampled: 09/03/09 09:50					
Aluminum	6020 Total Recoverable	~~0.081~~	*0.0023*	0.40 U	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:37	~~J~~
SSI0028-07 (G-MW5-090309)		Water			Sampled: 09/03/09 12:00					
Arsenic	6020 Total Recoverable	**0.010**	*0.00024*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:50	
Barium	"	**0.055**	*0.00027*	0.0060	"	"	"	"	"	
Antimony	"	**0.0015**	*0.00040*	0.0020	"	"	"	"	"	J
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Chromium	"	**0.0043**	*0.00037*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		**Water**			**Sampled: 09/03/09 12:00**					
Cobalt	6020 Total Recoverable	**0.0032**	*0.00016*	0.0020	mg/L	5x	50336	09/16/09 13:15	09/16/09 19:50	
Thallium	"	~~0.000080~~	*0.000060*	0.0040 U	"	"	"	"	"	~~J-B~~
Copper	"	**0.018**	*0.00015*	0.0050	"	"	"	"	"	
Vanadium	"	**0.0057**	*0.00023*	0.0020	"	"	"	"	"	
Lead	"	**0.012**	*0.00017*	0.0020	"	"	"	"	"	
Zinc	"	**0.028**	*0.0020*	0.0070	"	"	"	"	"	
Nickel	"	**0.0057**	*0.00022*	0.0020	"	"	"	"	"	
SSI0028-07RE1 (G-MW5-090309)		**Water**			**Sampled: 09/03/09 12:00**					
Aluminum	6020 Total Recoverable	**3.7**	*0.0023*	0.40	mg/L	5x	51212	09/16/09 13:15	09/30/09 20:41	B

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Mercury	7471A	ND	*0.0055*	0.018	mg/Kg	1x	50401	09/17/09 09:56	09/17/09 12:58	
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:32	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:15	
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:36	
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:41	
SSI0028-06 (G-GA3D-090309)		**Water**			**Sampled: 09/03/09 09:50**					
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:45	
SSI0028-07 (G-MW5-090309)		**Water**			**Sampled: 09/03/09 12:00**					
Mercury	7470A	**0.000073**	*0.000041*	0.00020	mg/L	1x	50342	09/16/09 14:15	09/16/09 16:49	J

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Metals (ICP) (6010B TMP)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0028-01	G-MW11FP-090109	09/01/09 17:10	09/17/09 10:34	09/17/09 23:44
SSI0028-01RE1	G-MW11FP-090109	09/01/09 17:10	10/01/09 10:41	10/01/09 18:38

<180 DAY ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Mercury (CVAA) (7471A)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-01	G-MW11FP-090109	09/01/09 17:10	09/17/09 09:56	16	09/17/09 12:58

<28 DAY ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 16:33

Laboratory Analysis Times Report

Mercury (CVAA) (7470A)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/16/09 14:15	14	09/16/09 16:32
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/16/09 14:15	↓	09/16/09 16:15
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/16/09 14:15	↓	09/16/09 16:36
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/16/09 14:15	13	09/16/09 16:41
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/16/09 14:15	↓	09/16/09 16:45
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/16/09 14:15	↓	09/16/09 16:49

< 28 Days

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Metals (ICP/MS) Total Recoverable (6020 Total Recoverable)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/16/09 13:15	09/16/09 18:57
SSI0028-02RE1	G-GA2-090209	09/02/09 12:15	09/16/09 13:15	09/30/09 19:50
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/16/09 13:15	09/16/09 19:35
SSI0028-03RE1	G-GA4-090209	09/02/09 14:30	09/16/09 13:15	09/30/09 20:26
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/16/09 13:15	09/16/09 19:39
SSI0028-04RE1	G-DW01-090209	09/02/09 18:50	09/16/09 13:15	09/30/09 20:30
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/16/09 13:15	09/16/09 19:43
SSI0028-05RE1	G-GA3-090309	09/03/09 09:40	09/16/09 13:15	09/30/09 20:33
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/16/09 13:15	09/16/09 19:46
SSI0028-06RE1	G-GA3D-090309	09/03/09 09:50	09/16/09 13:15	09/30/09 20:37
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/16/09 13:15	09/16/09 19:50
SSI0028-07RE1	G-MW5-090309	09/03/09 12:00	09/16/09 13:15	09/30/09 20:41

< 180 DAYS ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 16:33

Laboratory Analysis Times Report

Metals (ICP) Total Recoverable (6010B Total Recoverable)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/16/09 13:45	09/17/09 00:58
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/16/09 13:45	09/17/09 12:23
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/16/09 13:45	09/17/09 01:35
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/16/09 13:45	09/17/09 12:51
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/16/09 13:45	09/17/09 01:41
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/16/09 13:45	09/17/09 12:55
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/16/09 13:45	09/17/09 01:47
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/16/09 13:45	09/17/09 13:00
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/16/09 13:45	09/17/09 01:53
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/16/09 13:45	09/17/09 13:04
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/16/09 13:45	09/17/09 02:00
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/16/09 13:45	09/17/09 13:09

< 180 Day ✓

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **#SSI0028**

SAMPLES	Collect:	MATRIX
G-GA2	9-02-09	WATER
G-GA4		
G-DW01		
G-GA3		
G-GA3D		
G-MW5		

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA	BNA	Pest / PCB	TPH-Dx	PAH - SIM	OTHER	OTHER
1. Data Completeness		O	O	O	O		
2. Preservation, Holding Times		O	O	O	O		
3.GC/MS Tune, Inst. Performance		O	—	—	O		
4. Calibrations (1)		O	X	O	O		
5. Surrogates		O	O	O	O		
6. Internal Standards			—	—			
7. Lab Blanks, Field Blanks (2)		O	O	O	X		
8. Lab Duplicates, Field Duplicates		—	—	O	—		
9. LCS, Blank Spike, MS/MSD		O	O	O	O		
10.Compound Identification, TICs		O	O	O	O		
11. Result Verification, D.Limits		O	O	O	O		
12. Overall Summary		O	O	O	O		

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Select Arochlors out of limit for %RSD in CCAL. Assoc. results on 10/14 qualified 'UJ'.

(2) Select contaminants in PAH method blank qualify assoc. results as ND (U) for 1-methylnapthalen, phenanthrene and pyrene.

Validated by: [signature] **Date:** Nov. 10, 2009

Reviewed by: **Date:**

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

	YES	NO
1. Date Package Completeness (Check if present).....	☐	☐

__Case narrative
__Chain of Custody
__Sample Results
__Detection Limits
__GC/MS Tuning
__Initial Calibration
__Continuing Calib.
__

__Blank Results
__Surrogate Results
__Internal Standards
__ MS/MSD, LCS Results
__Preparation Logs
__Analysis Run Logs
__Raw Data
__Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: _____

	YES	NO
2. Holding Times (Check all that apply).....	☑	☐

✓ Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
✓ BNA samples extracted within 7 days (14 day soil) of collection
__BNA extracts analyzed within 40 days of collection
✓ Pest/PCBs samples extracted within 7 days (14 day soil) of collection
__Pest/PCBs extracts analyzed within 40 days of collection
Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: _____

PCB's ✓ < 7 Day
PAH's ✓ < 7 Day
NWTPH-Dx < 14 Day ✓
SVOA ✓ < 14 Day

	YES	NO
3. GC Instrument Tune, Performance Check	☐	☐

__GC/MS Tuning performed
__GC/MS Tuning within control limits
__GC/MS Tuning out of control limits, (qualify R/UR)
__Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
__PEM resolution <90% adj pks, (J for detects, UR other)
__DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
__Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results: _____

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☐ ☒

GC/MS Data: __ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
__ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: __RSD<10% for performance checks (If no J detects)
__Stnds analyzed prior to analysis, & at proper frequency
__Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

PCB #50247 CCAL %RSD ✓ recovery ↑ on A-1016, A-1260. No Qual.
⊗ #52272 CCAL ↓ for A-1221, -1232, -1242, -1248, -1254, assoc. results qualif. (J/UJ).

5. Surrogates (Check all that apply)..... ☑ ☐

✓ Surrogates analyzed
✓ Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__Recoveries above Method Control limits (J detects only)
__Recoveries below Method Control limits but>20% (J/UJ)
__Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results

NWTPH-Dx Batch# 0043 ✓, 0077 ✓
SVOA Batch 50178 ✓
PAH-SIM Batch 49936 ✓
PCBs Batch 50176 ✓, 52320 ✓

6. Internal Standards Performance..... ☐ ☐

__Internal standards added to all QC and samples
__Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
**Associated with 12 Hour CCV Stnd.*
__Internal standards out of Control limits but >10% (J/UJ)
__Internal standards zero or <10% of Control limits (J/UR)
__Internal standards RTs within +/-20 sec window (If no, J/UJ)

Comments/Qualified Results:

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☐ ☒

__Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

Examples:

BLANK			SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

TPH-Dx #0043 9/13 NDs ✓
#0077 9/11 NDs ✓
#0094 9/16 NDs ✓
⊗ 9/11 PAHs - #50190 9/14 ✓, #50120 - 1meth Napth, Phenanth, Pyrene
⊗ in method blank → *10 results = .0163, .0319, .0379.
PCBs - #50176 9/15 ✓, #52320 10/19 ✓

8. Duplicate, Field Duplicates (Check all that apply)..... ☒ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results TPH-Dx #0043 non-assoc. ✓ #0077 MS/MSD ✓

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply).... ☒ ☐

__LCS %R 80-120%
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: TPH-Dx #0043 LCS 76% ✓, MS non-assoc. ✓
#0077 BSI/BSD ✓; #0094 78% ✓
PAHs - #50190 9/14 LCS ✓, #50120 LCS ✓
PCB - #50176 9/15 A-1016 & A-1260 ✓, #52320 10/19 ✓

	Acceptable: Yes	NO
10.Compound Identification, TICs	☑	☐

Comments/Qualified Results: _____

	Acceptable: Yes	NO
11. Result Verification, Detection Limits	☑	☐

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: _____

	Acceptable: Yes	NO
12. Overall Assessment	☑	☐

Comments/Qualified Results: _____

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr (8082 STD)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-01	G-MW11FP-090109	09/01/09 17:10	09/14/09 11:14	13	09/15/09 12:18
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/09/09 17:01	7	10/19/09 18:50
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/09/09 17:01	7	10/19/09 19:06
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/09/09 17:01	6	10/19/09 19:21
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/09/09 17:01	6	10/19/09 19:37

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 16:33

Laboratory Analysis Times Report (PAHs)

Semivolatile Organic Compounds (GC/MS SIM) (8270C STD)
TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/09/09 16:54	7	09/12/09 00:23
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/09/09 16:54	↓	09/12/09 00:42
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/09/09 16:54	↓	09/12/09 01:02
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/09/09 16:54	6	09/12/09 01:21
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/09/09 16:54	↓	09/12/09 01:41
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/09/09 16:54	↓	09/12/09 02:00

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Semivolatile Petroleum Products by NWTPH-Dx (NWTPH-Dx)

TestAmerica Spokane

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-01	G-MW11FP-090109	09/01/09 17:10	09/08/09 18:28	7	09/13/09 17:47
SSI0028-02	G-GA2-090209	09/02/09 12:15	09/11/09 08:00	9	09/13/09 19:47
SSI0028-03	G-GA4-090209	09/02/09 14:30	09/11/09 08:00	9	09/13/09 20:12
SSI0028-04	G-DW01-090209	09/02/09 18:50	09/11/09 08:00	9	09/13/09 20:36
SSI0028-05	G-GA3-090309	09/03/09 09:40	09/11/09 08:00	8	09/13/09 21:00
SSI0028-06	G-GA3D-090309	09/03/09 09:50	09/11/09 08:00	8	09/13/09 21:24
SSI0028-07	G-MW5-090309	09/03/09 12:00	09/15/09 07:58	12	09/16/09 23:44

All < 14 DAY ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Date:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Laboratory Analysis Times Report

Semivolatile Compounds by Gas Chromatography/Mass (8270C PAH)

TestAmerica Tacoma

SSI0028

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0028-01	G-MW11FP-090109	09/01/09 17:10	09/14/09 11:17	13	09/15/09 00:32

✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:21	
PCB-1221	"	ND UJ	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*66%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*64%*		*40 - 135 %*	"			"	
SSI0028-06 (G-GA3D-090309)		**Water**			**Sampled: 09/03/09 09:50**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:37	
PCB-1221	"	ND UJ	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*65%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*52%*		*40 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
PCB-1016	8082 STD	ND	*0.14*	0.43	mg/Kg	1x	50176	09/14/09 11:14	09/15/09 12:18	
PCB-1221	"	ND	*0.34*	0.43	"	"	"	"	"	
PCB-1232	"	ND	*0.30*	0.43	"	"	"	"	"	
PCB-1242	"	ND	*0.089*	0.43	"	"	"	"	"	
PCB-1248	"	ND	*0.055*	0.43	"	"	"	"	"	
PCB-1254	"	ND	*0.089*	0.43	"	"	"	"	"	
PCB-1260	"	**0.37**	*0.13*	0.43	"	"	"	"	"	J, p
Surrogate(s): *Tetrachloro-m-xylene*			*87%*		*45 - 155 %*	"			"	
DCB Decachlorobiphenyl			*110%*		*60 - 125 %*	"			"	
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 18:50	
PCB-1221	"	ND UJ	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*63%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*67%*		*40 - 135 %*	"			"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52320	09/09/09 17:01	10/19/09 19:06	
PCB-1221	"	ND UJ	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*64%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*73%*		*40 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Naphthalene	8270C PAH	ND	*1700*	16000	ug/Kg	10x	50178	09/14/09 11:17	09/15/09 00:32	
2-Methylnaphthalene	"	**16000**	*1800*	16000	"	"	"	"	"	J
1-Methylnaphthalene	"	**52000**	*1400*	24000	"	"	"	"	"	
Acenaphthylene	"	ND	*1300*	16000	"	"	"	"	"	
Acenaphthene	"	**42000**	*1300*	16000	"	"	"	"	"	
Fluorene	"	**68000**	*950*	16000	"	"	"	"	"	
Phenanthrene	"	**140000**	*1700*	16000	"	"	"	"	"	
Anthracene	"	**26000**	*1100*	16000	"	"	"	"	"	
Fluoranthene	"	**69000**	*950*	16000	"	"	"	"	"	
Pyrene	"	**110000**	*1100*	16000	"	"	"	"	"	
Benzo[a]anthracene	"	**40000**	*1300*	20000	"	"	"	"	"	
Chrysene	"	**71000**	*1100*	20000	"	"	"	"	"	
Benzo[b]fluoranthene	"	**20000**	*3300*	16000	"	"	"	"	"	
Benzo[k]fluoranthene	"	**3000**	*1000*	20000	"	"	"	"	"	J
Benzo[a]pyrene	"	**25000**	*1700*	24000	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**4700**	*3300*	32000	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*1700*	32000	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**6700**	*1200*	20000	"	"	"	"	"	J
Surrogate(s):	*Nitrobenzene-d5*		*87%*		*38 - 141 %*	"			"	
	2-Fluorobiphenyl		*74%*		*42 - 140 %*	"			"	
	Terphenyl-d14		*78%*		*42 - 151 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Naphthalene	8270C STD	**0.0062**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:23	J
2-Methylnaphthalene	"	**0.0037**	*0.0028*	0.012	"	"	"	"	"	J
1-Methylnaphthalene	"	~~0.0023~~	*0.0011*	0.0094	U	"	"	"	"	~~J, B~~
Acenaphthylene	"	ND	*0.0010*	0.0094		"	"	"	"	
Acenaphthene	"	**0.0029**	*0.00094*	0.0094		"	"	"	"	J
Fluorene	"	**0.0034**	*0.0011*	0.0094		"	"	"	"	J
Phenanthrene	"	~~0.0078~~	*0.0010*	0.0094	U	"	"	"	"	~~J, B~~
Anthracene	"	**0.0021**	*0.00075*	0.0094		"	"	"	"	J
Fluoranthene	"	**0.0032**	*0.0015*	0.0094		"	"	"	"	J
Pyrene	"	~~0.0027~~	*0.0016*	0.0094	U	"	"	"	"	~~J, B~~
Benzo[a]anthracene	"	ND	*0.0023*	0.0094		"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094		"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094		"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094		"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019		"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094		"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094		"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094		"	"	"	"	
Surrogate(s):	*Nitrobenzene-d5*	*88%*			*40 - 110 %*	"			"	
	2-Fluorobiphenyl	*85%*			*50 - 110 %*	"			"	
	Terphenyl-d14	*103%*			*50 - 135 %*	"			"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Naphthalene	8270C STD	**0.0074**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:42	J
2-Methylnaphthalene	"	**0.0048**	*0.0028*	0.012	"	"	"	"	"	J
1-Methylnaphthalene	"	~~0.0023~~	*0.0011*	0.0094	U	"	"	"	"	~~J, B~~
Acenaphthylene	"	**0.0016**	*0.0010*	0.0094		"	"	"	"	J
Acenaphthene	"	ND	*0.00094*	0.0094		"	"	"	"	
Fluorene	"	**0.0020**	*0.0011*	0.0094		"	"	"	"	J
Phenanthrene	"	~~0.0043~~	*0.0010*	0.0094	U	"	"	"	"	~~J, B~~
Anthracene	"	**0.00083**	*0.00075*	0.0094		"	"	"	"	J
Fluoranthene	"	ND	*0.0015*	0.0094		"	"	"	"	
Pyrene	"	~~0.0020~~	*0.0016*	0.0094	U	"	"	"	"	~~J, B~~
Benzo[a]anthracene	"	ND	*0.0023*	0.0094		"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094		"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094		"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094		"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019		"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094		"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 00:42	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*94%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*86%*		*50 - 110 %*	"			"	
Terphenyl-d14			*99%*		*50 - 135 %*	"			"	
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:02	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0016~~	*0.0011*	0.0094	"	"	"	"	"	~~J,B~~
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0011**	*0.00094*	0.0094	"	"	"	"	"	J
Fluorene	"	**0.0012**	*0.0011*	0.0094	"	"	"	"	"	J
Phenanthrene	"	~~0.0026~~	*0.0010*	0.0094	"	"	"	"	"	~~J,B~~
Anthracene	"	**0.0016**	*0.00075*	0.0094	"	"	"	"	"	J
Fluoranthene	"	ND	*0.0015*	0.0094	"	"	"	"	"	
Pyrene	"	ND	*0.0016*	0.0094	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*95%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*83%*		*50 - 110 %*	"			"	
Terphenyl-d14			*98%*		*50 - 135 %*	"			"	
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Naphthalene	8270C STD	**0.040**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:21	
2-Methylnaphthalene	"	**0.020**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.021**	*0.0011*	0.0094	"	"	"	"	"	B
Acenaphthylene	"	**0.0050**	*0.0010*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**0.025**	*0.00094*	0.0094	"	"	"	"	"	
Fluorene	"	**0.019**	*0.0011*	0.0094	"	"	"	"	"	
Phenanthrene	"	**0.020**	*0.0010*	0.0094	"	"	"	"	"	B
Anthracene	"	ND	*0.00075*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-05 (G-GA3-090309)		Water			Sampled: 09/03/09 09:40					
Fluoranthene	8270C STD	**0.0087**	*0.0015*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:21	J
Pyrene	"	~~0.0097~~ U	*0.0016*	0.0094	U	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s):	*Nitrobenzene-d5*		*79%*		*40 - 110 %*	"			"	
	2-Fluorobiphenyl		*89%*		*50 - 110 %*	"			"	
	Terphenyl-d14		*104%*		*50 - 135 %*	"			"	
SSI0028-06 (G-GA3D-090309)		Water			Sampled: 09/03/09 09:50					
Naphthalene	8270C STD	**0.038**	*0.0034*	0.0094	ug/L	1x	49936	09/09/09 16:54	09/12/09 01:41	
2-Methylnaphthalene	"	**0.019**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.020**	*0.0011*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.0048**	*0.0010*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**0.025**	*0.00094*	0.0094	"	"	"	"	"	
Fluorene	"	**0.017**	*0.0011*	0.0094	"	"	"	"	"	
Phenanthrene	"	**0.019** U	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	ND	*0.00075*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0049**	*0.0015*	0.0094	"	"	"	"	"	J
Pyrene	"	~~0.0041~~	*0.0016*	0.0094	U	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s):	*Nitrobenzene-d5*		*67%*		*40 - 110 %*	"			"	
	2-Fluorobiphenyl		*80%*		*50 - 110 %*	"			"	
	Terphenyl-d14		*105%*		*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		Water			Sampled: 09/03/09 12:00					
Naphthalene	8270C STD	**0.22**	*0.0034*	0.0095	ug/L	1x	49936	09/09/09 16:54	09/12/09 02:00	
2-Methylnaphthalene	"	**0.094**	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**1.1**	*0.0011*	0.0095	"	"	"	"	"	B
Acenaphthylene	"	**0.081**	*0.0010*	0.0095	"	"	"	"	"	
Acenaphthene	"	**0.50**	*0.00095*	0.0095	"	"	"	"	"	
Fluorene	"	**0.47**	*0.0011*	0.0095	"	"	"	"	"	
Phenanthrene	"	**0.14**	*0.0010*	0.0095	"	"	"	"	"	B
Anthracene	"	**0.088**	*0.00076*	0.0095	"	"	"	"	"	
Fluoranthene	"	**0.023**	*0.0015*	0.0095	"	"	"	"	"	
Pyrene	"	**0.064**	*0.0016*	0.0095	"	"	"	"	"	B
Benzo[a]anthracene	"	**0.0081**	*0.0023*	0.0095	"	"	"	"	"	J
Chrysene	"	**0.011**	*0.0020*	0.0095	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0095	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0021**	*0.0019*	0.0095	"	"	"	"	"	J
Surrogate(s): *Nitrobenzene-d5*			*92%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*64%*		*50 - 110 %*	"			"	
Terphenyl-d14			*91%*		*50 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-01 (G-MW11FP-090109)		**Other (L)**			**Sampled: 09/01/09 17:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**202000**	-----	4000	mg/kg wet	1x	9090043	09/08/09 18:28	09/13/09 17:47	
Heavy Oil Range Hydrocarbons	"	**321000**	-----	10000	"	"	"	"	"	
Surrogate(s): 2-FBP		*111%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*108%*			*50 - 150 %*	"			"	
SSI0028-02 (G-GA2-090209)		**Water**			**Sampled: 09/02/09 12:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 19:47	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP		*79.0%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*94.6%*			*50 - 150 %*	"			"	
SSI0028-03 (G-GA4-090209)		**Water**			**Sampled: 09/02/09 14:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 20:12	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP		*79.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*93.7%*			*50 - 150 %*	"			"	
SSI0028-04 (G-DW01-090209)		**Water**			**Sampled: 09/02/09 18:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 20:36	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP		*78.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*93.4%*			*50 - 150 %*	"			"	
SSI0028-05 (G-GA3-090309)		**Water**			**Sampled: 09/03/09 09:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.243	mg/l	1x	9090077	09/11/09 08:00	09/13/09 21:00	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.485	"	"	"	"	"	C
Surrogate(s): 2-FBP		*74.1%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*90.6%*			*50 - 150 %*	"			"	
SSI0028-06 (G-GA3D-090309)		**Water**			**Sampled: 09/03/09 09:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.250	mg/l	1x	9090077	09/11/09 08:00	09/13/09 21:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.500	"	"	"	"	"	C
Surrogate(s): 2-FBP		*79.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*96.8%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0028-07 (G-MW5-090309)		Water			Sampled: 09/03/09 12:00					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.484**	-----	0.312	mg/l	1x	9090094	09/15/09 07:58	09/16/09 23:44	
Heavy Oil Range Hydrocarbons	"	**0.713**	-----	0.625	"	"	"	"	"	
Surrogate(s): 2-FBP		*85.6%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*103%*			*50 - 150 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

Data Deliverable Package

Golder Associates, Inc.
Doug Morell
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project: Avery Landing

Project Number: 073-93312-03

Laboratory Work Order: SSI0028

November 10, 2009

Total Pages
1401

TestAmerica-Spokane
11922 E. 1st Avenue
Spokane, WA 99206

Phone: (509) 924-9200
Fax: (509)924-9290

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/3/2009 to 9/1/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/3/2009
Lab:	SSI0028		
NJDEP#:	PA004		

SAMPLE RECEIPT: Samples were received intact, on ice, with custody seals and chain of custody documentation. Cooler(s) were received and the sample temperature(s) were measured at 8.9° C upon receipt at the laboratory.

HOLDING TIMES: All samples were analyzed within holding times.

PROBLEMS ENCOUNTERED: No problems were encountered.

QA/QC CRITERIA: The surrogate Decachlorobiphenyl in samples 580-50247-3 and -4 batch 580-502 by 8082 STD exceeds the control limits.

The sample, as received, was not preserved in accordance to the referenced analytical method.

Due to high levels of analyte in the sample, the MS/MSD calculation does not provide useful spike recovery information for batch 9090043 by NWTPH-Dx. See Blank Spike (LCS).

The Calibration Verification recovery for Heavy Oil Range Hydrocarbons was above the method control limit in batch 9090077 by Heavy Oil Range Hydrocarbons. Analyte not detected, data not impacted.

OBSERVATIONS: Results that fall between the MDL and RL are 'J' flagged.

SUBCONTRACTED: Mercury by EPA 7470A, Metals by EPA 6010B/6020, PAH SIM by EPA 8270C and PCB's by EPA 8082 were analyzed at the TestAmerica Tacoma Laboratory.

TestAmerica Spokane

Randee Decker
Project Manager

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 16:33

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-MW11FP-090109	SSI0028-01	Other (L)	09/01/09 17:10	09/03/09 13:30
G-GA2-090209	SSI0028-02	Water	09/02/09 12:15	09/03/09 13:30
G-GA4-090209	SSI0028-03	Water	09/02/09 14:30	09/03/09 13:30
G-DW01-090209	SSI0028-04	Water	09/02/09 18:50	09/03/09 13:30
G-GA3-090309	SSI0028-05	Water	09/03/09 09:40	09/03/09 13:30
G-GA3D-090309	SSI0028-06	Water	09/03/09 09:50	09/03/09 13:30
G-MW5-090309	SSI0028-07	Water	09/03/09 12:00	09/03/09 13:30

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

CASE NARRATIVE

Client: TestAmerica Laboratories, Inc
Project: SSI0028
Report Number: 580-15325-1

This case narrative is in the form of an exception report, where only the anomalies related to this report, method specific performance and/or QA/QC issues are discussed. If there are no issues to report, this narrative will include a statement that documents that there are no relevant data issues.

It should be noted that samples with elevated Reporting Limits (RLs) as a result of a dilution may not be able to satisfy customer reporting limits in some cases. Such increases in the RLs are unavoidable but acceptable consequence of sample dilution that enables quantification of target analytes or interferences which exceed the calibration range of the instrument.

Calculations are performed before rounding to avoid round-off errors in calculated results.

All holding times were met and proper preservation noted for the methods performed on these samples, unless otherwise detailed in the individual sections below.

RECEIPT
The samples were received on 09/04/2009; the samples arrived in good condition, properly preserved and on ice. The temperature of the coolers at receipt was 7.2 and 8.2 C.

Note: All samples which require thermal preservation are considered acceptable if the arrival temperature is within 2C of the required temperature or method specified range. For samples with a specified temperature of 4C, samples with a temperature ranging from just above freezing temperature of water to 6C shall be acceptable. Samples that are hand delivered immediately following collection may not meet these criteria, however they will be deemed acceptable according to NELAC standards, if there is evidence that the chilling process has begun, such as arrival on ice, etc.

SEMIVOLATILE ORGANIC COMPOUNDS (GC-MS)
Sample 580-15325-1 was analyzed for semivolatile organic compounds (GC-MS) in accordance with EPA SW-846 Method 8270C. The sample was prepared on 09/14/2009 and analyzed on 09/15/2009.

Sample 580-15325-1 required dilution prior to analysis. The reporting limits have been adjusted accordingly.

No difficulties were encountered during the semivolatiles analysis.

All quality control parameters were within the acceptance limits.

POLYCYCLIC AROMATIC HYDROCARBONS (PAHS)
Samples 580-15325-2 through 580-15325-7 were analyzed for polycyclic aromatic hydrocarbons (PAHs) in accordance with EPA SW-846 Method 8270C SIM. The samples were prepared on 09/09/2009 and analyzed on 09/12/2009.

1-Methylnaphthalene, Phenanthrene and Pyrene were detected in method blank MB 580-49936/1-A at levels that were above the method detection limit but below the reporting limit. The values should be considered estimates, and have been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

No other difficulties were encountered during the PAHs analyses.

All other quality control parameters were within the acceptance limits.

POLYCHLORINATED BIPHENYLS (PCBS)
Samples 580-15325-1, 580-15325-2, 580-15325-3, 580-15325-5 and 580-15325-6 were analyzed for polychlorinated biphenyls (PCBs) in accordance with EPA SW-846 Method 8082. The samples were prepared on 09/09/2009 and 09/14/2009 and analyzed on 09/15/2009 and 10/19/2009.

The surrogate recovery for the method blank and LCS associated with batch 580-50176 were outside of the upper recovery limits in analytical batch 580-50247. The associated sample surrogates fell within acceptance criteria, the method blank was non-detect for the target analytes and the spiked analytes were within control limits in the LCS; therefore, the surrogates outside of the control limits were X flagged and the data have been reported.

The continuing calibration verification (CCV) for analytical batch 50247 exceeded control criteria as follows: CCVRT 50247/ 2, DCB, PCB-1016 and PCB-1260 failed high on the primary column, DCB and TCMX failed high on the confirmation column. The affected sample was 580-15325-1. The CCV failures were biased high and affected sample did not contain any target analytes above the reporting limit; therefore the results were reported from the confirmation column.

The continuing calibration verifications (CCVs) for analytical batch 580-52272 recovered below acceptance criteria for PCB-1221, PCB-1232, PCB-1242, PCB-1248 and PCB-1254. A low-level standard (RL check standard), spiked at the reporting limit (RL), was

prepared with this batch. The affected target analytes recovered within acceptance limits; therefore, the RL check standard demonstrates the analytical system had sufficient sensitivity to detect the compounds had they been present. Since the affected target compounds were not detected in the samples, the data have been reported and qualified.

No other difficulties were encountered during the PCBs analysis.

All other quality control parameters were within the acceptance limits.

TOTAL METALS

Samples 580-15325-1 through 580-15325-7 were analyzed for total metals in accordance with EPA SW-846 Method 6010B. The samples were prepared on 09/16/2009, 09/17/2009 and 10/01/2009 and analyzed on 09/17/2009 and 10/01/2009.

Magnesium was detected in method blank MB 580-50413/5-A at a level that was above the method detection limit but below the reporting limit. The value should be considered an estimate, and has been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Sodium was detected in method blank MB 580-50338/20-A at a level that was above the method detection limit but below the reporting limit. The value should be considered an estimate, and has been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Thallium was detected in method blank MB 580-51220/5-A at a level that was above the method detection limit but below the reporting limit. The value should be considered an estimate, and has been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Aluminum, Iron, Magnesium and Potassium failed the recovery criteria low for LCSSRM 580-50413/8-A. Recoveries of these compounds in the associated LCS/LCSD were within quality control limits. Waste oil digest uses HNO3 and not HCl, therefore not strong enough to fully digest all metals from the soil LCSSRM which is a soil matrix.

Recovery values for Copper in the matrix spike/matrix spike duplicate of sample 580-15325-1 were outside advisory QC limits. Matrix interference is indicated based on acceptable LCS/LCSD recovery.

No other difficulties were encountered during the total metals analyses.

All other quality control parameters were within the acceptance limits.

TOTAL METALS

Samples 580-15325-2 through 580-15325-7 were analyzed for total metals in accordance with EPA SW-846 Method 6020. The samples were prepared on 09/16/2009 and analyzed on 09/16/2009 and 09/30/2009.

Thallium was detected in method blank MB 580-50336/20-A at a level that was above the method detection limit but below the reporting limit. The value should be considered an estimate, and has been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Aluminum was detected in method blank MB 580-51212/10-A at a level that was above the method detection limit but below the reporting limit. The value should be considered an estimate, and has been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

No other difficulties were encountered during the total metals analyses.

All other quality control parameters were within the acceptance limits.

TOTAL MERCURY

Samples 580-15325-2 through 580-15325-7 were analyzed for total mercury in accordance with EPA SW-846 Method 7470A. The samples were prepared and analyzed on 09/16/2009.

No difficulties were encountered during the total mercury analyses.

All quality control parameters were within the acceptance limits.

TOTAL MERCURY

Sample 580-15325-1 was analyzed for total mercury in accordance with EPA SW-846 Method 7471A. The samples were prepared and analyzed on 09/17/2009.

No difficulties were encountered during the total mercury analysis.

All quality control parameters were within the acceptance limits.

SAMPLE SUMMARY

Client: TestAmerica Laboratories, Inc

Job Number: 580-15325-1

Lab Sample ID	Client Sample ID	Client Matrix	Date/Time Sampled	Date/Time Received
580-15325-1	SSI0028-01	Waste	09/01/2009 1710	09/04/2009 1010
580-15325-2	SSI0028-02	Water	09/02/2009 1215	09/04/2009 1010
580-15325-3	SSI0028-03	Water	09/02/2009 1430	09/04/2009 1010
580-15325-4	SSI0028-04	Water	09/02/2009 1850	09/04/2009 1010
580-15325-5	SSI0028-05	Water	09/03/2009 0940	09/04/2009 1010
580-15325-6	SSI0028-06	Water	09/03/2009 0950	09/04/2009 1010
580-15325-7	SSI0028-07	Water	09/03/2009 0950	09/04/2009 1010

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SST0029

CLIENT: Golder Associates

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200
Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498

INVOICE TO: Accounting
Golder Associates
(same Address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [X] STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: HCL | — | — | Nitric | Nitric

REQUESTED ANALYSES

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	NWTPH-Dx extended	PCB (8082A low level)	PAH * (8270 SIM)	TAL metals Total	TAL Metals Dissolved	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-MW11FP-090109	9/1/09 17:10	X	X	X	X	▨	LNAPL	2	See project specific reporting limits	-01
2 G-GA2-090209	9/2/09 1215	X	X	X	X	Hold	W	7		-02
3 G-GA4-090209	9/2/09 1430	X	X	X	X	Hold	W	7		-03
4 G-DW01-090209	9/2/09 1850	X		X	X	Hold	W	5		-04
5 G-GA3-090309	9/3/09 940	X	X	X	X	Hold	W	7		-05
6 G-GA3D-090309	9/3/09 950	X	X	X	X	Hold	W	7		-06
7 G-MW5-090309	9/3/09 1200	X		X	X		W	3	low volume - sorry!	
8										
9										
10										

RELEASED BY: [signature] DATE: 9/3/09
PRINT NAME: Kirsi Longley FIRM: Golder TIME: 1330

RECEIVED BY: [signature] DATE: 9/3/09
PRINT NAME: Chris Williams FIRM: TA Spokane TIME: 1350

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier IV Data Package (EPA CLP deliverable).
*PAH analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of Total metals.

TEMP: 0.4 PAGE 1 OF 1

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0028 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 9/3/09 1330 Cooler signed for by: C. Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☒ same as date received *or* ____/____/____

Cooler opened by (print) C. Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☒ Other: pickup

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 0 1 Signed by See Back Date __/__/__

Were custody seals unbroken and intact on arrival?	☐ Yes	☒ No
3. Were custody papers sealed in a plastic bag?	☐ Yes	☒ No
4. Were custody papers filled out properly (ink, signed, etc.)?	☒ Yes	☐ No
5. Did you sign the custody papers in the appropriate place?	☒ Yes	☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: melted

   Temperature by IR Gun 8.9 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☐ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags?	☐ Yes	☒ No
9. Did all bottles arrive unbroken, and with labels in good condition?	☒ Yes	☐ No
10. Are all bottle labels complete (ID, date, time, etc.)	☒ Yes	☐ No
11. Do bottle labels and Chain of Custody agree?	☒ Yes	☐ No
12. Are the containers and preservatives correct for the tests indicated?	☒ Yes	☐ No
13. Is there adequate volume for the tests requested?	☒ Yes	☐ No
14. Were VOA vials free of bubbles? ☒ N/A	☐ Yes	☐ No

If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 9/3/09

Samples logged in by (print) C. Hanson (sign) [signature]

1. Was project identifiable from custody papers?	☒ Yes	☐ No
2. Do Turn Around Times and Due Dates agree?	☒ Yes	☐ No
3. Was the Project Manager notified of status?	☒ Yes	☐ No
4. Was the Lab notified of status?	☒ Yes	☐ No
5. Was the COC scanned and copied?	☒ Yes	☐ No

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **SSI0032**

SAMPLES	Collect		MATRIX
G-P1010FP	09-04-09		LNAPL
G-RS5FP	9-05-09		
G-RS4FP			
G-RS3FP			
G-RS3aFP			
G-HQR	G-GA1	G-RS4SW	Total . WATER
G-EW3	G-EB	5SW	Fraction
G-EW4	G-RS1SW	6SW	Metals
G-EMW04	G-RS2SW	7SW	ONLY
G-EMW05	G-RS3SW	8SW	*
G-EMW06	G-RS3DSW		

* Data package 16474 has Dissolv fraction for these samples.

DATA ASSESSMENT SUMMARY

REVIEW ITEM	ICP/ AES 6010	ICP/ MS 6020	Hg/ Se 7074	CN	Anions	OTHER
1. Data Completeness	O	O	O			
2. Holding Times	O	O	O			
3. Calibration	O	O	O			
4. Blanks	1 X	O	O			
5. Lab Duplicate, Field Duplicate RPD	O	O	O			
6. LCS, Blank Spike, MFS	O	O	O			
7. Matrix Spike, MSD	O	O	O			
8. GFAA, MSA, Serial Dil.	O	O	-			
9. Detection Limits, Other QC	O	O	O			
10. Data Verification, Overall Summary	O	O	O			

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Mg & Tl detected in M.Blank of LNAPL assoc. samples. Mg results qualified as non-detect 'U'.

Validated by: [signature] **Date:** Nov. 11, 2009

Reviewed by: **Date:**

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ ICV/CCV Results
- ✓ Blank Results
- ✓ ICP Interference Check Results
- ✓ Spike Recovery Results
- ✓ Duplicate Results
- ✓ LCS Results
- ○ Standard Addition Results
- ✓ ICP Serial Dilution
- ✓ Instrument Det. Limits
- ✓ ICP Correction Factors
- ✓ ICP Linear Ranges
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ ICP Raw Data
- ○ GFAA Raw Data
- ✓ Hg Raw Data
- ○ Cyanide Raw Data
- ○ Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Requested Lower MRL on 1-12-10.

Comments/Qualified Results: ICS – 617/10 ✓, 993/9 ✓, 992/10 ✓, 624/11 ✓
6010 Water – for total fraction (AL) Na, Ca, Mn, K, Fe, & Mg.
6020 Water – for total fract. As, Cd, Pb, Sb, Cr, Ni, Ba, Co, Se, Be, Cu, Ag, Tl, V, Zn. (AL) – 6020 data reported. 1-14-2010
TM

2. Holding Times (Check all that apply)..... ☑ ☐

__ICP/GFAA metals completed in <6 months from collection
__Mercury analyzed in <28 days from collection
__Cyanide completed in 14 days from collection

Comments/Qualified Results: See H. Time Summary attached.

3. Calibrations (Check all that apply)..... ☑ ☐

__ICV/CCV %R for ICP/AA, 90%-110%, acceptable
__ICV/CCV %R for ICP/AA, 75%-89% or 111%-125%, results estimated (J/UJ)
__ICV/CCV %R for ICP/AA, <75% or >125%, reject positive results (R)
__ICV/CCV %R 80-120% for Hg, results accepted
✓ CRDL Check Stnd %R 70 – 130, (50-150 SbPbTl)
__ICV/CCV %R for Hg, 65%-79% or 121%-135%, results estimated (J/UJ)
__ICV/CCV %R 85-115% for Cyanide, results acceptable
__ICV/CCV %R 70-84% or 116-130%, results estimated (J/UJ)
__ICV/CCV %R <70% or >130%, reject pos results (R)

Comments/Qualified Results: 6010 (WATER) 9/2 ✓, 9/25 ✓
6020 (WATER) 9/2 ✓
Hg (WATER) 9/14 ✓
CRQL – 617/8 ✓, 992/8 ✓, 624/9 ✓

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

4. Blanks (Check all that apply)..... ☐ ☒

__Detects reported in ICB/CCB list:
✓ Detects in preparation blanks, list: Mg, Tl
__Detects in field blanks, list

Qualified as undetected (U) all sample concentrations ≤10X any associated blank concentrations and less than the PQL, or J+ for samples greater than the PQL.

Comments/Qualified Results: Hg (LNAPL) MB #~~4820X~~ 077-23 9/28 ✓, (WATER) MB #191-23 9/14 ✓

⊗ 6010 (LNAPL) #922-13 9/25 Mg (x10=55.4 mg/kg), Tl (x10=27.9) detects.
(WATER) #617-13 9/21 ✓,
6020 (WATER) #621-27 9/21 ✓

5. Duplicates (Check all that apply)..... ☒ ☐

✓ Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field Duplicate ID_____

Comments/Qualified Results Hg on -22 ✓ (WATER), -05 (LNAPL) ✓ LCS/LCSD ✓ and MS/MSD ✓.
6010 (LNAPL) Na >35% assoc. on Sample -05 Qual. (J/UJ). LCS/LCSD ✓.
(WATER) Smpl -22 ✓, MS/MSD ✓, LCS/LCSD ✓.
6020 (WATER) Smpl -22 ✓, LCS/LCSD ✓, MS/MSD on -22 ✓

6. Laboratory Control Samples, Blank Spikes (Check all that apply)... ☒ ☐

✓ LCS %R 80-120%, [50-150% for Ag, Sb]
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: Hg (WATER) LCS/LCSD (100/108%) ✓; (LNAPL) 96% ✓, MS/MSD on -05 ✓.
6010 (LNAPL) - LCS (90-100%) ✓; (WATER) MS/MSD on -22 (90-105%) ✓, LCS/LCSD 9/21 (80-102%) ✓
6020 (WATER): MS/MSD on -22 (95-115%) ✓, LCS (92-110%) ✓

7. Spike Recovery (Check all that apply)..... ☑ ☐

☑ Spike %R with 75-125%
__Spike %R 30-74%, >125%, results > IDL est. (J)
__Spike %R 30-74% results <IDL estimated (UJ)
__Spike %R <30%, results <IDL rejected (UR)
__Field blanks used for spike analysis
__Post digest spk rqrd: %R 75-125%, excpt Ag

Comments/Qualified Results: See Section 6 for MS/MSD reviews.

8. GFAA Performance, MSA, or Serial Dilutions..... ☑ ☐

__Duplicate injection RSD <20%
__Duplicate injection RSD >20%, results > CRDL estimated (J)
__Analytical spike %R 85-115%
__Analytical spike %R 40-85%, results > IDL estimated (J)
__Analytical spike %R 10-40%, results <IDL estimated (UJ)
__Analytical spike %R <10%, results <IDL rejected (R)

Comments/Qualified Results: Serial Dilutions: 6010 (WATER) #348-17 ✓, #348/20 ✓, 348/17 ✓

9. Detection Limits, Other QC..... ☑ ☐

Comments/Qualified Results:

10. Data Verification and Overall Assessment..... ☑ ☐

Comments/Qualified Results:

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Metals (ICP) Total Recoverable (6010B Total Recoverable)

TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0032-01	G-HC1R-090409	09/04/09 09:00	09/18/09 11:30	09/21/09 12:34
SSI0032-02	G-EW3-090409	09/04/09 11:20	09/18/09 11:30	09/21/09 12:40
SSI0032-03	G-EW4-090409	09/04/09 13:20	09/18/09 11:30	09/21/09 12:44
SSI0032-04	G-EMW04-090409	09/04/09 15:35	09/18/09 11:30	09/21/09 12:49
SSI0032-06	G-GA1-090509	09/05/09 09:40	09/18/09 11:30	09/21/09 12:54
SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/18/09 11:30	09/21/09 12:58
SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/18/09 11:30	09/21/09 13:03
SSI0032-09	G-EB-090509	09/05/09 14:00	09/18/09 11:30	09/21/09 13:08
SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/18/09 11:30	09/21/09 13:12
SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/18/09 11:30	09/21/09 13:18
SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/18/09 11:30	09/21/09 13:32
SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/18/09 11:30	09/21/09 13:37
SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/18/09 11:30	09/21/09 13:43
SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/18/09 11:30	09/21/09 13:49
SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/18/09 11:30	09/21/09 13:54
SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/18/09 11:30	09/21/09 12:03
SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/18/09 11:30	09/21/09 14:00

<180 ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 11:16

Laboratory Analysis Times Report

Metals (ICP/MS) Total Recoverable (6020 Total Recoverable)
TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0032-01	G-HC1R-090409	09/04/09 09:00	09/18/09 11:30	09/21/09 09:32
SSI0032-02	G-EW3-090409	09/04/09 11:20	09/18/09 11:30	09/21/09 09:37
SSI0032-03	G-EW4-090409	09/04/09 13:20	09/18/09 11:30	09/21/09 09:42
SSI0032-04	G-EMW04-090409	09/04/09 15:35	09/18/09 11:30	09/21/09 09:47
SSI0032-06	G-GA1-090509	09/05/09 09:40	09/18/09 11:30	09/21/09 09:53
SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/18/09 11:30	09/21/09 09:58
SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/18/09 11:30	09/21/09 10:03
SSI0032-09	G-EB-090509	09/05/09 14:00	09/18/09 11:30	09/21/09 10:08
SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/18/09 11:30	09/21/09 10:14
SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/18/09 11:30	09/21/09 10:19
SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/18/09 11:30	09/21/09 10:35
SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/18/09 11:30	09/21/09 10:40
SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/18/09 11:30	09/21/09 10:45
SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/18/09 11:30	09/21/09 10:51
SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/18/09 11:30	09/21/09 10:56
SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/18/09 11:30	09/21/09 08:39
SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/18/09 11:30	09/21/09 11:01

<180 ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 11:16

Laboratory Analysis Times Report

Mercury (CVAA) (7470A)
TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0032-01	G-HC1R-090409	09/04/09 09:00	09/14/09 09:02	10	09/14/09 11:21
SSI0032-02	G-EW3-090409	09/04/09 11:20	09/14/09 09:02		09/14/09 11:33
SSI0032-03	G-EW4-090409	09/04/09 13:20	09/14/09 09:02		09/14/09 11:37
SSI0032-04	G-EMW04-090409	09/04/09 15:35	09/14/09 09:02		09/14/09 11:42
SSI0032-06	G-GA1-090509	09/05/09 09:40	09/14/09 09:02	9	09/14/09 11:46
SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/14/09 09:02		09/14/09 11:51
SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/14/09 09:02		09/14/09 11:55
SSI0032-09	G-EB-090509	09/05/09 14:00	09/14/09 09:02		09/14/09 11:59
SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/14/09 09:02	8	09/14/09 12:03
SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/14/09 09:02		09/14/09 12:07
SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/14/09 09:02		09/14/09 12:12
SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/14/09 09:02		09/14/09 12:24
SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/14/09 09:02		09/14/09 12:29
SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/14/09 09:02		09/14/09 12:33
SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/14/09 09:02		09/14/09 12:37
SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/14/09 09:02		09/14/09 11:03
SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/14/09 09:02		09/14/09 12:41

< 28 ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Metals (ICP) (6010B TMP) LNAPL Samples
TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted		Analyzed
SSI0032-05	G-P101OFP-090409	09/04/09 17:30	09/25/09 10:48	21	09/25/09 16:19
SSI0032-10	G-RS5FP-090509	09/05/09 15:00	09/25/09 10:48	20	09/25/09 16:57
SSI0032-11	G-RS4FP-090509	09/05/09 16:08	09/25/09 10:48	↓	09/25/09 17:03
SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/25/09 10:48	↓	09/25/09 17:10
SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/25/09 10:48	↓	09/25/09 17:17

< 180 Days ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 11:16

Laboratory Analysis Times Report

Mercury (CVAA) (7471A)
TestAmerica Tacoma

LNAPL Samples

SSI0032

Lab Number	SampleName	Sampled	Extracted		Analyzed
SSI0032-05	G-P101OFP-090409	09/04/09 17:30	09/25/09 11:09	21	09/28/09 12:40
SSI0032-10	G-RS5FP-090509	09/05/09 15:00	09/25/09 11:09	20	09/28/09 12:57
SSI0032-11	G-RS4FP-090509	09/05/09 16:08	09/25/09 11:09	↓	09/28/09 13:01
SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/25/09 11:09	↓	09/28/09 13:06
SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/25/09 11:09	↓	09/28/09 13:10

< 28 Day ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**			**Sampled: 09/04/09 09:00**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:32	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.0014**	*0.00040*	0.0020	"	"	"	"	"	J
Chromium	"	**0.00052**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00044**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0081**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00082**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Arsenic	6020 Total Recoverable	**0.037**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:37	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00095**	*0.00040*	0.0020	"	"	"	"	"	J
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0014**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.097**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.0011**	*0.00016*	0.0020	"	"	"	"	"	J
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00083**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-03 (G-EW4-090409)		**Water**			**Sampled: 09/04/09 13:20**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:42	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00074**	*0.00040*	0.0020	"	"	"	"	"	J
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0012**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.023**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00045**	*0.00016*	0.0020	"	"	"	"	"	J
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00084**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	**1.2**	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Arsenic	6020 Total Recoverable	**0.015**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:47	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00062**	*0.00040*	0.0020	"	"	"	"	"	J
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0013**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.062**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00060**	*0.00016*	0.0020	"	"	"	"	"	J
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00081**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Arsenic	6020 Total Recoverable	**0.0063**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:53	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00078**	*0.00040*	0.0020	"	"	"	"	"	J
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0020**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.094**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.0012**	*0.00016*	0.0020	"	"	"	"	"	J
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.0013**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Arsenic	6020 Total Recoverable	**0.052**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:58	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00085**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.057**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00042**	*0.00016*	0.0020	"	"	"	"	"	J
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00077**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Arsenic	6020 Total Recoverable	**0.023**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:03	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00073**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.045**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00064**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:08	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00037**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	ND	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00066**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:14	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00046**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00053**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0079**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00075**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	**0.00028**	*0.00023*	0.0020	"	"	"	"	"	J
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-15 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:19	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00052**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0081**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00090**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:35	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00046**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0072**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00074**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:40	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00043**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0077**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00075**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**			**Sampled: 09/06/09 13:30**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:45	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00044**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00038**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0079**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00078**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.00014**	*0.000060*	0.0040	"	"	"	"	"	J
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-20 (G-RS5SW-090609)		**Water**			**Sampled: 09/06/09 14:00**					
Arsenic	6020 Total Recoverable	**0.00052**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:51	J
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00058**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.013**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00080**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Arsenic	6020 Total Recoverable	**0.0011**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:56	J
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00038**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00046**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0080**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00084**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 08:39	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00042**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00047**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0076**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00076**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 11:01	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00051**	*0.00037*	0.0020	"	"	"	"	"	J
Nickel	"	**0.00039**	*0.00022*	0.0020	"	"	"	"	"	J
Barium	"	**0.0072**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00077**	*0.00015*	0.0050	"	"	"	"	"	J
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**			**Sampled: 09/04/09 09:00**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:34	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0085**	*0.0017*	0.020	"	"	"	"	"	J
Potassium	"	**0.74**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.5**	*0.23*	1.1	"	"	"	"	"	
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:40	
Sodium	"	**2.4**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**61**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**3.8**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**2.9**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**38**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**8.7**	*0.23*	1.1	"	"	"	"	"	
SSI0032-03 (G-EW4-090409)		**Water**			**Sampled: 09/04/09 13:20**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:44	
Sodium	"	**2.5**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**29**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.18**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.90**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**23**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**8.0**	*0.23*	1.1	"	"	"	"	"	
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:49	
Sodium	"	**3.3**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**69**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**1.4**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**3.2**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**20**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:54	
Sodium	"	**3.5**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**70**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**2.0**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**3.4**	*0.41*	3.3	"	"	"	"	"	
Iron	"	**7.8**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:58	
Sodium	"	**2.4**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**34**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**2.2**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.5**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**19**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**6.9**	*0.23*	1.1	"	"	"	"	"	
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:03	
Sodium	"	**2.6**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**36**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**1.0**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.4**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**12**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**7.8**	*0.23*	1.1	"	"	"	"	"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:08	
Sodium	"	ND	*0.18*	2.0	"	"	"	"	"	
Calcium	"	ND	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	ND	*0.41*	3.3	"	"	"	"	"	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	ND	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:12	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.66**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.5**	*0.23*	1.1	"	"	"	"	"	
SSI0032-15 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:18	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.67**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**0.051**	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	**2.4**	*0.23*	1.1	"	"	"	"	"	
SSI0032-16 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:32	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.4**	*0.23*	1.1	"	"	"	"	"	
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:37	
Sodium	"	**0.99**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.64**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**			**Sampled: 09/06/09 13:30**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:43	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.011**	*0.0017*	0.020	"	"	"	"	"	J
Potassium	"	**0.66**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**0.041**	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	
SSI0032-20 (G-RS5SW-090609)		**Water**			**Sampled: 09/06/09 14:00**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:49	
Sodium	"	**1.2**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**15**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.16**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.76**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**1.7**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**3.0**	*0.23*	1.1	"	"	"	"	"	
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:54	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.011**	*0.0017*	0.020	"	"	"	"	"	J
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	**0.068**	*0.032*	0.20	"	"	"	"	"	J
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:03	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0076**	*0.0017*	0.020	"	"	"	"	"	J
Potassium	"	**0.69**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 14:00	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	J
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0019**	*0.0017*	0.020	"	"	"	"	"	J
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	J
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)			**Water**			**Sampled: 09/04/09 09:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:21	
SSI0032-02 (G-EW3-090409)			**Water**			**Sampled: 09/04/09 11:20**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:33	
SSI0032-03 (G-EW4-090409)			**Water**			**Sampled: 09/04/09 13:20**				
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:37	J
SSI0032-04 (G-EMW04-090409)			**Water**			**Sampled: 09/04/09 15:35**				
Mercury	7470A	**0.000074**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:42	J
SSI0032-05 (G-P101OFP-090409)			**Other (L)**			**Sampled: 09/04/09 17:30**				
Mercury	7471A	ND	*0.011*	0.036	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 12:40	
SSI0032-06 (G-GA1-090509)			**Water**			**Sampled: 09/05/09 09:40**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:46	
SSI0032-07 (G-EMW05-090509)			**Water**			**Sampled: 09/05/09 11:25**				
Mercury	7470A	**0.000079**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:51	J
SSI0032-08 (G-EMW06-090509)			**Water**			**Sampled: 09/05/09 13:25**				
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:55	J
SSI0032-09 (G-EB-090509)			**Water**			**Sampled: 09/05/09 14:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:59	
SSI0032-10 (G-RS5FP-090509)			**Other (L)**			**Sampled: 09/05/09 15:00**				
Mercury	7471A	**0.034**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 12:57	J
SSI0032-11 (G-RS4FP-090509)			**Other (L)**			**Sampled: 09/05/09 16:08**				
Mercury	7471A	**0.034**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:01	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)			**Other (L)**			**Sampled: 09/05/09 16:35**				
Mercury	7471A	**0.019**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:06	J
SSI0032-13 (G-RS3aFP-090509)			**Other (L)**			**Sampled: 09/05/09 17:00**				
Mercury	7471A	**0.013**	*0.013*	0.040	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:10	J
SSI0032-14 (G-RS1SW-090609)			**Water**			**Sampled: 09/06/09 09:45**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:03	
SSI0032-15 (G-RS2SW-090609)			**Water**			**Sampled: 09/06/09 10:45**				
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:07	J
SSI0032-16 (G-RS3SW-090609)			**Water**			**Sampled: 09/06/09 12:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:12	
SSI0032-17 (G-RS3DSW-090609)			**Water**			**Sampled: 09/06/09 11:40**				
Mercury	7470A	**0.000090**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:24	J
SSI0032-19 (G-RS4SW-090609)			**Water**			**Sampled: 09/06/09 13:30**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:29	
SSI0032-20 (G-RS5SW-090609)			**Water**			**Sampled: 09/06/09 14:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:33	
SSI0032-21 (G-RS6SW-090609)			**Water**			**Sampled: 09/06/09 14:50**				
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:37	J
SSI0032-22 (G-RS7SW-090609)			**Water**			**Sampled: 09/06/09 15:20**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:03	
SSI0032-23 (G-RS8SW-090609)			**Water**			**Sampled: 09/06/09 16:25**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:41	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

LNAPL

ANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					
Aluminum	6010B TMP	**1500**	*36*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:19	
Lead	"	**3.2**	*0.48*	6.1	"	"	"	"	"	**J**
Arsenic	"	**4.8**	*0.52*	12	"	"	"	"	"	**J**
Calcium	"	**570**	*6.1*	220	"	"	"	"	"	
Antimony	"	ND	*0.69*	12	"	"	"	"	"	
Beryllium	"	**0.055**	*0.0048*	1.0	"	"	"	"	"	**J**
Chromium	"	**1.8**	*0.19*	5.2	"	"	"	"	"	**J**
Potassium	"	**290**	*65*	670	"	"	"	"	"	**J**
Selenium	"	ND	*0.48*	20	"	"	"	"	"	
Barium	"	**24**	*0.061*	2.0	"	"	"	"	"	
Iron	"	**2300**	*1.9*	40	"	"	"	"	"	
Silver	"	ND	*0.18*	4.0	"	"	"	"	"	
Magnesium	"	**800**	*2.7*	220	"	"	"	"	"	B
Nickel	"	**9.7**	*0.32*	4.0	"	"	"	"	"	
Sodium	"	**780** J	*27*	400	"	"	"	"	"	
Cadmium	"	ND	*0.32*	2.0	"	"	"	"	"	
Copper	"	**12**	*0.89*	4.0	"	"	"	"	"	
Manganese	"	**31**	*0.032*	4.0	"	"	"	"	"	
Cobalt	"	**1.8**	*0.13*	2.0	"	"	"	"	"	**J**
Thallium	"	ND	*0.56*	20	"	"	"	"	"	
Vanadium	"	**8.5**	*0.12*	2.0	"	"	"	"	"	
Zinc	"	**21**	*0.81*	10	"	"	"	"	"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Aluminum	6010B TMP	**360**	*36*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:57	
Lead	"	**24**	*0.49*	6.1	"	"	"	"	"	
Arsenic	"	**4.6**	*0.53*	12	"	"	"	"	"	**J**
Calcium	"	**470**	*6.1*	220	"	"	"	"	"	
Antimony	"	ND	*0.70*	12	"	"	"	"	"	
Beryllium	"	ND	*0.0049*	1.0	"	"	"	"	"	
Chromium	"	**2.1**	*0.19*	5.3	"	"	"	"	"	**J**
Potassium	"	**180**	*65*	670	"	"	"	"	"	**J**
Selenium	"	**1.6**	*0.49*	20	"	"	"	"	"	**J**
Barium	"	**7.4**	*0.061*	2.0	"	"	"	"	"	
Iron	"	**390**	*1.9*	41	"	"	"	"	"	
Silver	"	ND	*0.18*	4.1	"	"	"	"	"	
Magnesium	"	~~68~~	*2.7*	220 U	"	"	"	"	"	J, B
Nickel	"	**39**	*0.33*	4.1	"	"	"	"	"	
Sodium	"	**850**	*28*	410	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Cadmium	6010B TMP	ND	*0.33*	2.0	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:57	
Copper	"	**69**	*0.90*	4.1	"	"	"	"	"	
Manganese	"	**8.7**	*0.033*	4.1	"	"	"	"	"	
Cobalt	"	**0.65**	*0.13*	2.0	"	"	"	"	"	J
Thallium	"	ND	*0.57*	20	"	"	"	"	"	
Vanadium	"	**110**	*0.12*	2.0	"	"	"	"	"	
Zinc	"	**67**	*0.82*	10	"	"	"	"	"	
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
Aluminum	6010B TMP	**340**	*34*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:03	
Lead	"	**27**	*0.46*	5.8	"	"	"	"	"	
Arsenic	"	**4.4**	*0.50*	12	"	"	"	"	"	J
Calcium	"	**340**	*5.8*	210	"	"	"	"	"	
Antimony	"	ND	*0.66*	12	"	"	"	"	"	
Beryllium	"	ND	*0.0046*	0.97	"	"	"	"	"	
Chromium	"	**2.0**	*0.18*	5.0	"	"	"	"	"	J
Potassium	"	ND	*62*	640	"	"	"	"	"	
Selenium	"	**0.63**	*0.46*	19	"	"	"	"	"	J
Barium	"	**5.9**	*0.058*	1.9	"	"	"	"	"	
Iron	"	**170**	*1.8*	39	"	"	"	"	"	
Silver	"	ND	*0.17*	3.9	"	"	"	"	"	
Magnesium	"	~~48~~	*2.6*	210	U "	"	"	"	"	~~J B~~
Nickel	"	**34**	*0.31*	3.9	"	"	"	"	"	
Sodium	"	**970**	*26*	390	"	"	"	"	"	
Cadmium	"	ND	*0.31*	1.9	"	"	"	"	"	
Copper	"	**71**	*0.85*	3.9	"	"	"	"	"	
Manganese	"	**2.9**	*0.031*	3.9	"	"	"	"	"	J
Cobalt	"	**0.56**	*0.12*	1.9	"	"	"	"	"	J
Thallium	"	ND	*0.54*	19	"	"	"	"	"	
Vanadium	"	**140**	*0.12*	1.9	"	"	"	"	"	
Zinc	"	**15**	*0.77*	9.7	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
Aluminum	6010B TMP	**120**	*40*	130	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:10	J
Lead	"	ND	*0.54*	6.7	"	"	"	"	"	
Arsenic	"	**1.7**	*0.58*	13	"	"	"	"	"	J
Calcium	"	**340**	*6.7*	250	"	"	"	"	"	
Antimony	"	ND	*0.76*	13	"	"	"	"	"	
Beryllium	"	ND	*0.0054*	1.1	"	"	"	"	"	
Chromium	"	**0.47**	*0.21*	5.8	"	"	"	"	"	J
Potassium	"	ND	*72*	740	"	"	"	"	"	
Selenium	"	ND	*0.54*	22	"	"	"	"	"	
Barium	"	**3.4**	*0.067*	2.2	"	"	"	"	"	
Iron	"	**57**	*2.1*	45	"	"	"	"	"	
Silver	"	ND	*0.20*	4.5	"	"	"	"	"	
Magnesium	"	~~53~~	*3.0*	250 U	"	"	"	"	"	J,B
Nickel	"	**20**	*0.36*	4.5	"	"	"	"	"	
Sodium	"	**1100**	*31*	450	"	"	"	"	"	
Cadmium	"	ND	*0.36*	2.2	"	"	"	"	"	
Copper	"	**12**	*0.99*	4.5	"	"	"	"	"	
Manganese	"	**1.4**	*0.036*	4.5	"	"	"	"	"	J
Cobalt	"	**0.28**	*0.14*	2.2	"	"	"	"	"	J
Thallium	"	ND	*0.63*	22	"	"	"	"	"	
Vanadium	"	**16**	*0.13*	2.2	"	"	"	"	"	
Zinc	"	**12**	*0.90*	11	"	"	"	"	"	
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
Aluminum	6010B TMP	**85**	*33*	110	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:17	J
Lead	"	ND	*0.44*	5.6	"	"	"	"	"	
Arsenic	"	**1.2**	*0.48*	11	"	"	"	"	"	J
Calcium	"	**280**	*5.6*	200	"	"	"	"	"	
Antimony	"	ND	*0.63*	11	"	"	"	"	"	
Beryllium	"	ND	*0.0044*	0.93	"	"	"	"	"	
Chromium	"	ND	*0.17*	4.8	"	"	"	"	"	
Potassium	"	ND	*59*	610	"	"	"	"	"	
Selenium	"	ND	*0.44*	19	"	"	"	"	"	
Barium	"	**2.2**	*0.056*	1.9	"	"	"	"	"	
Iron	"	**130**	*1.7*	37	"	"	"	"	"	
Silver	"	ND	*0.17*	3.7	"	"	"	"	"	
Magnesium	"	~~73~~	*2.4*	200 U	"	"	"	"	"	J,B
Nickel	"	**4.6**	*0.30*	3.7	"	"	"	"	"	
Sodium	"	**1100**	*25*	370	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL^A	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
Cadmium	6010B TMP	ND	*0.30*	1.9	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:17	
Copper	"	**4.6**	*0.81*	3.7	"	"	"	"	"	
Manganese	"	**1.2**	*0.030*	3.7	"	"	"	"	"	J
Cobalt	"	ND	*0.12*	1.9	"	"	"	"	"	
Thallium	"	ND	*0.52*	19	"	"	"	"	"	
Vanadium	"	**4.1**	*0.11*	1.9	"	"	"	"	"	
Zinc	"	**5.6**	*0.74*	9.3	"	"	"	"	"	J

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

November 19, 2009

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 09/07/09 09:14. The following list is a summary of the Work Orders contained in this report, generated on 11/19/09 15:16.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSI0032	Avery Landing	073-93312-03

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-HC1R-090409	SSI0032-01	Water	09/04/09 09:00	09/07/09 09:14
G-EW3-090409	SSI0032-02	Water	09/04/09 11:20	09/07/09 09:14
G-EW4-090409	SSI0032-03	Water	09/04/09 13:20	09/07/09 09:14
G-EMW04-090409	SSI0032-04	Water	09/04/09 15:35	09/07/09 09:14
G-P101OFP-090409	SSI0032-05	Other (L)	09/04/09 17:30	09/07/09 09:14
G-GA1-090509	SSI0032-06	Water	09/05/09 09:40	09/07/09 09:14
G-EMW05-090509	SSI0032-07	Water	09/05/09 11:25	09/07/09 09:14
G-EMW06-090509	SSI0032-08	Water	09/05/09 13:25	09/07/09 09:14
G-EB-090509	SSI0032-09	Water	09/05/09 14:00	09/07/09 09:14
G-RS5FP-090509	SSI0032-10	Other (L)	09/05/09 15:00	09/07/09 09:14
G-RS4FP-090509	SSI0032-11	Other (L)	09/05/09 16:08	09/07/09 09:14
G-RS3FP-090509	SSI0032-12	Other (L)	09/05/09 16:35	09/07/09 09:14
G-RS3aFP-090509	SSI0032-13	Other (L)	09/05/09 17:00	09/07/09 09:14
G-RS1SW-090609	SSI0032-14	Water	09/06/09 09:45	09/07/09 09:14
G-RS2SW-090609	SSI0032-15	Water	09/06/09 10:45	09/07/09 09:14
G-RS3SW-090609	SSI0032-16	Water	09/06/09 12:00	09/07/09 09:14
G-RS3DSW-090609	SSI0032-17	Water	09/06/09 11:40	09/07/09 09:14
G-RS4SW-090609	SSI0032-19	Water	09/06/09 13:30	09/07/09 09:14
G-RS5SW-090609	SSI0032-20	Water	09/06/09 14:00	09/07/09 09:14
G-RS6SW-090609	SSI0032-21	Water	09/06/09 14:50	09/07/09 09:14
G-RS7SW-090609	SSI0032-22	Water	09/06/09 15:20	09/07/09 09:14
G-RS8SW-090609	SSI0032-23	Water	09/06/09 16:25	09/07/09 09:14

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Analytical Case Narrative

TestAmerica - Spokane, WA

SSI0032

As per EPA SW846 revision 4 the holding time for 8082 PCB analysis is one year from collection.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**				**Sampled: 09/04/09 09:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	**0.992**	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 01:42	
Heavy Oil Range Hydrocarbons	"	**0.637**	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.0%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*105%*			*50 - 150 %*	"		"	
SSI0032-02 (G-EW3-090409)		**Water**				**Sampled: 09/04/09 11:20**				
Diesel Range Hydrocarbons	NWTPH-Dx	**1.85**	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 02:05	
Heavy Oil Range Hydrocarbons	"	**1.60**	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*73.1%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*92.2%*			*50 - 150 %*	"		"	
SSI0032-03RE1 (G-EW4-090409)		**Water**				**Sampled: 09/04/09 13:20**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.236	mg/l	1x	9090121	09/18/09 14:11	09/18/09 23:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*97.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*118%*			*50 - 150 %*	"		"	
SSI0032-04 (G-EMW04-090409)		**Water**				**Sampled: 09/04/09 15:35**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 02:52	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*73.7%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*104%*			*50 - 150 %*	"		"	
SSI0032-05 (G-P101OFP-090409)		**Other (L)**				**Sampled: 09/04/09 17:30**				
Diesel Range Hydrocarbons	NWTPH-Dx	**201000**	-----	5660	mg/kg	5x	9090118	09/18/09 06:13	09/18/09 11:42	
Heavy Oil Range Hydrocarbons	"	**120000**	-----	14200	"	"	"	"	"	
Surrogate(s): 2-FBP			*158%*			*50 - 150 %*	"		"	*Z3*
p-Terphenyl-d14			*106%*			*50 - 150 %*	"		"	
SSI0032-06 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 03:16	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*69.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*97.7%*			*50 - 150 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06RE1 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					**H**
Diesel Range Hydrocarbons	NWTPH-Dx	**0.352**	-----	0.236	mg/l	1x	9100094	10/15/09 12:59	10/15/09 17:01	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP		*76.4%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*78.1%*			*50 - 150 %*	"			"	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.611**	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 03:39	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP		*75.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*102%*			*50 - 150 %*	"			"	
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.546**	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 04:03	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*71.5%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*98.1%*			*50 - 150 %*	"			"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 05:13	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*87.6%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*110%*			*50 - 150 %*	"			"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	**233000**	-----	12000	mg/kg	10x	9090118	09/18/09 06:13	09/18/09 12:06	
Heavy Oil Range Hydrocarbons	"	**265000**	-----	30000	"	"	"	"	"	
Surrogate(s): 2-FBP		*73.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*89.1%*			*50 - 150 %*	"			"	
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
Diesel Range Hydrocarbons	NWTPH-Dx	**386000**	-----	5880	mg/kg	5x	9090118	09/18/09 06:13	09/18/09 12:06	
Heavy Oil Range Hydrocarbons	"	**306000**	-----	14700	"	"	"	"	"	
Surrogate(s): 2-FBP		*161%*			*50 - 150 %*	"			"	***Z3***
p-Terphenyl-d14		*95.0%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**				**Sampled: 09/05/09 16:35**				
Diesel Range Hydrocarbons	NWTPH-Dx	**154000**	-----	11300	mg/kg	10x	9090118	09/18/09 06:13	09/18/09 12:32	
Heavy Oil Range Hydrocarbons	"	**149000**	-----	28300	"	"	"	"	"	
Surrogate(s): 2-FBP			*132%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*98.6%*			*50 - 150 %*	"		"	
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**				**Sampled: 09/05/09 17:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	**80700**	-----	2400	mg/kg	1x	9090118	09/18/09 06:13	09/18/09 12:32	
Heavy Oil Range Hydrocarbons	"	**67500**	-----	6000	"	"	"	"	"	
Surrogate(s): 2-FBP			*103%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*107%*			*50 - 150 %*	"		"	
SSI0032-14 (G-RS1SW-090609)		**Water**				**Sampled: 09/06/09 09:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.250	mg/l	1x	9090104	09/16/09 08:06	09/17/09 05:37	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.500	"	"	"	"	"	
Surrogate(s): 2-FBP			*72.1%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*92.6%*			*50 - 150 %*	"		"	
SSI0032-15 (G-RS2SW-090609)		**Water**				**Sampled: 09/06/09 10:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.260	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:00	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.521	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.8%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*103%*			*50 - 150 %*	"		"	
SSI0032-16 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.266	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.532	"	"	"	"	"	
Surrogate(s): 2-FBP			*76.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*99.6%*			*50 - 150 %*	"		"	
SSI0032-17 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:47	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*82.2%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*103%*			*50 - 150 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.248	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:11	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.495	"	"	"	"	"	
Surrogate(s): 2-FBP			*73.4%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*96.4%*			*50 - 150 %*	"		"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:34	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP			*78.4%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*103%*			*50 - 150 %*	"		"	
SSI0032-21 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.278	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:58	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.556	"	"	"	"	"	
Surrogate(s): 2-FBP			*83.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*106%*			*50 - 150 %*	"		"	
SSI0032-22 (G-RS7SW-090609)		**Water**				**Sampled: 09/06/09 15:20**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.245	mg/l	1x	9090104	09/16/09 08:06	09/17/09 08:21	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.490	"	"	"	"	"	
Surrogate(s): 2-FBP			*79.2%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*100%*			*50 - 150 %*	"		"	
SSI0032-23 (G-RS8SW-090609)		**Water**				**Sampled: 09/06/09 16:25**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 09:32	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP			*77.7%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*101%*			*50 - 150 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					**C7**
PCB-1016	EPA 8082	ND	-----	0.943	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 18:14	
PCB-1221	"	ND	-----	0.943	"	"	"	"	"	
PCB-1232	"	ND	-----	0.943	"	"	"	"	"	
PCB-1242	"	ND	-----	0.943	"	"	"	"	"	
PCB-1248	"	ND	-----	0.943	"	"	"	"	"	
PCB-1254	"	ND	-----	0.943	"	"	"	"	"	
PCB-1260	"	ND	-----	0.943	"	"	"	"	"	
Surrogate(s): TCX		*83.6%*			*50 - 150 %*	"			"	
Decachlorobiphenyl		*41.0%*			*50 - 150 %*	"			"	*Z*
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					**C7**
PCB-1016	EPA 8082	ND	-----	0.962	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 18:37	
PCB-1221	"	ND	-----	0.962	"	"	"	"	"	
PCB-1232	"	ND	-----	0.962	"	"	"	"	"	
PCB-1242	"	ND	-----	0.962	"	"	"	"	"	
PCB-1248	"	ND	-----	0.962	"	"	"	"	"	
PCB-1254	"	ND	-----	0.962	"	"	"	"	"	
PCB-1260	"	ND	-----	0.962	"	"	"	"	"	
Surrogate(s): TCX		*79.2%*			*50 - 150 %*	"			"	
Decachlorobiphenyl		*38.8%*			*50 - 150 %*	"			"	*Z*
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					**C7**
PCB-1016	EPA 8082	ND	-----	0.980	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:00	
PCB-1221	"	ND	-----	0.980	"	"	"	"	"	
PCB-1232	"	ND	-----	0.980	"	"	"	"	"	
PCB-1242	"	ND	-----	0.980	"	"	"	"	"	
PCB-1248	"	ND	-----	0.980	"	"	"	"	"	
PCB-1254	"	ND	-----	0.980	"	"	"	"	"	
PCB-1260	"	ND	-----	0.980	"	"	"	"	"	
Surrogate(s): TCX		*86.9%*			*50 - 150 %*	"			"	
Decachlorobiphenyl		*34.9%*			*50 - 150 %*	"			"	*Z*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					**C7**
PCB-1016	EPA 8082	ND	-----	0.877	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:22	
PCB-1221	"	ND	-----	0.877	"	"	"	"	"	
PCB-1232	"	ND	-----	0.877	"	"	"	"	"	
PCB-1242	"	ND	-----	0.877	"	"	"	"	"	
PCB-1248	"	ND	-----	0.877	"	"	"	"	"	
PCB-1254	"	ND	-----	0.877	"	"	"	"	"	
PCB-1260	"	ND	-----	0.877	"	"	"	"	09/18/09 19:45	
Surrogate(s): TCX		*80.8%*			*50 - 150 %*	"			*09/18/09 19:22*	
Decachlorobiphenyl		*48.6%*			*50 - 150 %*	"			"	*Z*
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					**C7**
PCB-1016	EPA 8082	ND	-----	2.38	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:45	
PCB-1221	"	ND	-----	2.38	"	"	"	"	"	
PCB-1232	"	ND	-----	2.38	"	"	"	"	"	
PCB-1242	"	ND	-----	2.38	"	"	"	"	"	
PCB-1248	"	ND	-----	2.38	"	"	"	"	"	
PCB-1254	"	ND	-----	2.38	"	"	"	"	"	
PCB-1260	"	ND	-----	2.38	"	"	"	"	09/18/09 20:08	
Surrogate(s): TCX		*76.2%*			*50 - 150 %*	"			*09/18/09 19:45*	
Decachlorobiphenyl		*50.3%*			*50 - 150 %*	"			"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					
1-Methylnapthalene	EPA 8270 mod.	**114**	-----	2.88	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 18:25	
2-Methylnaphthalene	"	**48.3**	-----	2.88	"	"	"	"	"	
Acenaphthene	"	**29.2**	-----	2.88	"	"	"	"	"	
Acenaphthylene	"	ND	-----	2.88	"	"	"	"	"	
Anthracene	"	**33.5**	-----	2.88	"	"	"	"	"	
Benzo (a) anthracene	"	**4.42**	-----	2.88	"	"	"	"	"	
Benzo (a) pyrene	"	**4.62**	-----	2.88	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	2.88	"	"	"	"	"	
Benzo (ghi) perylene	"	**14.0**	-----	2.88	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	2.88	"	"	"	"	"	
Chrysene	"	**9.04**	-----	2.88	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**9.62**	-----	2.88	"	"	"	"	"	
Fluoranthene	"	**8.27**	-----	2.88	"	"	"	"	"	
Fluorene	"	**45.6**	-----	2.88	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**10.2**	-----	2.88	"	"	"	"	"	
Naphthalene	"	**13.3**	-----	2.88	"	"	"	"	"	
Phenanthrene	"	**88.8**	-----	2.88	"	"	"	"	"	
Pyrene	"	**22.7**	-----	2.88	"	"	"	"	"	
Surrogate(s): 2-FBP		*104%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*103%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*120%*			*37.8 - 150 %*	"			"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
1-Methylnapthalene	EPA 8270 mod.	**15.3**	-----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 23:47	
2-Methylnaphthalene	"	ND	-----	3.06	"	"	"	"	"	
Acenaphthene	"	**33.1**	-----	3.06	"	"	"	"	"	
Acenaphthylene	"	ND	-----	3.06	"	"	"	"	"	
Anthracene	"	**96.9**	-----	3.06	"	"	"	"	"	
Benzo (a) anthracene	"	**19.2**	-----	3.06	"	"	"	"	"	I01
Benzo (a) pyrene	"	**8.57**	-----	3.06	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	3.06	"	"	"	"	"	
Benzo (ghi) perylene	"	**9.59**	-----	3.06	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	3.06	"	"	"	"	"	
Chrysene	"	**45.7**	-----	3.06	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**4.29**	-----	3.06	"	"	"	"	"	
Fluoranthene	"	**9.18**	-----	3.06	"	"	"	"	"	
Fluorene	"	**86.3**	-----	3.06	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**4.49**	-----	3.06	"	"	"	"	"	
Naphthalene	"	ND	-----	3.06	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Phenanthrene	EPA 8270 mod.	**205**	-----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 23:47	
Pyrene	"	**118**	-----	3.06	"	"	"	"	"	**I01**
Surrogate(s): 2-FBP		*97.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*93.4%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*142%*			*37.8 - 150 %*	"			"	***I01***
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
1-Methylnapthalene	EPA 8270 mod.	**328**	-----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/14/09 00:08	
2-Methylnaphthalene	"	**35.3**	-----	3.06	"	"	"	"	"	
Acenaphthene	"	**100**	-----	3.06	"	"	"	"	"	
Acenaphthylene	"	ND	-----	3.06	"	"	"	"	"	
Anthracene	"	**120**	-----	3.06	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	3.06	"	"	"	"	"	**I01**
Benzo (a) pyrene	"	**11.0**	-----	3.06	"	"	"	"	"	**I01**
Benzo (b) fluoranthene	"	ND	-----	3.06	"	"	"	"	"	**I01**
Benzo (ghi) perylene	"	**12.2**	-----	3.06	"	"	"	"	"	**I01**
Benzo (k) fluoranthene	"	ND	-----	3.06	"	"	"	"	"	**I01**
Chrysene	"	**50.6**	-----	3.06	"	"	"	"	"	**I01**
Dibenzo (a,h) anthracene	"	**4.90**	-----	3.06	"	"	"	"	"	**I01**
Fluoranthene	"	**15.1**	-----	3.06	"	"	"	"	"	
Fluorene	"	**178**	-----	3.06	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**3.88**	-----	3.06	"	"	"	"	"	**I01**
Naphthalene	"	ND	-----	3.06	"	"	"	"	"	
Phenanthrene	"	**292**	-----	3.06	"	"	"	"	"	
Pyrene	"	**161**	-----	3.06	"	"	"	"	"	**I01**
Surrogate(s): 2-FBP		*88.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*65.8%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*170%*			*37.8 - 150 %*	"			"	***I01. ZX***
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
1-Methylnapthalene	EPA 8270 mod.	**63.1**	-----	3.12	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 20:55	
2-Methylnaphthalene	"	ND	-----	3.12	"	"	"	"	"	
Acenaphthene	"	**30.2**	-----	3.12	"	"	"	"	"	
Acenaphthylene	"	ND	-----	3.12	"	"	"	"	"	
Anthracene	"	**50.4**	-----	3.12	"	"	"	"	"	
Benzo (a) anthracene	"	**10.4**	-----	3.12	"	"	"	"	"	
Benzo (a) pyrene	"	**3.96**	-----	3.12	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	3.12	"	"	"	"	"	
Benzo (ghi) perylene	"	**3.12**	-----	3.12	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
Benzo (k) fluoranthene	EPA 8270 mod.	ND	-----	3.12	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 20:55	
Chrysene	"	**23.1**	-----	3.12	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	3.12	"	"	"	"	"	
Fluoranthene	"	**9.38**	-----	3.12	"	"	"	"	"	
Fluorene	"	**45.6**	-----	3.12	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	3.12	"	"	"	"	"	
Naphthalene	"	**7.29**	-----	3.12	"	"	"	"	"	
Phenanthrene	"	**84.0**	-----	3.12	"	"	"	"	"	
Pyrene	"	**55.8**	-----	3.12	"	"	"	"	"	
Surrogate(s): 2-FBP		*95.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*101%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*133%*			*37.8 - 150 %*	"			"	
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
1-Methylnapthalene	EPA 8270 mod.	**47.6**	-----	2.73	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 19:08	
2-Methylnaphthalene	"	**45.6**	-----	2.73	"	"	"	"	"	
Acenaphthene	"	**16.5**	-----	2.73	"	"	"	"	"	
Acenaphthylene	"	ND	-----	2.73	"	"	"	"	"	
Anthracene	"	**20.2**	-----	2.73	"	"	"	"	"	
Benzo (a) anthracene	"	**3.27**	-----	2.73	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	2.73	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	2.73	"	"	"	"	"	
Benzo (ghi) perylene	"	**3.64**	-----	2.73	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	2.73	"	"	"	"	"	
Chrysene	"	**7.27**	-----	2.73	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**2.73**	-----	2.73	"	"	"	"	"	
Fluoranthene	"	**4.00**	-----	2.73	"	"	"	"	"	
Fluorene	"	**25.3**	-----	2.73	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**2.91**	-----	2.73	"	"	"	"	"	
Naphthalene	"	**6.91**	-----	2.73	"	"	"	"	"	
Phenanthrene	"	**47.8**	-----	2.73	"	"	"	"	"	
Pyrene	"	**15.3**	-----	2.73	"	"	"	"	"	
Surrogate(s): 2-FBP		*104%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*104%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*110%*			*37.8 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Dissolved

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-02 (G-EW3-090409)		**Water**				**Sampled: 09/04/09 11:20**				
Calcium	6010B Dissolved	**29**	*0.028*	1.1	mg/L	1x	53620	11/09/09 10:32	11/09/09 18:14	
Iron	"	**5.1**	*0.032*	0.20	"	"	"	"	"	
Manganese	"	**0.21**	*0.0017*	0.020	"	"	"	"	"	
Magnesium	"	**6.4**	*0.23*	1.1	"	"	"	"	"	
Antimony	"	ND	*0.0025*	0.060	"	"	"	"	"	
Lead	"	ND	*0.0017*	0.030	"	"	"	"	"	
Potassium	"	**1.1**	*0.41*	3.3	"	"	"	"	11/10/09 16:41	**J**
Sodium	"	**2.2**	*0.18*	2.0	"	"	"	"	"	
SSI0032-04 (G-EMW04-090409)		**Water**				**Sampled: 09/04/09 15:35**				
Calcium	6010B Dissolved	**69**	*0.028*	1.1	mg/L	1x	53620	11/09/09 10:32	11/09/09 18:49	
Iron	"	**19**	*0.032*	0.20	"	"	"	"	"	
Manganese	"	**1.3**	*0.0017*	0.020	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	
Antimony	"	ND	*0.0025*	0.060	"	"	"	"	"	
Lead	"	ND	*0.0017*	0.030	"	"	"	"	"	
Potassium	"	**3.2**	*0.41*	3.3	"	"	"	"	11/10/09 17:08	**J**
Sodium	"	**3.2**	*0.18*	2.0	"	"	"	"	"	
SSI0032-06 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
Iron	6010B Dissolved	**8.0**	*0.032*	0.20	mg/L	1x	54228	11/18/09 11:31	11/18/09 20:18	
SSI0032-07 (G-EMW05-090509)		**Water**				**Sampled: 09/05/09 11:25**				
Calcium	6010B Dissolved	**35**	*0.028*	1.1	mg/L	1x	53620	11/09/09 10:32	11/09/09 18:57	
Iron	"	**19**	*0.032*	0.20	"	"	"	"	"	
Manganese	"	**2.3**	*0.0017*	0.020	"	"	"	"	"	
Magnesium	"	**6.8**	*0.23*	1.1	"	"	"	"	"	
Antimony	"	ND	*0.0025*	0.060	"	"	"	"	"	
Lead	"	ND	*0.0017*	0.030	"	"	"	"	"	
Potassium	"	**1.6**	*0.41*	3.3	"	"	"	"	11/10/09 17:13	**J**
Sodium	"	**2.3**	*0.18*	2.0	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Dissolved

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-08 (G-EMW06-090509)		**Water**				**Sampled: 09/05/09 13:25**				
Calcium	6010B Dissolved	**34**	*0.028*	1.1	mg/L	1x	53620	11/09/09 10:32	11/09/09 19:03	
Iron	"	**11**	*0.032*	0.20	"	"	"	"	"	
Manganese	"	**0.98**	*0.0017*	0.020	"	"	"	"	"	
Magnesium	"	**7.5**	*0.23*	1.1	"	"	"	"	"	
Antimony	"	ND	*0.0025*	0.060	"	"	"	"	"	
Lead	"	ND	*0.0017*	0.030	"	"	"	"	"	
Potassium	"	**1.4**	*0.41*	3.3	"	"	"	"	11/10/09 17:17	**J**
Sodium	"	**2.6**	*0.18*	2.0	"	"	"	"	"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
Iron	6010B Dissolved	**0.59**	*0.032*	0.20	mg/L	1x	54228	11/18/09 11:31	11/18/09 20:50	
Manganese	"	**0.13**	*0.0017*	0.020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Dissolved

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Arsenic	6020 Dissolved	ND	*0.00024*	0.0020	mg/L	5x	53620	11/09/09 10:32	11/09/09 16:55	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00090**	*0.00040*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.025**	*0.00027*	0.0060	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Chromium	"	**0.00064**	*0.00037*	0.0020	"	"	"	"	"	**J**
Copper	"	**0.00068**	*0.00015*	0.0050	"	"	"	"	"	**J**
Nickel	"	**0.00090**	*0.00022*	0.0020	"	"	"	"	"	**J**
Selenium	"	**0.00052**	*0.00034*	0.0020	"	"	"	"	"	**J, B**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.00045**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Vanadium	"	**0.0016**	*0.00023*	0.0020	"	"	"	"	"	**J, B**
Zinc	"	**32**	*0.0020*	0.0070	"	"	"	"	"	
Aluminum	"	**0.012**	*0.0023*	0.40	"	"	"	"	"	**J, B**
Cobalt	"	**0.00082**	*0.00016*	0.0020	"	"	"	"	"	**J**
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Arsenic	6020 Dissolved	**0.017**	*0.00024*	0.0020	mg/L	5x	53620	11/09/09 10:32	11/09/09 17:34	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.0022**	*0.00040*	0.0020	"	"	"	"	"	
Barium	"	**0.061**	*0.00027*	0.0060	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Chromium	"	**0.00066**	*0.00037*	0.0020	"	"	"	"	"	**J**
Copper	"	**0.00040**	*0.00015*	0.0050	"	"	"	"	"	**J**
Nickel	"	**0.0013**	*0.00022*	0.0020	"	"	"	"	"	**J**
Selenium	"	**0.00094**	*0.00034*	0.0020	"	"	"	"	"	**J, B**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.0014**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Vanadium	"	**0.0020**	*0.00023*	0.0020	"	"	"	"	"	**J, B**
Zinc	"	**0.027**	*0.0020*	0.0070	"	"	"	"	"	
Aluminum	"	**0.014**	*0.0023*	0.40	"	"	"	"	"	**J, B**
Cobalt	"	**0.0017**	*0.00016*	0.0020	"	"	"	"	"	**J**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Dissolved

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Arsenic	6020 Dissolved	**0.0096**	*0.00024*	0.0020	mg/L	5x	54228	11/18/09 11:31	11/18/09 19:47	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Arsenic	6020 Dissolved	**0.063**	*0.00024*	0.0020	mg/L	5x	53620	11/09/09 10:32	11/09/09 17:38	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.0019**	*0.00040*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.059**	*0.00027*	0.0060	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Chromium	"	**0.00080**	*0.00037*	0.0020	"	"	"	"	"	**J**
Copper	"	**0.00022**	*0.00015*	0.0050	"	"	"	"	"	**J**
Nickel	"	**0.00044**	*0.00022*	0.0020	"	"	"	"	"	**J**
Selenium	"	**0.00046**	*0.00034*	0.0020	"	"	"	"	"	**J, B**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.0011**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Vanadium	"	**0.0031**	*0.00023*	0.0020	"	"	"	"	"	**B**
Zinc	"	**0.0040**	*0.0020*	0.0070	"	"	"	"	"	**J**
Aluminum	"	**0.012**	*0.0023*	0.40	"	"	"	"	"	**J, B**
Cobalt	"	**0.0014**	*0.00016*	0.0020	"	"	"	"	"	**J**
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Arsenic	6020 Dissolved	**0.028**	*0.00024*	0.0020	mg/L	5x	53620	11/09/09 10:32	11/09/09 17:41	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.0018**	*0.00040*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.044**	*0.00027*	0.0060	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Chromium	"	**0.0010**	*0.00037*	0.0020	"	"	"	"	"	**J**
Copper	"	**0.00021**	*0.00015*	0.0050	"	"	"	"	"	**J**
Nickel	"	**0.00042**	*0.00022*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.00092**	*0.000060*	0.0040	"	"	"	"	"	**J, B**
Vanadium	"	**0.0031**	*0.00023*	0.0020	"	"	"	"	"	**B**
Zinc	"	**0.0056**	*0.0020*	0.0070	"	"	"	"	"	**J**
Aluminum	"	**0.020**	*0.0023*	0.40	"	"	"	"	"	**J, B**
Cobalt	"	**0.0013**	*0.00016*	0.0020	"	"	"	"	"	**J**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Mercury (CVAA) Dissolved

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-02 (G-EW3-090409)		**Water**				**Sampled: 09/04/09 11:20**				
Mercury	7470A Dissolved	ND	*0.000041*	0.00020	mg/L	1x	53714	11/10/09 10:01	11/10/09 15:13	**Ha**
SSI0032-04 (G-EMW04-090409)		**Water**				**Sampled: 09/04/09 15:35**				
Mercury	7470A Dissolved	ND	*0.000041*	0.00020	mg/L	1x	53714	11/10/09 10:01	11/10/09 15:31	**Ha**
SSI0032-07 (G-EMW05-090509)		**Water**				**Sampled: 09/05/09 11:25**				
Mercury	7470A Dissolved	ND	*0.000041*	0.00020	mg/L	1x	53714	11/10/09 10:01	11/10/09 15:35	**Ha**
SSI0032-08 (G-EMW06-090509)		**Water**				**Sampled: 09/05/09 13:25**				
Mercury	7470A Dissolved	ND	*0.000041*	0.00020	mg/L	1x	53714	11/10/09 10:01	11/10/09 15:39	**Ha**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)			**Water**				**Sampled: 09/04/09 09:00**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:21	
SSI0032-02 (G-EW3-090409)			**Water**				**Sampled: 09/04/09 11:20**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:33	
SSI0032-03 (G-EW4-090409)			**Water**				**Sampled: 09/04/09 13:20**			
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:37	**J**
SSI0032-04 (G-EMW04-090409)			**Water**				**Sampled: 09/04/09 15:35**			
Mercury	7470A	**0.000074**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:42	**J**
SSI0032-05 (G-P101OFP-090409)			**Other (L)**				**Sampled: 09/04/09 17:30**			
Mercury	7471A	ND	*0.011*	0.036	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 12:40	
SSI0032-06 (G-GA1-090509)			**Water**				**Sampled: 09/05/09 09:40**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:46	
SSI0032-07 (G-EMW05-090509)			**Water**				**Sampled: 09/05/09 11:25**			
Mercury	7470A	**0.000079**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:51	**J**
SSI0032-08 (G-EMW06-090509)			**Water**				**Sampled: 09/05/09 13:25**			
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:55	**J**
SSI0032-09 (G-EB-090509)			**Water**				**Sampled: 09/05/09 14:00**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:59	
SSI0032-10 (G-RS5FP-090509)			**Other (L)**				**Sampled: 09/05/09 15:00**			
Mercury	7471A	**0.034**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 12:57	**J**
SSI0032-11 (G-RS4FP-090509)			**Other (L)**				**Sampled: 09/05/09 16:08**			
Mercury	7471A	**0.034**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:01	**J**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)			**Other (L)**				**Sampled: 09/05/09 16:35**			
Mercury	7471A	**0.019**	*0.012*	0.038	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:06	**J**
SSI0032-13 (G-RS3aFP-090509)			**Other (L)**				**Sampled: 09/05/09 17:00**			
Mercury	7471A	**0.013**	*0.013*	0.040	mg/Kg	1x	50889	09/25/09 11:09	09/28/09 13:10	**J**
SSI0032-14 (G-RS1SW-090609)			**Water**				**Sampled: 09/06/09 09:45**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:03	
SSI0032-15 (G-RS2SW-090609)			**Water**				**Sampled: 09/06/09 10:45**			
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:07	**J**
SSI0032-16 (G-RS3SW-090609)			**Water**				**Sampled: 09/06/09 12:00**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:12	
SSI0032-17 (G-RS3DSW-090609)			**Water**				**Sampled: 09/06/09 11:40**			
Mercury	7470A	**0.000090**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:24	**J**
SSI0032-19 (G-RS4SW-090609)			**Water**				**Sampled: 09/06/09 13:30**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:29	
SSI0032-20 (G-RS5SW-090609)			**Water**				**Sampled: 09/06/09 14:00**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:33	
SSI0032-21 (G-RS6SW-090609)			**Water**				**Sampled: 09/06/09 14:50**			
Mercury	7470A	**0.00012**	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:37	**J**
SSI0032-22 (G-RS7SW-090609)			**Water**				**Sampled: 09/06/09 15:20**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 11:03	
SSI0032-23 (G-RS8SW-090609)			**Water**				**Sampled: 09/06/09 16:25**			
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50154	09/14/09 09:02	09/14/09 12:41	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					
Aluminum	6010B TMP	**1500**	*36*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:19	
Lead	"	**3.2**	*0.48*	6.1	"	"	"	"	"	**J**
Arsenic	"	**4.8**	*0.52*	12	"	"	"	"	"	**J**
Calcium	"	**570**	*6.1*	220	"	"	"	"	"	
Antimony	"	ND	*0.69*	12	"	"	"	"	"	
Beryllium	"	**0.055**	*0.0048*	1.0	"	"	"	"	"	**J**
Chromium	"	**1.8**	*0.19*	5.2	"	"	"	"	"	**J**
Potassium	"	**290**	*65*	670	"	"	"	"	"	**J**
Selenium	"	ND	*0.48*	20	"	"	"	"	"	
Barium	"	**24**	*0.061*	2.0	"	"	"	"	"	
Iron	"	**2300**	*1.9*	40	"	"	"	"	"	
Silver	"	ND	*0.18*	4.0	"	"	"	"	"	
Magnesium	"	**800**	*2.7*	220	"	"	"	"	"	**B**
Nickel	"	**9.7**	*0.32*	4.0	"	"	"	"	"	
Sodium	"	**780**	*27*	400	"	"	"	"	"	
Cadmium	"	ND	*0.32*	2.0	"	"	"	"	"	
Copper	"	**12**	*0.89*	4.0	"	"	"	"	"	
Manganese	"	**31**	*0.032*	4.0	"	"	"	"	"	
Cobalt	"	**1.8**	*0.13*	2.0	"	"	"	"	"	**J**
Thallium	"	ND	*0.56*	20	"	"	"	"	"	
Vanadium	"	**8.5**	*0.12*	2.0	"	"	"	"	"	
Zinc	"	**21**	*0.81*	10	"	"	"	"	"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Aluminum	6010B TMP	**360**	*36*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:57	
Lead	"	**24**	*0.49*	6.1	"	"	"	"	"	
Arsenic	"	**4.6**	*0.53*	12	"	"	"	"	"	**J**
Calcium	"	**470**	*6.1*	220	"	"	"	"	"	
Antimony	"	ND	*0.70*	12	"	"	"	"	"	
Beryllium	"	ND	*0.0049*	1.0	"	"	"	"	"	
Chromium	"	**2.1**	*0.19*	5.3	"	"	"	"	"	**J**
Potassium	"	**180**	*65*	670	"	"	"	"	"	**J**
Selenium	"	**1.6**	*0.49*	20	"	"	"	"	"	**J**
Barium	"	**7.4**	*0.061*	2.0	"	"	"	"	"	
Iron	"	**390**	*1.9*	41	"	"	"	"	"	
Silver	"	ND	*0.18*	4.1	"	"	"	"	"	
Magnesium	"	**68**	*2.7*	220	"	"	"	"	"	**J, B**
Nickel	"	**39**	*0.33*	4.1	"	"	"	"	"	
Sodium	"	**850**	*28*	410	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Cadmium	6010B TMP	ND	*0.33*	2.0	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 16:57	
Copper	"	**69**	*0.90*	4.1	"	"	"	"	"	
Manganese	"	**8.7**	*0.033*	4.1	"	"	"	"	"	
Cobalt	"	**0.65**	*0.13*	2.0	"	"	"	"	"	**J**
Thallium	"	ND	*0.57*	20	"	"	"	"	"	
Vanadium	"	**110**	*0.12*	2.0	"	"	"	"	"	
Zinc	"	**67**	*0.82*	10	"	"	"	"	"	
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
Aluminum	6010B TMP	**340**	*34*	120	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:03	
Lead	"	**27**	*0.46*	5.8	"	"	"	"	"	
Arsenic	"	**4.4**	*0.50*	12	"	"	"	"	"	**J**
Calcium	"	**340**	*5.8*	210	"	"	"	"	"	
Antimony	"	ND	*0.66*	12	"	"	"	"	"	
Beryllium	"	ND	*0.0046*	0.97	"	"	"	"	"	
Chromium	"	**2.0**	*0.18*	5.0	"	"	"	"	"	**J**
Potassium	"	ND	*62*	640	"	"	"	"	"	
Selenium	"	**0.63**	*0.46*	19	"	"	"	"	"	**J**
Barium	"	**5.9**	*0.058*	1.9	"	"	"	"	"	
Iron	"	**170**	*1.8*	39	"	"	"	"	"	
Silver	"	ND	*0.17*	3.9	"	"	"	"	"	
Magnesium	"	**48**	*2.6*	210	"	"	"	"	"	**J, B**
Nickel	"	**34**	*0.31*	3.9	"	"	"	"	"	
Sodium	"	**970**	*26*	390	"	"	"	"	"	
Cadmium	"	ND	*0.31*	1.9	"	"	"	"	"	
Copper	"	**71**	*0.85*	3.9	"	"	"	"	"	
Manganese	"	**2.9**	*0.031*	3.9	"	"	"	"	"	**J**
Cobalt	"	**0.56**	*0.12*	1.9	"	"	"	"	"	**J**
Thallium	"	ND	*0.54*	19	"	"	"	"	"	
Vanadium	"	**140**	*0.12*	1.9	"	"	"	"	"	
Zinc	"	**15**	*0.77*	9.7	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
Aluminum	6010B TMP	**120**	*40*	130	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:10	**J**
Lead	"	ND	*0.54*	6.7	"	"	"	"	"	
Arsenic	"	**1.7**	*0.58*	13	"	"	"	"	"	**J**
Calcium	"	**340**	*6.7*	250	"	"	"	"	"	
Antimony	"	ND	*0.76*	13	"	"	"	"	"	
Beryllium	"	ND	*0.0054*	1.1	"	"	"	"	"	
Chromium	"	**0.47**	*0.21*	5.8	"	"	"	"	"	**J**
Potassium	"	ND	*72*	740	"	"	"	"	"	
Selenium	"	ND	*0.54*	22	"	"	"	"	"	
Barium	"	**3.4**	*0.067*	2.2	"	"	"	"	"	
Iron	"	**57**	*2.1*	45	"	"	"	"	"	
Silver	"	ND	*0.20*	4.5	"	"	"	"	"	
Magnesium	"	**53**	*3.0*	250	"	"	"	"	"	**J, B**
Nickel	"	**20**	*0.36*	4.5	"	"	"	"	"	
Sodium	"	**1100**	*31*	450	"	"	"	"	"	
Cadmium	"	ND	*0.36*	2.2	"	"	"	"	"	
Copper	"	**12**	*0.99*	4.5	"	"	"	"	"	
Manganese	"	**1.4**	*0.036*	4.5	"	"	"	"	"	**J**
Cobalt	"	**0.28**	*0.14*	2.2	"	"	"	"	"	**J**
Thallium	"	ND	*0.63*	22	"	"	"	"	"	
Vanadium	"	**16**	*0.13*	2.2	"	"	"	"	"	
Zinc	"	**12**	*0.90*	11	"	"	"	"	"	
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
Aluminum	6010B TMP	**85**	*33*	110	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:17	**J**
Lead	"	ND	*0.44*	5.6	"	"	"	"	"	
Arsenic	"	**1.2**	*0.48*	11	"	"	"	"	"	**J**
Calcium	"	**280**	*5.6*	200	"	"	"	"	"	
Antimony	"	ND	*0.63*	11	"	"	"	"	"	
Beryllium	"	ND	*0.0044*	0.93	"	"	"	"	"	
Chromium	"	ND	*0.17*	4.8	"	"	"	"	"	
Potassium	"	ND	*59*	610	"	"	"	"	"	
Selenium	"	ND	*0.44*	19	"	"	"	"	"	
Barium	"	**2.2**	*0.056*	1.9	"	"	"	"	"	
Iron	"	**130**	*1.7*	37	"	"	"	"	"	
Silver	"	ND	*0.17*	3.7	"	"	"	"	"	
Magnesium	"	**73**	*2.4*	200	"	"	"	"	"	**J, B**
Nickel	"	**4.6**	*0.30*	3.7	"	"	"	"	"	
Sodium	"	**1100**	*25*	370	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
Cadmium	6010B TMP	ND	*0.30*	1.9	mg/Kg	1x	50886	09/25/09 10:48	09/25/09 17:17	
Copper	"	**4.6**	*0.81*	3.7	"	"	"	"	"	
Manganese	"	**1.2**	*0.030*	3.7	"	"	"	"	"	**J**
Cobalt	"	ND	*0.12*	1.9	"	"	"	"	"	
Thallium	"	ND	*0.52*	19	"	"	"	"	"	
Vanadium	"	**4.1**	*0.11*	1.9	"	"	"	"	"	
Zinc	"	**5.6**	*0.74*	9.3	"	"	"	"	"	**J**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**				**Sampled: 09/04/09 09:00**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:34	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0085**	*0.0017*	0.020	"	"	"	"	"	**J**
Potassium	"	**0.74**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.5**	*0.23*	1.1	"	"	"	"	"	
SSI0032-02 (G-EW3-090409)		**Water**				**Sampled: 09/04/09 11:20**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:40	
Sodium	"	**2.4**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**61**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**3.8**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**2.9**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**38**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**8.7**	*0.23*	1.1	"	"	"	"	"	
SSI0032-03 (G-EW4-090409)		**Water**				**Sampled: 09/04/09 13:20**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:44	
Sodium	"	**2.5**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**29**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.18**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.90**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**23**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**8.0**	*0.23*	1.1	"	"	"	"	"	
SSI0032-04 (G-EMW04-090409)		**Water**				**Sampled: 09/04/09 15:35**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:49	
Sodium	"	**3.3**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**69**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**1.4**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**3.2**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**20**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:54	
Sodium	"	**3.5**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**70**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**2.0**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**3.4**	*0.41*	3.3	"	"	"	"	"	
Iron	"	**7.8**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**11**	*0.23*	1.1	"	"	"	"	"	
SSI0032-07 (G-EMW05-090509)		**Water**				**Sampled: 09/05/09 11:25**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:58	
Sodium	"	**2.4**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**34**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**2.2**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.5**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**19**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**6.9**	*0.23*	1.1	"	"	"	"	"	
SSI0032-08 (G-EMW06-090509)		**Water**				**Sampled: 09/05/09 13:25**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:03	
Sodium	"	**2.6**	*0.18*	2.0	"	"	"	"	"	
Calcium	"	**36**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**1.0**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**1.4**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**12**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**7.8**	*0.23*	1.1	"	"	"	"	"	
SSI0032-09 (G-EB-090509)		**Water**				**Sampled: 09/05/09 14:00**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:08	
Sodium	"	ND	*0.18*	2.0	"	"	"	"	"	
Calcium	"	ND	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	ND	*0.41*	3.3	"	"	"	"	"	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	ND	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**				**Sampled: 09/06/09 09:45**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:12	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.66**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.5**	*0.23*	1.1	"	"	"	"	"	
SSI0032-15 (G-RS2SW-090609)		**Water**				**Sampled: 09/06/09 10:45**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:18	
Sodium	"	**1.1**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**12**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.67**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**0.051**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**2.4**	*0.23*	1.1	"	"	"	"	"	
SSI0032-16 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:32	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.4**	*0.23*	1.1	"	"	"	"	"	
SSI0032-17 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:37	
Sodium	"	**0.99**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.64**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:43	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.011**	*0.0017*	0.020	"	"	"	"	"	**J**
Potassium	"	**0.66**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**0.041**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:49	
Sodium	"	**1.2**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**15**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.16**	*0.0017*	0.020	"	"	"	"	"	
Potassium	"	**0.76**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**1.7**	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**3.0**	*0.23*	1.1	"	"	"	"	"	
SSI0032-21 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 13:54	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.011**	*0.0017*	0.020	"	"	"	"	"	**J**
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	**0.068**	*0.032*	0.20	"	"	"	"	"	**J**
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	
SSI0032-22 (G-RS7SW-090609)		**Water**				**Sampled: 09/06/09 15:20**				
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 12:03	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0076**	*0.0017*	0.020	"	"	"	"	"	**J**
Potassium	"	**0.69**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50495	09/18/09 11:30	09/21/09 14:00	
Sodium	"	**1.0**	*0.18*	2.0	"	"	"	"	"	**J**
Calcium	"	**11**	*0.028*	1.1	"	"	"	"	"	
Manganese	"	**0.0019**	*0.0017*	0.020	"	"	"	"	"	**J**
Potassium	"	**0.68**	*0.41*	3.3	"	"	"	"	"	**J**
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	**2.3**	*0.23*	1.1	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**				**Sampled: 09/04/09 09:00**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:32	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.0014**	*0.00040*	0.0020	"	"	"	"	"	**J**
Chromium	"	**0.00052**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00044**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0081**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00082**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-02 (G-EW3-090409)		**Water**				**Sampled: 09/04/09 11:20**				
Arsenic	6020 Total Recoverable	**0.037**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:37	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00095**	*0.00040*	0.0020	"	"	"	"	"	**J**
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0014**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.097**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.0011**	*0.00016*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00083**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-03 (G-EW4-090409)		**Water**				**Sampled: 09/04/09 13:20**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:42	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00074**	*0.00040*	0.0020	"	"	"	"	"	**J**
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0012**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.023**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00045**	*0.00016*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00084**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	**1.2**	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-04 (G-EMW04-090409)		**Water**				**Sampled: 09/04/09 15:35**				
Arsenic	6020 Total Recoverable	**0.015**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:47	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00062**	*0.00040*	0.0020	"	"	"	"	"	**J**
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0013**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.062**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00060**	*0.00016*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00081**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Arsenic	6020 Total Recoverable	**0.0063**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:53	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	**0.00078**	*0.00040*	0.0020	"	"	"	"	"	**J**
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.0020**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.094**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.0012**	*0.00016*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.0013**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Arsenic	6020 Total Recoverable	**0.052**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 09:58	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00085**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.057**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	**0.00042**	*0.00016*	0.0020	"	"	"	"	"	**J**
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00077**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Arsenic	6020 Total Recoverable	**0.023**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:03	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00073**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.045**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00064**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:08	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00037**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	ND	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00066**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**				**Sampled: 09/06/09 09:45**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:14	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00046**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00053**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0079**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00075**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	**0.00028**	*0.00023*	0.0020	"	"	"	"	"	**J**
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-15 (G-RS2SW-090609)		**Water**				**Sampled: 09/06/09 10:45**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:19	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00052**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0081**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00090**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:35	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00046**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0072**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00074**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-17 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:40	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00043**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0077**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00075**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:45	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00044**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00038**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0079**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00078**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	**0.00014**	*0.000060*	0.0040	"	"	"	"	"	**J**
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
Arsenic	6020 Total Recoverable	**0.00052**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:51	**J**
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	ND	*0.00037*	0.0020	"	"	"	"	"	
Nickel	"	**0.00058**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.013**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00080**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
Arsenic	6020 Total Recoverable	**0.0011**	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 10:56	**J**
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00038**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00046**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0080**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00084**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	
SSI0032-22 (G-RS7SW-090609)		**Water**				**Sampled: 09/06/09 15:20**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 08:39	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00042**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00047**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0076**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00076**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**				**Sampled: 09/06/09 16:25**				
Arsenic	6020 Total Recoverable	ND	*0.00024*	0.0020	mg/L	5x	50495	09/18/09 11:30	09/21/09 11:01	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	
Antimony	"	ND	*0.00040*	0.0020	"	"	"	"	"	
Chromium	"	**0.00051**	*0.00037*	0.0020	"	"	"	"	"	**J**
Nickel	"	**0.00039**	*0.00022*	0.0020	"	"	"	"	"	**J**
Barium	"	**0.0072**	*0.00027*	0.0060	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Copper	"	**0.00077**	*0.00015*	0.0050	"	"	"	"	"	**J**
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Vanadium	"	ND	*0.00023*	0.0020	"	"	"	"	"	
Zinc	"	ND	*0.0020*	0.0070	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 16:53	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-06RE1 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
PCB-1016	8082 STD	ND	*0.042*	0.47	ug/L	1x	51857	10/12/09 15:10	10/13/09 17:16	
PCB-1232	"	ND	*0.039*	0.47	"	"	"	"	"	
PCB-1221	"	ND	*0.058*	0.47	"	"	"	"	"	
PCB-1242	"	ND	*0.039*	0.47	"	"	"	"	"	
PCB-1248	"	ND	*0.067*	0.47	"	"	"	"	"	
PCB-1254	"	ND	*0.042*	0.47	"	"	"	"	"	
PCB-1260	"	ND	*0.037*	0.47	"	"	"	"	"	
SSI0032-06RE2 (G-GA1-090509)		**Water**				**Sampled: 09/05/09 09:40**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:15	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*59%*			*60 - 150 %*	"		"	***X***
DCB Decachlorobiphenyl			*33%*			*40 - 135 %*	"		"	***X***
SSI0032-09 (G-EB-090509)		**Water**				**Sampled: 09/05/09 14:00**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:09	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-09RE1 (G-EB-090509)		**Water**				**Sampled: 09/05/09 14:00**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:30	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.048	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*69%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*66%*			*40 - 135 %*	"		"	
SSI0032-14 (G-RS1SW-090609)		**Water**				**Sampled: 09/06/09 09:45**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:24	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.048	"	"	"	"	"	
SSI0032-14RE1 (G-RS1SW-090609)		**Water**				**Sampled: 09/06/09 09:45**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:46	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*63%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*62%*			*40 - 135 %*	"		"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-15 (G-RS2SW-090609)		**Water**				**Sampled: 09/06/09 10:45**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:40	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
SSI0032-15RE1 (G-RS2SW-090609)		**Water**				**Sampled: 09/06/09 10:45**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:01	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*72%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*67%*			*40 - 135 %*	"		"	
SSI0032-16 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:55	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-16RE1 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
PCB-1016	8082 STD	ND	*0.0044*	0.049	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:17	
PCB-1232	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.049	"	"	"	"	"	
PCB-1242	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1248	"	ND	*0.0069*	0.049	"	"	"	"	"	
PCB-1254	"	ND	*0.0043*	0.049	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.049	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*67%*			*60 - 150 %*	"		"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16RE1 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
DCB Decachlorobiphenyl		*61%*			*40 - 135 %*	*1x*			*10/23/09 16:17*	
SSI0032-17 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:11	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-17RE1 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:32	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*		*71%*			*60 - 150 %*	*"*			*"*	
DCB Decachlorobiphenyl		*69%*			*40 - 135 %*	*"*			*"*	
SSI0032-19 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:26	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19RE1 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:48	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*65%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*61%*			*40 - 135 %*	"		"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
PCB-1016	8082 STD	ND	*0.0049*	0.054	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:42	
PCB-1232	"	ND	*0.0044*	0.054	"	"	"	"	"	
PCB-1221	"	ND	*0.0067*	0.054	"	"	"	"	"	
PCB-1242	"	ND	*0.0044*	0.054	"	"	"	"	"	
PCB-1248	"	ND	*0.0077*	0.054	"	"	"	"	"	
PCB-1254	"	ND	*0.0048*	0.054	"	"	"	"	"	
PCB-1260	"	ND	*0.0042*	0.054	"	"	"	"	"	
SSI0032-20RE1 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:03	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*61%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*60%*			*40 - 135 %*	"		"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:57	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
SSI0032-21RE1 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
PCB-1016	8082 STD	ND	*0.045*	0.50	ug/L	1x	51857	10/12/09 15:10	10/13/09 19:35	
PCB-1232	"	ND	*0.041*	0.50	"	"	"	"	"	
PCB-1221	"	ND	*0.062*	0.50	"	"	"	"	"	
PCB-1242	"	ND	*0.041*	0.50	"	"	"	"	"	
PCB-1248	"	ND	*0.071*	0.50	"	"	"	"	"	
PCB-1254	"	ND	*0.044*	0.50	"	"	"	"	"	
PCB-1260	"	ND	*0.039*	0.50	"	"	"	"	"	
SSI0032-21RE2 (G-RS6SW-090609)		**Water**				**Sampled: 09/06/09 14:50**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:34	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*56%*		*60 - 150 %*	"			"	***X***
DCB Decachlorobiphenyl			*53%*		*40 - 135 %*	"			"	
SSI0032-22 (G-RS7SW-090609)		**Water**				**Sampled: 09/06/09 15:20**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 19:28	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-22RE1 (G-RS7SW-090609)		**Water**				**Sampled: 09/06/09 15:20**				
PCB-1016	8082 STD	ND	*0.0044*	0.049	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:50	
PCB-1232	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.049	"	"	"	"	"	
PCB-1242	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1248	"	ND	*0.0069*	0.049	"	"	"	"	"	
PCB-1254	"	ND	*0.0043*	0.049	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.049	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*61%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*61%*			*40 - 135 %*	"		"	
SSI0032-23 (G-RS8SW-090609)		**Water**				**Sampled: 09/06/09 16:25**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 19:44	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
SSI0032-23RE1 (G-RS8SW-090609)		**Water**				**Sampled: 09/06/09 16:25**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 18:36	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*68%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*66%*			*40 - 135 %*	"		"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**			**Sampled: 09/04/09 09:00**					
Naphthalene	8270C STD	**0.078**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 14:32	**B**
2-Methylnaphthalene	"	**0.012**	*0.0028*	0.012	"	"	"	"	"	**B**
1-Methylnaphthalene	"	**0.069**	*0.0011*	0.0094	"	"	"	"	"	**B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.027**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.036**	*0.00075*	0.0094	"	"	"	"	"	**B**
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.21**	*0.00094*	0.0094	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0070**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.12**	*0.0011*	0.0094	"	"	"	"	"	**B**
Pyrene	"	**0.014**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0099**	*0.0010*	0.0094	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*113%*		*40 - 110 %*	"			"		***X. I***
2-Fluorobiphenyl		*55%*		*50 - 110 %*	"			"		
Terphenyl-d14		*90%*		*50 - 135 %*	"			"		
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Naphthalene	8270C STD	**0.017**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:36	**B**
2-Methylnaphthalene	"	**0.0074**	*0.0028*	0.012	"	"	"	"	"	**J, B**
1-Methylnaphthalene	"	**0.045**	*0.0011*	0.0094	"	"	"	"	"	**B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.0055**	*0.0010*	0.0094	"	"	"	"	"	**J**
Anthracene	"	**0.0096**	*0.00075*	0.0094	"	"	"	"	"	**B**
Chrysene	"	**0.0023**	*0.0020*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**0.040**	*0.00094*	0.0094	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.014**	*0.0015*	0.0094	"	"	"	"	"	**B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.054**	*0.0011*	0.0094	"	"	"	"	"	**B**
Pyrene	"	**0.033**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.036**	*0.0010*	0.0094	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:36	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*98%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*72%*		*50 - 110 %*	"			"	
Terphenyl-d14			*94%*		*50 - 135 %*	"			"	
SSI0032-03 (G-EW4-090409)		**Water**			**Sampled: 09/04/09 13:20**					
Naphthalene	8270C STD	**0.0055**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:56	**J, B**
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0026**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.0018**	*0.00075*	0.0094	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0041**	*0.00094*	0.0094	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0020**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0023**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Pyrene	"	**0.0020**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0037**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*101%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*77%*		*50 - 110 %*	"			"	
Terphenyl-d14			*97%*		*50 - 135 %*	"			"	
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Naphthalene	8270C STD	**0.042**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:16	**B**
2-Methylnaphthalene	"	**0.066**	*0.0028*	0.012	"	"	"	"	"	**B**
1-Methylnaphthalene	"	**0.034**	*0.0011*	0.0094	"	"	"	"	"	**B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.0073**	*0.0010*	0.0094	"	"	"	"	"	**J**
Anthracene	"	**0.017**	*0.00075*	0.0094	"	"	"	"	"	**B**
Chrysene	"	**0.0052**	*0.0020*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**0.049**	*0.00094*	0.0094	"	"	"	"	"	**B**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:16	
Fluoranthene	"	**0.0075**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.078**	*0.0011*	0.0094	"	"	"	"	"	**B**
Pyrene	"	**0.015**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.014**	*0.0010*	0.0094	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*131%*			*40 - 110 %*	"		"	***X, I***
2-Fluorobiphenyl			*59%*			*50 - 110 %*	"		"	
Terphenyl-d14			*103%*			*50 - 135 %*	"		"	
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Naphthalene	8270C STD	**0.039**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:36	**B**
2-Methylnaphthalene	"	**0.0077**	*0.0028*	0.012	"	"	"	"	"	**J, B**
1-Methylnaphthalene	"	**0.077**	*0.0011*	0.0094	"	"	"	"	"	**B**
Benzo[a]anthracene	"	**0.0024**	*0.0023*	0.0094	"	"	"	"	"	**J**
Acenaphthylene	"	**0.042**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.033**	*0.00075*	0.0094	"	"	"	"	"	**B**
Chrysene	"	**0.0065**	*0.0020*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**0.20**	*0.00094*	0.0094	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.018**	*0.0015*	0.0094	"	"	"	"	"	**B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.47**	*0.0011*	0.0094	"	"	"	"	"	**B**
Pyrene	"	**0.019**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.040**	*0.0010*	0.0094	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*115%*			*40 - 110 %*	"		"	***X, I***
2-Fluorobiphenyl			*77%*			*50 - 110 %*	"		"	
Terphenyl-d14			*100%*			*50 - 135 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Naphthalene	8270C STD	**2.4**	*0.0035*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:56	**B**
2-Methylnaphthalene	"	**1.6**	*0.0029*	0.012	"	"	"	"	"	**B**
1-Methylnaphthalene	"	**9.7**	*0.012*	0.096	"	10x	"	"	09/17/09 19:12	
Benzo[a]anthracene	"	ND	*0.0023*	0.0096	"	1x	"	"	09/15/09 16:56	
Acenaphthylene	"	**0.13**	*0.0011*	0.0096	"	"	"	"	"	
Anthracene	"	**0.19**	*0.00077*	0.0096	"	"	"	"	"	**B**
Chrysene	"	**0.0024**	*0.0020*	0.0096	"	"	"	"	"	**J**
Acenaphthene	"	**1.0**	*0.00096*	0.0096	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0096	"	"	"	"	"	
Fluoranthene	"	**0.048**	*0.0015*	0.0096	"	"	"	"	"	**B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Fluorene	"	**1.3**	*0.0012*	0.0096	"	"	"	"	"	**B**
Pyrene	"	**0.055**	*0.0016*	0.0096	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**1.3**	*0.0011*	0.0096	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0096	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Surrogate(s):	*Nitrobenzene-d5*		*91%*		*40 - 110 %*	"			"	
	2-Fluorobiphenyl		*34%*		*50 - 110 %*	"			"	***X. I***
	Terphenyl-d14		*94%*		*50 - 135 %*	"			"	
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Naphthalene	8270C STD	**5.8**	*0.034*	0.094	ug/L	10x	50020	09/10/09 15:12	09/17/09 19:32	
2-Methylnaphthalene	"	**6.7**	*0.0028*	0.012	"	1x	"	"	09/15/09 17:17	**B**
1-Methylnaphthalene	"	**14**	*0.011*	0.094	"	10x	"	"	09/17/09 19:32	
Benzo[a]anthracene	"	**0.0040**	*0.0023*	0.0094	"	1x	"	"	09/15/09 17:17	**J**
Acenaphthylene	"	**0.25**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.26**	*0.00075*	0.0094	"	"	"	"	"	**B**
Chrysene	"	**0.0068**	*0.0020*	0.0094	"	"	"	"	"	**J**
Acenaphthene	"	**1.6**	*0.00094*	0.0094	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.060**	*0.0015*	0.0094	"	"	"	"	"	**B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**2.3**	*0.0011*	0.0094	"	"	"	"	"	**B**
Pyrene	"	**0.074**	*0.0016*	0.0094	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**2.0**	*0.0010*	0.0094	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 17:17	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*109%*		*40 - 110 %*	"				"	
2-Fluorobiphenyl		*51%*		*50 - 110 %*	"				"	
Terphenyl-d14		*103%*		*50 - 135 %*	"				"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Naphthalene	8270C STD	**0.021**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:32	
2-Methylnaphthalene	"	**0.013**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0098**	*0.0011*	0.0094	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.0012**	*0.00075*	0.0094	"	"	"	"	"	J
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.038**	*0.00094*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0019**	*0.0015*	0.0094	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0034**	*0.0011*	0.0094	"	"	"	"	"	J
Pyrene	"	ND	*0.0016*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0047**	*0.0010*	0.0094	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*103%*		*40 - 110 %*	"				"	
2-Fluorobiphenyl		*86%*		*50 - 110 %*	"				"	
Terphenyl-d14		*105%*		*50 - 135 %*	"				"	
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Naphthalene	8270C STD	ND	*0.0035*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:52	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0024**	*0.0012*	0.0096	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.0096	"	"	"	"	"	
Anthracene	"	**0.0011**	*0.00077*	0.0096	"	"	"	"	"	J
Chrysene	"	ND	*0.0020*	0.0096	"	"	"	"	"	
Acenaphthene	"	**0.0012**	*0.00096*	0.0096	"	"	"	"	"	J

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:52	
Fluoranthene	"	**0.0020**	*0.0015*	0.0096	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Fluorene	"	**0.0026**	*0.0012*	0.0096	"	"	"	"	"	**J**
Pyrene	"	ND	*0.0016*	0.0096	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0040**	*0.0011*	0.0096	"	"	"	"	"	**J**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0096	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*103%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*87%*		*50 - 110 %*	"			"	
Terphenyl-d14			*102%*		*50 - 135 %*	"			"	
SSI0032-15 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
Naphthalene	8270C STD	ND	*0.0036*	0.0099	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:17	
2-Methylnaphthalene	"	ND	*0.0030*	0.013	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0016**	*0.0012*	0.0099	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.0099	"	"	"	"	"	
Anthracene	"	**0.0013**	*0.00079*	0.0099	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0021*	0.0099	"	"	"	"	"	
Acenaphthene	"	**0.0011**	*0.00099*	0.0099	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0026*	0.0099	"	"	"	"	"	
Fluoranthene	"	**0.0031**	*0.0016*	0.0099	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Fluorene	"	**0.0023**	*0.0012*	0.0099	"	"	"	"	"	**J, B**
Pyrene	"	**0.0036**	*0.0017*	0.0099	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	**0.0054**	*0.0011*	0.0099	"	"	"	"	"	**J, B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0018*	0.0099	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*92%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*80%*		*50 - 110 %*	"			"	
Terphenyl-d14			*92%*		*50 - 135 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:38	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0055**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.0015**	*0.00075*	0.0094	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0029**	*0.00094*	0.0094	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0026**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0046**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Pyrene	"	**0.0017**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0069**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*104%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*90%*			*50 - 110 %*	"			"	
Terphenyl-d14		*108%*			*50 - 135 %*	"			"	
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:58	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0061**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.0016**	*0.00075*	0.0094	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.0029**	*0.00094*	0.0094	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0028**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0040**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Pyrene	"	**0.0027**	*0.0016*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0063**	*0.0010*	0.0094	"	"	"	"	"	**J, B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*106%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*91%*			*50 - 110 %*	"			"	
Terphenyl-d14		*107%*			*50 - 135 %*	"			"	
SSI0032-19 (G-RS4SW-090609)		**Water**			**Sampled: 09/06/09 13:30**					
Naphthalene	8270C STD	**0.0076**	*0.0036*	0.0099	ug/L	1x	50020	09/10/09 15:12	09/15/09 19:18	**J, B**
2-Methylnaphthalene	"	**0.011**	*0.0030*	0.013	"	"	"	"	"	**J, B**
1-Methylnaphthalene	"	**0.11**	*0.0012*	0.0099	"	"	"	"	"	**B**
Benzo[a]anthracene	"	**0.0077**	*0.0024*	0.0099	"	"	"	"	"	**J**
Acenaphthylene	"	**0.0094**	*0.0011*	0.0099	"	"	"	"	"	**J**
Anthracene	"	**0.021**	*0.00079*	0.0099	"	"	"	"	"	**B**
Chrysene	"	**0.015**	*0.0021*	0.0099	"	"	"	"	"	
Acenaphthene	"	**0.044**	*0.00099*	0.0099	"	"	"	"	"	**B**
Benzo[b]fluoranthene	"	ND	*0.0026*	0.0099	"	"	"	"	"	
Fluoranthene	"	**0.017**	*0.0016*	0.0099	"	"	"	"	"	**B**
Benzo[k]fluoranthene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Fluorene	"	**0.13**	*0.0012*	0.0099	"	"	"	"	"	**B**
Pyrene	"	**0.039**	*0.0017*	0.0099	"	"	"	"	"	**B**
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	**0.21**	*0.0011*	0.0099	"	"	"	"	"	**B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0018*	0.0099	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*99%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*84%*			*50 - 110 %*	"			"	
Terphenyl-d14		*104%*			*50 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-20 (G-RS5SW-090609)		**Water**			**Sampled: 09/06/09 14:00**					
Naphthalene	8270C STD	**0.054**	*0.0039*	0.011	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:32	
2-Methylnaphthalene	"	**0.013**	*0.0032*	0.014	"	"	"	"	"	J
1-Methylnaphthalene	"	**0.21**	*0.0013*	0.011	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0026*	0.011	"	"	"	"	"	
Acenaphthylene	"	**0.0071**	*0.0012*	0.011	"	"	"	"	"	J
Anthracene	"	**0.0049**	*0.00086*	0.011	"	"	"	"	"	J
Chrysene	"	ND	*0.0023*	0.011	"	"	"	"	"	
Acenaphthene	"	**0.059**	*0.0011*	0.011	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0028*	0.011	"	"	"	"	"	
Fluoranthene	"	**0.0038**	*0.0017*	0.011	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0026*	0.011	"	"	"	"	"	
Fluorene	"	**0.097**	*0.0013*	0.011	"	"	"	"	"	
Pyrene	"	**0.0049**	*0.0018*	0.011	"	"	"	"	"	J
Benzo[a]pyrene	"	ND	*0.0021*	0.022	"	"	"	"	"	
Phenanthrene	"	**0.035**	*0.0012*	0.011	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0022*	0.011	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0019*	0.011	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0022*	0.011	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*95%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*73%*		*50 - 110 %*	"			"	
Terphenyl-d14			*101%*		*50 - 135 %*	"			"	
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Naphthalene	8270C STD	ND	*0.0036*	0.010	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:52	
2-Methylnaphthalene	"	ND	*0.0030*	0.013	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0056**	*0.0012*	0.010	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0024*	0.010	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.010	"	"	"	"	"	
Anthracene	"	**0.0015**	*0.00080*	0.010	"	"	"	"	"	J
Chrysene	"	ND	*0.0021*	0.010	"	"	"	"	"	
Acenaphthene	"	**0.0025**	*0.0010*	0.010	"	"	"	"	"	J
Benzo[b]fluoranthene	"	ND	*0.0026*	0.010	"	"	"	"	"	
Fluoranthene	"	**0.0025**	*0.0016*	0.010	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0024*	0.010	"	"	"	"	"	
Fluorene	"	**0.0045**	*0.0012*	0.010	"	"	"	"	"	J
Pyrene	"	**0.0022**	*0.0017*	0.010	"	"	"	"	"	J
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	**0.0085**	*0.0011*	0.010	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.010	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0018*	0.010	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:52	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.010	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*104%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*90%*		*50 - 110 %*	"			"	
Terphenyl-d14			*104%*		*50 - 135 %*	"			"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
Naphthalene	8270C STD	ND	*0.0034*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/15/09 13:32	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0049**	*0.0011*	0.0095	"	"	"	"	"	**J, B**
Benzo[a]anthracene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Acenaphthylene	"	**0.0015**	*0.0010*	0.0095	"	"	"	"	"	**J**
Anthracene	"	**0.0015**	*0.00076*	0.0095	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0020*	0.0095	"	"	"	"	"	
Acenaphthene	"	**0.0031**	*0.00095*	0.0095	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0095	"	"	"	"	"	
Fluoranthene	"	**0.0033**	*0.0015*	0.0095	"	"	"	"	"	**J, B**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Fluorene	"	**0.0047**	*0.0011*	0.0095	"	"	"	"	"	**J, B**
Pyrene	"	**0.0054**	*0.0016*	0.0095	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0034**	*0.0010*	0.0095	"	"	"	"	"	**J, B**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*104%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*89%*		*50 - 110 %*	"			"	
Terphenyl-d14			*95%*		*50 - 135 %*	"			"	
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Naphthalene	8270C STD	ND	*0.0034*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:12	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0041**	*0.0011*	0.0095	"	"	"	"	"	**J**
Benzo[a]anthracene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0095	"	"	"	"	"	
Anthracene	"	**0.0011**	*0.00076*	0.0095	"	"	"	"	"	**J**
Chrysene	"	ND	*0.0020*	0.0095	"	"	"	"	"	
Acenaphthene	"	**0.0017**	*0.00095*	0.0095	"	"	"	"	"	**J**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:12	
Fluoranthene	"	**0.0022**	*0.0015*	0.0095	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Fluorene	"	**0.0026**	*0.0011*	0.0095	"	"	"	"	"	**J**
Pyrene	"	**0.0023**	*0.0016*	0.0095	"	"	"	"	"	**J**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0033**	*0.0010*	0.0095	"	"	"	"	"	**J**
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*105%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*95%*			*50 - 110 %*	"			"	
Terphenyl-d14		*111%*			*50 - 135 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090104 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090104-BLK1)								**Extracted: 09/16/09 08:06**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	09/17/09 00:31	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 75.9%*			*Limits: 50-150%*	"							*09/17/09 00:31*	
p-Terphenyl-d14		*106%*			*50-150%*	"							"	
LCS (9090104-BS1)								**Extracted: 09/16/09 08:06**						
Diesel Range Hydrocarbons	NWTPH-Dx	1.69	---	0.250	mg/l	1x	--	2.50	67.6%	(54.5-136)	--	--	09/17/09 00:55	
Surrogate(s): 2-FBP		*Recovery: 75.8%*			*Limits: 50-150%*	"							*09/17/09 00:55*	
p-Terphenyl-d14		*94.8%*			*50-150%*	"							"	
LCS Dup (9090104-BSD1)								**Extracted: 09/16/09 08:06**						
Diesel Range Hydrocarbons	NWTPH-Dx	1.82	---	0.250	mg/l	1x	--	2.50	72.9%	(54.5-136)	7.66%	(32.5)	09/17/09 01:18	
Surrogate(s): 2-FBP		*Recovery: 81.3%*			*Limits: 50-150%*	"							*09/17/09 01:18*	
p-Terphenyl-d14		*103%*			*50-150%*	"							"	
Matrix Spike (9090104-MS1)							**QC Source: SSI0032-20**		**Extracted: 09/16/09 08:06**					
Diesel Range Hydrocarbons	NWTPH-Dx	1.49	---	0.236	mg/l	1x	ND	2.36	63.1%	(54.5-136)	--	--	09/17/09 14:16	
Surrogate(s): 2-FBP		*Recovery: 69.8%*			*Limits: 50-150%*	"							*09/17/09 14:16*	
p-Terphenyl-d14		*90.2%*			*50-150%*	"							"	
Matrix Spike (9090104-MS2)							**QC Source: SSI0032-22**		**Extracted: 09/16/09 08:06**					
Diesel Range Hydrocarbons	NWTPH-Dx	1.56	---	0.245	mg/l	1x	ND	2.45	63.8%	(54.5-136)	--	--	09/17/09 15:03	
Surrogate(s): 2-FBP		*Recovery: 63.2%*			*Limits: 50-150%*	"							*09/17/09 15:03*	
p-Terphenyl-d14		*79.2%*			*50-150%*	"							"	
Matrix Spike Dup (9090104-MSD1)							**QC Source: SSI0032-20**		**Extracted: 09/16/09 08:06**					
Diesel Range Hydrocarbons	NWTPH-Dx	1.45	---	0.236	mg/l	1x	ND	2.36	61.6%	(54.5-136)	2.48%	(35)	09/17/09 14:39	
Surrogate(s): 2-FBP		*Recovery: 69.5%*			*Limits: 50-150%*	"							*09/17/09 14:39*	
p-Terphenyl-d14		*91.0%*			*50-150%*	"							"	
Matrix Spike Dup (9090104-MSD2)							**QC Source: SSI0032-22**		**Extracted: 09/16/09 08:06**					
Diesel Range Hydrocarbons	NWTPH-Dx	1.67	---	0.240	mg/l	1x	ND	2.40	69.3%	(54.5-136)	6.40%	(35)	09/17/09 15:03	
Surrogate(s): 2-FBP		*Recovery: 77.6%*			*Limits: 50-150%*	"							*09/17/09 15:03*	
p-Terphenyl-d14		*97.3%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090118 **Other (L) Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090118-BLK1)								**Extracted: 09/18/09 06:13**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg	1x	--	--	--	--	--	--	09/18/09 09:33	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 111%*			*Limits: 50-150%*	"							*09/18/09 09:33*	
p-Terphenyl-d14		*133%*			*50-150%*	"							"	
LCS (9090118-BS1)								**Extracted: 09/18/09 06:13**						
Diesel Range Hydrocarbons	NWTPH-Dx	69.2	---	10.0	mg/kg	1x	--	83.3	83.1%	(50-150)	--	--	09/18/09 09:57	
Surrogate(s): 2-FBP		*Recovery: 97.5%*			*Limits: 50-150%*	"							*09/18/09 09:57*	
p-Terphenyl-d14		*122%*			*50-150%*	"							"	
Duplicate (9090118-DUP1)							**QC Source: SSI0074-01**	**Extracted: 09/18/09 06:13**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	9.85	mg/kg	1x	ND	--	--	--	NR	(25)	09/18/09 11:42	
Heavy Oil Range Hydrocarbons	"	ND	---	24.6	"	"	ND	--	--	--	NR	"	"	
Surrogate(s): 2-FBP		*Recovery: 94.5%*			*Limits: 50-150%*	"							*09/18/09 11:42*	
p-Terphenyl-d14		*122%*			*50-150%*	"							"	
Matrix Spike (9090118-MS1)							**QC Source: SSI0074-01**	**Extracted: 09/18/09 06:13**						
Diesel Range Hydrocarbons	NWTPH-Dx	69.5	---	10.9	mg/kg	1x	ND	90.6	76.7%	(70-130)	--	--	09/18/09 10:20	
Surrogate(s): 2-FBP		*Recovery: 86.0%*			*Limits: 50-150%*	"							*09/18/09 10:20*	
p-Terphenyl-d14		*106%*			*50-150%*	"							"	
Matrix Spike Dup (9090118-MSD1)							**QC Source: SSI0074-01**	**Extracted: 09/18/09 06:13**						
Diesel Range Hydrocarbons	NWTPH-Dx	69.5	---	10.9	mg/kg	1x	ND	90.6	76.7%	(70-130)	0.00%	(25)	09/18/09 10:20	
Surrogate(s): 2-FBP		*Recovery: 86.0%*			*Limits: 50-150%*	"							*09/18/09 10:20*	
p-Terphenyl-d14		*106%*			*50-150%*	"							"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090121 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090121-BLK1)								**Extracted: 09/18/09 14:11**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	09/18/09 21:03	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 109%*			*Limits: 50-150%*	"							*09/18/09 21:03*	
p-Terphenyl-d14		*135%*			*50-150%*	"							"	
LCS (9090121-BS1)								**Extracted: 09/18/09 14:11**						
Diesel Range Hydrocarbons	NWTPH-Dx	2.19	---	0.250	mg/l	1x	--	2.50	87.4%	(54.5-136)	--	--	09/18/09 21:50	
Surrogate(s): 2-FBP		*Recovery: 103%*			*Limits: 50-150%*	"							*09/18/09 21:50*	
p-Terphenyl-d14		*128%*			*50-150%*	"							"	
LCS Dup (9090121-BSD1)								**Extracted: 09/18/09 14:11**						
Diesel Range Hydrocarbons	NWTPH-Dx	2.23	---	0.250	mg/l	1x	--	2.50	89.1%	(54.5-136)	1.86%	(32.5)	09/18/09 22:37	
Surrogate(s): 2-FBP		*Recovery: 102%*			*Limits: 50-150%*	"							*09/18/09 22:37*	
p-Terphenyl-d14		*130%*			*50-150%*	"							"	

QC Batch: 9100094 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9100094-BLK1)								**Extracted: 10/15/09 12:59**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	10/15/09 17:24	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 83.9%*			*Limits: 50-150%*	"							*10/15/09 17:24*	
p-Terphenyl-d14		*84.2%*			*50-150%*	"							"	
LCS (9100094-BS1)								**Extracted: 10/15/09 12:59**						
Diesel Range Hydrocarbons	NWTPH-Dx	1.97	---	0.250	mg/l	1x	--	2.50	78.6%	(54.5-136)	--	--	10/15/09 17:47	
Surrogate(s): 2-FBP		*Recovery: 86.9%*			*Limits: 50-150%*	"							*10/15/09 17:47*	
p-Terphenyl-d14		*89.8%*			*50-150%*	"							"	
LCS Dup (9100094-BSD1)								**Extracted: 10/15/09 12:59**						
Diesel Range Hydrocarbons	NWTPH-Dx	1.88	---	0.250	mg/l	1x	--	2.50	75.2%	(54.5-136)	4.47%	(32.5)	10/15/09 18:10	
Surrogate(s): 2-FBP		*Recovery: 83.1%*			*Limits: 50-150%*	"							*10/15/09 18:10*	
p-Terphenyl-d14		*87.3%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090119 **Other (L) Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090119-BLK1)							**Extracted: 09/18/09 08:06**							C7
PCB-1016	EPA 8082	ND	---	1.00	mg/kg	1x	--	--	--	--	--	--	09/18/09 17:29	
PCB-1221	"	ND	---	1.00	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	---	1.00	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	1.00	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	1.00	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	1.00	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	1.00	"	"	--	--	--	--	--	--	09/18/09 17:52	
Surrogate(s): TCX		*Recovery: 78.5%*			*Limits: 50-150%*	"							*09/18/09 17:29*	
Decachlorobiphenyl		*72.6%*			*50-150%*	"							"	
LCS (9090119-BS1)							**Extracted: 09/18/09 08:06**							C7
PCB-1016	EPA 8082	18.8	---	1.00	mg/kg	1x	--	20.0	94.0%	(70-130)	--	--	09/18/09 17:52	
PCB-1260	"	19.7	---	1.00	"	"	--	"	98.6%	"	--	--	"	
Surrogate(s): TCX		*Recovery: 107%*			*Limits: 50-150%*	"							*09/18/09 17:52*	
Decachlorobiphenyl		*95.1%*			*50-150%*	"							"	
Matrix Spike (9090119-MS1)					**QC Source: SSI0032-05**		**Extracted: 09/18/09 08:06**							C7
PCB-1016	EPA 8082	26.8	---	1.00	mg/kg	1x	ND	20.0	134%	(70-130)	--	--	09/18/09 20:08	M1
PCB-1260	"	11.4	---	1.00	"	"	0.116	"	56.5%	"	--	--	"	M2
Surrogate(s): TCX		*Recovery: 84.4%*			*Limits: 50-150%*	"							*09/18/09 20:08*	
Decachlorobiphenyl		*48.9%*			*50-150%*	"							"	*Z*
Matrix Spike Dup (9090119-MSD1)					**QC Source: SSI0032-05**		**Extracted: 09/18/09 08:06**							C7
PCB-1016	EPA 8082	29.4	---	1.00	mg/kg	1x	ND	20.0	147%	(70-130)	9.06%	(25)	09/18/09 20:30	M1
PCB-1260	"	11.1	---	1.00	"	"	0.116	"	55.0%	"	2.76%	"	"	M2
Surrogate(s): TCX		*Recovery: 101%*			*Limits: 50-150%*	"							*09/18/09 20:30*	
Decachlorobiphenyl		*51.5%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090081 **Other (L) Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090081-BLK1)									**Extracted: 09/11/09 11:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	---	3.00	mg/kg	1x	--	--	--	--	--	--	09/14/09 16:28	
2-Methylnaphthalene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Benzo (ghi) perylene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	---	3.00	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 102%*			*Limits: 34.5-148%*	"							*09/14/09 16:28*	
Nitrobenzene-d5		*98.6%*			*33-141%*	"							*"*	
p-Terphenyl-d14		*96.8%*			*37.8-150%*	"							*"*	
LCS (9090081-BS1)									**Extracted: 09/11/09 11:35**					
Chrysene	EPA 8270 mod.	91.0	---	3.00	mg/kg	1x	--	100	91.0%	(41.1-125)	--	--	09/14/09 19:01	
Fluorene	"	90.8	---	3.00	"	"	--	"	90.8%	(44.5-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	84.2	---	3.00	"	"	--	"	84.2%	(30.1-150)	--	--	"	
Naphthalene	"	94.0	---	3.00	"	"	--	"	94.0%	(29.3-120)	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 97.2%*			*Limits: 34.5-148%*	"							*09/14/09 19:01*	
Nitrobenzene-d5		*93.8%*			*33-141%*	"							*"*	
p-Terphenyl-d14		*97.6%*			*37.8-150%*	"							*"*	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090081 **Other (L) Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090081-MS1)					**QC Source: SSI0032-11**				**Extracted: 09/11/09 11:35**					
Chrysene	EPA 8270 mod.	140	---	3.00	mg/kg	1x	50.6	100	89.8%	(45.2-120)	--	--	09/14/09 00:29	
Fluorene	"	581	---	3.00	"	"	178	"	403%	(25.3-128)	--	--	"	M1
Indeno (1,2,3-cd) pyrene	"	114	---	3.00	"	"	3.88	"	110%	(32.2-145)	--	--	"	
Naphthalene	"	66.8	---	3.00	"	"	ND	"	66.8%	(28.9-120)	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 202%*			*Limits: 34.5-148%*	"							*09/14/09 00:29*	*ZX*
Nitrobenzene-d5		*53.2%*			*33-141%*	"							"	
p-Terphenyl-d14		*118%*			*37.8-150%*	"							"	
Matrix Spike Dup (9090081-MSD1)					**QC Source: SSI0032-11**				**Extracted: 09/11/09 11:35**					
Chrysene	EPA 8270 mod.	137	---	3.00	mg/kg	1x	50.6	100	86.2%	(45.2-120)	2.60%	(34.7)	09/14/09 00:51	
Fluorene	"	505	---	3.00	"	"	178	"	328%	(25.3-128)	13.9%	(38)	"	M1
Indeno (1,2,3-cd) pyrene	"	114	---	3.00	"	"	3.88	"	111%	(32.2-145)	0.350%	(31.5)	"	
Naphthalene	"	57.2	---	3.00	"	"	ND	"	57.2%	(28.9-120)	15.5%	(34.6)	"	
Surrogate(s): 2-FBP		*Recovery: 176%*			*Limits: 34.5-148%*	"							*09/14/09 00:51*	*ZX*
Nitrobenzene-d5		*45.6%*			*33-141%*	"							"	
p-Terphenyl-d14		*127%*			*37.8-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Dissolved - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 53620 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (163871D)				**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**						
Iron	6010B Dissolved	25.0	0.032	0.20	mg/L	1x	5.1	22.0	90%	(75-125)	1%	(20)	11/09/09 18:30	
Calcium	"	46.6	0.028	1.1	"	"	29	20.0	90%	"	1%	"	"	
Manganese	"	1.12	0.0017	0.020	"	"	0.21	1.00	91%	"	1%	"	"	
Magnesium	"	24.5	0.23	1.1	"	"	6.4	20.0	90%	"	0%	"	"	
Antimony	"	2.69	0.0025	0.060	"	"	ND	3.00	90%	"	0%	"	"	
Lead	"	0.915	0.0017	0.030	"	"	ND	1.00	91%	"	1%	"	"	
Potassium	"	19.6	0.41	3.3	"	"	1.1	20.0	93%	"	0%	"	11/10/09 16:53	
Sodium	"	20.2	0.18	2.0	"	"	2.2	"	90%	"	0%	"	"	
Matrix Spike (163871S)				**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**						
Iron	6010B Dissolved	24.7	0.032	0.20	mg/L	1x	5.1	22.0	89%	(75-125)	--	--	11/09/09 18:25	
Calcium	"	46.9	0.028	1.1	"	"	29	20.0	92%	"	--	--	"	
Manganese	"	1.11	0.0017	0.020	"	"	0.21	1.00	90%	"	--	--	"	
Magnesium	"	24.4	0.23	1.1	"	"	6.4	20.0	90%	"	--	--	"	
Antimony	"	2.68	0.0025	0.060	"	"	ND	3.00	89%	"	--	--	"	
Lead	"	0.908	0.0017	0.030	"	"	ND	1.00	91%	"	--	--	"	
Potassium	"	19.6	0.41	3.3	"	"	1.1	20.0	93%	"	--	--	11/10/09 16:50	
Sodium	"	20.3	0.18	2.0	"	"	2.2	"	91%	"	--	--	"	
Duplicate (163871X)				**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**						
Iron	6010B Dissolved	5.02	0.032	0.20	mg/L	1x	5.1	--	--	--	1%	(20)	11/09/09 18:19	
Calcium	"	28.5	0.028	1.1	"	"	29	--	--	--	0%	"	"	
Manganese	"	0.209	0.0017	0.020	"	"	0.21	--	--	--	1%	"	"	
Magnesium	"	6.31	0.23	1.1	"	"	6.4	--	--	--	2%	"	"	
Antimony	"	ND	0.0025	0.060	"	"	ND	--	--	--	NC%	"	"	
Lead	"	ND	0.0017	0.030	"	"	ND	--	--	--	NC%	"	"	
Potassium	"	1.09	0.41	3.3	"	"	1.1	--	--	--	0%	"	11/10/09 16:45	J
Sodium	"	2.14	0.18	2.0	"	"	2.2	--	--	--	1%	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Dissolved - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 54228 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (164741D)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Iron	6010B Dissolved	28.6	0.032	0.20	mg/L	1x	8.0	22.0	94%	(75-125)	0%	(20)	11/18/09 20:32	
Manganese	"	2.91	0.0017	0.020	"	"	2.0	1.00	90%	"	1%	"	"	
Matrix Spike (164741S)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Iron	6010B Dissolved	28.7	0.032	0.20	mg/L	1x	8.0	22.0	94%	(75-125)	--	--	11/18/09 20:27	
Manganese	"	2.94	0.0017	0.020	"	"	2.0	1.00	93%	"	--	--	"	
Duplicate (164741X)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Iron	6010B Dissolved	8.15	0.032	0.20	mg/L	1x	8.0	--	--	--	1%	(20)	11/18/09 20:22	
Manganese	"	2.02	0.0017	0.020	"	"	2.0	--	--	--	0%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Dissolved - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 53620 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (163871D)				**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**						
Arsenic	6020 Dissolved	3.86	0.0024	0.020	mg/L	50x	ND	4.00	97%	(75-125)	0%	(20)	11/09/09 17:06	
Lead	"	1.02	0.0017	0.020	"	"	ND	1.00	102%	"	0%	"	"	
Antimony	"	2.65	0.0040	0.020	"	"	0.00090	3.00	88%	"	2%	"	"	
Barium	"	4.00	0.0027	0.060	"	"	0.025	4.00	99%	"	0%	"	"	
Beryllium	"	0.0980	0.0026	0.020	"	"	ND	0.100	98%	"	4%	"	"	
Cadmium	"	0.0970	0.0014	0.020	"	"	ND	"	97%	"	3%	"	"	
Chromium	"	0.408	0.0037	0.020	"	"	0.00064	0.400	102%	"	2%	"	"	
Copper	"	0.533	0.0015	0.050	"	"	0.00068	0.500	106%	"	1%	"	"	
Nickel	"	1.04	0.0022	0.020	"	"	0.00090	1.00	104%	"	3%	"	"	
Selenium	"	4.00	0.0034	0.020	"	"	0.00052	4.00	100%	"	2%	"	"	
Silver	"	0.597	0.0015	0.020	"	"	ND	0.600	100%	"	1%	"	"	
Thallium	"	4.03	0.00060	0.040	"	"	0.00045	4.00	101%	"	1%	"	"	
Vanadium	"	1.05	0.0023	0.020	"	"	0.0016	1.00	105%	"	2%	"	"	
Zinc	"	25.5	0.020	0.070	"	"	32	"	-654%	"	0%	"	"	4
Aluminum	"	4.15	0.023	4.0	"	"	0.012	4.00	103%	"	0%	"	"	
Cobalt	"	1.06	0.0016	0.020	"	"	0.00082	1.00	106%	"	2%	"	"	
Matrix Spike (163871S)				**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**						
Arsenic	6020 Dissolved	3.88	0.0024	0.020	mg/L	50x	ND	4.00	97%	(75-125)	--	--	11/09/09 17:02	
Lead	"	1.02	0.0017	0.020	"	"	ND	1.00	102%	"	--	--	"	
Antimony	"	2.60	0.0040	0.020	"	"	0.00090	3.00	87%	"	--	--	"	
Barium	"	4.00	0.0027	0.060	"	"	0.025	4.00	100%	"	--	--	"	
Beryllium	"	0.102	0.0026	0.020	"	"	ND	0.100	102%	"	--	--	"	
Cadmium	"	0.0946	0.0014	0.020	"	"	ND	"	95%	"	--	--	"	
Chromium	"	0.401	0.0037	0.020	"	"	0.00064	0.400	100%	"	--	--	"	
Copper	"	0.529	0.0015	0.050	"	"	0.00068	0.500	106%	"	--	--	"	
Nickel	"	1.01	0.0022	0.020	"	"	0.00090	1.00	101%	"	--	--	"	
Selenium	"	4.07	0.0034	0.020	"	"	0.00052	4.00	102%	"	--	--	"	
Silver	"	0.594	0.0015	0.020	"	"	ND	0.600	99%	"	--	--	"	
Thallium	"	3.99	0.00060	0.040	"	"	0.00045	4.00	100%	"	--	--	"	
Vanadium	"	1.04	0.0023	0.020	"	"	0.0016	1.00	103%	"	--	--	"	
Zinc	"	25.6	0.020	0.070	"	"	32	"	-642%	"	--	--	"	4
Aluminum	"	4.15	0.023	4.0	"	"	0.012	4.00	103%	"	--	--	"	
Cobalt	"	1.04	0.0016	0.020	"	"	0.00082	1.00	104%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Dissolved - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 53620 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (163871X)					**QC Source: SSI0032-02**				**Extracted: 11/09/09 10:32**					
Arsenic	6020 Dissolved	ND	0.00024	0.0020	mg/L	5x	ND	--	--	--	NC%	(20)	11/09/09 16:58	
Lead	"	ND	0.00017	0.0020	"	"	ND	--	--	--	NC%	"	"	
Antimony	"	0.000810	0.00040	0.0020	"	"	0.00090	--	--	--	11%	"	"	J
Barium	"	0.0260	0.00027	0.0060	"	"	0.025	--	--	--	5%	"	"	
Beryllium	"	ND	0.00026	0.0020	"	"	ND	--	--	--	NC%	"	"	
Cadmium	"	ND	0.00014	0.0020	"	"	ND	--	--	--	NC%	"	"	
Chromium	"	0.000905	0.00037	0.0020	"	"	0.00064	--	--	--	35%	"	"	J
Copper	"	0.000685	0.00015	0.0050	"	"	0.00068	--	--	--	1%	"	"	J
Nickel	"	0.000860	0.00022	0.0020	"	"	0.00090	--	--	--	5%	"	"	J
Selenium	"	ND	0.00034	0.0020	"	"	0.00052	--	--	--	NC%	"	"	
Silver	"	ND	0.00015	0.0020	"	"	ND	--	--	--	NC%	"	"	
Thallium	"	0.000475	0.000060	0.0040	"	"	0.00045	--	--	--	5%	"	"	J
Vanadium	"	0.00291	0.00023	0.0020	"	"	0.0016	--	--	--	57%	"	"	
Zinc	"	32.3	0.0020	0.0070	"	"	32	--	--	--	1%	"	"	
Aluminum	"	0.0128	0.0023	0.40	"	"	0.012	--	--	--	10%	"	"	J
Cobalt	"	0.000735	0.00016	0.0020	"	"	0.00082	--	--	--	10%	"	"	J

QC Batch: 54228 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (164741D)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Arsenic	6020 Dissolved	3.77	0.0024	0.020	mg/L	50x	0.0096	4.00	94%	(75-125)	1%	(20)	11/18/09 20:05	
Matrix Spike (164741S)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Arsenic	6020 Dissolved	3.73	0.0024	0.020	mg/L	50x	0.0096	4.00	93%	(75-125)	--	--	11/18/09 19:59	
Duplicate (164741X)					**QC Source: SSI0032-06**				**Extracted: 11/18/09 11:31**					
Arsenic	6020 Dissolved	0.00910	0.00024	0.0020	mg/L	5x	0.0096	--	--	--	6%	(20)	11/18/09 19:53	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Mercury (CVAA) Dissolved - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 53714 **Water Preparation Method: 7470A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (163871D)				**QC Source: SSI0032-02**				**Extracted: 11/10/09 10:01**						
Mercury	7470A Dissolved	0.00195	0.000041	0.00020	mg/L	1x	ND	0.00200	98%	(75-125)	1%	(20)	11/10/09 15:26	
Matrix Spike (163871S)				**QC Source: SSI0032-02**				**Extracted: 11/10/09 10:01**						
Mercury	7470A Dissolved	0.00193	0.000041	0.00020	mg/L	1x	ND	0.00200	96%	(75-125)	--	--	11/10/09 15:22	
Duplicate (163871X)				**QC Source: SSI0032-02**				**Extracted: 11/10/09 10:01**						
Mercury	7470A Dissolved	ND	0.000041	0.00020	mg/L	1x	ND	--	--	--	NC%	(20)	11/10/09 15:17	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50154 **Water Preparation Method: 7470A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534817D)				**QC Source: SSI0032-22**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	0.00195	0.000041	0.00020	mg/L	1x	ND	0.00200	98%	(75-125)	7%	(20)	09/14/09 11:16	
Matrix Spike (1534817S)				**QC Source: SSI0032-22**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	0.00210	0.000041	0.00020	mg/L	1x	ND	0.00200	105%	(75-125)	--	--	09/14/09 11:12	
Duplicate (1534817X)				**QC Source: SSI0032-22**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	ND	0.000041	0.00020	mg/L	1x	ND	--	--	--	NC%	(20)	09/14/09 11:07	
Blank (580-50191-23)				**QC Source:**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	ND	0.000041	0.00020	mg/L	1x	--	--	--	--	--	--	09/14/09 10:46	
LCS (580-50191-24)				**QC Source:**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	0.00200	0.000041	0.00020	mg/L	1x	--	0.00200	100%	(75-125)	--	--	09/14/09 10:50	
LCS Dup (580-50191-25)				**QC Source:**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	0.00215	0.000041	0.00020	mg/L	1x	--	0.00200	108%	(75-125)	7%	(20)	09/14/09 10:55	
LCS (580-50191-26)				**QC Source:**				**Extracted: 09/14/09 09:02**						
Mercury	7470A	0.00215	0.000041	0.00020	mg/L	1x	--	0.00200	108%	(75-125)	--	--	09/14/09 10:59	

QC Batch: 50889 **Waste Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534820D)				**QC Source: SSI0032-05**				**Extracted: 09/25/09 11:09**						
Mercury	7471A	0.350	0.012	0.038	mg/Kg	1x	ND	0.378	92%	(75-125)	6%	(35)	09/28/09 12:53	
Matrix Spike (1534820S)				**QC Source: SSI0032-05**				**Extracted: 09/25/09 11:09**						
Mercury	7471A	0.371	0.012	0.038	mg/Kg	1x	ND	0.380	97%	(75-125)	--	--	09/28/09 12:48	
Duplicate (1534820X)				**QC Source: SSI0032-05**				**Extracted: 09/25/09 11:09**						
Mercury	7471A	ND	0.012	0.037	mg/Kg	1x	ND	--	--	--	NC%	(35)	09/28/09 12:44	
Blank (580-51077-23)				**QC Source:**				**Extracted: 09/25/09 11:09**						
Mercury	7471A	ND	0.013	0.040	mg/Kg	1x	--	--	--	--	--	--	09/28/09 12:14	
LCS (580-51077-24)				**QC Source:**				**Extracted: 09/25/09 11:09**						
Mercury	7471A	0.382	0.013	0.040	mg/Kg	1x	--	0.400	96%	(75-125)	--	--	09/28/09 12:19	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50889 **Waste Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-51077-25)				**QC Source:**					**Extracted: 09/25/09 11:09**					
Mercury	7471A	0.384	0.013	0.040	mg/Kg	1x	--	0.400	96%	(75-125)	1%	(25)	09/28/09 12:23	
LCS (580-51077-26)				**QC Source:**					**Extracted: 09/25/09 11:09**					
Mercury	7471A	4.43	0.031	0.10	mg/Kg	1x	--	4.47	99%	(80-120)	--	--	09/28/09 12:27	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50886 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534820D)					**QC Source: SSI0032-05**				**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	985	33	110	mg/Kg	1x	1500	752	-68%	(75-125)	69%	(35)	09/25/09 16:37	F
Lead	"	185	0.45	5.6	"	"	3.2	188	97%	"	0%	"	"	
Arsenic	"	746	0.49	11	"	"	4.8	752	99%	"	0%	"	"	
Calcium	"	3970	5.6	210	"	"	570	3760	91%	"	7%	"	"	
Antimony	"	535	0.64	11	"	"	ND	564	95%	"	3%	"	"	
Beryllium	"	17.8	0.0045	0.94	"	"	0.055	18.8	95%	"	1%	"	"	
Chromium	"	75.6	0.18	4.9	"	"	1.8	75.2	98%	"	1%	"	"	
Potassium	"	3810	60	620	"	"	290	3760	93%	"	2%	"	"	
Selenium	"	704	0.45	19	"	"	ND	752	94%	"	1%	"	"	
Silver	"	102	0.17	3.8	"	"	ND	113	90%	"	1%	"	"	
Barium	"	754	0.056	1.9	"	"	24	752	97%	"	2%	"	"	
Iron	"	4450	1.7	38	"	"	2300	4140	53%	"	23%	"	"	F
Sodium	"	3410	26	380	"	"	780	3760	70%	"	18%	"	"	F
Magnesium	"	3980	2.5	210	"	"	800	"	85%	"	9%	"	"	
Nickel	"	198	0.30	3.8	"	"	9.7	188	100%	"	0%	"	"	
Copper	"	105	0.83	3.8	"	"	12	94.0	99%	"	3%	"	"	
Manganese	"	192	0.030	3.8	"	"	31	188	86%	"	8%	"	"	
Cadmium	"	18.2	0.30	1.9	"	"	ND	18.8	97%	"	1%	"	"	
Cobalt	"	193	0.12	1.9	"	"	1.8	188	102%	"	1%	"	"	
Thallium	"	754	0.53	19	"	"	ND	752	100%	"	1%	"	"	
Vanadium	"	195	0.11	1.9	"	"	8.5	188	99%	"	0%	"	"	
Zinc	"	191	0.75	9.4	"	"	21	"	90%	"	5%	"	"	
Matrix Spike (1534820S)					**QC Source: SSI0032-05**				**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	2020	34	110	mg/Kg	1x	1500	761	69%	(75-125)	--	--	09/25/09 16:32	F
Lead	"	185	0.46	5.7	"	"	3.2	190	96%	"	--	--	"	
Arsenic	"	743	0.49	11	"	"	4.8	761	97%	"	--	--	"	
Calcium	"	4270	5.7	210	"	"	570	3810	97%	"	--	--	"	
Antimony	"	521	0.65	11	"	"	ND	571	91%	"	--	--	"	
Beryllium	"	18.0	0.0046	0.95	"	"	0.055	19.0	95%	"	--	--	"	
Selenium	"	700	0.46	19	"	"	ND	761	92%	"	--	--	"	
Chromium	"	76.6	0.18	4.9	"	"	1.8	76.1	98%	"	--	--	"	
Potassium	"	3890	61	630	"	"	290	3810	95%	"	--	--	"	
Silver	"	101	0.17	3.8	"	"	ND	114	89%	"	--	--	"	
Barium	"	769	0.057	1.9	"	"	24	761	98%	"	--	--	"	
Iron	"	5610	1.8	38	"	"	2300	4190	80%	"	--	--	"	
Sodium	"	4100	26	380	"	"	780	3810	87%	"	--	--	"	
Nickel	"	198	0.30	3.8	"	"	9.7	190	99%	"	--	--	"	
Magnesium	"	4380	2.5	210	"	"	800	3810	94%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50886 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1534820S)					**QC Source: SSI0032-05**				**Extracted: 09/25/09 10:48**					
Manganese	6010B TMP	208	0.030	3.8	mg/Kg	1x	31	190	93%	(75-125)	--	--	09/25/09 16:32	
Copper	"	108	0.84	3.8	"	"	12	95.1	102%	"	--	--	"	
Cadmium	"	18.0	0.30	1.9	"	"	ND	19.0	95%	"	--	--	"	
Cobalt	"	194	0.12	1.9	"	"	1.8	190	101%	"	--	--	"	
Thallium	"	743	0.53	19	"	"	ND	761	98%	"	--	--	"	
Vanadium	"	195	0.11	1.9	"	"	8.5	190	98%	"	--	--	"	
Zinc	"	200	0.76	9.5	"	"	21	"	94%	"	--	--	"	
Duplicate (1534820X)					**QC Source: SSI0032-05**				**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	1230	36	120	mg/Kg	1x	1500	--	--	--	20%	(35)	09/25/09 16:26	
Lead	"	2.68	0.48	6.0	"	"	3.2	--	--	--	17%	"	"	J
Arsenic	"	4.89	0.52	12	"	"	4.8	--	--	--	1%	"	"	J
Calcium	"	544	6.0	220	"	"	570	--	--	--	4%	"	"	
Antimony	"	ND	0.68	12	"	"	ND	--	--	--	NC%	"	"	
Selenium	"	ND	0.48	20	"	"	ND	--	--	--	NC%	"	"	
Beryllium	"	0.0402	0.0048	1.0	"	"	0.055	--	--	--	31%	"	"	J
Chromium	"	1.77	0.19	5.2	"	"	1.8	--	--	--	0%	"	"	J
Potassium	"	241	64	660	"	"	290	--	--	--	20%	"	"	J
Iron	"	1980	1.8	40	"	"	2300	--	--	--	13%	"	"	
Barium	"	20.8	0.060	2.0	"	"	24	--	--	--	16%	"	"	
Silver	"	ND	0.18	4.0	"	"	ND	--	--	--	NC%	"	"	
Magnesium	"	614	2.6	220	"	"	800	--	--	--	26%	"	"	
Sodium	"	1150	27	400	"	"	780	--	--	--	38%	"	"	
Nickel	"	12.2	0.32	4.0	"	"	9.7	--	--	--	23%	"	"	
Cadmium	"	ND	0.32	2.0	"	"	ND	--	--	--	NC%	"	"	
Copper	"	12.0	0.88	4.0	"	"	12	--	--	--	3%	"	"	
Manganese	"	25.8	0.032	4.0	"	"	31	--	--	--	18%	"	"	
Cobalt	"	1.40	0.13	2.0	"	"	1.8	--	--	--	23%	"	"	J
Thallium	"	ND	0.56	20	"	"	ND	--	--	--	NC%	"	"	
Vanadium	"	10.9	0.12	2.0	"	"	8.5	--	--	--	25%	"	"	
Zinc	"	19.6	0.80	10	"	"	21	--	--	--	5%	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50886 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50992-13)				**QC Source:**					**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	ND	36	120	mg/Kg	1x	--	--	--	--	--	--	09/25/09 15:52	
Lead	"	ND	0.48	6.0	"	"	--	--	--	--	--	--	"	
Arsenic	"	ND	0.52	12	"	"	--	--	--	--	--	--	"	
Calcium	"	ND	6.0	220	"	"	--	--	--	--	--	--	"	
Antimony	"	ND	0.68	12	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.19	5.2	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.48	20	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	64	660	"	"	--	--	--	--	--	--	"	
Beryllium	"	ND	0.0048	1.0	"	"	--	--	--	--	--	--	"	
Barium	"	ND	0.060	2.0	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.18	4.0	"	"	--	--	--	--	--	--	"	
Iron	"	ND	1.8	40	"	"	--	--	--	--	--	--	"	
Sodium	"	ND	27	400	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.32	4.0	"	"	--	--	--	--	--	--	"	
Magnesium	"	5.54	2.6	220	"	"	--	--	--	--	--	--	"	J
Copper	"	ND	0.88	4.0	"	"	--	--	--	--	--	--	"	
Manganese	"	ND	0.032	4.0	"	"	--	--	--	--	--	--	"	
Cadmium	"	ND	0.32	2.0	"	"	--	--	--	--	--	--	"	
Cobalt	"	ND	0.13	2.0	"	"	--	--	--	--	--	--	"	
Thallium	"	2.79	0.56	20	"	"	--	--	--	--	--	--	"	J
Vanadium	"	ND	0.12	2.0	"	"	--	--	--	--	--	--	"	
Zinc	"	ND	0.80	10	"	"	--	--	--	--	--	--	"	
LCS (580-50992-14)				**QC Source:**					**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	771	36	120	mg/Kg	1x	--	800	96%	(80-120)	--	--	09/25/09 15:59	
Lead	"	187	0.48	6.0	"	"	--	200	93%	"	--	--	"	
Arsenic	"	745	0.52	12	"	"	--	800	93%	"	--	--	"	
Calcium	"	3830	6.0	220	"	"	--	4000	96%	"	--	--	"	
Antimony	"	550	0.68	12	"	"	--	600	92%	"	--	--	"	
Beryllium	"	18.5	0.0048	1.0	"	"	--	20.0	92%	"	--	--	"	
Selenium	"	713	0.48	20	"	"	--	800	89%	"	--	--	"	
Potassium	"	3810	64	660	"	"	--	4000	95%	"	--	--	"	
Chromium	"	77.4	0.19	5.2	"	"	--	80.0	97%	"	--	--	"	
Silver	"	111	0.18	4.0	"	"	--	120	92%	"	--	--	"	
Barium	"	780	0.060	2.0	"	"	--	800	97%	"	--	--	"	
Iron	"	4310	1.8	40	"	"	--	4400	98%	"	--	--	"	
Sodium	"	3310	27	400	"	"	--	4000	83%	"	--	--	"	
Magnesium	"	3860	2.6	220	"	"	--	"	97%	"	--	--	"	
Nickel	"	195	0.32	4.0	"	"	--	200	98%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50886 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50992-14)				**QC Source:**					**Extracted: 09/25/09 10:48**					
Cadmium	6010B TMP	18.4	0.32	2.0	mg/Kg	1x	--	20.0	92%	(80-120)	--	--	09/25/09 15:59	
Manganese	"	197	0.032	4.0	"	"	--	200	98%	"	--	--	"	
Copper	"	89.9	0.88	4.0	"	"	--	100	90%	"	--	--	"	
Cobalt	"	197	0.13	2.0	"	"	--	200	99%	"	--	--	"	
Thallium	"	776	0.56	20	"	"	--	800	97%	"	--	--	"	
Vanadium	"	192	0.12	2.0	"	"	--	200	96%	"	--	--	"	
Zinc	"	187	0.80	10	"	"	--	"	93%	"	--	--	"	
LCS Dup (580-50992-15)				**QC Source:**					**Extracted: 09/25/09 10:48**					
Aluminum	6010B TMP	783	36	120	mg/Kg	1x	--	800	98%	(80-120)	1%	(35)	09/25/09 16:03	
Lead	"	190	0.48	6.0	"	"	--	200	95%	"	1%	"	"	
Arsenic	"	755	0.52	12	"	"	--	800	94%	"	1%	"	"	
Calcium	"	3820	6.0	220	"	"	--	4000	95%	"	0%	"	"	
Antimony	"	557	0.68	12	"	"	--	600	93%	"	1%	"	"	
Chromium	"	78.3	0.19	5.2	"	"	--	80.0	98%	"	1%	"	"	
Beryllium	"	18.7	0.0048	1.0	"	"	--	20.0	93%	"	1%	"	"	
Potassium	"	3800	64	660	"	"	--	4000	95%	"	0%	"	"	
Selenium	"	723	0.48	20	"	"	--	800	90%	"	1%	"	"	
Iron	"	4310	1.8	40	"	"	--	4400	98%	"	0%	"	"	
Barium	"	790	0.060	2.0	"	"	--	800	99%	"	1%	"	"	
Silver	"	112	0.18	4.0	"	"	--	120	93%	"	1%	"	"	
Sodium	"	3310	27	400	"	"	--	4000	83%	"	0%	"	"	
Magnesium	"	3850	2.6	220	"	"	--	"	96%	"	0%	"	"	
Nickel	"	198	0.32	4.0	"	"	--	200	99%	"	1%	"	"	
Cadmium	"	18.6	0.32	2.0	"	"	--	20.0	93%	"	1%	"	"	
Manganese	"	199	0.032	4.0	"	"	--	200	100%	"	1%	"	"	
Copper	"	90.8	0.88	4.0	"	"	--	100	91%	"	1%	"	"	
Cobalt	"	200	0.13	2.0	"	"	--	200	100%	"	1%	"	"	
Thallium	"	785	0.56	20	"	"	--	800	98%	"	1%	"	"	
Vanadium	"	194	0.12	2.0	"	"	--	200	97%	"	1%	"	"	
Zinc	"	189	0.80	10	"	"	--	"	95%	"	1%	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50886 **Waste Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50992-16)				**QC Source:**									**Extracted: 09/25/09 10:50**	
Aluminum	6010B TMP	787	36	120	mg/Kg	1x	--	800	98%	(51.5-148.	--	--	09/25/09 16:08	
Lead	"	192	0.48	6.0	"	"	--	200	96%	(81.5-118.	--	--	"	
Arsenic	"	767	0.52	12	"	"	--	800	96%	(79.2-121.	--	--	"	
Calcium	"	3890	6.0	220	"	"	--	4000	97%	(80.6-119.	--	--	"	
Antimony	"	560	0.68	12	"	"	--	600	93%	(0-263.2)	--	--	"	
Potassium	"	3870	64	660	"	"	--	4000	97%	(73.3-127.	--	--	"	
Selenium	"	734	0.48	20	"	"	--	800	92%	(76.7-123.	--	--	"	
Chromium	"	79.5	0.19	5.2	"	"	--	80.0	99%	(80.1-119.	--	--	"	
Beryllium	"	19.0	0.0048	1.0	"	"	--	20.0	95%	(79.6-120.	--	--	"	
Silver	"	112	0.18	4.0	"	"	--	120	93%	(46.6-153.	--	--	"	
Iron	"	4350	1.8	40	"	"	--	4400	99%	(30.1-169.	--	--	"	
Barium	"	800	0.060	2.0	"	"	--	800	100%	(81.5-118.	--	--	"	
Nickel	"	200	0.32	4.0	"	"	--	200	100%	(78.5-122.	--	--	"	
Magnesium	"	3910	2.6	220	"	"	--	4000	98%	(73.8-126.	--	--	"	
Sodium	"	3330	27	400	"	"	--	"	83%	(70.1-129.	--	--	"	
Manganese	"	202	0.032	4.0	"	"	--	200	101%	(76.7-123.	--	--	"	
Copper	"	91.3	0.88	4.0	"	"	--	100	91%	(78.4-122.	--	--	"	
Cadmium	"	18.9	0.32	2.0	"	"	--	20.0	94%	(81.2-118.	--	--	"	
Cobalt	"	202	0.13	2.0	"	"	--	200	101%	(81.0-119.	--	--	"	
Thallium	"	797	0.56	20	"	"	--	800	100%	(78.1-121.	--	--	"	
Vanadium	"	197	0.12	2.0	"	"	--	200	98%	(77.1-123.	--	--	"	
Zinc	"	192	0.80	10	"	"	--	"	96%	(80.4-119.	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534817D)				**QC Source: SSI0032-22**				**Extracted: 09/18/09 11:30**						
Aluminum	6010B Total Recoverable	4.18	0.31	0.50	mg/L	1x	ND	4.00	105%	(75-125)	4%	(20)	09/21/09 12:18	
Sodium	"	19.7	0.18	2.0	"	"	1.0	20.0	93%	"	3%	"	"	
Potassium	"	20.2	0.41	3.3	"	"	0.69	"	97%	"	1%	"	"	
Calcium	"	31.0	0.028	1.1	"	"	11	"	100%	"	4%	"	"	
Manganese	"	1.01	0.0017	0.020	"	"	0.0076	1.00	100%	"	3%	"	"	
Iron	"	21.9	0.032	0.20	"	"	ND	22.0	99%	"	2%	"	"	
Magnesium	"	22.0	0.23	1.1	"	"	2.3	20.0	99%	"	4%	"	"	
Matrix Spike (1534817S)				**QC Source: SSI0032-22**				**Extracted: 09/18/09 11:30**						
Aluminum	6010B Total Recoverable	4.04	0.31	0.50	mg/L	1x	ND	4.00	101%	(75-125)	--	--	09/21/09 12:15	
Sodium	"	19.1	0.18	2.0	"	"	1.0	20.0	90%	"	--	--	"	
Calcium	"	29.9	0.028	1.1	"	"	11	"	94%	"	--	--	"	
Manganese	"	0.985	0.0017	0.020	"	"	0.0076	1.00	98%	"	--	--	"	
Potassium	"	20.0	0.41	3.3	"	"	0.69	20.0	97%	"	--	--	"	
Iron	"	21.4	0.032	0.20	"	"	ND	22.0	97%	"	--	--	"	
Magnesium	"	21.2	0.23	1.1	"	"	2.3	20.0	95%	"	--	--	"	
Duplicate (1534817X)				**QC Source: SSI0032-22**				**Extracted: 09/18/09 11:30**						
Sodium	6010B Total Recoverable	1.06	0.18	2.0	mg/L	1x	1.0	--	--	--	3%	(20)	09/21/09 12:09	J
Aluminum	"	ND	0.31	0.50	"	"	ND	--	--	--	NC%	"	"	
Potassium	"	0.687	0.41	3.3	"	"	0.69	--	--	--	0%	"	"	J
Manganese	"	0.00823	0.0017	0.020	"	"	0.0076	--	--	--	8%	"	"	J
Calcium	"	11.6	0.028	1.1	"	"	11	--	--	--	4%	"	"	
Iron	"	ND	0.032	0.20	"	"	ND	--	--	--	NC%	"	"	
Magnesium	"	2.37	0.23	1.1	"	"	2.3	--	--	--	3%	"	"	
Blank (580-50617-13)				**QC Source:**				**Extracted: 09/18/09 11:30**						
Sodium	6010B Total Recoverable	ND	0.18	2.0	mg/L	1x	--	--	--	--	--	--	09/21/09 11:42	
Aluminum	"	ND	0.31	0.50	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	0.41	3.3	"	"	--	--	--	--	--	--	"	
Manganese	"	ND	0.0017	0.020	"	"	--	--	--	--	--	--	"	
Calcium	"	ND	0.028	1.1	"	"	--	--	--	--	--	--	"	
Iron	"	ND	0.032	0.20	"	"	--	--	--	--	--	--	"	
Magnesium	"	ND	0.23	1.1	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50617-14)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Aluminum	6010B Total Recoverable	4.10	0.31	0.50	mg/L	1x	--	4.00	103%	(80-120)	--	--	09/21/09 11:47	
Sodium	"	17.9	0.18	2.0	"	"	--	20.0	89%	"	--	--	"	
Potassium	"	19.3	0.41	3.3	"	"	--	"	96%	"	--	--	"	
Calcium	"	19.1	0.028	1.1	"	"	--	"	95%	"	--	--	"	
Manganese	"	0.991	0.0017	0.020	"	"	--	1.00	99%	"	--	--	"	
Iron	"	21.6	0.032	0.20	"	"	--	22.0	98%	"	--	--	"	
Magnesium	"	19.3	0.23	1.1	"	"	--	20.0	97%	"	--	--	"	
LCS Dup (580-50617-15)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Aluminum	6010B Total Recoverable	4.08	0.31	0.50	mg/L	1x	--	4.00	102%	(80-120)	0%	(20)	09/21/09 11:51	
Sodium	"	18.1	0.18	2.0	"	"	--	20.0	91%	"	1%	"	"	
Manganese	"	0.990	0.0017	0.020	"	"	--	1.00	99%	"	0%	"	"	
Potassium	"	20.2	0.41	3.3	"	"	--	20.0	101%	"	5%	"	"	
Calcium	"	19.7	0.028	1.1	"	"	--	"	98%	"	3%	"	"	
Iron	"	21.9	0.032	0.20	"	"	--	22.0	100%	"	2%	"	"	
Magnesium	"	19.9	0.23	1.1	"	"	--	20.0	100%	"	3%	"	"	
LCS (580-50617-16)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Sodium	6010B Total Recoverable	17.6	0.18	2.0	mg/L	1x	--	20.0	88%	(80-120)	--	--	09/21/09 11:54	
Aluminum	"	4.02	0.31	0.50	"	"	--	4.00	100%	"	--	--	"	
Calcium	"	19.1	0.028	1.1	"	"	--	20.0	95%	"	--	--	"	
Manganese	"	0.974	0.0017	0.020	"	"	--	1.00	97%	"	--	--	"	
Potassium	"	18.5	0.41	3.3	"	"	--	20.0	93%	"	--	--	"	
Iron	"	21.3	0.032	0.20	"	"	--	22.0	97%	"	--	--	"	
Magnesium	"	19.3	0.23	1.1	"	"	--	20.0	96%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534817D)					**QC Source: SSI0032-22**					**Extracted: 09/18/09 11:30**				
Arsenic	6020 Total Recoverable	3.80	0.0024	0.020	mg/L	50x	ND	4.00	95%	(75-125)	1%	(20)	09/21/09 08:54	
Cadmium	"	0.109	0.0014	0.020	"	"	ND	0.100	109%	"	1%	"	"	
Lead	"	1.07	0.0017	0.020	"	"	ND	1.00	107%	"	0%	"	"	
Antimony	"	3.05	0.0040	0.020	"	"	ND	3.00	102%	"	2%	"	"	
Chromium	"	0.397	0.0037	0.020	"	"	0.00042	0.400	99%	"	3%	"	"	
Nickel	"	1.00	0.0022	0.020	"	"	0.00047	1.00	100%	"	4%	"	"	
Selenium	"	3.88	0.0034	0.020	"	"	ND	4.00	97%	"	2%	"	"	
Barium	"	4.34	0.0027	0.060	"	"	0.0076	"	108%	"	1%	"	"	
Cobalt	"	1.01	0.0016	0.020	"	"	ND	1.00	101%	"	2%	"	"	
Silver	"	0.684	0.0015	0.020	"	"	ND	0.600	114%	"	1%	"	"	
Beryllium	"	0.111	0.0026	0.020	"	"	ND	0.100	111%	"	3%	"	"	
Copper	"	0.510	0.0015	0.050	"	"	0.00076	0.500	102%	"	4%	"	"	
Thallium	"	4.14	0.00060	0.040	"	"	ND	4.00	103%	"	1%	"	"	
Vanadium	"	0.989	0.0023	0.020	"	"	ND	1.00	99%	"	6%	"	"	
Zinc	"	0.963	0.020	0.070	"	"	ND	"	96%	"	5%	"	"	
Matrix Spike (1534817S)					**QC Source: SSI0032-22**					**Extracted: 09/18/09 11:30**				
Arsenic	6020 Total Recoverable	3.84	0.0024	0.020	mg/L	50x	ND	4.00	96%	(75-125)	--	--	09/21/09 08:49	
Cadmium	"	0.108	0.0014	0.020	"	"	ND	0.100	108%	"	--	--	"	
Lead	"	1.07	0.0017	0.020	"	"	ND	1.00	107%	"	--	--	"	
Chromium	"	0.410	0.0037	0.020	"	"	0.00042	0.400	102%	"	--	--	"	
Nickel	"	1.04	0.0022	0.020	"	"	0.00047	1.00	104%	"	--	--	"	
Antimony	"	3.00	0.0040	0.020	"	"	ND	3.00	100%	"	--	--	"	
Barium	"	4.37	0.0027	0.060	"	"	0.0076	4.00	109%	"	--	--	"	
Cobalt	"	1.03	0.0016	0.020	"	"	ND	1.00	103%	"	--	--	"	
Selenium	"	3.95	0.0034	0.020	"	"	ND	4.00	99%	"	--	--	"	
Beryllium	"	0.108	0.0026	0.020	"	"	ND	0.100	108%	"	--	--	"	
Copper	"	0.530	0.0015	0.050	"	"	0.00076	0.500	106%	"	--	--	"	
Silver	"	0.692	0.0015	0.020	"	"	ND	0.600	115%	"	--	--	"	
Thallium	"	4.18	0.00060	0.040	"	"	ND	4.00	104%	"	--	--	"	
Vanadium	"	1.04	0.0023	0.020	"	"	ND	1.00	104%	"	--	--	"	
Zinc	"	1.01	0.020	0.070	"	"	ND	"	101%	"	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (1534817X)				**QC Source: SSI0032-22**					**Extracted: 09/18/09 11:30**					
Arsenic	6020 Total Recoverable	ND	0.00024	0.0020	mg/L	5x	ND	--	--	--	NC%	(20)	09/21/09 08:44	
Cadmium	"	ND	0.00014	0.0020	"	"	ND	--	--	--	NC%	"	"	
Lead	"	ND	0.00017	0.0020	"	"	ND	--	--	--	NC%	"	"	
Antimony	"	ND	0.00040	0.0020	"	"	ND	--	--	--	NC%	"	"	
Chromium	"	0.000440	0.00037	0.0020	"	"	0.00042	--	--	--	6%	"	"	J
Nickel	"	0.000460	0.00022	0.0020	"	"	0.00047	--	--	--	2%	"	"	J
Selenium	"	ND	0.00034	0.0020	"	"	ND	--	--	--	NC%	"	"	
Barium	"	0.00763	0.00027	0.0060	"	"	0.0076	--	--	--	1%	"	"	
Cobalt	"	ND	0.00016	0.0020	"	"	ND	--	--	--	NC%	"	"	
Copper	"	0.000770	0.00015	0.0050	"	"	0.00076	--	--	--	2%	"	"	J
Silver	"	ND	0.00015	0.0020	"	"	ND	--	--	--	NC%	"	"	
Beryllium	"	ND	0.00026	0.0020	"	"	ND	--	--	--	NC%	"	"	
Thallium	"	ND	0.000060	0.0040	"	"	ND	--	--	--	NC%	"	"	
Vanadium	"	ND	0.00023	0.0020	"	"	ND	--	--	--	NC%	"	"	
Zinc	"	ND	0.0020	0.0070	"	"	ND	--	--	--	NC%	"	"	
Blank (580-50621-27)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Arsenic	6020 Total Recoverable	ND	0.00024	0.0020	mg/L	5x	--	--	--	--	--	--	09/21/09 08:28	
Cadmium	"	ND	0.00014	0.0020	"	"	--	--	--	--	--	--	"	
Lead	"	ND	0.00017	0.0020	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.00022	0.0020	"	"	--	--	--	--	--	--	"	
Antimony	"	ND	0.00040	0.0020	"	"	--	--	--	--	--	--	"	
Chromium	"	ND	0.00037	0.0020	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.00034	0.0020	"	"	--	--	--	--	--	--	"	
Barium	"	ND	0.00027	0.0060	"	"	--	--	--	--	--	--	"	
Cobalt	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
Copper	"	ND	0.00015	0.0050	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.00015	0.0020	"	"	--	--	--	--	--	--	"	
Beryllium	"	ND	0.00026	0.0020	"	"	--	--	--	--	--	--	"	
Thallium	"	ND	0.000060	0.0040	"	"	--	--	--	--	--	--	"	
Vanadium	"	ND	0.00023	0.0020	"	"	--	--	--	--	--	--	"	
Zinc	"	ND	0.0020	0.0070	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50621-34)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Lead	6020 Total Recoverable	1.02	0.0017	0.020	mg/L	50x	--	1.00	102%	(80-120)	--	--	09/21/09 09:05	
Arsenic	"	3.78	0.0024	0.020	"	"	--	4.00	94%	"	--	--	"	
Cadmium	"	0.101	0.0014	0.020	"	"	--	0.100	101%	"	--	--	"	
Nickel	"	0.974	0.0022	0.020	"	"	--	1.00	97%	"	--	--	"	
Chromium	"	0.386	0.0037	0.020	"	"	--	0.400	96%	"	--	--	"	
Antimony	"	2.86	0.0040	0.020	"	"	--	3.00	95%	"	--	--	"	
Cobalt	"	0.967	0.0016	0.020	"	"	--	1.00	97%	"	--	--	"	
Selenium	"	3.90	0.0034	0.020	"	"	--	4.00	98%	"	--	--	"	
Barium	"	4.18	0.0027	0.060	"	"	--	"	104%	"	--	--	"	
Beryllium	"	0.102	0.0026	0.020	"	"	--	0.100	102%	"	--	--	"	
Copper	"	0.490	0.0015	0.050	"	"	--	0.500	98%	"	--	--	"	
Silver	"	0.649	0.0015	0.020	"	"	--	0.600	108%	"	--	--	"	
Thallium	"	3.92	0.00060	0.040	"	"	--	4.00	98%	"	--	--	"	
Vanadium	"	0.980	0.0023	0.020	"	"	--	1.00	98%	"	--	--	"	
Zinc	"	0.966	0.020	0.070	"	"	--	"	97%	"	--	--	"	
LCS Dup (580-50621-35)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Arsenic	6020 Total Recoverable	3.70	0.0024	0.020	mg/L	50x	--	4.00	93%	(80-120)	2%	(20)	09/21/09 09:10	
Lead	"	1.00	0.0017	0.020	"	"	--	1.00	100%	"	1%	"	"	
Cadmium	"	0.107	0.0014	0.020	"	"	--	0.100	107%	"	5%	"	"	
Nickel	"	0.954	0.0022	0.020	"	"	--	1.00	95%	"	2%	"	"	
Chromium	"	0.383	0.0037	0.020	"	"	--	0.400	96%	"	1%	"	"	
Antimony	"	2.82	0.0040	0.020	"	"	--	3.00	94%	"	1%	"	"	
Cobalt	"	0.957	0.0016	0.020	"	"	--	1.00	96%	"	1%	"	"	
Selenium	"	3.80	0.0034	0.020	"	"	--	4.00	95%	"	3%	"	"	
Barium	"	4.15	0.0027	0.060	"	"	--	"	104%	"	1%	"	"	
Silver	"	0.657	0.0015	0.020	"	"	--	0.600	110%	"	1%	"	"	
Copper	"	0.475	0.0015	0.050	"	"	--	0.500	95%	"	3%	"	"	
Beryllium	"	0.109	0.0026	0.020	"	"	--	0.100	109%	"	6%	"	"	
Thallium	"	4.02	0.00060	0.040	"	"	--	4.00	100%	"	2%	"	"	
Vanadium	"	0.976	0.0023	0.020	"	"	--	1.00	98%	"	0%	"	"	
Zinc	"	0.918	0.020	0.070	"	"	--	"	92%	"	5%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50495 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50621-36)				**QC Source:**					**Extracted: 09/18/09 11:30**					
Cadmium	6020 Total Recoverable	0.100	0.0014	0.020	mg/L	50x	--	0.100	100%	(80-120)	--	--	09/21/09 09:16	
Lead	"	1.03	0.0017	0.020	"	"	--	1.00	103%	"	--	--	"	
Arsenic	"	3.75	0.0024	0.020	"	"	--	4.00	94%	"	--	--	"	
Antimony	"	2.90	0.0040	0.020	"	"	--	3.00	97%	"	--	--	"	
Nickel	"	0.970	0.0022	0.020	"	"	--	1.00	97%	"	--	--	"	
Chromium	"	0.394	0.0037	0.020	"	"	--	0.400	99%	"	--	--	"	
Selenium	"	3.86	0.0034	0.020	"	"	--	4.00	97%	"	--	--	"	
Cobalt	"	0.970	0.0016	0.020	"	"	--	1.00	97%	"	--	--	"	
Barium	"	4.21	0.0027	0.060	"	"	--	4.00	105%	"	--	--	"	
Silver	"	0.668	0.0015	0.020	"	"	--	0.600	111%	"	--	--	"	
Copper	"	0.489	0.0015	0.050	"	"	--	0.500	98%	"	--	--	"	
Beryllium	"	0.112	0.0026	0.020	"	"	--	0.100	112%	"	--	--	"	
Thallium	"	3.99	0.00060	0.040	"	"	--	4.00	100%	"	--	--	"	
Vanadium	"	0.998	0.0023	0.020	"	"	--	1.00	100%	"	--	--	"	
Zinc	"	0.961	0.020	0.070	"	"	--	"	96%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50020 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-52355-16)				**QC Source:**									**Extracted: 09/10/09 15:12**	
PCB-1232	8082 STD	ND	0.0041	0.050	ug/L	1x	--	--	--	--	--	--	10/20/09 16:38	
PCB-1016	"	ND	0.0045	0.050	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1221	"	ND	0.0062	0.050	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	0.0071	0.050	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	0.0044	0.050	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	0.0039	0.050	"	"	--	--	--	--	--	--	"	

QC Batch: 52716 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534817D)				**QC Source: SSI0032-22**									**Extracted: 10/12/09 15:10**	
PCB-1016	8082 STD	0.618	0.0044	0.049	ug/L	1x	ND	0.971	64%	(25-145)	5%	(27)	10/23/09 18:21	
PCB-1260	"	0.774	0.0038	0.049	"	"	ND	"	80%	(30-145)	7%	(22)	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 63%*			*Limits: 60-150%*	*"*							*10/23/09 18:21*	
DCB Decachlorobiphenyl			*58%*			*40-135%*	*"*						*"*	
Matrix Spike (1534817S)				**QC Source: SSI0032-22**									**Extracted: 10/12/09 15:10**	
PCB-1016	8082 STD	0.588	0.0042	0.047	ug/L	1x	ND	0.943	62%	(25-145)	--	--	10/23/09 18:06	
PCB-1260	"	0.724	0.0037	0.047	"	"	ND	"	77%	(30-145)	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 61%*			*Limits: 60-150%*	*"*							*10/23/09 18:06*	
DCB Decachlorobiphenyl			*58%*			*40-135%*	*"*						*"*	
Blank (580-52626-15)				**QC Source:**									**Extracted: 10/12/09 15:10**	
PCB-1016	8082 STD	ND	0.0045	0.050	ug/L	1x	--	--	--	--	--	--	10/23/09 14:44	
PCB-1232	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1221	"	ND	0.0062	0.050	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	0.0071	0.050	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	0.0044	0.050	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	0.0039	0.050	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 52716 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-52626-16)			**QC Source:**						**Extracted: 10/12/09 15:10**					
PCB-1016	8082 STD	0.624	0.0045	0.050	ug/L	1x	--	1.00	62%	(25-145)	--	--	10/23/09 14:59	
PCB-1260	"	0.766	0.0039	0.050	"	"	--	"	77%	(30-145)	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 63%*			*Limits: 60-150%*	"							*10/23/09 14:59*	
DCB Decachlorobiphenyl		*61%*			*40-135%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50020 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1534817D)					**QC Source: SSI0032-22**				**Extracted: 09/10/09 15:12**					
Naphthalene	8270C STD	0.799	0.0034	0.0094	ug/L	1x	ND	0.947	84%	(40-100)	3%	(30)	09/15/09 14:12	
2-Methylnaphthalene	"	0.909	0.0028	0.012	"	"	ND	0.946	96%	(45-105)	3%	"	"	
Benzo[a]anthracene	"	0.912	0.0023	0.0094	"	"	ND	"	96%	(55-110)	3%	"	"	
1-Methylnaphthalene	"	0.809	0.0011	0.0094	"	"	0.0049	0.945	85%	(50-150)	4%	"	"	
Acenaphthylene	"	0.855	0.0010	0.0094	"	"	0.0015	0.946	90%	(50-105)	1%	"	"	
Anthracene	"	0.805	0.00075	0.0094	"	"	0.0015	0.947	85%	(55-110)	1%	"	"	
Chrysene	"	0.833	0.0020	0.0094	"	"	ND	0.943	88%	"	3%	"	"	
Fluoranthene	"	0.881	0.0015	0.0094	"	"	0.0033	0.944	93%	(55-115)	4%	"	"	
Benzo[b]fluoranthene	"	0.778	0.0025	0.0094	"	"	ND	"	82%	(45-120)	3%	"	"	
Acenaphthene	"	0.806	0.00094	0.0094	"	"	0.0031	0.946	85%	(45-110)	2%	"	"	
Fluorene	"	0.881	0.0011	0.0094	"	"	0.0047	0.943	93%	(50-110)	0%	"	"	
Benzo[k]fluoranthene	"	0.723	0.0023	0.0094	"	"	ND	"	77%	(45-125)	2%	"	"	
Pyrene	"	0.845	0.0016	0.0094	"	"	0.0054	0.945	89%	(50-130)	4%	"	"	
Phenanthrene	"	0.828	0.0010	0.0094	"	"	0.0034	0.946	87%	(50-115)	2%	"	"	
Benzo[a]pyrene	"	0.810	0.0018	0.019	"	"	ND	0.947	86%	(55-110)	2%	"	"	
Indeno[1,2,3-cd]pyrene	"	0.773	0.0019	0.0094	"	"	ND	0.946	82%	(45-125)	2%	"	"	
Dibenz(a,h)anthracene	"	0.772	0.0017	0.0094	"	"	ND	0.943	82%	(40-125)	2%	"	"	
Benzo[g,h,i]perylene	"	0.741	0.0019	0.0094	"	"	ND	0.946	78%	"	3%	"	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 104%*			*Limits: 40-110%*	"							*09/15/09 14:12*	
2-Fluorobiphenyl			*84%*		*50-110%*	"							"	
Terphenyl-d14			*96%*		*50-135%*	"							"	
Matrix Spike (1534817S)					**QC Source: SSI0032-22**				**Extracted: 09/10/09 15:12**					
Naphthalene	8270C STD	0.774	0.0035	0.0098	ug/L	1x	ND	0.984	79%	(40-100)	--	--	09/15/09 13:52	
2-Methylnaphthalene	"	0.879	0.0029	0.013	"	"	ND	0.983	89%	(45-105)	--	--	"	
1-Methylnaphthalene	"	0.779	0.0012	0.0098	"	"	0.0049	0.982	79%	(50-150)	--	--	"	
Benzo[a]anthracene	"	0.883	0.0024	0.0098	"	"	ND	0.983	90%	(55-110)	--	--	"	
Acenaphthylene	"	0.848	0.0011	0.0098	"	"	0.0015	"	86%	(50-105)	--	--	"	
Anthracene	"	0.799	0.00078	0.0098	"	"	0.0015	0.984	81%	(55-110)	--	--	"	
Chrysene	"	0.805	0.0021	0.0098	"	"	ND	0.980	82%	"	--	--	"	
Acenaphthene	"	0.791	0.00098	0.0098	"	"	0.0031	0.983	80%	(45-110)	--	--	"	
Fluoranthene	"	0.844	0.0016	0.0098	"	"	0.0033	0.981	86%	(55-115)	--	--	"	
Benzo[b]fluoranthene	"	0.756	0.0025	0.0098	"	"	ND	"	77%	(45-120)	--	--	"	
Pyrene	"	0.810	0.0017	0.0098	"	"	0.0054	0.982	82%	(50-130)	--	--	"	
Fluorene	"	0.880	0.0012	0.0098	"	"	0.0047	0.980	89%	(50-110)	--	--	"	
Benzo[k]fluoranthene	"	0.712	0.0024	0.0098	"	"	ND	"	73%	(45-125)	--	--	"	
Phenanthrene	"	0.809	0.0011	0.0098	"	"	0.0034	0.983	82%	(50-115)	--	--	"	
Benzo[a]pyrene	"	0.796	0.0019	0.020	"	"	ND	0.984	81%	(55-110)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	0.757	0.0020	0.0098	"	"	ND	0.983	77%	(45-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50020 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1534817S)					**QC Source: SSI0032-22**				**Extracted: 09/10/09 15:12**					
Dibenz(a,h)anthracene	8270C STD	0.760	0.0018	0.0098	ug/L	1x	ND	0.980	77%	(40-125)	--	--	09/15/09 13:52	
Benzo[g,h,i]perylene	"	0.719	0.0020	0.0098	"	"	ND	0.983	73%	"	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 97%*			*Limits: 40-110%*	"							*09/15/09 13:52*	
2-Fluorobiphenyl		*79%*			*50-110%*	"							"	
Terphenyl-d14		*90%*			*50-135%*	"							"	
Blank (580-50233-5)					**QC Source:**				**Extracted: 09/10/09 15:12**					
Naphthalene	8270C STD	0.00511	0.0036	0.010	ug/L	1x	--	--	--	--	--	--	09/15/09 10:51	J
2-Methylnaphthalene	"	0.00488	0.0030	0.013	"	"	--	--	--	--	--	--	"	J
1-Methylnaphthalene	"	0.00299	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[a]anthracene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.0021	0.010	"	"	--	--	--	--	--	--	"	
Anthracene	"	0.00316	0.00080	0.010	"	"	--	--	--	--	--	--	"	J
Acenaphthylene	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	0.00345	0.0016	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[b]fluoranthene	"	ND	0.0026	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	0.00180	0.0010	0.010	"	"	--	--	--	--	--	--	"	J
Pyrene	"	0.00356	0.0017	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[k]fluoranthene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Fluorene	"	0.00279	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Phenanthrene	"	0.00532	0.0011	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[a]pyrene	"	ND	0.0019	0.020	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	0.0018	0.010	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 87%*			*Limits: 40-110%*	"							*09/15/09 10:51*	
2-Fluorobiphenyl		*71%*			*50-110%*	"							"	
Terphenyl-d14		*78%*			*50-135%*	"							"	
LCS (580-50233-6)					**QC Source:**				**Extracted: 09/10/09 15:12**					
Naphthalene	8270C STD	0.880	0.0036	0.010	ug/L	1x	--	1.00	88%	(40-100)	--	--	09/15/09 11:11	
2-Methylnaphthalene	"	0.991	0.0030	0.013	"	"	--	"	99%	(45-105)	--	--	"	
Benzo[a]anthracene	"	0.998	0.0024	0.010	"	"	--	"	100%	(55-110)	--	--	"	
1-Methylnaphthalene	"	0.879	0.0012	0.010	"	"	--	"	88%	(50-150)	--	--	"	
Acenaphthylene	"	0.972	0.0011	0.010	"	"	--	"	97%	(50-105)	--	--	"	
Chrysene	"	0.932	0.0021	0.010	"	"	--	"	93%	(55-110)	--	--	"	
Anthracene	"	0.930	0.00080	0.010	"	"	--	"	93%	"	--	--	"	
Fluoranthene	"	0.938	0.0016	0.010	"	"	--	"	94%	(55-115)	--	--	"	
Benzo[b]fluoranthene	"	0.882	0.0026	0.010	"	"	--	"	88%	(45-120)	--	--	"	
Acenaphthene	"	0.904	0.0010	0.010	"	"	--	"	90%	(45-110)	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50020 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50233-6)				**QC Source:**					**Extracted: 09/10/09 15:12**					
Pyrene	"	0.893	0.0017	0.010	"	"	--	"	89%	(50-130)	--	--	"	
Fluorene	"	1.01	0.0012	0.010	"	"	--	"	101%	(50-110)	--	--	"	
Benzo[k]fluoranthene	"	0.818	0.0024	0.010	"	"	--	"	82%	(45-125)	--	--	"	
Phenanthrene	"	0.919	0.0011	0.010	"	"	--	"	92%	(50-115)	--	--	"	
Benzo[a]pyrene	"	0.917	0.0019	0.020	"	"	--	"	91%	(55-110)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	0.872	0.0020	0.010	"	"	--	"	87%	(45-125)	--	--	"	
Dibenz(a,h)anthracene	"	0.874	0.0018	0.010	"	"	--	"	87%	(40-125)	--	--	"	
Benzo[g,h,i]perylene	"	0.827	0.0020	0.010	"	"	--	"	82%	"	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 111%*			*Limits: 40-110%*	"							*09/15/09 11:11*	*X*
2-Fluorobiphenyl		*88%*			*50-110%*	"							"	
Terphenyl-d14		*97%*			*50-135%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Method Performed: 6010B Dissolved
Samples: SSI0032-02, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08, SSI0032-20

Method Performed: 6010B TMP
Samples: SSI0032-05, SSI0032-10, SSI0032-11, SSI0032-12, SSI0032-13

Method Performed: 6010B Total Recoverable
Samples: SSI0032-01, SSI0032-02, SSI0032-03, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08, SSI0032-09, SSI0032-14, SSI0032-15, SSI0032-16, SSI0032-17, SSI0032-19, SSI0032-20, SSI0032-21, SSI0032-22, SSI0032-23

Method Performed: 6020 Dissolved
Samples: SSI0032-02, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08

Method Performed: 6020 Total Recoverable
Samples: SSI0032-01, SSI0032-02, SSI0032-03, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08, SSI0032-09, SSI0032-14, SSI0032-15, SSI0032-16, SSI0032-17, SSI0032-19, SSI0032-20, SSI0032-21, SSI0032-22, SSI0032-23

Method Performed: 7470A
Samples: SSI0032-01, SSI0032-02, SSI0032-03, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08, SSI0032-09, SSI0032-14, SSI0032-15, SSI0032-16, SSI0032-17, SSI0032-19, SSI0032-20, SSI0032-21, SSI0032-22, SSI0032-23

Method Performed: 7470A Dissolved
Samples: SSI0032-02, SSI0032-04, SSI0032-07, SSI0032-08

Method Performed: 7471A
Samples: SSI0032-05, SSI0032-10, SSI0032-11, SSI0032-12, SSI0032-13

Method Performed: 8082 STD
Samples: SSI0032-06, SSI0032-06RE1, SSI0032-06RE2, SSI0032-09, SSI0032-09RE1, SSI0032-14, SSI0032-14RE1, SSI0032-15, SSI0032-15RE1, SSI0032-16, SSI0032-16RE1, SSI0032-17, SSI0032-17RE1, SSI0032-19, SSI0032-19RE1, SSI0032-20, SSI0032-20RE1, SSI0032-21, SSI0032-21RE1, SSI0032-21RE2, SSI0032-22, SSI0032-22RE1, SSI0032-23, SSI0032-23RE1

Method Performed: 8270C STD
Samples: SSI0032-01, SSI0032-02, SSI0032-03, SSI0032-04, SSI0032-06, SSI0032-07, SSI0032-08, SSI0032-09, SSI0032-14, SSI0032-15, SSI0032-16, SSI0032-17, SSI0032-19, SSI0032-20, SSI0032-21, SSI0032-22, SSI0032-23

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Notes and Definitions

Report Specific Notes:

4	-	MS, MSD: The analyte present in the original sample is 4 times greater than the matrix spike concentration; therefore, control limits are not applicable.
B	-	Compound was found in the blank and sample.
C7	-	Calibration Verification recovery was below the method control limit due to matrix interference carried over from analytical samples. The matrix interference was confirmed by reanalysis with the same result.
F	-	MS or MSD exceeds the control limits
H	-	Sample analysis performed past method-specified holding time.
Ha	-	Sample was prepped or analyzed beyond the specified holding time
I	-	Indicates the presence of an interference, recovery is not calculated.
I01	-	Internal Standard recovery was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.
J	-	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
M1	-	The MS and/or MSD were above the acceptance limits due to sample matrix interference. See Blank Spike (LCS).
M2	-	The MS and/or MSD were below the acceptance limits due to sample matrix interference. See Blank Spike (LCS).
X	-	Surrogate exceeds the control limits
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
Z3	-	The sample required a dilution due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.
Reporting Limits	-	Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	11/19/09 15:16

Electronic Signature - Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy*. Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210 ☐
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 ☒
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210 ☐
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210 ☐

CHAIN OF CUSTODY REPORT

Work Order #: 550088

CLIENT: Golder Associates

INVOICE TO: Accounting (same address)

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200 Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498 cc: Kirsi Longley

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ☒ STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE					REQUESTED ANALYSES							MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
		HCl	—	—	HNO3	HNO3	NWTPH-Dx extended	PCB (8082A) low level	PAH * (8270SIM)	TAL metals total	TAL metals Dissolved						
1 G-HC1R-090409	9/4/09 900						X		X	X	Hold			W	5		-01
2 G-EW3-090409	9/4/09 1120						X		X	X	Hold			W	15	Extra volume ms/msd	-02
3 G-EW4-090409	9/4/09 1320						X		X	X	Hold			W	5		-03
4 G-EMW04-090409	9/4/09 1535						X		X	X	Hold			W	5		-04
5 G-P101OFP-090409	9/4/09 1730						X	X	X	X				LNAPL	1	**	-05
6 G-GA1-090509	9/5/09 940						X	X	X	X	Hold			W	7		-06
7 G-EMW05-090509	9/5/09 1125						X		X	X	Hold			W	5		-07
8 G-EMW06-090509	9/5/09 1325						X		X	X	Hold			W	5		-08
9 G-EB-090509	9/5/09 1400						X	X	X	X				W	6 7	9/7/09	-09
10 G-RS5FP-090509	9/5/09 1500						X	X	X	X				LNAPL		**	-10

RELEASED BY: [signature] DATE: 9/7/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 914

RECEIVED BY: [signature] DATE: 9/7/09
PRINT NAME: Chris Williams FIRM: TA Spokane TIME: 9:14

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier IV Data Package (EPA CLP deliverable). Project Specific Reporting Limits
*PAH analysis must include ~~naphth~~ naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of total metals.
** If LNAPL volume is insufficient for all analyses requested, prioritize the analysis as follows: PCB, PAH, Metals, TPH-Dx
#1 #2 #3 #4

TEMP: 3.1 °C

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 [X]
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #:

CLIENT: Golder Associates

INVOICE TO: Accounting (same address)

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200 Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498 cc: Kirsi Longley

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [10] STD. [7] [5] [4] [3] [2] [1] [<1]

Petroleum Hydrocarbon Analyses: [5] STD. [4] [3] [2] [1] [<1]

[OTHER] Specify:

* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: HCL | — | — | HNO3 | HNO3

REQUESTED ANALYSES

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	NWTPH-Dx extended	PCB (8082A) (low level)	PAH * (8270 SIM)	TAL metals (Total)	TAL Metals (Dissolved)	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-RS4FP-090509	9/5/09 1608	X	X	X	X		LNAPL	2	**	-11
2 G-RS3FP-090509	9/5/09 1635	X	X	X	X		LNAPL	1	**	-12
3 G-RS3aFP-090509	9/5/09 1700	X	X	X	X		LNAPL	1	**	-13
4 G-RS1SW-090509	9/6/09 945	X	X	X	X	Hold	W	7		-14
5 G-RS2SW-090609	9/6/09 1045	X	X	X	X	Hold	W	7		-15
6 G-RS3SW-090609	9/6/09 1200	X	X	X	X	Hold	W	7		-16
7 G-RSBDSW-090609	9/6/09 1140	X	X	X	X	Hold	W	7		-17
8 G-RS3SSW-090609	9/6/09 1145	X	X	X	X	Hold	W	7		-18
9 G-RS4SW-090609	9/6/09 1330	X	X	X	X	Hold	W	7		-19
10 G-RS5SW-090609	9/6/09 1400	X	X	X	X	Hold	W	7		-20

RELEASED BY: [signature] DATE: 9/7/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 914

RECEIVED BY: [signature] DATE: 9/7/09
PRINT NAME: Chris Williams FIRM: TA-Spokane TIME: 914

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier IV Data Package (EPA CLP deliverable). Project Specific Reporting Limits.
* PAH analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of total metals.
** If LNAPL volume is insufficient for all analyses requested, prioritize the analysis as follows: PCB #1, PAH #2, metals #3, TPH-Dx #4

TEMP:

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210 ☐
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 ☒
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210 ☐
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210 ☐

CHAIN OF CUSTODY REPORT

Work Order #:

CLIENT: Golder Associates

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200
Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498 cc: Kirsi Longley

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: ☒ 10 STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE					REQUESTED ANALYSES								MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
		HCL	—	—	HNO3	HNO3	NWTPH-Dx extended	PCB (8082A) low level	PAH * (8270 SIM)	TAL metals (Total)	TAL metals (Dissolved)							
1 G-RS6SW-090609	9/6/09 1450						X	X	X	X	Hold				W	7		-21
2 G-RS7SW-090609	9/6/09 1520						X	X	X	X	Hold				W	21	Extra volume MS/MSD	-22
3 G-RS8SW-090609	9/6/09 1625						X	X	X	X	Hold				W	7		-23
4																		
5																		
6																		
7																		
8																		
9																		
10																		

RELEASED BY: [signature] DATE: 9/7/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 914

RECEIVED BY: [signature] DATE: 9/7/09
PRINT NAME: Chris Willson FIRM: TA Spokane TIME: 914

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier ~~III~~ Data Package (EPA CLP deliverable).
* PAH Analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene
Hold dissolved metals bottles - pending analysis of total metals.
Project specific reporting limits.

TEMP:

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0032 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 09/01/09 09:14 Cooler signed for by: Chris Williams (Print name)

Preliminary Examination Phase:

Date cooler opened: [X] same as date received *or* ____/____/____

Cooler opened by (print) Chris Williams (sign) _____

1. Delivered by [ ] ALASKA AIRLINES [ ] Fed-Ex [ ] UPS [ ] NAC [ ] LYNDEN [ ] CLIENT [X] Other: Pickup courier

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 8 Signed by K. Langley Date 09/01/09

   Were custody seals unbroken and intact on arrival? [X] Yes [ ] No

3. Were custody papers sealed in a plastic bag? [ ] Yes [X] No

4. Were custody papers filled out properly (ink, signed, etc.)? [X] Yes [ ] No

5. Did you sign the custody papers in the appropriate place? [X] Yes [ ] No

6. Was ice used? [X] Yes [ ] No Type of ice: [ ] blue ice [ ] gel ice [X] real ice [ ] dry ice Condition of Ice: _____

   Temperature by IR Gun 3.1 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: [X] bubble wrap [ ] styrofoam [ ] cardboard [ ] Other: _____

8. Did samples arrive in plastic bags? [X] Yes [ ] No

9. Did all bottles arrive unbroken, and with labels in good condition? [X] Yes [ ] No

10. Are all bottle labels complete (ID, date, time, etc.) [X] Yes [ ] No

11. Do bottle labels and Chain of Custody agree? [ ] Yes [X] No Did not receive sample RB SSW and we received an extra container not listed on COC (MW05). RD

12. Are the containers and preservatives correct for the tests indicated? [X] Yes [ ] No

13. Is there adequate volume for the tests requested? [X] Yes [ ] No

14. Were VOA vials free of bubbles? [X] N/A [ ] Yes [ ] No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 09/01/09 RD

Samples logged in by (print) ~~Chris Williams~~ Randi Decker (sign) _____

1. Was project identifiable from custody papers? [X] Yes [ ] No

2. Do Turn Around Times and Due Dates agree? [X] Yes [ ] No

3. Was the Project Manager notified of status? [X] Yes [ ] No

4. Was the Lab notified of status? [X] Yes [ ] No

5. Was the COC scanned and copied? [X] Yes [ ] No

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **#SSI0032**
SAMPLES Collect:	MATRIX
See Attached Summary page	Soil & LNAPL Water

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA	BNA	Pest / PCB	TPH-Dx	PAH - SIM	OTHER	OTHER
1. Data Completeness			Θ	Θ	Θ		
2. Preservation, Holding Times			Θ	X[1]	Θ		
3.GC/MS Tune, Inst. Performance			–	–	Θ		
4. Calibrations			Θ	Θ	Θ		
5. Surrogates			X[2]	Θ	Θ		
6. Internal Standards			–	–	X[3]		
7. Lab Blanks, Field Blanks			Θ	Θ	X[4]		
8. Lab Duplicates, Field Duplicates			Θ	Θ	Θ		
9. LCS, Blank Spike, MS/MSD			Θ	Θ	Θ		
10.Compound Identification, TICs			Θ	Θ	Θ		
11. Result Verification, D.Limits			Θ	Θ	Θ		
12. Overall Summary			Θ	Θ	Θ		

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Sample 'B-6A1-090509' results qualif. (J/UJ) since past Hold time. (2) LNAPL Samples for PCB's had Low Surrog. recovery. Assoc. results qual. (J/UJ). Water sample -06 qualify (J/UJ) for same reason. (2) Single Surrog. out for select TPH & PAH samples – NO QUALIF. APPLIED.
(3) IS out of Limit Qualifies p-Terphenyl assoc. cmpds in LNAPL Samples -10 & -11 as estimated (J/UJ).
(4) Contaminants in M.Blank qual. assoc. Samples as 'U'.

Validated by: [signature] Date: Nov. 11, 2009

Reviewed by: Date:

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

	YES	NO
1. Date Package Completeness (Check if present).....	☑	☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ Detection Limits
- ✓ GC/MS Tuning
- ✓ Initial Calibration
- ✓ Continuing Calib.
- ✓ Blank Results
- ✓ Surrogate Results
- ✓ Internal Standards
- ✓ MS/MSD, LCS Results
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ Raw Data
- Other

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results:

2. Holding Times (Check all that apply)..... ☐ ☒

- ✓ Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection PAHs
- ✓ BNA samples extracted within 7 days (14 day soil) of collection
- BNA extracts analyzed within 40 days of collection
- ✓ Pest/PCBs samples extracted within 7 days (14 day soil) of collection
- Pest/PCBs extracts analyzed within 40 days of collection

Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: See Hold Time Summary Tables attached.

⊗ NWTPH-Dx results for -06RE1 (G-GA1-090509) qualif. J/UJ; H. Time @ 39 Days.

3. GC Instrument Tune, Performance Check ..... ☑ ☐

- ✓ GC/MS Tuning performed
- ✓ GC/MS Tuning within control limits
- GC/MS Tuning out of control limits, (qualify R/UR)
- Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
- PEM resolution <90% adj pks, (J for detects, UR other)
- DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
- Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results:

PAH: 9/13 ✓, 9/15 ✓, 9/17 ✓

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☑ ☐

GC/MS Data: ✓ ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
✓ ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__ Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__ Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: ✓ RSD<10% for performance checks (If no J detects)
✓ Stnds analyzed prior to analysis, & at proper frequency
X Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

x - PCB ccal out of limit high for select samples, All - ND, ∴ No Qual. applied!

5. Surrogates (Check all that apply)..... ☐ ☒

__ Surrogates analyzed
__ Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__ Recoveries above Method Control limits (J detects only)
__ Recoveries below Method Control limits but>20% (J/UJ)
__ Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results TPH-Dx (LNAPL) 2FBP↑ for -05 & -11. No Qual since these are Single surrogates. (WATER) ✓.
PAHs (LNAPL) Terphenyl↑ for -10 & -11. Single Surrg. out - No Qual. (WATER) Nitrobenz↑ for smpls -01, 04, -06. 2FBP↓ for -07. - No Qual.
⊗ PCBs (LNAPL) DCBP↓ in -5, -10, -11, -12. Associated results ⊗ qualif. (J/UJ). (WATER) TCMX & DCBP↓ in -06, & TCMX↓ in -21. Assoc. results Qualif (J/UJ).

6. Internal Standards Performance..... ☐ ☒

✓ Internal standards added to all QC and samples
✓ Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
*Associated with 12 Hour CCV Stnd.
✓ Internal standards out of Control limits but >10% (J/UJ)
__ Internal standards zero or <10% of Control limits (J/UR)
__ Internal standards RTs within +/-20 sec window (If no. J/UJ)

Comments/Qualified Results: ⊗ PAHs (LNAPL) IS out for -10, -11 assoc. w/ p-Terphenyl cmpnds qualif. (J/UJ). (WATER) ✓.

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☐ ☒

__Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

Examples:

	BLANK		SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

TPH Dx - (Water) MB0104, MB0121
(LNAPL) MB0118 / MB0094

PCBs (LNAPL) MB0119
(Water) MB 335/16, 626/15

PAHs (LNAPL) MB0081
(WATER) 233/5 - Naph, 2MNaph, 1MNaph, Anthrac, Fluoran, Acen, Pyrene, Fluoren, Phenanth detected in MB. Assoc. samples qualif. 'U'

8. Duplicate, Field Duplicates (Check all that apply)..... ☑ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results TPH: (WATER) LCS/LCSD MS/MSD -20, -22: 9/18 LCS/LCSD. 10/15 LCS/LCSD

PCB: MS/MSD on -05; #52716

PAH: MS/MSD on -11; (WATER): 50020 Batch,

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply).... ☑ ☐

__LCS %R 80-120%
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: TPH (LNAPL) #00118 LCS, MS/MSD; (WATER) #0104 LCS/LCSD, MS/MSD on -20, -22. 9/18 #0118 0121. 10/15 #0094
PCB (LNAPL) LCS, MS/MSD on -05 PCB-1016 ↑recovery & assoc. ~~detects (qualif. (J))~~. sample has no Detects NO Qual. (WATER) LCS, MS/MSD on -22. PAHs (LNAPL) LCS, MS/MSD on -11 Fluorene ↑ qual. (J). (WATER) LCS 9/15, MS/MSD on -22.

	Acceptable: Yes	NO
10.Compound Identification, TICs	☑	☐

Comments/Qualified Results: _____

	Acceptable: Yes	NO
11. Result Verification, Detection Limits	☑	☐

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: _____

	Acceptable: Yes	NO
12. Overall Assessment	☑	☐

Comments/Qualified Results: _____

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-HC1R-090409	SSI0032-01	Water	09/04/09 09:00	09/07/09 09:14
G-EW3-090409	SSI0032-02	Water	09/04/09 11:20	09/07/09 09:14
G-EW4-090409	SSI0032-03	Water	09/04/09 13:20	09/07/09 09:14
G-EMW04-090409	SSI0032-04	Water	09/04/09 15:35	09/07/09 09:14
G-P101OFP-090409	SSI0032-05	Other (L)	09/04/09 17:30	09/07/09 09:14
G-GA1-090509	SSI0032-06	Water	09/05/09 09:40	09/07/09 09:14
G-EMW05-090509	SSI0032-07	Water	09/05/09 11:25	09/07/09 09:14
G-EMW06-090509	SSI0032-08	Water	09/05/09 13:25	09/07/09 09:14
G-EB-090509	SSI0032-09	Water	09/05/09 14:00	09/07/09 09:14
G-RS5FP-090509	SSI0032-10	Other (L)	09/05/09 15:00	09/07/09 09:14
G-RS4FP-090509	SSI0032-11	Other (L)	09/05/09 16:08	09/07/09 09:14
G-RS3FP-090509	SSI0032-12	Other (L)	09/05/09 16:35	09/07/09 09:14
G-RS3aFP-090509	SSI0032-13	Other (L)	09/05/09 17:00	09/07/09 09:14
G-RS1SW-090609	SSI0032-14	Water	09/06/09 09:45	09/07/09 09:14
G-RS2SW-090609	SSI0032-15	Water	09/06/09 10:45	09/07/09 09:14
G-RS3SW-090609	SSI0032-16	Water	09/06/09 12:00	09/07/09 09:14
G-RS3DSW-090609	SSI0032-17	Water	09/06/09 11:40	09/07/09 09:14
G-RS4SW-090609	SSI0032-19	Water	09/06/09 13:30	09/07/09 09:14
G-RS5SW-090609	SSI0032-20	Water	09/06/09 14:00	09/07/09 09:14
G-RS6SW-090609	SSI0032-21	Water	09/06/09 14:50	09/07/09 09:14
G-RS7SW-090609	SSI0032-22	Water	09/06/09 15:20	09/07/09 09:14
G-RS8SW-090609	SSI0032-23	Water	09/06/09 16:25	09/07/09 09:14

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 17:17	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*109%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*51%*		*50 - 110 %*	"			"	
Terphenyl-d14			*103%*		*50 - 135 %*	"			"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Naphthalene	8270C STD	**0.021**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:32	
2-Methylnaphthalene	"	**0.013**	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0098**	*0.0011*	0.0094	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.0012**	*0.00075*	0.0094	"	"	"	"	"	J
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.038**	*0.00094*	0.0094	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0019**	*0.0015*	0.0094	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.0034**	*0.0011*	0.0094	"	"	"	"	"	J
Pyrene	"	ND	*0.0016*	0.0094	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0047**	*0.0010*	0.0094	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*103%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*86%*		*50 - 110 %*	"			"	
Terphenyl-d14			*105%*		*50 - 135 %*	"			"	
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Naphthalene	8270C STD	ND	*0.0035*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:52	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0024**	*0.0012*	0.0096	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.0096	"	"	"	"	"	
Anthracene	"	**0.0011**	*0.00077*	0.0096	"	"	"	"	"	J
Chrysene	"	ND	*0.0020*	0.0096	"	"	"	"	"	
Acenaphthene	"	**0.0012**	*0.00096*	0.0096	"	"	"	"	"	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:52	
Fluoranthene	"	**0.0020**	*0.0015*	0.0096	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Fluorene	"	**0.0026**	*0.0012*	0.0096	"	"	"	"	"	J
Pyrene	"	ND	*0.0016*	0.0096	"	"	"	"	"	
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0040**	*0.0011*	0.0096	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0096	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*103%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*87%*		*50 - 110 %*	"			"	
Terphenyl-d14			*102%*		*50 - 135 %*	"			"	
SSI0032-15 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
Naphthalene	8270C STD	ND	*0.0036*	0.0099	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:17	
2-Methylnaphthalene	"	ND	*0.0030*	0.013	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0016~~	*0.0012*	0.0099 U	"	"	"	"	"	J,B
Benzo[a]anthracene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.0099	"	"	"	"	"	
Anthracene	"	~~0.0013~~	*0.00079*	0.0099 U	"	"	"	"	"	J,B
Chrysene	"	ND	*0.0021*	0.0099	"	"	"	"	"	
Acenaphthene	"	~~0.0011~~	*0.00099*	0.0099 U	"	"	"	"	"	J,B
Benzo[b]fluoranthene	"	ND	*0.0026*	0.0099	"	"	"	"	"	
Fluoranthene	"	~~0.0031~~	*0.0016*	0.0099 U	"	"	"	"	"	J,B
Benzo[k]fluoranthene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Fluorene	"	~~0.0023~~	*0.0012*	0.0099 U	"	"	"	"	"	J,B
Pyrene	"	~~0.0036~~	*0.0017*	0.0099 U	"	"	"	"	"	J,B
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	~~0.0054~~	*0.0011*	0.0099 U	"	"	"	"	"	J,B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0018*	0.0099	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*92%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*80%*		*50 - 110 %*	"			"	
Terphenyl-d14			*92%*		*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:38	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0055~~	*0.0011*	0.0094 U	"	"	"	"	"	J,B
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	~~0.0015~~	*0.00075*	0.0094 U	"	"	"	"	"	J,B
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	~~0.0039~~	*0.00094*	0.0094 U	"	"	"	"	"	J,B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	~~0.0026~~	*0.0015*	0.0094 U	"	"	"	"	"	J,B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	~~0.0046~~	*0.0011*	0.0094 U	"	"	"	"	"	J,B
Pyrene	"	~~0.0017~~	*0.0016*	0.0094 U	"	"	"	"	"	J,B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	~~0.0069~~	*0.0010*	0.0094 U	"	"	"	"	"	J,B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*104%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*90%*			*50 - 110 %*	"			"	
Terphenyl-d14		*108%*			*50 - 135 %*	"			"	
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Naphthalene	8270C STD	ND	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 18:58	
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0061~~	*0.0011*	0.0094 U	"	"	"	"	"	J,B
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	~~0.0016~~	*0.00075*	0.0094 U	"	"	"	"	"	J,B
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	~~0.0029~~	*0.00094*	0.0094 U	"	"	"	"	"	J,B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	~~0.0028~~	*0.0015*	0.0094 U	"	"	"	"	"	J,B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	~~0.0040~~	*0.0011*	0.0094 U	"	"	"	"	"	J,B
Pyrene	"	~~0.0027~~	*0.0016*	0.0094 U	"	"	"	"	"	J,B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	~~0.0063~~	*0.0010*	0.0094 U	"	"	"	"	"	J,B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-17 (G-RS3DSW-090609)		**Water**			**Sampled: 09/06/09 11:40**					
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*106%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*91%*			*50 - 110 %*	"			"	
Terphenyl-d14		*107%*			*50 - 135 %*	"			"	
SSI0032-19 (G-RS4SW-090609)		**Water**			**Sampled: 09/06/09 13:30**					
Naphthalene	8270C STD	~~0.0076~~	*0.0036*	0.0099	U ug/L	1x	50020	09/10/09 15:12	09/15/09 19:18	~~J,B~~
2-Methylnaphthalene	"	~~0.011~~	*0.0030*	0.013	U "	"	"	"	"	~~J,B~~
1-Methylnaphthalene	"	**0.11**	*0.0012*	0.0099	"	"	"	"	"	~~B~~
Benzo[a]anthracene	"	**0.0077**	*0.0024*	0.0099	"	"	"	"	"	J
Acenaphthylene	"	**0.0094**	*0.0011*	0.0099	"	"	"	"	"	J
Anthracene	"	**0.021**	*0.00079*	0.0099	"	"	"	"	"	~~B~~
Chrysene	"	**0.015**	*0.0021*	0.0099	"	"	"	"	"	
Acenaphthene	"	**0.044**	*0.00099*	0.0099	"	"	"	"	"	~~B~~
Benzo[b]fluoranthene	"	ND	*0.0026*	0.0099	"	"	"	"	"	
Fluoranthene	"	**0.017**	*0.0016*	0.0099	"	"	"	"	"	~~B~~
Benzo[k]fluoranthene	"	ND	*0.0024*	0.0099	"	"	"	"	"	
Fluorene	"	**0.13**	*0.0012*	0.0099	"	"	"	"	"	~~B~~
Pyrene	"	**0.039**	*0.0017*	0.0099	"	"	"	"	"	~~B~~
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	**0.21**	*0.0011*	0.0099	"	"	"	"	"	~~B~~
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0018*	0.0099	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.0099	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*99%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*84%*			*50 - 110 %*	"			"	
Terphenyl-d14		*104%*			*50 - 135 %*	"			"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-20 (G-RS5SW-090609)		**Water**			**Sampled: 09/06/09 14:00**					
Naphthalene	8270C STD	**0.054**	*0.0039*	0.011	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:32	
2-Methylnaphthalene	"	**0.013**	*0.0032*	0.014	"	"	"	"	"	J
1-Methylnaphthalene	"	**0.21**	*0.0013*	0.011	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0026*	0.011	"	"	"	"	"	
Acenaphthylene	"	**0.0071**	*0.0012*	0.011	"	"	"	"	"	J
Anthracene	"	**0.0049**	*0.00086*	0.011	"	"	"	"	"	J
Chrysene	"	ND	*0.0023*	0.011	"	"	"	"	"	
Acenaphthene	"	**0.059**	*0.0011*	0.011	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0028*	0.011	"	"	"	"	"	
Fluoranthene	"	**0.0038**	*0.0017*	0.011	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0026*	0.011	"	"	"	"	"	
Fluorene	"	**0.097**	*0.0013*	0.011	"	"	"	"	"	
Pyrene	"	**0.0049**	*0.0018*	0.011	"	"	"	"	"	J
Benzo[a]pyrene	"	ND	*0.0021*	0.022	"	"	"	"	"	
Phenanthrene	"	**0.035**	*0.0012*	0.011	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0022*	0.011	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0019*	0.011	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0022*	0.011	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*95%*		*40 - 110 %*	"				"	
2-Fluorobiphenyl		*73%*		*50 - 110 %*	"				"	
Terphenyl-d14		*101%*		*50 - 135 %*	"				"	
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Naphthalene	8270C STD	ND	*0.0036*	0.010	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:52	
2-Methylnaphthalene	"	ND	*0.0030*	0.013	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0056**	*0.0012*	0.010	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0024*	0.010	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0011*	0.010	"	"	"	"	"	
Anthracene	"	**0.0015**	*0.00080*	0.010	"	"	"	"	"	J
Chrysene	"	ND	*0.0021*	0.010	"	"	"	"	"	
Acenaphthene	"	**0.0025**	*0.0010*	0.010	"	"	"	"	"	J
Benzo[b]fluoranthene	"	ND	*0.0026*	0.010	"	"	"	"	"	
Fluoranthene	"	**0.0025**	*0.0016*	0.010	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0024*	0.010	"	"	"	"	"	
Fluorene	"	**0.0045**	*0.0012*	0.010	"	"	"	"	"	J
Pyrene	"	**0.0022**	*0.0017*	0.010	"	"	"	"	"	J
Benzo[a]pyrene	"	ND	*0.0019*	0.020	"	"	"	"	"	
Phenanthrene	"	**0.0085**	*0.0011*	0.010	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0020*	0.010	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0018*	0.010	ug/L	1x	50020	09/10/09 15:12	09/17/09 17:52	
Benzo[g,h,i]perylene	"	ND	*0.0020*	0.010	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*104%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*90%*		*50 - 110 %*	"			"	
Terphenyl-d14			*104%*		*50 - 135 %*	"			"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
Naphthalene	8270C STD	ND	*0.0034*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/15/09 13:32	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0049~~	*0.0011*	0.0095 U	"	"	"	"	"	~~J,B~~
Benzo[a]anthracene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Acenaphthylene	"	**0.0015**	*0.0010*	0.0095	"	"	"	"	"	J
Anthracene	"	~~0.0015~~	*0.00076*	0.0095 U	"	"	"	"	"	~~J,B~~
Chrysene	"	ND	*0.0020*	0.0095	"	"	"	"	"	
Acenaphthene	"	~~0.0051~~	*0.00095*	0.0095 U	"	"	"	"	"	~~J,B~~
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0095	"	"	"	"	"	
Fluoranthene	"	~~0.0033~~	*0.0015*	0.0095 U	"	"	"	"	"	~~J,B~~
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Fluorene	"	~~0.0047~~	*0.0011*	0.0095 U	"	"	"	"	"	~~J,B~~
Pyrene	"	~~0.0054~~	*0.0016*	0.0095 U	"	"	"	"	"	~~J,B~~
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	~~0.0034~~	*0.0010*	0.0095 U	"	"	"	"	"	~~J,B~~
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5			*104%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*89%*		*50 - 110 %*	"			"	
Terphenyl-d14			*95%*		*50 - 135 %*	"			"	
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Naphthalene	8270C STD	ND	*0.0034*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:12	
2-Methylnaphthalene	"	ND	*0.0029*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0041**	*0.0011*	0.0095	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0095	"	"	"	"	"	
Anthracene	"	**0.0011**	*0.00076*	0.0095	"	"	"	"	"	J
Chrysene	"	ND	*0.0020*	0.0095	"	"	"	"	"	
Acenaphthene	"	**0.0017**	*0.00095*	0.0095	"	"	"	"	"	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0095	ug/L	1x	50020	09/10/09 15:12	09/17/09 18:12	
Fluoranthene	"	**0.0022**	*0.0015*	0.0095	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0095	"	"	"	"	"	
Fluorene	"	**0.0026**	*0.0011*	0.0095	"	"	"	"	"	J
Pyrene	"	**0.0023**	*0.0016*	0.0095	"	"	"	"	"	J
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0033**	*0.0010*	0.0095	"	"	"	"	"	J
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0095	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0095	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*105%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*95%*			*50 - 110 %*	"			"	
Terphenyl-d14		*111%*			*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					
1-Methylnapthalene	EPA 8270 mod.	**114**	----	2.88	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 18:25	
2-Methylnaphthalene	"	**48.3**	----	2.88	"	"	"	"	"	
Acenaphthene	"	**29.2**	----	2.88	"	"	"	"	"	
Acenaphthylene	"	ND	----	2.88	"	"	"	"	"	
Anthracene	"	**33.5**	----	2.88	"	"	"	"	"	
Benzo (a) anthracene	"	**4.42**	----	2.88	"	"	"	"	"	
Benzo (a) pyrene	"	**4.62**	----	2.88	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	2.88	"	"	"	"	"	
Benzo (ghi) perylene	"	**14.0**	----	2.88	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	2.88	"	"	"	"	"	
Chrysene	"	**9.04**	----	2.88	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**9.62**	----	2.88	"	"	"	"	"	
Fluoranthene	"	**8.27**	----	2.88	"	"	"	"	"	
Fluorene	"	**45.6**	----	2.88	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**10.2**	----	2.88	"	"	"	"	"	
Naphthalene	"	**13.3**	----	2.88	"	"	"	"	"	
Phenanthrene	"	**88.8**	----	2.88	"	"	"	"	"	
Pyrene	"	**22.7**	----	2.88	"	"	"	"	"	
Surrogate(s): 2-FBP			*104%*		*34.5 - 148 %*	"			"	
Nitrobenzene-d5			*103%*		*33 - 141 %*	"			"	
p-Terphenyl-d14			*120%*		*37.8 - 150 %*	"			"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
1-Methylnapthalene	EPA 8270 mod.	**15.3**	----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 23:47	
2-Methylnaphthalene	"	ND	----	3.06	"	"	"	"	"	
Acenaphthene	"	**33.1**	----	3.06	"	"	"	"	"	
Acenaphthylene	"	ND	----	3.06	"	"	"	"	"	
Anthracene	"	**96.9**	----	3.06	"	"	"	"	"	
Benzo (a) anthracene	"	**19.2** J	----	3.06	"	"	"	"	"	I01
Benzo (a) pyrene	"	**8.57**	----	3.06	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	3.06	"	"	"	"	"	
Benzo (ghi) perylene	"	**9.59**	----	3.06	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	3.06	"	"	"	"	"	
Chrysene	"	**45.7** J	----	3.06	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**4.29**	----	3.06	"	"	"	"	"	
Fluoranthene	"	**9.18**	----	3.06	"	"	"	"	"	
Fluorene	"	**86.3**	----	3.06	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**4.49**	----	3.06	"	"	"	"	"	
Naphthalene	"	ND	----	3.06	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Phenanthrene	EPA 8270 mod.	**205**	----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 23:47	
Pyrene	"	**118**	----	3.06	"	"	"	"	"	I01
Surrogate(s): 2-FBP		*97.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*93.4%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*142%*			*37.8 - 150 %*	"			"	*I01*
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
1-Methylnapthalene	EPA 8270 mod.	**328**	----	3.06	mg/kg	1x	9090081	09/11/09 13:20	09/14/09 00:08	
2-Methylnaphthalene	"	**35.3**	----	3.06	"	"	"	"	"	
Acenaphthene	"	**100**	----	3.06	"	"	"	"	"	
Acenaphthylene	"	ND	----	3.06	"	"	"	"	"	
Anthracene	"	**120**	----	3.06	"	"	"	"	"	
Benzo (a) anthracene	"	ND UJ	----	3.06	"	"	"	"	"	I01
Benzo (a) pyrene	"	**11.0** J	----	3.06	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND UJ	----	3.06	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**12.2** J	----	3.06	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND UJ	----	3.06	"	"	"	"	"	I01
Chrysene	"	**50.6** J	----	3.06	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**4.90** J	----	3.06	"	"	"	"	"	I01
Fluoranthene	"	**15.1**	----	3.06	"	"	"	"	"	
Fluorene	"	**178** J	----	3.06	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**3.88** J	----	3.06	"	"	"	"	"	I01
Naphthalene	"	ND	----	3.06	"	"	"	"	"	
Phenanthrene	"	**292**	----	3.06	"	"	"	"	"	
Pyrene	"	**161** J	----	3.06	"	"	"	"	"	I01
Surrogate(s): 2-FBP		*88.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*65.8%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*170%*			*37.8 - 150 %*	"			"	*I01, ZX*
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
1-Methylnapthalene	EPA 8270 mod.	**63.1**	----	3.12	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 20:55	
2-Methylnaphthalene	"	ND	----	3.12	"	"	"	"	"	
Acenaphthene	"	**30.2**	----	3.12	"	"	"	"	"	
Acenaphthylene	"	ND	----	3.12	"	"	"	"	"	
Anthracene	"	**50.4**	----	3.12	"	"	"	"	"	
Benzo (a) anthracene	"	**10.4**	----	3.12	"	"	"	"	"	
Benzo (a) pyrene	"	**3.96**	----	3.12	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	3.12	"	"	"	"	"	
Benzo (ghi) perylene	"	**3.12**	----	3.12	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					
Benzo (k) fluoranthene	EPA 8270 mod.	ND	----	3.12	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 20:55	
Chrysene	"	**23.1**	----	3.12	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	3.12	"	"	"	"	"	
Fluoranthene	"	**9.38**	----	3.12	"	"	"	"	"	
Fluorene	"	**45.6**	----	3.12	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	3.12	"	"	"	"	"	
Naphthalene	"	**7.29**	----	3.12	"	"	"	"	"	
Phenanthrene	"	**84.0**	----	3.12	"	"	"	"	"	
Pyrene	"	**55.8**	----	3.12	"	"	"	"	"	
Surrogate(s): 2-FBP		*95.4%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*101%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*133%*			*37.8 - 150 %*	"			"	
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					
1-Methylnapthalene	EPA 8270 mod.	**47.6**	----	2.73	mg/kg	1x	9090081	09/11/09 13:20	09/13/09 19:08	
2-Methylnaphthalene	"	**45.6**	----	2.73	"	"	"	"	"	
Acenaphthene	"	**16.5**	----	2.73	"	"	"	"	"	
Acenaphthylene	"	ND	----	2.73	"	"	"	"	"	
Anthracene	"	**20.2**	----	2.73	"	"	"	"	"	
Benzo (a) anthracene	"	**3.27**	----	2.73	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	2.73	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	2.73	"	"	"	"	"	
Benzo (ghi) perylene	"	**3.64**	----	2.73	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	2.73	"	"	"	"	"	
Chrysene	"	**7.27**	----	2.73	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**2.73**	----	2.73	"	"	"	"	"	
Fluoranthene	"	**4.00**	----	2.73	"	"	"	"	"	
Fluorene	"	**25.3**	----	2.73	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**2.91**	----	2.73	"	"	"	"	"	
Naphthalene	"	**6.91**	----	2.73	"	"	"	"	"	
Phenanthrene	"	**47.8**	----	2.73	"	"	"	"	"	
Pyrene	"	**15.3**	----	2.73	"	"	"	"	"	
Surrogate(s): 2-FBP		*104%*			*34.5 - 148 %*	"			"	
Nitrobenzene-d5		*104%*			*33 - 141 %*	"			"	
p-Terphenyl-d14		*110%*			*37.8 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

LNAPL Sample

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-05 (G-P101OFP-090409)		**Other (L)**				**Sampled: 09/04/09 17:30**					C7
PCB-1016	EPA 8082	ND	UJ	----	0.943	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 18:14	
PCB-1221	"	ND		----	0.943	"	"	"	"	"	
PCB-1232	"	ND		----	0.943	"	"	"	"	"	
PCB-1242	"	ND		----	0.943	"	"	"	"	"	
PCB-1248	"	ND		----	0.943	"	"	"	"	"	
PCB-1254	"	ND		----	0.943	"	"	"	"	"	
PCB-1260	"	ND		----	0.943	"	"	"	"	"	
Surrogate(s): *TCX*		*83.6%*				*50 - 150 %*	"			"	
Decachlorobiphenyl		*41.0%*				*50 - 150 %*	"			"	Z
SSI0032-10 (G-RS5FP-090509)		**Other (L)**				**Sampled: 09/05/09 15:00**					C7
PCB-1016	EPA 8082	ND	UJ	----	0.962	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 18:37	
PCB-1221	"	ND		----	0.962	"	"	"	"	"	
PCB-1232	"	ND		----	0.962	"	"	"	"	"	
PCB-1242	"	ND		----	0.962	"	"	"	"	"	
PCB-1248	"	ND		----	0.962	"	"	"	"	"	
PCB-1254	"	ND		----	0.962	"	"	"	"	"	
PCB-1260	"	ND		----	0.962	"	"	"	"	"	
Surrogate(s): *TCX*		*79.2%*				*50 - 150 %*	"			"	
Decachlorobiphenyl		*38.8%*				*50 - 150 %*	"			"	Z
SSI0032-11 (G-RS4FP-090509)		**Other (L)**				**Sampled: 09/05/09 16:08**					C7
PCB-1016	EPA 8082	ND	UJ	----	0.980	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:00	
PCB-1221	"	ND		----	0.980	"	"	"	"	"	
PCB-1232	"	ND		----	0.980	"	"	"	"	"	
PCB-1242	"	ND		----	0.980	"	"	"	"	"	
PCB-1248	"	ND		----	0.980	"	"	"	"	"	
PCB-1254	"	ND		----	0.980	"	"	"	"	"	
PCB-1260	"	ND		----	0.980	"	"	"	"	"	
Surrogate(s): *TCX*		*86.9%*				*50 - 150 %*	"			"	
Decachlorobiphenyl		*34.9%*				*50 - 150 %*	"			"	Z

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:35**					C7
PCB-1016	EPA 8082	ND UJ	----	0.877	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:22	
PCB-1221	"	ND	----	0.877	"	"	"	"	"	
PCB-1232	"	ND	----	0.877	"	"	"	"	"	
PCB-1242	"	ND	----	0.877	"	"	"	"	"	
PCB-1248	"	ND	----	0.877	"	"	"	"	"	
PCB-1254	"	ND	----	0.877	"	"	"	"	"	
PCB-1260	"	ND	----	0.877	"	"	"	"	09/18/09 19:45	
Surrogate(s): *TCX*		*80.8%*			*50 - 150 %*	"			*09/18/09 19:22*	
Decachlorobiphenyl		*48.6%*			*50 - 150 %*	"			"	Z
SSI0032-13 (G-RS3aFP-090509)		**Other (L)**			**Sampled: 09/05/09 17:00**					C7
PCB-1016	EPA 8082	ND	----	2.38	mg/kg	1x	9090119	09/18/09 08:06	09/18/09 19:45	
PCB-1221	"	ND	----	2.38	"	"	"	"	"	
PCB-1232	"	ND	----	2.38	"	"	"	"	"	
PCB-1242	"	ND	----	2.38	"	"	"	"	"	
PCB-1248	"	ND	----	2.38	"	"	"	"	"	
PCB-1254	"	ND	----	2.38	"	"	"	"	"	
PCB-1260	"	ND	----	2.38	"	"	"	"	09/18/09 20:08	
Surrogate(s): *TCX*		*76.2%*			*50 - 150 %*	"			*09/18/09 19:45*	
Decachlorobiphenyl		*50.3%*			*50 - 150 %*	"			"	

OK 11-10-09

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:57	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
SSI0032-21RE1 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
PCB-1016	8082 STD	ND	*0.045*	0.50	ug/L	1x	51857	10/12/09 15:10	10/13/09 19:35	
PCB-1232	"	ND	*0.041*	0.50	"	"	"	"	"	
PCB-1221	"	ND	*0.062*	0.50	"	"	"	"	"	
PCB-1242	"	ND	*0.041*	0.50	"	"	"	"	"	
PCB-1248	"	ND	*0.071*	0.50	"	"	"	"	"	
PCB-1254	"	ND	*0.044*	0.50	"	"	"	"	"	
PCB-1260	"	ND	*0.039*	0.50	"	"	"	"	"	
SSI0032-21RE2 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
PCB-1016	8082 STD	ND UJ	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:34	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*56%*		*60 - 150 %*	"			"	X
DCB Decachlorobiphenyl			*53%*		*40 - 135 %*	"			"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 19:28	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-22RE1 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
PCB-1016	8082 STD	ND	*0.0044*	0.049	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:50	
PCB-1232	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.049	"	"	"	"	"	
PCB-1242	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1248	"	ND	*0.0069*	0.049	"	"	"	"	"	
PCB-1254	"	ND	*0.0043*	0.049	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.049	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*61%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*61%*		*40 - 135 %*	"			"	
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 19:44	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
SSI0032-23RE1 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 18:36	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*68%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*66%*		*40 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 16:53	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-06RE1 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
PCB-1016	8082 STD	ND	*0.042*	0.47	ug/L	1x	51857	10/12/09 15:10	10/13/09 17:16	
PCB-1232	"	ND	*0.039*	0.47	"	"	"	"	"	
PCB-1221	"	ND	*0.058*	0.47	"	"	"	"	"	
PCB-1242	"	ND	*0.039*	0.47	"	"	"	"	"	
PCB-1248	"	ND	*0.067*	0.47	"	"	"	"	"	
PCB-1254	"	ND	*0.042*	0.47	"	"	"	"	"	
PCB-1260	"	ND	*0.037*	0.47	"	"	"	"	"	
SSI0032-06RE2 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
PCB-1016	8082 STD	ND UJ	*0.0042*	0.047	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:15	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*59%*		*60 - 150 %*	"			"	X
DCB Decachlorobiphenyl			*33%*		*40 - 135 %*	"			"	X
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:09	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-09RE1 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:30	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.048	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*69%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*66%*		*40 - 135 %*	"			"	
SSI0032-14 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:24	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.048	"	"	"	"	"	
SSI0032-14RE1 (G-RS1SW-090609)		**Water**			**Sampled: 09/06/09 09:45**					
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 15:46	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0062*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0071*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*63%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*62%*		*40 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-15 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:40	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
SSI0032-15RE1 (G-RS2SW-090609)		**Water**			**Sampled: 09/06/09 10:45**					
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:01	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*72%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*67%*		*40 - 135 %*	"			"	
SSI0032-16 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 17:55	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-16RE1 (G-RS3SW-090609)		**Water**			**Sampled: 09/06/09 12:00**					
PCB-1016	8082 STD	ND	*0.0044*	0.049	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:17	
PCB-1232	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1221	"	ND	*0.0060*	0.049	"	"	"	"	"	
PCB-1242	"	ND	*0.0040*	0.049	"	"	"	"	"	
PCB-1248	"	ND	*0.0069*	0.049	"	"	"	"	"	
PCB-1254	"	ND	*0.0043*	0.049	"	"	"	"	"	
PCB-1260	"	ND	*0.0038*	0.049	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*67%*		*60 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-16RE1 (G-RS3SW-090609)		**Water**				**Sampled: 09/06/09 12:00**				
DCB Decachlorobiphenyl		*61%*			*40 - 135 %*	*1x*			*10/23/09 16:17*	
SSI0032-17 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:11	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
SSI0032-17RE1 (G-RS3DSW-090609)		**Water**				**Sampled: 09/06/09 11:40**				
PCB-1016	8082 STD	ND	*0.0043*	0.048	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:32	
PCB-1232	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1221	"	ND	*0.0059*	0.048	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.048	"	"	"	"	"	
PCB-1248	"	ND	*0.0068*	0.048	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.048	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.048	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*		*71%*			*60 - 150 %*	"			"	
DCB Decachlorobiphenyl		*69%*			*40 - 135 %*	"			"	
SSI0032-19 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:26	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19RE1 (G-RS4SW-090609)		**Water**				**Sampled: 09/06/09 13:30**				
PCB-1016	8082 STD	ND	*0.0045*	0.050	ug/L	1x	52716	10/12/09 15:10	10/23/09 16:48	
PCB-1232	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1221	"	ND	*0.0061*	0.050	"	"	"	"	"	
PCB-1242	"	ND	*0.0041*	0.050	"	"	"	"	"	
PCB-1248	"	ND	*0.0070*	0.050	"	"	"	"	"	
PCB-1254	"	ND	*0.0044*	0.050	"	"	"	"	"	
PCB-1260	"	ND	*0.0039*	0.050	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*65%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*61%*		*40 - 135 %*	"			"	
SSI0032-20 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
PCB-1016	8082 STD	ND	*0.0049*	0.054	ug/L	1x	50020	09/10/09 15:12	10/20/09 18:42	
PCB-1232	"	ND	*0.0044*	0.054	"	"	"	"	"	
PCB-1221	"	ND	*0.0067*	0.054	"	"	"	"	"	
PCB-1242	"	ND	*0.0044*	0.054	"	"	"	"	"	
PCB-1248	"	ND	*0.0077*	0.054	"	"	"	"	"	
PCB-1254	"	ND	*0.0048*	0.054	"	"	"	"	"	
PCB-1260	"	ND	*0.0042*	0.054	"	"	"	"	"	
SSI0032-20RE1 (G-RS5SW-090609)		**Water**				**Sampled: 09/06/09 14:00**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52716	10/12/09 15:10	10/23/09 17:03	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*61%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*60%*		*40 - 135 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**			**Sampled: 09/04/09 09:00**					
Naphthalene	8270C STD	**0.078**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 14:32	B
2-Methylnaphthalene	"	**0.012**	*0.0028*	0.012	"	"	"	"	"	B
1-Methylnaphthalene	"	**0.069**	*0.0011*	0.0094	"	"	"	"	"	B
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.027**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.036**	*0.00075*	0.0094	"	"	"	"	"	B
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	**0.21**	*0.00094*	0.0094	"	"	"	"	"	B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	~~0.0070~~	*0.0015*	0.0094 U	"	"	"	"	"	J,B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.12**	*0.0011*	0.0094	"	"	"	"	"	B
Pyrene	"	**0.014**	*0.0016*	0.0094	"	"	"	"	"	B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.0099**	*0.0010*	0.0094	"	"	"	"	"	B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s):	*Nitrobenzene-d5*		*113%*		*40 - 110 %*	"		"		*X, I*
	2-Fluorobiphenyl		*55%*		*50 - 110 %*	"		"		
	Terphenyl-d14		*90%*		*50 - 135 %*	"		"		
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Naphthalene	8270C STD	**0.017**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:36	B
2-Methylnaphthalene	"	~~0.0074~~	*0.0028*	0.012 U	"	"	"	"	"	J,B
1-Methylnaphthalene	"	**0.045**	*0.0011*	0.0094	"	"	"	"	"	B
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.0055**	*0.0010*	0.0094	"	"	"	"	"	J
Anthracene	"	**0.0096**	*0.00075*	0.0094	"	"	"	"	"	B
Chrysene	"	**0.0023**	*0.0020*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**0.040**	*0.00094*	0.0094	"	"	"	"	"	B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.014**	*0.0015*	0.0094	"	"	"	"	"	B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.054**	*0.0011*	0.0094	"	"	"	"	"	B
Pyrene	"	**0.033**	*0.0016*	0.0094	"	"	"	"	"	B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.036**	*0.0010*	0.0094	"	"	"	"	"	B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Dibenz(a,h)anthracene	8270C STD	ND	*0.0017*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:36	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*98%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*72%*			*50 - 110 %*	"			"	
Terphenyl-d14		*94%*			*50 - 135 %*	"			"	
SSI0032-03 (G-EW4-090409)		**Water**			**Sampled: 09/04/09 13:20**					
Naphthalene	8270C STD	~~0.0055~~	*0.0034*	0.0094 U	ug/L	1x	50020	09/10/09 15:12	09/15/09 15:56	~~J,B~~
2-Methylnaphthalene	"	ND	*0.0028*	0.012	"	"	"	"	"	
1-Methylnaphthalene	"	~~0.0026~~	*0.0011*	0.0094 U	"	"	"	"	"	~~J,B~~
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	~~0.0018~~	*0.00075*	0.0094 U	"	"	"	"	"	~~J,B~~
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Acenaphthene	"	~~0.0041~~	*0.00094*	0.0094 U	"	"	"	"	"	~~J,B~~
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	~~0.0020~~	*0.0015*	0.0094 U	"	"	"	"	"	~~J,B~~
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	~~0.0023~~	*0.0011*	0.0094 U	"	"	"	"	"	~~J,B~~
Pyrene	"	~~0.0020~~	*0.0016*	0.0094 U	"	"	"	"	"	~~J,B~~
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	~~0.0037~~	*0.0010*	0.0094 U	"	"	"	"	"	~~J,B~~
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*101%*			*40 - 110 %*	"			"	
2-Fluorobiphenyl		*77%*			*50 - 110 %*	"			"	
Terphenyl-d14		*97%*			*50 - 135 %*	"			"	
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Naphthalene	8270C STD	**0.042**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:16	~~B~~
2-Methylnaphthalene	"	**0.066**	*0.0028*	0.012	"	"	"	"	"	~~B~~
1-Methylnaphthalene	"	**0.034**	*0.0011*	0.0094	"	"	"	"	"	~~B~~
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Acenaphthylene	"	**0.0073**	*0.0010*	0.0094	"	"	"	"	"	J
Anthracene	"	**0.017**	*0.00075*	0.0094	"	"	"	"	"	~~B~~
Chrysene	"	**0.0052**	*0.0020*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**0.049**	*0.00094*	0.0094	"	"	"	"	"	~~B~~

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Benzo[b]fluoranthene	8270C STD	ND	*0.0025*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:16	
Fluoranthene	"	~~0.0075~~	*0.0015*	0.0094 U	"	"	"	"	"	~~J,B~~
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.078**	*0.0011*	0.0094	"	"	"	"	"	~~B~~
Pyrene	"	**0.015**	*0.0016*	0.0094	"	"	"	"	"	~~B~~
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.014**	*0.0010*	0.0094	"	"	"	"	"	~~B~~
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*131%*			*40 - 110 %*	"			"	*X, I*
2-Fluorobiphenyl		*59%*			*50 - 110 %*	"			"	
Terphenyl-d14		*103%*			*50 - 135 %*	"			"	
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Naphthalene	8270C STD	**0.039**	*0.0034*	0.0094	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:36	~~B~~
2-Methylnaphthalene	"	~~0.0077~~	*0.0028*	0.012 U	"	"	"	"	"	~~J,B~~
1-Methylnaphthalene	"	**0.077**	*0.0011*	0.0094	"	"	"	"	"	~~B~~
Benzo[a]anthracene	"	**0.0024**	*0.0023*	0.0094	"	"	"	"	"	J
Acenaphthylene	"	**0.042**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.033**	*0.00075*	0.0094	"	"	"	"	"	~~B~~
Chrysene	"	**0.0065**	*0.0020*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**0.20**	*0.00094*	0.0094	"	"	"	"	"	~~B~~
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.018**	*0.0015*	0.0094	"	"	"	"	"	~~B~~
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**0.47**	*0.0011*	0.0094	"	"	"	"	"	~~B~~
Pyrene	"	**0.019**	*0.0016*	0.0094	"	"	"	"	"	~~B~~
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**0.040**	*0.0010*	0.0094	"	"	"	"	"	~~B~~
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*115%*			*40 - 110 %*	"			"	*X, I*
2-Fluorobiphenyl		*77%*			*50 - 110 %*	"			"	
Terphenyl-d14		*100%*			*50 - 135 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Naphthalene	8270C STD	**2.4**	*0.0035*	0.0096	ug/L	1x	50020	09/10/09 15:12	09/15/09 16:56	B
2-Methylnaphthalene	"	**1.6**	*0.0029*	0.012	"	"	"	"	"	B
1-Methylnaphthalene	"	**9.7**	*0.012*	0.096	"	10x	"	"	09/17/09 19:12	
Benzo[a]anthracene	"	ND	*0.0023*	0.0096	"	1x	"	"	09/15/09 16:56	
Acenaphthylene	"	**0.13**	*0.0011*	0.0096	"	"	"	"	"	
Anthracene	"	**0.19**	*0.00077*	0.0096	"	"	"	"	"	B
Chrysene	"	**0.0024**	*0.0020*	0.0096	"	"	"	"	"	J
Acenaphthene	"	**1.0**	*0.00096*	0.0096	"	"	"	"	"	B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0096	"	"	"	"	"	
Fluoranthene	"	**0.048**	*0.0015*	0.0096	"	"	"	"	"	B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0096	"	"	"	"	"	
Fluorene	"	**1.3**	*0.0012*	0.0096	"	"	"	"	"	B
Pyrene	"	**0.055**	*0.0016*	0.0096	"	"	"	"	"	B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**1.3**	*0.0011*	0.0096	"	"	"	"	"	B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0096	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0096	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*			*91%*		*40 - 110 %*	"			"	
2-Fluorobiphenyl			*34%*		*50 - 110 %*	"			"	*X, I*
Terphenyl-d14			*94%*		*50 - 135 %*	"			"	
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Naphthalene	8270C STD	**5.8**	*0.034*	0.094	ug/L	10x	50020	09/10/09 15:12	09/17/09 19:32	
2-Methylnaphthalene	"	**6.7**	*0.0028*	0.012	"	1x	"	"	09/15/09 17:17	B
1-Methylnaphthalene	"	**14**	*0.011*	0.094	"	10x	"	"	09/17/09 19:32	
Benzo[a]anthracene	"	**0.0040**	*0.0023*	0.0094	"	1x	"	"	09/15/09 17:17	J
Acenaphthylene	"	**0.25**	*0.0010*	0.0094	"	"	"	"	"	
Anthracene	"	**0.26**	*0.00075*	0.0094	"	"	"	"	"	B
Chrysene	"	**0.0068**	*0.0020*	0.0094	"	"	"	"	"	J
Acenaphthene	"	**1.6**	*0.00094*	0.0094	"	"	"	"	"	B
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.060**	*0.0015*	0.0094	"	"	"	"	"	B
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluorene	"	**2.3**	*0.0011*	0.0094	"	"	"	"	"	B
Pyrene	"	**0.074**	*0.0016*	0.0094	"	"	"	"	"	B
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Phenanthrene	"	**2.0**	*0.0010*	0.0094	"	"	"	"	"	B
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50020 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1534817S)					QC Source: SSI0032-22			Extracted: 09/10/09 15:12						
Dibenz(a,h)anthracene	8270C STD	0.760	0.0018	0.0098	ug/L	1x	ND	0.980	77%	(40-125)	--	--	09/15/09 13:52	
Benzo[g,h,i]perylene	"	0.719	0.0020	0.0098	"	"	ND	0.983	73%	"	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 97%*			*Limits: 40-110%*	"							*09/15/09 13:52*	
2-Fluorobiphenyl		*79%*			*50-110%*	"							"	
Terphenyl-d14		*90%*			*50-135%*	"							"	
Blank (580-50233-5)					QC Source:			Extracted: 09/10/09 15:12						
Naphthalene	8270C STD	0.00511 ↓	0.0036	0.010	ug/L	1x							09/15/09 10:51	J
2-Methylnaphthalene	"	0.00488 ↓	0.0030	0.013	"	"								J
Benzo[a]anthracene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
1-Methylnaphthalene	"	0.00299 ↓	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Chrysene	"	ND	0.0021	0.010	"	"	--	--	--	--	--	--	"	
Anthracene	"	0.00316 ↓	0.00080	0.010	"	"	--	--	--	--	--	--	"	J
Acenaphthylene	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	0.00345 ↓	0.0016	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[b]fluoranthene	"	ND	0.0026	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	0.00180 ↓	0.0010	0.010	"	"	--	--	--	--	--	--	"	J
Pyrene	"	0.00356 ↓	0.0017	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[k]fluoranthene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Fluorene	"	0.00279 ↓	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Phenanthrene	"	0.00532 ↓	0.0011	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[a]pyrene	"	ND	0.0019	0.020	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	0.0018	0.010	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 87%*			*Limits: 40-110%*	"							*09/15/09 10:51*	
2-Fluorobiphenyl		*71%*			*50-110%*	"							"	
Terphenyl-d14		*78%*			*50-135%*	"							"	
LCS (580-50233-6)					QC Source:			Extracted: 09/10/09 15:12						
Naphthalene	8270C STD	0.880	0.0036	0.010	ug/L	1x	--	1.00	88%	(40-100)	--	--	09/15/09 11:11	
2-Methylnaphthalene	"	0.991	0.0030	0.013	"	"	--	"	99%	(45-105)	--	--	"	
Benzo[a]anthracene	"	0.998	0.0024	0.010	"	"	--	"	100%	(55-110)	--	--	"	
1-Methylnaphthalene	"	0.879	0.0012	0.010	"	"	--	"	88%	(50-150)	--	--	"	
Acenaphthylene	"	0.972	0.0011	0.010	"	"	--	"	97%	(50-105)	--	--	"	
Chrysene	"	0.932	0.0021	0.010	"	"	--	"	93%	(55-110)	--	--	"	
Anthracene	"	0.930	0.00080	0.010	"	"	--	"	93%	"	--	--	"	
Fluoranthene	"	0.938	0.0016	0.010	"	"	--	"	94%	(55-115)	--	--	"	
Benzo[b]fluoranthene	"	0.882	0.0026	0.010	"	"	--	"	88%	(45-120)	--	--	"	
Acenaphthene	"	0.904	0.0010	0.010	"	"	--	"	90%	(45-110)	--	--	"	

BLANK CONTAMINANTS

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-01 (G-HC1R-090409)		**Water**			**Sampled: 09/04/09 09:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.992**	----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 01:42	
Heavy Oil Range Hydrocarbons	"	**0.637**	----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.0%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*105%*			*50 - 150 %*	"		"	
SSI0032-02 (G-EW3-090409)		**Water**			**Sampled: 09/04/09 11:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**1.85**	----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 02:05	
Heavy Oil Range Hydrocarbons	"	**1.60**	----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*73.1%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*92.2%*			*50 - 150 %*	"		"	
SSI0032-03RE1 (G-EW4-090409)		**Water**			**Sampled: 09/04/09 13:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.236	mg/l	1x	9090121	09/18/09 14:11	09/18/09 23:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*97.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*118%*			*50 - 150 %*	"		"	
SSI0032-04 (G-EMW04-090409)		**Water**			**Sampled: 09/04/09 15:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 02:52	
Heavy Oil Range Hydrocarbons	"	ND	----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*73.7%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*104%*			*50 - 150 %*	"		"	
SSI0032-05 (G-P101OFP-090409)		**Other (L)**			**Sampled: 09/04/09 17:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	**201000**	-----	5660	mg/kg	5x	9090118	09/18/09 06:13	09/18/09 11:42	
Heavy Oil Range Hydrocarbons	"	**120000**	-----	14200	"	"	"	"	"	
Surrogate(s): 2-FBP			*158%*			*50 - 150 %*	"		"	*Z3*
p-Terphenyl-d14			*106%*			*50 - 150 %*	"		"	
SSI0032-06 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 03:16	
Heavy Oil Range Hydrocarbons	"	ND	----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*69.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*97.7%*			*50 - 150 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 11:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-06RE1 (G-GA1-090509)		**Water**			**Sampled: 09/05/09 09:40**					H
Diesel Range Hydrocarbons	NWTPH-Dx	**0.352** J	-----	0.236	mg/l	1x	9100094	10/15/09 12:59	10/15/09 17:01	
Heavy Oil Range Hydrocarbons	"	ND UJ	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP		*76.4%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*78.1%*			*50 - 150 %*	"			"	
SSI0032-07 (G-EMW05-090509)		**Water**			**Sampled: 09/05/09 11:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.611**	-----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 03:39	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP		*75.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*102%*			*50 - 150 %*	"			"	
SSI0032-08 (G-EMW06-090509)		**Water**			**Sampled: 09/05/09 13:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**0.546**	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 04:03	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*71.5%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*98.1%*			*50 - 150 %*	"			"	
SSI0032-09 (G-EB-090509)		**Water**			**Sampled: 09/05/09 14:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 05:13	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*87.6%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*110%*			*50 - 150 %*	"			"	
SSI0032-10 (G-RS5FP-090509)		**Other (L)**			**Sampled: 09/05/09 15:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	**233000**	-----	12000	mg/kg	10x	9090118	09/18/09 06:13	09/18/09 12:06	
Heavy Oil Range Hydrocarbons	"	**265000**	-----	30000	"	"	"	"	"	
Surrogate(s): 2-FBP		*73.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*89.1%*			*50 - 150 %*	"			"	
SSI0032-11 (G-RS4FP-090509)		**Other (L)**			**Sampled: 09/05/09 16:08**					
Diesel Range Hydrocarbons	NWTPH-Dx	**386000**	-----	5880	mg/kg	5x	9090118	09/18/09 06:13	09/18/09 12:06	
Heavy Oil Range Hydrocarbons	"	**306000**	-----	14700	"	"	"	"	"	
Surrogate(s): 2-FBP		*161%*			*50 - 150 %*	"			"	Z3
p-Terphenyl-d14		*95.0%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-12 (G-RS3FP-090509)			**Other (L)**			**Sampled: 09/05/09 16:35**				
Diesel Range Hydrocarbons	NWTPH-Dx	**154000**	-----	11300	mg/kg	10x	9090118	09/18/09 06:13	09/18/09 12:32	
Heavy Oil Range Hydrocarbons	"	**149000**	----	28300	"	"	"	"	"	
Surrogate(s): 2-FBP			*132%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*98.6%*			*50 - 150 %*	"		"	
SSI0032-13 (G-RS3aFP-090509)			**Other (L)**			**Sampled: 09/05/09 17:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	**80700**	-----	2400	mg/kg	1x	9090118	09/18/09 06:13	09/18/09 12:32	
Heavy Oil Range Hydrocarbons	"	**67500**	----	6000	"	"	"	"	"	
Surrogate(s): 2-FBP			*103%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*107%*			*50 - 150 %*	"		"	
SSI0032-14 (G-RS1SW-090609)			**Water**			**Sampled: 09/06/09 09:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.250	mg/l	1x	9090104	09/16/09 08:06	09/17/09 05:37	
Heavy Oil Range Hydrocarbons	"	ND	----	0.500	"	"	"	"	"	
Surrogate(s): 2-FBP			*72.1%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*92.6%*			*50 - 150 %*	"		"	
SSI0032-15 (G-RS2SW-090609)			**Water**			**Sampled: 09/06/09 10:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.260	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:00	
Heavy Oil Range Hydrocarbons	"	ND	----	0.521	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.8%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*103%*			*50 - 150 %*	"		"	
SSI0032-16 (G-RS3SW-090609)			**Water**			**Sampled: 09/06/09 12:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.266	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:24	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.532	"	"	"	"	"	
Surrogate(s): 2-FBP			*76.9%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*99.6%*			*50 - 150 %*	"		"	
SSI0032-17 (G-RS3DSW-090609)			**Water**			**Sampled: 09/06/09 11:40**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.236	mg/l	1x	9090104	09/16/09 08:06	09/17/09 06:47	
Heavy Oil Range Hydrocarbons	"	ND	----	0.472	"	"	"	"	"	
Surrogate(s): 2-FBP			*82.2%*			*50 - 150 %*	"		"	
p-Terphenyl-d14			*103%*			*50 - 150 %*	"		"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0032-19 (G-RS4SW-090609)		**Water**			**Sampled: 09/06/09 13:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.248	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:11	
Heavy Oil Range Hydrocarbons	"	ND	----	0.495	"	"	"	"	"	
Surrogate(s): 2-FBP		*73.4%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*96.4%*			*50 - 150 %*	"			"	
SSI0032-20 (G-RS5SW-090609)		**Water**			**Sampled: 09/06/09 14:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:34	
Heavy Oil Range Hydrocarbons	"	ND	----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*78.4%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*103%*			*50 - 150 %*	"			"	
SSI0032-21 (G-RS6SW-090609)		**Water**			**Sampled: 09/06/09 14:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.278	mg/l	1x	9090104	09/16/09 08:06	09/17/09 07:58	
Heavy Oil Range Hydrocarbons	"	ND	----	0.556	"	"	"	"	"	
Surrogate(s): 2-FBP		*83.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*106%*			*50 - 150 %*	"			"	
SSI0032-22 (G-RS7SW-090609)		**Water**			**Sampled: 09/06/09 15:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.245	mg/l	1x	9090104	09/16/09 08:06	09/17/09 08:21	
Heavy Oil Range Hydrocarbons	"	ND	----	0.490	"	"	"	"	"	
Surrogate(s): 2-FBP		*79.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*100%*			*50 - 150 %*	"			"	
SSI0032-23 (G-RS8SW-090609)		**Water**			**Sampled: 09/06/09 16:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	0.240	mg/l	1x	9090104	09/16/09 08:06	09/17/09 09:32	
Heavy Oil Range Hydrocarbons	"	ND	----	0.481	"	"	"	"	"	
Surrogate(s): 2-FBP		*77.7%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*101%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Data Deliverable Package

Golder Associates, Inc.
Doug Morell
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project: Avery Landing

Project Number: 073-93312-03

Laboratory Work Order: SSI0032

November 10, 2009

Total Pages
1996

TestAmerica-Spokane
11922 E. 1st Avenue
Spokane, WA 99206

Phone: (509) 924-9200
Fax: (509)924-9290

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/6/2009 to 9/4/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/7/2009
Lab:	SSI0032		
NJDEP#:	PA004		

SAMPLE RECEIPT: Samples were received intact, on ice, with custody seals and chain of custody documentation. The Cooler(s) were received and the sample temperature(s) were measured at 3.1° C upon receipt at the laboratory.

HOLDING TIMES: The sample analysis for SSI0032-06RE1 in batch 9100094 by NWTPH-Dx was performed past method-specified holding time.

As per EPA SW846 revision 4 the holding time for 8082 PCB analysis is one year from collection.

PROBLEMS ENCOUNTERED: No problems were encountered.

QA/QC CRITERIA: The surrogates Decachlorobiphenyl and Tetrachloro-m-xylene in sample SSI0032-06RE2, batch 52716 by 8082 exceeds the control limits.

The surrogate Tetrachloro-m-xylene in sample SSI0032-21RE2, batch 52716 by 8082 exceeds the control limits.

The Internal Standard associated with Nitrobenzene-d5 in sample SSI0032-01 recovered outside of method limits in batch 50020 by 8270C. Matrix interference was confirmed by reanalysis.

The surrogate Nitrobenzene-d5 in sample SSI0032-01, batch 50020 by 8270C exceeds the control limits.

The Internal Standard associated with Nitrobenzene-d5 in sample SSI0032-04 recovered outside of method limits in batch 50020 by 8270C. Matrix interference was confirmed by reanalysis.

The surrogate Nitrobenzene-d5 in sample SSI0032-04, batch 50020 by 8270C exceeds the control limits.

The Internal Standard associated with Nitrobenzene-d5 in sample SSI0032-06 recovered outside of method limits in batch 50020 by 8270C STD. Matrix interference was confirmed by reanalysis.

The surrogate Nitrobenzene-d5 in sample SSI0032-06, batch 50020 by

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/6/2009 to 9/4/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/7/2009
Lab:	SSI0032		
NJDEP#:	PA004		

8270C exceeds the control limits.

The Internal Standard associated with 2-Fluorobiphenyl in sample SSI0032-07 recovered outside of method limits in batch 50020 by 8270C. Matrix interference was confirmed by reanalysis.

The surrogate 2-Fluorobiphenyl in sample SSI0032-07, batch 50020 by 8270C exceeds the control limits.

The Calibration Verification recovery for samples SSI0032-05, -10, -11, -12 and -13 in batch 9090119 by EPA 8082 was below the method control limit due to matrix interference carried over from analytical samples. The matrix interference was confirmed by reanalysis with the same result.

Due to sample matrix effects in samples 9090119-MS1, -05, -10, -11 and -12 the surrogate recoveries were below the acceptance limits in batch 9090119 EPA 8082.

The PCB-1016 and PCB-1260 recoveries in samples 9090119-MS1 and 9090119-MSD1 were above the acceptance limits for EPA 8082 batch 9090119 due to sample matrix interference. See Blank Spike (LCS).

Due to sample matrix effects in samples 9090081-MS1 and -MSD1, batch 9090081 by EPA 8270 mod., the 2-FBP recovery was outside the acceptance limits.

The Fluorene recovery in samples 9090081-MS1 and -MSD1 was above the acceptance limits for EPA 8270 mod. batch 9090081 due to sample matrix interference. See Blank Spike (LCS).

The Internal Standard recovery associated with Benzo (a) anthracene, Chrysene, p-Terphenyl-d14 and Pyrene in sample SSI0032-10 batch 9090081 for EPA 8270 mod. were below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

The Internal Standard recovery associated with Benzo (a) anthracene in sample SSI0032-11 batch 9090081 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/6/2009 to 9/4/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/7/2009
Lab:	SSI0032		
NJDEP#:	PA004		

The Internal Standard recovery associated with Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0032-11 batch 9090081 for EPA 8270 mod. were below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

Due to sample matrix effects in sample SSI0032-11 batch 9090081 by EPA 8270 mod., the p-Terphenyl-d14 recovery was outside the acceptance limits.

Sample SSI0032-05 and -11 for NWTPH-Dx batch 9090118 required dilutions due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.

OBSERVATIONS: Results that fall between the MDL and RL are 'J' flagged.

SUBCONTRACTED: The EPA 6010C/6020A, EPA 7471B, EPA 8082 and EPA 8270C PAH SIM waters were subcontracted to the TestAmerica Tacoma laboratory.

TestAmerica Spokane

Randee Decker
Project Manager

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

CASE NARRATIVE

Client: TestAmerica Laboratories, Inc
Project: SSI0032
Report Number: 580-15348-1

This case narrative is in the form of an exception report, where only the anomalies related to this report, method specific performance and/or QA/QC issues are discussed. If there are no issues to report, this narrative will include a statement that documents that there are no relevant data issues.

It should be noted that samples with elevated Reporting Limits (RLs) as a result of a dilution may not be able to satisfy customer reporting limits in some cases. Such increases in the RLs are unavoidable but acceptable consequence of sample dilution that enables quantification of target analytes or interferences which exceed the calibration range of the instrument.

Calculations are performed before rounding to avoid round-off errors in calculated results.

All holding times were met and proper preservation noted for the methods performed on these samples, unless otherwise detailed in the individual sections below.

RECEIPT
The samples were received on 09/09/2009; the samples arrived in good condition, properly preserved and on ice. The temperature of the coolers at receipt was 1.1, 0.6, 0.8, 1.4, 0.6 and 3.8 C.

TestAmerica Seattle/Tacoma did not receive any containers for sample SSI0032-18. Randee Decker was contacted via e-mail. Randee Decker requested that sample SSI0032-18 be cancelled.

Note: All samples which require thermal preservation are considered acceptable if the arrival temperature is within 2C of the required temperature or method specified range. For samples with a specified temperature of 4C, samples with a temperature ranging from just above freezing temperature of water to 6C shall be acceptable. Samples that are hand delivered immediately following collection may not meet these criteria, however they will be deemed acceptable according to NELAC standards, if there is evidence that the chilling process has begun, such as arrival on ice, etc.

POLYCYCLIC AROMATIC HYDROCARBONS (PAHS)
Samples 580-15348-1 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 were analyzed for polycyclic aromatic hydrocarbons (PAHs) in accordance with EPA SW-846 Method 8270C SIM. The samples were prepared on 09/10/2009 and analyzed on 09/15/2009 and 09/17/2009.

Samples 580-15348-6 and 580-15348-7 required further dilution to bring the results for several analytes within calibration range of the instrument. The dilution analyses were performed on 09/17/2009, which was within the required holding time. Results for these dilutions are included in the report and raw data package. The reporting limits have been adjusted accordingly.

The continuing calibration verification (CCV) for analytical batch 580-50428 exceeded the upper control criteria for the CCC compound pentachlorophenol. This analyte was not on the target list. All target analytes were within 20%D limit. The data have been qualified and reported.

Several analytes were detected in method blank MB 580-50020/1-A at levels that were above the method detection limit but below the reporting limit. The values should be considered estimates, and have been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Recovery of the surrogate Nitrobenzene-d5 in samples 580-15348-1, 580-15348-4 and 580-15348-5 exceeded quality control limits due to matrix interference.

The surrogate recovery of Nitrobenzene-d5 in the LCS of batch 580-50233 exceeded QC limits. The recoveries of all spiked target compounds and all other surrogates were within QC limits, no further action was taken on this outlier. The anomaly was flagged "X."

No other difficulties were encountered during the PAHs analyses.

All other quality control parameters were within the acceptance limits.

POLYCHLORINATED BIPHENYLS (PCBS)
Samples 580-15348-5, 580-15348-8 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 were analyzed for polychlorinated biphenyls (PCBs) in accordance with EPA SW-846 Method 8082. The samples were prepared on 09/10/2009 and 10/12/2009 and analyzed on 10/13/2009, 10/20/2009 and 10/23/2009.

Due to laboratory oversight the sample extract for method 8082 was taken to a 10 ml final volume instead of the required 1 ml final volume. The extract for samples 580-15348-5, 580-15348-8 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 and all associated QC were blown down to a 1 ml final volume and reanalyzed. Recovery values for the surrogates in samples 580-15348-5 and 580-15348-16 recovered below the quality control limits in the 1 ml final volume analysis results from the 10 ml final volume analysis for these two samples is provided as secondary data in analytical batch 580-51891 to show that surrogate recovery

was acceptable in the original analysis.

Per client request samples 580-15348-5, 580-15348-8 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 and associated method blank were exchanged from method 8270 extract to hexane to be run by method 8082. No 8082 surrogates or spiking compounds were added to these samples; therefore no recovery values for surrogates and spikes are provided.

The continuing calibration verifications (CCVs), [CCV 580-51891/20, CCV 580-51891/31, CCV 580-51891/40], for analytical batch 580-51891 exceeded control criteria high. The affected samples were non-detect; Therefore the data have been reported.

The continuing calibration verification (CCV) for analytical batch 52355 recovered below acceptance criteria for PCB-1221, PCB-1232, PCB-1248 and PCB-1254. A low-level standard (RL check standard), spiked at the reporting limit (RL), was prepared with this batch. The affected target analytes recovered within acceptance limits; therefore, the RL check standard demonstrates the analytical system had sufficient sensitivity to detect the compounds had they been present. Since the affected target compounds were not detected in the samples, the data have been reported and qualified. In addition PCB-1232, PCB-1248 and PCB-1254 were within control limits in the CCV on the confirmation column and all the sample results confirmed on the confirmation column.

No other difficulties were encountered during the PCBs analyses.

All other quality control parameters were within the acceptance limits.

TOTAL METALS

Samples 580-15348-1 through 580-15348-12, 580-15348-14 through 580-15348-17, 580-15348-19 and 580-15348-20 through 580-15348-24 were analyzed for total metals in accordance with EPA SW-846 Method 6010B. The samples were prepared on 09/18/2009 and 09/25/2009 and analyzed on 09/21/2009 and 09/25/2009.

Magnesium and Thallium were detected in method blank MB 580-50886/9-A at levels that were above the method detection limit but below the reporting limit. The values should be considered estimates, and have been flagged "J". If the associated sample reported a result above the MDL and/or RL, the result has been "B" flagged.

Recovery and/or RPD values for Aluminum, Iron and Sodium in the matrix spike/matrix spike duplicate of sample 580-15348-20 were outside advisory QC limits. Matrix interference is indicated based on acceptable LCS/LCSD recovery and/or RPD.

No other difficulties were encountered during the total metals analyses.

All other quality control parameters were within the acceptance limits.

TOTAL METALS

Samples 580-15348-1 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 were analyzed for total metals in accordance with EPA SW-846 Method 6020. The samples were prepared on 09/18/2009 and analyzed on 09/21/2009.

No difficulties were encountered during the total metals analyses.

All quality control parameters were within the acceptance limits.

TOTAL MERCURY

Samples 580-15348-1 through 580-15348-12, 580-15348-14 through 580-15348-17 and 580-15348-19 were analyzed for total mercury in accordance with EPA SW-846 Method 7470A. The samples were prepared and analyzed on 09/14/2009.

No difficulties were encountered during the total mercury analyses.

All quality control parameters were within the acceptance limits.

TOTAL MERCURY

Samples 580-15348-20 through 580-15348-24 were analyzed for total mercury in accordance with EPA SW-846 Method 7471A. The samples were prepared on 09/25/2009 and analyzed on 09/28/2009.

No difficulties were encountered during the total mercury analyses.

All quality control parameters were within the acceptance limits.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 [X]
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 55I0032

CLIENT: Golder Associates

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200
Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498 cc: Kirsi Longley

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *
Organic & Inorganic Analyses: [X] STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE			HNO3	HNO3								MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
		HCL	—	—													
		REQUESTED ANALYSES															
		NWTPH-Dx extended	PCB (8082A low level)	PAH * (8270SIM)	TAL metals total	TAL metals Dissolved											
1 G-HC1R-090409	9/4/09 900	X		X	X	Hold								W	5		-01
2 G-EW3-090409	9/4/09 1120	X		X	X	Hold								W	15	Extra volume ms/msD	-02
3 G-EW4-090409	9/4/09 1320	X		X	X	Hold								W	5		-03
4 G-EMW04-090409	9/4/09 1535	X		X	X	Hold								W	5		-04
5 G-P101OFP-090409	9/4/09 1730	X	X	X	X									LNAPL	1	**	-05
6 G-GA1-090509	9/5/09 940	X	X	X	X	Hold								W	7		-06
7 G-EMW05-090509	9/5/09 1125	X		X	X	Hold								W	5		-07
8 G-EMW06-090509	9/5/09 1325	X		X	X	Hold								W	5		-08
9 G-EB-090509	9/5/09 1400	X	X	X	X									W	6	9 filter	-09
10 G-RS5FP-090509	9/5/09 1500	X	X	X	X									LNAPL	1	**	-10

RELEASED BY: [signature] DATE: 9/7/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 914

RECEIVED BY: [signature] DATE: 9/7/09
PRINT NAME: Chris Williams FIRM: TA Spokane TIME: 9:14

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier IV Data Package (CEPA CLP deliverable). Project Specific Reporting Limits
*PAH analysis must include ~~naphtha~~ naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of total metals.
** If LNAPL volume is insufficient for all analyses requested, prioritize the analysis as follows: PCB, PAH, Metals, TPH-Dx
#1 #2 #3 #4

TEMP: 3.1°C PAGE 1 OF 3

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 ☒
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #:

CLIENT: Golder Associates

INVOICE TO: Accounting (same address)

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200 Redmond, WA 98052
PHONE: 425-883-0777 FAX: 425-882-5498 cc: Kirsi Longley

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [10] STD. [7] [5] [4] [3] [2] [1] [<1]

Petroleum Hydrocarbon Analyses: [5] STD. [4] [3] [2] [1] [<1]

[OTHER] Specify:

* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: HCL | — | — | HNO3 | HNO3

REQUESTED ANALYSES: NWTPH-Dx extended | PCB (8082A low level) | PAH * (8270 SIM) | TAL metals (Total) | TAL metals (Dissolved)

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	NWTPH-Dx ext.	PCB (8082A low level)	PAH * (8270 SIM)	TAL metals (Total)	TAL metals (Dissolved)	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
11	1 G-RS4FP-090509	9/5/09 1608	X	X	X	X		LNAPL	2	* **	-11
12	2 G-RS3FP-090509	9/5/09 1635	X	X	X	X		LNAPL	1	* **	-12
13	3 G-RS3aFP-090509	9/5/09 1700	X	X	X	X		LNAPL	1	**	-13
	4 G-RS1SW-090609	9/6/09 945	X	X	X	X	Hold	W	7		-14
	5 G-RS2SW-090609	9/6/09 1045	X	X	X	X	Hold	W	7		-15
	6 G-RS3SW-090609	9/6/09 1200	X	X	X	X	Hold	W	7		-16
	7 G-RSBDSW-090609	9/6/09 1140	X	X	X	X	Hold	W	7		-17
	8 G-RS3SSW-090609	9/6/09 1145	X	X	X	X	Hold	W	7		-18
	9 G-RS4SW-090609	9/6/09 1330	X	X	X	X	Hold	W	7		-19
	10 G-RS5SW-090609	9/6/09 1400	X	X	X	X	Hold	W	7		-20

RELEASED BY: K. Longley — PRINT NAME: Kirsi Longley — FIRM: Golder Assoc. — DATE: 9/7/09 — TIME: 914

RECEIVED BY: Chris Williams — PRINT NAME: Chris Williams — FIRM: TA-Spokane — DATE: 9/7/09 — TIME: 914

RELEASED BY: — PRINT NAME: — FIRM: — DATE: — TIME:

RECEIVED BY: — PRINT NAME: — FIRM: — DATE: — TIME:

ADDITIONAL REMARKS: Tier IV Data Package (EPA CLP deliverable). Project Specific Reporting Limits.
* PAH analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene.
Hold dissolved metals bottles - pending analysis of total metals.
** If LNAPL volume is insufficient for all analyses requested, prioritize the analysis as follows: PCB, #1 PAH, #2 metals, #3 TPH-Dx #4

TEMP:

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210 ☐
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 ☒
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210 ☐
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210 ☐

CHAIN OF CUSTODY REPORT

Work Order #:

CLIENT: Golder Associates

REPORT TO: Doug Morell
ADDRESS: 18300 NE Union Hill Road, Suite 200
Redmond, WA 98052 cc: Kirsi Longley
PHONE: 425-883-0777 FAX: 425-882-5498

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [X] STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE					REQUESTED ANALYSES								MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
		HCL	—	—	HNO3	HNO3	NWTPH-Dx extended	PCB (8082A) low level	PAH * (8270 SIM)	TAL Metals (Total)	TAL metals (Dissolved)							
1 G-RS6SW-090609	9/6/09 1450						X	X	X	X	Hold				W	7		-21
2 G-RS7SW-090609	9/6/09 1520						X	X	X	X	Hold				W	21	Extra volume ms/msD	-22
3 G-RS8SW-090609	9/6/09 1625						X	X	X	X	Hold				W	7		-23
4																		
5																		
6																		
7																		
8																		
9																		
10																		

RELEASED BY: [signature] DATE: 9/7/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 914

RECEIVED BY: [signature] DATE: 9/7/09
PRINT NAME: Chris Wilson FIRM: TAS Spokane TIME: 914

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS: Tier ~~III~~ Data Package (EPA CLP deliverable).
* PAH Analysis must include naphthalene, 1-methylnaphthalene, and 2-methylnaphthalene
Hold dissolved metals bottles - pending analysis of total metals.
Project specific reporting limits.

TEMP:

PAGE 3 OF 3

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0032 CLIENT: Golder PROJECT: Avery

Date /Time Cooler Arrived 09/01/09 09:14 Cooler signed for by: Chris Williams (Print name)

Preliminary Examination Phase:

Date cooler opened: [X] same as date received *or* ____/____/____

Cooler opened by (print) Chris Williams (sign) _____

1. Delivered by [ ] ALASKA AIRLINES [ ] Fed-Ex [ ] UPS [ ] NAC [ ] LYNDEN [ ] CLIENT [X] Other: Pickup courier

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals 8 Signed by K. Langley Date 09/01/09

   Were custody seals unbroken and intact on arrival? [X] Yes [ ] No

3. Were custody papers sealed in a plastic bag? [ ] Yes [X] No

4. Were custody papers filled out properly (ink, signed, etc.)? [X] Yes [ ] No

5. Did you sign the custody papers in the appropriate place? [X] Yes [ ] No

6. Was ice used? [X] Yes [ ] No Type of ice: [ ] blue ice [ ] gel ice [X] real ice [ ] dry ice Condition of Ice: _____

   Temperature by IR Gun 3.1 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: [X] bubble wrap [ ] styrofoam [ ] cardboard [ ] Other: _____

8. Did samples arrive in plastic bags? [X] Yes [ ] No

9. Did all bottles arrive unbroken, and with labels in good condition? [X] Yes [ ] No

10. Are all bottle labels complete (ID, date, time, etc.) [X] Yes [ ] No

11. Do bottle labels and Chain of Custody agree? [ ] Yes [X] No Did not receive sample RB.SSW and we received an extra container not listed on COC (MW05). PD

12. Are the containers and preservatives correct for the tests indicated? [X] Yes [ ] No

13. Is there adequate volume for the tests requested? [X] Yes [ ] No

14. Were VOA vials free of bubbles? [X] N/A [ ] Yes [ ] No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 09/01/09 PD

Samples logged in by (print) ~~Chris Williams~~ Kandace Ecker (sign) Kandace Ecker

1. Was project identifiable from custody papers? [X] Yes [ ] No

2. Do Turn Around Times and Due Dates agree? [X] Yes [ ] No

3. Was the Project Manager notified of status? [X] Yes [ ] No

4. Was the Lab notified of status? [X] Yes [ ] No

5. Was the COC scanned and copied? [X] Yes [ ] No

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr (8082 STD)

TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0032-06	G-GA1-090509	09/05/09 09:40	09/10/09 15:12	5	10/20/09 16:53
SSI0032-06RE1	G-GA1-090509	09/05/09 09:40	10/12/09 15:10	38	10/13/09 17:16
SSI0032-06RE2	G-GA1-090509	09/05/09 09:40	10/12/09 15:10	38	10/23/09 15:15
SSI0032-09	G-EB-090509	09/05/09 14:00	09/10/09 15:12	5	10/20/09 17:09
SSI0032-09RE1	G-EB-090509	09/05/09 14:00	10/12/09 15:10	38	10/23/09 15:30
SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/10/09 15:12	4	10/20/09 17:24
SSI0032-14RE1	G-RS1SW-090609	09/06/09 09:45	10/12/09 15:10	37	10/23/09 15:46
SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/10/09 15:12	4	10/20/09 17:40
SSI0032-15RE1	G-RS2SW-090609	09/06/09 10:45	10/12/09 15:10	37	10/23/09 16:01
SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/10/09 15:12	4	10/20/09 17:55
SSI0032-16RE1	G-RS3SW-090609	09/06/09 12:00	10/12/09 15:10	37	10/23/09 16:17
SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/10/09 15:12	4	10/20/09 18:11
SSI0032-17RE1	G-RS3DSW-090609	09/06/09 11:40	10/12/09 15:10	37	10/23/09 16:32
SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/10/09 15:12	4	10/20/09 18:26
SSI0032-19RE1	G-RS4SW-090609	09/06/09 13:30	10/12/09 15:10	37	10/23/09 16:48
SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/10/09 15:12	4	10/20/09 18:42
SSI0032-20RE1	G-RS5SW-090609	09/06/09 14:00	10/12/09 15:10	37	10/23/09 17:03
SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/10/09 15:12	4	10/20/09 18:57
SSI0032-21RE1	G-RS6SW-090609	09/06/09 14:50	10/12/09 15:10	37	10/13/09 19:35
SSI0032-21RE2	G-RS6SW-090609	09/06/09 14:50	10/12/09 15:10	37	10/23/09 17:34
SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/10/09 15:12	4	10/20/09 19:28
SSI0032-22RE1	G-RS7SW-090609	09/06/09 15:20	10/12/09 15:10	37	10/23/09 17:50
SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/10/09 15:12		10/20/09 19:44
SSI0032-23RE1	G-RS8SW-090609	09/06/09 16:25	10/12/09 15:10	37	10/23/09 18:36

17 WATER Smpls.

1 Year Max H. TIME CITED by LAB. NO QUALIF

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 11:16

Laboratory Analysis Times Report

Semivolatile Organic Compounds (GC/MS SIM) (8270C STD)

TestAmerica Tacoma

SSI0032

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0032-01	G-HC1R-090409	09/04/09 09:00	09/10/09 15:12	6	09/15/09 14:32
SSI0032-02	G-EW3-090409	09/04/09 11:20	09/10/09 15:12		09/15/09 15:36
SSI0032-03	G-EW4-090409	09/04/09 13:20	09/10/09 15:12		09/15/09 15:56
SSI0032-04	G-EMW04-090409	09/04/09 15:35	09/10/09 15:12		09/15/09 16:16
SSI0032-06	G-GA1-090509	09/05/09 09:40	09/10/09 15:12	5	09/15/09 16:36
SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/10/09 15:12		09/15/09 16:56
SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/10/09 15:12		09/17/09 19:12
SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/10/09 15:12		09/15/09 17:17
SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/10/09 15:12		09/17/09 19:32
SSI0032-09	G-EB-090509	09/05/09 14:00	09/10/09 15:12		09/17/09 18:32
SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/10/09 15:12	4	09/17/09 18:52
SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/10/09 15:12		09/15/09 18:17
SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/10/09 15:12		09/15/09 18:38
SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/10/09 15:12		09/15/09 18:58
SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/10/09 15:12		09/15/09 19:18
SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/10/09 15:12		09/17/09 17:32
SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/10/09 15:12		09/17/09 17:52
SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/10/09 15:12		09/15/09 13:32
SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/10/09 15:12		09/17/09 18:12

17 WATER Smpls.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Semivolatile Petroleum Products by NWTPH-Dx (NWTPH-Dx)

TestAmerica Spokane

SSI0032

	Lab Number	SampleName	Sampled	Extracted	Analyzed
	SSI0032-01	G-HC1R-090409	09/04/09 09:00	09/16/09 08:06 12	09/17/09 01:42
	SSI0032-02	G-EW3-090409	09/04/09 11:20	09/16/09 08:06 12	09/17/09 02:05
	SSI0032-03RE1	G-EW4-090409	09/04/09 13:20	09/18/09 14:11 14	09/18/09 23:24
	SSI0032-04	G-EMW04-090409	09/04/09 15:35	09/16/09 08:06 12	09/17/09 02:52
*	SSI0032-05	G-P101OFP-090409	09/04/09 17:30	09/18/09 06:13 14	09/18/09 11:42
	SSI0032-06	G-GA1-090509	09/05/09 09:40	09/16/09 08:06 12	09/17/09 03:16
	SSI0032-06RE1	G-GA1-090509	09/05/09 09:40	10/15/09 12:59 39	10/15/09 17:01 39
	SSI0032-07	G-EMW05-090509	09/05/09 11:25	09/16/09 08:06 12	09/17/09 03:39
	SSI0032-08	G-EMW06-090509	09/05/09 13:25	09/16/09 08:06 ↓	09/17/09 04:03
	SSI0032-09	G-EB-090509	09/05/09 14:00	09/16/09 08:06 ↓	09/17/09 05:13
*	SSI0032-10	G-RS5FP-090509	09/05/09 15:00	09/18/09 06:13 13	09/18/09 12:06
*	SSI0032-11	G-RS4FP-090509	09/05/09 16:08	09/18/09 06:13 ↓	09/18/09 12:06
*	SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/18/09 06:13 ↓	09/18/09 12:32
*	SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/18/09 06:13 ↓	09/18/09 12:32
	SSI0032-14	G-RS1SW-090609	09/06/09 09:45	09/16/09 08:06 10	09/17/09 05:37
	SSI0032-15	G-RS2SW-090609	09/06/09 10:45	09/16/09 08:06 ↓	09/17/09 06:00
	SSI0032-16	G-RS3SW-090609	09/06/09 12:00	09/16/09 08:06 ↓	09/17/09 06:24
	SSI0032-17	G-RS3DSW-090609	09/06/09 11:40	09/16/09 08:06 ↓	09/17/09 06:47
	SSI0032-19	G-RS4SW-090609	09/06/09 13:30	09/16/09 08:06 ↓	09/17/09 07:11
	SSI0032-20	G-RS5SW-090609	09/06/09 14:00	09/16/09 08:06 ↓	09/17/09 07:34
	SSI0032-21	G-RS6SW-090609	09/06/09 14:50	09/16/09 08:06 ↓	09/17/09 07:58
	SSI0032-22	G-RS7SW-090609	09/06/09 15:20	09/16/09 08:06 ↓	09/17/09 08:21
	SSI0032-23	G-RS8SW-090609	09/06/09 16:25	09/16/09 08:06 ↓	09/17/09 09:32

-06 RE1 past H.TIME ; JTuJ

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Polychlorinated Biphenyls by EPA Method 8082 (EPA 8082)

TestAmerica Spokane

SSI0032

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0032-05	G-P101OFP-090409	09/04/09 17:30	09/18/09 08:06	14	09/18/09 18:14
SSI0032-10	G-RS5FP-090509	09/05/09 15:00	09/18/09 08:06	13	09/18/09 18:37
SSI0032-11	G-RS4FP-090509	09/05/09 16:08	09/18/09 08:06		09/18/09 19:00
SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/18/09 08:06		09/18/09 19:22
SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/18/09 08:06		09/18/09 19:45
SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/18/09 08:06		09/18/09 19:45
SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/18/09 08:06		09/18/09 20:08

5 LNAPL Smpls. ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 11:16

Laboratory Analysis Times Report

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring (EPA 8270 mod.)

TestAmerica Spokane

SSI0032

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0032-05	G-P101OFP-090409	09/04/09 17:30	09/11/09 13:20	7	09/13/09 18:25
SSI0032-10	G-RS5FP-090509	09/05/09 15:00	09/11/09 13:20	6	09/13/09 23:47
SSI0032-11	G-RS4FP-090509	09/05/09 16:08	09/11/09 13:20	6	09/14/09 00:08
SSI0032-12	G-RS3FP-090509	09/05/09 16:35	09/11/09 13:20	6	09/13/09 20:55
SSI0032-13	G-RS3aFP-090509	09/05/09 17:00	09/11/09 13:20	6	09/13/09 19:08

5 LNAPL Smpls. ✓

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

October 28, 2009

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 09/09/09 11:00. The following list is a summary of the Work Orders contained in this report, generated on 10/28/09 13:08.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSI0046	Avery Landing	073-93312-03

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-GA1-21-082609	SSI0046-01	Soil	08/26/09 15:15	09/09/09 11:00
Trip Blank	SSI0046-02	Other (S)	09/08/09 00:00	09/09/09 11:00
G-GA3-20-082608	SSI0046-03	Soil	08/26/09 10:00	09/09/09 11:00
GA-D2-082609	SSI0046-04	Soil	08/26/09 10:00	09/09/09 11:00
G-GA-D-082609	SSI0046-05	Soil	08/26/09 15:15	09/09/09 11:00

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**37.1**	-----	11.2	mg/kg dry	1x	9090070	09/10/09 14:30	09/13/09 18:59	
Heavy Oil Range Hydrocarbons	"	**73.0**	-----	28.1	"	"	"	"	"	
Surrogate(s): *2-FBP*			*96.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*119%*		*50 - 150 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**22.9**	-----	11.4	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 20:59	
Heavy Oil Range Hydrocarbons	"	**70.7**	-----	28.5	"	"	"	"	"	
Surrogate(s): *2-FBP*			*93.0%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*125%*		*50 - 150 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**39.4**	-----	11.3	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 21:23	
Heavy Oil Range Hydrocarbons	"	**119**	-----	28.2	"	"	"	"	"	
Surrogate(s): *2-FBP*			*95.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*123%*		*50 - 150 %*	"			"	
SSI0046-05 (G-GA-D-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**50.1**	-----	11.2	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 21:46	
Heavy Oil Range Hydrocarbons	"	**88.1**	-----	28.1	"	"	"	"	"	
Surrogate(s): *2-FBP*			*87.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*111%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
PCB-1016	EPA 8082	ND	-----	9.89	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 09:18	
PCB-1221	"	ND	-----	9.89	"	"	"	"	"	
PCB-1232	"	ND	-----	9.89	"	"	"	"	"	
PCB-1242	"	ND	-----	9.89	"	"	"	"	"	
PCB-1248	"	ND	-----	9.89	"	"	"	"	"	
PCB-1254	"	ND	-----	9.89	"	"	"	"	"	
PCB-1260	"	ND	-----	9.89	"	"	"	"	"	
Surrogate(s): TCX		*89.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*71.7%*			*35 - 157 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		**Soil**				**Sampled: 08/26/09 10:00**				
PCB-1016	EPA 8082	ND	-----	9.59	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 09:41	
PCB-1221	"	ND	-----	9.59	"	"	"	"	"	
PCB-1232	"	ND	-----	9.59	"	"	"	"	"	
PCB-1242	"	ND	-----	9.59	"	"	"	"	"	
PCB-1248	"	ND	-----	9.59	"	"	"	"	"	
PCB-1254	"	ND	-----	9.59	"	"	"	"	"	
PCB-1260	"	ND	-----	9.59	"	"	"	"	"	
Surrogate(s): TCX		*95.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*73.0%*			*35 - 157 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**				**Sampled: 08/26/09 10:00**				
PCB-1016	EPA 8082	ND	-----	9.93	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 10:03	
PCB-1221	"	ND	-----	9.93	"	"	"	"	"	
PCB-1232	"	ND	-----	9.93	"	"	"	"	"	
PCB-1242	"	ND	-----	9.93	"	"	"	"	"	
PCB-1248	"	ND	-----	9.93	"	"	"	"	"	
PCB-1254	"	ND	-----	9.93	"	"	"	"	"	
PCB-1260	"	ND	-----	9.93	"	"	"	"	"	
Surrogate(s): TCX		*88.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*71.1%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-05 (G-GA-D-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
PCB-1016	EPA 8082	ND	-----	9.89	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 10:26	
PCB-1221	"	ND	-----	9.89	"	"	"	"	"	
PCB-1232	"	ND	-----	9.89	"	"	"	"	"	
PCB-1242	"	ND	-----	9.89	"	"	"	"	"	
PCB-1248	"	ND	-----	9.89	"	"	"	"	"	
PCB-1254	"	ND	-----	9.89	"	"	"	"	"	
PCB-1260	"	ND	-----	9.89	"	"	"	"	"	
Surrogate(s): TCX		*68.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*60.5%*			*35 - 157 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00449	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:34	
2-Methylnaphthalene	"	ND	-----	0.00449	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00449	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00449	"	"	"	"	"	
Anthracene	"	**0.00499**	-----	0.00449	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Chrysene	"	ND	-----	0.00449	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00449	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Fluorene	"	**0.00499**	-----	0.00449	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00449	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00449	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00449	"	"	"	"	"	
Pyrene	"	ND	-----	0.00449	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*76.0%*			*38.8 - 139 %*	"			"	
2-FBP		*84.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*98.6%*			*31.7 - 179 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00457	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:12	
2-Methylnaphthalene	"	ND	-----	0.00457	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00457	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00457	"	"	"	"	"	
Anthracene	"	ND	-----	0.00457	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00457	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00457	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00457	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00457	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00457	"	"	"	"	"	
Chrysene	"	ND	-----	0.00457	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00457	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00457	"	"	"	"	"	
Fluorene	"	ND	-----	0.00457	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00457	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Naphthalene	EPA 8270 mod.	ND	-----	0.00457	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:12	
Phenanthrene	"	ND	-----	0.00457	"	"	"	"	"	
Pyrene	"	ND	-----	0.00457	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*71.8%*			*38.8 - 139 %*	"			"	
2-FBP		*74.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*87.4%*			*31.7 - 179 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00451	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 19:51	
2-Methylnaphthalene	"	ND	-----	0.00451	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00451	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00451	"	"	"	"	"	
Anthracene	"	ND	-----	0.00451	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00451	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00451	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00451	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00451	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00451	"	"	"	"	"	
Chrysene	"	**0.00652**	-----	0.00451	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00451	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00451	"	"	"	"	"	
Fluorene	"	ND	-----	0.00451	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00451	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00451	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00451	"	"	"	"	"	
Pyrene	"	**0.00752**	-----	0.00451	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*69.8%*			*38.8 - 139 %*	"			"	
2-FBP		*76.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*87.6%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-05 (G-GA-D-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00449	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 19:29	
2-Methylnaphthalene	"	ND	-----	0.00449	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00449	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00449	"	"	"	"	"	
Anthracene	"	**0.00749**	-----	0.00449	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00449	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Chrysene	"	**0.00549**	-----	0.00449	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00449	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00449	"	"	"	"	"	
Fluorene	"	**0.00599**	-----	0.00449	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00449**	-----	0.00449	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00449	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00449	"	"	"	"	"	
Pyrene	"	**0.00649**	-----	0.00449	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*58.6%*			*38.8 - 139 %*	"			"	
2-FBP		*60.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*104%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.



Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
% Solids	TA SOP	**89.0**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-03 (G-GA3-20-082608)		**Soil**				**Sampled: 08/26/09 10:00**				
% Solids	TA SOP	**87.6**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-04 (GA-D2-082609)		**Soil**				**Sampled: 08/26/09 10:00**				
% Solids	TA SOP	**88.6**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-05 (G-GA-D-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
% Solids	TA SOP	**89.0**	-----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-02 (Trip Blank)		**Other (S)**			**Sampled: 09/08/09 00:00**					
Dichlorodifluoromethane	8260B STD	ND	*8.0*	40	ug/Kg	1x	50920	09/25/09 16:16	09/25/09 22:34	**H**
Chloromethane	"	ND	*60*	400	"	"	"	"	"	**H**
Vinyl chloride	"	ND	*1.7*	8.0	"	"	"	"	"	**H**
Bromomethane	"	ND	*25*	140	"	"	"	"	"	**H**
Chloroethane	"	ND	*23*	400	"	"	"	"	"	**H**
Trichlorofluoromethane	"	ND	*5.0*	40	"	"	"	"	"	**H**
1,1-Dichloroethene	"	ND	*5.0*	20	"	"	"	"	"	**H**
Methylene Chloride	"	ND	*3.8*	40	"	"	"	"	"	**H**
trans-1,2-Dichloroethene	"	ND	*3.5*	40	"	"	"	"	"	**H**
1,1-Dichloroethane	"	ND	*3.8*	40	"	"	"	"	"	**H**
2,2-Dichloropropane	"	ND	*3.7*	40	"	"	"	"	"	**H**
cis-1,2-Dichloroethene	"	ND	*2.4*	40	"	"	"	"	"	**H**
Chlorobromomethane	"	ND	*12*	40	"	"	"	"	"	**H**
Chloroform	"	ND	*2.1*	40	"	"	"	"	"	**H**
1,1,1-Trichloroethane	"	ND	*5.0*	40	"	"	"	"	"	**H**
Carbon tetrachloride	"	ND	*3.7*	20	"	"	"	"	"	**H**
1,1-Dichloropropene	"	ND	*1.8*	40	"	"	"	"	"	**H**
Benzene	"	ND	*2.5*	16	"	"	"	"	"	**H**
1,2-Dichloroethane	"	ND	*2.2*	40	"	"	"	"	"	**H**
Trichloroethene	"	ND	*3.4*	16	"	"	"	"	"	**H**
1,2-Dichloropropane	"	ND	*3.9*	12	"	"	"	"	"	**H, ***
Dibromomethane	"	ND	*4.0*	40	"	"	"	"	"	**H**
Dichlorobromomethane	"	ND	*3.0*	40	"	"	"	"	"	**H**
cis-1,3-Dichloropropene	"	ND	*2.4*	16	"	"	"	"	"	**H**
Toluene	"	ND	*2.4*	40	"	"	"	"	"	**H**
trans-1,3-Dichloropropene	"	ND	*4.0*	16	"	"	"	"	"	**H**
1,1,2-Trichloroethane	"	ND	*1.8*	12	"	"	"	"	"	**H**
Tetrachloroethene	"	ND	*2.1*	20	"	"	"	"	"	**H**
1,3-Dichloropropane	"	ND	*5.0*	40	"	"	"	"	"	**H**
Chlorodibromomethane	"	ND	*8.0*	40	"	"	"	"	"	**H**
Ethylene Dibromide	"	ND	*3.2*	40	"	"	"	"	"	**H**
Chlorobenzene	"	ND	*2.3*	40	"	"	"	"	"	**H**
Ethylbenzene	"	ND	*3.7*	40	"	"	"	"	"	**H**
1,1,1,2-Tetrachloroethane	"	ND	*4.8*	40	"	"	"	"	"	**H**
1,1,2,2-Tetrachloroethane	"	ND	*3.3*	10	"	"	"	"	"	**H**
m-Xylene & p-Xylene	"	ND	*7.8*	40	"	"	"	"	"	**H**
o-Xylene	"	ND	*2.3*	40	"	"	"	"	"	**H**
Styrene	"	ND	*3.8*	40	"	"	"	"	"	**H**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-02 (Trip Blank)		**Other (S)**			**Sampled: 09/08/09 00:00**					
Bromoform	8260B STD	ND	*11*	40	ug/Kg	1x	50920	09/25/09 16:16	09/25/09 22:34	**H**
Isopropylbenzene	"	ND	*1.8*	40	"	"	"	"	"	**H**
Bromobenzene	"	ND	*2.7*	40	"	"	"	"	"	**H**
N-Propylbenzene	"	ND	*2.8*	40	"	"	"	"	"	**H**
1,2,3-Trichloropropane	"	ND	*12*	40	"	"	"	"	"	**H**
2-Chlorotoluene	"	ND	*5.4*	40	"	"	"	"	"	**H**
1,3,5-Trimethylbenzene	"	ND	*4.2*	40	"	"	"	"	"	**H**
4-Chlorotoluene	"	ND	*13*	40	"	"	"	"	"	**H**
tert-Butylbenzene	"	ND	*3.2*	40	"	"	"	"	"	**H**
1,2,4-Trimethylbenzene	"	ND	*2.1*	40	"	"	"	"	"	**H**
sec-Butylbenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
1,3-Dichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
4-Isopropyltoluene	"	ND	*2.8*	40	"	"	"	"	"	**H**
1,4-Dichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
n-Butylbenzene	"	ND	*7.3*	40	"	"	"	"	"	**H**
1,2-Dichlorobenzene	"	ND	*2.6*	40	"	"	"	"	"	**H**
1,2-Dibromo-3-Chloropropane	"	ND	*66*	200	"	"	"	"	"	**H**
1,2,4-Trichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
1,2,3-Trichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
Hexachlorobutadiene	"	ND	*5.6*	40	"	"	"	"	"	**H**
Naphthalene	"	ND	*6.0*	40	"	"	"	"	"	**H**

Surrogate(s):	*Fluorobenzene (Surr)*	*102%*	*75 - 125 %*	"	"
	Toluene-d8 (Surr)	*98%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*102%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*99%*	*85 - 120 %*	"	"
	Trifluorotoluene (Surr)	*92%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090070 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090070-BLK1)								**Extracted: 09/10/09 14:30**						
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/16/09 11:26	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 88.1%*			*Limits: 50-150%*	"							*09/16/09 11:26*	
p-Terphenyl-d14		*110%*			*50-150%*	"							"	
LCS (9090070-BS1)								**Extracted: 09/10/09 14:30**						
Diesel Range Hydrocarbons	NWTPH-Dx	61.1	---	10.0	mg/kg wet	1x	--	83.3	73.4%	(73-133)	--	--	09/16/09 11:50	
Surrogate(s): 2-FBP		*Recovery: 94.5%*			*Limits: 50-150%*	"							*09/16/09 11:50*	
p-Terphenyl-d14		*107%*			*50-150%*	"							"	
Duplicate (9090070-DUP1)							**QC Source: SSH0168-24**						**Extracted: 09/10/09 14:30**	
Diesel Range Hydrocarbons	NWTPH-Dx	1820	---	34.8	mg/kg dry	1x	1790	--	--	--	1.21%	(40)	09/16/09 22:34	
Heavy Oil Range Hydrocarbons	"	2050	---	87.1	"	"	2050	--	--	--	0.0467%	"	"	
Surrogate(s): 2-FBP		*Recovery: 111%*			*Limits: 50-150%*	"							*09/16/09 22:34*	
p-Terphenyl-d14		*117%*			*50-150%*	"							"	
Matrix Spike (9090070-MS1)							**QC Source: SSH0168-24**						**Extracted: 09/10/09 14:30**	
Diesel Range Hydrocarbons	NWTPH-Dx	2470	---	34.8	mg/kg dry	1x	1790	290	235%	(70.1-139)	--	--	09/16/09 22:57	MHA
Surrogate(s): 2-FBP		*Recovery: 118%*			*Limits: 50-150%*	"							*09/16/09 22:57*	
p-Terphenyl-d14		*118%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090142 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090142-BLK1)							**Extracted: 09/21/09 13:29**							
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/24/09 08:32	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): TCX		*Recovery: 106%*			*Limits: 27.9-154%*	"							*09/24/09 08:32*	
Decachlorobiphenyl		*90.8%*			*35-157%*	"							"	
LCS (9090142-BS1)							**Extracted: 09/21/09 13:29**							
PCB-1016	EPA 8082	186	---	10.0	ug/kg wet	1x	--	167	111%	(63.1-147)	--	--	09/24/09 08:55	
PCB-1260	"	190	---	10.0	"	"	--	"	114%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 112%*			*Limits: 27.9-154%*	"							*09/24/09 08:55*	
Decachlorobiphenyl		*98.0%*			*35-157%*	"							"	
Matrix Spike (9090142-MS1)					**QC Source: SSI0046-05**		**Extracted: 09/21/09 13:29**							
PCB-1016	EPA 8082	140	---	9.89	ug/kg dry	1x	ND	187	74.9%	(50.6-145)	--	--	09/24/09 10:49	
PCB-1260	"	122	---	9.89	"	"	ND	"	65.4%	(57.6-120)	--	--	"	
Surrogate(s): TCX		*Recovery: 76.7%*			*Limits: 27.9-154%*	"							*09/24/09 10:49*	
Decachlorobiphenyl		*62.5%*			*35-157%*	"							"	
Matrix Spike Dup (9090142-MSD1)					**QC Source: SSI0046-05**		**Extracted: 09/21/09 13:29**							
PCB-1016	EPA 8082	147	---	9.89	ug/kg dry	1x	ND	187	78.4%	(50.6-145)	4.51%	(40)	09/24/09 11:12	
PCB-1260	"	123	---	9.89	"	"	ND	"	65.8%	(57.6-120)	0.624%	(27.4)	"	
Surrogate(s): TCX		*Recovery: 85.0%*			*Limits: 27.9-154%*	"							*09/24/09 11:12*	
Decachlorobiphenyl		*63.7%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090060 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090060-BLK1)							**Extracted: 09/10/09 09:59**							
1-Methylnapthalene	EPA 8270 mod.	ND	---	0.00467	mg/kg wet	1x	--	--	--	--	--	--	09/14/09 16:07	
2-Methylnaphthalene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (ghi) perylene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	---	0.00467	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 49.6%*			*Limits: 38.8-139%*	"							*09/14/09 16:07*	
2-FBP		*56.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*72.4%*			*31.7-179%*	"							"	
LCS (9090060-BS1)							**Extracted: 09/10/09 09:59**							
Chrysene	EPA 8270 mod.	0.352	---	0.00667	mg/kg wet	1x	--	0.444	79.1%	(47.8-120)	--	--	09/14/09 18:40	
Fluorene	"	0.292	---	0.00667	"	"	--	"	65.7%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.336	---	0.00667	"	"	--	"	75.6%	(39.5-120)	--	--	"	
Naphthalene	"	0.260	---	0.00667	"	"	--	"	58.6%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 64.8%*			*Limits: 38.8-139%*	"							*09/14/09 18:40*	
2-FBP		*69.4%*			*40-132%*	"							"	
p-Terphenyl-d14		*84.6%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090060 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090060-MS1)				**QC Source: SSH0168-24**					**Extracted: 09/10/09 09:59**					
Chrysene	EPA 8270 mod.	0.369	---	0.00774	mg/kg dry	1x	0.0733	0.516	57.2%	(31.6-132)	--	--	09/15/09 20:17	
Fluorene	"	0.222	---	0.00774	"	"	0.184	"	7.40%	(43.4-123)	--	--	"	M8
Indeno (1,2,3-cd) pyrene	"	0.292	---	0.00774	"	"	0.0155	"	53.5%	(28.3-147)	--	--	"	
Naphthalene	"	0.490	---	0.00774	"	"	0.109	"	73.8%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 104%*			*Limits: 38.8-139%*	"							*09/15/09 20:17*	
2-FBP		*20.6%*			*40-132%*	"							"	*Z*
p-Terphenyl-d14		*116%*			*31.7-179%*	"							"	
Matrix Spike Dup (9090060-MSD1)				**QC Source: SSH0168-24**					**Extracted: 09/10/09 09:59**					
Chrysene	EPA 8270 mod.	0.370	---	0.00774	mg/kg dry	1x	0.0733	0.516	57.4%	(31.6-132)	0.280%	(30.2)	09/15/09 20:39	
Fluorene	"	0.470	---	0.00774	"	"	0.184	"	55.4%	(43.4-123)	71.6%	(36)	"	R
Indeno (1,2,3-cd) pyrene	"	0.294	---	0.00774	"	"	0.0155	"	53.9%	(28.3-147)	0.705%	(32.7)	"	
Naphthalene	"	0.426	---	0.00774	"	"	0.109	"	61.3%	(30.9-120)	14.1%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 148%*			*Limits: 38.8-139%*	"							*09/15/09 20:39*	*ZX*
2-FBP		*40.2%*			*40-132%*	"							"	
p-Terphenyl-d14		*110%*			*31.7-179%*	"							"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Conventional Chemistry Parameters by APHA/EPA Methods - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090098 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090098-DUP1)					**QC Source: SSI0046-05**				**Extracted: 09/10/09 10:10**					
% Solids	TA SOP	89.3	---	0.0100	% by Weight	1x	89.0	--	--	--	0.337%	(5)	09/10/09 15:00	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50920 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50930-3)				QC Source:					Extracted: 09/25/09 16:16					
Dichlorodifluoromethane	8260B STD	ND	8.0	40	ug/Kg	1x	--	--	--	--	--	--	09/25/09 20:10	
Chloromethane	"	ND	60	400	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	1.7	8.0	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	25	140	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	23	400	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	5.0	20	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	3.5	40	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	3.7	40	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	2.4	40	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	12	40	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	2.1	40	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	3.7	20	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	1.8	40	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	2.5	16	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	2.2	40	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	3.4	16	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	3.9	12	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	4.0	40	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	3.0	40	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	2.4	16	"	"	--	--	--	--	--	--	"	
Toluene	"	ND	2.4	40	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	4.0	16	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	1.8	12	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	2.1	20	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	8.0	40	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	3.2	40	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	ND	2.3	40	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	3.7	40	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	4.8	40	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	3.3	10	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	7.8	40	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	2.3	40	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	11	40	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50920 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50930-3)				**QC Source:**					**Extracted: 09/25/09 16:16**					
Isopropylbenzene	8260B STD	ND	1.8	40	ug/Kg	1x	--	--	--	--	--	--	09/25/09 20:10	
Bromobenzene	"	ND	2.7	40	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	2.8	40	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	12	40	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	5.4	40	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	4.2	40	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	13	40	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	3.2	40	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	2.1	40	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
1,3-Dichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	2.8	40	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	7.3	40	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	2.6	40	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	66	200	"	"	--	--	--	--	--	--	"	
1,2,4-Trichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	5.6	40	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	6.0	40	"	"	--	--	--	--	--	--	"	
Surrogate(s): Fluorobenzene (Surr)		*Recovery: 100%*			*Limits: 75-125%*	"							*09/25/09 20:10*	
Toluene-d8 (Surr)		*96%*			*85-115%*	"							"	
Ethylbenzene-d10		*101%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*97%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*98%*			*75-125%*	"							"	
LCS (580-50930-4)				**QC Source:**					**Extracted: 09/25/09 16:16**					
Dichlorodifluoromethane	8260B STD	821	8.0	40	ug/Kg	1x	--	787	104%	(35-135)	--	--	09/25/09 20:34	
Chloromethane	"	724	60	400	"	"	--	800	90%	(50-130)	--	--	"	
Vinyl chloride	"	798	1.7	8.0	"	"	--	"	100%	(60-125)	--	--	"	
Bromomethane	"	408	25	140	"	"	--	"	51%	(30-160)	--	--	"	
Chloroethane	"	452	23	400	"	"	--	802	56%	(40-155)	--	--	"	
Trichlorofluoromethane	"	877	5.0	40	"	"	--	792	111%	(25-185)	--	--	"	
1,1-Dichloroethene	"	927	5.0	20	"	"	--	"	117%	(65-135)	--	--	"	
Methylene Chloride	"	837	3.8	40	"	"	--	800	105%	(55-140)	--	--	"	
trans-1,2-Dichloroethene	"	873	3.5	40	"	"	--	"	109%	(65-135)	--	--	"	
1,1-Dichloroethane	"	866	3.8	40	"	"	--	797	109%	(75-125)	--	--	"	
2,2-Dichloropropane	"	908	3.7	40	"	"	--	800	114%	(65-135)	--	--	"	
cis-1,2-Dichloroethene	"	876	2.4	40	"	"	--	"	109%	(65-125)	--	--	"	
Chlorobromomethane	"	801	12	40	"	"	--	794	101%	(70-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50920 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50930-4)				**QC Source:**						**Extracted: 09/25/09 16:16**				
Chloroform	"	745	2.1	40	"	"	--	799	93%	"	--	--	"	
1,1,1-Trichloroethane	"	765	5.0	40	"	"	--	800	96%	(70-135)	--	--	"	
Carbon tetrachloride	"	754	3.7	20	"	"	--	"	94%	(65-135)	--	--	"	
1,1-Dichloropropene	"	861	1.8	40	"	"	--	796	108%	(70-135)	--	--	"	
Benzene	"	867	2.5	16	"	"	--	800	108%	(75-125)	--	--	"	
1,2-Dichloroethane	"	795	2.2	40	"	"	--	"	99%	(70-135)	--	--	"	
Trichloroethene	"	867	3.4	16	"	"	--	801	108%	(75-125)	--	--	"	
1,2-Dichloropropane	"	980	3.9	12	"	"	--	800	122%	(70-120)	--	--	"	*
Dibromomethane	"	781	4.0	40	"	"	--	789	99%	(75-130)	--	--	"	
Dichlorobromomethane	"	667	3.0	40	"	"	--	800	83%	(70-130)	--	--	"	
cis-1,3-Dichloropropene	"	699	2.4	16	"	"	--	841	83%	(70-125)	--	--	"	
Toluene	"	814	2.4	40	"	"	--	800	102%	"	--	--	"	
trans-1,3-Dichloropropene	"	654	4.0	16	"	"	--	760	86%	(65-125)	--	--	"	
1,1,2-Trichloroethane	"	695	1.8	12	"	"	--	789	88%	(60-125)	--	--	"	
Tetrachloroethene	"	923	2.1	20	"	"	--	801	115%	(65-140)	--	--	"	
1,3-Dichloropropane	"	785	5.0	40	"	"	--	796	99%	(75-125)	--	--	"	
Chlorodibromomethane	"	637	8.0	40	"	"	--	784	81%	(65-130)	--	--	"	
Ethylene Dibromide	"	694	3.2	40	"	"	--	792	88%	(70-125)	--	--	"	
Chlorobenzene	"	746	2.3	40	"	"	--	800	93%	(75-125)	--	--	"	
Ethylbenzene	"	872	3.7	40	"	"	--	"	109%	"	--	--	"	
1,1,1,2-Tetrachloroethane	"	756	4.8	40	"	"	--	787	96%	"	--	--	"	
1,1,2,2-Tetrachloroethane	"	633	3.3	10	"	"	--	"	80%	(55-130)	--	--	"	
m-Xylene & p-Xylene	"	1540	7.8	40	"	"	--	1600	96%	(80-125)	--	--	"	
o-Xylene	"	766	2.3	40	"	"	--	792	97%	(75-125)	--	--	"	
Styrene	"	824	3.8	40	"	"	--	798	103%	"	--	--	"	
Bromoform	"	594	11	40	"	"	--	794	75%	(55-135)	--	--	"	
Isopropylbenzene	"	713	1.8	40	"	"	--	800	89%	(75-130)	--	--	"	
Bromobenzene	"	822	2.7	40	"	"	--	797	103%	(65-120)	--	--	"	
N-Propylbenzene	"	756	2.8	40	"	"	--	801	94%	(65-135)	--	--	"	
1,2,3-Trichloropropane	"	790	12	40	"	"	--	788	100%	(65-130)	--	--	"	
2-Chlorotoluene	"	861	5.4	40	"	"	--	791	109%	(70-130)	--	--	"	
1,3,5-Trimethylbenzene	"	823	4.2	40	"	"	--	"	104%	(65-135)	--	--	"	
4-Chlorotoluene	"	794	13	40	"	"	--	788	101%	(75-125)	--	--	"	
tert-Butylbenzene	"	813	3.2	40	"	"	--	792	103%	(65-130)	--	--	"	
1,2,4-Trimethylbenzene	"	817	2.1	40	"	"	--	796	103%	(65-135)	--	--	"	
sec-Butylbenzene	"	844	5.0	40	"	"	--	801	105%	(65-130)	--	--	"	
1,3-Dichlorobenzene	"	862	5.0	40	"	"	--	799	108%	(70-125)	--	--	"	
4-Isopropyltoluene	"	839	2.8	40	"	"	--	796	105%	(75-135)	--	--	"	
1,4-Dichlorobenzene	"	778	5.0	40	"	"	--	800	97%	(70-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50920 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50930-4)			**QC Source:**					**Extracted: 09/25/09 16:16**						
n-Butylbenzene	8260B STD	882	7.3	40	ug/Kg	1x	--	796	111%	(65-140)	--	--	09/25/09 20:34	
1,2-Dichlorobenzene	"	753	2.6	40	"	"	--	799	94%	(75-120)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	588	66	200	"	"	--	800	74%	(40-135)	--	--	"	
1,2,4-Trichlorobenzene	"	789	5.0	40	"	"	--	795	99%	(65-130)	--	--	"	
1,2,3-Trichlorobenzene	"	775	5.0	40	"	"	--	801	97%	(60-135)	--	--	"	
Hexachlorobutadiene	"	860	5.6	40	"	"	--	785	110%	(55-140)	--	--	"	
Naphthalene	"	711	6.0	40	"	"	--	801	89%	(40-125)	--	--	"	
Surrogate(s): *Fluorobenzene (Surr)*		*Recovery:* *101%*			*Limits:* *75-125%*	"							*09/25/09 20:34*	
Toluene-d8 (Surr)		*102%*			*85-115%*	"							"	
Ethylbenzene-d10		*95%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*93%*			*75-125%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Method Performed: 8260B STD

Samples: SSI0046-02

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Notes and Definitions

Report Specific Notes:

*	-	LCS or LCSD exceeds the control limits
H	-	Sample was prepped or analyzed beyond the specified holding time
H8	-	The sample was extracted past the holding time.
M8	-	The MS and/or MSD were below the acceptance limits. See Blank Spike (LCS).
MHA	-	Due to high levels of analyte in the sample, the MS/MSD calculation does not provide useful spike recovery information. See Blank Spike (LCS).
R	-	The RPD exceeded the method control limit due to sample matrix effects. The individual analyte QA/QC recoveries, however, were within acceptance limits.
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.
Reporting Limits	-	Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.
Electronic Signature	-	Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy.* Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSI00414

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond WA
PHONE: 425-883-0777 FAX: ~

INVOICE TO: ~ Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 083-93312
SAMPLED BY: A. COTE

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses
[10 STD.] [7] [5] [4] [3] [2] [1] [<1]
Petroleum Hydrocarbon Analyses
[5 STD.] [4] [3] [2] [1] [<1]
[OTHER] Specify:
* Turnaround Requests less than standard may incur Rush Charges.

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM NAPHTH. DX	EPA 8082	VOC 8260	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	G-GA1-21-082609	082609/ 3:15		X	X	X				-01
2	Trip Blank			X	X	X				-02
3	G-GA3-20-082609	082609/ 1630		X	X	X				-03
4	GA-D2-082609	082609/ 1020		X	X	X				-04
5	G-GA-D-082609	082609/ 3:15		X	X	X				-05
6										
7										
8										
9										
10										

RELEASED BY: [signature] DATE: 090809
PRINT NAME: Amanda Cote FIRM: GAI TIME: 3:15

RECEIVED BY: [signature] DATE: 9/9/09
PRINT NAME: C. Hanson FIRM: TestAmerica TIME: 1100

RELEASED BY: DATE:
PRINT NAME: FIRM: TIME:

RECEIVED BY: DATE:
PRINT NAME: FIRM: TIME:

ADDITIONAL REMARKS:
EPA 8270C inc. naphthalene, 1-methylnaphthalene & 2-methylnaphthalene

TEMP: 7.0

PAGE OF

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0046 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 9/9/09 11 00 Cooler signed for by: C. Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☑ same as date received *or* ____/____/____

Cooler opened by (print) C. Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☑ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☐ Other: ____

   Shipment Tracking # if applicable ____ (include copy of shipping papers in file)

2. Number of Custody Seals 0 Signed by ____ Date ___/___/___

   Were custody seals unbroken and intact on arrival? ☐ Yes ☑ No

3. Were custody papers sealed in a plastic bag? ☑ Yes ☐ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☑ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☑ Yes ☐ No

6. Was ice used? ☑ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☑ real ice ☐ dry ice Condition of Ice: melting

   Temperature by IR Gun 7.2 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☑ bubble wrap ☑ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags? ☐ Yes ☑ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☑ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☑ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☑ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☑ Yes ☐ No

13. Is there adequate volume for the tests requested? ☑ Yes ☐ No

14. Were VOA vials free of bubbles? ☑ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? ____

Log-in Phase:

Date of sample log-in 9/9/09

Samples logged in by (print) C. Hanson (sign) [signature]

1. Was project identifiable from custody papers? ☑ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☑ Yes ☐ No

3. Was the Project Manager notified of status? ☑ Yes ☐ No

4. Was the Lab notified of status? ☑ Yes ☐ No

5. Was the COC scanned and copied? ☑ Yes ☐ No

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: 073-93312.05		SITE: Avery Landing/ POTLATCH / Idaho
LABORATORY: Test America		SDG: #SSI0046
SAMPLES	Collect:	MATRIX
01 G-GA1-21	8-26-09	SOIL BORINGS
02 G-GA3-20	↓	↓
04 GA-D2	↓	↓
05 G-GA-D	↓	↓
TRIP Blank	9-08-09	WATER

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA	BNA	Pest / PCB	TPH-Dx	PAH - SIM	OTHER	OTHER
1. Data Completeness	O	✓	O	O ✓	O ✓		
2. Preservation, Holding Times (1)	X		O	X ✓	X ✓		
3.GC/MS Tune, Inst. Performance	O		—	—	O		
4. Calibrations	O		O	O	O		
5. Surrogates	O		O	O	O		
6. Internal Standards	—		—	—			
7. Lab Blanks, Field Blanks	O		O	O	O		
8. Lab Duplicates, Field Duplicates	O		O	O	O		
9. LCS, Blank Spike, MS/MSD	O		O	O	O		
10.Compound Identification, TICs	O		O	O	O		
11. Result Verification, D.Limits	O		O	O	O		
12. Overall Summary	O		O	O	O		

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Hold times out for VOA, TPH-Dx & PAH for all samples. Results qualified (J/UJ). All dates are just one day past recommended hold time. ✓ MS Confirmed 1-20-2010

(1) Cite new SW-846, Third Edition Update IV, Chapter 4, Section 4.1, Table 4-1. MS

Validated by: Tom Rapp Date: Nov. 10, 2009

Reviewed by: Date:

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

YES ☑ NO ☐

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ Detection Limits
- ✓ GC/MS Tuning
- ✓ Initial Calibration
- ✓ Continuing Calib.
- ✓ Blank Results
- ✓ Surrogate Results
- Internal Standards
- ✓ MS/MSD, LCS Results
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ Raw Data
- Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: _____

2. Holding Times (Check all that apply)..... ☐ ☒

- Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
- BNA samples extracted within 7 days (14 day soil) of collection
- BNA extracts analyzed within 40 days of collection
- ✓ Pest/PCBs samples extracted within 7 days (14 day soil) of collection — NO QUAL.
- Pest/PCBs extracts analyzed within 40 days of collection

Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results:

⊗ TPH-Dx – 15 Days assoc. results J/UJ
PCB – No Qual. 26 Days
⊗ PAHs – 15 Days assoc. Qual J/UJ
⊗ VOA – 17 Days " " J/UJ

3. GC Instrument Tune, Performance Check ..... ☑ ☐

- ✓ GC/MS Tuning performed
- GC/MS Tuning within control limits
- GC/MS Tuning out of control limits, (qualify R/UR)
- Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
- PEM resolution <90% adj pks, (J for detects, UR other)
- DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
- Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results:

VOA 9/24 ✓, RRF & R^2 ✓, CCAL ✓
PCB 9/16, RRF ✓ & R^2 ✓, CCAL ✓
PAHs 9/13, Tune ✓, RRF ✓ & RSD ✓, R^2 ✓
TPH-Dx 9/11, RRF ✓

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☑ ☐

GC/MS Data: __ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
__ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: __RSD<10% for performance checks (If no J detects)
__Stnds analyzed prior to analysis, & at proper frequency
__Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

See section (3). ICAL & CCAL

5. Surrogates (Check all that apply)..... ☑ ☐

✓ Surrogates analyzed
✓ Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__Recoveries above Method Control limits (J detects only)
__Recoveries below Method Control limits but>20% (J/UJ)
__Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results

TPH-Dx ✓
PCB ✓
PAHs ✓
VOA – Trip Blank ✓

6. Internal Standards Performance..... ☐ ☐

__Internal standards added to all QC and samples
__Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
Associated with 12 Hour CCV Stnd.
__Internal standards out of Control limits but >10% (J/UJ)
__Internal standards zero or <10% of Control limits (J/UR)
__Internal standards RTs within +/-20 sec window (If no, J/UJ)

Comments/Qualified Results:

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☑ ☐

__Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

Examples:

BLANK			SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

VOA on Trip Blank = MB50920 ✓ All ND.

PAHs MB0060 ✓

PCB MB 0142 ✓

TPH-Dx MB 0070 ✓

8. Duplicate, Field Duplicates (Check all that apply)..... ☑ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results

PAHs #0060 on MS/MSD non-assoc. ✓

PCB - MS/MSD RPD ✓

TPH-Dx ✓ non-assoc. Smpl.

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply).... ☑ ☐

✓ LCS %R 80-120%
✓ LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: VOA LCS recovery: 1,2dCPropane ↑ assoc. detect qualif. (J) - No Qual - No detect.

PAHs - 0060-BS1 ✓, MS/MSD non-assoc. Smpl. ✓

PCBs #0142 LCS ✓, MS/MSD on Smpl. -05 ✓ for A1016, 1260.

TPH-Dx #0070 LCS ✓, MS sample non-assoc. ✓

	Acceptable: Yes	NO
10.Compound Identification, TICs	☑	☐

Comments/Qualified Results: _____

	Yes	NO
11. Result Verification, Detection Limits	☑	☐

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: _____

	Yes	NO
12. Overall Assessment	☑	☐

Comments/Qualified Results: _____

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Data Deliverable Package

Golder Associates, Inc.
Doug Morell
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project: Avery Landing

Project Number: 073-93312-03

Laboratory Work Order: SSI0046

November 9, 2009

Total Pages
794

TestAmerica-Spokane
11922 E. 1st Avenue
Spokane, WA 99206

Phone: (509) 924-9200
Fax: (509)924-9290

CASE NARRATIVE

Client: TestAmerica Laboratories, Inc

Project: SSI0046

Report Number: 580-15384-1

This case narrative is in the form of an exception report, where only the anomalies related to this report, method specific performance and/or QA/QC issues are discussed. If there are no issues to report, this narrative will include a statement that documents that there are no relevant data issues.

It should be noted that samples with elevated Reporting Limits (RLs) as a result of a dilution may not be able to satisfy customer reporting limits in some cases. Such increases in the RLs are unavoidable but acceptable consequence of sample dilution that enables quantification of target analytes or interferences which exceed the calibration range of the instrument.

Calculations are performed before rounding to avoid round-off errors in calculated results.

All holding times were met and proper preservation noted for the methods performed on these samples, unless otherwise detailed in the individual sections below.

RECEIPT
The samples were received on 09/11/2009; the samples arrived in good condition, properly preserved and on ice. The temperature of the coolers at receipt was 2.8 C.

Note: All samples which require thermal preservation are considered acceptable if the arrival temperature is within 2C of the required temperature or method specified range. For samples with a specified temperature of 4C, samples with a temperature ranging from just above freezing temperature of water to 6C shall be acceptable. Samples that are hand delivered immediately following collection may not meet these criteria, however they will be deemed acceptable according to NELAC standards, if there is evidence that the chilling process has begun, such as arrival on ice, etc.

VOLATILE ORGANIC COMPOUNDS (GC-MS)
Sample 580-15384-1 was analyzed for volatile organic compounds (GC-MS) in accordance with EPA SW-846 Method 8260B. The samples were prepared and analyzed on 09/25/2009.

1,2-Dichloropropane failed the recovery criteria high for LCS 580-50920/2-A. This analyte was biased high in the LCS and was not detected in the associated sample; therefore, the data have been reported.

No other difficulties were encountered during the volatiles analysis.

All other quality control parameters were within the acceptance limits.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 8/26/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0046		
NJDEP#:	PA004		

SAMPLE RECEIPT: Samples were received intact, on ice, with custody seals and chain of custody documentation. The Cooler(s) were received and the sample temperature(s) were measured at 7.2° C upon receipt at the laboratory.

HOLDING TIMES: The sample analysis for SSI0046-02 in batch 50920 by 8260B was performed past method-specified holding time.

Samples SSI0046-01, -03, -04 and -05 in batch 9090060 by EPA 8270 mod. were extracted past the holding time.

Sample SSI0046-01, -03, -04 and -05 in batch 9090070 by NWTPH-Dx was extracted past the holding time.

As per EPA SW846 revision 4 the holding time for 8082 PCB analysis is one year from collection.

PROBLEMS ENCOUNTERED: No problems were encountered.

QA/QC CRITERIA: Due to sample matrix effects in sample 9090060-MS1, the surrogate recovery was below the acceptance limits in batch 9090060 EPA 8270 mod..

The Fluorene recovery in samples 9090060-MS1 was below the acceptance limits for EPA 8270 mod., batch 9090060. See Blank Spike (LCS).

The Fluorene RPD for sample 9090060-MSD1 in batch 9090060 for EPA 8270 mod. exceeded the method control limit due to sample matrix effects. The individual analyte QA/QC recoveries, however, were within acceptance limits.

Due to sample matrix effects in sample 9090060-MSD1 batch 9090060 by EPA 8270 mod., the Nitrobenzene-d5 recovery was outside the acceptance limits.

Due to high levels of analyte in the sample, the MS/MSD calculation does

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 8/26/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0046		
NJDEP#:	PA004		

not provide useful spike recovery information for batch 9090070 by NWTPH-Dx. See Blank Spike (LCS).

OBSERVATIONS: No significant observations were made.

SUBCONTRACTED: EPA 8260B was subcontracted to the TestAmerica Tacoma laboratory.

TestAmerica Spokane

Randee Decker
Project Manager

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave, Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSJ00414

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglass Morell
ADDRESS: 18300 Union Hill Rd, Suite 200
Redmond WA
PHONE: 425-883-0777 FAX: ℄

INVOICE TO: ℄ Same

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 083-93312
SAMPLED BY: A-COTE

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: [X] 10 STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: [X] STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	EPA 8270C SIM WATER	DX	EPA 8082	VOC 8260	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
G-GA1-2-082609	082609/ 3:15	X	X	X					-01
2 Trip Blank		~~X~~	~~X~~	~~X~~	X				-02
G-GA3-20-082609	082609/ 1000	X	X	X					-03
4 GA-D2-082609	082609/ 10:00	X	X	X					-04
5 G-GA-D-082609	082609/ 3:15	X	X	X					-05
6									
7									
8									
9									
10									

RELEASED BY: Amanda Cote — DATE: 090809 — TIME: 3:15
PRINT NAME: Amanda Cote — FIRM: GAI
RECEIVED BY: [signature] — DATE: 9/9/09
PRINT NAME: C Hanson — FIRM: TestAmerica — TIME: 1100

RELEASED BY: — DATE: — TIME:
PRINT NAME: — FIRM:
RECEIVED BY: — DATE: — TIME:
PRINT NAME: — FIRM:

ADDITIONAL REMARKS: EPA 8270C inc. naphthalene, 1-methylnaphthalene & 2-methylnaphthalene

TEMP: 7.0 °C

PAGE OF

TAL-1000(0408)

8

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSI00446

CLIENT: GOLDER ASSOC. INC

REPORT TO: Douglas Morell
ADDRESS: 18308 Union Hill Rd, Suite 200
Redmond WA
PHONE: 425-883-0777 FAX:

INVOICE TO: & Same

P.O. NUMBER:

PROJECT NAME: Arroy Landy
PROJECT NUMBER: 083-93312
SAMPLED BY: A. COTE

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [10] STD. [7] [5] [4] [3] [2] [1] [<1]

Petroleum Hydrocarbon Analyses: [5] STD. [4] [3] [2] [1] [<1]

[OTHER] Specify:

* Turnaround Requests less than standard may incur Rush Charges.

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES: EPA 8270C SIM (WATER) DC	REQUESTED ANALYSES: EPA 8082	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	G-GA1-21-082609	082609/ 3:15		X	X				-01
2	Trip Blank			X	X				-02
3	G-GA3-20-082609	082609/ 1630		X	X				-03
4	GA-D2-082609	082609/ 10.00		X	X				-04
5	G-GA-D-082609	082609/ 3:15		X	X				-05
6									
7									
8									
9									
10									

RELEASED BY: Amanda Cote — DATE: 090809 — TIME: 3:15
PRINT NAME: Amanda Cote — FIRM: GAI

RECEIVED BY: — DATE: 9/9/09
PRINT NAME: — FIRM: TestAmerica — TIME: 1100

RELEASED BY: — DATE:
PRINT NAME: — FIRM: — TIME:

RECEIVED BY: — DATE:
PRINT NAME: — FIRM: — TIME:

ADDITIONAL REMARKS:
EPA 8270C inc. naphthalene, 1-methylnaphthalene & 2-methylnaphthalene

TEMP: 1.7

PAGE OF

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0046 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 9/9/09 11 00 Cooler signed for by: C. Hanson (Print name)

Preliminary Examination Phase:

Date cooler opened: ☒ same as date received *or* ____/____/____

Cooler opened by (print) C. Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☒ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☐ Other: ____

   Shipment Tracking # if applicable ____ (include copy of shipping papers in file)

2. Number of Custody Seals 0 Signed by ____ Date __/__/__

   Were custody seals unbroken and intact on arrival? ☐ Yes ☒ No

3. Were custody papers sealed in a plastic bag? ☒ Yes ☐ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: Melting

   Temperature by IR Gun 7.2 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☒ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags? ☐ Yes ☒ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☒ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? ____

Log-in Phase:

Date of sample log-in 9/9/09

Samples logged in by (print) C. Hanson (sign) [signature]

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-GA1-21-082609	SSI0046-01	Soil	08/26/09 15:15	09/09/09 11:00
Trip Blank	SSI0046-02	Other (S)	09/08/09 00:00	09/09/09 11:00
G-GA3-20-082608	SSI0046-03	Soil	08/26/09 10:00	09/09/09 11:00
GA-D2-082609	SSI0046-04	Soil	08/26/09 10:00	09/09/09 11:00
G-GA-D-082609	SSI0046-05	Soil	08/26/09 15:15	09/09/09 11:00

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**37.1** J	----	11.2	mg/kg dry	1x	9090070	09/10/09 14:30	09/13/09 18:59	
Heavy Oil Range Hydrocarbons	"	**73.0** J	----	28.1	"	"	"	"	"	
Surrogate(s): 2-FBP		*96.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*119%*			*50 - 150 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**22.9** J	----	11.4	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 20:59	
Heavy Oil Range Hydrocarbons	"	**70.7** J	----	28.5	"	"	"	"	"	
Surrogate(s): 2-FBP		*93.0%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*125%*			*50 - 150 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**39.4** J	----	11.3	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 21:23	
Heavy Oil Range Hydrocarbons	"	**119** J	----	28.2	"	"	"	"	"	
Surrogate(s): 2-FBP		*95.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*123%*			*50 - 150 %*	"			"	
SSI0046-05 (G-GA-D-082609)		**Soil**			**Sampled: 08/26/09 15:15**					**H8**
Diesel Range Hydrocarbons	NWTPH-Dx	**50.1** J	----	11.2	mg/kg dry	1x	9090070	09/10/09 14:30	09/16/09 21:46	
Heavy Oil Range Hydrocarbons	"	**88.1** J	----	28.1	"	"	"	"	"	
Surrogate(s): 2-FBP		*87.1%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*111%*			*50 - 150 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**			**Sampled: 08/26/09 15:15**					
PCB-1016	EPA 8082	ND	----	9.89	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 09:18	
PCB-1221	"	ND	----	9.89	"	"	"	"	"	
PCB-1232	"	ND	----	9.89	"	"	"	"	"	
PCB-1242	"	ND	----	9.89	"	"	"	"	"	
PCB-1248	"	ND	----	9.89	"	"	"	"	"	
PCB-1254	"	ND	----	9.89	"	"	"	"	"	
PCB-1260	"	ND	----	9.89	"	"	"	"	"	
Surrogate(s): TCX		*89.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*71.7%*			*35 - 157 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					
PCB-1016	EPA 8082	ND	----	9.59	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 09:41	
PCB-1221	"	ND	----	9.59	"	"	"	"	"	
PCB-1232	"	ND	----	9.59	"	"	"	"	"	
PCB-1242	"	ND	----	9.59	"	"	"	"	"	
PCB-1248	"	ND	----	9.59	"	"	"	"	"	
PCB-1254	"	ND	----	9.59	"	"	"	"	"	
PCB-1260	"	ND	----	9.59	"	"	"	"	"	
Surrogate(s): TCX		*95.7%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*73.0%*			*35 - 157 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**			**Sampled: 08/26/09 10:00**					
PCB-1016	EPA 8082	ND	----	9.93	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 10:03	
PCB-1221	"	ND	----	9.93	"	"	"	"	"	
PCB-1232	"	ND	----	9.93	"	"	"	"	"	
PCB-1242	"	ND	----	9.93	"	"	"	"	"	
PCB-1248	"	ND	----	9.93	"	"	"	"	"	
PCB-1254	"	ND	----	9.93	"	"	"	"	"	
PCB-1260	"	ND	----	9.93	"	"	"	"	"	
Surrogate(s): TCX		*88.4%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*71.1%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-05 (G-GA-D-082609)		**Soil**			**Sampled: 08/26/09 15:15**					
PCB-1016	EPA 8082	ND	----	9.89	ug/kg dry	1x	9090142	09/21/09 14:51	09/24/09 10:26	
PCB-1221	"	ND	----	9.89	"	"	"	"	"	
PCB-1232	"	ND	----	9.89	"	"	"	"	"	
PCB-1242	"	ND	----	9.89	"	"	"	"	"	
PCB-1248	"	ND	----	9.89	"	"	"	"	"	
PCB-1254	"	ND	----	9.89	"	"	"	"	"	
PCB-1260	"	ND	----	9.89	"	"	"	"	"	
Surrogate(s): *TCX*		*68.0%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*60.5%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		Soil Q			Sampled: 08/26/09 15:15					H8
1-Methylnapthalene	EPA 8270 mod.	ND UJ	----	0.00449	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:34	
2-Methylnaphthalene	"	ND	----	0.00449	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00449	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00449	"	"	"	"	"	
Anthracene	"	**0.00499** J	----	0.00449	"	"	"	"	"	
Benzo (a) anthracene	"	ND UJ	----	0.00449	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00449	"	"	"	"	"	
Chrysene	"	ND	----	0.00449	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00449	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00449	"	"	"	"	"	
Fluorene	"	**0.00499** J	----	0.00449	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND UJ	----	0.00449	"	"	"	"	"	
Naphthalene	"	ND	----	0.00449	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00449	"	"	"	"	"	
Pyrene	"	ND	----	0.00449	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*76.0%*			*38.8 - 139 %*	"			"	
2-FBP		*84.2%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*98.6%*			*31.7 - 179 %*	"			"	
SSI0046-03 (G-GA3-20-082608)		Soil Q			Sampled: 08/26/09 10:00					H8
1-Methylnapthalene	EPA 8270 mod.	ND UJ	----	0.00457	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:12	
2-Methylnaphthalene	"	ND	----	0.00457	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00457	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00457	"	"	"	"	"	
Anthracene	"	ND	----	0.00457	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00457	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00457	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00457	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00457	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00457	"	"	"	"	"	
Chrysene	"	ND	----	0.00457	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00457	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00457	"	"	"	"	"	
Fluorene	"	ND	----	0.00457	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00457	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-03 (G-GA3-20-082608)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
Naphthalene	EPA 8270 mod.	ND UJ	----	0.00457	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 20:12	
Phenanthrene	"	ND	----	0.00457	"	"	"	"	"	
Pyrene	"	ND	----	0.00457	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*71.8%*			*38.8 - 139 %*	"			"	
2-FBP		*74.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*87.4%*			*31.7 - 179 %*	"			"	
SSI0046-04 (GA-D2-082609)		**Soil**			**Sampled: 08/26/09 10:00**					**H8**
1-Methylnapthalene	EPA 8270 mod.	ND UJ	----	0.00451	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 19:51	
2-Methylnaphthalene	"	ND	----	0.00451	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00451	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00451	"	"	"	"	"	
Anthracene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00451	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Chrysene	"	**0.00652** J	----	0.00451	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND UJ	----	0.00451	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00451	"	"	"	"	"	
Fluorene	"	ND	----	0.00451	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00451	"	"	"	"	"	
Naphthalene	"	ND	----	0.00451	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00451	"	"	"	"	"	
Pyrene	"	**0.00752** J	----	0.00451	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*69.8%*			*38.8 - 139 %*	"			"	
2-FBP		*76.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*87.6%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-05 (G-GA-D-082609)		Soil			Sampled: 08/26/09 15:15					H8
1-Methylnapthalene	EPA 8270 mod.	ND UJ	----	0.00449	mg/kg dry	1x	9090060	09/10/09 09:59	09/13/09 19:29	
2-Methylnaphthalene	"	ND	----	0.00449	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00449	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00449	"	"	"	"	"	
Anthracene	"	**0.00749** J	----	0.00449	"	"	"	"	"	
Benzo (a) anthracene	"	ND UJ	----	0.00449	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00449	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00449	"	"	"	"	"	
Chrysene	"	**0.00549** J	----	0.00449	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND UJ	----	0.00449	"	"	"	"	"	
Fluoranthene	"	ND UJ	----	0.00449	"	"	"	"	"	
Fluorene	"	**0.00599** J	----	0.00449	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00449** J	----	0.00449	"	"	"	"	"	
Naphthalene	"	ND UJ	----	0.00449	"	"	"	"	"	
Phenanthrene	"	ND UJ	----	0.00449	"	"	"	"	"	
Pyrene	"	**0.00649** J	----	0.00449	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*58.6%*			*38.8 - 139 %*	"			"	
2-FBP		*60.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*104%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-01 (G-GA1-21-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
% Solids	TA SOP	**89.0**	----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-03 (G-GA3-20-082608)		**Soil**				**Sampled: 08/26/09 10:00**				
% Solids	TA SOP	**87.6**	----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-04 (GA-D2-082609)		**Soil**				**Sampled: 08/26/09 10:00**				
% Solids	TA SOP	**88.6**	----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	
SSI0046-05 (G-GA-D-082609)		**Soil**				**Sampled: 08/26/09 15:15**				
% Solids	TA SOP	**89.0**	----	0.0100	% by Weight	1x	9090098	09/10/09 10:00	09/10/09 15:00	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-02 (Trip Blank)		**Other (S)**			**Sampled: 09/08/09 00:00**					
Dichlorodifluoromethane	8260B STD	ND UJ	*8.0*	40	ug/Kg	1x	50920	09/25/09 16:16	09/25/09 22:34	H
Chloromethane	"	ND	*60*	400	"	"	"	"	"	H
Vinyl chloride	"	ND	*1.7*	8.0	"	"	"	"	"	H
Bromomethane	"	ND	*25*	140	"	"	"	"	"	H
Chloroethane	"	ND	*23*	400	"	"	"	"	"	H
Trichlorofluoromethane	"	ND	*5.0*	40	"	"	"	"	"	H
1,1-Dichloroethene	"	ND	*5.0*	20	"	"	"	"	"	H
Methylene Chloride	"	ND	*3.8*	40	"	"	"	"	"	H
trans-1,2-Dichloroethene	"	ND	*3.5*	40	"	"	"	"	"	H
1,1-Dichloroethane	"	ND	*3.8*	40	"	"	"	"	"	H
2,2-Dichloropropane	"	ND	*3.7*	40	"	"	"	"	"	H
cis-1,2-Dichloroethene	"	ND	*2.4*	40	"	"	"	"	"	H
Chlorobromomethane	"	ND	*12*	40	"	"	"	"	"	H
Chloroform	"	ND	*2.1*	40	"	"	"	"	"	H
1,1,1-Trichloroethane	"	ND	*5.0*	40	"	"	"	"	"	H
Carbon tetrachloride	"	ND	*3.7*	20	"	"	"	"	"	H
1,1-Dichloropropene	"	ND	*1.8*	40	"	"	"	"	"	H
Benzene	"	ND	*2.5*	16	"	"	"	"	"	H
1,2-Dichloroethane	"	ND	*2.2*	40	"	"	"	"	"	H
Trichloroethene	"	ND	*3.4*	16	"	"	"	"	"	H
1,2-Dichloropropane	"	ND	*3.9*	12	"	"	"	"	"	H, *
Dibromomethane	"	ND	*4.0*	40	"	"	"	"	"	H
Dichlorobromomethane	"	ND	*3.0*	40	"	"	"	"	"	H
cis-1,3-Dichloropropene	"	ND	*2.4*	16	"	"	"	"	"	H
Toluene	"	ND	*2.4*	40	"	"	"	"	"	H
trans-1,3-Dichloropropene	"	ND	*4.0*	16	"	"	"	"	"	H
1,1,2-Trichloroethane	"	ND	*1.8*	12	"	"	"	"	"	H
Tetrachloroethene	"	ND	*2.1*	20	"	"	"	"	"	H
1,3-Dichloropropane	"	ND	*5.0*	40	"	"	"	"	"	H
Chlorodibromomethane	"	ND	*8.0*	40	"	"	"	"	"	H
Ethylene Dibromide	"	ND	*3.2*	40	"	"	"	"	"	H
Chlorobenzene	"	ND	*2.3*	40	"	"	"	"	"	H
Ethylbenzene	"	ND	*3.7*	40	"	"	"	"	"	H
1,1,1,2-Tetrachloroethane	"	ND	*4.8*	40	"	"	"	"	"	H
1,1,2,2-Tetrachloroethane	"	ND	*3.3*	10	"	"	"	"	"	H
m-Xylene & p-Xylene	"	ND	*7.8*	40	"	"	"	"	"	H
o-Xylene	"	ND	*2.3*	40	"	"	"	"	"	H
Styrene	"	ND	*3.8*	40	"	"	"	"	"	H

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0046-02 (Trip Blank)		Other (S)			Sampled: 09/08/09 00:00					
Bromoform	8260B STD	ND UJ	11	40	ug/Kg	1x	50920	09/25/09 16:16	09/25/09 22:34	H
Isopropylbenzene	"	ND	1.8	40	"	"	"	"	"	H
Bromobenzene	"	ND	2.7	40	"	"	"	"	"	H
N-Propylbenzene	"	ND	2.8	40	"	"	"	"	"	H
1,2,3-Trichloropropane	"	ND	12	40	"	"	"	"	"	H
2-Chlorotoluene	"	ND	5.4	40	"	"	"	"	"	H
1,3,5-Trimethylbenzene	"	ND	4.2	40	"	"	"	"	"	H
4-Chlorotoluene	"	ND	13	40	"	"	"	"	"	H
tert-Butylbenzene	"	ND	3.2	40	"	"	"	"	"	H
1,2,4-Trimethylbenzene	"	ND	2.1	40	"	"	"	"	"	H
sec-Butylbenzene	"	ND	5.0	40	"	"	"	"	"	H
1,3-Dichlorobenzene	"	ND	5.0	40	"	"	"	"	"	H
4-Isopropyltoluene	"	ND	2.8	40	"	"	"	"	"	H
1,4-Dichlorobenzene	"	ND	5.0	40	"	"	"	"	"	H
n-Butylbenzene	"	ND	7.3	40	"	"	"	"	"	H
1,2-Dichlorobenzene	"	ND	2.6	40	"	"	"	"	"	H
1,2-Dibromo-3-Chloropropane	"	ND	66	200	"	"	"	"	"	H
1,2,4-Trichlorobenzene	"	ND	5.0	40	"	"	"	"	"	H
1,2,3-Trichlorobenzene	"	ND	5.0	40	"	"	"	"	"	H
Hexachlorobutadiene	"	ND	5.6	40	"	"	"	"	"	H
Naphthalene	"	ND	6.0	40	"	"	"	"	"	H

Surrogate(s):	*Fluorobenzene (Surr)*	*102%*	*75 - 125 %*	"	"
	Toluene-d8 (Surr)	*98%*	*85 - 115 %*	"	"
	Ethylbenzene-d10	*102%*	*75 - 125 %*	"	"
	4-Bromofluorobenzene (Surr)	*99%*	*85 - 120 %*	"	"
	Trifluorotoluene (Surr)	*92%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Laboratory Analysis Times Report

Semivolatile Petroleum Products by NWTPH-Dx (NWTPH-Dx)

TestAmerica Spokane

SSI0046

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0046-01	G-GA1-21-082609	08/26/09 15:15	09/10/09 14:30	15	09/13/09 18:59
SSI0046-03	G-GA3-20-082608	08/26/09 10:00	09/10/09 14:30	↓	09/16/09 20:59
SSI0046-04	GA-D2-082609	08/26/09 10:00	09/10/09 14:30	↓	09/16/09 21:23
SSI0046-05	G-GA-D-082609	08/26/09 15:15	09/10/09 14:30	↓	09/16/09 21:46

>14 DAY
Assoc results qual. J/UJ.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Laboratory Analysis Times Report

PCB's

Polychlorinated Biphenyls by EPA Method 8082 (EPA 8082) ✓

TestAmerica Spokane

SSI0046

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0046-01	G-GA1-21-082609	08/26/09 15:15	09/21/09 14:51	26	09/24/09 09:18
SSI0046-03	G-GA3-20-082608	08/26/09 10:00	09/21/09 14:51	↓	09/24/09 09:41
SSI0046-04	GA-D2-082609	08/26/09 10:00	09/21/09 14:51		09/24/09 10:03
SSI0046-05	G-GA-D-082609	08/26/09 15:15	09/21/09 14:51		09/24/09 10:26

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Date:
10/28/09 13:08

Laboratory Analysis Times Report

PAHs

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring (EPA 8270 mod.)
TestAmerica Spokane

SSI0046

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0046-01	G-GA1-21-082609	08/26/09 15:15	09/10/09 09:59	15	09/13/09 20:34
SSI0046-03	G-GA3-20-082608	08/26/09 10:00	09/10/09 09:59	↓	09/13/09 20:12
SSI0046-04	GA-D2-082609	08/26/09 10:00	09/10/09 09:59	↓	09/13/09 19:51
SSI0046-05	G-GA-D-082609	08/26/09 15:15	09/10/09 09:59	↓	09/13/09 19:29

>14 Day; Assoc. results J/UJ.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Date:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 13:08

Laboratory Analysis Times Report

Conventional Chemistry Parameters by APHA/EPA Methods (TA SOP)

TestAmerica Spokane

SSI0046

Lab Number	SampleName	Sampled	Extracted	Analyzed
SSI0046-01	G-GA1-21-082609	08/26/09 15:15	09/10/09 10:00	09/10/09 15:00
SSI0046-03	G-GA3-20-082608	08/26/09 10:00	09/10/09 10:00	09/10/09 15:00
SSI0046-04	GA-D2-082609	08/26/09 10:00	09/10/09 10:00	09/10/09 15:00
SSI0046-05	G-GA-D-082609	08/26/09 15:15	09/10/09 10:00	09/10/09 15:00

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

Anchorage, AK 907.563.9200 Fax 907.563.9210
Portland, OR 503.906.9200 Fax 503.906.9210
Seattle, WA 425.420.9200 Fax 425.420.9210
Spokane, WA 509.924.9200 Fax 509.924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Date:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 13:08

Laboratory Analysis Times Report

Volatile Organic Compounds (GC/MS) (8260B STD)

TestAmerica Tacoma

SSI0046

Lab Number	SampleName	Sampled	Extracted	DAYS	Analyzed
SSI0046-02	Trip Blank	09/08/09 00:00	09/25/09 16:16	17	09/25/09 22:34

> 14 preserved water.
Results Qual J/UJ.

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: **SSI0049**

SAMPLES	MATRIX
GRS-1SED-4	SOIL / SEDIMENT
GRS-1SED-0	SEDIMENT
-8SED-3	
-8SED-0	
-7SED-0	
-7SED-4	
-2SED-3	
-2SED-0	
-5SED-0	
-5DSED-0	
-5SED-4	
-6SED-0	
-6SED-3	
GRS-3SED-4	SOIL / SEDIMENT
-3SED-0	
-4SED-0	
-4SED-4	
G-EB-090709	WATER

DATA ASSESSMENT SUMMARY

REVIEW ITEM	ICP/ AES 6010	ICP/ MS 6020	Hg/ Se 7470	CN	Anions	OTHER % Moisture
1. Data Completeness	O	O	O			O
2. Holding Times	O	O	O			O
3. Calibration	O	O	O			—
4. Blanks	O	(1) X	O			—
5. Lab Duplicate, Field Duplicate RPD	O	(2) X	O			—
6. LCS, Blank Spike, MFS	O	O	O			—
7. Matrix Spike, MSD	O	O	O			—
8. GFAA, MSA (Serial Dil.)	(3) X	O	O			—
9. Detection Limits, Other QC	(4) ⊖	O	O			—
10. Data Verification, Overall Summary	O	O	O			O

O = Data had no problems ⊖ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) Cd, Se, Tl detected in Lab prep blank qualifies associated detects (ALL SAMPLES) as 'U' non-detect. (ALL SOILS).
(2) Water Sample G-EB090709 qualif. 'J' for ↓ due to ↑RPD.
(3) Serial dilution out for Fe in Soil #13; Assoc. result qualif. (J)
(4) Ag screen level above MDL but below RL. - No Qualif (advisory only).

Validated by: [signature] **Date:** Nov. 9, 2009

Reviewed by: **Date:**

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES ☑ NO ☐

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ ICV/CCV Results
- ✓ Blank Results
- ✓ ICP Interference Check Results
- ✓ Spike Recovery Results
- ✓ Duplicate Results
- ✓ LCS Results
- ✓ Standard Addition Results
- ✓ ICP Serial Dilution
- ✓ Instrument Det. Limits
- ✓ ICP Correction Factors
- ✓ ICP Linear Ranges
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ ICP Raw Data
- ✓ GFAA Raw Data
- ✓ Hg Raw Data
- ✓ Cyanide Raw Data
- ___ Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: _____

2. Holding Times (Check all that apply)..... ☑ ☐

- ✓ ICP/GFAA metals completed in <6 months from collection
- ✓ Mercury analyzed in <28 days from collection
- ___ Cyanide completed in 14 days from collection

Comments/Qualified Results: See Summary Table

3. Calibrations (Check all that apply)..... ☑ ☐

- ✓ ICV/CCV %R for ICP/AA, 90%-110%, acceptable
- ___ ICV/CCV %R for ICP/AA, 75%-89% or 111%-125%, results estimated (J/UJ)
- ___ ICV/CCV %R for ICP/AA, <75% or >125%, reject positive results (R)
- ___ ICV/CCV %R 80-120% for Hg, results accepted
- ___ CRDL Check Stnd %R 70 – 130, (50-150 SbPbTl)
- ___ ICV/CCV %R for Hg, 65%-79% or 121%-135%, results estimated (J/UJ)
- ___ ICV/CCV %R 85-115% for Cyanide, results acceptable
- ___ ICV/CCV %R 70-84% or 116-130%, results estimated (J/UJ)
- ___ ICV/CCV %R <70% or >130%, reject pos results (R)

Comments/Qualified Results: 6010 ✓ – ICV, CCV 9/22 ✓, 9/23 ✓

6020 – ICV, CCV 9/22 ✓ 9/23 ✓ Hg (7470) – ICV, CCV 9/22 ✓, 9/23 ✓

CRQL – 6010B ✓

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

Acceptable: YES NO

4. Blanks (Check all that apply)..... ☐ ☒

__Detects reported in ICB/CCB list:
☑ Detects in preparation blanks, list: V, Cr
__Detects in field blanks, list

Qualified as undetected (U) all sample concentrations ≤10X any associated blank concentrations and less than the PQL, or J+ for samples greater than the PQL.

Comments/Qualified Results: 6010 ICP – ICB, CCB 9/22 ✓, 9/23 ✓,
⊗ 6010 ICB/CCB V @ 0.256 ug/L for 9/22, 0.453 for 9/23. ~~MB/21A~~
Fe @ 173 ug/L (=MB/1A). Cr .625, V 2.08 <J+ Qualif.>
⊗ Hg(7470) – ICB @ 0.035 ug/L on 9/22.

6010 [Soil] – Fe 1.29 mg/Kg, Mg 0.76 mg/Kg (=MB 21A). ≠ Sb .007, As .058, Cd .0005, Se .036, Th 0.014

X10 = Fe 12.9 Mg 7.6 — NO QUAL.
As .58 Cd .005 Th .14
Sb .07 Se .36

5. Duplicates (Check all that apply)..... ☐ ☒

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field Duplicate ID_____

⊗ 6010/6020

Comments/Qualified Results Lab Duplic. #9: V @ 145% result qual. (J).
6010/6020 on sample 13: NO Quals.

7. Laboratory Control Samples, Blank Spikes (Check all that apply)... ☑ ☐

__LCS %R 80-120%, [50-150% for Ag, Sb]
__LCS %R 50-79% or >120%, results >IDL estimated (J)
__LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

ICSA/10 ✓ Ag, Ca, Fe, K, Mg.
" /11 ✓ " " " "

Comments/Qualified Results: 6010 – 22A ✓, 23A ✓, 24A ✓ except Na ↓
6010 (WATER) – 13A ✓, 14A ✓, 12A ✓
Hg Water – 15A ✓, 16A, 17A ✓ ; Hg (SOIL) 22A ✓, 23A ✓, 24A ✓

METALS & INORGANIC / Tier I & II Data Validation Summary Checklist

8. Spike Recovery (Check all that apply)..... ☑ ☐

__Spike %R with 75-125%
__Spike %R 30-74%, >125%, results > IDL est. (J)
__Spike %R 30-74% results <IDL estimated (UJ)
__Spike %R <30%, results <IDL rejected (UR)
__Field blanks used for spike analysis
__Post digest spk rqrd: %R 75-125%, excpt Ag

Comments/Qualified Results: 6010/6020 Water Smpl #9 MS/~~MSD~~ std

6010/6020 SOIL #13 MS/MSD

9. GFAA Performance, MSA, or Serial Dilutions..... ☐ ☒

__Duplicate injection RSD <20%
__Duplicate injection RSD >20%, results > CRDL estimated (J)
__Analytical spike %R 85-115%
__Analytical spike %R 40-85%, results > IDL estimated (J)
__Analytical spike %R 10-40%, results <IDL estimated (UJ)
__Analytical spike %R <10%, results <IDL rejected (R)

Comments/Qualified Results: Ser. Dil #9 Water

⊗ #13 SOIL: Fe @ 14% J/UJ

10. Detection Limits, Other QC..... ☑ ☐

Comments/Qualified Results:

Ag regulatory screen level @ 0.5 mg/kg — Lab MRL (RL) is ~1.5 mg/kg — No qual.

11. Data Verification and Overall Assessment..... ☑ ☐

Comments/Qualified Results:

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210 ☐
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 ☒
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210 ☐
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210 ☐

CHAIN OF CUSTODY REPORT

Work Order #: SSI0049

CLIENT: Golder Associates

REPORT TO: Doug Morell cc: Kirsi Longley
ADDRESS: 18300 Union Hill Road, Suite 200
Redmond WA 98052
PHONE: 425-883-0777 FAX:

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: ☑ STD. | 10 | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	PRESERVATIVE	REQUESTED ANALYSES	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
		HCL / — / MeOH Sod. Bisulf. / — / — / Nitric	TPH-Dx extended; PCB (8082A) low level; TCL VOCs (8260B low); PAH (8270 SIM); TCL SVOC (8270C low); TAL metals				
1 G-RS1SED-4-090709	9/7/09 1350		X X X X X X	S	5		-01
2 G-RS1SED-0-090709	1355		X X X X X X	S	5		-02
3 G-RS8SED-3-090709	1445		X X X X X X	S	5		-03
4 G-RS8SED-0-090709	1450		X X X X X X	S	5		-04
5 G-RS7SED-0-090709	1530		X X X X X X	S	5		-05
6 G-RS7SED-4-090709	1525		X X X X X X	S	5		-06
7 G-RS9SED-3-090709	1615		X X X X X X	S	5		-07
8 G-RS2SED-0-090709	1620		X X X X X X	S	5		-08
9 G-EB-090709	1700		X X X X X	W	6		-09
10 G-RS5SED-0-090809	9/8/09 830		X X X X X X	S	5		-10

RELEASED BY: K. Longley DATE: 9/9/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc TIME: 704
RECEIVED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzy Bartosik FIRM: Golder TIME: 730

RELEASED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzy Bartosik FIRM: Golder TIME: 930
RECEIVED BY: Chris Williams DATE: 9/9/09
PRINT NAME: Chris Williams FIRM: TA-Spokane TIME: 0930

ADDITIONAL REMARKS:

TEMP: 5.3

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 [X]
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: SSI0049

CLIENT: Golder Associates

REPORT TO: Doug Morell & Kirsi Langley
ADDRESS: 18300 NE Union Hill Road

PHONE: 425-883-0777 FAX:

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Langley

TURNAROUND REQUEST
in Business Days *
Organic & Inorganic Analyses: [X] 10 STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1
Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1
OTHER Specify:
* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: — — — MeOH Soil — — —

REQUESTED ANALYSES: TPH-Dx extended | PCB (8082A) low level | PAH 8270 SIM | TCL SVOC 8270C low | TCL VOC 8260B low | TAL metals

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-RS5SED-0-090809	9/8/09 835	S	5		-11
2 ~~G-RS6~~					48
3 G-RS5SED-4-090809	845	S	5		-12
4 G-RS6SED-0-090809	740	S	15	extra volume ms/msD	-13
5 G-RS6SED-3-090809	735	S	5		-14
6 G-RS3SED-4-090809	1115	S	5		-15
7 G-RS3SED-0-090809	1110	S	5		-16
8 G-RS4SED-0-090809	1220	S	5		-17
9 G-RS4SED-4-090809	1225	S	5		-18
10 Trip Blank	— —	W	3		-19

RELEASED BY: K. Langley — DATE: 9/9/09
PRINT NAME: K. Langley — FIRM: Golder Assoc. — TIME: 704

RECEIVED BY: L. Bartosik — DATE: 9/9/09
PRINT NAME: Lizzi Bartosik — FIRM: Golder — TIME: 730

RELEASED BY: L. Bartosik — DATE: 9/9/09
PRINT NAME: Lizzi Bartosik — FIRM: Golder — TIME: 930

RECEIVED BY: Chris William — DATE: 9/9/09
PRINT NAME: Chris William — FIRM: TA Spokane — TIME: 0930

ADDITIONAL REMARKS:

TEMP:

PAGE 2 OF 2

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SS10019 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 9/9/09 930 Cooler signed for by: C. Williams (Print name)

Preliminary Examination Phase:

Date cooler opened: ☒ same as date received *or* ___/___/___

Cooler opened by (print) C. Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☒ Other: Pickup

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals ~~#~~ 3 Signed by See Back Date ___/___/___

   Were custody seals unbroken and intact on arrival? ☒ Yes ☐ ~~No~~ RP 10-22-09

3. Were custody papers sealed in a plastic bag? ☐ Yes ☒ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: 1/2 melted

   Temperature by IR Gun 5.3 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags? ☐ Yes ☒ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☐ N/A ☒ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 9/9/09

Samples logged in by (print) C. Hanson (sign) [signature]

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Calcium	6010B TMP Dry	**1300**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:50	
Iron	"	**13000**	*0.53*	11	"	"	"	"	"	B
Magnesium	"	**3000**	*0.75*	63	"	"	"	"	"	B
Potassium	"	**760**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.8*	110	"	"	"	"	09/23/09 17:33	*
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Calcium	6010B TMP Dry	**830**	*2.1*	77	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:54	
Iron	"	**13000**	*0.65*	14	"	"	"	"	"	B
Magnesium	"	**3300**	*0.93*	77	"	"	"	"	"	B
Potassium	"	**900**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.063*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.5*	140	"	"	"	"	09/23/09 17:35	*
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
Calcium	6010B TMP Dry	**1200**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:58	
Iron	"	**13000**	*0.54*	12	"	"	"	"	"	B
Magnesium	"	**3400**	*0.78*	65	"	"	"	"	"	B
Potassium	"	**910**	*19*	190	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.0*	120	"	"	"	"	09/23/09 17:37	*
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Calcium	6010B TMP Dry	**1100**	*2.2*	81	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:01	
Iron	"	**15000**	*0.67*	15	"	"	"	"	"	B
Magnesium	"	**4400**	*0.97*	81	"	"	"	"	"	B
Potassium	"	**1300**	*23*	240	"	"	"	"	"	
Silver	"	ND	*0.066*	1.5	"	"	"	"	"	
Sodium	"	ND	*10*	150	"	"	"	"	09/23/09 17:39	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Calcium	6010B TMP Dry	**1200**	*2.0*	74	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:06	
Iron	"	**14000**	*0.62*	14	"	"	"	"	"	**B**
Magnesium	"	**4400**	*0.89*	74	"	"	"	"	"	**B**
Potassium	"	**1400**	*22*	220	"	"	"	"	"	
Silver	"	ND	*0.061*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.2*	140	"	"	"	"	09/23/09 17:41	*
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Calcium	6010B TMP Dry	**590**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:09	
Iron	"	**11000**	*0.53*	11	"	"	"	"	"	**B**
Magnesium	"	**2200**	*0.76*	63	"	"	"	"	"	**B**
Potassium	"	**560**	*18*	190	"	"	"	"	"	
Silver	"	**0.053**	*0.052*	1.1	"	"	"	"	"	**J**
Sodium	"	ND	*7.8*	110	"	"	"	"	09/23/09 17:44	*
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Calcium	6010B TMP Dry	**2700**	*1.8*	67	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:14	
Iron	"	**12000**	*0.56*	12	"	"	"	"	"	**B**
Magnesium	"	**3600**	*0.81*	67	"	"	"	"	"	**B**
Potassium	"	**690**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.055*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.3*	120	"	"	"	"	09/23/09 17:46	*
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Calcium	6010B TMP Dry	**8500**	*2.0*	72	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:19	
Iron	"	**14000**	*0.60*	13	"	"	"	"	"	**B**
Magnesium	"	**5300**	*0.87*	72	"	"	"	"	"	**B**
Potassium	"	**1200**	*21*	220	"	"	"	"	"	
Silver	"	ND	*0.059*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.9*	130	"	"	"	"	09/23/09 17:48	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Calcium	6010B TMP Dry	**1300**	*2.1*	77	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:23	
Iron	"	**16000**	*0.64*	14	"	"	"	"	"	B
Magnesium	"	**4100**	*0.92*	77	"	"	"	"	"	B
Potassium	"	**1200**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.063*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.5*	140	"	"	"	"	09/23/09 17:51	*
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Calcium	6010B TMP Dry	**1400**	*2.0*	74	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:26	
Iron	"	**16000**	*0.62*	14	"	"	"	"	"	B
Magnesium	"	**4100**	*0.89*	74	"	"	"	"	"	B
Potassium	"	**1100**	*22*	220	"	"	"	"	"	
Silver	"	ND	*0.061*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.2*	140	"	"	"	"	09/23/09 17:53	*
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Calcium	6010B TMP Dry	**970**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:38	
Iron	"	**12000**	*0.55*	12	"	"	"	"	"	B
Magnesium	"	**2800**	*0.78*	65	"	"	"	"	"	B
Potassium	"	**980**	*19*	200	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.1*	120	"	"	"	"	09/23/09 18:01	*
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Calcium	6010B TMP Dry	**1000**	*1.9*	70	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:23	
Iron	"	**16000** J	*0.58*	13	"	"	"	"	"	B
Magnesium	"	**4300**	*0.84*	70	"	"	"	"	"	B
Potassium	"	**1100**	*20*	210	"	"	"	"	"	
Silver	"	ND	*0.057*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.6*	130	"	"	"	"	09/23/09 17:12	*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Calcium	6010B TMP Dry	**890**	*2.1*	78	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:42	
Iron	"	**15000**	*0.65*	14	"	"	"	"	"	B
Magnesium	"	**4000**	*0.94*	78	"	"	"	"	"	B
Potassium	"	**1100**	*23*	230	"	"	"	"	"	
Silver	"	ND	*0.064*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.7*	140	"	"	"	"	09/23/09 18:04	*
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Calcium	6010B TMP Dry	**1500**	*1.7*	62	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:46	
Iron	"	**16000**	*0.52*	11	"	"	"	"	"	B
Magnesium	"	**3000**	*0.74*	62	"	"	"	"	"	B
Potassium	"	**880**	*18*	180	"	"	"	"	"	
Silver	"	ND	*0.050*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.6*	110	"	"	"	"	09/23/09 18:06	*
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Calcium	6010B TMP Dry	**1400**	*1.9*	71	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:50	
Iron	"	**14000**	*0.59*	13	"	"	"	"	"	B
Magnesium	"	**3300**	*0.85*	71	"	"	"	"	"	B
Potassium	"	**1000**	*21*	210	"	"	"	"	"	
Silver	"	ND	*0.058*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.8*	130	"	"	"	"	09/23/09 18:08	*
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Calcium	6010B TMP Dry	**1100**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:54	
Iron	"	**13000**	*0.55*	12	"	"	"	"	"	B
Magnesium	"	**2800**	*0.78*	65	"	"	"	"	"	B
Potassium	"	**750**	*19*	200	"	"	"	"	"	
Silver	"	ND	*0.054*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.1*	120	"	"	"	"	09/23/09 18:11	*

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Calcium	6010B TMP Dry	**850**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:57	
Iron	"	**12000**	*0.52*	11	"	"	"	"	"	**B**
Magnesium	"	**2300**	*0.75*	63	"	"	"	"	"	**B**
Potassium	"	**590**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.7*	110	"	"	"	"	09/23/09 18:13	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

General Chemistry

Client Sample ID: **SSI0049-01**

Lab Sample ID: 580-15385-1
Client Matrix: Solid

Date Sampled: 09/07/2009 1350
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	81		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	19		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-02**

Lab Sample ID: 580-15385-2
Client Matrix: Solid

Date Sampled: 09/07/2009 1355
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	69		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	31		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-03**

Lab Sample ID: 580-15385-3
Client Matrix: Solid

Date Sampled: 09/07/2009 1445
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	83		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	17		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-04**

Lab Sample ID: 580-15385-4 Date Sampled: 09/07/2009 1450
Client Matrix: Solid Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	67		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	33		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-05**

Lab Sample ID: 580-15385-5
Client Matrix: Solid

Date Sampled: 09/07/2009 1530
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	69		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	31		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-06**

Lab Sample ID: 580-15385-6
Client Matrix: Solid

Date Sampled: 09/07/2009 1525
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	82		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	18		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-07**

Lab Sample ID: 580-15385-7
Client Matrix: Solid

Date Sampled: 09/07/2009 1615
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	78		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	22		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-08**

Lab Sample ID: 580-15385-8
Client Matrix: Solid

Date Sampled: 09/07/2009 1620
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	71		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	29		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-10**

Lab Sample ID: 580-15385-10
Client Matrix: Solid

Date Sampled: 09/08/2009 0830
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	70		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	30		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-11**

Lab Sample ID: 580-15385-11
Client Matrix: Solid

Date Sampled: 09/08/2009 0835
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	71		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	29		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-12**

Lab Sample ID: 580-15385-12
Client Matrix: Solid

Date Sampled: 09/08/2009 0845
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	82		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	18		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-13**

Lab Sample ID: 580-15385-13
Client Matrix: Solid

Date Sampled: 09/08/2009 0740
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	75		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	25		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-14**

Lab Sample ID: 580-15385-14
Client Matrix: Solid

Date Sampled: 09/08/2009 0735
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	68		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	32		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

General Chemistry

Client Sample ID: **SSI0049-15**

Lab Sample ID: 580-15385-15
Client Matrix: Solid

Date Sampled: 09/08/2009 1115
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	83		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	17		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-16**

Lab Sample ID: 580-15385-16
Client Matrix: Solid

Date Sampled: 09/08/2009 1110
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	72		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	28		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-17**

Lab Sample ID: 580-15385-17
Client Matrix: Solid

Date Sampled: 09/08/2009 1220
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	83		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	17		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

General Chemistry

Client Sample ID: **SSI0049-18**

Lab Sample ID: 580-15385-18
Client Matrix: Solid

Date Sampled: 09/08/2009 1225
Date Received: 09/11/2009 0940

Analyte	Result	Qual	Units	RL	RL	Dil	Method
Percent Solids	87		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N
Percent Moisture	13		%	0.10	0.10	1.0	Moisture
Analysis Batch: 580-50245	Date Analyzed: 09/15/2009 1026						DryWt Corrected: N

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Aluminum	6020 TMP Dry	**4700**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:45	
Arsenic	"	**7.3**	*0.00089*	0.23	"	"	"	"	"	B
Antimony	"	**3.5**	*0.0075*	0.23	"	"	"	"	"	B
Barium	"	**34**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00079*	0.23	"	"	"	"	"	
Cadmium	"	**0.061**	*0.00054*	0.23 U	"	"	"	"	"	J, B
Chromium	"	**7.1**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**6.4**	*0.00062*	0.23	"	"	"	"	"	
Copper	"	**50**	*0.0037*	0.23	"	"	"	"	"	
Lead	"	**45**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**170**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**9.9**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	**0.095**	*0.0021*	0.57 U	"	"	"	"	"	J, B
Thallium	"	**0.078**	*0.0046*	0.46 U	"	"	"	"	"	J, B
Vanadium	"	**14**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**34**	*0.017*	0.80	"	"	"	"	"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Aluminum	6020 TMP Dry	**5300**	*0.42*	42	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:50	
Arsenic	"	**5.8**	*0.0011*	0.28	"	"	"	"	"	B
Antimony	"	**1.3**	*0.0093*	0.28	"	"	"	"	"	B
Barium	"	**31**	*0.0021*	0.28	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00097*	0.28	"	"	"	"	"	J
Cadmium	"	**0.023**	*0.00066*	0.28 U	"	"	"	"	"	J, B
Chromium	"	**6.7**	*0.0056*	0.28	"	"	"	"	"	
Cobalt	"	**5.2**	*0.00076*	0.28	"	"	"	"	"	
Copper	"	**23**	*0.0045*	0.28	"	"	"	"	"	
Lead	"	**18**	*0.0014*	0.28	"	"	"	"	"	
Manganese	"	**140**	*0.022*	0.70	"	"	"	"	"	
Nickel	"	**9.0**	*0.0052*	0.28	"	"	"	"	"	
Selenium	"	**0.048**	*0.0026*	0.70 U	"	"	"	"	"	J, B
Thallium	"	**0.078**	*0.0056*	0.56 U	"	"	"	"	"	J, B
Vanadium	"	**10**	*0.0038*	0.28	"	"	"	"	"	
Zinc	"	**26**	*0.021*	0.98	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Aluminum	6020 TMP Dry	4100	0.37	37	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:16	
Arsenic	"	6.2	0.00095	0.24	"	"	"	"	"	B
Antimony	"	5.5	0.0081	0.24	"	"	"	"	"	B
Barium	"	24	0.0018	0.24	"	"	"	"	"	
Beryllium	"	0.16	0.00084	0.24	"	"	"	"	"	J
Cadmium	"	0.0067	0.00057	0.24 U	"	"	"	"	"	J,B
Chromium	"	5.3	0.0049	0.24	"	"	"	"	"	
Cobalt	"	5.0	0.00066	0.24	"	"	"	"	"	
Copper	"	18	0.0039	0.24	"	"	"	"	"	
Lead	"	24	0.0012	0.24	"	"	"	"	"	
Manganese	"	150	0.020	0.61	"	"	"	"	"	
Nickel	"	8.6	0.0045	0.24	"	"	"	"	"	
Selenium	"	0.11	0.0023	0.61 U	"	"	"	"	"	J,B
Thallium	"	0.059	0.0049	0.49 U	"	"	"	"	"	J,B
Vanadium	"	14	0.0033	0.24	"	"	"	"	"	
Zinc	"	22	0.018	0.86	"	"	"	"	"	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Aluminum	6020 TMP Dry	6700	0.39	39	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:22	
Arsenic	"	7.6	0.0010	0.26	"	"	"	"	"	B
Antimony	"	1.9	0.0087	0.26	"	"	"	"	"	B
Barium	"	46	0.0020	0.26	"	"	"	"	"	
Beryllium	"	0.29	0.00090	0.26	"	"	"	"	"	
Cadmium	"	0.018	0.00062	0.26 U	"	"	"	"	"	J,B
Chromium	"	8.2	0.0052	0.26	"	"	"	"	"	
Cobalt	"	7.1	0.00071	0.26	"	"	"	"	"	
Copper	"	58	0.0042	0.26	"	"	"	"	"	
Lead	"	17	0.0013	0.26	"	"	"	"	"	
Manganese	"	260	0.021	0.66	"	"	"	"	"	
Nickel	"	12	0.0049	0.26	"	"	"	"	"	
Selenium	"	0.14	0.0025	0.66 U	"	"	"	"	"	J,B
Thallium	"	0.096	0.0052	0.52 U	"	"	"	"	"	J,B
Vanadium	"	16	0.0035	0.26	"	"	"	"	"	
Zinc	"	28	0.020	0.92	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Aluminum	6020 TMP Dry	**5100**	*0.39*	39	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:04	
Arsenic	"	**10**	*0.0010*	0.26	"	"	"	"	"	B
Antimony	"	**2.3**	*0.0085*	0.26	"	"	"	"	"	B
Barium	"	**32**	*0.0019*	0.26	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00089*	0.26	"	"	"	"	"	
Cadmium	"	~~0.032~~	*0.00061*	0.26	"	"	"	"	"	J, B
Chromium	"	**6.2**	*0.0052*	0.26	"	"	"	"	"	
Cobalt	"	**6.8**	*0.00070*	0.26	"	"	"	"	"	
Copper	"	**17**	*0.0041*	0.26	"	"	"	"	"	
Lead	"	**11**	*0.0013*	0.26	"	"	"	"	"	
Manganese	"	**170**	*0.021*	0.64	"	"	"	"	"	
Nickel	"	**13**	*0.0048*	0.26	"	"	"	"	"	
Selenium	"	~~0.12~~	*0.0024*	0.64 U	"	"	"	"	"	J, B
Thallium	"	~~0.075~~	*0.0052*	0.52 U	"	"	"	"	"	J, B
Vanadium	"	**15**	*0.0035*	0.26	"	"	"	"	"	
Zinc	"	**32**	*0.019*	0.90	"	"	"	"	"	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Aluminum	6020 TMP Dry	**4600**	*0.36*	36	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:09	
Arsenic	"	**16**	*0.00093*	0.24	"	"	"	"	"	B
Antimony	"	**24**	*0.0078*	0.24	"	"	"	"	"	B
Barium	"	**35**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00082*	0.24	"	"	"	"	"	J
Cadmium	"	ND	*0.00056*	0.24	"	"	"	"	"	
Chromium	"	**6.1**	*0.0048*	0.24	"	"	"	"	"	
Cobalt	"	**6.3**	*0.00064*	0.24	"	"	"	"	"	
Copper	"	**23**	*0.0038*	0.24	"	"	"	"	"	
Lead	"	**48**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**91**	*0.019*	0.59	"	"	"	"	"	
Nickel	"	**9.2**	*0.0044*	0.24	"	"	"	"	"	
Selenium	"	~~0.13~~	*0.0022*	0.59 U	"	"	"	"	"	J, B
Thallium	"	~~0.055~~	*0.0048*	0.48 U	"	"	"	"	"	J, B
Vanadium	"	**18**	*0.0032*	0.24	"	"	"	"	"	
Zinc	"	**22**	*0.018*	0.83	"	"	"	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Aluminum	6020 TMP Dry	**3900**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:14	
Arsenic	"	**16**	*0.00089*	0.23	"	"	"	"	"	~~B~~
Antimony	"	**1.1**	*0.0075*	0.23	"	"	"	"	"	~~B~~
Barium	"	**24**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.17**	*0.00079*	0.23	"	"	"	"	"	J
Cadmium	"	~~0.015~~	*0.00054*	0.23 U	"	"	"	"	"	~~J, B~~
Chromium	"	**5.0**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**4.1**	*0.00061*	0.23	"	"	"	"	"	
Copper	"	**17**	*0.0036*	0.23	"	"	"	"	"	
Lead	"	**12**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**180**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**8.9**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	~~0.14~~	*0.0021*	0.57 U	"	"	"	"	"	~~J, B~~
Thallium	"	~~0.048~~	*0.0046*	0.46 U	"	"	"	"	"	~~J, B~~
Vanadium	"	**12**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**21**	*0.017*	0.80	"	"	"	"	"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Antimony	6020 Total Recoverable	ND	*0.00040*	0.0020	mg/L	5x	50762	09/23/09 13:31	09/23/09 22:38	
Arsenic	"	ND	*0.00024*	0.0020	"	"	"	"	"	
Barium	"	ND	*0.00027*	0.0060	"	"	"	"	"	
Nickel	"	ND	*0.00022*	0.0020	"	"	"	"	"	^
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Chromium	"	~~0.00092~~	*0.00037*	0.0020	U "	"	"	"	"	~~J, ^, B~~
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	^
Vanadium	"	**0.0048.**	*0.00023*	0.0020	J+ "	"	"	"	"	~~^, B~~
Copper	"	**0.00024**	*0.00015*	0.0050	"	"	"	"	"	J, ^
Zinc	"	**0.0092**	*0.0020*	0.0070	"	"	"	"	"	^
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	

11-9-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**			**Sampled: 09/07/09 17:00**					
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50762	09/23/09 13:31	09/23/09 20:20	
Calcium	"	ND	*0.028*	1.1	"	"	"	"	"	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	ND	*0.23*	1.1	"	"	"	"	"	
Potassium	"	ND	*0.41*	3.3	"	"	"	"	"	
Sodium	"	ND	*0.18*	2.0	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Aluminum	6020 TMP Dry	6900	0.42	42	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:27	
Arsenic	"	8.5	0.0011	0.28	"	"	"	"	"	B
Antimony	"	1.2	0.0092	0.28	"	"	"	"	"	B
Barium	"	39	0.0021	0.28	"	"	"	"	"	
Beryllium	"	0.28	0.00097	0.28	"	"	"	"	"	J
Cadmium	"	0.0077	0.00066	0.28	U	"	"	"	"	J, B
Chromium	"	7.8	0.0056	0.28	"	"	"	"	"	
Cobalt	"	6.8	0.00076	0.28	"	"	"	"	"	
Copper	"	22	0.0045	0.28	"	"	"	"	"	
Lead	"	13	0.0014	0.28	"	"	"	"	"	
Manganese	"	210	0.022	0.70	"	"	"	"	"	
Nickel	"	12	0.0052	0.28	"	"	"	"	"	
Selenium	"	0.17	0.0026	0.70	U	"	"	"	"	J, B
Thallium	"	0.088	0.0056	0.56	U	"	"	"	"	J, B
Vanadium	"	16	0.0038	0.28	"	"	"	"	"	
Zinc	"	30	0.021	0.98	"	"	"	"	"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Aluminum	6020 TMP Dry	7000	0.41	41	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:32	
Arsenic	"	9.0	0.0011	0.27	"	"	"	"	"	B
Antimony	"	1.0	0.0089	0.27	"	"	"	"	"	B
Barium	"	41	0.0020	0.27	"	"	"	"	"	
Beryllium	"	0.28	0.00093	0.27	"	"	"	"	"	
Cadmium	"	0.0027	0.00064	0.27	U	"	"	"	"	J, B
Chromium	"	7.9	0.0054	0.27	"	"	"	"	"	
Cobalt	"	7.0	0.00073	0.27	"	"	"	"	"	
Copper	"	21	0.0043	0.27	"	"	"	"	"	
Lead	"	14	0.0014	0.27	"	"	"	"	"	
Manganese	"	190	0.022	0.68	"	"	"	"	"	
Nickel	"	11	0.0050	0.27	"	"	"	"	"	
Selenium	"	0.23	0.0025	0.68	U	"	"	"	"	J, B
Thallium	"	0.087	0.0054	0.54	U	"	"	"	"	J, B
Vanadium	"	17	0.0037	0.27	"	"	"	"	"	
Zinc	"	34	0.020	0.95	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)
TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Aluminum	6020 TMP Dry	**5000**	*0.36*	36	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:48	
Arsenic	"	**28**	*0.00093*	0.24	"	"	"	"	"	B
Antimony	"	**8.3**	*0.0078*	0.24	"	"	"	"	"	B
Barium	"	**37**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00082*	0.24	"	"	"	"	"	
Cadmium	"	**0.026**	*0.00056*	0.24	U	"	"	"	"	J, B
Chromium	"	**7.8**	*0.0048*	0.24	"	"	"	"	"	
Cobalt	"	**5.0**	*0.00064*	0.24	"	"	"	"	"	
Copper	"	**28**	*0.0038*	0.24	"	"	"	"	"	
Lead	"	**23**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**91**	*0.019*	0.59	"	"	"	"	"	
Nickel	"	**8.8**	*0.0044*	0.24	"	"	"	"	"	
Selenium	"	**0.12**	*0.0022*	0.59	U	"	"	"	"	J, B
Thallium	"	**0.087**	*0.0048*	0.48	U	"	"	"	"	J, B
Vanadium	"	**15**	*0.0032*	0.24	"	"	"	"	"	
Zinc	"	**70**	*0.018*	0.83	"	"	"	"	"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Aluminum	6020 TMP Dry	**6900**	*0.38*	38	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 12:57	
Arsenic	"	**7.1**	*0.00099*	0.25	"	"	"	"	"	B
Antimony	"	**0.85**	*0.0084*	0.25	"	"	"	"	"	B
Barium	"	**36**	*0.0019*	0.25	"	"	"	"	"	
Beryllium	"	**0.27**	*0.00087*	0.25	"	"	"	"	"	
Cadmium	"	**0.019**	*0.00060*	0.25	U	"	"	"	"	J, B
Chromium	"	**7.8**	*0.0051*	0.25	"	"	"	"	"	
Cobalt	"	**6.7**	*0.00068*	0.25	"	"	"	"	"	
Copper	"	**24**	*0.0041*	0.25	"	"	"	"	"	
Lead	"	**14**	*0.0013*	0.25	"	"	"	"	"	
Manganese	"	**160**	*0.020*	0.63	"	"	"	"	"	
Nickel	"	**12**	*0.0047*	0.25	"	"	"	"	"	
Selenium	"	**0.14**	*0.0024*	0.63	U	"	"	"	"	J, B
Thallium	"	**0.092**	*0.0051*	0.51	U	"	"	"	"	J, B
Vanadium	"	**17**	*0.0034*	0.25	"	"	"	"	"	
Zinc	"	**31**	*0.019*	0.89	"	"	"	"	"	

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Aluminum	6020 TMP Dry	**6500**	*0.43*	43	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:53	
Arsenic	"	**9.9**	*0.0011*	0.28	"	"	"	"	"	B
Antimony	"	**0.93**	*0.0094*	0.28	"	"	"	"	"	B
Barium	"	**49**	*0.0021*	0.28	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00098*	0.28	"	"	"	"	"	J
Cadmium	"	0.013	*0.00067*	0.28 U	"	"	"	"	"	J,B
Chromium	"	**7.1**	*0.0057*	0.28	"	"	"	"	"	
Cobalt	"	**7.2**	*0.00077*	0.28	"	"	"	"	"	
Copper	"	**22**	*0.0045*	0.28	"	"	"	"	"	
Lead	"	**11**	*0.0014*	0.28	"	"	"	"	"	
Manganese	"	**160**	*0.023*	0.71	"	"	"	"	"	
Nickel	"	**13**	*0.0053*	0.28	"	"	"	"	"	
Selenium	"	0.16	*0.0027*	0.71 U	"	"	"	"	"	J,B
Thallium	"	0.092	*0.0057*	0.57 U	"	"	"	"	"	J,B
Vanadium	"	**15**	*0.0038*	0.28	"	"	"	"	"	
Zinc	"	**30**	*0.021*	0.99	"	"	"	"	"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Aluminum	6020 TMP Dry	**5000**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:59	
Arsenic	"	**9.9**	*0.00087*	0.22	"	"	"	"	"	B
Antimony	"	**1.3**	*0.0074*	0.22	"	"	"	"	"	B
Barium	"	**38**	*0.0017*	0.22	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00077*	0.22	"	"	"	"	"	
Cadmium	"	0.016	*0.00053*	0.22 U	"	"	"	"	"	J,B
Chromium	"	**6.2**	*0.0045*	0.22	"	"	"	"	"	
Cobalt	"	**8.4**	*0.00061*	0.22	"	"	"	"	"	
Copper	"	**23**	*0.0036*	0.22	"	"	"	"	"	
Lead	"	**20**	*0.0011*	0.22	"	"	"	"	"	
Manganese	"	**420**	*0.018*	0.56	"	"	"	"	"	
Nickel	"	**10**	*0.0041*	0.22	"	"	"	"	"	
Selenium	"	0.12	*0.0021*	0.56 U	"	"	"	"	"	J,B
Thallium	"	0.069	*0.0045*	0.45 U	"	"	"	"	"	J,B
Vanadium	"	**17**	*0.0030*	0.22	"	"	"	"	"	
Zinc	"	**31**	*0.017*	0.78	"	"	"	"	"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Aluminum	6020 TMP Dry	**6900**	*0.41*	41	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:06	
Arsenic	"	**7.0**	*0.0011*	0.27	"	"	"	"	"	B
Antimony	"	**0.68**	*0.0089*	0.27	"	"	"	"	"	B
Barium	"	**38**	*0.0020*	0.27	"	"	"	"	"	
Beryllium	"	**0.28**	*0.00093*	0.27	"	"	"	"	"	
Cadmium	"	0.023	*0.00063*	0.27 U	"	"	"	"	"	J, B
Chromium	"	**7.7**	*0.0054*	0.27	"	"	"	"	"	
Cobalt	"	**7.4**	*0.00073*	0.27	"	"	"	"	"	
Copper	"	**20**	*0.0043*	0.27	"	"	"	"	"	
Lead	"	**8.2**	*0.0014*	0.27	"	"	"	"	"	
Manganese	"	**87**	*0.022*	0.68	"	"	"	"	"	
Nickel	"	**10**	*0.0050*	0.27	"	"	"	"	"	
Selenium	"	0.11	*0.0025*	0.68 U	"	"	"	"	"	J, B
Thallium	"	0.10	*0.0054*	0.54 U	"	"	"	"	"	J, B
Vanadium	"	**17**	*0.0036*	0.27	"	"	"	"	"	
Zinc	"	**31**	*0.020*	0.95	"	"	"	"	"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Aluminum	6020 TMP Dry	**3300**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:11	
Arsenic	"	**7.5**	*0.00089*	0.23	"	"	"	"	"	B
Antimony	"	**210**	*0.0076*	0.23	"	"	"	"	"	B
Barium	"	**16**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.13**	*0.00079*	0.23	"	"	"	"	"	J
Cadmium	"	ND	*0.00054*	0.23	"	"	"	"	"	
Chromium	"	**5.9**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**4.8**	*0.00062*	0.23	"	"	"	"	"	
Copper	"	**36**	*0.0037*	0.23	"	"	"	"	"	
Lead	"	**600**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**110**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**7.6**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	0.085	*0.0022*	0.57 U	"	"	"	"	"	J, B
Thallium	"	0.051	*0.0046*	0.46 U	"	"	"	"	"	J, B
Vanadium	"	**9.6**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**24**	*0.017*	0.80	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
Aluminum	6020 TMP Dry	5400	0.35	35	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:55	
Arsenic	"	5.4	0.00092	0.24	"	"	"	"	"	B
Antimony	"	0.75	0.0078	0.24	"	"	"	"	"	B
Barium	"	27	0.0018	0.24	"	"	"	"	"	
Beryllium	"	0.21	0.00081	0.24	"	"	"	"	"	J
Cadmium	"	0.014	0.00055	0.24 U	"	"	"	"	"	J,B
Chromium	"	6.3	0.0047	0.24	"	"	"	"	"	
Cobalt	"	7.7	0.00064	0.24	"	"	"	"	"	
Copper	"	18	0.0038	0.24	"	"	"	"	"	
Lead	"	8.2	0.0012	0.24	"	"	"	"	"	
Manganese	"	190	0.019	0.59	"	"	"	"	"	
Nickel	"	9.4	0.0044	0.24	"	"	"	"	"	
Selenium	"	0.12	0.0022	0.59 U	"	"	"	"	"	J,B
Thallium	"	0.077	0.0047	0.47 U	"	"	"	"	"	J,B
Vanadium	"	17	0.0032	0.24	"	"	"	"	"	
Zinc	"	24	0.018	0.82	"	"	"	"	"	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**				**Sampled: 09/07/09 14:50**				
Aluminum	6020 TMP Dry	7000	0.44	44	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:00	
Arsenic	"	6.4	0.0011	0.29	"	"	"	"	"	B
Antimony	"	0.64	0.0097	0.29	"	"	"	"	"	B
Barium	"	37	0.0022	0.29	"	"	"	"	"	
Beryllium	"	0.31	0.0010	0.29	"	"	"	"	"	
Cadmium	"	0.0095	0.00069	0.29 U	"	"	"	"	"	J,B
Chromium	"	7.8	0.0059	0.29	"	"	"	"	"	
Cobalt	"	7.6	0.00079	0.29	"	"	"	"	"	
Copper	"	21	0.0047	0.29	"	"	"	"	"	
Lead	"	7.7	0.0015	0.29	"	"	"	"	"	
Manganese	"	200	0.023	0.73	"	"	"	"	"	
Nickel	"	11	0.0054	0.29	"	"	"	"	"	
Selenium	"	0.11	0.0028	0.73 U	"	"	"	"	"	J,B
Thallium	"	0.097	0.0059	0.59 U	"	"	"	"	"	J,B
Vanadium	"	18	0.0040	0.29	"	"	"	"	"	
Zinc	"	28	0.022	1.0	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**				**Sampled: 09/07/09 13:50**				
Mercury	7471A Dry	**0.061**	*0.0074*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:28	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
Mercury	7471A Dry	ND	*0.0087*	0.028	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:32	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
Mercury	7471A Dry	ND	*0.0070*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:36	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**				**Sampled: 09/07/09 14:50**				
Mercury	7471A Dry	**0.026**	*0.0084*	0.027	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:40	J
SSI0049-05 (G-RS7SED-0-090709)		**Soil**				**Sampled: 09/07/09 15:30**				
Mercury	7471A Dry	ND	*0.0082*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:44	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**				**Sampled: 09/07/09 15:25**				
Mercury	7471A Dry	ND	*0.0075*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:49	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**				
Mercury	7471A Dry	ND	*0.0077*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:01	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**				
Mercury	7471A Dry	**0.021**	*0.0078*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:05	J
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50776	09/23/09 15:17	09/23/09 17:35	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**				**Sampled: 09/08/09 08:30**				
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:10	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**				**Sampled: 09/08/09 08:35**				
Mercury	7471A Dry	ND	*0.0081*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:15	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Mercury	7471A Dry	**0.013**	*0.0068*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:19	J
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Mercury	7471A Dry	**0.020**	*0.0083*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:11	J
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:23	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Mercury	7471A Dry	**0.0099**	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:27	J
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Mercury	7471A Dry	**0.0085**	*0.0079*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:32	J
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Mercury	7471A Dry	ND	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:37	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Mercury	7471A Dry	**0.020**	*0.0066*	0.021	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:41	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

GOLDER PROJECT #: **073-93312.05**	SITE: **Avery Landing/ POTLATCH / Idaho**
LABORATORY: **Test America**	SDG: SSI0049

SAMPLES	Collect:	MATRIX
See Analyte report Sheets & Summary page - Attatched	9/07 & 9/08	17 SOIL/SED. 2 WATER

DATA ASSESSMENT SUMMARY

REVIEW ITEM	VOA	BNA	Pest / PCB	TPH-Dx	PAHs (Sim)	OTHER	OTHER
1. Data Completeness	O	O	O	O	O		
2. Preservation, Holding Times	X (1)	O	Θ (2)	O	X (7)	No Qualif. TMB	
3.GC/MS Tune, Inst. Performance	O	O	–	–	O		
4. Calibrations	O	O	O	O	O		
5. Surrogates	X (3)	Θ	O	Θ	Θ		
6. Internal Standards	O	O	–	–	X (9)		
7. Lab Blanks, Field Blanks	X (4)	X (5)	O	O	O		
8. Lab Duplicates, Field Duplicates	O	O	O	O	Θ (8)		
9. LCS, Blank Spike, MS/MSD	O	X (6)	O	O	O		
10.Compound Identification, TICs	O	O	O	O	O		
11. Result Verification, D.Limits	O	Θ	O	O	O		
12. Overall Summary	O	O	O	O	O		

O = Data had no problems Θ = Problems, but do not affect data

X = Data qualified due to minor problems [typically estimated data (J or UJ)].

M = Data qualified due to major problems [typically more than 50% qualified (J/UJ).

Z = Data unacceptable [typically data rejected (R).

Comments/Qualified Results: (1) VOA trip blank analysis out of hold; Qual.f. J/UJ. (2) Samples 1-8 out of Hold for PCB; Assoc. results ~~qualif.~~ (J/UJ). (3) Surrogates out of limit for VOA Samples. Qual. applied to #8, #11, #17 (J). (4) VOA preparation (LAB) blanks have multiple detects. Assoc. results for 1-8 and 10-18 qualified 'U'. (See annotated report pages). (5) SVOA prep. blanks have contamination; Assoc. results qualified 'U' in samples 3-8 and 10, 11, 13, 14. (See annotated pages). (6) Multiple SVOA compounds in LCS below limit; Associated results qualif. (UJ) in all samples (See section 9 for analyte list.)

No Qual. TMB 12-16-09

~~(7) PAH samples 1-8 tested 1 Day past H. TIME. Assoc results (J/UJ).~~

No Qual. TMB 1-20-2010

(8) Field Duplic GRS5-SED: RPD out of limit select analytes (section 8).

Validated by: CM Date: Nov. 7, 2009

Reviewed by: Date:

(9) Multiple ID out of limit for PAH's; Assoc. detects (J) non-detects (R).

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable:

YES ☑ NO ☐

1. Date Package Completeness (Check if present)..... ☑ ☐

- ✓ Case narrative
- ✓ Chain of Custody
- ✓ Sample Results
- ✓ Detection Limits
- ✓ GC/MS Tuning
- ✓ Initial Calibration
- ✓ Continuing Calib.
- ✓ Blank Results
- ✓ Surrogate Results
- ✓ Internal Standards
- ✓ MS/MSD, LCS Results
- ✓ Preparation Logs
- ✓ Analysis Run Logs
- ✓ Raw Data
- Other_____

/ Acceptable
x Absent
o Not required for data package requested.

Comments/Qualified Results: Error on chain of custody cites SVOA analysis for sample EQUIP Blank (TRIP). NO QUAL.

2. Holding Times (Check all that apply)..... ☐ ☒

- ✓ Unpreserved VOA analyzed in 7 days from collection; Preserved 14 days from collection
- ✓ BNA samples extracted within 7 days (14 day soil) of collection
- ✓ BNA extracts analyzed within 40 days of collection
- ✓ Pest/PCBs samples extracted within 7 days (14 day soil) of collection
- X Pest/PCBs extracts analyzed within 40 days of collection — 46 Day - No Qual.

TPH-Dx — 14 Day

Qualify as estimated (J/UJ) all results analyzed past hold time limits, but within 2X of the limit. Outside the 2X limit, qualify detects as (J) and non-detects as (UR).

Comments/Qualified Results: (X) VOA - 14 Days all, except TRIP BLANK → Assoc. results qual. (J/UJ). SVOA - 14 Day max met, all Samples (soil), 7 Day for Equip Blank. PCB - 7 Day Water Prep. TPH-Dx - 10 Day on water (X) PCB (soil) - 15 day prep for Samples 1-8 Assoc. results ~~qual (J/UJ)~~. NO Qualif. applied due to SW-846 citation that allows 1 year HOLD TIME for PCBs. 12-16-09; See SW-846 Update IV, Section 4.0 in Chapter 4, Table 4-1.

3. GC Instrument Tune, Performance Check ..... ☑ ☐

- ✓ GC/MS Tuning performed
- ✓ GC/MS Tuning within control limits
- GC/MS Tuning out of control limits, (qualify R/UR)
- Res Chk Mix, MidPoint AB <60%, (J for detects, UR other)
- PEM resolution <90% adj pks, (J for detects, UR other)
- DDT, Endrin breakdown >20%, (J for DDD,DDT, Endrin, Endrin Aldehyde, Endrin Ketone, or NJ/R)
- Res Check Mix, MidPoint AB, TCMX, DCBP within RT windows from ICAL AB mixture (Fix or R/UR)

Comments/Qualified Results: PAH 9/18, 9/21 ; SVOA 9/19, 9/22 ; VOA 9/14, 9/18, 9/22

PCB — ICAL & CCAL accept.

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable: Yes NO

4. Initial & Continuing Calibration (Check all that apply)..... ☑ ☒

TMB 11-6-09

GC/MS Data: __ICal RRFs>0.05 all cmpnds (If no,J/UR), [>0.01 for Poor Performers] VOA, SVOA
__ICal RSD of RRF <30% all cmpnds (If no,J detects) [<50% for Poor Performers] VOA
__ICal RSD of RRF<20.5% all cmpnds (If no,J detects) [<50% or *30% for Poor Performers] SVOA
*Note: *Applies to 2,4-DNT, 2-Nitrophenol, and 2,4-DMP only [SVOA].*
__Continue Cal. +/- 30% Diff of RRF (If no, J/UJ) [+/- 50% Diff, Poor Performers] VOA, SVOA
__Continue Cal. %D <25% all cmpnds (If no,J/UJ) , VOA, SVOA
Pesticide/PCB: __RSD<10% for performance checks (If no J detects)
__Stnds analyzed prior to analysis, & at proper frequency
__Continuing Cal. % Diff. <15% for quant. (<20% for confirm column)

TPH-Dx - Sept. 11-12 ✓, LIBE @ 0.998=r² ✓, CCAL %D ✓ (Front, Rear columns). PAH-Tune 9/18 ✓ 9/21 ✓, CCAL %Rec. ; PCB - ICAL 9/16, R²=0.998 for TMB A-1016, A-1260 ✓, CCAL 90-110% ✓ (Front Rear). SVOA - ICAL %RSD ✓, ~~CCAL %D ✓ 9/18~~, 9/22 ; TUNE 9/19, 9/22 ✓. CCAL 9/18 ✓ ~~Pentachlorophenol~~ ⊗ 9/22 OK ✓ ~~out of Limit - Assoc detects qualif. (J). TMB~~. 9/18 is Water smpls. No Qual. VOA ICAL 9/14 %RSD ✓ CCAL 9/21: ~~tetrachloroethene ✓ - No Qualif.~~ 9/22: No TAL out ✓, 9/25 ✓.

5. Surrogates (Check all that apply)..... ☐ ☒

✓ - Indicates surrog. are OK.

__Surrogates analyzed
__Recoveries within Method Control (lab) limits (VOA: 80 – 120%, SVOA: Lab Established, PEST: 30-150%)
__Recoveries above Method Control limits (J detects only)
__Recoveries below Method Control limits but>20% (J/UJ)
__Recoveries below 20%, 10% for PEST (J/UR for VOA, J/ UJ or UR for SVOA, J/UR for PEST)

Comments/Qualified Results ⊗ VOA out of Limit #6 ✗, 8 ✗, 11, 17 ⊗; ✗ for Trifluoro-toluene, ⊗ for Bromofluorobenzt; Assoc detects (J). SVOA ✓ Out of Lim: #03 ↓, 04 ↓, 05 ↓, 08 ↓; ~~14 ↓ Assoc results J/ur~~ Single Surrogates only - NO Qualif. SVOC-PAH ✓ ~~#15~~ Surrog. diluted out for #15-18. - NO QUALIF. PCB #9 ✓ TPH-Dx - ✓

6. Internal Standards Performance..... ☑ ☒

TMB 11-06-09

✓ Internal standards added to all QC and samples
__Internal standards areas within Control Limits* [+/-40% VOA, +/-50% SVOA]*
*Associated with 12 Hour CCV Stnd.
__Internal standards out of Control limits but >10% (J/~~UJ~~)
__Internal standards zero or <10% of Control limits (J/UR)
__Internal standards RTs within +/-20 sec window (If no, J/UJ)

⊗

Comments/Qualified Results: VOA ✓; SVOA ✓ = PAHs - Benzo(a)A. B(a)P, Benzo(b)Flur, Benzo(ghi), Benzo(K), Chrysene, Dibenzo(ah), Ideno(123), and Pyrene - Samples 01, 07, 14, 15, 16 & 17 out of limit Low - Assoc detects qualif. (J) Non-detects (R).

ORGANIC ANALYTE - Tier III & IV Data Validation Summary Checklist

Acceptable: Yes NO

7. Laboratory Blanks, Field Blanks (Check all that apply)..... ☐ X

✓ Method Blanks, Prep.Blanks analyzed after Cal Stnds and every 12 hours
__Method Blnk Common Lab Contaminants, list: MeCl2, Cyclohex (<10X RLs); Acetone, 2-butanone (<2X RLs); Chart
__Other Contaminants: Qualify results (< 5X RL) according to Chart below.
__Instrument blanks after all high level samples, All cmpnds must be <RL

G-EB-090709 ; TRIP BLNK are EQUIP BLANKS (FIELD) #s 9 & 19 respect.

Examples:

BLANK			SAMPLE	Q
MDL	Result	PQL	Result	Applied
0.3	0.45	1.0	0.8	1.0 U
0.3	0.99	1.0	1.8	1.8 J
0.3	1.5	1.0	1.1	1.5 U
0.3	1.5	1.0	1.8	1.8 J
0.3	0	1.0	0.85	0.85 J
0.3	0	1.0	1.8	1.8

Comments/Qualified Results:

VOA #9 Detects: Not Analyz.
#19 Detects: MeCl, 135 TriM.Benz, n-But, lBenz, 124 TriClBenz, 123 TCB.
SVOA - #9 Napthal. Acenapth above RL.
⊗ VOA Samples: 9/21 Detects qualif. 'U' @ RL for Benz, Tol, o-Xyl, Chl.Benz, 124 TCB, 123 TCB, mpXyl & Naphthalene. 9/22 detects for Benz, Tol. CBenz, 123 TCB.
⊗ SVOA: 9/15 prep detects qualif. 'U' @ RL for Diethylphth. & DinButyl phth.
PCB: 9/14 prep ND ✓ TPH-Dx - ND ✓, PAH - ND ✓

8. Duplicate, Field Duplicates (Check all that apply)..... ✓ ☐

__Duplicate RPD ≤20% for waters (≤35% for soils) for results >5X CRDL
__Duplicate range is within ±CRDL (± 2X CRDL for soils) for results <5X CRDL
__Field duplicate RPD ≤20% (≤35% for soils)

Comments/Qualified Results: TPH-Dx ✓, PCB MS/MSD RPD ✓. PAH - Ideno pyrene on MS/MSD - No Qual.

Sample GRS5-SED-0 & GRS5D-SED assumed F.Duplic: RPD calc.
VOA ✓ SVOA - Phenanthrene, Fluoranthene & Pyrene exceed precision limits - NO QUALIF. APPLIED (Advisory only). PCB - All ND ✓.
⊗ TPH-Dx - All ND ✓.

9. MS/MSD, Lab Control Samples, Blank Spikes (Check all that apply)....☐ X

__LCS ~~%R 80-120%~~ w/in Labestab. limits
__LCS %R 50-79% or >120%, results >IDL estimated (J)
✓ LCS %R 50-79% and results <IDL estimated (UJ)
__LCS %R <50% and all results rejected (R/UR)

Comments/Qualified Results: TPH-Dx (Smpl.-01) ✓ 76% MS ✓, 82% LCS ✓.
PCB - LCS 93 & 105 ✓, MS/MSD 92/86% ✓. PAH - LCS ✓, MS/MSD ✓.
SVOA - Multiple TAL don't meet Lab estab. limits - No Qualif. Advisory.
⊗ LCS - 1,3DCB, 2-NitroPhen, HexaClPentadiene, 24DiNphenol, ~~24DiNit.2methphenR~~ - Assoc. results qualif. (J/UJ).

	Acceptable: Yes	NO
10.Compound Identification, TICs.....	☑	☐

Comments/Qualified Results: _____

11. Result Verification, Detection Limits ..... ☑ ☐

__All results supported in raw data
__Detection Limits appropriate to meet project needs (Review Work Plan, QAPP)

Comments/Qualified Results: SVOA & SVOC/PAH – B@P screen level not met @lab reported RL, MDL ~~meets~~ met for B@P all results below RL Advisory. condition for Lab RL requirement.

12. Overall Assessment..... ☑ ☐

Comments/Qualified Results: _____

TestAmerica

Data Deliverable Package

Golder Associates, Inc.
Doug Morell
18300 NE Union Hill Rd. Suite 20(
Redmond, WA 98077

Done

Project: Avery Landing

Project Number: 073-93312-03

Laboratory Work Order: SSI0049

October 30, 2009

Total Pages
3204

TestAmerica-Spokane
11922 E. 1st Avenue
Spokane, WA 99206

Phone: (509) 924-9200
Fax: (509)924-9290

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 9/7/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0049		
NJDEP#:	PA004		

SAMPLE RECEIPT: Samples were received intact, on ice, with custody seals and chain of custody documentation. The Cooler(s) were received and the sample temperature(s) were measured at 5.3° C upon receipt at the laboratory.

HOLDING TIMES: The sample analysis for SSI0049-19 in batch 51093 by 8260B STD was performed past method-specified holding time.

As per EPA SW846 revision 4 the holding time for 8082 PCB analysis is one year from collection.

PROBLEMS ENCOUNTERED: No problems were encountered.

QA/QC CRITERIA: The surrogate Trifluorotoluene in samples SSI0049-06, -08 and -11 batch 50608 by 8260B exceeds the control limits.

The surrogate 4-Bromofluorobenzene in sample SSI0049-17, batch 50646 by 8260B exceeds the control limits.

The surrogate 2-Fluorobiphenyl in samples SSI0049-03, -04, -05, -08, -14, -15, -16, -17 and -18 batch 50242 by 8270C exceeds the control limits.

The surrogate 2,4,6-Tribromophenol in samples SSI0049-15, -16 -17 and -18 batch 50242 by 8270C exceeds the control limits.

The surrogate Nitrobenzene-d5 in sample SSI0049-15, -16, -17 and -18 batch 50242 by 8270C STD Dry exceeds the control limits.

The surrogate Phenol-d5 in sample SSI0049-15, -16, -17 and -18 batch 50242 by 8270C exceeds the control limits.

The surrogate Terphenyl-d14 in sample SSI0049-15, -16, -17 and 18 batch 50242 by 8270C exceeds the control limits.

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 9/7/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0049		
NJDEP#:	PA004		

The PCB-1016 and PCB-1260 recoveries in samples 9090148-MS1 and –MSD1 were above the acceptance limits for EPA 8082, batch 9090148, due to sample matrix interference. See Blank Spike (LCS).

Due to sample matrix effects in samples SSI0049-03, -07, -08, -10 and -17 the surrogate recoveries were below the acceptance limits in batch 9090148 by EPA 8082.

The Calibration Verification recovery for SSI0049-17 in batch 9090148 by EPA 8082 was below the method control limit due to matrix interference carried over from analytical samples. The matrix interference was confirmed by reanalysis with the same result.

The Indeno (1,2,3-cd) pyrene RPD for samples 9090148-MS1 and MSD1 exceeded the acceptance limit due to sample matrix effects for EPA 8270 mod., batch 9090116.

Samples SSI0049-01 and -15 for EPA 8270 mod., batch 9090116, required a dilution due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.

The Internal Standard recovery associated with Benzo (a) anthracene, Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0049-01 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

The Internal Standard recovery associated with Benzo (a) anthracene, Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0049-07 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

The Internal Standard recovery associated with Benzo (a) pyrene, Benzo

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 9/7/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0049		
NJDEP#:	PA004		

(b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Dibenzo (a,h) anthracene and Indeno (1,2,3-cd) pyrene in sample SSI0049-14 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

The Internal Standard recovery associated with Benzo (a) anthracene, Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0049-15 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

The Internal Standard recovery associated with Benzo (a) anthracene, Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0049-16 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

Due to sample matrix effects in sample SSI0049-17 batch 9090116 by EPA 8270 mod., the 2-FBP recovery was outside the acceptance limits.

The Internal Standard recovery associated with Benzo (a) anthracene, Benzo (a) pyrene, Benzo (b) fluoranthene, Benzo (ghi) perylene, Benzo (k) fluoranthene, Chrysene, Dibenzo (a,h) anthracene, Indeno (1,2,3-cd) pyrene, p-Terphenyl-d14 and Pyrene in sample SSI0049-17 batch 9090116 for EPA 8270 mod. was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.

Due to sample matrix effects in sample SSI0049-17 batch 9090116 by EPA 8270 mod., the p-Terphenyl-d14 recovery was outside the acceptance limits.

OBSERVATIONS: Results that fall between the MDL and RL are 'J' flagged.

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

CASE NARRATIVE

Client:	Golder Associates, Inc.	**Date Sampled:**	9/8/2009 to 9/7/2009
Project:	Avery Landing 073-93312-03	**Date Received:**	9/9/2009
Lab:	SSI0049		
NJDEP#:	PA004		

SUBCONTRACTED: EPA 8260B, EPA 8270C, EPA 6010C/6020A and EPA 7471B were subcontracted to the TestAmerica Tacoma laboratory.

TestAmerica Spokane

Randee Decker
Project Manager

11922 East 1st. Avenue Spokane, WA 99206 (509)924-9200 (509)924-9290

The case narrative is an integral part of the report. This report shall not be reproduced, except in full, without written permission from TestAmerica.

DATA REPORTING QUALIFIERS

Client: TestAmerica Laboratories, Inc Job Number: 580-15385-1

Lab Section	Qualifier	Description
GC/MS VOA		
	B	Compound was found in the blank and sample.
	F	MS or MSD exceeds the control limits
	J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
	H	Sample was prepped or analyzed beyond the specified holding time
	X	Surrogate exceeds the control limits
GC/MS Semi VOA		
	B	Compound was found in the blank and sample.
	*	LCS or LCSD exceeds the control limits
	F	MS or MSD exceeds the control limits
	J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
	F	RPD of the MS and MSD exceeds the control limits
	X	Surrogate exceeds the control limits
	D	Surrogate or matrix spike recoveries were not obtained because the extract was diluted for analysis; also compounds analyzed at a dilution may be flagged with a D.

DATA REPORTING QUALIFIERS

Client: TestAmerica Laboratories, Inc Job Number: 580-15385-1

Lab Section	Qualifier	Description
Metals		
	B	Compound was found in the blank and sample.
	F	Duplicate RPD exceeds the control limit
	^	ICV,CCV,ICB,CCB, ISA, ISB, CRI, CRA, DLCK or MRL standard: Instrument related QC exceeds the control limits.
	*	LCS or LCSD exceeds the control limits
	4	MS, MSD: The analyte present in the original sample is 4 times greater than the matrix spike concentration; therefore, control limits are not applicable.
	W	PS: Post-digestion spike was outside control limits
	J	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
	V	Serial Dilution exceeds the control limits

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Notes and Definitions

Report Specific Notes:

*	-	LCS or LCSD exceeds the control limits
^	-	ICV,CCV,ICB,CCB, ISA, ISB, CRI, CRA, DLCK or MRL standard: Instrument related QC exceeds the control limits.
4	-	MS, MSD: The analyte present in the original sample is 4 times greater than the matrix spike concentration; therefore, control limits are not applicable.
B	-	Compound was found in the blank and sample.
C7	-	Calibration Verification recovery was below the method control limit due to matrix interference carried over from analytical samples. The matrix interference was confirmed by reanalysis with the same result.
D	-	Surrogate or matrix spike recoveries were not obtained because the extract was diluted for analysis; also compounds analyzed at a dilution may be flagged with a D.
F	-	Duplicate RPD exceeds the control limit
H	-	Sample was prepped or analyzed beyond the specified holding time
I01	-	Internal Standard recovery was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.
J	-	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
M1	-	The MS and/or MSD were above the acceptance limits due to sample matrix interference. See Blank Spike (LCS).
R3	-	The RPD exceeded the acceptance limit due to sample matrix effects.
X	-	Surrogate exceeds the control limits
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
Z3	-	The sample required a dilution due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.



Randee Decker, Project Manager

Table of Contents

Cover Title Page 1

Data Summaries 6

Report Narrative 6

Sample Summary 10

Method Summary 11

Sample Datasheets 12

Surrogate Summary 136

QC Data Summary 141

Data Qualifiers 208

QC Association Summary 210

Organic Sample Data 222

GC/MS VOA 222

8260B 222

8260B QC Summary 223

8260B Sample Data 254

Standards Data 496

8260B ICAL Data 496

8260B CCAL Data 771

Raw QC Data 864

8260B Tune Data 864

8260B Blank Data 879

8260B LCS/LCSD Data 921

8260B MS/MSD Data 971

8260B Run Logs 991

8260B Prep Data 996

GC/MS Semi VOA 1003

Table of Contents

8270C 1003

8270C QC Summary 1004

8270C Sample Data 1020

Standards Data 1405

8270C ICAL Data 1405

8270C CCAL Data 1493

Raw QC Data 1522

8270C Tune Data 1522

8270C Blank Data 1534

8270C LCS/LCSD Data 1541

8270C MS/MSD Data 1550

8270C Run Logs 1565

8270C Prep Data 1569

8270C_SIM 1571

8270C_SIM QC Summary 1572

8270C_SIM Sample Data 1579

Standards Data 1593

8270C_SIM ICAL Data 1593

8270C_SIM CCAL Data 1638

Raw QC Data 1650

8270C_SIM Tune Data 1650

8270C_SIM Blank Data 1656

8270C_SIM LCS/LCSD Data 1667

8270C_SIM Run Logs 1670

8270C_SIM Prep Data 1672

GC Semi VOA 1675

Table of Contents

8082 1675

8082 QC Summary 1676

8082 Sample Data 1681

Standards Data 1685

8082 ICAL Data 1685

8082 CCAL Data 1814

Raw QC Data 1881

8082 Blank Data 1881

8082 LCS/LCSD Data 1884

8082 Run Logs 1888

8082 Prep Data 1892

Inorganic Sample Data 1895

Metals Data 1895

Met Cover Page 1896

Met Sample Data 1897

Met QC Data 1916

Met ICV/CCV 1916

Met CRQL 1930

Met Blanks 1933

Met ICSA/ICSAB 1954

Met MS/MSD/PDS 1965

Met Duplicates 1971

Met LCS/LCSD 1973

Met Serial Dilution 1997

Met MDL 2001

Met Linear Ranges 2007

Table of Contents

Met Preparation Log 2010

Met Analysis Run Log 2016

Met Raw Data 2030

Met Prep Data 2232

General Chemistry Data 2238

Gen Chem Cover Page 2239

Gen Chem MDL 2240

Gen Chem Analysis Run Log 2241

Gen Chem Prep Data 2242

Shipping and Receiving Documents 2243

Client Chain of Custody 2244

Sample Receipt Checklist 2262

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: Moisture

Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC).

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**							**Sampled: 09/07/09 13:50**		
PCB-1016	EPA 8082	ND	U	-----	9.69	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 09:41	
PCB-1221	"	ND		----	9.69	"	"	"	"	09/23/09 09:18	
PCB-1232	"	ND		----	9.69	"	"	"	"	"	
PCB-1242	"	ND		----	9.69	"	"	"	"	"	
PCB-1248	"	ND		----	9.69	"	"	"	"	"	
PCB-1254	"	ND		----	9.69	"	"	"	"	"	
PCB-1260	"	**10.4**		----	9.69	"	"	"	"	09/23/09 09:41	
Surrogate(s): *TCX*		*61.6%*			*27.9 - 154 %*		"			"	
Decachlorobiphenyl		*50.5%*			*35 - 157 %*		"			"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**							**Sampled: 09/07/09 13:55**		
PCB-1016	EPA 8082	ND	U	-----	9.68	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:11	
PCB-1221	"	ND		----	9.68	"	"	"	"	09/23/09 09:41	
PCB-1232	"	ND		----	9.68	"	"	"	"	"	
PCB-1242	"	ND		----	9.68	"	"	"	"	"	
PCB-1248	"	ND		----	9.68	"	"	"	"	"	
PCB-1254	"	ND		----	9.68	"	"	"	"	"	
PCB-1260	"	ND		----	9.68	"	"	"	"	09/23/09 10:11	
Surrogate(s): *TCX*		*54.9%*			*27.9 - 154 %*		"			"	
Decachlorobiphenyl		*51.4%*			*35 - 157 %*		"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**							**Sampled: 09/07/09 14:45**		
PCB-1016	EPA 8082	ND	U	-----	9.51	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:33	
PCB-1221	"	ND		----	9.51	"	"	"	"	09/23/09 10:11	
PCB-1232	"	ND		----	9.51	"	"	"	"	"	
PCB-1242	"	ND		----	9.51	"	"	"	"	"	
PCB-1248	"	ND		----	9.51	"	"	"	"	"	
PCB-1254	"	ND		----	9.51	"	"	"	"	"	
PCB-1260	"	ND		----	9.51	"	"	"	"	09/23/09 10:33	
Surrogate(s): *TCX*		*8.35%*			*27.9 - 154 %*		"			"	Z
Decachlorobiphenyl		*36.5%*			*35 - 157 %*		"			"	

NO QUALIFICATION
12-16-09

No Qualif.
12-16-09

NO Qualif.
12-16-09

11-06-09

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**						**Sampled: 09/07/09 14:50**			
PCB-1016	EPA 8082	ND	U-J	-----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:56	
PCB-1221	"	ND		-----	9.99	"	"	"	"	09/23/09 10:33	
PCB-1232	"	ND		-----	9.99	"	"	"	"	"	
PCB-1242	"	ND		-----	9.99	"	"	"	"	"	
PCB-1248	"	ND		-----	9.99	"	"	"	"	"	
PCB-1254	"	ND		-----	9.99	"	"	"	"	"	
PCB-1260	"	ND		-----	9.99	"	"	"	"	09/23/09 10:56	
Surrogate(s): *TCX*		*35.8%*				*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*41.0%*				*35 - 157 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**						**Sampled: 09/07/09 15:30**			
PCB-1016	EPA 8082	ND	U-J	-----	9.54	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 11:19	
PCB-1221	"	ND		-----	9.54	"	"	"	"	09/23/09 10:56	
PCB-1232	"	ND		-----	9.54	"	"	"	"	"	
PCB-1242	"	ND		-----	9.54	"	"	"	"	"	
PCB-1248	"	ND		-----	9.54	"	"	"	"	"	
PCB-1254	"	ND		-----	9.54	"	"	"	"	"	
PCB-1260	"	ND		-----	9.54	"	"	"	"	09/23/09 11:19	
Surrogate(s): *TCX*		*41.3%*				*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*37.7%*				*35 - 157 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**						**Sampled: 09/07/09 15:25**			
PCB-1016	EPA 8082	ND	U-J	-----	9.94	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 11:42	
PCB-1221	"	ND		-----	9.94	"	"	"	"	09/23/09 11:19	
PCB-1232	"	ND		-----	9.94	"	"	"	"	"	
PCB-1242	"	ND		-----	9.94	"	"	"	"	"	
PCB-1248	"	ND		-----	9.94	"	"	"	"	"	
PCB-1254	"	ND		-----	9.94	"	"	"	"	"	
PCB-1260	"	ND		-----	9.94	"	"	"	"	09/23/09 11:42	
Surrogate(s): *TCX*		*32.5%*				*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*58.2%*				*35 - 157 %*	"			"	

NO QUALIF. TMD 12-16-09

NO QUALIF. TMD 12-16-09

NO QUALIF. TMD 12-16-09

TMD 11-06-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	Q	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**					
PCB-1016	EPA 8082	ND	U	----	9.58	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 12:04	
PCB-1221	"	ND		----	9.58	"	"	"	"	09/23/09 11:42	
PCB-1232	"	ND		----	9.58	"	"	"	"	"	
PCB-1242	"	ND		----	9.58	"	"	"	"	"	
PCB-1248	"	ND		----	9.58	"	"	"	"	"	
PCB-1254	"	ND		----	9.58	"	"	"	"	"	
PCB-1260	"	ND		----	9.58	"	"	"	"	09/23/09 12:04	
Surrogate(s): *TCX*		*39.3%*				*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*34.2%*				*35 - 157 %*	"			"	Z
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**					
PCB-1016	EPA 8082	ND	U	----	9.76	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 12:27	
PCB-1221	"	ND		----	9.76	"	"	"	"	09/23/09 12:04	
PCB-1232	"	ND		----	9.76	"	"	"	"	"	
PCB-1242	"	ND		----	9.76	"	"	"	"	"	
PCB-1248	"	ND		----	9.76	"	"	"	"	"	
PCB-1254	"	ND		----	9.76	"	"	"	"	"	
PCB-1260	"	ND		----	9.76	"	"	"	"	09/23/09 12:27	
Surrogate(s): *TCX*		*17.5%*				*27.9 - 154 %*	"			"	Z
Decachlorobiphenyl		*26.6%*				*35 - 157 %*	"			"	Z
SSI0049-10 (G-RS5SED-0-090809)		**Soil**				**Sampled: 09/08/09 08:30**					
PCB-1016	EPA 8082	ND		----	9.96	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:05	
PCB-1221	"	ND		----	9.96	"	"	"	"	"	
PCB-1232	"	ND		----	9.96	"	"	"	"	"	
PCB-1242	"	ND		----	9.96	"	"	"	"	"	
PCB-1248	"	ND		----	9.96	"	"	"	"	"	
PCB-1254	"	ND		----	9.96	"	"	"	"	"	
PCB-1260	"	ND		----	9.96	"	"	"	"	"	
Surrogate(s): *TCX*		*27.5%*				*27.9 - 154 %*	"			"	Z
Decachlorobiphenyl		*35.8%*				*35 - 157 %*	"			"	

No Qualif. TMS 12-16-09

No Qualif. TMS 12-16-09

TMS 11-06-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
PCB-1016	EPA 8082	ND	----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:28	
PCB-1221	"	ND	----	9.99	"	"	"	"	"	
PCB-1232	"	ND	----	9.99	"	"	"	"	"	
PCB-1242	"	ND	----	9.99	"	"	"	"	"	
PCB-1248	"	ND	----	9.99	"	"	"	"	"	
PCB-1254	"	ND	----	9.99	"	"	"	"	"	
PCB-1260	"	ND	----	9.99	"	"	"	"	"	
Surrogate(s): TCX		*65.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*64.6%*			*35 - 157 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
PCB-1016	EPA 8082	ND	----	9.95	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:50	
PCB-1221	"	ND	----	9.95	"	"	"	"	"	
PCB-1232	"	ND	----	9.95	"	"	"	"	"	
PCB-1242	"	ND	----	9.95	"	"	"	"	"	
PCB-1248	"	ND	----	9.95	"	"	"	"	"	
PCB-1254	"	ND	----	9.95	"	"	"	"	"	
PCB-1260	"	ND	----	9.95	"	"	"	"	"	
Surrogate(s): TCX		*66.8%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*64.7%*			*35 - 157 %*	"			"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
PCB-1016	EPA 8082	ND	----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:13	
PCB-1221	"	ND	----	9.99	"	"	"	"	"	
PCB-1232	"	ND	----	9.99	"	"	"	"	"	
PCB-1242	"	ND	----	9.99	"	"	"	"	"	
PCB-1248	"	ND	----	9.99	"	"	"	"	"	
PCB-1254	"	ND	----	9.99	"	"	"	"	"	
PCB-1260	"	ND	----	9.99	"	"	"	"	"	
Surrogate(s): TCX		*101%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*114%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
PCB-1016	EPA 8082	ND	----	9.79	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:35	
PCB-1221	"	ND	----	9.79	"	"	"	"	"	
PCB-1232	"	ND	----	9.79	"	"	"	"	"	
PCB-1242	"	ND	----	9.79	"	"	"	"	"	
PCB-1248	"	ND	----	9.79	"	"	"	"	"	
PCB-1254	"	ND	----	9.79	"	"	"	"	"	
PCB-1260	"	ND	----	9.79	"	"	"	"	"	
Surrogate(s): *TCX*		*75.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*68.9%*			*35 - 157 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
PCB-1016	EPA 8082	ND	----	9.98	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:58	
PCB-1221	"	ND	----	9.98	"	"	"	"	"	
PCB-1232	"	ND	----	9.98	"	"	"	"	"	
PCB-1242	"	ND	----	9.98	"	"	"	"	"	
PCB-1248	"	ND	----	9.98	"	"	"	"	"	
PCB-1254	"	ND	----	9.98	"	"	"	"	"	
PCB-1260	"	ND	----	9.98	"	"	"	"	"	
Surrogate(s): *TCX*		*104%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*55.4%*			*35 - 157 %*	"			"	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
PCB-1016	EPA 8082	ND	----	9.62	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 15:21	
PCB-1221	"	ND	----	9.62	"	"	"	"	"	
PCB-1232	"	ND	----	9.62	"	"	"	"	"	
PCB-1242	"	ND	----	9.62	"	"	"	"	"	
PCB-1248	"	ND	----	9.62	"	"	"	"	"	
PCB-1254	"	ND	----	9.62	"	"	"	"	"	
PCB-1260	"	ND	----	9.62	"	"	"	"	"	
Surrogate(s): *TCX*		*109%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*82.0%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					**C7**
PCB-1016	EPA 8082	ND	----	9.66	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 17:37	
PCB-1221	"	ND	----	9.66	"	"	"	"	"	
PCB-1232	"	ND	----	9.66	"	"	"	"	"	
PCB-1242	"	ND	----	9.66	"	"	"	"	"	
PCB-1248	"	ND	----	9.66	"	"	"	"	"	
PCB-1254	"	ND	----	9.66	"	"	"	"	"	
PCB-1260	"	ND	----	9.66	"	"	"	"	"	
Surrogate(s): TCX		*103%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*11.2%*			*35 - 157 %*	"			"	Z
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
PCB-1016	EPA 8082	ND	----	9.55	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 15:43	
PCB-1221	"	ND	----	9.55	"	"	"	"	"	
PCB-1232	"	ND	----	9.55	"	"	"	"	"	
PCB-1242	"	ND	----	9.55	"	"	"	"	"	
PCB-1248	"	ND	----	9.55	"	"	"	"	"	
PCB-1254	"	ND	----	9.55	"	"	"	"	"	
PCB-1260	"	ND	----	9.55	"	"	"	"	"	
Surrogate(s): TCX		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*55.6%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**			**Sampled: 09/07/09 17:00**					
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52855	09/14/09 08:57	10/23/09 14:13	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): Tetrachloro-m-xylene			*86%*		*60 - 150 %*	"			"	
DCB Decachlorobiphenyl			*58%*		*40 - 135 %*	"			"	

11-06-09

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Acenaphthylene	8270C STD	**0.0013**	*0.0010*	0.0094	ug/L	1x	50156	09/14/09 09:08	09/18/09 09:28	J
Naphthalene	"	**0.014**	*0.0034*	0.0094	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0079**	*0.0028*	0.012	"	"	"	"	"	J
Acenaphthene	"	**0.018**	*0.00094*	0.0094	"	"	"	"	"	B
1-Methylnaphthalene	"	~~0.0048~~	*0.0011*	0.0094	U	"	"	"	"	~~J,B~~
Fluorene	"	~~0.0026~~	*0.0011*	0.0094	U	"	"	"	"	~~J,B~~
Chrysene	"	ND	*0.0020*	0.0094		"	"	"	"	
Phenanthrene	"	**0.0034**	*0.0010*	0.0094		"	"	"	"	J
Anthracene	"	~~0.0012~~	*0.00075*	0.0094	U	"	"	"	"	~~J,B~~
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094		"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094		"	"	"	"	
Fluoranthene	"	~~0.0026~~	*0.0015*	0.0094	U	"	"	"	"	~~J,B~~
Benzo[a]pyrene	"	ND	*0.0018*	0.019		"	"	"	"	
Pyrene	"	ND	*0.0016*	0.0094		"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094		"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094		"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094		"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094		"	"	"	"	
Surrogate(s): *2-Fluorobiphenyl*			*71%*			*50 - 110 %*	"		"	
Terphenyl-d14			*89%*			*50 - 135 %*	"		"	
Nitrobenzene-d5			*80%*			*40 - 110 %*	"		"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**				**Sampled: 09/07/09 13:50**				
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00850	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 22:01	
2-Methylnaphthalene	"	ND	----	0.00850	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00850	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00850	"	"	"	"	"	
Anthracene	"	ND	----	0.00850	"	"	"	"	"	
Benzo (a) anthracene	"	ND R	----	0.00850	"	"	"	"	"	I01
Benzo (a) pyrene	"	ND R	----	0.00850	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	**0.0147** J	----	0.00850	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0193** J	----	0.00850	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND R	----	0.00850	"	"	"	"	"	I01
Chrysene	"	**0.00907** J	----	0.00850	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.00907** J	----	0.00850	"	"	"	"	"	I01
Fluoranthene	"	ND	----	0.00850	"	"	"	"	"	
Fluorene	"	ND	----	0.00850	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0113** J	----	0.00850	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00850	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00850	"	"	"	"	"	
Pyrene	"	**0.0204** J	----	0.00850	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*29.2%*		*38.8 - 139 %*	"			"		*Z3*
2-FBP		*35.6%*		*40 - 132 %*	"			"		*Z3*
p-Terphenyl-d14		*83.2%*		*31.7 - 179 %*	"			"		*I01*
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00494	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:50	
2-Methylnaphthalene	"	ND	----	0.00494	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00494	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00494	"	"	"	"	"	
Anthracene	"	ND	----	0.00494	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00494	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00494	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0155** J	----	0.00494	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00672** J	----	0.00494	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND R	----	0.00494	"	"	"	"	"	
Chrysene	"	**0.00941**	----	0.00494	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00494	"	"	"	"	"	
Fluoranthene	"	**0.00874**	----	0.00494	"	"	"	"	"	
Fluorene	"	ND	----	0.00494	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00494	"	"	"	"	"	

TestAmerica Spokane

No Quals.

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
Naphthalene	EPA 8270 mod.	ND	----	0.00494	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:50	
Phenanthrene	"	ND	----	0.00494	"	"	"	"	"	
Pyrene	"	**0.00874**	----	0.00494	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*92.2%*			*38.8 - 139 %*	"			"	
2-FBP		*100%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*89.8%*			*31.7 - 179 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00417	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 21:24	
2-Methylnaphthalene	"	ND	----	0.00417	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00417	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00417	"	"	"	"	"	
Anthracene	"	ND	----	0.00417	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00417	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00417	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00417	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00417	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00417	"	"	"	"	"	
Chrysene	"	ND	----	0.00417	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00417	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00417	"	"	"	"	"	
Fluorene	"	ND	----	0.00417	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00417	"	"	"	"	"	
Naphthalene	"	ND	----	0.00417	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00417	"	"	"	"	"	
Pyrene	"	ND	----	0.00417	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*78.6%*			*38.8 - 139 %*	"			"	
2-FBP		*87.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*85.8%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00489	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:20	
2-Methylnaphthalene	"	ND	----	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00489	"	"	"	"	"	
Anthracene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Chrysene	"	ND	----	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00489	"	"	"	"	"	
Fluorene	"	ND	----	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00489	"	"	"	"	"	
Naphthalene	"	ND	----	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00489	"	"	"	"	"	
Pyrene	"	ND	----	0.00489	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*77.8%*			*38.8 - 139 %*	"			"	
2-FBP		*78.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*83.6%*			*31.7 - 179 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00497	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:42	
2-Methylnaphthalene	"	ND	----	0.00497	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00497	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00497	"	"	"	"	"	
Anthracene	"	ND	----	0.00497	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00497	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00497	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00530**	----	0.00497	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00497	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00497	"	"	"	"	"	
Chrysene	"	ND	----	0.00497	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00497	"	"	"	"	"	
Fluoranthene	"	**0.0139**	----	0.00497	"	"	"	"	"	
Fluorene	"	ND	----	0.00497	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00497	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Naphthalene	EPA 8270 mod.	ND	----	0.00497	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:42	
Phenanthrene	"	ND	----	0.00497	"	"	"	"	"	
Pyrene	"	**0.0119**	----	0.00497	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*83.0%*			*38.8 - 139 %*	"			"	
2-FBP		*88.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*84.8%*			*31.7 - 179 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00473	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 21:03	
2-Methylnaphthalene	"	ND	----	0.00473	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00473	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00473	"	"	"	"	"	
Anthracene	"	ND	----	0.00473	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00473	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00473	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00473	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00473	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00473	"	"	"	"	"	
Chrysene	"	ND	----	0.00473	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00473	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00473	"	"	"	"	"	
Fluorene	"	ND	----	0.00473	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00473	"	"	"	"	"	
Naphthalene	"	ND	----	0.00473	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00473	"	"	"	"	"	
Pyrene	"	ND	----	0.00473	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*78.2%*			*38.8 - 139 %*	"			"	
2-FBP		*80.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*81.0%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00841	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 21:18	
2-Methylnaphthalene	"	ND	----	0.00841	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00841	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00841	"	"	"	"	"	
Anthracene	"	ND	----	0.00841	"	"	"	"	"	
Benzo (a) anthracene	"	ND R	----	0.00841	"	"	"	"	"	I01
Benzo (a) pyrene	"	ND R	----	0.00841	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND R	----	0.00841	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0112 J**	----	0.00841	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND R	----	0.00841	"	"	"	"	"	I01
Chrysene	"	ND R	----	0.00841	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.00897 J**	----	0.00841	"	"	"	"	"	I01
Fluoranthene	"	ND	----	0.00841	"	"	"	"	"	
Fluorene	"	ND	----	0.00841	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND R	----	0.00841	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00841	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00841	"	"	"	"	"	
Pyrene	"	ND R	----	0.00841	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*44.8%*			*38.8 - 139 %*	"			"	
2-FBP		*48.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*90.0%*			*31.7 - 179 %*	"			"	*I01*
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:28	
2-Methylnaphthalene	"	ND	----	0.00498	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00498	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00498	"	"	"	"	"	
Anthracene	"	ND	----	0.00498	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00498	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00498	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00498	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0115**	----	0.00498	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00498	"	"	"	"	"	
Chrysene	"	ND	----	0.00498	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00745**	----	0.00498	"	"	"	"	"	
Fluoranthene	"	ND	----	0.00498	"	"	"	"	"	
Fluorene	"	ND	----	0.00498	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00881**	----	0.00498	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Naphthalene	EPA 8270 mod.	ND	----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:28	
Phenanthrene	"	ND	----	0.00498	"	"	"	"	"	
Pyrene	"	ND	----	0.00498	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*47.2%*			*38.8 - 139 %*	"			"	
2-FBP		*50.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*53.0%*			*31.7 - 179 %*	"			"	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00488	mg/kg dry	1x	9090116	09/17/09 12:06	09/19/09 00:36	
2-Methylnaphthalene	"	ND	----	0.00488	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00488	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00488	"	"	"	"	"	
Anthracene	"	ND	----	0.00488	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00586**	----	0.00488	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00521**	----	0.00488	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00488	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00586**	----	0.00488	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.0104**	----	0.00488	"	"	"	"	"	
Chrysene	"	**0.00976**	----	0.00488	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00488	"	"	"	"	"	
Fluoranthene	"	**0.00716**	----	0.00488	"	"	"	"	"	
Fluorene	"	ND	----	0.00488	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00488	"	"	"	"	"	
Naphthalene	"	ND	----	0.00488	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00488	"	"	"	"	"	
Pyrene	"	**0.0143**	----	0.00488	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*84.4%*			*38.8 - 139 %*	"			"	
2-FBP		*87.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*98.0%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00489	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:49	
2-Methylnaphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00489	"	"	"	"	"	
Anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00587**	-----	0.00489	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00848**	-----	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Chrysene	"	ND	-----	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00522**	-----	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Fluorene	"	ND	-----	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00718**	-----	0.00489	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00489	"	"	"	"	"	
Pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*59.4%*			*38.8 - 139 %*	"			"	
2-FBP		*70.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*64.8%*			*31.7 - 179 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.101**	-----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/23/09 17:31	
2-Methylnaphthalene	"	ND	-----	0.00498	"	"	"	"	"	
Acenaphthene	"	**0.0453**	-----	0.00498	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00498	"	"	"	"	"	
Anthracene	"	**0.0122**	-----	0.00498	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0326**	-----	0.00498	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0774**	-----	0.00498	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.143**	-----	0.00498	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.106**	-----	0.00498	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00498	"	"	"	"	"	
Chrysene	"	**0.0625**	-----	0.00498	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0370**	-----	0.00498	"	"	"	"	"	
Fluoranthene	"	**0.0293**	-----	0.00498	"	"	"	"	"	
Fluorene	"	**0.0840**	-----	0.00498	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0746**	-----	0.00498	"	"	"	"	"	
Naphthalene	"	**0.0122**	-----	0.00498	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Phenanthrene	EPA 8270 mod.	**0.0802**	----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/23/09 17:31	
Pyrene	"	**0.129**	----	0.00498	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*85.8%*			*38.8 - 139 %*	"			"	
2-FBP		*96.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*119%*			*31.7 - 179 %*	"			"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00462	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:07	
2-Methylnaphthalene	"	ND	----	0.00462	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00462	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00462	"	"	"	"	"	
Anthracene	"	ND	----	0.00462	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00462	"	"	"	"	"	
Benzo (a) pyrene	"	ND	----	0.00462	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	----	0.00462	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	----	0.00462	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	----	0.00462	"	"	"	"	"	
Chrysene	"	ND	----	0.00462	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	----	0.00462	"	"	"	"	"	
Fluoranthene	"	**0.00616**	----	0.00462	"	"	"	"	"	
Fluorene	"	ND	----	0.00462	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	----	0.00462	"	"	"	"	"	
Naphthalene	"	ND	----	0.00462	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00462	"	"	"	"	"	
Pyrene	"	**0.00555**	----	0.00462	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*65.6%*			*38.8 - 139 %*	"			"	
2-FBP		*66.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*76.2%*			*31.7 - 179 %*	"			"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00499	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:28	
2-Methylnaphthalene	"	ND	----	0.00499	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00499	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00499	"	"	"	"	"	
Anthracene	"	ND	----	0.00499	"	"	"	"	"	
Benzo (a) anthracene	"	ND	----	0.00499	"	"	"	"	"	
Benzo (a) pyrene	"	ND R	----	0.00499	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND R	----	0.00499	"	"	"	"	"	I01

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Benzo (ghi) perylene	EPA 8270 mod.	ND R	----	0.00499	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:28	I01
Benzo (k) fluoranthene	"	ND R	----	0.00499	"	"	"	"	"	I01
Chrysene	"	ND	----	0.00499	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND R	----	0.00499	"	"	"	"	"	I01
Fluoranthene	"	ND	----	0.00499	"	"	"	"	"	
Fluorene	"	ND	----	0.00499	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND R	----	0.00499	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00499	"	"	"	"	"	
Phenanthrene	"	ND	----	0.00499	"	"	"	"	"	
Pyrene	"	ND R	----	0.00499	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*82.6%*			*38.8 - 139 %*	"			"	
2-FBP		*92.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*83.0%*			*31.7 - 179 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
1-Methylnapthalene	EPA 8270 mod.	**0.0964**	----	0.00831	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 21:39	
2-Methylnaphthalene	"	ND	----	0.00831	"	"	"	"	"	
Acenaphthene	"	**0.103**	----	0.00831	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00831	"	"	"	"	"	
Anthracene	"	**0.120**	----	0.00831	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0709 J**	----	0.00831	"	"	"	"	"	I01
Benzo (a) pyrene	"	**0.0333 J**	----	0.00831	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	**0.0388 J**	----	0.00831	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0299 J**	----	0.00831	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND R	----	0.00831	"	"	"	"	"	I01
Chrysene	"	**0.129 J**	----	0.00831	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.0111 J**	----	0.00831	"	"	"	"	"	I01
Fluoranthene	"	**0.0521**	----	0.00831	"	"	"	"	"	
Fluorene	"	**0.0998**	----	0.00831	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0144 J**	----	0.00831	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00831	"	"	"	"	"	
Phenanthrene	"	**0.354**	----	0.00831	"	"	"	"	"	
Pyrene	"	**0.440 J**	----	0.00831	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*36.0%*			*38.8 - 139 %*	"			"	*Z3*
2-FBP		*42.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*76.4%*			*31.7 - 179 %*	"			"	*I01*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		Soil			Sampled: 09/08/09 11:10					
1-Methylnapthalene	EPA 8270 mod.	**0.0176**	----	0.00471	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 20:36	
2-Methylnaphthalene	"	ND	----	0.00471	"	"	"	"	"	
Acenaphthene	"	**0.0101**	----	0.00471	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00471	"	"	"	"	"	
Anthracene	"	**0.00817**	----	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	ND R	----	0.00471	"	"	"	"	"	I01
Benzo (a) pyrene	"	**0.0101 J**	----	0.00471	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND R	----	0.00471	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0277 J**	----	0.00471	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND R	----	0.00471	"	"	"	"	"	I01
Chrysene	"	**0.0101 J**	----	0.00471	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.0151 J**	----	0.00471	"	"	"	"	"	I01
Fluoranthene	"	ND	----	0.00471	"	"	"	"	"	
Fluorene	"	**0.0151**	----	0.00471	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0182 J**	----	0.00471	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00471	"	"	"	"	"	
Phenanthrene	"	**0.0214**	----	0.00471	"	"	"	"	"	
Pyrene	"	**0.0270 J**	----	0.00471	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*60.0%*			*38.8 - 139 %*	"			"	
2-FBP		*62.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*122%*			*31.7 - 179 %*	"			"	*I01*
SSI0049-17 (G-RS4SED-0-090809)		Soil			Sampled: 09/08/09 12:20					
1-Methylnapthalene	EPA 8270 mod.	ND	----	0.00947	mg/kg dry	2x	9090116	09/17/09 12:06	09/19/09 06:40	
2-Methylnaphthalene	"	ND	----	0.00947	"	"	"	"	"	
Acenaphthene	"	ND	----	0.00947	"	"	"	"	"	
Acenaphthylene	"	ND	----	0.00947	"	"	"	"	"	
Anthracene	"	ND	----	0.00947	"	"	"	"	"	
Benzo (a) anthracene	"	ND R	----	0.00947	"	"	"	"	"	I01
Benzo (a) pyrene	"	**0.0455 J**	----	0.00947	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND R	----	0.00947	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0101 J**	----	0.00947	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	**0.0467 J**	----	0.00947	"	"	"	"	"	I01
Chrysene	"	**0.0455 J**	----	0.00947	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.0152 J**	----	0.00947	"	"	"	"	"	I01
Fluoranthene	"	**0.0189**	----	0.00947	"	"	"	"	"	
Fluorene	"	ND	----	0.00947	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0114 J**	----	0.00947	"	"	"	"	"	I01
Naphthalene	"	ND	----	0.00947	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		Soil			Sampled: 09/08/09 12:20					
Phenanthrene	EPA 8270 mod.	**0.0202**	——	0.00947	mg/kg dry	2x	9090116	09/17/09 12:06	09/19/09 06:40	
Pyrene	"	**0.0960** J	——	0.00947	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*104%*			*38.8 - 139 %*	"			"	
2-FBP		*148%*			*40 - 132 %*	"			"	*ZX*
p-Terphenyl-d14		*319%*			*31.7 - 179 %*	"			"	*I01, ZX*
SSI0049-18 (G-RS4SED-4-090809)		Soil			Sampled: 09/08/09 12:25					
1-Methylnapthalene	EPA 8270 mod.	ND	——	0.00477	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:06	
2-Methylnaphthalene	"	ND	——	0.00477	"	"	"	"	"	
Acenaphthene	"	ND	——	0.00477	"	"	"	"	"	
Acenaphthylene	"	ND	——	0.00477	"	"	"	"	"	
Anthracene	"	ND	——	0.00477	"	"	"	"	"	
Benzo (a) anthracene	"	ND	——	0.00477	"	"	"	"	"	
Benzo (a) pyrene	"	ND	——	0.00477	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	——	0.00477	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0101**	——	0.00477	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	——	0.00477	"	"	"	"	"	
Chrysene	"	ND	——	0.00477	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00796**	——	0.00477	"	"	"	"	"	
Fluoranthene	"	ND	——	0.00477	"	"	"	"	"	
Fluorene	"	ND	——	0.00477	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00849**	——	0.00477	"	"	"	"	"	
Naphthalene	"	ND	——	0.00477	"	"	"	"	"	
Phenanthrene	"	ND	——	0.00477	"	"	"	"	"	
Pyrene	"	**0.00636**	——	0.00477	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*45.2%*			*38.8 - 139 %*	"			"	
2-FBP		*47.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*52.6%*			*31.7 - 179 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	**66.3**	----	12.8	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 09:55	
Heavy Oil Range Hydrocarbons	"	**464**	----	31.9	"	"	"	"	"	
Surrogate(s): 2-FBP		*92.2%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*111%*			*50 - 150 %*	"			"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	15.1	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:19	
Heavy Oil Range Hydrocarbons	"	**89.0**	----	37.8	"	"	"	"	"	
Surrogate(s): 2-FBP		*80.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*99.9%*			*50 - 150 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	12.5	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:43	
Heavy Oil Range Hydrocarbons	"	ND	----	31.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*78.5%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*100%*			*50 - 150 %*	"			"	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	14.7	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:06	
Heavy Oil Range Hydrocarbons	"	ND	----	36.7	"	"	"	"	"	
Surrogate(s): 2-FBP		*69.8%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*98.7%*			*50 - 150 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	14.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:30	
Heavy Oil Range Hydrocarbons	"	ND	----	37.3	"	"	"	"	"	
Surrogate(s): 2-FBP		*87.9%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*107%*			*50 - 150 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	----	11.8	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:54	
Heavy Oil Range Hydrocarbons	"	ND	----	29.6	"	"	"	"	"	
Surrogate(s): 2-FBP		*81.1%*			*50 - 150 %*	"			"	
p-Terphenyl-d14		*102%*			*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**62.4**	----	12.6	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:17	
Heavy Oil Range Hydrocarbons	"	**272**	----	31.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*110%*		*50 - 150 %*	"			"	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**74.3**	----	15.2	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:41	
Heavy Oil Range Hydrocarbons	"	**336**	----	38.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSI0049-09 (G-EB-090709)		**Water**			**Sampled: 09/07/09 17:00**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.245	mg/l	1x	9090094	09/15/09 07:58	09/17/09 03:39	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.490	"	"	"	"	"	
Surrogate(s): 2-FBP			*71.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*91.7%*		*50 - 150 %*	"			"	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	**24.3**	----	14.6	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 13:05	
Heavy Oil Range Hydrocarbons	"	**112**	----	36.6	"	"	"	"	"	
Surrogate(s): 2-FBP			*78.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*90.0%*		*50 - 150 %*	"			"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**36.9**	----	14.7	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 09:55	
Heavy Oil Range Hydrocarbons	"	**182**	----	36.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*124%*		*50 - 150 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	**73.1**	-----	12.4	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:19	
Heavy Oil Range Hydrocarbons	"	**178**	----	31.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*91.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*121%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**22.4**	----	13.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:43	
Heavy Oil Range Hydrocarbons	"	**140**	----	34.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*83.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*119%*		*50 - 150 %*	"			"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**25.3**	----	15.3	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:06	
Heavy Oil Range Hydrocarbons	"	**126**	----	38.2	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*113%*		*50 - 150 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**403**	----	12.5	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:30	
Heavy Oil Range Hydrocarbons	"	**588**	----	31.2	"	"	"	"	"	
Surrogate(s): 2-FBP			*97.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*129%*		*50 - 150 %*	"			"	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**194**	----	14.1	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:54	
Heavy Oil Range Hydrocarbons	"	**492**	----	35.4	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**8830**	----	142	mg/kg dry	10x	9090105	09/16/09 08:11	09/17/09 12:17	
Heavy Oil Range Hydrocarbons	"	**6980**	----	355	"	"	"	"	"	
Surrogate(s): 2-FBP			*54.7%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*71.2%*		*50 - 150 %*	"			"	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**39.6**	----	11.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:41	
Heavy Oil Range Hydrocarbons	"	**164**	----	29.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*86.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*121%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-01 G-RS1-SED-4

Lab Sample ID: 580-15385-1

Client Matrix: Solid

% Moisture: 18.6

Date Sampled: 09/07/2009 1350

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109022.D
Dilution:	1.0			Initial Weight/Volume:	5.876 g
Date Analyzed:	09/21/2009 1833			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		0.00018	J	0.000092	0.0021
1,2,3-Trichloropropane		ND		0.00038	0.0010
1,2-Dibromo-3-Chloropropane		0.00045	J	0.00019	0.0021
1,2-Dichloroethane		ND		0.00017	0.0010
1,2-Dichloropropane		ND		0.00018	0.0010
Bromoform		ND		0.000075	0.0010
Bromomethane		ND		0.00040	0.0010
Carbon tetrachloride		ND		0.00039	0.0010
Chloroethane		ND		0.00028	0.0010
Chloroform		ND		0.00015	0.0010
Chloromethane		0.0032		0.00018	0.0010
cis-1,3-Dichloropropene		ND		0.00012	0.0010
Dichlorobromomethane		ND		0.000077	0.0010
Ethylene Dibromide		ND		0.00014	0.0010
Hexachlorobutadiene		0.0011		0.00035	0.0010
trans-1,3-Dichloropropene		ND		0.00019	0.0010
Trichloroethene		ND		0.00018	0.0010
1,1,1-Trichloroethane		ND		0.00040	0.0010
Benzene		0.0013	~~B~~	0.000083	0.0010
Chlorobromomethane		ND		0.00026	0.0010
Tetrachloroethene		ND		0.00011	0.0010
1,1-Dichloroethane		ND		0.00041	0.0010
1,1,2-Trichloroethane		ND		0.00011	0.0010
Dichlorodifluoromethane		ND		0.00020	0.0010
Methylene Chloride		ND		0.00020	0.0010
n-Butylbenzene		0.0012		0.00033	0.0010
1,2,4-Trimethylbenzene		0.00077	J	0.00035	0.0010
2-Chlorotoluene		0.00035	J	0.00015	0.0010
Chlorodibromomethane		ND		0.00014	0.0010
Dibromomethane		ND		0.00011	0.0010
1,1-Dichloropropene		ND		0.00041	0.0010
Toluene		~~0.00080~~	~~J B~~	0.000089	0.0010 U
1,2,4-Trichlorobenzene		~~0.0011~~	~~J B~~	0.00040	0.0021 U
o-Xylene		~~0.00035~~	~~J B~~	0.000055	0.0010 U
Chlorobenzene	Stet	~~0.0011~~	~~B~~	0.00019	~~0.0010 U~~
1,3-Dichlorobenzene		0.00049	J	0.00040	0.0010
Naphthalene		~~0.0030~~	~~J B~~	0.00025	0.0052 U
Styrene		0.00051	J	0.00033	0.0010
4-Chlorotoluene		0.00046	J	0.00040	0.0010
trans-1,2-Dichloroethene		ND		0.00030	0.0010
Bromobenzene		0.00033	J	0.00016	0.0010
1,2,3-Trichlorobenzene		~~0.0012~~	~~J B~~	0.00018	0.0021 U
1,1-Dichloroethene		ND		0.00015	0.0052
1,2-Dichlorobenzene		0.00059	J	0.00036	0.0010
1,1,1,2-Tetrachloroethane		ND		0.000091	0.0010
sec-Butylbenzene		0.00081	J	0.00036	0.0010

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-01**

Lab Sample ID: 580-15385-1
Client Matrix: Solid
% Moisture: 18.6

Date Sampled: 09/07/2009 1350
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109022.D
Dilution:	1.0			Initial Weight/Volume:	5.876 g
Date Analyzed:	09/21/2009 1833			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		0.00035	J	0.00016	0.0010
Isopropylbenzene		0.00030	J	0.00016	0.0010
2,2-Dichloropropane		ND		0.00040	0.0010
N-Propylbenzene		0.00054	J	0.00015	0.0010
Trichlorofluoromethane		ND		0.00020	0.0010
4-Isopropyltoluene		0.0011		0.00032	0.0010
1,3,5-Trimethylbenzene		0.00060	J	0.00037	0.0021
cis-1,2-Dichloroethene		ND		0.00013	0.0010
m-Xylene & p-Xylene		~~0.00066~~	~~JB~~	0.00017	0.0021 U
Vinyl chloride		ND		0.00015	0.0010
tert-Butylbenzene		0.00082	J	0.00035	0.0010
1,4-Dichlorobenzene		~~0.00065~~	~~JB~~	0.00041	0.0010 U
1,3-Dichloropropane		ND		0.00023	0.0010

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	111		85 - 120
Toluene-d8 (Surr)	103		85 - 115
Trifluorotoluene (Surr)	85		75 - 125
1,2-Dichloroethane-d4 (Surr)	93		75 - 125

TNB 11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-02** G-RS1-SED-Ø

Lab Sample ID: 580-15385-2

Client Matrix: Solid

% Moisture: 31.0

Date Sampled: 09/07/2009 1355

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109023.D
Dilution:	1.0			Initial Weight/Volume:	5.709 g
Date Analyzed:	09/21/2009 1857			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00011	0.0025
1,2,3-Trichloropropane		ND		0.00046	0.0013
1,2-Dibromo-3-Chloropropane		ND		0.00023	0.0025
1,2-Dichloroethane		ND		0.00020	0.0013
1,2-Dichloropropane		ND		0.00022	0.0013
Bromoform		ND		0.000091	0.0013
Bromomethane		ND		0.00049	0.0013
Carbon tetrachloride		ND		0.00047	0.0013
Chloroethane		ND		0.00034	0.0013
Chloroform		ND		0.00019	0.0013
Chloromethane		ND		0.00022	0.0013
cis-1,3-Dichloropropene		ND		0.00015	0.0013
Dichlorobromomethane		ND		0.000094	0.0013
Ethylene Dibromide		ND		0.00017	0.0013
Hexachlorobutadiene		0.00047	J	0.00043	0.0013
trans-1,3-Dichloropropene		ND		0.00023	0.0013
Trichloroethene		ND		0.00022	0.0013
1,1,1-Trichloroethane		ND		0.00049	0.0013
Benzene		~~0.00051~~	~~J B~~	0.00010	0.0013 U
Chlorobromomethane		ND		0.00032	0.0013
Tetrachloroethene		ND		0.00013	0.0013
1,1-Dichloroethane		ND		0.00050	0.0013
1,1,2-Trichloroethane		ND		0.00013	0.0013
Dichlorodifluoromethane		ND		0.00024	0.0013
Methylene Chloride		ND		0.00024	0.0013
n-Butylbenzene		0.00052	J	0.00040	0.0013
1,2,4-Trimethylbenzene		ND		0.00042	0.0013
2-Chlorotoluene		ND		0.00019	0.0013
Chlorodibromomethane		ND		0.00017	0.0013
Dibromomethane		ND		0.00013	0.0013
1,1-Dichloropropene		ND		0.00049	0.0013
Toluene		~~0.00079~~	~~J B~~	0.00011	0.0013 U
1,2,4-Trichlorobenzene		~~0.00054~~	~~J B~~	0.00049	0.0025 U
o-Xylene		~~0.00017~~	~~J B~~	0.000067	0.0013 U
Chlorobenzene		~~0.0012~~	~~J B~~	0.00023	0.0013 U
1,3-Dichlorobenzene		ND		0.00048	0.0013
Naphthalene		~~0.00067~~	~~J B~~	0.00030	0.0063 U
Styrene		ND		0.00040	0.0013
4-Chlorotoluene		ND		0.00049	0.0013
trans-1,2-Dichloroethene		ND		0.00036	0.0013
Bromobenzene		ND		0.00020	0.0013
1,2,3-Trichlorobenzene		~~0.00060~~	~~J B~~	0.00022	0.0025 U
1,1-Dichloroethene		ND		0.00018	0.0063
1,2-Dichlorobenzene		ND		0.00044	0.0013
1,1,1,2-Tetrachloroethane		ND		0.00011	0.0013
sec-Butylbenzene		ND		0.00043	0.0013

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-02

Lab Sample ID: 580-15385-2
Client Matrix: Solid

% Moisture: 31.0

Date Sampled: 09/07/2009 1355
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109023.D
Dilution:	1.0			Initial Weight/Volume:	5.709 g
Date Analyzed:	09/21/2009 1857			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00019	0.0013
Isopropylbenzene		ND		0.00019	0.0013
2,2-Dichloropropane		ND		0.00049	0.0013
N-Propylbenzene		0.00020	J	0.00018	0.0013
Trichlorofluoromethane		ND		0.00025	0.0013
4-Isopropyltoluene		0.00081	J	0.00039	0.0013
1,3,5-Trimethylbenzene		ND		0.00045	0.0025
cis-1,2-Dichloroethene		ND		0.00016	0.0013
m-Xylene & p-Xylene		~~0.00037~~	~~J B~~	0.00020	0.0025 U
Vinyl chloride		ND		0.00019	0.0013
tert-Butylbenzene		ND		0.00043	0.0013
1,4-Dichlorobenzene		ND		0.00050	0.0013
1,3-Dichloropropane		ND		0.00028	0.0013

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	112		85 - 120
Toluene-d8 (Surr)	104		85 - 115
Trifluorotoluene (Surr)	92		75 - 125
1,2-Dichloroethane-d4 (Surr)	95		75 - 125

TMB 11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-03 G-RS8SED-3

Lab Sample ID: 580-15385-3

Client Matrix: Solid

% Moisture: 17.4

Date Sampled: 09/07/2009 1445

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109024.D
Dilution:	1.0			Initial Weight/Volume:	3.927 g
Date Analyzed:	09/21/2009 1921			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00014	0.0031
1,2,3-Trichloropropane		ND		0.00056	0.0015
1,2-Dibromo-3-Chloropropane		ND		0.00028	0.0031
1,2-Dichloroethane		ND		0.00025	0.0015
1,2-Dichloropropane		ND		0.00026	0.0015
Bromoform		ND		0.00011	0.0015
Bromomethane		ND		0.00059	0.0015
Carbon tetrachloride		ND		0.00057	0.0015
Chloroethane		ND		0.00041	0.0015
Chloroform		ND		0.00023	0.0015
Chloromethane		ND		0.00027	0.0015
cis-1,3-Dichloropropene		ND		0.00018	0.0015
Dichlorobromomethane		ND		0.00011	0.0015
Ethylene Dibromide		ND		0.00020	0.0015
Hexachlorobutadiene		ND		0.00052	0.0015
trans-1,3-Dichloropropene		ND		0.00027	0.0015
Trichloroethene		ND		0.00027	0.0015
1,1,1-Trichloroethane		ND		0.00059	0.0015
Benzene		~~0.00017~~	~~J B~~	0.00012	0.0015 U
Chlorobromomethane		ND		0.00038	0.0015
Tetrachloroethene		ND		0.00016	0.0015
1,1-Dichloroethane		ND		0.00061	0.0015
1,1,2-Trichloroethane		ND		0.00016	0.0015
Dichlorodifluoromethane		ND		0.00030	0.0015
Methylene Chloride		ND		0.00030	0.0015
n-Butylbenzene		ND		0.00048	0.0015
1,2,4-Trimethylbenzene		ND		0.00051	0.0015
2-Chlorotoluene		ND		0.00023	0.0015
Chlorodibromomethane		ND		0.00021	0.0015
Dibromomethane		ND		0.00016	0.0015
1,1-Dichloropropene		ND		0.00060	0.0015
Toluene		~~0.00024~~	~~J B~~	0.00013	0.0015 U
1,2,4-Trichlorobenzene		ND		0.00059	0.0031
o-Xylene		~~0.000098~~	~~J B~~	0.000082	0.0015 U
Chlorobenzene		~~0.0011~~	~~J B~~	0.00027	0.0015 U
1,3-Dichlorobenzene		ND		0.00059	0.0015
Naphthalene		ND		0.00037	0.0077
Styrene		ND		0.00049	0.0015
4-Chlorotoluene		ND		0.00060	0.0015
trans-1,2-Dichloroethene		ND		0.00044	0.0015
Bromobenzene		ND		0.00024	0.0015
1,2,3-Trichlorobenzene		~~0.00044~~	~~J B~~	0.00027	0.0031 U
1,1-Dichloroethene		ND		0.00021	0.0077
1,2-Dichlorobenzene		ND		0.00054	0.0015
1,1,1,2-Tetrachloroethane		ND		0.00013	0.0015
sec-Butylbenzene		ND		0.00053	0.0015

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-03**

Lab Sample ID: 580-15385-3
Client Matrix: Solid

% Moisture: 17.4

Date Sampled: 09/07/2009 1445
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109024.D
Dilution:	1.0			Initial Weight/Volume:	3.927 g
Date Analyzed:	09/21/2009 1921			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00023	0.0015
Isopropylbenzene		ND		0.00023	0.0015
2,2-Dichloropropane		ND		0.00059	0.0015
N-Propylbenzene		ND		0.00022	0.0015
Trichlorofluoromethane		ND		0.00030	0.0015
4-Isopropyltoluene		ND		0.00048	0.0015
1,3,5-Trimethylbenzene		ND		0.00054	0.0031
cis-1,2-Dichloroethene		ND		0.00020	0.0015
m-Xylene & p-Xylene		ND		0.00025	0.0031
Vinyl chloride		ND		0.00023	0.0015
tert-Butylbenzene		ND		0.00052	0.0015
1,4-Dichlorobenzene		ND		0.00061	0.0015
1,3-Dichloropropane		ND		0.00034	0.0015

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	100		85 - 120
Toluene-d8 (Surr)	101		85 - 115
Trifluorotoluene (Surr)	105		75 - 125
1,2-Dichloroethane-d4 (Surr)	97		75 - 125

TMB 11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS8-SED Ø

Client Sample ID: **SSI0049-04**

Lab Sample ID: 580-15385-4

Client Matrix: Solid

% Moisture: 33.1

Date Sampled: 09/07/2009 1450

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109025.D
Dilution:	1.0			Initial Weight/Volume:	6.252 g
Date Analyzed:	09/21/2009 1945			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00011	0.0024
1,2,3-Trichloropropane		ND		0.00043	0.0012
1,2-Dibromo-3-Chloropropane		ND		0.00022	0.0024
1,2-Dichloroethane		ND		0.00019	0.0012
1,2-Dichloropropane		ND		0.00020	0.0012
Bromoform		ND		0.000086	0.0012
Bromomethane		ND		0.00046	0.0012
Carbon tetrachloride		ND		0.00044	0.0012
Chloroethane		ND		0.00032	0.0012
Chloroform		ND		0.00018	0.0012
Chloromethane		ND		0.00021	0.0012
cis-1,3-Dichloropropene		ND		0.00014	0.0012
Dichlorobromomethane		ND		0.000088	0.0012
Ethylene Dibromide		ND		0.00016	0.0012
Hexachlorobutadiene		ND		0.00040	0.0012
trans-1,3-Dichloropropene		ND		0.00021	0.0012
Trichloroethene		ND		0.00021	0.0012
1,1,1-Trichloroethane		ND		0.00046	0.0012
Benzene		~~0.00019~~	~~JB~~	0.000094	0.0012 U
Chlorobromomethane		ND		0.00030	0.0012
Tetrachloroethene		ND		0.00012	0.0012
1,1-Dichloroethane		ND		0.00047	0.0012
1,1,2-Trichloroethane		ND		0.00012	0.0012
Dichlorodifluoromethane		ND		0.00023	0.0012
Methylene Chloride		ND		0.00023	0.0012
n-Butylbenzene		ND		0.00038	0.0012
1,2,4-Trimethylbenzene		ND		0.00040	0.0012
2-Chlorotoluene		ND		0.00017	0.0012
Chlorodibromomethane		ND		0.00016	0.0012
Dibromomethane		ND		0.00013	0.0012
1,1-Dichloropropene		ND		0.00046	0.0012
Toluene		~~0.00037~~	~~JB~~	0.00010	0.0012 U
1,2,4-Trichlorobenzene		ND		0.00046	0.0024
o-Xylene		ND		0.000063	0.0012
Chlorobenzene		~~0.00080~~	~~JB~~	0.00021	0.0012 U
1,3-Dichlorobenzene		ND		0.00045	0.0012
Naphthalene		ND		0.00029	0.0060
Styrene		ND		0.00038	0.0012
4-Chlorotoluene		ND		0.00046	0.0012
trans-1,2-Dichloroethene		ND		0.00034	0.0012
Bromobenzene		ND		0.00019	0.0012
1,2,3-Trichlorobenzene		ND		0.00021	0.0024
1,1-Dichloroethene		ND		0.00017	0.0060
1,2-Dichlorobenzene		ND		0.00042	0.0012
1,1,1,2-Tetrachloroethane		ND		0.00010	0.0012
sec-Butylbenzene		ND		0.00041	0.0012

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-04**

Lab Sample ID: 580-15385-4
Client Matrix: Solid
% Moisture: 33.1

Date Sampled: 09/07/2009 1450
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109025.D
Dilution:	1.0			Initial Weight/Volume:	6.252 g
Date Analyzed:	09/21/2009 1945			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00018	0.0012
Isopropylbenzene		ND		0.00018	0.0012
2,2-Dichloropropane		ND		0.00046	0.0012
N-Propylbenzene		ND		0.00017	0.0012
Trichlorofluoromethane		ND		0.00023	0.0012
4-Isopropyltoluene		0.00078	J	0.00037	0.0012
1,3,5-Trimethylbenzene		ND		0.00042	0.0024
cis-1,2-Dichloroethene		ND		0.00015	0.0012
m-Xylene & p-Xylene		~~0.00020~~	~~JB~~	0.00019	0.0024 U
Vinyl chloride		ND		0.00018	0.0012
tert-Butylbenzene		ND		0.00040	0.0012
1,4-Dichlorobenzene		ND		0.00047	0.0012
1,3-Dichloropropane		ND		0.00026	0.0012

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	105		85 - 120
Toluene-d8 (Surr)	102		85 - 115
Trifluorotoluene (Surr)	89		75 - 125
1,2-Dichloroethane-d4 (Surr)	96		75 - 125

TMS 11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-05** RS7-SED-Ø

Lab Sample ID: 580-15385-5

Client Matrix: Solid

% Moisture: 30.8

Date Sampled: 09/07/2009 1530

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109026.D
Dilution:	1.0			Initial Weight/Volume:	5.082 g
Date Analyzed:	09/21/2009 2009			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.00013	0.0028	
1,2,3-Trichloropropane		ND		0.00051	0.0014	
1,2-Dibromo-3-Chloropropane		ND		0.00026	0.0028	
1,2-Dichloroethane		ND		0.00023	0.0014	
1,2-Dichloropropane		ND		0.00024	0.0014	
Bromoform		ND		0.00010	0.0014	
Bromomethane		ND		0.00055	0.0014	
Carbon tetrachloride		ND		0.00053	0.0014	
Chloroethane		ND		0.00038	0.0014	
Chloroform		ND		0.00021	0.0014	
Chloromethane		ND		0.00025	0.0014	
cis-1,3-Dichloropropene		ND		0.00017	0.0014	
Dichlorobromomethane		ND		0.00011	0.0014	
Ethylene Dibromide		ND		0.00019	0.0014	
Hexachlorobutadiene		ND		0.00048	0.0014	
trans-1,3-Dichloropropene		ND		0.00025	0.0014	
Trichloroethene		ND		0.00025	0.0014	
1,1,1-Trichloroethane		ND		0.00055	0.0014	
Benzene		~~0.00033~~	~~JB~~	0.00011	0.0014	U
Chlorobromomethane		ND		0.00035	0.0014	
Tetrachloroethene		ND		0.00015	0.0014	
1,1-Dichloroethane		ND		0.00056	0.0014	
1,1,2-Trichloroethane		ND		0.00014	0.0014	
Dichlorodifluoromethane		ND		0.00027	0.0014	
Methylene Chloride		ND		0.00027	0.0014	
n-Butylbenzene		ND		0.00045	0.0014	
1,2,4-Trimethylbenzene		ND		0.00047	0.0014	
2-Chlorotoluene		ND		0.00021	0.0014	
Chlorodibromomethane		ND		0.00019	0.0014	
Dibromomethane		ND		0.00015	0.0014	
1,1-Dichloropropene		ND		0.00055	0.0014	
✓ Toluene		0.0018	~~B~~	0.00012	0.0014	
1,2,4-Trichlorobenzene		ND		0.00055	0.0028	
o-Xylene		~~0.000098~~	~~JB~~	0.000075	0.0014	U
Chlorobenzene		~~0.00080~~	~~JB~~	0.00025	0.0014	U
1,3-Dichlorobenzene		ND		0.00054	0.0014	
Naphthalene		ND		0.00034	0.0071	
Styrene		ND		0.00045	0.0014	
4-Chlorotoluene		ND		0.00055	0.0014	
trans-1,2-Dichloroethene		ND		0.00041	0.0014	
Bromobenzene		ND		0.00022	0.0014	
1,2,3-Trichlorobenzene		ND		0.00024	0.0028	
1,1-Dichloroethene		ND		0.00020	0.0071	
1,2-Dichlorobenzene		ND		0.00050	0.0014	
1,1,1,2-Tetrachloroethane		ND		0.00012	0.0014	
sec-Butylbenzene		ND		0.00049	0.0014	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-05

Lab Sample ID: 580-15385-5
Client Matrix: Solid

% Moisture: 30.8

Date Sampled: 09/07/2009 1530
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612	Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608	Lab File ID:	I2109026.D
Dilution:	1.0		Initial Weight/Volume:	5.082 g
Date Analyzed:	09/21/2009 2009		Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240			

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00021	0.0014
Isopropylbenzene		ND		0.00021	0.0014
2,2-Dichloropropane		ND		0.00055	0.0014
N-Propylbenzene		ND		0.00020	0.0014
Trichlorofluoromethane		ND		0.00028	0.0014
4-Isopropyltoluene		0.00097	J	0.00044	0.0014
1,3,5-Trimethylbenzene		ND		0.00050	0.0028
cis-1,2-Dichloroethene		ND		0.00018	0.0014
m-Xylene & p-Xylene		~~0.00024~~	~~JB~~	0.00023	0.0028 U
Vinyl chloride		ND		0.00021	0.0014
tert-Butylbenzene		ND		0.00048	0.0014
1,4-Dichlorobenzene		ND		0.00056	0.0014
1,3-Dichloropropane		ND		0.00031	0.0014

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	103		85 - 120
Toluene-d8 (Surr)	100		85 - 115
Trifluorotoluene (Surr)	97		75 - 125
1,2-Dichloroethane-d4 (Surr)	95		75 - 125

11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-06** RS-7-SED-4

Lab Sample ID: 580-15385-6

Client Matrix: Solid

% Moisture: 18.2

Date Sampled: 09/07/2009 1525

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109027.D
Dilution:	1.0			Initial Weight/Volume:	5.803 g
Date Analyzed:	09/21/2009 2033			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.000093	0.0021	
1,2,3-Trichloropropane		ND		0.00038	0.0011	
1,2-Dibromo-3-Chloropropane		ND		0.00019	0.0021	
1,2-Dichloroethane		ND		0.00017	0.0011	
1,2-Dichloropropane		ND		0.00018	0.0011	
Bromoform		ND		0.000076	0.0011	
Bromomethane		ND		0.00041	0.0011	
Carbon tetrachloride		ND		0.00039	0.0011	
Chloroethane		ND		0.00028	0.0011	
Chloroform		ND		0.00016	0.0011	
Chloromethane		ND		0.00019	0.0011	
cis-1,3-Dichloropropene		ND		0.00012	0.0011	
Dichlorobromomethane		ND		0.000078	0.0011	
Ethylene Dibromide		ND		0.00014	0.0011	
Hexachlorobutadiene		ND		0.00035	0.0011	
trans-1,3-Dichloropropene		ND		0.00019	0.0011	
Trichloroethene		ND		0.00019	0.0011	
1,1,1-Trichloroethane		ND		0.00040	0.0011	
Benzene		~~0.00024~~	~~J B~~ J	0.000083	0.0011	U
Chlorobromomethane		ND		0.00026	0.0011	
Tetrachloroethene		ND		0.00011	0.0011	
1,1-Dichloroethane		ND		0.00041	0.0011	
1,1,2-Trichloroethane		ND		0.00011	0.0011	
Dichlorodifluoromethane		ND		0.00020	0.0011	
Methylene Chloride		ND		0.00020	0.0011	
n-Butylbenzene		ND		0.00033	0.0011	
1,2,4-Trimethylbenzene		ND		0.00035	0.0011	
2-Chlorotoluene		ND		0.00015	0.0011	
Chlorodibromomethane		ND		0.00014	0.0011	
Dibromomethane		ND		0.00011	0.0011	
1,1-Dichloropropene		ND		0.00041	0.0011	
Toluene		~~0.00034~~	~~J B~~ J	0.000089	0.0011	U
1,2,4-Trichlorobenzene		ND		0.00040	0.0021	
o-Xylene		~~0.000092~~	~~J B~~ J	0.000056	0.0011	U
Chlorobenzene		~~0.00090~~	~~J B~~ J	0.00019	0.0011	U
1,3-Dichlorobenzene		ND		0.00040	0.0011	
Naphthalene		ND		0.00025	0.0053	
Styrene		ND		0.00033	0.0011	
4-Chlorotoluene		ND		0.00041	0.0011	
trans-1,2-Dichloroethene		ND		0.00030	0.0011	
Bromobenzene		ND		0.00017	0.0011	
1,2,3-Trichlorobenzene		ND		0.00018	0.0021	
1,1-Dichloroethene		ND		0.00015	0.0053	
1,2-Dichlorobenzene		ND		0.00037	0.0011	
1,1,1,2-Tetrachloroethane		ND		0.000092	0.0011	
sec-Butylbenzene		ND		0.00036	0.0011	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-06**

Lab Sample ID: 580-15385-6
Client Matrix: Solid

% Moisture: 18.2

Date Sampled: 09/07/2009 1525
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109027.D
Dilution:	1.0			Initial Weight/Volume:	5.803 g
Date Analyzed:	09/21/2009 2033			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00016	0.0011
Isopropylbenzene		ND		0.00016	0.0011
2,2-Dichloropropane		ND		0.00040	0.0011
N-Propylbenzene		ND		0.00015	0.0011
Trichlorofluoromethane		ND		0.00021	0.0011
4-Isopropyltoluene		ND		0.00033	0.0011
1,3,5-Trimethylbenzene		ND		0.00037	0.0021
cis-1,2-Dichloroethene		ND		0.00013	0.0011
m-Xylene & p-Xylene		~~0.00020~~	~~JB~~ ~~J~~	0.00017	0.0021 U
Vinyl chloride		ND		0.00016	0.0011
tert-Butylbenzene		ND		0.00035	0.0011
1,4-Dichlorobenzene		ND		0.00042	0.0011
1,3-Dichloropropane		ND		0.00023	0.0011

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	102		85 - 120
Toluene-d8 (Surr)	101		85 - 115
Trifluorotoluene (Surr)	130	X	75 - 125
1,2-Dichloroethane-d4 (Surr)	103		75 - 125

11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-07** RS2-SED3

Lab Sample ID: 580-15385-7

Client Matrix: Solid

% Moisture: 22.1

Date Sampled: 09/07/2009 1615

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109028.D
Dilution:	1.0			Initial Weight/Volume:	2.906 g
Date Analyzed:	09/21/2009 2056			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00019	0.0044
1,2,3-Trichloropropane		ND		0.00080	0.0022
1,2-Dibromo-3-Chloropropane		ND		0.00040	0.0044
1,2-Dichloroethane		ND		0.00035	0.0022
1,2-Dichloropropane		ND		0.00038	0.0022
Bromoform		ND		0.00016	0.0022
Bromomethane		ND		0.00085	0.0022
Carbon tetrachloride		ND		0.00082	0.0022
Chloroethane		ND		0.00059	0.0022
Chloroform		ND		0.00033	0.0022
Chloromethane		ND		0.00039	0.0022
cis-1,3-Dichloropropene		ND		0.00026	0.0022
Dichlorobromomethane		ND		0.00016	0.0022
Ethylene Dibromide		ND		0.00029	0.0022
Hexachlorobutadiene		ND		0.00074	0.0022
trans-1,3-Dichloropropene		ND		0.00039	0.0022
Trichloroethene		ND		0.00039	0.0022
1,1,1-Trichloroethane		ND		0.00085	0.0022
Benzene		~~0.00056~~	~~JB~~	0.00017	0.0022 U
Chlorobromomethane		ND		0.00055	0.0022
Tetrachloroethene		ND		0.00023	0.0022
1,1-Dichloroethane		ND		0.00087	0.0022
1,1,2-Trichloroethane		ND		0.00022	0.0022
Dichlorodifluoromethane		ND		0.00042	0.0022
Methylene Chloride		ND		0.00043	0.0022
n-Butylbenzene		ND		0.00069	0.0022
1,2,4-Trimethylbenzene		ND		0.00073	0.0022
2-Chlorotoluene		ND		0.00032	0.0022
Chlorodibromomethane		ND		0.00030	0.0022
Dibromomethane		ND		0.00023	0.0022
1,1-Dichloropropene		ND		0.00086	0.0022
Toluene		~~0.00066~~	~~JB~~	0.00019	0.0022 U
1,2,4-Trichlorobenzene		ND		0.00085	0.0044
o-Xylene		~~0.00017~~	~~JB~~	0.00012	0.0022 U
Chlorobenzene		~~0.0014~~	~~JB~~	0.00039	0.0022 U
1,3-Dichlorobenzene		ND		0.00084	0.0022
Naphthalene		ND		0.00053	0.011
Styrene		ND		0.00070	0.0022
4-Chlorotoluene		ND		0.00085	0.0022
trans-1,2-Dichloroethene		ND		0.00063	0.0022
Bromobenzene		ND		0.00035	0.0022
1,2,3-Trichlorobenzene		ND		0.00038	0.0044
1,1-Dichloroethene		ND		0.00031	0.011
1,2-Dichlorobenzene		ND		0.00077	0.0022
1,1,1,2-Tetrachloroethane		ND		0.00019	0.0022
sec-Butylbenzene		ND		0.00075	0.0022

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-07**

Lab Sample ID: 580-15385-7
Client Matrix: Solid
% Moisture: 22.1

Date Sampled: 09/07/2009 1615
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612	Instrument ID: SEA015
Preparation:	5035	Prep Batch: 580-50608	Lab File ID: I2109028.D
Dilution:	1.0		Initial Weight/Volume: 2.906 g
Date Analyzed:	09/21/2009 2056		Final Weight/Volume: 5 mL
Date Prepared:	09/21/2009 1240		

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00033	0.0022
Isopropylbenzene		ND		0.00033	0.0022
2,2-Dichloropropane		ND		0.00085	0.0022
N-Propylbenzene		ND		0.00032	0.0022
Trichlorofluoromethane		ND		0.00043	0.0022
4-Isopropyltoluene		0.0015	J	0.00069	0.0022
1,3,5-Trimethylbenzene		ND		0.00078	0.0044
cis-1,2-Dichloroethene		ND		0.00028	0.0022
m-Xylene & p-Xylene		ND		0.00035	0.0044
Vinyl chloride		ND		0.00033	0.0022
tert-Butylbenzene		ND		0.00074	0.0022
1,4-Dichlorobenzene		ND		0.00088	0.0022
1,3-Dichloropropane		ND		0.00048	0.0022

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	106		85 - 120
Toluene-d8 (Surr)	101		85 - 115
Trifluorotoluene (Surr)	101		75 - 125
1,2-Dichloroethane-d4 (Surr)	98		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-08** RS-2-SED Ø

Lab Sample ID: 580-15385-8

Client Matrix: Solid

% Moisture: 29.1

Date Sampled: 09/07/2009 1620

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109029.D
Dilution:	1.0			Initial Weight/Volume:	6.099 g
Date Analyzed:	09/21/2009 2120			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00010	0.0023
1,2,3-Trichloropropane		ND		0.00042	0.0012
1,2-Dibromo-3-Chloropropane		ND		0.00021	0.0023
1,2-Dichloroethane		ND		0.00018	0.0012
1,2-Dichloropropane		ND		0.00020	0.0012
Bromoform		ND		0.000083	0.0012
Bromomethane		ND		0.00045	0.0012
Carbon tetrachloride		ND		0.00043	0.0012
Chloroethane		ND		0.00031	0.0012
Chloroform		ND		0.00017	0.0012
Chloromethane		0.00080	~~J~~ J	0.00020	0.0012
cis-1,3-Dichloropropene		ND		0.00014	0.0012
Dichlorobromomethane		ND		0.000086	0.0012
Ethylene Dibromide		ND		0.00015	0.0012
Hexachlorobutadiene		ND		0.00039	0.0012
trans-1,3-Dichloropropene		ND		0.00021	0.0012
Trichloroethene		ND		0.00020	0.0012
1,1,1-Trichloroethane		ND		0.00044	0.0012
Benzene		~~0.00062~~	~~JB~~ ~~J~~	0.000091	0.0012 U
Chlorobromomethane		ND		0.00029	0.0012
Tetrachloroethene		ND		0.00012	0.0012
1,1-Dichloroethane		ND		0.00045	0.0012
1,1,2-Trichloroethane		ND		0.00012	0.0012
Dichlorodifluoromethane		ND		0.00022	0.0012
Methylene Chloride		ND		0.00022	0.0012
n-Butylbenzene		ND		0.00036	0.0012
1,2,4-Trimethylbenzene		ND		0.00038	0.0012
2-Chlorotoluene		ND		0.00017	0.0012
Chlorodibromomethane		ND		0.00016	0.0012
Dibromomethane		ND		0.00012	0.0012
1,1-Dichloropropene		ND		0.00045	0.0012
Toluene		~~0.00057~~	~~JB~~ ~~J~~	0.000098	0.0012 U
1,2,4-Trichlorobenzene		ND		0.00044	0.0023
o-Xylene		~~0.00013~~	~~JB~~ ~~J~~	0.000061	0.0012 U
Chlorobenzene		~~0.0030~~	~~B~~ ~~J~~	0.00021	~~0.0012 U~~
1,3-Dichlorobenzene		ND		0.00044	0.0012
Naphthalene		~~0.00044~~	~~JB~~ ~~J~~	0.00028	0.0058 U
Styrene		ND		0.00036	0.0012
4-Chlorotoluene		ND		0.00045	0.0012
trans-1,2-Dichloroethene		ND		0.00033	0.0012
Bromobenzene		ND		0.00018	0.0012
1,2,3-Trichlorobenzene		ND		0.00020	0.0023
1,1-Dichloroethene		ND		0.00016	0.0058
1,2-Dichlorobenzene		ND		0.00040	0.0012
1,1,1,2-Tetrachloroethane		ND		0.00010	0.0012
sec-Butylbenzene		ND		0.00039	0.0012

STET

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-08**

Lab Sample ID: 580-15385-8
Client Matrix: Solid

% Moisture: 29.1

Date Sampled: 09/07/2009 1620
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50612		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50608		Lab File ID:	I2109029.D
Dilution:	1.0			Initial Weight/Volume:	6.099 g
Date Analyzed:	09/21/2009 2120			Final Weight/Volume:	5 mL
Date Prepared:	09/21/2009 1240				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00017	0.0012
Isopropylbenzene		ND		0.00017	0.0012
2,2-Dichloropropane		ND		0.00044	0.0012
N-Propylbenzene		ND		0.00017	0.0012
Trichlorofluoromethane		ND		0.00023	0.0012
4-Isopropyltoluene		0.0072	J	0.00036	0.0012
1,3,5-Trimethylbenzene		ND		0.00041	0.0023
cis-1,2-Dichloroethene		ND		0.00015	0.0012
m-Xylene & p-Xylene		~~0.00039~~	~~J B~~ ~~J~~	0.00018	0.0023 U
Vinyl chloride		ND		0.00017	0.0012
tert-Butylbenzene		ND		0.00039	0.0012
1,4-Dichlorobenzene		ND		0.00046	0.0012
1,3-Dichloropropane		ND		0.00025	0.0012

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	103		85 - 120
Toluene-d8 (Surr)	102		85 - 115
Trifluorotoluene (Surr)	166	X	75 - 125
1,2-Dichloroethane-d4 (Surr)	100		75 - 125

11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS 5-SED Ø

Client Sample ID: **SSI0049-10**

Lab Sample ID: 580-15385-10

Client Matrix: Solid

% Moisture: 29.7

Date Sampled: 09/08/2009 0830

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209018.D
Dilution:	1.0			Initial Weight/Volume:	5.70 g
Date Analyzed:	09/22/2009 1546			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.00011	0.0025	
1,2,3-Trichloropropane		ND		0.00045	0.0012	
1,2-Dibromo-3-Chloropropane		ND		0.00023	0.0025	
1,2-Dichloroethane		ND		0.00020	0.0012	
1,2-Dichloropropane		ND		0.00021	0.0012	
Bromoform		ND		0.000090	0.0012	
Bromomethane		ND		0.00048	0.0012	
Carbon tetrachloride		ND		0.00046	0.0012	
Chloroethane		ND		0.00033	0.0012	
Chloroform		ND		0.00018	0.0012	
Chloromethane		ND		0.00022	0.0012	
cis-1,3-Dichloropropene		ND		0.00015	0.0012	
Dichlorobromomethane		ND		0.000092	0.0012	
Ethylene Dibromide		ND		0.00016	0.0012	
Hexachlorobutadiene		ND		0.00042	0.0012	
trans-1,3-Dichloropropene		ND		0.00022	0.0012	
Trichloroethene		ND		0.00022	0.0012	
1,1,1-Trichloroethane		ND		0.00048	0.0012	
Benzene		0.00025	JB	0.000099	0.0012	U
Chlorobromomethane		ND		0.00031	0.0012	
Tetrachloroethene		ND		0.00013	0.0012	
1,1-Dichloroethane		ND		0.00049	0.0012	
1,1,2-Trichloroethane		ND		0.00013	0.0012	
Dichlorodifluoromethane		ND		0.00024	0.0012	
Methylene Chloride		ND		0.00024	0.0012	
n-Butylbenzene		ND		0.00039	0.0012	
1,2,4-Trimethylbenzene		ND		0.00041	0.0012	
2-Chlorotoluene		ND		0.00018	0.0012	
Chlorodibromomethane		ND		0.00017	0.0012	
Dibromomethane		ND		0.00013	0.0012	
1,1-Dichloropropene		ND		0.00048	0.0012	
Toluene		0.00031	JB	0.00011	0.0012	U
1,2,4-Trichlorobenzene		ND		0.00048	0.0025	
o-Xylene		ND		0.000066	0.0012	
Chlorobenzene		0.00046	JB	0.00022	0.0012	U
1,3-Dichlorobenzene		ND		0.00047	0.0012	
Naphthalene		ND		0.00030	0.0062	
Styrene		ND		0.00039	0.0012	
4-Chlorotoluene		ND		0.00048	0.0012	
trans-1,2-Dichloroethene		ND		0.00036	0.0012	
Bromobenzene		ND		0.00020	0.0012	
1,2,3-Trichlorobenzene		ND		0.00021	0.0025	
1,1-Dichloroethene		ND		0.00017	0.0062	
1,2-Dichlorobenzene		ND		0.00043	0.0012	
1,1,1,2-Tetrachloroethane		ND		0.00011	0.0012	
sec-Butylbenzene		ND		0.00043	0.0012	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-10

Lab Sample ID: 580-15385-10
Client Matrix: Solid
% Moisture: 29.7

Date Sampled: 09/08/2009 0830
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209018.D
Dilution:	1.0			Initial Weight/Volume:	5.70 g
Date Analyzed:	09/22/2009 1546			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00019	0.0012
Isopropylbenzene		ND		0.00019	0.0012
2,2-Dichloropropane		ND		0.00048	0.0012
N-Propylbenzene		ND		0.00018	0.0012
Trichlorofluoromethane		ND		0.00024	0.0012
4-Isopropyltoluene		ND		0.00039	0.0012
1,3,5-Trimethylbenzene		ND		0.00044	0.0025
cis-1,2-Dichloroethene		ND		0.00016	0.0012
m-Xylene & p-Xylene		ND		0.00020	0.0025
Vinyl chloride		ND		0.00018	0.0012
tert-Butylbenzene		ND		0.00042	0.0012
1,4-Dichlorobenzene		ND		0.00050	0.0012
1,3-Dichloropropane		ND		0.00027	0.0012

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	103		85 - 120
Toluene-d8 (Surr)	99		85 - 115
Trifluorotoluene (Surr)	105		75 - 125
1,2-Dichloroethane-d4 (Surr)	106		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

G-RS5D-SED-Ø

Client Sample ID: **SSI0049-11**

Lab Sample ID: 580-15385-11

Client Matrix: Solid

% Moisture: 29.4

Date Sampled: 09/08/2009 0835

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209019.D
Dilution:	1.0			Initial Weight/Volume:	5.44 g
Date Analyzed:	09/22/2009 1610			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00011	0.0026
1,2,3-Trichloropropane		ND		0.00047	0.0013
1,2-Dibromo-3-Chloropropane		ND		0.00024	0.0026
1,2-Dichloroethane		ND		0.00021	0.0013
1,2-Dichloropropane		ND		0.00022	0.0013
Bromoform		ND		0.000094	0.0013
Bromomethane		ND		0.00050	0.0013
Carbon tetrachloride		ND		0.00048	0.0013
Chloroethane		ND		0.00035	0.0013
Chloroform		ND		0.00019	0.0013
Chloromethane		ND		0.00023	0.0013
cis-1,3-Dichloropropene		ND		0.00015	0.0013
Dichlorobromomethane		ND		0.000096	0.0013
Ethylene Dibromide		ND		0.00017	0.0013
Hexachlorobutadiene		ND		0.00044	0.0013
trans-1,3-Dichloropropene		ND		0.00023	0.0013
Trichloroethene		ND		0.00023	0.0013
1,1,1-Trichloroethane		ND		0.00050	0.0013
Benzene		~~0.00021~~	~~JB~~ J	0.00010	0.0013 U
Chlorobromomethane		ND		0.00032	0.0013
Tetrachloroethene		ND		0.00013	0.0013
1,1-Dichloroethane		ND		0.00051	0.0013
1,1,2-Trichloroethane		ND		0.00013	0.0013
Dichlorodifluoromethane		ND		0.00025	0.0013
Methylene Chloride		ND		0.00025	0.0013
n-Butylbenzene		ND		0.00041	0.0013
1,2,4-Trimethylbenzene		ND		0.00043	0.0013
2-Chlorotoluene		ND		0.00019	0.0013
Chlorodibromomethane		ND		0.00018	0.0013
Dibromomethane		ND		0.00014	0.0013
1,1-Dichloropropene		ND		0.00051	0.0013
Toluene		~~0.00051~~	~~JB~~ J	0.00011	0.0013 U
1,2,4-Trichlorobenzene		ND		0.00050	0.0026
o-Xylene		0.00018	J	0.000069	0.0013
Chlorobenzene		~~0.0012~~	~~JB~~ J	0.00023	0.0013 U
1,3-Dichlorobenzene		ND		0.00049	0.0013
Naphthalene		ND		0.00031	0.0065
Styrene		ND		0.00041	0.0013
4-Chlorotoluene		ND		0.00050	0.0013
trans-1,2-Dichloroethene		ND		0.00037	0.0013
Bromobenzene		ND		0.00020	0.0013
1,2,3-Trichlorobenzene		ND		0.00022	0.0026
1,1-Dichloroethene		ND		0.00018	0.0065
1,2-Dichlorobenzene		ND		0.00045	0.0013
1,1,1,2-Tetrachloroethane		ND		0.00011	0.0013
sec-Butylbenzene		ND		0.00044	0.0013

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-11**

Lab Sample ID: 580-15385-11
Client Matrix: Solid
% Moisture: 29.4

Date Sampled: 09/08/2009 0835
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209019.D
Dilution:	1.0			Initial Weight/Volume:	5.44 g
Date Analyzed:	09/22/2009 1610			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00019	0.0013
Isopropylbenzene		ND		0.00019	0.0013
2,2-Dichloropropane		ND		0.00050	0.0013
N-Propylbenzene		ND		0.00019	0.0013
Trichlorofluoromethane		ND		0.00025	0.0013
4-Isopropyltoluene		ND		0.00040	0.0013
1,3,5-Trimethylbenzene		ND		0.00046	0.0026
cis-1,2-Dichloroethene		ND		0.00017	0.0013
m-Xylene & p-Xylene		0.00022	J	0.00021	0.0026
Vinyl chloride		ND		0.00019	0.0013
tert-Butylbenzene		ND		0.00044	0.0013
1,4-Dichlorobenzene		ND		0.00052	0.0013
1,3-Dichloropropane		ND		0.00029	0.0013

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	103		85 - 120
Toluene-d8 (Surr)	97		85 - 115
Trifluorotoluene (Surr)	147	X	75 - 125
1,2-Dichloroethane-d4 (Surr)	108		75 - 125

11-06-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS 5-SED4

Client Sample ID: **SSI0049-12**

Lab Sample ID: 580-15385-12

Client Matrix: Solid

% Moisture: 18.0

Date Sampled: 09/08/2009 0845

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209020.D
Dilution:	1.0			Initial Weight/Volume:	6.52 g
Date Analyzed:	09/22/2009 1634			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.000082	0.0019	
1,2,3-Trichloropropane		ND		0.00034	0.00093	
1,2-Dibromo-3-Chloropropane		ND		0.00017	0.0019	
1,2-Dichloroethane		ND		0.00015	0.00093	
1,2-Dichloropropane		ND		0.00016	0.00093	
Bromoform		ND		0.000067	0.00093	
Bromomethane		ND		0.00036	0.00093	
Carbon tetrachloride		ND		0.00035	0.00093	
Chloroethane		ND		0.00025	0.00093	
Chloroform		ND		0.00014	0.00093	
Chloromethane		ND		0.00016	0.00093	
cis-1,3-Dichloropropene		ND		0.00011	0.00093	
Dichlorobromomethane		ND		0.000069	0.00093	
Ethylene Dibromide		ND		0.00012	0.00093	
Hexachlorobutadiene		ND		0.00031	0.00093	
trans-1,3-Dichloropropene		ND		0.00017	0.00093	
Trichloroethene		ND		0.00016	0.00093	
1,1,1-Trichloroethane		ND		0.00036	0.00093	
Benzene		~~0.00029~~	~~JB~~	0.000074	0.00093	U
Chlorobromomethane		ND		0.00023	0.00093	
Tetrachloroethene		ND		0.000096	0.00093	
1,1-Dichloroethane		ND		0.00037	0.00093	
1,1,2-Trichloroethane		ND		0.000094	0.00093	
Dichlorodifluoromethane		ND		0.00018	0.00093	
Methylene Chloride		ND		0.00018	0.00093	
n-Butylbenzene		ND		0.00029	0.00093	
1,2,4-Trimethylbenzene		ND		0.00031	0.00093	
2-Chlorotoluene		ND		0.00014	0.00093	
Chlorodibromomethane		ND		0.00013	0.00093	
Dibromomethane		ND		0.000098	0.00093	
1,1-Dichloropropene		ND		0.00036	0.00093	
Toluene		~~0.00049~~	~~JB~~	0.000079	0.00093	U
1,2,4-Trichlorobenzene		ND		0.00036	0.0019	
o-Xylene		0.00014	J	0.000050	0.00093	
Chlorobenzene		0.0010	U ~~B~~	0.00017	0.00093	
1,3-Dichlorobenzene		ND		0.00036	0.00093	
Naphthalene		0.0034	J	0.00022	0.0047	
Styrene		ND		0.00029	0.00093	
4-Chlorotoluene		ND		0.00036	0.00093	
trans-1,2-Dichloroethene		ND		0.00027	0.00093	
Bromobenzene		ND		0.00015	0.00093	
1,2,3-Trichlorobenzene		ND		0.00016	0.0019	
1,1-Dichloroethene		ND		0.00013	0.0047	
1,2-Dichlorobenzene		0.00039	J	0.00033	0.00093	
1,1,1,2-Tetrachloroethane		ND		0.000081	0.00093	
sec-Butylbenzene		0.0014		0.00032	0.00093	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-12**

Lab Sample ID: 580-15385-12
Client Matrix: Solid
% Moisture: 18.0

Date Sampled: 09/08/2009 0845
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209020.D
Dilution:	1.0			Initial Weight/Volume:	6.52 g
Date Analyzed:	09/22/2009 1634			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00014	0.00093
Isopropylbenzene		0.00050	J	0.00014	0.00093
2,2-Dichloropropane		ND		0.00036	0.00093
N-Propylbenzene		0.00045	J	0.00013	0.00093
Trichlorofluoromethane		ND		0.00018	0.00093
4-Isopropyltoluene		0.00045	J	0.00029	0.00093
1,3,5-Trimethylbenzene		ND		0.00033	0.0019
cis-1,2-Dichloroethene		ND		0.00012	0.00093
m-Xylene & p-Xylene		0.00022	J	0.00015	0.0019
Vinyl chloride		ND		0.00014	0.00093
tert-Butylbenzene		ND		0.00032	0.00093
1,4-Dichlorobenzene		ND		0.00037	0.00093
1,3-Dichloropropane		ND		0.00020	0.00093

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	104		85 - 120
Toluene-d8 (Surr)	100		85 - 115
Trifluorotoluene (Surr)	94		75 - 125
1,2-Dichloroethane-d4 (Surr)	103		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS6-SED0

Client Sample ID: **SSI0049-13**

Lab Sample ID: 580-15385-13

Client Matrix: Solid

% Moisture: 25.0

Date Sampled: 09/08/2009 0740

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209021.D
Dilution:	1.0			Initial Weight/Volume:	4.48 g
Date Analyzed:	09/22/2009 1657			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.00013	0.0030	
1,2,3-Trichloropropane		ND		0.00054	0.0015	
1,2-Dibromo-3-Chloropropane		ND		0.00027	0.0030	
1,2-Dichloroethane		ND		0.00024	0.0015	
1,2-Dichloropropane		ND		0.00025	0.0015	
Bromoform		ND		0.00011	0.0015	
Bromomethane		ND		0.00057	0.0015	
Carbon tetrachloride		ND		0.00055	0.0015	
Chloroethane		ND		0.00040	0.0015	
Chloroform		ND		0.00022	0.0015	
Chloromethane		ND		0.00026	0.0015	
cis-1,3-Dichloropropene		ND		0.00017	0.0015	
Dichlorobromomethane		ND		0.00011	0.0015	
Ethylene Dibromide		ND		0.00020	0.0015	
Hexachlorobutadiene		ND		0.00050	0.0015	
trans-1,3-Dichloropropene		ND		0.00026	0.0015	
Trichloroethene		ND		0.00026	0.0015	
1,1,1-Trichloroethane		ND		0.00057	0.0015	
Benzene		~~0.00020~~	~~J B~~	0.00012	0.0015	U
Chlorobromomethane		ND		0.00037	0.0015	
Tetrachloroethene		ND		0.00015	0.0015	
1,1-Dichloroethane		ND		0.00058	0.0015	
1,1,2-Trichloroethane		ND		0.00015	0.0015	
Dichlorodifluoromethane		ND		0.00029	0.0015	
Methylene Chloride		ND		0.00029	0.0015	
n-Butylbenzene		ND		0.00047	0.0015	
1,2,4-Trimethylbenzene		ND		0.00049	0.0015	
2-Chlorotoluene		ND		0.00022	0.0015	
Chlorodibromomethane		ND		0.00020	0.0015	
Dibromomethane		ND		0.00016	0.0015	
1,1-Dichloropropene		ND		0.00058	0.0015	
Toluene		~~0.00029~~	~~J B~~	0.00013	0.0015	U
1,2,4-Trichlorobenzene		ND		0.00057	0.0030	
o-Xylene		0.00012	J	0.000079	0.0015	
Chlorobenzene		~~0.00035~~	~~J B~~	0.00026	0.0015	U
1,3-Dichlorobenzene		ND		0.00057	0.0015	
Naphthalene		ND		0.00036	0.0074	
Styrene		ND		0.00047	0.0015	
4-Chlorotoluene		ND		0.00057	0.0015	
trans-1,2-Dichloroethene		ND		0.00043	0.0015	
Bromobenzene		ND		0.00023	0.0015	
1,2,3-Trichlorobenzene		ND		0.00026	0.0030	
1,1-Dichloroethene		ND		0.00021	0.0074	
1,2-Dichlorobenzene		ND		0.00052	0.0015	
1,1,1,2-Tetrachloroethane		ND		0.00013	0.0015	
sec-Butylbenzene		ND		0.00051	0.0015	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-13**

Lab Sample ID: 580-15385-13
Client Matrix: Solid
% Moisture: 25.0

Date Sampled: 09/08/2009 0740
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209021.D
Dilution:	1.0			Initial Weight/Volume:	4.48 g
Date Analyzed:	09/22/2009 1657			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00022	0.0015
Isopropylbenzene		ND		0.00022	0.0015
2,2-Dichloropropane		ND		0.00057	0.0015
N-Propylbenzene		ND		0.00021	0.0015
Trichlorofluoromethane		ND		0.00029	0.0015
4-Isopropyltoluene		ND		0.00046	0.0015
1,3,5-Trimethylbenzene		ND		0.00052	0.0030
cis-1,2-Dichloroethene		ND		0.00019	0.0015
m-Xylene & p-Xylene		0.00029	J	0.00024	0.0030
Vinyl chloride		ND		0.00022	0.0015
tert-Butylbenzene		ND		0.00050	0.0015
1,4-Dichlorobenzene		ND		0.00059	0.0015
1,3-Dichloropropane		ND		0.00033	0.0015

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	104		85 - 120
Toluene-d8 (Surr)	98		85 - 115
Trifluorotoluene (Surr)	97		75 - 125
1,2-Dichloroethane-d4 (Surr)	102		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS6-SED 3

Client Sample ID: **SSI0049-14**

Lab Sample ID: 580-15385-14
Client Matrix: Solid

% Moisture: 31.9

Date Sampled: 09/08/2009 0735
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209024.D
Dilution:	1.0			Initial Weight/Volume:	5.28 g
Date Analyzed:	09/22/2009 1809			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		0.00027	J	0.00012	0.0028	
1,2,3-Trichloropropane		ND		0.00050	0.0014	
1,2-Dibromo-3-Chloropropane		0.00054	J	0.00025	0.0028	
1,2-Dichloroethane		ND		0.00022	0.0014	
1,2-Dichloropropane		ND		0.00024	0.0014	
Bromoform		ND		0.00010	0.0014	
Bromomethane		ND		0.00054	0.0014	
Carbon tetrachloride		ND		0.00052	0.0014	
Chloroethane		ND		0.00037	0.0014	
Chloroform		ND		0.00021	0.0014	
Chloromethane		ND		0.00024	0.0014	
cis-1,3-Dichloropropene		ND		0.00016	0.0014	
Dichlorobromomethane		ND		0.00010	0.0014	
Ethylene Dibromide		ND		0.00018	0.0014	
Hexachlorobutadiene		0.00093	J	0.00047	0.0014	
trans-1,3-Dichloropropene		ND		0.00025	0.0014	
Trichloroethene		ND		0.00024	0.0014	
1,1,1-Trichloroethane		ND		0.00053	0.0014	
Benzene		~~0.00063~~	~~J B~~	0.00011	0.0014	U
Chlorobromomethane		ND		0.00035	0.0014	
Tetrachloroethene		ND		0.00014	0.0014	
1,1-Dichloroethane		ND		0.00055	0.0014	
1,1,2-Trichloroethane		ND		0.00014	0.0014	
Dichlorodifluoromethane		ND		0.00027	0.0014	
Methylene Chloride		ND		0.00027	0.0014	
n-Butylbenzene		0.0011	J	0.00044	0.0014	
1,2,4-Trimethylbenzene		0.00072	J	0.00046	0.0014	
2-Chlorotoluene		0.00029	J	0.00020	0.0014	
Chlorodibromomethane		ND		0.00019	0.0014	
Dibromomethane		ND		0.00015	0.0014	
1,1-Dichloropropene		ND		0.00054	0.0014	
Toluene		0.0022	~~B~~	0.00012	0.0014	
1,2,4-Trichlorobenzene		0.00088	J	0.00053	0.0028	
o-Xylene		0.00036	J	0.000074	0.0014	
Chlorobenzene		~~0.00058~~	~~J B~~	0.00025	0.0014	U
1,3-Dichlorobenzene		0.00054	J	0.00053	0.0014	
Naphthalene		0.0018	J	0.00033	0.0070	
Styrene		0.00049	J	0.00044	0.0014	
4-Chlorotoluene		ND		0.00054	0.0014	
trans-1,2-Dichloroethene		ND		0.00040	0.0014	
Bromobenzene		0.00035	J	0.00022	0.0014	
1,2,3-Trichlorobenzene		~~0.0010~~	~~J B~~	0.00024	0.0028	U
1,1-Dichloroethene		ND		0.00019	0.0070	
1,2-Dichlorobenzene		0.00057	J	0.00048	0.0014	
1,1,1,2-Tetrachloroethane		ND		0.00012	0.0014	
sec-Butylbenzene		0.00072	J	0.00047	0.0014	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-14**

Lab Sample ID: 580-15385-14
Client Matrix: Solid
% Moisture: 31.9

Date Sampled: 09/08/2009 0735
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209024.D
Dilution:	1.0			Initial Weight/Volume:	5.28 g
Date Analyzed:	09/22/2009 1809			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		0.00028	J	0.00021	0.0014
Isopropylbenzene		0.00029	J	0.00021	0.0014
2,2-Dichloropropane		ND		0.00053	0.0014
N-Propylbenzene		0.00088	J	0.00020	0.0014
Trichlorofluoromethane		ND		0.00027	0.0014
4-Isopropyltoluene		0.0022		0.00043	0.0014
1,3,5-Trimethylbenzene		0.00054	J	0.00049	0.0028
cis-1,2-Dichloroethene		ND		0.00018	0.0014
m-Xylene & p-Xylene		0.00065	J	0.00022	0.0028
Vinyl chloride		ND		0.00021	0.0014
tert-Butylbenzene		0.00062	J	0.00047	0.0014
1,4-Dichlorobenzene		0.00070	J	0.00055	0.0014
1,3-Dichloropropane		ND		0.00030	0.0014

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	105		85 - 120
Toluene-d8 (Surr)	101		85 - 115
Trifluorotoluene (Surr)	89		75 - 125
1,2-Dichloroethane-d4 (Surr)	96		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-15** RS3-SED4

Lab Sample ID: 580-15385-15

Client Matrix: Solid

% Moisture: 16.8

Date Sampled: 09/08/2009 1115

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209025.D
Dilution:	1.0			Initial Weight/Volume:	7.49 g
Date Analyzed:	09/22/2009 1833			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.000071	0.0016
1,2,3-Trichloropropane		ND		0.00029	0.00080
1,2-Dibromo-3-Chloropropane		ND		0.00015	0.0016
1,2-Dichloroethane		ND		0.00013	0.00080
1,2-Dichloropropane		ND		0.00014	0.00080
Bromoform		ND		0.000058	0.00080
Bromomethane		ND		0.00031	0.00080
Carbon tetrachloride		ND		0.00030	0.00080
Chloroethane		ND		0.00022	0.00080
Chloroform		ND		0.00012	0.00080
Chloromethane		ND		0.00014	0.00080
cis-1,3-Dichloropropene		ND		0.000094	0.00080
Dichlorobromomethane		ND		0.000059	0.00080
Ethylene Dibromide		ND		0.00011	0.00080
Hexachlorobutadiene		ND		0.00027	0.00080
trans-1,3-Dichloropropene		ND		0.00014	0.00080
Trichloroethene		ND		0.00014	0.00080
1,1,1-Trichloroethane		ND		0.00031	0.00080
Benzene		~~0.00026~~	~~JB~~	0.000063	0.00080 U
Chlorobromomethane		ND		0.00020	0.00080
Tetrachloroethene		ND		0.000083	0.00080
1,1-Dichloroethane		ND		0.00032	0.00080
1,1,2-Trichloroethane		ND		0.000081	0.00080
Dichlorodifluoromethane		ND		0.00015	0.00080
Methylene Chloride		ND		0.00015	0.00080
n-Butylbenzene		ND		0.00025	0.00080
1,2,4-Trimethylbenzene		ND		0.00027	0.00080
2-Chlorotoluene		ND		0.00012	0.00080
Chlorodibromomethane		ND		0.00011	0.00080
Dibromomethane		ND		0.000084	0.00080
1,1-Dichloropropene		ND		0.00031	0.00080
Toluene		~~0.00022~~	~~JB~~	0.000068	0.00080 U
1,2,4-Trichlorobenzene		ND		0.00031	0.0016
o-Xylene		0.000077	J	0.000043	0.00080
Chlorobenzene		~~0.00021~~	~~JB~~	0.00014	0.00080 U
1,3-Dichlorobenzene		ND		0.00030	0.00080
Naphthalene		ND		0.00019	0.0040
Styrene		ND		0.00025	0.00080
4-Chlorotoluene		ND		0.00031	0.00080
trans-1,2-Dichloroethene		ND		0.00023	0.00080
Bromobenzene		ND		0.00013	0.00080
1,2,3-Trichlorobenzene		~~0.00021~~	~~JB~~	0.00014	0.0016 U
1,1-Dichloroethene		ND		0.00011	0.0040
1,2-Dichlorobenzene		ND		0.00028	0.00080
1,1,1,2-Tetrachloroethane		ND		0.000070	0.00080
sec-Butylbenzene		ND		0.00027	0.00080

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-15

Lab Sample ID: 580-15385-15
Client Matrix: Solid
% Moisture: 16.8

Date Sampled: 09/08/2009 1115
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209025.D
Dilution:	1.0			Initial Weight/Volume:	7.49 g
Date Analyzed:	09/22/2009 1833			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00012	0.00080
Isopropylbenzene		ND		0.00012	0.00080
2,2-Dichloropropane		ND		0.00031	0.00080
N-Propylbenzene		ND		0.00012	0.00080
Trichlorofluoromethane		ND		0.00016	0.00080
4-Isopropyltoluene		ND		0.00025	0.00080
1,3,5-Trimethylbenzene		ND		0.00028	0.0016
cis-1,2-Dichloroethene		ND		0.00010	0.00080
m-Xylene & p-Xylene		0.00014	J	0.00013	0.0016
Vinyl chloride		ND		0.00012	0.00080
tert-Butylbenzene		ND		0.00027	0.00080
1,4-Dichlorobenzene		ND		0.00032	0.00080
1,3-Dichloropropane		ND		0.00018	0.00080

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	103		85 - 120
Toluene-d8 (Surr)	100		85 - 115
Trifluorotoluene (Surr)	88		75 - 125
1,2-Dichloroethane-d4 (Surr)	101		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS3-SED0

Client Sample ID: **SSI0049-16**

Lab Sample ID: 580-15385-16

Client Matrix: Solid

% Moisture: 27.9

Date Sampled: 09/08/2009 1110

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209026.D
Dilution:	1.0			Initial Weight/Volume:	4.23 g
Date Analyzed:	09/22/2009 1857			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
1,1,2,2-Tetrachloroethane		ND		0.00014	0.0033
1,2,3-Trichloropropane		ND		0.00059	0.0016
1,2-Dibromo-3-Chloropropane		ND		0.00030	0.0033
1,2-Dichloroethane		ND		0.00026	0.0016
1,2-Dichloropropane		ND		0.00028	0.0016
Bromoform		ND		0.00012	0.0016
Bromomethane		ND		0.00063	0.0016
Carbon tetrachloride		ND		0.00061	0.0016
Chloroethane		ND		0.00044	0.0016
Chloroform		ND		0.00024	0.0016
Chloromethane		ND		0.00029	0.0016
cis-1,3-Dichloropropene		ND		0.00019	0.0016
Dichlorobromomethane		ND		0.00012	0.0016
Ethylene Dibromide		ND		0.00022	0.0016
Hexachlorobutadiene		ND		0.00055	0.0016
trans-1,3-Dichloropropene		ND		0.00029	0.0016
Trichloroethene		ND		0.00029	0.0016
1,1,1-Trichloroethane		ND		0.00063	0.0016
Benzene		~~0.00064~~	~~JB~~	0.00013	0.0016 U
Chlorobromomethane		ND		0.00041	0.0016
Tetrachloroethene		ND		0.00017	0.0016
1,1-Dichloroethane		ND		0.00064	0.0016
1,1,2-Trichloroethane		ND		0.00017	0.0016
Dichlorodifluoromethane		ND		0.00031	0.0016
Methylene Chloride		ND		0.00032	0.0016
n-Butylbenzene		0.0092		0.00051	0.0016
1,2,4-Trimethylbenzene		ND		0.00054	0.0016
2-Chlorotoluene		ND		0.00024	0.0016
Chlorodibromomethane		ND		0.00022	0.0016
Dibromomethane		ND		0.00017	0.0016
1,1-Dichloropropene		ND		0.00064	0.0016
Toluene		~~0.00079~~	~~JB~~	0.00014	0.0016 U
1,2,4-Trichlorobenzene		ND		0.00063	0.0033
o-Xylene		0.00097	J	0.000087	0.0016
Chlorobenzene		~~0.0010~~	~~JB~~	0.00029	0.0016 U
1,3-Dichlorobenzene		ND		0.00062	0.0016
Naphthalene		0.0035	J	0.00039	0.0082
Styrene		ND		0.00052	0.0016
4-Chlorotoluene		ND		0.00063	0.0016
trans-1,2-Dichloroethene		ND		0.00047	0.0016
Bromobenzene		ND		0.00026	0.0016
1,2,3-Trichlorobenzene		ND		0.00028	0.0033
1,1-Dichloroethene		ND		0.00023	0.0082
1,2-Dichlorobenzene		0.0023		0.00057	0.0016
1,1,1,2-Tetrachloroethane		ND		0.00014	0.0016
sec-Butylbenzene		0.0065		0.00056	0.0016

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-16

Lab Sample ID: 580-15385-16
Client Matrix: Solid
% Moisture: 27.9

Date Sampled: 09/08/2009 1110
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209026.D
Dilution:	1.0			Initial Weight/Volume:	4.23 g
Date Analyzed:	09/22/2009 1857			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00024	0.0016
Isopropylbenzene		0.0028		0.00024	0.0016
2,2-Dichloropropane		ND		0.00063	0.0016
N-Propylbenzene		0.00072	J	0.00024	0.0016
Trichlorofluoromethane		ND		0.00032	0.0016
4-Isopropyltoluene		0.0020		0.00051	0.0016
1,3,5-Trimethylbenzene		ND		0.00058	0.0033
cis-1,2-Dichloroethene		ND		0.00021	0.0016
m-Xylene & p-Xylene		0.00048	J	0.00026	0.0033
Vinyl chloride		ND		0.00024	0.0016
tert-Butylbenzene		0.00089	J	0.00055	0.0016
1,4-Dichlorobenzene		0.00094	J	0.00065	0.0016
1,3-Dichloropropane		ND		0.00036	0.0016

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	114		85 - 120
Toluene-d8 (Surr)	104		85 - 115
Trifluorotoluene (Surr)	94		75 - 125
1,2-Dichloroethane-d4 (Surr)	96		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-17** RS4-SED ∅

Lab Sample ID: 580-15385-17

Client Matrix: Solid

% Moisture: 16.5

Date Sampled: 09/08/2009 1220

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209027.D
Dilution:	1.0			Initial Weight/Volume:	5.49 g
Date Analyzed:	09/22/2009 1921			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.000096	0.0022	
1,2,3-Trichloropropane		ND		0.00039	0.0011	
1,2-Dibromo-3-Chloropropane		ND		0.00020	0.0022	
1,2-Dichloroethane		ND		0.00017	0.0011	
1,2-Dichloropropane		ND		0.00019	0.0011	
Bromoform		ND		0.000079	0.0011	
Bromomethane		ND		0.00042	0.0011	
Carbon tetrachloride		ND		0.00041	0.0011	
Chloroethane		ND		0.00029	0.0011	
Chloroform		ND		0.00016	0.0011	
Chloromethane		ND		0.00019	0.0011	
cis-1,3-Dichloropropene		ND		0.00013	0.0011	
Dichlorobromomethane		ND		0.000081	0.0011	
Ethylene Dibromide		ND		0.00014	0.0011	
Hexachlorobutadiene		ND		0.00037	0.0011	
trans-1,3-Dichloropropene		ND		0.00019	0.0011	
Trichloroethene		ND		0.00019	0.0011	
1,1,1-Trichloroethane		ND		0.00042	0.0011	
Benzene		~~0.00053~~	~~JB~~ J	0.000086	0.0011	U
Chlorobromomethane		ND		0.00027	0.0011	
Tetrachloroethene		ND		0.00011	0.0011	
1,1-Dichloroethane		ND		0.00043	0.0011	
1,1,2-Trichloroethane		ND		0.00011	0.0011	
Dichlorodifluoromethane		ND		0.00021	0.0011	
Methylene Chloride		ND		0.00021	0.0011	
n-Butylbenzene		0.018	J	0.00034	0.0011	
1,2,4-Trimethylbenzene		ND		0.00036	0.0011	
2-Chlorotoluene		ND		0.00016	0.0011	
Chlorodibromomethane		ND		0.00015	0.0011	
Dibromomethane		ND		0.00011	0.0011	
1,1-Dichloropropene		ND		0.00042	0.0011	
Toluene		0.0014	~~B~~ J	0.000093	0.0011	
1,2,4-Trichlorobenzene		ND		0.00042	0.0022	
o-Xylene		ND		0.000058	0.0011	
Chlorobenzene		~~0.0020~~	~~B~~ J	0.00019	0.0011	U
1,3-Dichlorobenzene		ND		0.00041	0.0011	
Naphthalene		0.0062	J	0.00026	0.0055	
Styrene		ND		0.00034	0.0011	
4-Chlorotoluene		ND		0.00042	0.0011	
trans-1,2-Dichloroethene		ND		0.00031	0.0011	
Bromobenzene		ND		0.00017	0.0011	
1,2,3-Trichlorobenzene		ND		0.00019	0.0022	
1,1-Dichloroethene		ND		0.00015	0.0055	
1,2-Dichlorobenzene		0.0019	J	0.00038	0.0011	
1,1,1,2-Tetrachloroethane		ND		0.000095	0.0011	
sec-Butylbenzene		0.010	J	0.00037	0.0011	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-17

Lab Sample ID: 580-15385-17
Client Matrix: Solid
% Moisture: 16.5

Date Sampled: 09/08/2009 1220
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209027.D
Dilution:	1.0			Initial Weight/Volume:	5.49 g
Date Analyzed:	09/22/2009 1921			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00016	0.0011
Isopropylbenzene		0.0025	J	0.00016	0.0011
2,2-Dichloropropane		ND		0.00042	0.0011
N-Propylbenzene		ND		0.00016	0.0011
Trichlorofluoromethane		ND		0.00021	0.0011
4-Isopropyltoluene		0.0041	J	0.00034	0.0011
1,3,5-Trimethylbenzene		ND		0.00038	0.0022
cis-1,2-Dichloroethene		ND		0.00014	0.0011
m-Xylene & p-Xylene		ND		0.00017	0.0022
Vinyl chloride		ND		0.00016	0.0011
tert-Butylbenzene		ND		0.00037	0.0011
1,4-Dichlorobenzene		ND		0.00043	0.0011
1,3-Dichloropropane		ND		0.00024	0.0011

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	127	X	85 - 120
Toluene-d8 (Surr)	109		85 - 115
Trifluorotoluene (Surr)	95		75 - 125
1,2-Dichloroethane-d4 (Surr)	98		75 - 125

11-6-09

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

RS4-SED4

Client Sample ID: **SSI0049-18**

Lab Sample ID: 580-15385-18

Client Matrix: Solid

% Moisture: 13.4

Date Sampled: 09/08/2009 1225

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716		Instrument ID:	SEA015
Preparation:	5035	Prep Batch: 580-50646		Lab File ID:	I2209028.D
Dilution:	1.0			Initial Weight/Volume:	7.39 g
Date Analyzed:	09/22/2009 1944			Final Weight/Volume:	5 mL
Date Prepared:	09/22/2009 0732				

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL	
1,1,2,2-Tetrachloroethane		ND		0.000069	0.0016	
1,2,3-Trichloropropane		ND		0.00028	0.00078	
1,2-Dibromo-3-Chloropropane		ND		0.00014	0.0016	
1,2-Dichloroethane		ND		0.00012	0.00078	
1,2-Dichloropropane		ND		0.00013	0.00078	
Bromoform		ND		0.000056	0.00078	
Bromomethane		ND		0.00030	0.00078	
Carbon tetrachloride		ND		0.00029	0.00078	
Chloroethane		ND		0.00021	0.00078	
Chloroform		ND		0.00012	0.00078	
Chloromethane		ND		0.00014	0.00078	
cis-1,3-Dichloropropene		ND		0.000091	0.00078	
Dichlorobromomethane		ND		0.000058	0.00078	
Ethylene Dibromide		ND		0.00010	0.00078	
Hexachlorobutadiene		ND		0.00026	0.00078	
trans-1,3-Dichloropropene		ND		0.00014	0.00078	
Trichloroethene		ND		0.00014	0.00078	
1,1,1-Trichloroethane		ND		0.00030	0.00078	
Benzene		~~0.00011~~	~~JB~~	0.000062	0.00078	U
Chlorobromomethane		ND		0.00019	0.00078	
Tetrachloroethene		ND		0.000080	0.00078	
1,1-Dichloroethane		ND		0.00031	0.00078	
1,1,2-Trichloroethane		ND		0.000079	0.00078	
Dichlorodifluoromethane		ND		0.00015	0.00078	
Methylene Chloride		ND		0.00015	0.00078	
n-Butylbenzene		ND		0.00025	0.00078	
1,2,4-Trimethylbenzene		ND		0.00026	0.00078	
2-Chlorotoluene		ND		0.00011	0.00078	
Chlorodibromomethane		ND		0.00011	0.00078	
Dibromomethane		ND		0.000082	0.00078	
1,1-Dichloropropene		ND		0.00030	0.00078	
Toluene		~~0.00016~~	~~JB~~	0.000066	0.00078	U
1,2,4-Trichlorobenzene		ND		0.00030	0.0016	
o-Xylene		0.000049	J	0.000041	0.00078	
Chlorobenzene		~~0.00025~~	~~JB~~	0.00014	0.00078	U
1,3-Dichlorobenzene		ND		0.00030	0.00078	
Naphthalene		ND		0.00019	0.0039	
Styrene		ND		0.00025	0.00078	
4-Chlorotoluene		ND		0.00030	0.00078	
trans-1,2-Dichloroethene		ND		0.00022	0.00078	
Bromobenzene		ND		0.00012	0.00078	
1,2,3-Trichlorobenzene		ND		0.00013	0.0016	
1,1-Dichloroethene		ND		0.00011	0.0039	
1,2-Dichlorobenzene		ND		0.00027	0.00078	
1,1,1,2-Tetrachloroethane		ND		0.000068	0.00078	
sec-Butylbenzene		ND		0.00027	0.00078	

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-18

Lab Sample ID: 580-15385-18
Client Matrix: Solid

% Moisture: 13.4

Date Sampled: 09/08/2009 1225
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-50716	Instrument ID: SEA015
Preparation:	5035	Prep Batch: 580-50646	Lab File ID: I2209028.D
Dilution:	1.0		Initial Weight/Volume: 7.39 g
Date Analyzed:	09/22/2009 1944		Final Weight/Volume: 5 mL
Date Prepared:	09/22/2009 0732		

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Ethylbenzene		ND		0.00012	0.00078
Isopropylbenzene		ND		0.00012	0.00078
2,2-Dichloropropane		ND		0.00030	0.00078
N-Propylbenzene		ND		0.00011	0.00078
Trichlorofluoromethane		ND		0.00015	0.00078
4-Isopropyltoluene		ND		0.00024	0.00078
1,3,5-Trimethylbenzene		ND		0.00027	0.0016
cis-1,2-Dichloroethene		ND		0.000099	0.00078
m-Xylene & p-Xylene		ND		0.00012	0.0016
Vinyl chloride		ND		0.00012	0.00078
tert-Butylbenzene		ND		0.00026	0.00078
1,4-Dichlorobenzene		ND		0.00031	0.00078
1,3-Dichloropropane		ND		0.00017	0.00078

Surrogate	%Rec	Qualifier	Acceptance Limits
4-Bromofluorobenzene (Surr)	102		85 - 120
Toluene-d8 (Surr)	101		85 - 115
Trifluorotoluene (Surr)	91		75 - 125
1,2-Dichloroethane-d4 (Surr)	92		75 - 125

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-19** TRIP BLANK

Lab Sample ID: 580-15385-19TB

Client Matrix: Solid

Date Sampled: 09/08/2009 0000

Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-51100		Instrument ID:	TAC043
Preparation:	5035	Prep Batch: 580-51093		Lab File ID:	VB00118435.D
Dilution:	1.0			Initial Weight/Volume:	10 g
Date Analyzed:	09/29/2009 2121			Final Weight/Volume:	400 mL
Date Prepared:	09/29/2009 1454				

Analyte	DryWt Corrected: N	Result (ug/Kg)	Qualifier	MDL	RL
Dichlorodifluoromethane		ND	H UJ	8.0	40
Chloromethane		ND	H	60	400
Vinyl chloride		ND	H	1.7	8.0
Bromomethane		ND	H	25	140
Chloroethane		ND	H	23	400
Trichlorofluoromethane		ND	H	5.0	40
1,1-Dichloroethene		ND	H	5.0	20
Methylene Chloride		7.9	H J	3.8	40
trans-1,2-Dichloroethene		ND	H UJ	3.5	40
1,1-Dichloroethane		ND	H	3.8	40
2,2-Dichloropropane		ND	H	3.7	40
cis-1,2-Dichloroethene		ND	H	2.4	40
Chlorobromomethane		ND	H	12	40
Chloroform		ND	H	2.1	40
1,1,1-Trichloroethane		ND	H	5.0	40
Carbon tetrachloride		ND	H	3.7	20
1,1-Dichloropropene		ND	H	1.8	40
Benzene		ND	H	2.5	16
1,2-Dichloroethane		ND	H	2.2	40
Trichloroethene		ND	H	3.4	16
1,2-Dichloropropane		ND	H	3.9	12
Dibromomethane		ND	H	4.0	40
Dichlorobromomethane		ND	H	3.0	40
cis-1,3-Dichloropropene		ND	H	2.4	16
Toluene		ND	H	2.4	40
trans-1,3-Dichloropropene		ND	H	4.0	16
1,1,2-Trichloroethane		ND	H	1.8	12
Tetrachloroethene		ND	H	2.1	20
1,3-Dichloropropane		ND	H	5.0	40
Chlorodibromomethane		ND	H	8.0	40
Ethylene Dibromide		ND	H	3.2	40
Chlorobenzene		ND	H	2.3	40
Ethylbenzene		ND	H	3.7	40
1,1,1,2-Tetrachloroethane		ND	H	4.8	40
1,1,2,2-Tetrachloroethane		ND	H	3.3	10
m-Xylene & p-Xylene		ND	H	7.8	40
o-Xylene		ND	H	2.3	40
Styrene		ND	H	3.8	40
Bromoform		ND	H	11	40
Isopropylbenzene		ND	H	1.8	40
Bromobenzene		ND	H	2.7	40
N-Propylbenzene		ND	H	2.8	40
1,2,3-Trichloropropane		ND	H	12	40
2-Chlorotoluene		ND	H	5.4	40
1,3,5-Trimethylbenzene		4.4	H J	4.2	40
4-Chlorotoluene		ND	H UJ	13	40

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-19**

Lab Sample ID: 580-15385-19TB
Client Matrix: Solid

Date Sampled: 09/08/2009 0000
Date Received: 09/11/2009 0940

8260B Volatile Organic Compounds (GC/MS)

Method:	8260B	Analysis Batch: 580-51100		Instrument ID:	TAC043
Preparation:	5035	Prep Batch: 580-51093		Lab File ID:	VB00118435.D
Dilution:	1.0			Initial Weight/Volume:	10 g
Date Analyzed:	09/29/2009 2121			Final Weight/Volume:	400 mL
Date Prepared:	09/29/2009 1454				

Analyte	DryWt Corrected: N	Result (ug/Kg)	Qualifier	MDL	RL
tert-Butylbenzene		ND	H UJ	3.2	40
1,2,4-Trimethylbenzene		ND	H	2.1	40
sec-Butylbenzene		ND	H	5.0	40
1,3-Dichlorobenzene		ND	H	5.0	40
4-Isopropyltoluene		ND	H	2.8	40
1,4-Dichlorobenzene		ND	H	5.0	40
n-Butylbenzene		21	J H J	7.3	40
1,2-Dichlorobenzene		ND	H UJ	2.6	40
1,2-Dibromo-3-Chloropropane		ND	H UJ	66	200
1,2,4-Trichlorobenzene		33	J H J	5.0	40
1,2,3-Trichlorobenzene		73	H UJ	5.0	40
Hexachlorobutadiene		120	H	5.6	40
Naphthalene		ND	H	6.0	40

Surrogate	%Rec	Qualifier	Acceptance Limits
Fluorobenzene (Surr)	105		75 - 125
Toluene-d8 (Surr)	99		85 - 115
Ethylbenzene-d10	105		75 - 125
4-Bromofluorobenzene (Surr)	100		85 - 120
Trifluorotoluene (Surr)	88		75 - 125

Estimated Qualifier (J/UJ) applied due to exceedance of Hold Time

TR

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-01 G-RS1-SED 4

Lab Sample ID: 580-15385-1

Client Matrix: Solid

% Moisture: 18.6

Date Sampled: 09/07/2009 1350

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15235.D
Dilution:	10			Initial Weight/Volume:	20.6970 g
Date Analyzed:	09/18/2009 0942			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0088	0.12
Bis(2-chloroethyl)ether		ND		0.012	0.12
2-Chlorophenol		ND		0.0088	0.12
1,3-Dichlorobenzene		ND UJ		0.0085	0.059
1,4-Dichlorobenzene		ND		0.0038	0.059
Benzyl alcohol		ND		0.011	0.12
1,2-Dichlorobenzene		ND		0.0076	0.059
2-Methylphenol		ND		0.0084	0.12
3 & 4 Methylphenol		ND		0.0066	0.24
N-Nitrosodi-n-propylamine		ND		0.012	0.12
Hexachloroethane		ND		0.013	0.12
Nitrobenzene		ND		0.034	0.12
Isophorone		ND		0.0049	0.12
2-Nitrophenol		ND UJ		0.0051	0.12
2,4-Dimethylphenol		ND		0.0025	0.12
Benzoic acid		ND		0.77	3.0
Bis(2-chloroethoxy)methane		ND		0.0036	0.12
2,4-Dichlorophenol		ND		0.0036	0.12
1,2,4-Trichlorobenzene		ND		0.014	0.059
Naphthalene		0.019	J	0.0026	0.024
4-Chloroaniline		ND		0.013	0.12
Hexachlorobutadiene		ND		0.011	0.059
4-Chloro-3-methylphenol		ND		0.0084	0.12
2-Methylnaphthalene		0.021	J	0.0027	0.024
Hexachlorocyclopentadiene		ND UJ		0.0031	0.12
2,4,6-Trichlorophenol		ND		0.0047	0.18
2,4,5-Trichlorophenol		ND		0.0051	0.12
2-Chloronaphthalene		ND		0.0021	0.024
2-Nitroaniline		ND		0.0050	0.12
Dimethyl phthalate		ND		0.0050	0.12
Acenaphthylene		ND		0.0019	0.024
2,6-Dinitrotoluene		ND		0.0049	0.12
3-Nitroaniline		ND		0.0069	0.12
Acenaphthene		ND		0.0019	0.024
2,4-Dinitrophenol		ND UJ		0.017	1.2
4-Nitrophenol		ND		0.20	1.2
Dibenzofuran		0.015	J	0.0018	0.12
2,4-Dinitrotoluene		ND		0.0030	0.12
Diethyl phthalate		ND		0.018	0.12
4-Chlorophenyl phenyl ether		ND		0.0068	0.12
Fluorene		ND		0.0014	0.024
4-Nitroaniline		ND		0.017	0.12
4,6-Dinitro-2-methylphenol		ND		0.021	1.2
N-Nitrosodiphenylamine		ND		0.0026	0.059
4-Bromophenyl phenyl ether		ND		0.0039	0.12
Hexachlorobenzene		ND		0.0045	0.059

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-01

Lab Sample ID: 580-15385-1
Client Matrix: Solid

% Moisture: 18.6

Date Sampled: 09/07/2009 1350
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15235.D
Dilution:	10		Initial Weight/Volume: 20.6970 g
Date Analyzed:	09/18/2009 0942		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.014	0.12
Phenanthrene		0.040		0.0025	0.024
Anthracene		0.014	J	0.0017	0.024
Di-n-butyl phthalate		ND		0.031	0.24
Fluoranthene		0.040	*	0.0014	0.024
Pyrene		0.047		0.0017	0.024
Butyl benzyl phthalate		ND		0.037	0.12
3,3'-Dichlorobenzidine		ND		0.0094	0.24
Benzo[a]anthracene		0.012	J	0.0020	0.030
Chrysene		0.029	J	0.0017	0.030
Bis(2-ethylhexyl) phthalate		ND		0.050	1.8
Di-n-octyl phthalate		ND		0.0015	0.24
Benzo[a]pyrene		ND		0.0025	0.036
Indeno[1,2,3-cd]pyrene		0.035	J	0.0050	0.047
Dibenz(a,h)anthracene		ND		0.0026	0.047
Benzo[g,h,i]perylene		0.022	J	0.0018	0.030
Carbazole		ND		0.0051	0.18
1-Methylnaphthalene		0.0086	J	0.0021	0.036
Benzo[b]fluoranthene		ND		0.0049	0.024
Benzo[k]fluoranthene		ND		0.0015	0.030
2,2'-oxybis[1-chloropropane]		ND		0.0080	0.18

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	74		36 - 145
Phenol-d5	82		38 - 149
Nitrobenzene-d5	68		38 - 141
2-Fluorobiphenyl	76		42 - 140
2,4,6-Tribromophenol	96		28 - 143
Terphenyl-d14	96		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-02** G-RS1-SED Ø

Lab Sample ID: 580-15385-2

Client Matrix: Solid

% Moisture: 31.0

Date Sampled: 09/07/2009 1355

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15236.D
Dilution:	10			Initial Weight/Volume:	20.2421 g
Date Analyzed:	09/18/2009 1002			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.011	0.14
Bis(2-chloroethyl)ether		ND		0.014	0.14
2-Chlorophenol		ND		0.011	0.14
1,3-Dichlorobenzene		ND UJ		0.010	0.072
1,4-Dichlorobenzene		ND		0.0046	0.072
Benzyl alcohol		ND		0.014	0.14
1,2-Dichlorobenzene		ND		0.0092	0.072
2-Methylphenol		ND		0.010	0.14
3 & 4 Methylphenol		ND		0.0080	0.29
N-Nitrosodi-n-propylamine		ND		0.014	0.14
Hexachloroethane		ND		0.016	0.14
Nitrobenzene		ND		0.042	0.14
Isophorone		ND		0.0059	0.14
2-Nitrophenol		ND UJ		0.0062	0.14
2,4-Dimethylphenol		ND		0.0030	0.14
Benzoic acid		ND		0.93	3.6
Bis(2-chloroethoxy)methane		ND		0.0043	0.14
2,4-Dichlorophenol		ND		0.0043	0.14
1,2,4-Trichlorobenzene		ND		0.017	0.072
Naphthalene		ND		0.0032	0.029
4-Chloroaniline		ND		0.016	0.14
Hexachlorobutadiene		ND		0.013	0.072
4-Chloro-3-methylphenol		ND		0.010	0.14
2-Methylnaphthalene		0.0069	J	0.0033	0.029
Hexachlorocyclopentadiene		ND UJ		0.0037	0.14
2,4,6-Trichlorophenol		ND		0.0057	0.21
2,4,5-Trichlorophenol		ND		0.0062	0.14
2-Chloronaphthalene		ND		0.0026	0.029
2-Nitroaniline		ND		0.0060	0.14
Dimethyl phthalate		ND		0.0060	0.14
Acenaphthylene		ND		0.0023	0.029
2,6-Dinitrotoluene		ND		0.0059	0.14
3-Nitroaniline		ND		0.0083	0.14
Acenaphthene		ND		0.0023	0.029
2,4-Dinitrophenol		ND UJ		0.020	1.4
4-Nitrophenol		ND		0.24	1.4
Dibenzofuran		ND		0.0021	0.14
2,4-Dinitrotoluene		ND		0.0036	0.14
Diethyl phthalate		ND		0.021	0.14
4-Chlorophenyl phenyl ether		ND		0.0082	0.14
Fluorene		ND		0.0017	0.029
4-Nitroaniline		ND		0.020	0.14
4,6-Dinitro-2-methylphenol		ND		0.026	1.4
N-Nitrosodiphenylamine		ND		0.0032	0.072
4-Bromophenyl phenyl ether		ND		0.0047	0.14
Hexachlorobenzene		ND		0.0054	0.072

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-02

Lab Sample ID: 580-15385-2
Client Matrix: Solid

% Moisture: 31.0

Date Sampled: 09/07/2009 1355
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15236.D
Dilution:	10		Initial Weight/Volume: 20.2421 g
Date Analyzed:	09/18/2009 1002		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.017	0.14
Phenanthrene		0.017	J	0.0030	0.029
Anthracene		0.0078	J	0.0020	0.029
Di-n-butyl phthalate		ND		0.037	0.29
Fluoranthene		0.016	J *	0.0017	0.029
Pyrene		0.013	J	0.0020	0.029
Butyl benzyl phthalate		ND		0.044	0.14
3,3'-Dichlorobenzidine		ND		0.011	0.29
Benzo[a]anthracene		0.040		0.0024	0.036
Chrysene		0.0098	J	0.0020	0.036
Bis(2-ethylhexyl) phthalate		ND		0.060	2.1
Di-n-octyl phthalate		ND		0.0019	0.29
Benzo[a]pyrene		0.0066	J	0.0030	0.043
Indeno[1,2,3-cd]pyrene		0.024	J	0.0060	0.057
Dibenz(a,h)anthracene		ND		0.0032	0.057
Benzo[g,h,i]perylene		ND		0.0021	0.036
Carbazole		ND		0.0062	0.21
1-Methylnaphthalene		ND		0.0026	0.043
Benzo[b]fluoranthene		ND		0.0059	0.029
Benzo[k]fluoranthene		ND		0.0019	0.036
2,2'-oxybis[1-chloropropane]		ND		0.0096	0.21

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	73		36 - 145
Phenol-d5	80		38 - 149
Nitrobenzene-d5	65		38 - 141
2-Fluorobiphenyl	43		42 - 140
2,4,6-Tribromophenol	55		28 - 143
Terphenyl-d14	79		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-05** G-RS7SED Ø

Lab Sample ID: 580-15385-5

Client Matrix: Solid

% Moisture: 30.8

Date Sampled: 09/07/2009 1530

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15239.D
Dilution:	1.0			Initial Weight/Volume:	20.0088 g
Date Analyzed:	09/18/2009 1104			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0011	0.014
Bis(2-chloroethyl)ether		ND		0.0014	0.014
2-Chlorophenol		ND		0.0011	0.014
1,3-Dichlorobenzene		ND UJ		0.0010	0.0072
1,4-Dichlorobenzene		ND		0.00046	0.0072
Benzyl alcohol		ND		0.0014	0.014
1,2-Dichlorobenzene		ND		0.00093	0.0072
2-Methylphenol		ND		0.0010	0.014
3 & 4 Methylphenol		0.0071	J	0.00081	0.029
N-Nitrosodi-n-propylamine		ND		0.0014	0.014
Hexachloroethane		ND		0.0016	0.014
Nitrobenzene		ND		0.0042	0.014
Isophorone		ND		0.00059	0.014
2-Nitrophenol		ND UJ		0.00062	0.014
2,4-Dimethylphenol		ND		0.00030	0.014
Benzoic acid		ND		0.094	0.36
Bis(2-chloroethoxy)methane		ND		0.00043	0.014
2,4-Dichlorophenol		ND		0.00043	0.014
1,2,4-Trichlorobenzene		ND		0.0017	0.0072
Naphthalene		ND		0.00032	0.0029
4-Chloroaniline		ND		0.0016	0.014
Hexachlorobutadiene		ND		0.0013	0.0072
4-Chloro-3-methylphenol		ND		0.0010	0.014
2-Methylnaphthalene		0.00044	J	0.00033	0.0029
Hexachlorocyclopentadiene		ND UJ		0.00038	0.014
2,4,6-Trichlorophenol		ND		0.00058	0.022
2,4,5-Trichlorophenol		ND		0.00062	0.014
2-Chloronaphthalene		ND		0.00026	0.0029
2-Nitroaniline		ND		0.00061	0.014
Dimethyl phthalate		ND		0.00061	0.014
Acenaphthylene		ND		0.00023	0.0029
2,6-Dinitrotoluene		ND		0.00059	0.014
3-Nitroaniline		ND		0.00084	0.014
Acenaphthene		ND		0.00023	0.0029
2,4-Dinitrophenol		ND UJ		0.0020	0.14
4-Nitrophenol		ND		0.025	0.14
Dibenzofuran		ND		0.00022	0.014
2,4-Dinitrotoluene		ND		0.00036	0.014
Diethyl phthalate		~~0.0081~~	~~JB~~	0.0022	0.014 U
4-Chlorophenyl phenyl ether		ND		0.00082	0.014
Fluorene		ND		0.00017	0.0029
4-Nitroaniline		ND		0.0020	0.014
4,6-Dinitro-2-methylphenol		ND		0.0026	0.14
N-Nitrosodiphenylamine		ND		0.00032	0.0072
4-Bromophenyl phenyl ether		ND		0.00048	0.014
Hexachlorobenzene		ND		0.00055	0.0072

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-05

Lab Sample ID: 580-15385-5
Client Matrix: Solid

% Moisture: 30.8

Date Sampled: 09/07/2009 1530
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15239.D
Dilution:	1.0		Initial Weight/Volume: 20.0088 g
Date Analyzed:	09/18/2009 1104		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0017	0.014
Phenanthrene		0.0081		0.00030	0.0029
Anthracene		0.0012	J	0.00020	0.0029
Di-n-butyl phthalate		~~0.011~~	~~JB~~	0.0038	0.029 U
Fluoranthene		0.014	*	0.00017	0.0029
Pyrene		0.012		0.00020	0.0029
Butyl benzyl phthalate		ND		0.0045	0.014
3,3'-Dichlorobenzidine		ND		0.0011	0.029
Benzo[a]anthracene		0.0022	J	0.00025	0.0036
Chrysene		0.0054		0.00020	0.0036
Bis(2-ethylhexyl) phthalate		ND		0.0061	0.22
Di-n-octyl phthalate		ND		0.00019	0.029
Benzo[a]pyrene		ND		0.00030	0.0043
Indeno[1,2,3-cd]pyrene		ND		0.00061	0.0058
Dibenz(a,h)anthracene		ND		0.00032	0.0058
Benzo[g,h,i]perylene		ND		0.00022	0.0036
Carbazole		ND		0.00062	0.022
1-Methylnaphthalene		ND		0.00026	0.0043
Benzo[b]fluoranthene		0.0024	J	0.00059	0.0029
Benzo[k]fluoranthene		ND		0.00019	0.0036
2,2'-oxybis[1-chloropropane]		ND		0.00097	0.022

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	76		36 - 145
Phenol-d5	80		38 - 149
Nitrobenzene-d5	57		38 - 141
2-Fluorobiphenyl	29	X	42 - 140
2,4,6-Tribromophenol	66		28 - 143
Terphenyl-d14	65		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-06** G-RS7-SED 4

Lab Sample ID: 580-15385-6

Client Matrix: Solid

% Moisture: 18.2

Date Sampled: 09/07/2009 1525

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15255.D
Dilution:	1.0		Initial Weight/Volume: 20.4306 g
Date Analyzed:	09/18/2009 1633		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.00089	0.012
Bis(2-chloroethyl)ether		ND		0.0012	0.012
2-Chlorophenol		ND		0.00089	0.012
1,3-Dichlorobenzene		ND UJ		0.00086	0.0060
1,4-Dichlorobenzene		ND		0.00038	0.0060
Benzyl alcohol		ND		0.0011	0.012
1,2-Dichlorobenzene		ND		0.00077	0.0060
2-Methylphenol		ND		0.00085	0.012
3 & 4 Methylphenol		ND		0.00067	0.024
N-Nitrosodi-n-propylamine		ND		0.0012	0.012
Hexachloroethane		ND		0.0013	0.012
Nitrobenzene		ND		0.0035	0.012
Isophorone		ND		0.00049	0.012
2-Nitrophenol		ND UJ		0.00051	0.012
2,4-Dimethylphenol		ND		0.00025	0.012
Benzoic acid		ND		0.078	0.30
Bis(2-chloroethoxy)methane		ND		0.00036	0.012
2,4-Dichlorophenol		ND		0.00036	0.012
1,2,4-Trichlorobenzene		ND		0.0014	0.0060
Naphthalene		ND		0.00026	0.0024
4-Chloroaniline		ND		0.0013	0.012
Hexachlorobutadiene		ND		0.0011	0.0060
4-Chloro-3-methylphenol		ND		0.00085	0.012
2-Methylnaphthalene		0.00035	J	0.00028	0.0024
Hexachlorocyclopentadiene		ND UJ		0.00031	0.012
2,4,6-Trichlorophenol		ND		0.00048	0.018
2,4,5-Trichlorophenol		ND		0.00051	0.012
2-Chloronaphthalene		ND		0.00022	0.0024
2-Nitroaniline		ND		0.00050	0.012
Dimethyl phthalate		ND		0.00050	0.012
Acenaphthylene		ND		0.00019	0.0024
2,6-Dinitrotoluene		ND		0.00049	0.012
3-Nitroaniline		ND		0.00069	0.012
Acenaphthene		ND		0.00019	0.0024
2,4-Dinitrophenol		ND UJ		0.0017	0.12
4-Nitrophenol		ND		0.020	0.12
Dibenzofuran		ND		0.00018	0.012
2,4-Dinitrotoluene		ND		0.00030	0.012
Diethyl phthalate		~~0.0040~~	~~JB~~	0.0018	0.012 U
4-Chlorophenyl phenyl ether		ND		0.00068	0.012
Fluorene		ND		0.00014	0.0024
4-Nitroaniline		ND		0.0017	0.012
4,6-Dinitro-2-methylphenol		ND		0.0022	0.12
N-Nitrosodiphenylamine		ND		0.00026	0.0060
4-Bromophenyl phenyl ether		ND		0.00039	0.012
Hexachlorobenzene		ND		0.00045	0.0060

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-06**

Lab Sample ID: 580-15385-6
Client Matrix: Solid

% Moisture: 18.2

Date Sampled: 09/07/2009 1525
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15255.D
Dilution:	1.0		Initial Weight/Volume: 20.4306 g
Date Analyzed:	09/18/2009 1633		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0014	0.012
Phenanthrene		0.00053	J	0.00025	0.0024
Anthracene		0.00036	J	0.00017	0.0024
Di-n-butyl phthalate		~~0.015~~	~~J B~~	0.0031	0.024 U
Fluoranthene		0.00036	J *	0.00014	0.0024
Pyrene		0.00072	J	0.00017	0.0024
Butyl benzyl phthalate		ND		0.0037	0.012
3,3'-Dichlorobenzidine		ND		0.00094	0.024
Benzo[a]anthracene		0.00066	J	0.00020	0.0030
Chrysene		ND		0.00017	0.0030
Bis(2-ethylhexyl) phthalate		ND		0.0050	0.18
Di-n-octyl phthalate		ND		0.00016	0.024
Benzo[a]pyrene		ND		0.00025	0.0036
Indeno[1,2,3-cd]pyrene		ND		0.00050	0.0048
Dibenz(a,h)anthracene		ND		0.00026	0.0048
Benzo[g,h,i]perylene		ND		0.00018	0.0030
Carbazole		ND		0.00051	0.018
1-Methylnaphthalene		ND		0.00022	0.0036
Benzo[b]fluoranthene		ND		0.00049	0.0024
Benzo[k]fluoranthene		ND		0.00016	0.0030
2,2'-oxybis[1-chloropropane]		ND		0.00080	0.018

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	53		36 - 145
Phenol-d5	70		38 - 149
Nitrobenzene-d5	40		38 - 141
2-Fluorobiphenyl	53		42 - 140
2,4,6-Tribromophenol	70		28 - 143
Terphenyl-d14	102		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-04 G-RS8-SED Ø

Lab Sample ID: 580-15385-4

Client Matrix: Solid

% Moisture: 33.1

Date Sampled: 09/07/2009 1450

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15238.D
Dilution:	1.0			Initial Weight/Volume:	20.3292 g
Date Analyzed:	09/18/2009 1044			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0011	0.015
Bis(2-chloroethyl)ether		ND		0.0015	0.015
2-Chlorophenol		ND		0.0011	0.015
1,3-Dichlorobenzene		ND UJ		0.0011	0.0074
1,4-Dichlorobenzene		ND		0.00047	0.0074
Benzyl alcohol		0.0017	J	0.0014	0.015
1,2-Dichlorobenzene		ND		0.00094	0.0074
2-Methylphenol		ND		0.0010	0.015
3 & 4 Methylphenol		ND		0.00082	0.029
N-Nitrosodi-n-propylamine		ND		0.0014	0.015
Hexachloroethane		ND		0.0016	0.015
Nitrobenzene		ND		0.0043	0.015
Isophorone		ND		0.00060	0.015
2-Nitrophenol		ND UJ		0.00063	0.015
2,4-Dimethylphenol		ND		0.00031	0.015
Benzoic acid		ND		0.096	0.37
Bis(2-chloroethoxy)methane		ND		0.00044	0.015
2,4-Dichlorophenol		ND		0.00044	0.015
1,2,4-Trichlorobenzene		ND		0.0018	0.0074
Naphthalene		ND		0.00032	0.0029
4-Chloroaniline		ND		0.0016	0.015
Hexachlorobutadiene		ND		0.0013	0.0074
4-Chloro-3-methylphenol		ND		0.0010	0.015
2-Methylnaphthalene		ND		0.00034	0.0029
Hexachlorocyclopentadiene		ND UJ		0.00038	0.015
2,4,6-Trichlorophenol		ND		0.00059	0.022
2,4,5-Trichlorophenol		ND		0.00063	0.015
2-Chloronaphthalene		ND		0.00026	0.0029
2-Nitroaniline		ND		0.00062	0.015
Dimethyl phthalate		ND		0.00062	0.015
Acenaphthylene		ND		0.00024	0.0029
2,6-Dinitrotoluene		ND		0.00060	0.015
3-Nitroaniline		ND		0.00085	0.015
Acenaphthene		ND		0.00024	0.0029
2,4-Dinitrophenol		ND UJ		0.0021	0.15
4-Nitrophenol		ND		0.025	0.15
Dibenzofuran		ND		0.00022	0.015
2,4-Dinitrotoluene		ND		0.00037	0.015
Diethyl phthalate		~~0.0048~~	~~JB~~	0.0022	0.015 U
4-Chlorophenyl phenyl ether		ND		0.00084	0.015
Fluorene		ND		0.00018	0.0029
4-Nitroaniline		ND		0.0021	0.015
4,6-Dinitro-2-methylphenol		ND		0.0026	0.15
N-Nitrosodiphenylamine		ND		0.00032	0.0074
4-Bromophenyl phenyl ether		ND		0.00049	0.015
Hexachlorobenzene		ND		0.00056	0.0074

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-04**

Lab Sample ID: 580-15385-4
Client Matrix: Solid
% Moisture: 33.1

Date Sampled: 09/07/2009 1450
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15238.D
Dilution:	1.0		Initial Weight/Volume: 20.3292 g
Date Analyzed:	09/18/2009 1044		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0018	0.015
Phenanthrene		ND		0.00031	0.0029
Anthracene		ND		0.00021	0.0029
Di-n-butyl phthalate		~~0.011~~	~~JB~~	0.0038	0.029 U
Fluoranthene		0.0011	J *	0.00018	0.0029
Pyrene		0.0010	J	0.00021	0.0029
Butyl benzyl phthalate		ND		0.0046	0.015
3,3'-Dichlorobenzidine		ND		0.0012	0.029
Benzo[a]anthracene		0.00087	J	0.00025	0.0037
Chrysene		ND		0.00021	0.0037
Bis(2-ethylhexyl) phthalate		ND		0.0062	0.22
Di-n-octyl phthalate		ND		0.00019	0.029
Benzo[a]pyrene		ND		0.00031	0.0044
Indeno[1,2,3-cd]pyrene		ND		0.00062	0.0059
Dibenz(a,h)anthracene		ND		0.00032	0.0059
Benzo[g,h,i]perylene		ND		0.00022	0.0037
Carbazole		ND		0.00063	0.022
1-Methylnaphthalene		ND		0.00026	0.0044
Benzo[b]fluoranthene		ND		0.00060	0.0029
Benzo[k]fluoranthene		ND		0.00019	0.0037
2,2'-oxybis[1-chloropropane]		ND		0.00099	0.022

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	70		36 - 145
Phenol-d5	74		38 - 149
Nitrobenzene-d5	56		38 - 141
2-Fluorobiphenyl	22	X	42 - 140
2,4,6-Tribromophenol	51		28 - 143
Terphenyl-d14	52		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

G-RS8-SE03

Client Sample ID: **SSI0049-03**

Lab Sample ID: 580-15385-3

Client Matrix: Solid

% Moisture: 17.4

Date Sampled: 09/07/2009 1445

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15237.D
Dilution:	1.0			Initial Weight/Volume:	20.7951 g
Date Analyzed:	09/18/2009 1023			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.00086	0.012
Bis(2-chloroethyl)ether		ND		0.0012	0.012
2-Chlorophenol		ND		0.00086	0.012
1,3-Dichlorobenzene		ND UJ		0.00084	0.0058
1,4-Dichlorobenzene		ND		0.00037	0.0058
Benzyl alcohol		ND		0.0011	0.012
1,2-Dichlorobenzene		ND		0.00075	0.0058
2-Methylphenol		ND		0.00083	0.012
3 & 4 Methylphenol		ND		0.00065	0.023
N-Nitrosodi-n-propylamine		ND		0.0011	0.012
Hexachloroethane		ND		0.0013	0.012
Nitrobenzene		ND		0.0034	0.012
Isophorone		ND		0.00048	0.012
2-Nitrophenol		ND UJ		0.00050	0.012
2,4-Dimethylphenol		ND		0.00024	0.012
Benzoic acid		ND		0.076	0.29
Bis(2-chloroethoxy)methane		ND		0.00035	0.012
2,4-Dichlorophenol		ND		0.00035	0.012
1,2,4-Trichlorobenzene		ND		0.0014	0.0058
Naphthalene		0.00048	J	0.00026	0.0023
4-Chloroaniline		ND		0.0013	0.012
Hexachlorobutadiene		ND		0.0011	0.0058
4-Chloro-3-methylphenol		ND		0.00083	0.012
2-Methylnaphthalene		0.00071	J	0.00027	0.0023
Hexachlorocyclopentadiene		ND UJ		0.00030	0.012
2,4,6-Trichlorophenol		ND		0.00047	0.017
2,4,5-Trichlorophenol		ND		0.00050	0.012
2-Chloronaphthalene		ND		0.00021	0.0023
2-Nitroaniline		ND		0.00049	0.012
Dimethyl phthalate		ND		0.00049	0.012
Acenaphthylene		ND		0.00019	0.0023
2,6-Dinitrotoluene		ND		0.00048	0.012
3-Nitroaniline		ND		0.00068	0.012
Acenaphthene		ND		0.00019	0.0023
2,4-Dinitrophenol		ND UJ		0.0016	0.12
4-Nitrophenol		ND ~~UJ~~		0.020	0.12
Dibenzofuran		ND		0.00017	0.012
2,4-Dinitrotoluene		ND		0.00029	0.012
Diethyl phthalate		~~0.0030~~	~~JB~~	0.0017	0.012 U
4-Chlorophenyl phenyl ether		ND		0.00066	0.012
Fluorene		ND		0.00014	0.0023
4-Nitroaniline		ND		0.0016	0.012
4,6-Dinitro-2-methylphenol		ND		0.0021	0.12
N-Nitrosodiphenylamine		ND		0.00026	0.0058
4-Bromophenyl phenyl ether		ND		0.00038	0.012
Hexachlorobenzene		ND		0.00044	0.0058

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-03**

Lab Sample ID: 580-15385-3
Client Matrix: Solid

% Moisture: 17.4

Date Sampled: 09/07/2009 1445
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15237.D
Dilution:	1.0		Initial Weight/Volume: 20.7951 g
Date Analyzed:	09/18/2009 1023		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0014	0.012
Phenanthrene		ND		0.00024	0.0023
Anthracene		ND		0.00016	0.0023
Di-n-butyl phthalate		~~0.011~~	~~JB~~	0.0030	0.023 U
Fluoranthene		0.00066	J *	0.00014	0.0023
Pyrene		0.00078	J	0.00016	0.0023
Butyl benzyl phthalate		ND		0.0036	0.012
3,3'-Dichlorobenzidine		ND		0.00092	0.023
Benzo[a]anthracene		ND		0.00020	0.0029
Chrysene		ND		0.00016	0.0029
Bis(2-ethylhexyl) phthalate		ND		0.0049	0.17
Di-n-octyl phthalate		ND		0.00015	0.023
Benzo[a]pyrene		ND		0.00024	0.0035
Indeno[1,2,3-cd]pyrene		ND		0.00049	0.0047
Dibenz(a,h)anthracene		ND		0.00026	0.0047
Benzo[g,h,i]perylene		ND		0.00017	0.0029
Carbazole		0.00075	J	0.00050	0.017
1-Methylnaphthalene		0.00027	J	0.00021	0.0035
Benzo[b]fluoranthene		ND		0.00048	0.0023
Benzo[k]fluoranthene		ND		0.00015	0.0029
2,2'-oxybis[1-chloropropane]		ND		0.00078	0.017

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	74		36 - 145
Phenol-d5	80		38 - 149
Nitrobenzene-d5	62		38 - 141
2-Fluorobiphenyl	31	X	42 - 140
2,4,6-Tribromophenol	86		28 - 143
Terphenyl-d14	83		42 - 151

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-RS1SED-4-090709	SSI0049-01	Soil	09/07/09 13:50	09/09/09 09:30
G-RS1SED-0-090709	SSI0049-02	Soil	09/07/09 13:55	09/09/09 09:30
G-RS8SED-3-090709	SSI0049-03	Soil	09/07/09 14:45	09/09/09 09:30
G-RS8SED-0-090709	SSI0049-04	Soil	09/07/09 14:50	09/09/09 09:30
G-RS7SED-0-090709	SSI0049-05	Soil	09/07/09 15:30	09/09/09 09:30
G-RS7SED-4-090709	SSI0049-06	Soil	09/07/09 15:25	09/09/09 09:30
G-RS2SED-3-090709	SSI0049-07	Soil	09/07/09 16:15	09/09/09 09:30
G-RS2SED-0-090709	SSI0049-08	Soil	09/07/09 16:20	09/09/09 09:30
G-EB-090709	SSI0049-09	Water	09/07/09 17:00	09/09/09 09:30
G-RS5SED-0-090809	SSI0049-10	Soil	09/08/09 08:30	09/09/09 09:30
G-RS5DSED-0-090809	SSI0049-11	Soil	09/08/09 08:35	09/09/09 09:30
G-RS5SED-4-090809	SSI0049-12	Soil	09/08/09 08:45	09/09/09 09:30
G-RS6SED-0-090809	SSI0049-13	Soil	09/08/09 07:40	09/09/09 09:30
G-RS6SED-3-090809	SSI0049-14	Soil	09/08/09 07:35	09/09/09 09:30
G-RS3SED-4-090809	SSI0049-15	Soil	09/08/09 11:15	09/09/09 09:30
G-RS3SED-0-090809	SSI0049-16	Soil	09/08/09 11:10	09/09/09 09:30
G-RS4SED-0-090809	SSI0049-17	Soil	09/08/09 12:20	09/09/09 09:30
G-RS4SED-4-090809	SSI0049-18	Soil	09/08/09 12:25	09/09/09 09:30
TRIP BLANK	SSI0049-19	Soil	09/08/09 00:00	09/09/09 09:30

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-07** G-RS2-SED3

Lab Sample ID: 580-15385-7

Client Matrix: Solid

% Moisture: 22.1

Date Sampled: 09/07/2009 1615

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12254.D
Dilution:	1.0			Initial Weight/Volume:	20.2776 g
Date Analyzed:	09/22/2009 1401			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		0.0021	J	0.00094	0.013
Bis(2-chloroethyl)ether		ND		0.0013	0.013
2-Chlorophenol		ND		0.00094	0.013
1,3-Dichlorobenzene		ND UJ		0.00091	0.0063
1,4-Dichlorobenzene		ND		0.00041	0.0063
Benzyl alcohol		ND		0.0012	0.013
1,2-Dichlorobenzene		ND		0.00081	0.0063
2-Methylphenol		ND		0.00090	0.013
3 & 4 Methylphenol		ND		0.00071	0.025
N-Nitrosodi-n-propylamine		ND		0.0012	0.013
Hexachloroethane		ND		0.0014	0.013
Nitrobenzene		ND		0.0037	0.013
Isophorone		ND		0.00052	0.013
2-Nitrophenol		ND UJ		0.00054	0.013
2,4-Dimethylphenol		ND		0.00027	0.013
Benzoic acid		0.12	J	0.082	0.32
Bis(2-chloroethoxy)methane		ND		0.00038	0.013
2,4-Dichlorophenol		ND		0.00038	0.013
1,2,4-Trichlorobenzene		ND		0.0015	0.0063
Naphthalene		0.0050		0.00028	0.0025
4-Chloroaniline		ND		0.0014	0.013
Hexachlorobutadiene		ND		0.0012	0.0063
4-Chloro-3-methylphenol		ND		0.00090	0.013
2-Methylnaphthalene		0.011		0.00029	0.0025
Hexachlorocyclopentadiene		ND UJ		0.00033	0.013
2,4,6-Trichlorophenol		ND ~~UJ~~ TMB		0.00051	0.019
2,4,5-Trichlorophenol		ND		0.00054	0.013
2-Chloronaphthalene		0.0037		0.00023	0.0025
2-Nitroaniline		ND		0.00053	0.013
Dimethyl phthalate		ND		0.00053	0.013
Acenaphthylene		0.0046		0.00020	0.0025
2,6-Dinitrotoluene		ND		0.00052	0.013
3-Nitroaniline		ND		0.00073	0.013
Acenaphthene		ND		0.00020	0.0025
2,4-Dinitrophenol		ND UJ		0.0018	0.13
4-Nitrophenol		ND		0.022	0.13
Dibenzofuran		0.0030	J	0.00019	0.013
2,4-Dinitrotoluene		ND		0.00032	0.013
Diethyl phthalate		~~0.0041~~	~~J~~	0.0019	0.013 U
4-Chlorophenyl phenyl ether		ND		0.00072	0.013
Fluorene		ND		0.00015	0.0025
4-Nitroaniline		ND		0.0018	0.013
4,6-Dinitro-2-methylphenol		ND		0.0023	0.13
N-Nitrosodiphenylamine		ND		0.00028	0.0063
4-Bromophenyl phenyl ether		ND		0.00042	0.013
Hexachlorobenzene		ND		0.00048	0.0063

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-07**

Lab Sample ID: 580-15385-7
Client Matrix: Solid

% Moisture: 22.1

Date Sampled: 09/07/2009 1615
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12254.D
Dilution:	1.0		Initial Weight/Volume: 20.2776 g
Date Analyzed:	09/22/2009 1401		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0015	0.013
Phenanthrene		0.010		0.00027	0.0025
Anthracene		0.0057		0.00018	0.0025
Di-n-butyl phthalate		~~0.012~~	~~J~~	0.0033	0.025 U
Fluoranthene		0.0045		0.00015	0.0025
Pyrene		0.013		0.00018	0.0025
Butyl benzyl phthalate		ND		0.0039	0.013
3,3'-Dichlorobenzidine		ND		0.0010	0.025
Benzo[a]anthracene		0.0029	J	0.00022	0.0032
Chrysene		0.016		0.00018	0.0032
Bis(2-ethylhexyl) phthalate		0.0078	J	0.0053	0.19
Di-n-octyl phthalate		ND		0.00016	0.025
Benzo[a]pyrene		0.0064		0.00027	0.0038
Indeno[1,2,3-cd]pyrene		0.0064		0.00053	0.0051
Dibenz(a,h)anthracene		ND		0.00028	0.0051
Benzo[g,h,i]perylene		0.015		0.00019	0.0032
Carbazole		0.0023	J	0.00054	0.019
1-Methylnaphthalene		0.0056		0.00023	0.0038
Benzo[b]fluoranthene		0.013		0.00052	0.0025
Benzo[k]fluoranthene		0.0015	J	0.00016	0.0032
2,2'-oxybis[1-chloropropane]		ND		0.00085	0.019

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	64		36 - 145
Phenol-d5	75		38 - 149
Nitrobenzene-d5	51		38 - 141
2-Fluorobiphenyl	67		42 - 140
2,4,6-Tribromophenol	121		28 - 143
Terphenyl-d14	103		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-08** G-RS2-SED Ø

Lab Sample ID: 580-15385-8

Client Matrix: Solid

% Moisture: 29.1

Date Sampled: 09/07/2009 1620

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12255.D
Dilution:	1.0			Initial Weight/Volume:	20.3219 g
Date Analyzed:	09/22/2009 1421			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		0.0055	J	0.0010	0.014
Bis(2-chloroethyl)ether		ND		0.0014	0.014
2-Chlorophenol		ND		0.0010	0.014
1,3-Dichlorobenzene		ND UJ		0.0010	0.0069
1,4-Dichlorobenzene		ND		0.00044	0.0069
Benzyl alcohol		ND		0.0013	0.014
1,2-Dichlorobenzene		ND		0.00089	0.0069
2-Methylphenol		ND		0.00099	0.014
3 & 4 Methylphenol		0.0023	J	0.00078	0.028
N-Nitrosodi-n-propylamine		ND		0.0013	0.014
Hexachloroethane		ND		0.0015	0.014
Nitrobenzene		ND		0.0040	0.014
Isophorone		ND		0.00057	0.014
2-Nitrophenol		ND UJ		0.00060	0.014
2,4-Dimethylphenol		ND		0.00029	0.014
Benzoic acid		0.099	J	0.090	0.35
Bis(2-chloroethoxy)methane		ND		0.00042	0.014
2,4-Dichlorophenol		ND		0.00042	0.014
1,2,4-Trichlorobenzene		ND		0.0017	0.0069
Naphthalene		0.0068		0.00031	0.0028
4-Chloroaniline		ND		0.0015	0.014
Hexachlorobutadiene		ND		0.0013	0.0069
4-Chloro-3-methylphenol		ND		0.00099	0.014
2-Methylnaphthalene		0.019		0.00032	0.0028
Hexachlorocyclopentadiene		ND UJ		0.00036	0.014
2,4,6-Trichlorophenol		ND		0.00056	0.021
2,4,5-Trichlorophenol		ND		0.00060	0.014
2-Chloronaphthalene		0.0013	J	0.00025	0.0028
2-Nitroaniline		ND		0.00058	0.014
Dimethyl phthalate		ND		0.00058	0.014
Acenaphthylene		0.0025	J	0.00022	0.0028
2,6-Dinitrotoluene		ND		0.00057	0.014
3-Nitroaniline		ND		0.00080	0.014
Acenaphthene		0.0016	J	0.00022	0.0028
2,4-Dinitrophenol		ND UJ		0.0019	0.14
4-Nitrophenol		ND		0.024	0.14
Dibenzofuran		0.0032	J	0.00021	0.014
2,4-Dinitrotoluene		ND		0.00035	0.014
Diethyl phthalate		ND		0.0021	0.014
4-Chlorophenyl phenyl ether		ND		0.00079	0.014
Fluorene		ND		0.00017	0.0028
4-Nitroaniline		ND		0.0019	0.014
4,6-Dinitro-2-methylphenol		ND		0.0025	0.14
N-Nitrosodiphenylamine		ND		0.00031	0.0069
4-Bromophenyl phenyl ether		ND		0.00046	0.014
Hexachlorobenzene		ND		0.00053	0.0069

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-08**

Lab Sample ID: 580-15385-8
Client Matrix: Solid
% Moisture: 29.1

Date Sampled: 09/07/2009 1620
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12255.D
Dilution:	1.0		Initial Weight/Volume: 20.3219 g
Date Analyzed:	09/22/2009 1421		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0017	0.014
Phenanthrene		0.010		0.00029	0.0028
Anthracene		0.0034		0.00019	0.0028
Di-n-butyl phthalate		~~0.0099~~	~~J~~	0.0036	0.028 U
Fluoranthene		0.0065		0.00017	0.0028
Pyrene		0.010		0.00019	0.0028
Butyl benzyl phthalate		ND		0.0043	0.014
3,3'-Dichlorobenzidine		ND		0.0011	0.028
Benzo[a]anthracene		0.0034	J	0.00024	0.0035
Chrysene		0.0083		0.00019	0.0035
Bis(2-ethylhexyl) phthalate		ND		0.0058	0.21
Di-n-octyl phthalate		0.0018	J	0.00018	0.028
Benzo[a]pyrene		0.0052		0.00029	0.0042
Indeno[1,2,3-cd]pyrene		0.0043	J	0.00058	0.0056
Dibenz(a,h)anthracene		0.0017	J	0.00031	0.0056
Benzo[g,h,i]perylene		0.0074		0.00021	0.0035
Carbazole		0.0013	J	0.00060	0.021
1-Methylnaphthalene		0.0098		0.00025	0.0042
Benzo[b]fluoranthene		0.0069		0.00057	0.0028
Benzo[k]fluoranthene		0.0016	J	0.00018	0.0035
2,2'-oxybis[1-chloropropane]		ND		0.00093	0.021

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	83		36 - 145
Phenol-d5	83		38 - 149
Nitrobenzene-d5	60		38 - 141
2-Fluorobiphenyl	31	X	42 - 140
2,4,6-Tribromophenol	82		28 - 143
Terphenyl-d14	55		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-09** G-~~RS~~ EB

Lab Sample ID: 580-15385-9
Client Matrix: Water

Date Sampled: 09/07/2009 1700
Date Received: 09/11/2009 0940

8270C Semivolatile Organic Compounds (GC/MS SIM)

Method:	8270C	Analysis Batch: 580-50470		Instrument ID:	SEA016
Preparation:	3510C	Prep Batch: 580-50156		Lab File ID:	SE001015.D
Dilution:	1.0			Initial Weight/Volume:	1060 mL
Date Analyzed:	09/18/2009 0928			Final Weight/Volume:	1 mL
Date Prepared:	09/14/2009 0908			Injection Volume:	1 uL

Analyte	Result (ug/L)	Qualifier	MDL	RL
Naphthalene	0.014		0.0034	0.0094
2-Methylnaphthalene	0.0079	J	0.0028	0.012
1-Methylnaphthalene	0.0048	J B	0.0011	0.0094
Acenaphthylene	0.0013	J	0.0010	0.0094
Acenaphthene	0.018	B	0.00094	0.0094
Fluorene	0.0026	J B	0.0011	0.0094
Phenanthrene	0.0034	J	0.0010	0.0094
Anthracene	0.0012	J B	0.00075	0.0094
Fluoranthene	0.0026	J B	0.0015	0.0094
Pyrene	ND		0.0016	0.0094
Benzo[a]anthracene	ND		0.0023	0.0094
Chrysene	ND		0.0020	0.0094
Benzo[b]fluoranthene	ND		0.0025	0.0094
Benzo[k]fluoranthene	ND		0.0023	0.0094
Benzo[a]pyrene	ND		0.0018	0.019
Indeno[1,2,3-cd]pyrene	ND		0.0019	0.0094
Dibenz(a,h)anthracene	ND		0.0017	0.0094
Benzo[g,h,i]perylene	ND		0.0019	0.0094

Surrogate	%Rec	Qualifier	Acceptance Limits
Nitrobenzene-d5	80		40 - 110
2-Fluorobiphenyl	71		50 - 110
Terphenyl-d14	89		50 - 135

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-10** G-RS 5-SED-Ø

Lab Sample ID: 580-15385-10

Client Matrix: Solid

% Moisture: 29.7

Date Sampled: 09/08/2009 0830

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12256.D
Dilution:	1.0			Initial Weight/Volume:	20.4987 g
Date Analyzed:	09/22/2009 1442			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		0.0023	J	0.0010	0.014
Bis(2-chloroethyl)ether		ND		0.0014	0.014
2-Chlorophenol		ND		0.0010	0.014
1,3-Dichlorobenzene		ND UJ		0.0010	0.0069
1,4-Dichlorobenzene		ND		0.00044	0.0069
Benzyl alcohol		ND		0.0013	0.014
1,2-Dichlorobenzene		ND		0.00089	0.0069
2-Methylphenol		ND		0.00099	0.014
3 & 4 Methylphenol		0.0022	J	0.00078	0.028
N-Nitrosodi-n-propylamine		ND		0.0013	0.014
Hexachloroethane		ND		0.0015	0.014
Nitrobenzene		ND		0.0040	0.014
Isophorone		ND		0.00057	0.014
2-Nitrophenol		ND UJ		0.00060	0.014
2,4-Dimethylphenol		ND		0.00029	0.014
Benzoic acid		0.11	J	0.090	0.35
Bis(2-chloroethoxy)methane		ND		0.00042	0.014
2,4-Dichlorophenol		ND		0.00042	0.014
1,2,4-Trichlorobenzene		ND		0.0017	0.0069
Naphthalene		0.0081		0.00031	0.0028
4-Chloroaniline		ND		0.0015	0.014
Hexachlorobutadiene		ND		0.0013	0.0069
4-Chloro-3-methylphenol		ND		0.00099	0.014
2-Methylnaphthalene		0.013		0.00032	0.0028
Hexachlorocyclopentadiene		ND UJ		0.00036	0.014
2,4,6-Trichlorophenol		ND		0.00056	0.021
2,4,5-Trichlorophenol		ND		0.00060	0.014
2-Chloronaphthalene		ND		0.00025	0.0028
2-Nitroaniline		ND		0.00058	0.014
Dimethyl phthalate		ND		0.00058	0.014
Acenaphthylene		0.0025	J	0.00022	0.0028
2,6-Dinitrotoluene		ND		0.00057	0.014
3-Nitroaniline		ND		0.00081	0.014
Acenaphthene		0.0031		0.00022	0.0028
2,4-Dinitrophenol		ND UJ		0.0019	0.14
4-Nitrophenol		ND		0.024	0.14
Dibenzofuran		0.0064	J	0.00021	0.014
2,4-Dinitrotoluene		ND		0.00035	0.014
Diethyl phthalate		~~0.0039~~	~~J~~	0.0021	0.014 U
4-Chlorophenyl phenyl ether		ND		0.00079	0.014
Fluorene		0.0047		0.00017	0.0028
4-Nitroaniline		ND		0.0019	0.014
4,6-Dinitro-2-methylphenol		ND		0.0025	0.14
N-Nitrosodiphenylamine		ND		0.00031	0.0069
4-Bromophenyl phenyl ether		ND		0.00046	0.014
Hexachlorobenzene		ND		0.00053	0.0069

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-10**

Lab Sample ID: 580-15385-10
Client Matrix: Solid
% Moisture: 29.7

Date Sampled: 09/08/2009 0830
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12256.D
Dilution:	1.0		Initial Weight/Volume: 20.4987 g
Date Analyzed:	09/22/2009 1442		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0017	0.014
Phenanthrene		0.015		0.00029	0.0028
Anthracene		0.0036		0.00019	0.0028
Di-n-butyl phthalate		~~0.011~~	~~J~~	0.0036	0.028 U
Fluoranthene		0.013		0.00017	0.0028
Pyrene		0.017		0.00019	0.0028
Butyl benzyl phthalate		ND		0.0043	0.014
3,3'-Dichlorobenzidine		ND		0.0011	0.028
Benzo[a]anthracene		0.0089		0.00024	0.0035
Chrysene		0.021		0.00019	0.0035
Bis(2-ethylhexyl) phthalate		0.0076	J	0.0058	0.21
Di-n-octyl phthalate		0.0039	J	0.00018	0.028
Benzo[a]pyrene		0.0074		0.00029	0.0042
Indeno[1,2,3-cd]pyrene		0.0053	J	0.00058	0.0056
Dibenz(a,h)anthracene		0.0026	J	0.00031	0.0056
Benzo[g,h,i]perylene		0.0090		0.00021	0.0035
Carbazole		0.0024	J	0.00060	0.021
1-Methylnaphthalene		0.0063		0.00025	0.0042
Benzo[b]fluoranthene		0.018		0.00057	0.0028
Benzo[k]fluoranthene		0.0037		0.00018	0.0035
2,2'-oxybis[1-chloropropane]		ND		0.00093	0.021

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	57		36 - 145
Phenol-d5	78		38 - 149
Nitrobenzene-d5	56		38 - 141
2-Fluorobiphenyl	70		42 - 140
2,4,6-Tribromophenol	123		28 - 143
Terphenyl-d14	100		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-11** G-RS5D-SED Ø

Lab Sample ID: 580-15385-11

Client Matrix: Solid

% Moisture: 29.4

Date Sampled: 09/08/2009 0835

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12257.D
Dilution:	1.0			Initial Weight/Volume:	20.4354 g
Date Analyzed:	09/22/2009 1503			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0010	0.014
Bis(2-chloroethyl)ether		ND		0.0014	0.014
2-Chlorophenol		ND		0.0010	0.014
1,3-Dichlorobenzene		ND UJ		0.0010	0.0069
1,4-Dichlorobenzene		ND		0.00044	0.0069
Benzyl alcohol		ND		0.0013	0.014
1,2-Dichlorobenzene		ND		0.00089	0.0069
2-Methylphenol		ND		0.00098	0.014
3 & 4 Methylphenol		ND		0.00078	0.028
N-Nitrosodi-n-propylamine		ND		0.0013	0.014
Hexachloroethane		ND		0.0015	0.014
Nitrobenzene		ND		0.0040	0.014
Isophorone		ND		0.00057	0.014
2-Nitrophenol		ND UJ		0.00060	0.014
2,4-Dimethylphenol		ND		0.00029	0.014
Benzoic acid		ND		0.090	0.35
Bis(2-chloroethoxy)methane		ND		0.00042	0.014
2,4-Dichlorophenol		ND		0.00042	0.014
1,2,4-Trichlorobenzene		ND		0.0017	0.0069
Naphthalene		0.0045		0.00030	0.0028
4-Chloroaniline		ND		0.0015	0.014
Hexachlorobutadiene		ND		0.0013	0.0069
4-Chloro-3-methylphenol		ND		0.00098	0.014
2-Methylnaphthalene		0.0052		0.00032	0.0028
Hexachlorocyclopentadiene		ND UJ		0.00036	0.014
2,4,6-Trichlorophenol		ND		0.00055	0.021
2,4,5-Trichlorophenol		ND		0.00060	0.014
2-Chloronaphthalene		ND		0.00025	0.0028
2-Nitroaniline		ND		0.00058	0.014
Dimethyl phthalate		ND		0.00058	0.014
Acenaphthylene		0.0017	J	0.00022	0.0028
2,6-Dinitrotoluene		ND		0.00057	0.014
3-Nitroaniline		ND		0.00080	0.014
Acenaphthene		0.0044		0.00022	0.0028
2,4-Dinitrophenol		ND UJ		0.0019	0.14
4-Nitrophenol		ND		0.024	0.14
Dibenzofuran		0.0030	J	0.00021	0.014
2,4-Dinitrotoluene		ND		0.00035	0.014
Diethyl phthalate		~~0.0043~~	~~J~~	0.0021	0.014 U
4-Chlorophenyl phenyl ether		ND		0.00079	0.014
Fluorene		0.0052		0.00017	0.0028
4-Nitroaniline		ND		0.0019	0.014
4,6-Dinitro-2-methylphenol		ND		0.0025	0.14
N-Nitrosodiphenylamine		ND		0.00030	0.0069
4-Bromophenyl phenyl ether		ND		0.00046	0.014
Hexachlorobenzene		ND		0.00053	0.0069

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-11

Lab Sample ID: 580-15385-11
Client Matrix: Solid

% Moisture: 29.4

Date Sampled: 09/08/2009 0835
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID:	AT12257.D
Dilution:	1.0		Initial Weight/Volume:	20.4354 g
Date Analyzed:	09/22/2009 1503		Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010		Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0017	0.014
Phenanthrene		0.0084		0.00029	0.0028
Anthracene		0.0027	J	0.00019	0.0028
Di-n-butyl phthalate		~~0.011~~	~~J~~	0.0036	0.028 U
Fluoranthene		0.010		0.00017	0.0028
Pyrene		0.011		0.00019	0.0028
Butyl benzyl phthalate		ND		0.0043	0.014
3,3'-Dichlorobenzidine		ND		0.0011	0.028
Benzo[a]anthracene		0.0042		0.00024	0.0035
Chrysene		0.011		0.00019	0.0035
Bis(2-ethylhexyl) phthalate		ND		0.0058	0.21
Di-n-octyl phthalate		ND		0.00018	0.028
Benzo[a]pyrene		0.0056		0.00029	0.0042
Indeno[1,2,3-cd]pyrene		0.0045	J	0.00058	0.0055
Dibenz(a,h)anthracene		0.0023	J	0.00030	0.0055
Benzo[g,h,i]perylene		0.0083		0.00021	0.0035
Carbazole		ND		0.00060	0.021
1-Methylnaphthalene		0.0038	J	0.00025	0.0042
Benzo[b]fluoranthene		0.0076		0.00057	0.0028
Benzo[k]fluoranthene		0.0021	J	0.00018	0.0035
2,2'-oxybis[1-chloropropane]		ND		0.00093	0.021

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	76		36 - 145
Phenol-d5	80		38 - 149
Nitrobenzene-d5	51		38 - 141
2-Fluorobiphenyl	57		42 - 140
2,4,6-Tribromophenol	121		28 - 143
Terphenyl-d14	91		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-12** G-RS5-SED4

Lab Sample ID: 580-15385-12

Client Matrix: Solid

% Moisture: 18.0

Date Sampled: 09/08/2009 0845

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12258.D
Dilution:	1.0			Initial Weight/Volume:	20.4296 g
Date Analyzed:	09/22/2009 1524			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.00088	0.012
Bis(2-chloroethyl)ether		ND		0.0012	0.012
2-Chlorophenol		ND		0.00088	0.012
1,3-Dichlorobenzene		ND	UJ	0.00086	0.0060
1,4-Dichlorobenzene		ND		0.00038	0.0060
Benzyl alcohol		ND		0.0011	0.012
1,2-Dichlorobenzene		ND		0.00076	0.0060
2-Methylphenol		ND		0.00085	0.012
3 & 4 Methylphenol		ND		0.00067	0.024
N-Nitrosodi-n-propylamine		ND		0.0012	0.012
Hexachloroethane		ND		0.0013	0.012
Nitrobenzene		ND		0.0035	0.012
Isophorone		ND		0.00049	0.012
2-Nitrophenol		ND	UJ	0.00051	0.012
2,4-Dimethylphenol		ND		0.00025	0.012
Benzoic acid		ND		0.078	0.30
Bis(2-chloroethoxy)methane		ND		0.00036	0.012
2,4-Dichlorophenol		ND		0.00036	0.012
1,2,4-Trichlorobenzene		ND		0.0014	0.0060
Naphthalene		0.013		0.00026	0.0024
4-Chloroaniline		ND		0.0013	0.012
Hexachlorobutadiene		ND		0.0011	0.0060
4-Chloro-3-methylphenol		ND		0.00085	0.012
2-Methylnaphthalene		ND		0.00027	0.0024
Hexachlorocyclopentadiene		ND	UJ	0.00031	0.012
2,4,6-Trichlorophenol		ND		0.00048	0.018
2,4,5-Trichlorophenol		ND		0.00051	0.012
2-Chloronaphthalene		ND		0.00021	0.0024
2-Nitroaniline		ND		0.00050	0.012
Dimethyl phthalate		ND		0.00050	0.012
Acenaphthylene		ND		0.00019	0.0024
2,6-Dinitrotoluene		ND		0.00049	0.012
3-Nitroaniline		ND		0.00069	0.012
Acenaphthene		0.041		0.00019	0.0024
2,4-Dinitrophenol		ND	UJ	0.0017	0.12
4-Nitrophenol		ND		0.020	0.12
Dibenzofuran		ND		0.00018	0.012
2,4-Dinitrotoluene		ND		0.00030	0.012
Diethyl phthalate		ND		0.0018	0.012
4-Chlorophenyl phenyl ether		ND		0.00068	0.012
Fluorene		0.080		0.00014	0.0024
4-Nitroaniline		ND		0.0017	0.012
4,6-Dinitro-2-methylphenol		ND		0.0021	0.12
N-Nitrosodiphenylamine		ND		0.00026	0.0060
4-Bromophenyl phenyl ether		ND		0.00039	0.012
Hexachlorobenzene		ND		0.00045	0.0060

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-12

Lab Sample ID: 580-15385-12
Client Matrix: Solid
% Moisture: 18.0

Date Sampled: 09/08/2009 0845
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12258.D
Dilution:	1.0		Initial Weight/Volume: 20.4296 g
Date Analyzed:	09/22/2009 1524		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0014	0.012
Phenanthrene		0.080		0.00025	0.0024
Anthracene		0.010		0.00017	0.0024
Di-n-butyl phthalate		ND		0.0031	0.024
Fluoranthene		0.0078		0.00014	0.0024
Pyrene		0.027		0.00017	0.0024
Butyl benzyl phthalate		ND		0.0037	0.012
3,3'-Dichlorobenzidine		ND		0.00094	0.024
Benzo[a]anthracene		0.0059		0.00020	0.0030
Chrysene		0.013		0.00017	0.0030
Bis(2-ethylhexyl) phthalate		ND		0.0050	0.18
Di-n-octyl phthalate		ND		0.00016	0.024
Benzo[a]pyrene		0.0069		0.00025	0.0036
Indeno[1,2,3-cd]pyrene		0.0023	J	0.00050	0.0048
Dibenz(a,h)anthracene		ND		0.00026	0.0048
Benzo[g,h,i]perylene		0.0050		0.00018	0.0030
Carbazole		ND		0.00051	0.018
1-Methylnaphthalene		0.087		0.00021	0.0036
Benzo[b]fluoranthene		0.0052		0.00049	0.0024
Benzo[k]fluoranthene		ND		0.00016	0.0030
2,2'-oxybis[1-chloropropane]		ND		0.00080	0.018

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	71		36 - 145
Phenol-d5	79		38 - 149
Nitrobenzene-d5	52		38 - 141
2-Fluorobiphenyl	53		42 - 140
2,4,6-Tribromophenol	103		28 - 143
Terphenyl-d14	77		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-13** G-RS6-SED 0

Lab Sample ID: 580-15385-13

Client Matrix: Solid

% Moisture: 25.0

Date Sampled: 09/08/2009 0740

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12259.D
Dilution:	1.0			Initial Weight/Volume:	20.1655 g
Date Analyzed:	09/22/2009 1545			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		0.0012	J	0.00098	0.013
Bis(2-chloroethyl)ether		ND		0.0013	0.013
2-Chlorophenol		ND		0.00098	0.013
1,3-Dichlorobenzene		ND UJ		0.00095	0.0066
1,4-Dichlorobenzene		ND		0.00042	0.0066
Benzyl alcohol		ND		0.0013	0.013
1,2-Dichlorobenzene		ND		0.00085	0.0066
2-Methylphenol		ND		0.00094	0.013
3 & 4 Methylphenol		ND		0.00074	0.026
N-Nitrosodi-n-propylamine		ND		0.0013	0.013
Hexachloroethane		ND		0.0015	0.013
Nitrobenzene		ND		0.0038	0.013
Isophorone		ND		0.00054	0.013
2-Nitrophenol		ND UJ		0.00057	0.013
2,4-Dimethylphenol		ND		0.00028	0.013
Benzoic acid		ND		0.086	0.33
Bis(2-chloroethoxy)methane		ND		0.00040	0.013
2,4-Dichlorophenol		ND		0.00040	0.013
1,2,4-Trichlorobenzene		ND		0.0016	0.0066
Naphthalene		0.0016	J	0.00029	0.0026
4-Chloroaniline		ND		0.0015	0.013
Hexachlorobutadiene		ND		0.0012	0.0066
4-Chloro-3-methylphenol		ND		0.00094	0.013
2-Methylnaphthalene		0.0028		0.00030	0.0026
Hexachlorocyclopentadiene		ND UJ		0.00034	0.013
2,4,6-Trichlorophenol		ND		0.00053	0.020
2,4,5-Trichlorophenol		ND		0.00057	0.013
2-Chloronaphthalene		ND		0.00024	0.0026
2-Nitroaniline		ND		0.00056	0.013
Dimethyl phthalate		ND		0.00056	0.013
Acenaphthylene		0.00098	J	0.00021	0.0026
2,6-Dinitrotoluene		ND		0.00054	0.013
3-Nitroaniline		ND		0.00077	0.013
Acenaphthene		ND		0.00021	0.0026
2,4-Dinitrophenol		ND UJ		0.0019	0.13
4-Nitrophenol		ND		0.022	0.13
Dibenzofuran		0.00093	J	0.00020	0.013
2,4-Dinitrotoluene		ND		0.00033	0.013
Diethyl phthalate		~~0.0049~~	J	0.0020	0.013 U
4-Chlorophenyl phenyl ether		ND		0.00075	0.013
Fluorene		ND		0.00016	0.0026
4-Nitroaniline		ND		0.0019	0.013
4,6-Dinitro-2-methylphenol		ND		0.0024	0.13
N-Nitrosodiphenylamine		ND		0.00029	0.0066
4-Bromophenyl phenyl ether		ND		0.00044	0.013
Hexachlorobenzene		ND		0.00050	0.0066

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-13**

Lab Sample ID: 580-15385-13
Client Matrix: Solid
% Moisture: 25.0

Date Sampled: 09/08/2009 0740
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679		Instrument ID:	TAC002
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	AT12259.D
Dilution:	1.0			Initial Weight/Volume:	20.1655 g
Date Analyzed:	09/22/2009 1545			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0016	0.013
Phenanthrene		0.0043		0.00028	0.0026
Anthracene		0.0020	J	0.00019	0.0026
Di-n-butyl phthalate		~~0.0084~~	~~J~~	0.0034	0.026 U
Fluoranthene		0.014		0.00016	0.0026
Pyrene		0.013		0.00019	0.0026
Butyl benzyl phthalate		ND		0.0041	0.013
3,3'-Dichlorobenzidine		ND		0.0010	0.026
Benzo[a]anthracene		0.0058		0.00022	0.0033
Chrysene		0.0085		0.00019	0.0033
Bis(2-ethylhexyl) phthalate		0.010	J	0.0056	0.20
Di-n-octyl phthalate		ND		0.00017	0.026
Benzo[a]pyrene		0.0062		0.00028	0.0040
Indeno[1,2,3-cd]pyrene		0.0040	J	0.00056	0.0053
Dibenz(a,h)anthracene		0.0017	J	0.00029	0.0053
Benzo[g,h,i]perylene		0.0049		0.00020	0.0033
Carbazole		0.0011	J	0.00057	0.020
1-Methylnaphthalene		0.0015	J	0.00024	0.0040
Benzo[b]fluoranthene		0.010		0.00054	0.0026
Benzo[k]fluoranthene		0.0022	J	0.00017	0.0033
2,2'-oxybis[1-chloropropane]		ND		0.00089	0.020

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	61		36 - 145
Phenol-d5	74		38 - 149
Nitrobenzene-d5	47		38 - 141
2-Fluorobiphenyl	65		42 - 140
2,4,6-Tribromophenol	101		28 - 143
Terphenyl-d14	86		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-14** G-RS6-SED3

Lab Sample ID: 580-15385-14

Client Matrix: Solid

% Moisture: 31.9

Date Sampled: 09/08/2009 0735

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12262.D
Dilution:	1.0		Initial Weight/Volume: 20.0532 g
Date Analyzed:	09/22/2009 1649		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0011	0.015
Bis(2-chloroethyl)ether		ND		0.0015	0.015
2-Chlorophenol		ND		0.0011	0.015
1,3-Dichlorobenzene		ND UJ		0.0011	0.0073
1,4-Dichlorobenzene		ND		0.00047	0.0073
Benzyl alcohol		ND		0.0014	0.015
1,2-Dichlorobenzene		ND		0.00094	0.0073
2-Methylphenol		ND		0.0010	0.015
3 & 4 Methylphenol		0.0020	J	0.00082	0.029
N-Nitrosodi-n-propylamine		ND		0.0014	0.015
Hexachloroethane		ND		0.0016	0.015
Nitrobenzene		ND		0.0042	0.015
Isophorone		ND		0.00060	0.015
2-Nitrophenol		ND UJ		0.00063	0.015
2,4-Dimethylphenol		ND		0.00031	0.015
Benzoic acid		ND		0.095	0.37
Bis(2-chloroethoxy)methane		ND		0.00044	0.015
2,4-Dichlorophenol		ND		0.00044	0.015
1,2,4-Trichlorobenzene		ND		0.0018	0.0073
Naphthalene		ND		0.00032	0.0029
4-Chloroaniline		ND		0.0016	0.015
Hexachlorobutadiene		ND		0.0013	0.0073
4-Chloro-3-methylphenol		ND		0.0010	0.015
2-Methylnaphthalene		0.0020	J	0.00034	0.0029
Hexachlorocyclopentadiene		ND UJ		0.00038	0.015
2,4,6-Trichlorophenol		ND		0.00059	0.022
2,4,5-Trichlorophenol		ND		0.00063	0.015
2-Chloronaphthalene		ND		0.00026	0.0029
2-Nitroaniline		ND		0.00062	0.015
Dimethyl phthalate		ND		0.00062	0.015
Acenaphthylene		ND		0.00023	0.0029
2,6-Dinitrotoluene		0.0031	J	0.00060	0.015
3-Nitroaniline		ND		0.00085	0.015
Acenaphthene		ND		0.00023	0.0029
2,4-Dinitrophenol		ND UJ		0.0021	0.15
4-Nitrophenol		ND		0.025	0.15
Dibenzofuran		ND		0.00022	0.015
2,4-Dinitrotoluene		ND		0.00037	0.015
Diethyl phthalate		ND		0.0022	0.015
4-Chlorophenyl phenyl ether		ND		0.00084	0.015
Fluorene		ND		0.00018	0.0029
4-Nitroaniline		ND		0.0021	0.015
4,6-Dinitro-2-methylphenol		ND		0.0026	0.15
N-Nitrosodiphenylamine		ND		0.00032	0.0073
4-Bromophenyl phenyl ether		ND		0.00048	0.015
Hexachlorobenzene		ND		0.00056	0.0073

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-14

Lab Sample ID: 580-15385-14
Client Matrix: Solid

% Moisture: 31.9

Date Sampled: 09/08/2009 0735
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50679	Instrument ID: TAC002
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: AT12262.D
Dilution:	1.0		Initial Weight/Volume: 20.0532 g
Date Analyzed:	09/22/2009 1649		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.0018	0.015
Phenanthrene		0.0014	J	0.00031	0.0029
Anthracene		0.00081	J	0.00021	0.0029
Di-n-butyl phthalate		~~0.0096~~	~~J~~	0.0038	0.029 U
Fluoranthene		0.0016	J	0.00018	0.0029
Pyrene		ND		0.00021	0.0029
Butyl benzyl phthalate		ND		0.0045	0.015
3,3'-Dichlorobenzidine		ND		0.0012	0.029
Benzo[a]anthracene		0.00042	J	0.00025	0.0037
Chrysene		0.0033	J	0.00021	0.0037
Bis(2-ethylhexyl) phthalate		0.0068	J	0.0062	0.22
Di-n-octyl phthalate		ND		0.00019	0.029
Benzo[a]pyrene		0.00098	J	0.00031	0.0044
Indeno[1,2,3-cd]pyrene		0.0016	J	0.00062	0.0059
Dibenz(a,h)anthracene		ND		0.00032	0.0059
Benzo[g,h,i]perylene		0.0023	J	0.00022	0.0037
Carbazole		ND		0.00063	0.022
1-Methylnaphthalene		0.00097	J	0.00026	0.0044
Benzo[b]fluoranthene		0.0015	J	0.00060	0.0029
Benzo[k]fluoranthene		0.00061	J	0.00019	0.0037
2,2'-oxybis[1-chloropropane]		ND		0.00098	0.022

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	51		36 - 145
Phenol-d5	55		38 - 149
Nitrobenzene-d5	48		38 - 141
2-Fluorobiphenyl	31	X	42 - 140
2,4,6-Tribromophenol	63		28 - 143
Terphenyl-d14	67		42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-15** G-RS3-SED4

Lab Sample ID: 580-15385-15

Client Matrix: Solid

% Moisture: 16.8

Date Sampled: 09/08/2009 1115

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15250.D
Dilution:	10			Initial Weight/Volume:	20.4612 g
Date Analyzed:	09/18/2009 1450			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0087	0.12
Bis(2-chloroethyl)ether		ND		0.012	0.12
2-Chlorophenol		ND		0.0087	0.12
1,3-Dichlorobenzene		ND UJ		0.0085	0.059
1,4-Dichlorobenzene		ND		0.0038	0.059
Benzyl alcohol		ND		0.011	0.12
1,2-Dichlorobenzene		ND		0.0075	0.059
2-Methylphenol		ND		0.0083	0.12
3 & 4 Methylphenol		ND		0.0066	0.23
N-Nitrosodi-n-propylamine		ND		0.011	0.12
Hexachloroethane		ND		0.013	0.12
Nitrobenzene		ND		0.034	0.12
Isophorone		0.022	J	0.0048	0.12
2-Nitrophenol		ND UJ		0.0051	0.12
2,4-Dimethylphenol		ND		0.0025	0.12
Benzoic acid		ND		0.76	2.9
Bis(2-chloroethoxy)methane		ND		0.0035	0.12
2,4-Dichlorophenol		ND		0.0035	0.12
1,2,4-Trichlorobenzene		ND		0.014	0.059
Naphthalene		ND		0.0026	0.023
4-Chloroaniline		ND		0.013	0.12
Hexachlorobutadiene		ND		0.011	0.059
4-Chloro-3-methylphenol		ND		0.0083	0.12
2-Methylnaphthalene		0.016	J	0.0027	0.023
Hexachlorocyclopentadiene		ND UJ		0.0031	0.12
2,4,6-Trichlorophenol		ND		0.0047	0.18
2,4,5-Trichlorophenol		ND		0.0051	0.12
2-Chloronaphthalene		ND		0.0021	0.023
2-Nitroaniline		ND		0.0049	0.12
Dimethyl phthalate		ND		0.0049	0.12
Acenaphthylene		ND		0.0019	0.023
2,6-Dinitrotoluene		ND		0.0048	0.12
3-Nitroaniline		ND		0.0068	0.12
Acenaphthene		0.18		0.0019	0.023
2,4-Dinitrophenol		ND UJ		0.016	1.2
4-Nitrophenol		ND		0.20	1.2
Dibenzofuran		ND		0.0018	0.12
2,4-Dinitrotoluene		ND		0.0029	0.12
Diethyl phthalate		ND		0.018	0.12
4-Chlorophenyl phenyl ether		ND		0.0067	0.12
Fluorene		0.17		0.0014	0.023
4-Nitroaniline		ND		0.016	0.12
4,6-Dinitro-2-methylphenol		ND		0.021	1.2
N-Nitrosodiphenylamine		ND		0.0026	0.059
4-Bromophenyl phenyl ether		ND		0.0039	0.12
Hexachlorobenzene		ND		0.0045	0.059

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-15**

Lab Sample ID: 580-15385-15
Client Matrix: Solid
% Moisture: 16.8

Date Sampled: 09/08/2009 1115
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15250.D
Dilution:	10		Initial Weight/Volume: 20.4612 g
Date Analyzed:	09/18/2009 1450		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.014	0.12
Phenanthrene		0.48		0.0025	0.023
Anthracene		0.10		0.0016	0.023
Di-n-butyl phthalate		ND		0.031	0.23
Fluoranthene		0.15	*	0.0014	0.023
Pyrene		0.54		0.0016	0.023
Butyl benzyl phthalate		ND		0.036	0.12
3,3'-Dichlorobenzidine		ND		0.0093	0.23
Benzo[a]anthracene		0.10		0.0020	0.029
Chrysene		0.29		0.0016	0.029
Bis(2-ethylhexyl) phthalate		ND		0.049	1.8
Di-n-octyl phthalate		ND		0.0015	0.23
Benzo[a]pyrene		0.097		0.0025	0.035
Indeno[1,2,3-cd]pyrene		0.025	J	0.0049	0.047
Dibenz(a,h)anthracene		ND		0.0026	0.047
Benzo[g,h,i]perylene		0.038		0.0018	0.029
Carbazole		ND		0.0051	0.18
1-Methylnaphthalene		0.11		0.0021	0.035
Benzo[b]fluoranthene		0.078		0.0048	0.023
Benzo[k]fluoranthene		0.027	J	0.0015	0.029
2,2'-oxybis[1-chloropropane]		ND		0.0079	0.18

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	0	X D	36 - 145
Phenol-d5	0	X D	38 - 149
Nitrobenzene-d5	0	X D	38 - 141
2-Fluorobiphenyl	0	X D	42 - 140
2,4,6-Tribromophenol	0	X D	28 - 143
Terphenyl-d14	0	X D	42 - 151

Client: TestAmerica Laboratories, Inc | Job Number: 580-15385-1

Client Sample ID: **SSI0049-16** G-RS3-SED ϕ

Lab Sample ID: 580-15385-16 | Date Sampled: 09/08/2009 1110

Client Matrix: Solid | % Moisture: 27.9 | Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15251.D
Dilution:	10			Initial Weight/Volume:	20.2664 g
Date Analyzed:	09/18/2009 1511			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.010	0.14
Bis(2-chloroethyl)ether		ND		0.014	0.14
2-Chlorophenol		ND		0.010	0.14
1,3-Dichlorobenzene		ND UJ		0.0099	0.068
1,4-Dichlorobenzene		ND		0.0044	0.068
Benzyl alcohol		ND		0.013	0.14
1,2-Dichlorobenzene		ND		0.0088	0.068
2-Methylphenol		ND		0.0097	0.14
3 & 4 Methylphenol		ND		0.0077	0.27
N-Nitrosodi-n-propylamine		ND		0.013	0.14
Hexachloroethane		ND		0.015	0.14
Nitrobenzene		ND		0.040	0.14
Isophorone		ND		0.0056	0.14
2-Nitrophenol		ND UJ		0.0059	0.14
2,4-Dimethylphenol		ND		0.0029	0.14
Benzoic acid		ND		0.89	3.4
Bis(2-chloroethoxy)methane		ND		0.0041	0.14
2,4-Dichlorophenol		ND		0.0041	0.14
1,2,4-Trichlorobenzene		ND		0.016	0.068
Naphthalene		ND		0.0030	0.027
4-Chloroaniline		ND		0.015	0.14
Hexachlorobutadiene		ND		0.012	0.068
4-Chloro-3-methylphenol		ND		0.0097	0.14
2-Methylnaphthalene		0.0055	J	0.0031	0.027
Hexachlorocyclopentadiene		ND UJ		0.0036	0.14
2,4,6-Trichlorophenol		ND		0.0055	0.21
2,4,5-Trichlorophenol		ND		0.0059	0.14
2-Chloronaphthalene		ND		0.0025	0.027
2-Nitroaniline		ND		0.0057	0.14
Dimethyl phthalate		ND		0.0057	0.14
Acenaphthylene		ND		0.0022	0.027
2,6-Dinitrotoluene		ND		0.0056	0.14
3-Nitroaniline		ND		0.0079	0.14
Acenaphthene		0.032		0.0022	0.027
2,4-Dinitrophenol		ND UJ		0.019	1.4
4-Nitrophenol		ND		0.23	1.4
Dibenzofuran		ND		0.0021	0.14
2,4-Dinitrotoluene		ND		0.0034	0.14
Diethyl phthalate		ND		0.021	0.14
4-Chlorophenyl phenyl ether		ND		0.0078	0.14
Fluorene		0.059		0.0016	0.027
4-Nitroaniline		ND		0.019	0.14
4,6-Dinitro-2-methylphenol		ND		0.025	1.4
N-Nitrosodiphenylamine		ND		0.0030	0.068
4-Bromophenyl phenyl ether		ND		0.0045	0.14
Hexachlorobenzene		ND		0.0052	0.068

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-16

Lab Sample ID: 580-15385-16
Client Matrix: Solid
% Moisture: 27.9

Date Sampled: 09/08/2009 1110
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472	Instrument ID: TAC023
Preparation:	3550B	Prep Batch: 580-50242	Lab File ID: HP15251.D
Dilution:	10		Initial Weight/Volume: 20.2664 g
Date Analyzed:	09/18/2009 1511		Final Weight/Volume: 2 mL
Date Prepared:	09/15/2009 1010		Injection Volume: 1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.016	0.14
Phenanthrene		0.078		0.0029	0.027
Anthracene		0.017	J	0.0019	0.027
Di-n-butyl phthalate		ND		0.036	0.27
Fluoranthene		ND	*	0.0016	0.027
Pyrene		0.092		0.0019	0.027
Butyl benzyl phthalate		ND		0.042	0.14
3,3'-Dichlorobenzidine		ND		0.011	0.27
Benzo[a]anthracene		ND		0.0023	0.034
Chrysene		ND		0.0019	0.034
Bis(2-ethylhexyl) phthalate		ND		0.057	2.1
Di-n-octyl phthalate		ND		0.0018	0.27
Benzo[a]pyrene		ND		0.0029	0.041
Indeno[1,2,3-cd]pyrene		ND		0.0057	0.055
Dibenz(a,h)anthracene		ND		0.0030	0.055
Benzo[g,h,i]perylene		0.028	J	0.0021	0.034
Carbazole		ND		0.0059	0.21
1-Methylnaphthalene		0.050		0.0025	0.041
Benzo[b]fluoranthene		ND		0.0056	0.027
Benzo[k]fluoranthene		ND		0.0018	0.034
2,2'-oxybis[1-chloropropane]		ND		0.0092	0.21

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	0	X D	36 - 145
Phenol-d5	0	X D	38 - 149
Nitrobenzene-d5	0	X D	38 - 141
2-Fluorobiphenyl	0	X D	42 - 140
2,4,6-Tribromophenol	0	X D	28 - 143
Terphenyl-d14	0	X D	42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-17** G-RS4-SED Ø

Lab Sample ID: 580-15385-17

Client Matrix: Solid

% Moisture: 16.5

Date Sampled: 09/08/2009 1220

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15252.D
Dilution:	10			Initial Weight/Volume:	20.2801 g
Date Analyzed:	09/18/2009 1531			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0087	0.12
Bis(2-chloroethyl)ether		ND		0.012	0.12
2-Chlorophenol		ND		0.0087	0.12
1,3-Dichlorobenzene		ND	UJ	0.0085	0.059
1,4-Dichlorobenzene		ND		0.0038	0.059
Benzyl alcohol		ND		0.011	0.12
1,2-Dichlorobenzene		ND		0.0076	0.059
2-Methylphenol		ND		0.0084	0.12
3 & 4 Methylphenol		ND		0.0066	0.24
N-Nitrosodi-n-propylamine		ND		0.011	0.12
Hexachloroethane		ND		0.013	0.12
Nitrobenzene		ND		0.034	0.12
Isophorone		ND		0.0048	0.12
2-Nitrophenol		ND	UJ	0.0051	0.12
2,4-Dimethylphenol		ND		0.0025	0.12
Benzoic acid		ND		0.77	3.0
Bis(2-chloroethoxy)methane		ND		0.0035	0.12
2,4-Dichlorophenol		ND		0.0035	0.12
1,2,4-Trichlorobenzene		ND		0.014	0.059
Naphthalene		ND		0.0026	0.024
4-Chloroaniline		ND		0.013	0.12
Hexachlorobutadiene		ND		0.011	0.059
4-Chloro-3-methylphenol		ND		0.0084	0.12
2-Methylnaphthalene		0.47		0.0027	0.024
Hexachlorocyclopentadiene		ND	UJ	0.0031	0.12
2,4,6-Trichlorophenol		ND		0.0047	0.18
2,4,5-Trichlorophenol		ND		0.0051	0.12
2-Chloronaphthalene		ND		0.0021	0.024
2-Nitroaniline		ND		0.0050	0.12
Dimethyl phthalate		ND		0.0050	0.12
Acenaphthylene		ND		0.0019	0.024
2,6-Dinitrotoluene		ND		0.0048	0.12
3-Nitroaniline		ND		0.0069	0.12
Acenaphthene		1.9		0.0019	0.024
2,4-Dinitrophenol		ND	UJ	0.017	1.2
4-Nitrophenol		ND		0.20	1.2
Dibenzofuran		ND		0.0018	0.12
2,4-Dinitrotoluene		ND		0.0030	0.12
Diethyl phthalate		ND		0.018	0.12
4-Chlorophenyl phenyl ether		ND		0.0067	0.12
Fluorene		3.1		0.0014	0.024
4-Nitroaniline		ND		0.017	0.12
4,6-Dinitro-2-methylphenol		ND		0.021	1.2
N-Nitrosodiphenylamine		ND		0.0026	0.059
4-Bromophenyl phenyl ether		ND		0.0039	0.12
Hexachlorobenzene		ND		0.0045	0.059

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-17

Lab Sample ID: 580-15385-17
Client Matrix: Solid
% Moisture: 16.5

Date Sampled: 09/08/2009 1220
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15252.D
Dilution:	10			Initial Weight/Volume:	20.2801 g
Date Analyzed:	09/18/2009 1531			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.014	0.12
Phenanthrene		5.0		0.0025	0.024
Anthracene		0.23		0.0017	0.024
Di-n-butyl phthalate		ND		0.031	0.24
Fluoranthene		0.68	*	0.0014	0.024
Pyrene		2.3		0.0017	0.024
Butyl benzyl phthalate		ND		0.037	0.12
3,3'-Dichlorobenzidine		ND		0.0093	0.24
Benzo[a]anthracene		0.48		0.0020	0.030
Chrysene		1.0		0.0017	0.030
Bis(2-ethylhexyl) phthalate		ND		0.050	1.8
Di-n-octyl phthalate		ND		0.0015	0.24
Benzo[a]pyrene		ND		0.0025	0.035
Indeno[1,2,3-cd]pyrene		ND		0.0050	0.047
Dibenz(a,h)anthracene		ND		0.0026	0.047
Benzo[g,h,i]perylene		0.12		0.0018	0.030
Carbazole		ND		0.0051	0.18
1-Methylnaphthalene		5.0		0.0021	0.035
Benzo[b]fluoranthene		ND		0.0048	0.024
Benzo[k]fluoranthene		ND		0.0015	0.030
2,2'-oxybis[1-chloropropane]		ND		0.0079	0.18

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	0	X D	36 - 145
Phenol-d5	0	X D	38 - 149
Nitrobenzene-d5	0	X D	38 - 141
2-Fluorobiphenyl	0	X D	42 - 140
2,4,6-Tribromophenol	0	X D	28 - 143
Terphenyl-d14	0	X D	42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-18** G-RS4-SED4

Lab Sample ID: 580-15385-18

Client Matrix: Solid

% Moisture: 13.4

Date Sampled: 09/08/2009 1225

Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15253.D
Dilution:	10			Initial Weight/Volume:	20.2828 g
Date Analyzed:	09/18/2009 1552			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Phenol		ND		0.0084	0.11
Bis(2-chloroethyl)ether		ND		0.011	0.11
2-Chlorophenol		ND		0.0084	0.11
1,3-Dichlorobenzene		ND UJ		0.0082	0.057
1,4-Dichlorobenzene		ND		0.0036	0.057
Benzyl alcohol		ND		0.011	0.11
1,2-Dichlorobenzene		ND		0.0073	0.057
2-Methylphenol		ND		0.0081	0.11
3 & 4 Methylphenol		ND		0.0064	0.23
N-Nitrosodi-n-propylamine		ND		0.011	0.11
Hexachloroethane		ND		0.013	0.11
Nitrobenzene		ND		0.033	0.11
Isophorone		ND		0.0047	0.11
2-Nitrophenol		ND UJ		0.0049	0.11
2,4-Dimethylphenol		ND		0.0024	0.11
Benzoic acid		ND		0.74	2.8
Bis(2-chloroethoxy)methane		ND		0.0034	0.11
2,4-Dichlorophenol		ND		0.0034	0.11
1,2,4-Trichlorobenzene		ND		0.014	0.057
Naphthalene		ND		0.0025	0.023
4-Chloroaniline		ND		0.013	0.11
Hexachlorobutadiene		ND		0.010	0.057
4-Chloro-3-methylphenol		ND		0.0081	0.11
2-Methylnaphthalene		0.0048	J	0.0026	0.023
Hexachlorocyclopentadiene		ND UJ		0.0030	0.11
2,4,6-Trichlorophenol		ND		0.0046	0.17
2,4,5-Trichlorophenol		ND		0.0049	0.11
2-Chloronaphthalene		ND		0.0020	0.023
2-Nitroaniline		ND		0.0048	0.11
Dimethyl phthalate		ND		0.0048	0.11
Acenaphthylene		ND		0.0018	0.023
2,6-Dinitrotoluene		ND		0.0047	0.11
3-Nitroaniline		ND		0.0066	0.11
Acenaphthene		ND		0.0018	0.023
2,4-Dinitrophenol		ND UJ		0.016	1.1
4-Nitrophenol		ND		0.19	1.1
Dibenzofuran		ND		0.0017	0.11
2,4-Dinitrotoluene		ND		0.0028	0.11
Diethyl phthalate		ND		0.017	0.11
4-Chlorophenyl phenyl ether		ND		0.0065	0.11
Fluorene		ND		0.0014	0.023
4-Nitroaniline		ND		0.016	0.11
4,6-Dinitro-2-methylphenol		ND		0.020	1.1
N-Nitrosodiphenylamine		ND		0.0025	0.057
4-Bromophenyl phenyl ether		ND		0.0038	0.11
Hexachlorobenzene		ND		0.0043	0.057

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: SSI0049-18

Lab Sample ID: 580-15385-18
Client Matrix: Solid

% Moisture: 13.4

Date Sampled: 09/08/2009 1225
Date Received: 09/11/2009 0940

8270C Semivolatile Compounds by Gas Chromatography/Mass Spectrometry (GC/MS)

Method:	8270C	Analysis Batch: 580-50472		Instrument ID:	TAC023
Preparation:	3550B	Prep Batch: 580-50242		Lab File ID:	HP15253.D
Dilution:	10			Initial Weight/Volume:	20.2828 g
Date Analyzed:	09/18/2009 1552			Final Weight/Volume:	2 mL
Date Prepared:	09/15/2009 1010			Injection Volume:	1.0 uL

Analyte	DryWt Corrected: Y	Result (mg/Kg)	Qualifier	MDL	RL
Pentachlorophenol		ND		0.014	0.11
Phenanthrene		ND		0.0024	0.023
Anthracene		ND		0.0016	0.023
Di-n-butyl phthalate		ND		0.030	0.23
Fluoranthene		0.0065	J *	0.0014	0.023
Pyrene		0.023		0.0016	0.023
Butyl benzyl phthalate		ND		0.035	0.11
3,3'-Dichlorobenzidine		ND		0.0090	0.23
Benzo[a]anthracene		ND		0.0019	0.028
Chrysene		0.0035	J	0.0016	0.028
Bis(2-ethylhexyl) phthalate		ND		0.048	1.7
Di-n-octyl phthalate		ND		0.0015	0.23
Benzo[a]pyrene		ND		0.0024	0.034
Indeno[1,2,3-cd]pyrene		ND		0.0048	0.046
Dibenz(a,h)anthracene		ND		0.0025	0.046
Benzo[g,h,i]perylene		ND		0.0017	0.028
Carbazole		ND		0.0049	0.17
1-Methylnaphthalene		0.0033	J	0.0020	0.034
Benzo[b]fluoranthene		ND		0.0047	0.023
Benzo[k]fluoranthene		ND		0.0015	0.028
2,2'-oxybis[1-chloropropane]		ND		0.0076	0.17

Surrogate	%Rec	Qualifier	Acceptance Limits
2-Fluorophenol	0	X D	36 - 145
Phenol-d5	0	X D	38 - 149
Nitrobenzene-d5	0	X D	38 - 141
2-Fluorobiphenyl	0	X D	42 - 140
2,4,6-Tribromophenol	0	X D	28 - 143
Terphenyl-d14	0	X D	42 - 151

Client: TestAmerica Laboratories, Inc

Job Number: 580-15385-1

Client Sample ID: **SSI0049-09**

Lab Sample ID: 580-15385-9
Client Matrix: Water

Date Sampled: 09/07/2009 1700
Date Received: 09/11/2009 0940

8082 Polychlorinated Biphenyls (PCBs) by Gas Chromatography

Method:	8082	Analysis Batch: 580-52626		Instrument ID:	TAC034
Preparation:	3510C	Prep Batch: 580-52855		Initial Weight/Volume:	1060 mL
Dilution:	1.0			Final Weight/Volume:	1 mL
Date Analyzed:	10/23/2009 1413			Injection Volume:	
Date Prepared:	09/14/2009 0857			Result Type:	PRIMARY

Analyte	Result (ug/L)	Qualifier	MDL	RL
PCB-1016	ND		0.0042	0.047
PCB-1221	ND		0.0058	0.047
PCB-1232	ND		0.0039	0.047
PCB-1242	ND		0.0039	0.047
PCB-1248	ND		0.0067	0.047
PCB-1254	ND		0.0042	0.047
PCB-1260	ND		0.0037	0.047

Surrogate	%Rec	Qualifier	Acceptance Limits
Tetrachloro-m-xylene	86		60 - 150
DCB Decachlorobiphenyl	58		40 - 135

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
% Solids	TA SOP	78.4	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
% Solids	TA SOP	66.1	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
% Solids	TA SOP	79.9	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
% Solids	TA SOP	68.1	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
% Solids	TA SOP	67.1	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
% Solids	TA SOP	84.5	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
% Solids	TA SOP	79.3	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
% Solids	TA SOP	65.6	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
% Solids	TA SOP	68.3	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
% Solids	TA SOP	68.1	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
% Solids	TA SOP	**80.4**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
% Solids	TA SOP	**72.1**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
% Solids	TA SOP	**65.4**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
% Solids	TA SOP	**80.2**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
% Solids	TA SOP	**70.7**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
% Solids	TA SOP	**70.4**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
% Solids	TA SOP	**83.8**	----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**				**Sampled: 09/07/09 13:50**				
Mercury	7471A Dry	**0.061**	*0.0074*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:28	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
Mercury	7471A Dry	ND	*0.0087*	0.028	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:32	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
Mercury	7471A Dry	ND	*0.0070*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:36	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**				**Sampled: 09/07/09 14:50**				
Mercury	7471A Dry	**0.026**	*0.0084*	0.027	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:40	J
SSI0049-05 (G-RS7SED-0-090709)		**Soil**				**Sampled: 09/07/09 15:30**				
Mercury	7471A Dry	ND	*0.0082*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:44	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**				**Sampled: 09/07/09 15:25**				
Mercury	7471A Dry	ND	*0.0075*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:49	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**				
Mercury	7471A Dry	ND	*0.0077*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:01	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**				
Mercury	7471A Dry	**0.021**	*0.0078*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:05	J
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50776	09/23/09 15:17	09/23/09 17:35	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**				**Sampled: 09/08/09 08:30**				
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:10	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**				**Sampled: 09/08/09 08:35**				
Mercury	7471A Dry	ND	*0.0081*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:15	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**					**Sampled: 09/08/09 08:45**			
Mercury	7471A Dry	**0.013**	*0.0068*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:19	J
SSI0049-13 (G-RS6SED-0-090809)		**Soil**					**Sampled: 09/08/09 07:40**			
Mercury	7471A Dry	**0.020**	*0.0083*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:11	J
SSI0049-14 (G-RS6SED-3-090809)		**Soil**					**Sampled: 09/08/09 07:35**			
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:23	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**					**Sampled: 09/08/09 11:15**			
Mercury	7471A Dry	**0.0099**	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:27	J
SSI0049-16 (G-RS3SED-0-090809)		**Soil**					**Sampled: 09/08/09 11:10**			
Mercury	7471A Dry	**0.0085**	*0.0079*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:32	J
SSI0049-17 (G-RS4SED-0-090809)		**Soil**					**Sampled: 09/08/09 12:20**			
Mercury	7471A Dry	ND	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:37	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**					**Sampled: 09/08/09 12:25**			
Mercury	7471A Dry	**0.020**	*0.0066*	0.021	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:41	J

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206
ph: (509) 924.9200 fax: (509) 924.9290

October 28, 2009

Doug Morell
Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

RE: Avery Landing

Enclosed are the results of analyses for samples received by the laboratory on 09/09/09 09:30. The following list is a summary of the Work Orders contained in this report, generated on 10/28/09 14:26.

If you have any questions concerning this report, please feel free to contact me.

Work Order	Project	ProjectNumber
SSI0049	Avery Landing	073-93312-03

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

ANALYTICAL REPORT FOR SAMPLES

Sample ID	Laboratory ID	Matrix	Date Sampled	Date Received
G-RS1SED-4-090709	SSI0049-01	Soil	09/07/09 13:50	09/09/09 09:30
G-RS1SED-0-090709	SSI0049-02	Soil	09/07/09 13:55	09/09/09 09:30
G-RS8SED-3-090709	SSI0049-03	Soil	09/07/09 14:45	09/09/09 09:30
G-RS8SED-0-090709	SSI0049-04	Soil	09/07/09 14:50	09/09/09 09:30
G-RS7SED-0-090709	SSI0049-05	Soil	09/07/09 15:30	09/09/09 09:30
G-RS7SED-4-090709	SSI0049-06	Soil	09/07/09 15:25	09/09/09 09:30
G-RS2SED-3-090709	SSI0049-07	Soil	09/07/09 16:15	09/09/09 09:30
G-RS2SED-0-090709	SSI0049-08	Soil	09/07/09 16:20	09/09/09 09:30
G-EB-090709	SSI0049-09	Water	09/07/09 17:00	09/09/09 09:30
G-RS5SED-0-090809	SSI0049-10	Soil	09/08/09 08:30	09/09/09 09:30
G-RS5DSED-0-090809	SSI0049-11	Soil	09/08/09 08:35	09/09/09 09:30
G-RS5SED-4-090809	SSI0049-12	Soil	09/08/09 08:45	09/09/09 09:30
G-RS6SED-0-090809	SSI0049-13	Soil	09/08/09 07:40	09/09/09 09:30
G-RS6SED-3-090809	SSI0049-14	Soil	09/08/09 07:35	09/09/09 09:30
G-RS3SED-4-090809	SSI0049-15	Soil	09/08/09 11:15	09/09/09 09:30
G-RS3SED-0-090809	SSI0049-16	Soil	09/08/09 11:10	09/09/09 09:30
G-RS4SED-0-090809	SSI0049-17	Soil	09/08/09 12:20	09/09/09 09:30
G-RS4SED-4-090809	SSI0049-18	Soil	09/08/09 12:25	09/09/09 09:30
TRIP BLANK	SSI0049-19	Soil	09/08/09 00:00	09/09/09 09:30

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	**66.3**	-----	12.8	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 09:55	
Heavy Oil Range Hydrocarbons	"	**464**	-----	31.9	"	"	"	"	"	
Surrogate(s): 2-FBP			*92.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*111%*		*50 - 150 %*	"			"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	15.1	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:19	
Heavy Oil Range Hydrocarbons	"	**89.0**	-----	37.8	"	"	"	"	"	
Surrogate(s): 2-FBP			*80.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*99.9%*		*50 - 150 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	12.5	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:43	
Heavy Oil Range Hydrocarbons	"	ND	-----	31.3	"	"	"	"	"	
Surrogate(s): 2-FBP			*78.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*100%*		*50 - 150 %*	"			"	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	14.7	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:06	
Heavy Oil Range Hydrocarbons	"	ND	-----	36.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*69.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*98.7%*		*50 - 150 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	14.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:30	
Heavy Oil Range Hydrocarbons	"	ND	-----	37.3	"	"	"	"	"	
Surrogate(s): 2-FBP			*87.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*107%*		*50 - 150 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	11.8	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:54	
Heavy Oil Range Hydrocarbons	"	ND	-----	29.6	"	"	"	"	"	
Surrogate(s): 2-FBP			*81.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*102%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**				
Diesel Range Hydrocarbons	NWTPH-Dx	**62.4**	-----	12.6	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:17	
Heavy Oil Range Hydrocarbons	"	**272**	-----	31.5	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*110%*		*50 - 150 %*	"			"	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**				
Diesel Range Hydrocarbons	NWTPH-Dx	**74.3**	-----	15.2	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:41	
Heavy Oil Range Hydrocarbons	"	**336**	-----	38.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*90.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Diesel Range Hydrocarbons	NWTPH-Dx	ND	-----	0.245	mg/l	1x	9090094	09/15/09 07:58	09/17/09 03:39	
Heavy Oil Range Hydrocarbons	"	ND	-----	0.490	"	"	"	"	"	
Surrogate(s): 2-FBP			*71.5%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*91.7%*		*50 - 150 %*	"			"	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**				**Sampled: 09/08/09 08:30**				
Diesel Range Hydrocarbons	NWTPH-Dx	**24.3**	-----	14.6	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 13:05	
Heavy Oil Range Hydrocarbons	"	**112**	-----	36.6	"	"	"	"	"	
Surrogate(s): 2-FBP			*78.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*90.0%*		*50 - 150 %*	"			"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**				**Sampled: 09/08/09 08:35**				
Diesel Range Hydrocarbons	NWTPH-Dx	**36.9**	-----	14.7	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 09:55	
Heavy Oil Range Hydrocarbons	"	**182**	-----	36.7	"	"	"	"	"	
Surrogate(s): 2-FBP			*89.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*124%*		*50 - 150 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**				**Sampled: 09/08/09 08:45**				
Diesel Range Hydrocarbons	NWTPH-Dx	**73.1**	-----	12.4	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:19	
Heavy Oil Range Hydrocarbons	"	**178**	-----	31.1	"	"	"	"	"	
Surrogate(s): 2-FBP			*91.3%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*121%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Diesel Range Hydrocarbons	NWTPH-Dx	**22.4**	-----	13.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 10:43	
Heavy Oil Range Hydrocarbons	"	**140**	-----	34.7	"	"	"	"	"	
Surrogate(s): *2-FBP*			*83.8%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*119%*		*50 - 150 %*	"			"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Diesel Range Hydrocarbons	NWTPH-Dx	**25.3**	-----	15.3	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:06	
Heavy Oil Range Hydrocarbons	"	**126**	-----	38.2	"	"	"	"	"	
Surrogate(s): *2-FBP*			*80.6%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*113%*		*50 - 150 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Diesel Range Hydrocarbons	NWTPH-Dx	**403**	-----	12.5	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:30	
Heavy Oil Range Hydrocarbons	"	**588**	-----	31.2	"	"	"	"	"	
Surrogate(s): *2-FBP*			*97.1%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*129%*		*50 - 150 %*	"			"	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Diesel Range Hydrocarbons	NWTPH-Dx	**194**	-----	14.1	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 11:54	
Heavy Oil Range Hydrocarbons	"	**492**	-----	35.4	"	"	"	"	"	
Surrogate(s): *2-FBP*			*90.9%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*114%*		*50 - 150 %*	"			"	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Diesel Range Hydrocarbons	NWTPH-Dx	**8830**	-----	142	mg/kg dry	10x	9090105	09/16/09 08:11	09/17/09 12:17	
Heavy Oil Range Hydrocarbons	"	**6980**	-----	355	"	"	"	"	"	
Surrogate(s): *2-FBP*			*54.7%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*71.2%*		*50 - 150 %*	"			"	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Diesel Range Hydrocarbons	NWTPH-Dx	**39.6**	-----	11.9	mg/kg dry	1x	9090105	09/16/09 08:11	09/17/09 12:41	
Heavy Oil Range Hydrocarbons	"	**164**	-----	29.8	"	"	"	"	"	
Surrogate(s): *2-FBP*			*86.2%*		*50 - 150 %*	"			"	
p-Terphenyl-d14			*121%*		*50 - 150 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
PCB-1016	EPA 8082	ND	-----	9.69	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 09:41	
PCB-1221	"	ND	-----	9.69	"	"	"	"	09/23/09 09:18	
PCB-1232	"	ND	-----	9.69	"	"	"	"	"	
PCB-1242	"	ND	-----	9.69	"	"	"	"	"	
PCB-1248	"	ND	-----	9.69	"	"	"	"	"	
PCB-1254	"	ND	-----	9.69	"	"	"	"	"	
PCB-1260	"	**10.4**	-----	9.69	"	"	"	"	09/23/09 09:41	
Surrogate(s): TCX		*61.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*50.5%*			*35 - 157 %*	"			"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
PCB-1016	EPA 8082	ND	-----	9.68	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:11	
PCB-1221	"	ND	-----	9.68	"	"	"	"	09/23/09 09:41	
PCB-1232	"	ND	-----	9.68	"	"	"	"	"	
PCB-1242	"	ND	-----	9.68	"	"	"	"	"	
PCB-1248	"	ND	-----	9.68	"	"	"	"	"	
PCB-1254	"	ND	-----	9.68	"	"	"	"	"	
PCB-1260	"	ND	-----	9.68	"	"	"	"	09/23/09 10:11	
Surrogate(s): TCX		*54.9%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*51.4%*			*35 - 157 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
PCB-1016	EPA 8082	ND	-----	9.51	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:33	
PCB-1221	"	ND	-----	9.51	"	"	"	"	09/23/09 10:11	
PCB-1232	"	ND	-----	9.51	"	"	"	"	"	
PCB-1242	"	ND	-----	9.51	"	"	"	"	"	
PCB-1248	"	ND	-----	9.51	"	"	"	"	"	
PCB-1254	"	ND	-----	9.51	"	"	"	"	"	
PCB-1260	"	ND	-----	9.51	"	"	"	"	09/23/09 10:33	
Surrogate(s): TCX		*8.35%*			*27.9 - 154 %*	"			"	*Z*
Decachlorobiphenyl		*36.5%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
PCB-1016	EPA 8082	ND	-----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 10:56	
PCB-1221	"	ND	-----	9.99	"	"	"	"	09/23/09 10:33	
PCB-1232	"	ND	-----	9.99	"	"	"	"	"	
PCB-1242	"	ND	-----	9.99	"	"	"	"	"	
PCB-1248	"	ND	-----	9.99	"	"	"	"	"	
PCB-1254	"	ND	-----	9.99	"	"	"	"	"	
PCB-1260	"	ND	-----	9.99	"	"	"	"	09/23/09 10:56	
Surrogate(s): TCX		*35.8%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*41.0%*			*35 - 157 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
PCB-1016	EPA 8082	ND	-----	9.54	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 11:19	
PCB-1221	"	ND	-----	9.54	"	"	"	"	09/23/09 10:56	
PCB-1232	"	ND	-----	9.54	"	"	"	"	"	
PCB-1242	"	ND	-----	9.54	"	"	"	"	"	
PCB-1248	"	ND	-----	9.54	"	"	"	"	"	
PCB-1254	"	ND	-----	9.54	"	"	"	"	"	
PCB-1260	"	ND	-----	9.54	"	"	"	"	09/23/09 11:19	
Surrogate(s): TCX		*41.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*37.7%*			*35 - 157 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
PCB-1016	EPA 8082	ND	-----	9.94	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 11:42	
PCB-1221	"	ND	-----	9.94	"	"	"	"	09/23/09 11:19	
PCB-1232	"	ND	-----	9.94	"	"	"	"	"	
PCB-1242	"	ND	-----	9.94	"	"	"	"	"	
PCB-1248	"	ND	-----	9.94	"	"	"	"	"	
PCB-1254	"	ND	-----	9.94	"	"	"	"	"	
PCB-1260	"	ND	-----	9.94	"	"	"	"	09/23/09 11:42	
Surrogate(s): TCX		*32.5%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*58.2%*			*35 - 157 %*	"			"	

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.



Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
PCB-1016	EPA 8082	ND	-----	9.58	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 12:04	
PCB-1221	"	ND	-----	9.58	"	"	"	"	09/23/09 11:42	
PCB-1232	"	ND	-----	9.58	"	"	"	"	"	
PCB-1242	"	ND	-----	9.58	"	"	"	"	"	
PCB-1248	"	ND	-----	9.58	"	"	"	"	"	
PCB-1254	"	ND	-----	9.58	"	"	"	"	"	
PCB-1260	"	ND	-----	9.58	"	"	"	"	09/23/09 12:04	
Surrogate(s): TCX		*39.3%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*34.2%*			*35 - 157 %*	"			"	*Z*
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
PCB-1016	EPA 8082	ND	-----	9.76	ug/kg dry	1x	9090148	09/22/09 15:21	09/23/09 12:27	
PCB-1221	"	ND	-----	9.76	"	"	"	"	09/23/09 12:04	
PCB-1232	"	ND	-----	9.76	"	"	"	"	"	
PCB-1242	"	ND	-----	9.76	"	"	"	"	"	
PCB-1248	"	ND	-----	9.76	"	"	"	"	"	
PCB-1254	"	ND	-----	9.76	"	"	"	"	"	
PCB-1260	"	ND	-----	9.76	"	"	"	"	09/23/09 12:27	
Surrogate(s): TCX		*17.5%*			*27.9 - 154 %*	"			"	*Z*
Decachlorobiphenyl		*26.6%*			*35 - 157 %*	"			"	*Z*
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
PCB-1016	EPA 8082	ND	-----	9.96	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:05	
PCB-1221	"	ND	-----	9.96	"	"	"	"	"	
PCB-1232	"	ND	-----	9.96	"	"	"	"	"	
PCB-1242	"	ND	-----	9.96	"	"	"	"	"	
PCB-1248	"	ND	-----	9.96	"	"	"	"	"	
PCB-1254	"	ND	-----	9.96	"	"	"	"	"	
PCB-1260	"	ND	-----	9.96	"	"	"	"	"	
Surrogate(s): TCX		*27.5%*			*27.9 - 154 %*	"			"	*Z*
Decachlorobiphenyl		*35.8%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
PCB-1016	EPA 8082	ND	-----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:28	
PCB-1221	"	ND	-----	9.99	"	"	"	"	"	
PCB-1232	"	ND	-----	9.99	"	"	"	"	"	
PCB-1242	"	ND	-----	9.99	"	"	"	"	"	
PCB-1248	"	ND	-----	9.99	"	"	"	"	"	
PCB-1254	"	ND	-----	9.99	"	"	"	"	"	
PCB-1260	"	ND	-----	9.99	"	"	"	"	"	
Surrogate(s): TCX		*65.1%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*64.6%*			*35 - 157 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
PCB-1016	EPA 8082	ND	-----	9.95	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 13:50	
PCB-1221	"	ND	-----	9.95	"	"	"	"	"	
PCB-1232	"	ND	-----	9.95	"	"	"	"	"	
PCB-1242	"	ND	-----	9.95	"	"	"	"	"	
PCB-1248	"	ND	-----	9.95	"	"	"	"	"	
PCB-1254	"	ND	-----	9.95	"	"	"	"	"	
PCB-1260	"	ND	-----	9.95	"	"	"	"	"	
Surrogate(s): TCX		*66.8%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*64.7%*			*35 - 157 %*	"			"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
PCB-1016	EPA 8082	ND	-----	9.99	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:13	
PCB-1221	"	ND	-----	9.99	"	"	"	"	"	
PCB-1232	"	ND	-----	9.99	"	"	"	"	"	
PCB-1242	"	ND	-----	9.99	"	"	"	"	"	
PCB-1248	"	ND	-----	9.99	"	"	"	"	"	
PCB-1254	"	ND	-----	9.99	"	"	"	"	"	
PCB-1260	"	ND	-----	9.99	"	"	"	"	"	
Surrogate(s): TCX		*101%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*114%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
PCB-1016	EPA 8082	ND	-----	9.79	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:35	
PCB-1221	"	ND	-----	9.79	"	"	"	"	"	
PCB-1232	"	ND	-----	9.79	"	"	"	"	"	
PCB-1242	"	ND	-----	9.79	"	"	"	"	"	
PCB-1248	"	ND	-----	9.79	"	"	"	"	"	
PCB-1254	"	ND	-----	9.79	"	"	"	"	"	
PCB-1260	"	ND	-----	9.79	"	"	"	"	"	
Surrogate(s): TCX		*75.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*68.9%*			*35 - 157 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
PCB-1016	EPA 8082	ND	-----	9.98	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 14:58	
PCB-1221	"	ND	-----	9.98	"	"	"	"	"	
PCB-1232	"	ND	-----	9.98	"	"	"	"	"	
PCB-1242	"	ND	-----	9.98	"	"	"	"	"	
PCB-1248	"	ND	-----	9.98	"	"	"	"	"	
PCB-1254	"	ND	-----	9.98	"	"	"	"	"	
PCB-1260	"	ND	-----	9.98	"	"	"	"	"	
Surrogate(s): TCX		*104%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*55.4%*			*35 - 157 %*	"			"	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
PCB-1016	EPA 8082	ND	-----	9.62	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 15:21	
PCB-1221	"	ND	-----	9.62	"	"	"	"	"	
PCB-1232	"	ND	-----	9.62	"	"	"	"	"	
PCB-1242	"	ND	-----	9.62	"	"	"	"	"	
PCB-1248	"	ND	-----	9.62	"	"	"	"	"	
PCB-1254	"	ND	-----	9.62	"	"	"	"	"	
PCB-1260	"	ND	-----	9.62	"	"	"	"	"	
Surrogate(s): TCX		*109%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*82.0%*			*35 - 157 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					**C7**
PCB-1016	EPA 8082	ND	-----	9.66	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 17:37	
PCB-1221	"	ND	-----	9.66	"	"	"	"	"	
PCB-1232	"	ND	-----	9.66	"	"	"	"	"	
PCB-1242	"	ND	-----	9.66	"	"	"	"	"	
PCB-1248	"	ND	-----	9.66	"	"	"	"	"	
PCB-1254	"	ND	-----	9.66	"	"	"	"	"	
PCB-1260	"	ND	-----	9.66	"	"	"	"	"	
Surrogate(s): TCX		*103%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*11.2%*			*35 - 157 %*	"			"	*Z*
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
PCB-1016	EPA 8082	ND	-----	9.55	ug/kg dry	1x	9090148	09/22/09 15:21	09/24/09 15:43	
PCB-1221	"	ND	-----	9.55	"	"	"	"	"	
PCB-1232	"	ND	-----	9.55	"	"	"	"	"	
PCB-1242	"	ND	-----	9.55	"	"	"	"	"	
PCB-1248	"	ND	-----	9.55	"	"	"	"	"	
PCB-1254	"	ND	-----	9.55	"	"	"	"	"	
PCB-1260	"	ND	-----	9.55	"	"	"	"	"	
Surrogate(s): TCX		*67.6%*			*27.9 - 154 %*	"			"	
Decachlorobiphenyl		*55.6%*			*35 - 157 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00850	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 22:01	
2-Methylnaphthalene	"	ND	-----	0.00850	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00850	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00850	"	"	"	"	"	
Anthracene	"	ND	-----	0.00850	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00850	"	"	"	"	"	I01
Benzo (a) pyrene	"	ND	-----	0.00850	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	**0.0147**	-----	0.00850	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0193**	-----	0.00850	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND	-----	0.00850	"	"	"	"	"	I01
Chrysene	"	**0.00907**	-----	0.00850	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.00907**	-----	0.00850	"	"	"	"	"	I01
Fluoranthene	"	ND	-----	0.00850	"	"	"	"	"	
Fluorene	"	ND	-----	0.00850	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0113**	-----	0.00850	"	"	"	"	"	I01
Naphthalene	"	ND	-----	0.00850	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00850	"	"	"	"	"	
Pyrene	"	**0.0204**	-----	0.00850	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*29.2%*			*38.8 - 139 %*	"			"	***Z3***
2-FBP		*35.6%*			*40 - 132 %*	"			"	***Z3***
p-Terphenyl-d14		*83.2%*			*31.7 - 179 %*	"			"	***I01***
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00494	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:50	
2-Methylnaphthalene	"	ND	-----	0.00494	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00494	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00494	"	"	"	"	"	
Anthracene	"	ND	-----	0.00494	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00494	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00494	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.0155**	-----	0.00494	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00672**	-----	0.00494	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00494	"	"	"	"	"	
Chrysene	"	**0.00941**	-----	0.00494	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00494	"	"	"	"	"	
Fluoranthene	"	**0.00874**	-----	0.00494	"	"	"	"	"	
Fluorene	"	ND	-----	0.00494	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00494	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Naphthalene	EPA 8270 mod.	ND	-----	0.00494	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:50	
Phenanthrene	"	ND	-----	0.00494	"	"	"	"	"	
Pyrene	"	**0.00874**	-----	0.00494	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*92.2%*			*38.8 - 139 %*	"			"	
2-FBP		*100%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*89.8%*			*31.7 - 179 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00417	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 21:24	
2-Methylnaphthalene	"	ND	-----	0.00417	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00417	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00417	"	"	"	"	"	
Anthracene	"	ND	-----	0.00417	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00417	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00417	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00417	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00417	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00417	"	"	"	"	"	
Chrysene	"	ND	-----	0.00417	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00417	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00417	"	"	"	"	"	
Fluorene	"	ND	-----	0.00417	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00417	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00417	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00417	"	"	"	"	"	
Pyrene	"	ND	-----	0.00417	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*78.6%*			*38.8 - 139 %*	"			"	
2-FBP		*87.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*85.8%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00489	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:20	
2-Methylnaphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00489	"	"	"	"	"	
Anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Chrysene	"	ND	-----	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Fluorene	"	ND	-----	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00489	"	"	"	"	"	
Pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Surrogate(s): *Nitrobenzene-d5*		*77.8%*			*38.8 - 139 %*	"			"	
2-FBP		*78.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*83.6%*			*31.7 - 179 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00497	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:42	
2-Methylnaphthalene	"	ND	-----	0.00497	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00497	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00497	"	"	"	"	"	
Anthracene	"	ND	-----	0.00497	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00497	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00497	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00530**	-----	0.00497	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00497	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00497	"	"	"	"	"	
Chrysene	"	ND	-----	0.00497	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00497	"	"	"	"	"	
Fluoranthene	"	**0.0139**	-----	0.00497	"	"	"	"	"	
Fluorene	"	ND	-----	0.00497	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00497	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Naphthalene	EPA 8270 mod.	ND	-----	0.00497	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 20:42	
Phenanthrene	"	ND	-----	0.00497	"	"	"	"	"	
Pyrene	"	**0.0119**	-----	0.00497	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*83.0%*			*38.8 - 139 %*	"			"	
2-FBP		*88.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*84.8%*			*31.7 - 179 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00473	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 21:03	
2-Methylnaphthalene	"	ND	-----	0.00473	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00473	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00473	"	"	"	"	"	
Anthracene	"	ND	-----	0.00473	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00473	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00473	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00473	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00473	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00473	"	"	"	"	"	
Chrysene	"	ND	-----	0.00473	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00473	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00473	"	"	"	"	"	
Fluorene	"	ND	-----	0.00473	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00473	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00473	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00473	"	"	"	"	"	
Pyrene	"	ND	-----	0.00473	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*78.2%*			*38.8 - 139 %*	"			"	
2-FBP		*80.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*81.0%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00841	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 21:18	
2-Methylnaphthalene	"	ND	-----	0.00841	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00841	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00841	"	"	"	"	"	
Anthracene	"	ND	-----	0.00841	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00841	"	"	"	"	"	I01
Benzo (a) pyrene	"	ND	-----	0.00841	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND	-----	0.00841	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0112**	-----	0.00841	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND	-----	0.00841	"	"	"	"	"	I01
Chrysene	"	ND	-----	0.00841	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.00897**	-----	0.00841	"	"	"	"	"	I01
Fluoranthene	"	ND	-----	0.00841	"	"	"	"	"	
Fluorene	"	ND	-----	0.00841	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00841	"	"	"	"	"	I01
Naphthalene	"	ND	-----	0.00841	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00841	"	"	"	"	"	
Pyrene	"	ND	-----	0.00841	"	"	"	"	"	I01
Surrogate(s): *Nitrobenzene-d5*		*44.8%*			*38.8 - 139 %*	"			"	
2-FBP		*48.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*90.0%*			*31.7 - 179 %*	"			"	*I01*
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:28	
2-Methylnaphthalene	"	ND	-----	0.00498	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00498	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00498	"	"	"	"	"	
Anthracene	"	ND	-----	0.00498	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00498	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00498	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00498	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0115**	-----	0.00498	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00498	"	"	"	"	"	
Chrysene	"	ND	-----	0.00498	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00745**	-----	0.00498	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00498	"	"	"	"	"	
Fluorene	"	ND	-----	0.00498	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00881**	-----	0.00498	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Naphthalene	EPA 8270 mod.	ND	-----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:28	
Phenanthrene	"	ND	-----	0.00498	"	"	"	"	"	
Pyrene	"	ND	-----	0.00498	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*47.2%*			*38.8 - 139 %*	"			"	
2-FBP		*50.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*53.0%*			*31.7 - 179 %*	"			"	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00488	mg/kg dry	1x	9090116	09/17/09 12:06	09/19/09 00:36	
2-Methylnaphthalene	"	ND	-----	0.00488	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00488	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00488	"	"	"	"	"	
Anthracene	"	ND	-----	0.00488	"	"	"	"	"	
Benzo (a) anthracene	"	**0.00586**	-----	0.00488	"	"	"	"	"	
Benzo (a) pyrene	"	**0.00521**	-----	0.00488	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00488	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00586**	-----	0.00488	"	"	"	"	"	
Benzo (k) fluoranthene	"	**0.0104**	-----	0.00488	"	"	"	"	"	
Chrysene	"	**0.00976**	-----	0.00488	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00488	"	"	"	"	"	
Fluoranthene	"	**0.00716**	-----	0.00488	"	"	"	"	"	
Fluorene	"	ND	-----	0.00488	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00488	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00488	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00488	"	"	"	"	"	
Pyrene	"	**0.0143**	-----	0.00488	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*84.4%*			*38.8 - 139 %*	"			"	
2-FBP		*87.6%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*98.0%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00489	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:49	
2-Methylnaphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00489	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00489	"	"	"	"	"	
Anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.00587**	-----	0.00489	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.00848**	-----	0.00489	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Chrysene	"	ND	-----	0.00489	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00522**	-----	0.00489	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00489	"	"	"	"	"	
Fluorene	"	ND	-----	0.00489	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00718**	-----	0.00489	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00489	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00489	"	"	"	"	"	
Pyrene	"	ND	-----	0.00489	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*59.4%*			*38.8 - 139 %*	"			"	
2-FBP		*70.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*64.8%*			*31.7 - 179 %*	"			"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
1-Methylnapthalene	EPA 8270 mod.	**0.101**	-----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/23/09 17:31	
2-Methylnaphthalene	"	ND	-----	0.00498	"	"	"	"	"	
Acenaphthene	"	**0.0453**	-----	0.00498	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00498	"	"	"	"	"	
Anthracene	"	**0.0122**	-----	0.00498	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0326**	-----	0.00498	"	"	"	"	"	
Benzo (a) pyrene	"	**0.0774**	-----	0.00498	"	"	"	"	"	
Benzo (b) fluoranthene	"	**0.143**	-----	0.00498	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.106**	-----	0.00498	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00498	"	"	"	"	"	
Chrysene	"	**0.0625**	-----	0.00498	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.0370**	-----	0.00498	"	"	"	"	"	
Fluoranthene	"	**0.0293**	-----	0.00498	"	"	"	"	"	
Fluorene	"	**0.0840**	-----	0.00498	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0746**	-----	0.00498	"	"	"	"	"	
Naphthalene	"	**0.0122**	-----	0.00498	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Phenanthrene	EPA 8270 mod.	**0.0802**	-----	0.00498	mg/kg dry	1x	9090116	09/17/09 12:06	09/23/09 17:31	
Pyrene	"	**0.129**	-----	0.00498	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*85.8%*			*38.8 - 139 %*	"			"	
2-FBP		*96.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*119%*			*31.7 - 179 %*	"			"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00462	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:07	
2-Methylnaphthalene	"	ND	-----	0.00462	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00462	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00462	"	"	"	"	"	
Anthracene	"	ND	-----	0.00462	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00462	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00462	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00462	"	"	"	"	"	
Benzo (ghi) perylene	"	ND	-----	0.00462	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00462	"	"	"	"	"	
Chrysene	"	ND	-----	0.00462	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00462	"	"	"	"	"	
Fluoranthene	"	**0.00616**	-----	0.00462	"	"	"	"	"	
Fluorene	"	ND	-----	0.00462	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00462	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00462	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00462	"	"	"	"	"	
Pyrene	"	**0.00555**	-----	0.00462	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*65.6%*			*38.8 - 139 %*	"			"	
2-FBP		*66.8%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*76.2%*			*31.7 - 179 %*	"			"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00499	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:28	
2-Methylnaphthalene	"	ND	-----	0.00499	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00499	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00499	"	"	"	"	"	
Anthracene	"	ND	-----	0.00499	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00499	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00499	"	"	"	"	"	**I01**
Benzo (b) fluoranthene	"	ND	-----	0.00499	"	"	"	"	"	**I01**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Benzo (ghi) perylene	EPA 8270 mod.	ND	-----	0.00499	mg/kg dry	1x	9090116	09/17/09 12:06	09/18/09 22:28	**I01**
Benzo (k) fluoranthene	"	ND	-----	0.00499	"	"	"	"	"	**I01**
Chrysene	"	ND	-----	0.00499	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	ND	-----	0.00499	"	"	"	"	"	**I01**
Fluoranthene	"	ND	-----	0.00499	"	"	"	"	"	
Fluorene	"	ND	-----	0.00499	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	ND	-----	0.00499	"	"	"	"	"	**I01**
Naphthalene	"	ND	-----	0.00499	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00499	"	"	"	"	"	
Pyrene	"	ND	-----	0.00499	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*82.6%*			*38.8 - 139 %*	"			"	
2-FBP		*92.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*83.0%*			*31.7 - 179 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
1-Methylnapthalene	EPA 8270 mod.	**0.0964**	-----	0.00831	mg/kg dry	2x	9090116	09/17/09 12:06	09/21/09 21:39	
2-Methylnaphthalene	"	ND	-----	0.00831	"	"	"	"	"	
Acenaphthene	"	**0.103**	-----	0.00831	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00831	"	"	"	"	"	
Anthracene	"	**0.120**	-----	0.00831	"	"	"	"	"	
Benzo (a) anthracene	"	**0.0709**	-----	0.00831	"	"	"	"	"	**I01**
Benzo (a) pyrene	"	**0.0333**	-----	0.00831	"	"	"	"	"	**I01**
Benzo (b) fluoranthene	"	**0.0388**	-----	0.00831	"	"	"	"	"	**I01**
Benzo (ghi) perylene	"	**0.0299**	-----	0.00831	"	"	"	"	"	**I01**
Benzo (k) fluoranthene	"	ND	-----	0.00831	"	"	"	"	"	**I01**
Chrysene	"	**0.129**	-----	0.00831	"	"	"	"	"	**I01**
Dibenzo (a,h) anthracene	"	**0.0111**	-----	0.00831	"	"	"	"	"	**I01**
Fluoranthene	"	**0.0521**	-----	0.00831	"	"	"	"	"	
Fluorene	"	**0.0998**	-----	0.00831	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0144**	-----	0.00831	"	"	"	"	"	**I01**
Naphthalene	"	ND	-----	0.00831	"	"	"	"	"	
Phenanthrene	"	**0.354**	-----	0.00831	"	"	"	"	"	
Pyrene	"	**0.440**	-----	0.00831	"	"	"	"	"	**I01**
Surrogate(s): Nitrobenzene-d5		*36.0%*			*38.8 - 139 %*	"			"	***Z3***
2-FBP		*42.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*76.4%*			*31.7 - 179 %*	"			"	***I01***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
1-Methylnapthalene	EPA 8270 mod.	**0.0176**	-----	0.00471	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 20:36	
2-Methylnaphthalene	"	ND	-----	0.00471	"	"	"	"	"	
Acenaphthene	"	**0.0101**	-----	0.00471	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00471	"	"	"	"	"	
Anthracene	"	**0.00817**	-----	0.00471	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00471	"	"	"	"	"	I01
Benzo (a) pyrene	"	**0.0101**	-----	0.00471	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND	-----	0.00471	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0277**	-----	0.00471	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	ND	-----	0.00471	"	"	"	"	"	I01
Chrysene	"	**0.0101**	-----	0.00471	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.0151**	-----	0.00471	"	"	"	"	"	I01
Fluoranthene	"	ND	-----	0.00471	"	"	"	"	"	
Fluorene	"	**0.0151**	-----	0.00471	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0182**	-----	0.00471	"	"	"	"	"	I01
Naphthalene	"	ND	-----	0.00471	"	"	"	"	"	
Phenanthrene	"	**0.0214**	-----	0.00471	"	"	"	"	"	
Pyrene	"	**0.0270**	-----	0.00471	"	"	"	"	"	I01
Surrogate(s): Nitrobenzene-d5		*60.0%*			*38.8 - 139 %*	"			"	
2-FBP		*62.0%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*122%*			*31.7 - 179 %*	"			"	*I01*
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00947	mg/kg dry	2x	9090116	09/17/09 12:06	09/19/09 06:40	
2-Methylnaphthalene	"	ND	-----	0.00947	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00947	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00947	"	"	"	"	"	
Anthracene	"	ND	-----	0.00947	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00947	"	"	"	"	"	I01
Benzo (a) pyrene	"	**0.0455**	-----	0.00947	"	"	"	"	"	I01
Benzo (b) fluoranthene	"	ND	-----	0.00947	"	"	"	"	"	I01
Benzo (ghi) perylene	"	**0.0101**	-----	0.00947	"	"	"	"	"	I01
Benzo (k) fluoranthene	"	**0.0467**	-----	0.00947	"	"	"	"	"	I01
Chrysene	"	**0.0455**	-----	0.00947	"	"	"	"	"	I01
Dibenzo (a,h) anthracene	"	**0.0152**	-----	0.00947	"	"	"	"	"	I01
Fluoranthene	"	**0.0189**	-----	0.00947	"	"	"	"	"	
Fluorene	"	ND	-----	0.00947	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.0114**	-----	0.00947	"	"	"	"	"	I01
Naphthalene	"	ND	-----	0.00947	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Phenanthrene	EPA 8270 mod.	**0.0202**	-----	0.00947	mg/kg dry	2x	9090116	09/17/09 12:06	09/19/09 06:40	
Pyrene	"	**0.0960**	-----	0.00947	"	"	"	"	"	**I01**
Surrogate(s): Nitrobenzene-d5		*104%*			*38.8 - 139 %*	"			"	
2-FBP		*148%*			*40 - 132 %*	"			"	***ZX***
p-Terphenyl-d14		*319%*			*31.7 - 179 %*	"			"	***I01. ZX***
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
1-Methylnapthalene	EPA 8270 mod.	ND	-----	0.00477	mg/kg dry	1x	9090116	09/17/09 12:06	09/21/09 18:06	
2-Methylnaphthalene	"	ND	-----	0.00477	"	"	"	"	"	
Acenaphthene	"	ND	-----	0.00477	"	"	"	"	"	
Acenaphthylene	"	ND	-----	0.00477	"	"	"	"	"	
Anthracene	"	ND	-----	0.00477	"	"	"	"	"	
Benzo (a) anthracene	"	ND	-----	0.00477	"	"	"	"	"	
Benzo (a) pyrene	"	ND	-----	0.00477	"	"	"	"	"	
Benzo (b) fluoranthene	"	ND	-----	0.00477	"	"	"	"	"	
Benzo (ghi) perylene	"	**0.0101**	-----	0.00477	"	"	"	"	"	
Benzo (k) fluoranthene	"	ND	-----	0.00477	"	"	"	"	"	
Chrysene	"	ND	-----	0.00477	"	"	"	"	"	
Dibenzo (a,h) anthracene	"	**0.00796**	-----	0.00477	"	"	"	"	"	
Fluoranthene	"	ND	-----	0.00477	"	"	"	"	"	
Fluorene	"	ND	-----	0.00477	"	"	"	"	"	
Indeno (1,2,3-cd) pyrene	"	**0.00849**	-----	0.00477	"	"	"	"	"	
Naphthalene	"	ND	-----	0.00477	"	"	"	"	"	
Phenanthrene	"	ND	-----	0.00477	"	"	"	"	"	
Pyrene	"	**0.00636**	-----	0.00477	"	"	"	"	"	
Surrogate(s): Nitrobenzene-d5		*45.2%*			*38.8 - 139 %*	"			"	
2-FBP		*47.4%*			*40 - 132 %*	"			"	
p-Terphenyl-d14		*52.6%*			*31.7 - 179 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**				**Sampled: 09/07/09 13:50**				
% Solids	TA SOP	**78.4**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
% Solids	TA SOP	**66.1**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
% Solids	TA SOP	**79.9**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**				**Sampled: 09/07/09 14:50**				
% Solids	TA SOP	**68.1**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**				**Sampled: 09/07/09 15:30**				
% Solids	TA SOP	**67.1**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**				**Sampled: 09/07/09 15:25**				
% Solids	TA SOP	**84.5**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**				
% Solids	TA SOP	**79.3**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**				
% Solids	TA SOP	**65.6**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**				**Sampled: 09/08/09 08:30**				
% Solids	TA SOP	**68.3**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**				**Sampled: 09/08/09 08:35**				
% Solids	TA SOP	**68.1**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**				**Sampled: 09/08/09 08:45**				

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Conventional Chemistry Parameters by APHA/EPA Methods

TestAmerica Spokane

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
% Solids	TA SOP	**80.4**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
% Solids	TA SOP	**72.1**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
% Solids	TA SOP	**65.4**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
% Solids	TA SOP	**80.2**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
% Solids	TA SOP	**70.7**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
% Solids	TA SOP	**70.4**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
% Solids	TA SOP	**83.8**	-----	0.0100	% by Weight	1x	9090117	09/16/09 10:00	09/17/09 16:47	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.
18300 NE Union Hill Rd. Suite 200
Redmond, WA 98077

Project Name: **Avery Landing**
Project Number: 073-93312-03
Project Manager: Doug Morell

Report Created:
10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)			**Soil**			**Sampled: 09/07/09 13:50**				
Mercury	7471A Dry	**0.061**	*0.0074*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:28	
SSI0049-02 (G-RS1SED-0-090709)			**Soil**			**Sampled: 09/07/09 13:55**				
Mercury	7471A Dry	ND	*0.0087*	0.028	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:32	
SSI0049-03 (G-RS8SED-3-090709)			**Soil**			**Sampled: 09/07/09 14:45**				
Mercury	7471A Dry	ND	*0.0070*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:36	
SSI0049-04 (G-RS8SED-0-090709)			**Soil**			**Sampled: 09/07/09 14:50**				
Mercury	7471A Dry	**0.026**	*0.0084*	0.027	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:40	**J**
SSI0049-05 (G-RS7SED-0-090709)			**Soil**			**Sampled: 09/07/09 15:30**				
Mercury	7471A Dry	ND	*0.0082*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:44	
SSI0049-06 (G-RS7SED-4-090709)			**Soil**			**Sampled: 09/07/09 15:25**				
Mercury	7471A Dry	ND	*0.0075*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:49	
SSI0049-07 (G-RS2SED-3-090709)			**Soil**			**Sampled: 09/07/09 16:15**				
Mercury	7471A Dry	ND	*0.0077*	0.024	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:01	
SSI0049-08 (G-RS2SED-0-090709)			**Soil**			**Sampled: 09/07/09 16:20**				
Mercury	7471A Dry	**0.021**	*0.0078*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:05	**J**
SSI0049-09 (G-EB-090709)			**Water**			**Sampled: 09/07/09 17:00**				
Mercury	7470A	ND	*0.000041*	0.00020	mg/L	1x	50776	09/23/09 15:17	09/23/09 17:35	
SSI0049-10 (G-RS5SED-0-090809)			**Soil**			**Sampled: 09/08/09 08:30**				
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:10	
SSI0049-11 (G-RS5DSED-0-090809)			**Soil**			**Sampled: 09/08/09 08:35**				
Mercury	7471A Dry	ND	*0.0081*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:15	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Mercury (CVAA)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**				**Sampled: 09/08/09 08:45**				
Mercury	7471A Dry	**0.013**	*0.0068*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:19	**J**
SSI0049-13 (G-RS6SED-0-090809)		**Soil**				**Sampled: 09/08/09 07:40**				
Mercury	7471A Dry	**0.020**	*0.0083*	0.026	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 14:11	**J**
SSI0049-14 (G-RS6SED-3-090809)		**Soil**				**Sampled: 09/08/09 07:35**				
Mercury	7471A Dry	ND	*0.0080*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:23	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**				**Sampled: 09/08/09 11:15**				
Mercury	7471A Dry	**0.0099**	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:27	**J**
SSI0049-16 (G-RS3SED-0-090809)		**Soil**				**Sampled: 09/08/09 11:10**				
Mercury	7471A Dry	**0.0085**	*0.0079*	0.025	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:32	**J**
SSI0049-17 (G-RS4SED-0-090809)		**Soil**				**Sampled: 09/08/09 12:20**				
Mercury	7471A Dry	ND	*0.0071*	0.022	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:37	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**				**Sampled: 09/08/09 12:25**				
Mercury	7471A Dry	**0.020**	*0.0066*	0.021	mg/Kg dry	1x	50676	09/22/09 11:48	09/22/09 15:41	**J**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Calcium	6010B TMP Dry	**1300**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:50	
Iron	"	**13000**	*0.53*	11	"	"	"	"	"	**B**
Magnesium	"	**3000**	*0.75*	63	"	"	"	"	"	**B**
Potassium	"	**760**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.8*	110	"	"	"	"	09/23/09 17:33	*
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Calcium	6010B TMP Dry	**830**	*2.1*	77	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:54	
Iron	"	**13000**	*0.65*	14	"	"	"	"	"	**B**
Magnesium	"	**3300**	*0.93*	77	"	"	"	"	"	**B**
Potassium	"	**900**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.063*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.5*	140	"	"	"	"	09/23/09 17:35	*
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
Calcium	6010B TMP Dry	**1200**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:58	
Iron	"	**13000**	*0.54*	12	"	"	"	"	"	**B**
Magnesium	"	**3400**	*0.78*	65	"	"	"	"	"	**B**
Potassium	"	**910**	*19*	190	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.0*	120	"	"	"	"	09/23/09 17:37	*
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Calcium	6010B TMP Dry	**1100**	*2.2*	81	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:01	
Iron	"	**15000**	*0.67*	15	"	"	"	"	"	**B**
Magnesium	"	**4400**	*0.97*	81	"	"	"	"	"	**B**
Potassium	"	**1300**	*23*	240	"	"	"	"	"	
Silver	"	ND	*0.066*	1.5	"	"	"	"	"	
Sodium	"	ND	*10*	150	"	"	"	"	09/23/09 17:39	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Calcium	6010B TMP Dry	**1200**	*2.0*	74	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:06	
Iron	"	**14000**	*0.62*	14	"	"	"	"	"	**B**
Magnesium	"	**4400**	*0.89*	74	"	"	"	"	"	**B**
Potassium	"	**1400**	*22*	220	"	"	"	"	"	
Silver	"	ND	*0.061*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.2*	140	"	"	"	"	09/23/09 17:41	*
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Calcium	6010B TMP Dry	**590**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:09	
Iron	"	**11000**	*0.53*	11	"	"	"	"	"	**B**
Magnesium	"	**2200**	*0.76*	63	"	"	"	"	"	**B**
Potassium	"	**560**	*18*	190	"	"	"	"	"	
Silver	"	**0.053**	*0.052*	1.1	"	"	"	"	"	**J**
Sodium	"	ND	*7.8*	110	"	"	"	"	09/23/09 17:44	*
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Calcium	6010B TMP Dry	**2700**	*1.8*	67	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:14	
Iron	"	**12000**	*0.56*	12	"	"	"	"	"	**B**
Magnesium	"	**3600**	*0.81*	67	"	"	"	"	"	**B**
Potassium	"	**690**	*20*	200	"	"	"	"	"	
Silver	"	ND	*0.055*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.3*	120	"	"	"	"	09/23/09 17:46	*
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Calcium	6010B TMP Dry	**8500**	*2.0*	72	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:19	
Iron	"	**14000**	*0.60*	13	"	"	"	"	"	**B**
Magnesium	"	**5300**	*0.87*	72	"	"	"	"	"	**B**
Potassium	"	**1200**	*21*	220	"	"	"	"	"	
Silver	"	ND	*0.059*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.9*	130	"	"	"	"	09/23/09 17:48	*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Calcium	6010B TMP Dry	**1300**	*2.1*	77	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:23	
Iron	"	**16000**	*0.64*	14	"	"	"	"	"	**B**
Magnesium	"	**4100**	*0.92*	77	"	"	"	"	"	**B**
Potassium	"	**1200**	*22*	230	"	"	"	"	"	
Silver	"	ND	*0.063*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.5*	140	"	"	"	"	09/23/09 17:51	*
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Calcium	6010B TMP Dry	**1400**	*2.0*	74	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:26	
Iron	"	**16000**	*0.62*	14	"	"	"	"	"	**B**
Magnesium	"	**4100**	*0.89*	74	"	"	"	"	"	**B**
Potassium	"	**1100**	*22*	220	"	"	"	"	"	
Silver	"	ND	*0.061*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.2*	140	"	"	"	"	09/23/09 17:53	*
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Calcium	6010B TMP Dry	**970**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:38	
Iron	"	**12000**	*0.55*	12	"	"	"	"	"	**B**
Magnesium	"	**2800**	*0.78*	65	"	"	"	"	"	**B**
Potassium	"	**980**	*19*	200	"	"	"	"	"	
Silver	"	ND	*0.053*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.1*	120	"	"	"	"	09/23/09 18:01	*
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Calcium	6010B TMP Dry	**1000**	*1.9*	70	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 20:23	
Iron	"	**16000**	*0.58*	13	"	"	"	"	"	**B**
Magnesium	"	**4300**	*0.84*	70	"	"	"	"	"	**B**
Potassium	"	**1100**	*20*	210	"	"	"	"	"	
Silver	"	ND	*0.057*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.6*	130	"	"	"	"	09/23/09 17:12	*

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Calcium	6010B TMP Dry	**890**	*2.1*	78	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:42	
Iron	"	**15000**	*0.65*	14	"	"	"	"	"	**B**
Magnesium	"	**4000**	*0.94*	78	"	"	"	"	"	**B**
Potassium	"	**1100**	*23*	230	"	"	"	"	"	
Silver	"	ND	*0.064*	1.4	"	"	"	"	"	
Sodium	"	ND	*9.7*	140	"	"	"	"	09/23/09 18:04	*
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Calcium	6010B TMP Dry	**1500**	*1.7*	62	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:46	
Iron	"	**16000**	*0.52*	11	"	"	"	"	"	**B**
Magnesium	"	**3000**	*0.74*	62	"	"	"	"	"	**B**
Potassium	"	**880**	*18*	180	"	"	"	"	"	
Silver	"	ND	*0.050*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.6*	110	"	"	"	"	09/23/09 18:06	*
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Calcium	6010B TMP Dry	**1400**	*1.9*	71	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:50	
Iron	"	**14000**	*0.59*	13	"	"	"	"	"	**B**
Magnesium	"	**3300**	*0.85*	71	"	"	"	"	"	**B**
Potassium	"	**1000**	*21*	210	"	"	"	"	"	
Silver	"	ND	*0.058*	1.3	"	"	"	"	"	
Sodium	"	ND	*8.8*	130	"	"	"	"	09/23/09 18:08	*
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Calcium	6010B TMP Dry	**1100**	*1.8*	65	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:54	
Iron	"	**13000**	*0.55*	12	"	"	"	"	"	**B**
Magnesium	"	**2800**	*0.78*	65	"	"	"	"	"	**B**
Potassium	"	**750**	*19*	200	"	"	"	"	"	
Silver	"	ND	*0.054*	1.2	"	"	"	"	"	
Sodium	"	ND	*8.1*	120	"	"	"	"	09/23/09 18:11	*

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Calcium	6010B TMP Dry	**850**	*1.7*	63	mg/Kg dry	1x	50667	09/22/09 10:39	09/22/09 21:57	
Iron	"	**12000**	*0.52*	11	"	"	"	"	"	**B**
Magnesium	"	**2300**	*0.75*	63	"	"	"	"	"	**B**
Potassium	"	**590**	*18*	190	"	"	"	"	"	
Silver	"	ND	*0.051*	1.1	"	"	"	"	"	
Sodium	"	ND	*7.7*	110	"	"	"	"	09/23/09 18:13	*

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**						**Sampled: 09/07/09 17:00**		
Aluminum	6010B Total Recoverable	ND	*0.31*	0.50	mg/L	1x	50762	09/23/09 13:31	09/23/09 20:20	
Calcium	"	ND	*0.028*	1.1	"	"	"	"	"	
Iron	"	ND	*0.032*	0.20	"	"	"	"	"	
Magnesium	"	ND	*0.23*	1.1	"	"	"	"	"	
Potassium	"	ND	*0.41*	3.3	"	"	"	"	"	
Sodium	"	ND	*0.18*	2.0	"	"	"	"	"	
Manganese	"	ND	*0.0017*	0.020	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
Aluminum	6020 TMP Dry	**4700**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:45	
Arsenic	"	**7.3**	*0.00089*	0.23	"	"	"	"	"	**B**
Antimony	"	**3.5**	*0.0075*	0.23	"	"	"	"	"	**B**
Barium	"	**34**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00079*	0.23	"	"	"	"	"	
Cadmium	"	**0.061**	*0.00054*	0.23	"	"	"	"	"	**J, B**
Chromium	"	**7.1**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**6.4**	*0.00062*	0.23	"	"	"	"	"	
Copper	"	**50**	*0.0037*	0.23	"	"	"	"	"	
Lead	"	**45**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**170**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**9.9**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	**0.095**	*0.0021*	0.57	"	"	"	"	"	**J, B**
Thallium	"	**0.075**	*0.0046*	0.46	"	"	"	"	"	**J, B**
Vanadium	"	**14**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**34**	*0.017*	0.80	"	"	"	"	"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Aluminum	6020 TMP Dry	**5300**	*0.42*	42	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:50	
Arsenic	"	**5.8**	*0.0011*	0.28	"	"	"	"	"	**B**
Antimony	"	**1.3**	*0.0093*	0.28	"	"	"	"	"	**B**
Barium	"	**31**	*0.0021*	0.28	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00097*	0.28	"	"	"	"	"	**J**
Cadmium	"	**0.023**	*0.00066*	0.28	"	"	"	"	"	**J, B**
Chromium	"	**6.7**	*0.0056*	0.28	"	"	"	"	"	
Cobalt	"	**5.2**	*0.00076*	0.28	"	"	"	"	"	
Copper	"	**23**	*0.0045*	0.28	"	"	"	"	"	
Lead	"	**18**	*0.0014*	0.28	"	"	"	"	"	
Manganese	"	**140**	*0.022*	0.70	"	"	"	"	"	
Nickel	"	**9.0**	*0.0052*	0.28	"	"	"	"	"	
Selenium	"	**0.048**	*0.0026*	0.70	"	"	"	"	"	**J, B**
Thallium	"	**0.078**	*0.0056*	0.56	"	"	"	"	"	**J, B**
Vanadium	"	**10**	*0.0038*	0.28	"	"	"	"	"	
Zinc	"	**26**	*0.021*	0.98	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
Aluminum	6020 TMP Dry	**5400**	*0.35*	35	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 13:55	
Arsenic	"	**5.4**	*0.00092*	0.24	"	"	"	"	"	**B**
Antimony	"	**0.75**	*0.0078*	0.24	"	"	"	"	"	**B**
Barium	"	**27**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.21**	*0.00081*	0.24	"	"	"	"	"	**J**
Cadmium	"	**0.014**	*0.00055*	0.24	"	"	"	"	"	**J, B**
Chromium	"	**6.3**	*0.0047*	0.24	"	"	"	"	"	
Cobalt	"	**7.7**	*0.00064*	0.24	"	"	"	"	"	
Copper	"	**18**	*0.0038*	0.24	"	"	"	"	"	
Lead	"	**8.2**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**190**	*0.019*	0.59	"	"	"	"	"	
Nickel	"	**9.4**	*0.0044*	0.24	"	"	"	"	"	
Selenium	"	**0.12**	*0.0022*	0.59	"	"	"	"	"	**J, B**
Thallium	"	**0.077**	*0.0047*	0.47	"	"	"	"	"	**J, B**
Vanadium	"	**17**	*0.0032*	0.24	"	"	"	"	"	
Zinc	"	**24**	*0.018*	0.82	"	"	"	"	"	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Aluminum	6020 TMP Dry	**7000**	*0.44*	44	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:00	
Arsenic	"	**6.4**	*0.0011*	0.29	"	"	"	"	"	**B**
Antimony	"	**0.64**	*0.0097*	0.29	"	"	"	"	"	**B**
Barium	"	**37**	*0.0022*	0.29	"	"	"	"	"	
Beryllium	"	**0.31**	*0.0010*	0.29	"	"	"	"	"	
Cadmium	"	**0.0095**	*0.00069*	0.29	"	"	"	"	"	**J, B**
Chromium	"	**7.8**	*0.0059*	0.29	"	"	"	"	"	
Cobalt	"	**7.6**	*0.00079*	0.29	"	"	"	"	"	
Copper	"	**21**	*0.0047*	0.29	"	"	"	"	"	
Lead	"	**7.7**	*0.0015*	0.29	"	"	"	"	"	
Manganese	"	**200**	*0.023*	0.73	"	"	"	"	"	
Nickel	"	**11**	*0.0054*	0.29	"	"	"	"	"	
Selenium	"	**0.11**	*0.0028*	0.73	"	"	"	"	"	**J, B**
Thallium	"	**0.097**	*0.0059*	0.59	"	"	"	"	"	**J, B**
Vanadium	"	**18**	*0.0040*	0.29	"	"	"	"	"	
Zinc	"	**28**	*0.022*	1.0	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
Aluminum	6020 TMP Dry	**6900**	*0.41*	41	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:06	
Arsenic	"	**7.0**	*0.0011*	0.27	"	"	"	"	"	**B**
Antimony	"	**0.68**	*0.0089*	0.27	"	"	"	"	"	**B**
Barium	"	**38**	*0.0020*	0.27	"	"	"	"	"	
Beryllium	"	**0.28**	*0.00093*	0.27	"	"	"	"	"	
Cadmium	"	**0.023**	*0.00063*	0.27	"	"	"	"	"	**J, B**
Chromium	"	**7.7**	*0.0054*	0.27	"	"	"	"	"	
Cobalt	"	**7.4**	*0.00073*	0.27	"	"	"	"	"	
Copper	"	**20**	*0.0043*	0.27	"	"	"	"	"	
Lead	"	**8.2**	*0.0014*	0.27	"	"	"	"	"	
Manganese	"	**87**	*0.022*	0.68	"	"	"	"	"	
Nickel	"	**10**	*0.0050*	0.27	"	"	"	"	"	
Selenium	"	**0.11**	*0.0025*	0.68	"	"	"	"	"	**J, B**
Thallium	"	**0.10**	*0.0054*	0.54	"	"	"	"	"	**J, B**
Vanadium	"	**17**	*0.0036*	0.27	"	"	"	"	"	
Zinc	"	**31**	*0.020*	0.95	"	"	"	"	"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Aluminum	6020 TMP Dry	**3300**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:11	
Arsenic	"	**7.5**	*0.00089*	0.23	"	"	"	"	"	**B**
Antimony	"	**210**	*0.0076*	0.23	"	"	"	"	"	**B**
Barium	"	**16**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.13**	*0.00079*	0.23	"	"	"	"	"	**J**
Cadmium	"	ND	*0.00054*	0.23	"	"	"	"	"	
Chromium	"	**5.9**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**4.8**	*0.00062*	0.23	"	"	"	"	"	
Copper	"	**36**	*0.0037*	0.23	"	"	"	"	"	
Lead	"	**600**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**110**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**7.6**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	**0.085**	*0.0022*	0.57	"	"	"	"	"	**J, B**
Thallium	"	**0.051**	*0.0046*	0.46	"	"	"	"	"	**J, B**
Vanadium	"	**9.6**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**24**	*0.017*	0.80	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Aluminum	6020 TMP Dry	**4100**	*0.37*	37	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:16	
Arsenic	"	**6.2**	*0.00095*	0.24	"	"	"	"	"	**B**
Antimony	"	**5.5**	*0.0081*	0.24	"	"	"	"	"	**B**
Barium	"	**24**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.16**	*0.00084*	0.24	"	"	"	"	"	**J**
Cadmium	"	**0.0067**	*0.00057*	0.24	"	"	"	"	"	**J, B**
Chromium	"	**5.3**	*0.0049*	0.24	"	"	"	"	"	
Cobalt	"	**5.0**	*0.00066*	0.24	"	"	"	"	"	
Copper	"	**18**	*0.0039*	0.24	"	"	"	"	"	
Lead	"	**24**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**150**	*0.020*	0.61	"	"	"	"	"	
Nickel	"	**8.6**	*0.0045*	0.24	"	"	"	"	"	
Selenium	"	**0.11**	*0.0023*	0.61	"	"	"	"	"	**J, B**
Thallium	"	**0.059**	*0.0049*	0.49	"	"	"	"	"	**J, B**
Vanadium	"	**14**	*0.0033*	0.24	"	"	"	"	"	
Zinc	"	**22**	*0.018*	0.86	"	"	"	"	"	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Aluminum	6020 TMP Dry	**6700**	*0.39*	39	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:22	
Arsenic	"	**7.6**	*0.0010*	0.26	"	"	"	"	"	**B**
Antimony	"	**1.9**	*0.0087*	0.26	"	"	"	"	"	**B**
Barium	"	**46**	*0.0020*	0.26	"	"	"	"	"	
Beryllium	"	**0.29**	*0.00090*	0.26	"	"	"	"	"	
Cadmium	"	**0.018**	*0.00062*	0.26	"	"	"	"	"	**J, B**
Chromium	"	**8.2**	*0.0052*	0.26	"	"	"	"	"	
Cobalt	"	**7.1**	*0.00071*	0.26	"	"	"	"	"	
Copper	"	**58**	*0.0042*	0.26	"	"	"	"	"	
Lead	"	**17**	*0.0013*	0.26	"	"	"	"	"	
Manganese	"	**260**	*0.021*	0.66	"	"	"	"	"	
Nickel	"	**12**	*0.0049*	0.26	"	"	"	"	"	
Selenium	"	**0.14**	*0.0025*	0.66	"	"	"	"	"	**J, B**
Thallium	"	**0.096**	*0.0052*	0.52	"	"	"	"	"	**J, B**
Vanadium	"	**16**	*0.0035*	0.26	"	"	"	"	"	
Zinc	"	**28**	*0.020*	0.92	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Aluminum	6020 TMP Dry	**6900**	*0.42*	42	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:27	
Arsenic	"	**8.5**	*0.0011*	0.28	"	"	"	"	"	**B**
Antimony	"	**1.2**	*0.0092*	0.28	"	"	"	"	"	**B**
Barium	"	**39**	*0.0021*	0.28	"	"	"	"	"	
Beryllium	"	**0.28**	*0.00097*	0.28	"	"	"	"	"	**J**
Cadmium	"	**0.0077**	*0.00066*	0.28	"	"	"	"	"	**J, B**
Chromium	"	**7.8**	*0.0056*	0.28	"	"	"	"	"	
Cobalt	"	**6.8**	*0.00076*	0.28	"	"	"	"	"	
Copper	"	**22**	*0.0045*	0.28	"	"	"	"	"	
Lead	"	**13**	*0.0014*	0.28	"	"	"	"	"	
Manganese	"	**210**	*0.022*	0.70	"	"	"	"	"	
Nickel	"	**12**	*0.0052*	0.28	"	"	"	"	"	
Selenium	"	**0.17**	*0.0026*	0.70	"	"	"	"	"	**J, B**
Thallium	"	**0.088**	*0.0056*	0.56	"	"	"	"	"	**J, B**
Vanadium	"	**16**	*0.0038*	0.28	"	"	"	"	"	
Zinc	"	**30**	*0.021*	0.98	"	"	"	"	"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Aluminum	6020 TMP Dry	**7000**	*0.41*	41	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:32	
Arsenic	"	**9.0**	*0.0011*	0.27	"	"	"	"	"	**B**
Antimony	"	**1.0**	*0.0089*	0.27	"	"	"	"	"	**B**
Barium	"	**41**	*0.0020*	0.27	"	"	"	"	"	
Beryllium	"	**0.28**	*0.00093*	0.27	"	"	"	"	"	
Cadmium	"	**0.0027**	*0.00064*	0.27	"	"	"	"	"	**J, B**
Chromium	"	**7.9**	*0.0054*	0.27	"	"	"	"	"	
Cobalt	"	**7.0**	*0.00073*	0.27	"	"	"	"	"	
Copper	"	**21**	*0.0043*	0.27	"	"	"	"	"	
Lead	"	**14**	*0.0014*	0.27	"	"	"	"	"	
Manganese	"	**190**	*0.022*	0.68	"	"	"	"	"	
Nickel	"	**11**	*0.0050*	0.27	"	"	"	"	"	
Selenium	"	**0.23**	*0.0025*	0.68	"	"	"	"	"	**J, B**
Thallium	"	**0.087**	*0.0054*	0.54	"	"	"	"	"	**J, B**
Vanadium	"	**17**	*0.0037*	0.27	"	"	"	"	"	
Zinc	"	**34**	*0.020*	0.95	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Aluminum	6020 TMP Dry	**5000**	*0.36*	36	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:48	
Arsenic	"	**28**	*0.00093*	0.24	"	"	"	"	"	**B**
Antimony	"	**8.3**	*0.0078*	0.24	"	"	"	"	"	**B**
Barium	"	**37**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00082*	0.24	"	"	"	"	"	
Cadmium	"	**0.026**	*0.00056*	0.24	"	"	"	"	"	**J, B**
Chromium	"	**7.8**	*0.0048*	0.24	"	"	"	"	"	
Cobalt	"	**5.0**	*0.00064*	0.24	"	"	"	"	"	
Copper	"	**28**	*0.0038*	0.24	"	"	"	"	"	
Lead	"	**23**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**91**	*0.019*	0.59	"	"	"	"	"	
Nickel	"	**8.8**	*0.0044*	0.24	"	"	"	"	"	
Selenium	"	**0.12**	*0.0022*	0.59	"	"	"	"	"	**J, B**
Thallium	"	**0.087**	*0.0048*	0.48	"	"	"	"	"	**J, B**
Vanadium	"	**15**	*0.0032*	0.24	"	"	"	"	"	
Zinc	"	**70**	*0.018*	0.83	"	"	"	"	"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Aluminum	6020 TMP Dry	**6900**	*0.38*	38	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 12:57	
Arsenic	"	**7.1**	*0.00099*	0.25	"	"	"	"	"	**B**
Antimony	"	**0.85**	*0.0084*	0.25	"	"	"	"	"	**B**
Barium	"	**36**	*0.0019*	0.25	"	"	"	"	"	
Beryllium	"	**0.27**	*0.00087*	0.25	"	"	"	"	"	
Cadmium	"	**0.019**	*0.00060*	0.25	"	"	"	"	"	**J, B**
Chromium	"	**7.8**	*0.0051*	0.25	"	"	"	"	"	
Cobalt	"	**6.7**	*0.00068*	0.25	"	"	"	"	"	
Copper	"	**24**	*0.0041*	0.25	"	"	"	"	"	
Lead	"	**14**	*0.0013*	0.25	"	"	"	"	"	
Manganese	"	**160**	*0.020*	0.63	"	"	"	"	"	
Nickel	"	**12**	*0.0047*	0.25	"	"	"	"	"	
Selenium	"	**0.14**	*0.0024*	0.63	"	"	"	"	"	**J, B**
Thallium	"	**0.092**	*0.0051*	0.51	"	"	"	"	"	**J, B**
Vanadium	"	**17**	*0.0034*	0.25	"	"	"	"	"	
Zinc	"	**31**	*0.019*	0.89	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Aluminum	6020 TMP Dry	**6500**	*0.43*	43	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:53	
Arsenic	"	**9.9**	*0.0011*	0.28	"	"	"	"	"	**B**
Antimony	"	**0.93**	*0.0094*	0.28	"	"	"	"	"	**B**
Barium	"	**49**	*0.0021*	0.28	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00098*	0.28	"	"	"	"	"	**J**
Cadmium	"	**0.013**	*0.00067*	0.28	"	"	"	"	"	**J, B**
Chromium	"	**7.1**	*0.0057*	0.28	"	"	"	"	"	
Cobalt	"	**7.2**	*0.00077*	0.28	"	"	"	"	"	
Copper	"	**22**	*0.0045*	0.28	"	"	"	"	"	
Lead	"	**11**	*0.0014*	0.28	"	"	"	"	"	
Manganese	"	**160**	*0.023*	0.71	"	"	"	"	"	
Nickel	"	**13**	*0.0053*	0.28	"	"	"	"	"	
Selenium	"	**0.16**	*0.0027*	0.71	"	"	"	"	"	**J, B**
Thallium	"	**0.092**	*0.0057*	0.57	"	"	"	"	"	**J, B**
Vanadium	"	**15**	*0.0038*	0.28	"	"	"	"	"	
Zinc	"	**30**	*0.021*	0.99	"	"	"	"	"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Aluminum	6020 TMP Dry	**5000**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 14:59	
Arsenic	"	**9.9**	*0.00087*	0.22	"	"	"	"	"	**B**
Antimony	"	**1.3**	*0.0074*	0.22	"	"	"	"	"	**B**
Barium	"	**38**	*0.0017*	0.22	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00077*	0.22	"	"	"	"	"	
Cadmium	"	**0.016**	*0.00053*	0.22	"	"	"	"	"	**J, B**
Chromium	"	**6.2**	*0.0045*	0.22	"	"	"	"	"	
Cobalt	"	**8.4**	*0.00061*	0.22	"	"	"	"	"	
Copper	"	**23**	*0.0036*	0.22	"	"	"	"	"	
Lead	"	**20**	*0.0011*	0.22	"	"	"	"	"	
Manganese	"	**420**	*0.018*	0.56	"	"	"	"	"	
Nickel	"	**10**	*0.0041*	0.22	"	"	"	"	"	
Selenium	"	**0.12**	*0.0021*	0.56	"	"	"	"	"	**J, B**
Thallium	"	**0.069**	*0.0045*	0.45	"	"	"	"	"	**J, B**
Vanadium	"	**17**	*0.0030*	0.22	"	"	"	"	"	
Zinc	"	**31**	*0.017*	0.78	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Aluminum	6020 TMP Dry	**5100**	*0.39*	39	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:04	
Arsenic	"	**10**	*0.0010*	0.26	"	"	"	"	"	**B**
Antimony	"	**2.3**	*0.0085*	0.26	"	"	"	"	"	**B**
Barium	"	**32**	*0.0019*	0.26	"	"	"	"	"	
Beryllium	"	**0.26**	*0.00089*	0.26	"	"	"	"	"	
Cadmium	"	**0.032**	*0.00061*	0.26	"	"	"	"	"	**J, B**
Chromium	"	**6.2**	*0.0052*	0.26	"	"	"	"	"	
Cobalt	"	**6.8**	*0.00070*	0.26	"	"	"	"	"	
Copper	"	**17**	*0.0041*	0.26	"	"	"	"	"	
Lead	"	**11**	*0.0013*	0.26	"	"	"	"	"	
Manganese	"	**170**	*0.021*	0.64	"	"	"	"	"	
Nickel	"	**13**	*0.0048*	0.26	"	"	"	"	"	
Selenium	"	**0.12**	*0.0024*	0.64	"	"	"	"	"	**J, B**
Thallium	"	**0.075**	*0.0052*	0.52	"	"	"	"	"	**J, B**
Vanadium	"	**15**	*0.0035*	0.26	"	"	"	"	"	
Zinc	"	**32**	*0.019*	0.90	"	"	"	"	"	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Aluminum	6020 TMP Dry	**4600**	*0.36*	36	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:09	
Arsenic	"	**16**	*0.00093*	0.24	"	"	"	"	"	**B**
Antimony	"	**24**	*0.0078*	0.24	"	"	"	"	"	**B**
Barium	"	**35**	*0.0018*	0.24	"	"	"	"	"	
Beryllium	"	**0.24**	*0.00082*	0.24	"	"	"	"	"	**J**
Cadmium	"	ND	*0.00056*	0.24	"	"	"	"	"	
Chromium	"	**6.1**	*0.0048*	0.24	"	"	"	"	"	
Cobalt	"	**6.3**	*0.00064*	0.24	"	"	"	"	"	
Copper	"	**23**	*0.0038*	0.24	"	"	"	"	"	
Lead	"	**48**	*0.0012*	0.24	"	"	"	"	"	
Manganese	"	**91**	*0.019*	0.59	"	"	"	"	"	
Nickel	"	**9.2**	*0.0044*	0.24	"	"	"	"	"	
Selenium	"	**0.13**	*0.0022*	0.59	"	"	"	"	"	**J, B**
Thallium	"	**0.055**	*0.0048*	0.48	"	"	"	"	"	**J, B**
Vanadium	"	**18**	*0.0032*	0.24	"	"	"	"	"	
Zinc	"	**22**	*0.018*	0.83	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
Aluminum	6020 TMP Dry	**3900**	*0.34*	34	mg/Kg dry	10x	50667	09/22/09 10:39	09/22/09 15:14	
Arsenic	"	**16**	*0.00089*	0.23	"	"	"	"	"	**B**
Antimony	"	**1.1**	*0.0075*	0.23	"	"	"	"	"	**B**
Barium	"	**24**	*0.0017*	0.23	"	"	"	"	"	
Beryllium	"	**0.17**	*0.00079*	0.23	"	"	"	"	"	**J**
Cadmium	"	**0.015**	*0.00054*	0.23	"	"	"	"	"	**J, B**
Chromium	"	**5.0**	*0.0046*	0.23	"	"	"	"	"	
Cobalt	"	**4.1**	*0.00061*	0.23	"	"	"	"	"	
Copper	"	**17**	*0.0036*	0.23	"	"	"	"	"	
Lead	"	**12**	*0.0011*	0.23	"	"	"	"	"	
Manganese	"	**180**	*0.018*	0.57	"	"	"	"	"	
Nickel	"	**8.9**	*0.0042*	0.23	"	"	"	"	"	
Selenium	"	**0.14**	*0.0021*	0.57	"	"	"	"	"	**J, B**
Thallium	"	**0.048**	*0.0046*	0.46	"	"	"	"	"	**J, B**
Vanadium	"	**12**	*0.0031*	0.23	"	"	"	"	"	
Zinc	"	**21**	*0.017*	0.80	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
Antimony	6020 Total Recoverable	ND	*0.00040*	0.0020	mg/L	5x	50762	09/23/09 13:31	09/23/09 22:38	
Arsenic	"	ND	*0.00024*	0.0020	"	"	"	"	"	
Barium	"	ND	*0.00027*	0.0060	"	"	"	"	"	
Nickel	"	ND	*0.00022*	0.0020	"	"	"	"	"	^
Beryllium	"	ND	*0.00026*	0.0020	"	"	"	"	"	
Selenium	"	ND	*0.00034*	0.0020	"	"	"	"	"	
Cadmium	"	ND	*0.00014*	0.0020	"	"	"	"	"	
Silver	"	ND	*0.00015*	0.0020	"	"	"	"	"	
Chromium	"	**0.00092**	*0.00037*	0.0020	"	"	"	"	"	**J, ^, B**
Thallium	"	ND	*0.000060*	0.0040	"	"	"	"	"	
Cobalt	"	ND	*0.00016*	0.0020	"	"	"	"	"	^
Vanadium	"	**0.0048**	*0.00023*	0.0020	"	"	"	"	"	**^, B**
Copper	"	**0.00024**	*0.00015*	0.0050	"	"	"	"	"	**J, ^**
Zinc	"	**0.0092**	*0.0020*	0.0070	"	"	"	"	"	**^**
Lead	"	ND	*0.00017*	0.0020	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**				**Sampled: 09/07/09 13:50**				
Percent Solids	Moisture	**81**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**19**	*0.10*	0.10	"	"	"	"	"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**				**Sampled: 09/07/09 13:55**				
Percent Solids	Moisture	**69**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**31**	*0.10*	0.10	"	"	"	"	"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**				**Sampled: 09/07/09 14:45**				
Percent Solids	Moisture	**83**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**17**	*0.10*	0.10	"	"	"	"	"	
SSI0049-04 (G-RS8SED-0-090709)		**Soil**				**Sampled: 09/07/09 14:50**				
Percent Solids	Moisture	**67**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**33**	*0.10*	0.10	"	"	"	"	"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**				**Sampled: 09/07/09 15:30**				
Percent Solids	Moisture	**69**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**31**	*0.10*	0.10	"	"	"	"	"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**				**Sampled: 09/07/09 15:25**				
Percent Solids	Moisture	**82**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**18**	*0.10*	0.10	"	"	"	"	"	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**				**Sampled: 09/07/09 16:15**				
Percent Solids	Moisture	**78**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**22**	*0.10*	0.10	"	"	"	"	"	
SSI0049-08 (G-RS2SED-0-090709)		**Soil**				**Sampled: 09/07/09 16:20**				
Percent Solids	Moisture	**71**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**29**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Percent Solids	Moisture	**70**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**30**	*0.10*	0.10	"	"	"	"	"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Percent Solids	Moisture	**71**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**29**	*0.10*	0.10	"	"	"	"	"	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Percent Solids	Moisture	**82**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**18**	*0.10*	0.10	"	"	"	"	"	
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Percent Solids	Moisture	**75**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**25**	*0.10*	0.10	"	"	"	"	"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
Percent Solids	Moisture	**68**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**32**	*0.10*	0.10	"	"	"	"	"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Percent Solids	Moisture	**83**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**17**	*0.10*	0.10	"	"	"	"	"	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
Percent Solids	Moisture	**72**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**28**	*0.10*	0.10	"	"	"	"	"	
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Percent Solids	Moisture	**83**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**17**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Percent Moisture

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**				**Sampled: 09/08/09 12:25**				
Percent Solids	Moisture	**87**	*0.10*	0.10	%	1x	50245	09/15/09 10:26	09/15/09 10:26	
Percent Moisture	"	**13**	*0.10*	0.10	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**				**Sampled: 09/07/09 17:00**				
PCB-1016	8082 STD	ND	*0.0042*	0.047	ug/L	1x	52855	09/14/09 08:57	10/23/09 14:13	
PCB-1221	"	ND	*0.0058*	0.047	"	"	"	"	"	
PCB-1232	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1242	"	ND	*0.0039*	0.047	"	"	"	"	"	
PCB-1248	"	ND	*0.0067*	0.047	"	"	"	"	"	
PCB-1254	"	ND	*0.0042*	0.047	"	"	"	"	"	
PCB-1260	"	ND	*0.0037*	0.047	"	"	"	"	"	
Surrogate(s): *Tetrachloro-m-xylene*			*86%*			*60 - 150 %*	"		"	
DCB Decachlorobiphenyl			*58%*			*40 - 135 %*	"		"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
2-Chlorophenol	8270C STD Dry	ND	*0.0088*	0.12	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 09:42	
Phenol	"	ND	*0.0088*	0.12	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0085*	0.059	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.012*	0.12	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0038*	0.059	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.012*	0.12	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.011*	0.12	"	"	"	"	"	
Hexachloroethane	"	ND	*0.013*	0.12	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0076*	0.059	"	"	"	"	"	
Nitrobenzene	"	ND	*0.034*	0.12	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0084*	0.12	"	"	"	"	"	
Isophorone	"	ND	*0.0049*	0.12	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0066*	0.24	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0025*	0.12	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0036*	0.12	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0036*	0.12	"	"	"	"	"	
Benzoic acid	"	ND	*0.77*	3.0	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.014*	0.059	"	"	"	"	"	
2-Methylnaphthalene	"	**0.021**	*0.0027*	0.024	"	"	"	"	"	J
Hexachlorocyclopentadiene	"	ND	*0.0031*	0.12	"	"	"	"	"	
Naphthalene	"	**0.019**	*0.0026*	0.024	"	"	"	"	"	J
2,4,6-Trichlorophenol	"	ND	*0.0047*	0.18	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.013*	0.12	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.011*	0.059	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0021*	0.024	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0084*	0.12	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0050*	0.12	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0019*	0.024	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0049*	0.12	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0050*	0.12	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0030*	0.12	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0069*	0.12	"	"	"	"	"	
Acenaphthene	"	ND	*0.0019*	0.024	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.018*	0.12	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.017*	1.2	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0068*	0.12	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
4-Nitrophenol	8270C STD Dry	ND	*0.20*	1.2	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 09:42	
Fluorene	"	ND	*0.0014*	0.024	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.017*	0.12	"	"	"	"	"	
Dibenzofuran	"	**0.015**	*0.0018*	0.12	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.021*	1.2	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0039*	0.12	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0045*	0.059	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0026*	0.059	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.014*	0.12	"	"	"	"	"	
Pyrene	"	**0.047**	*0.0017*	0.024	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.037*	0.12	"	"	"	"	"	
Phenanthrene	"	**0.040**	*0.0025*	0.024	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0094*	0.24	"	"	"	"	"	
Anthracene	"	**0.014**	*0.0017*	0.024	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.012**	*0.0020*	0.030	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	ND	*0.031*	0.24	"	"	"	"	"	
Chrysene	"	**0.029**	*0.0017*	0.030	"	"	"	"	"	**J**
Fluoranthene	"	**0.040**	*0.0014*	0.024	"	"	"	"	"	*
Benzo[a]pyrene	"	ND	*0.0025*	0.036	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.050*	1.8	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0015*	0.24	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.035**	*0.0050*	0.047	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	ND	*0.0015*	0.030	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0026*	0.047	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0080*	0.18	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.022**	*0.0018*	0.030	"	"	"	"	"	**J**
Carbazole	"	ND	*0.0051*	0.18	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0086**	*0.0021*	0.036	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	ND	*0.0049*	0.024	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*96%*	*42 - 151 %*	"	"
	2-Fluorophenol	*74%*	*36 - 145 %*	"	"
	Phenol-d5	*82%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*68%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*76%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*96%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
2-Chlorophenol	8270C STD Dry	ND	*0.011*	0.14	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 10:02	
Phenol	"	ND	*0.011*	0.14	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.010*	0.072	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.014*	0.14	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0046*	0.072	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.014*	0.14	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.014*	0.14	"	"	"	"	"	
Hexachloroethane	"	ND	*0.016*	0.14	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0092*	0.072	"	"	"	"	"	
Nitrobenzene	"	ND	*0.042*	0.14	"	"	"	"	"	
2-Methylphenol	"	ND	*0.010*	0.14	"	"	"	"	"	
Isophorone	"	ND	*0.0059*	0.14	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0062*	0.14	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0080*	0.29	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0030*	0.14	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0043*	0.14	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0043*	0.14	"	"	"	"	"	
Benzoic acid	"	ND	*0.93*	3.6	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.017*	0.072	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0069**	*0.0033*	0.029	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.0037*	0.14	"	"	"	"	"	
Naphthalene	"	ND	*0.0032*	0.029	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0057*	0.21	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.016*	0.14	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0062*	0.14	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.013*	0.072	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0026*	0.029	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.010*	0.14	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0060*	0.14	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0023*	0.029	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0059*	0.14	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0060*	0.14	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0036*	0.14	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0083*	0.14	"	"	"	"	"	
Acenaphthene	"	ND	*0.0023*	0.029	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.021*	0.14	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.020*	1.4	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0082*	0.14	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
4-Nitrophenol	8270C STD Dry	ND	*0.24*	1.4	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 10:02	
Fluorene	"	ND	*0.0017*	0.029	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.020*	0.14	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0021*	0.14	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.026*	1.4	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0047*	0.14	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0054*	0.072	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0032*	0.072	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.017*	0.14	"	"	"	"	"	
Pyrene	"	**0.013**	*0.0020*	0.029	"	"	"	"	"	**J**
Butyl benzyl phthalate	"	ND	*0.044*	0.14	"	"	"	"	"	
Phenanthrene	"	**0.017**	*0.0030*	0.029	"	"	"	"	"	**J**
3,3'-Dichlorobenzidine	"	ND	*0.011*	0.29	"	"	"	"	"	
Anthracene	"	**0.0078**	*0.0020*	0.029	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.040**	*0.0024*	0.036	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.037*	0.29	"	"	"	"	"	
Chrysene	"	**0.0098**	*0.0020*	0.036	"	"	"	"	"	**J**
Fluoranthene	"	**0.016**	*0.0017*	0.029	"	"	"	"	"	**J, ***
Benzo[a]pyrene	"	**0.0066**	*0.0030*	0.043	"	"	"	"	"	**J**
Bis(2-ethylhexyl) phthalate	"	ND	*0.060*	2.1	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0019*	0.29	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.024**	*0.0060*	0.057	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	ND	*0.0019*	0.036	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0032*	0.057	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0096*	0.21	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0021*	0.036	"	"	"	"	"	
Carbazole	"	ND	*0.0062*	0.21	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.0026*	0.043	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0059*	0.029	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*79%*	*42 - 151 %*	"	"
	2-Fluorophenol	*73%*	*36 - 145 %*	"	"
	Phenol-d5	*80%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*65%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*43%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*55%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
2-Chlorophenol	8270C STD Dry	ND	*0.00086*	0.012	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 10:23	
Phenol	"	ND	*0.00086*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00084*	0.0058	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0012*	0.012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00037*	0.0058	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0011*	0.012	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.012	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0013*	0.012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00075*	0.0058	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0034*	0.012	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00083*	0.012	"	"	"	"	"	
Isophorone	"	ND	*0.00048*	0.012	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00050*	0.012	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00065*	0.023	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00024*	0.012	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00035*	0.012	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00035*	0.012	"	"	"	"	"	
Benzoic acid	"	ND	*0.076*	0.29	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0014*	0.0058	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00071**	*0.00027*	0.0023	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.00030*	0.012	"	"	"	"	"	
Naphthalene	"	**0.00048**	*0.00026*	0.0023	"	"	"	"	"	**J**
2,4,6-Trichlorophenol	"	ND	*0.00047*	0.017	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0013*	0.012	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00050*	0.012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0011*	0.0058	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00021*	0.0023	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00083*	0.012	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00049*	0.012	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00019*	0.0023	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00048*	0.012	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00049*	0.012	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00029*	0.012	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00068*	0.012	"	"	"	"	"	
Acenaphthene	"	ND	*0.00019*	0.0023	"	"	"	"	"	
Diethyl phthalate	"	**0.0030**	*0.0017*	0.012	"	"	"	"	"	**J, B**
2,4-Dinitrophenol	"	ND	*0.0016*	0.12	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00066*	0.012	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
4-Nitrophenol	8270C STD Dry	ND	*0.020*	0.12	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 10:23	
Fluorene	"	ND	*0.00014*	0.0023	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0016*	0.012	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00017*	0.012	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0021*	0.12	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00038*	0.012	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00044*	0.0058	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00026*	0.0058	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0014*	0.012	"	"	"	"	"	
Pyrene	"	**0.00078**	*0.00016*	0.0023	"	"	"	"	"	**J**
Butyl benzyl phthalate	"	ND	*0.0036*	0.012	"	"	"	"	"	
Phenanthrene	"	ND	*0.00024*	0.0023	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00092*	0.023	"	"	"	"	"	
Anthracene	"	ND	*0.00016*	0.0023	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.00020*	0.0029	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.011**	*0.0030*	0.023	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.00016*	0.0029	"	"	"	"	"	
Fluoranthene	"	**0.00066**	*0.00014*	0.0023	"	"	"	"	"	**J, ***
Benzo[a]pyrene	"	ND	*0.00024*	0.0035	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0049*	0.17	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00015*	0.023	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00049*	0.0047	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00015*	0.0029	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00026*	0.0047	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00078*	0.017	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00017*	0.0029	"	"	"	"	"	
Carbazole	"	**0.00075**	*0.00050*	0.017	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.00027**	*0.00021*	0.0035	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	ND	*0.00048*	0.0023	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*83%*	*42 - 151 %*	"	"	
	2-Fluorophenol	*74%*	*36 - 145 %*	"	"	
	Phenol-d5	*80%*	*38 - 149 %*	"	"	
	Nitrobenzene-d5	*62%*	*38 - 141 %*	"	"	
	2-Fluorobiphenyl	*31%*	*42 - 140 %*	"	"	***X***
	2,4,6-Tribromophenol	*86%*	*28 - 143 %*	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
2-Chlorophenol	8270C STD Dry	ND	*0.0011*	0.015	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 10:44	
Phenol	"	ND	*0.0011*	0.015	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0011*	0.0074	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0015*	0.015	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00047*	0.0074	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0014*	0.015	"	"	"	"	"	
Benzyl alcohol	"	**0.0017**	*0.0014*	0.015	"	"	"	"	"	**J**
Hexachloroethane	"	ND	*0.0016*	0.015	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00094*	0.0074	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0043*	0.015	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0010*	0.015	"	"	"	"	"	
Isophorone	"	ND	*0.00060*	0.015	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00063*	0.015	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00082*	0.029	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00031*	0.015	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00044*	0.015	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00044*	0.015	"	"	"	"	"	
Benzoic acid	"	ND	*0.096*	0.37	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0018*	0.0074	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00034*	0.0029	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00038*	0.015	"	"	"	"	"	
Naphthalene	"	ND	*0.00032*	0.0029	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00059*	0.022	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0016*	0.015	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00063*	0.015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0074	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00026*	0.0029	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0010*	0.015	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00062*	0.015	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00024*	0.0029	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00060*	0.015	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00062*	0.015	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00037*	0.015	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00085*	0.015	"	"	"	"	"	
Acenaphthene	"	ND	*0.00024*	0.0029	"	"	"	"	"	
Diethyl phthalate	"	**0.0048**	*0.0022*	0.015	"	"	"	"	"	**J, B**
2,4-Dinitrophenol	"	ND	*0.0021*	0.15	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00084*	0.015	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
4-Nitrophenol	8270C STD Dry	ND	*0.025*	0.15	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 10:44	
Fluorene	"	ND	*0.00018*	0.0029	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0021*	0.015	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00022*	0.015	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0026*	0.15	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00049*	0.015	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00056*	0.0074	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00032*	0.0074	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0018*	0.015	"	"	"	"	"	
Pyrene	"	**0.0010**	*0.00021*	0.0029	"	"	"	"	"	**J**
Butyl benzyl phthalate	"	ND	*0.0046*	0.015	"	"	"	"	"	
Phenanthrene	"	ND	*0.00031*	0.0029	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0012*	0.029	"	"	"	"	"	
Anthracene	"	ND	*0.00021*	0.0029	"	"	"	"	"	
Benzo[a]anthracene	"	**0.00087**	*0.00025*	0.0037	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.011**	*0.0038*	0.029	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.00021*	0.0037	"	"	"	"	"	
Fluoranthene	"	**0.0011**	*0.00018*	0.0029	"	"	"	"	"	**J, ***
Benzo[a]pyrene	"	ND	*0.00031*	0.0044	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0062*	0.22	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00019*	0.029	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00062*	0.0059	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00019*	0.0037	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00032*	0.0059	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00099*	0.022	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00022*	0.0037	"	"	"	"	"	
Carbazole	"	ND	*0.00063*	0.022	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.00026*	0.0044	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.00060*	0.0029	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*52%*	*42 - 151 %*	"	"
	2-Fluorophenol	*70%*	*36 - 145 %*	"	"
	Phenol-d5	*74%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*56%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*22%*	*42 - 140 %*	"	" *X*
	2,4,6-Tribromophenol	*51%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
2-Chlorophenol	8270C STD Dry	ND	*0.0011*	0.014	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 11:04	
Phenol	"	ND	*0.0011*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0010*	0.0072	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0014*	0.014	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00046*	0.0072	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0014*	0.014	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0014*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0016*	0.014	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00093*	0.0072	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0042*	0.014	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0010*	0.014	"	"	"	"	"	
Isophorone	"	ND	*0.00059*	0.014	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00062*	0.014	"	"	"	"	"	
3 & 4 Methylphenol	"	**0.0071**	*0.00081*	0.029	"	"	"	"	"	**J**
2,4-Dimethylphenol	"	ND	*0.00030*	0.014	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00043*	0.014	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00043*	0.014	"	"	"	"	"	
Benzoic acid	"	ND	*0.094*	0.36	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0017*	0.0072	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00044**	*0.00033*	0.0029	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.00038*	0.014	"	"	"	"	"	
Naphthalene	"	ND	*0.00032*	0.0029	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00058*	0.022	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0016*	0.014	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00062*	0.014	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0072	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00026*	0.0029	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0010*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00061*	0.014	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00023*	0.0029	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00059*	0.014	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00061*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00036*	0.014	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00084*	0.014	"	"	"	"	"	
Acenaphthene	"	ND	*0.00023*	0.0029	"	"	"	"	"	
Diethyl phthalate	"	**0.0061**	*0.0022*	0.014	"	"	"	"	"	**J, B**
2,4-Dinitrophenol	"	ND	*0.0020*	0.14	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00082*	0.014	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
4-Nitrophenol	8270C STD Dry	ND	*0.025*	0.14	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 11:04	
Fluorene	"	ND	*0.00017*	0.0029	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0020*	0.014	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00022*	0.014	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0026*	0.14	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00048*	0.014	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00055*	0.0072	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00032*	0.0072	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0017*	0.014	"	"	"	"	"	
Pyrene	"	**0.012**	*0.00020*	0.0029	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0045*	0.014	"	"	"	"	"	
Phenanthrene	"	**0.0081**	*0.00030*	0.0029	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0011*	0.029	"	"	"	"	"	
Anthracene	"	**0.0012**	*0.00020*	0.0029	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.0022**	*0.00025*	0.0036	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.011**	*0.0038*	0.029	"	"	"	"	"	**J, B**
Chrysene	"	**0.0054**	*0.00020*	0.0036	"	"	"	"	"	
Fluoranthene	"	**0.014**	*0.00017*	0.0029	"	"	"	"	"	*
Benzo[a]pyrene	"	ND	*0.00030*	0.0043	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0061*	0.22	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00019*	0.029	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00061*	0.0058	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00019*	0.0036	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00032*	0.0058	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00097*	0.022	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00022*	0.0036	"	"	"	"	"	
Carbazole	"	ND	*0.00062*	0.022	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.00026*	0.0043	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0024**	*0.00059*	0.0029	"	"	"	"	"	**J**
Surrogate(s): *Terphenyl-d14*			*65%*		*42 - 151 %*	"		"		
2-Fluorophenol			*76%*		*36 - 145 %*	"		"		
Phenol-d5			*80%*		*38 - 149 %*	"		"		
Nitrobenzene-d5			*57%*		*38 - 141 %*	"		"		
2-Fluorobiphenyl			*29%*		*42 - 140 %*	"		"		***X***
2,4,6-Tribromophenol			*66%*		*28 - 143 %*	"		"		

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
2-Chlorophenol	8270C STD Dry	ND	*0.00089*	0.012	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 16:33	
Phenol	"	ND	*0.00089*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00086*	0.0060	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0012*	0.012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00038*	0.0060	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0012*	0.012	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.012	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0013*	0.012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00077*	0.0060	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0035*	0.012	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00085*	0.012	"	"	"	"	"	
Isophorone	"	ND	*0.00049*	0.012	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00051*	0.012	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00067*	0.024	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00025*	0.012	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00036*	0.012	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00036*	0.012	"	"	"	"	"	
Benzoic acid	"	ND	*0.078*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0014*	0.0060	"	"	"	"	"	
2-Methylnaphthalene	"	**0.00035**	*0.00028*	0.0024	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.00031*	0.012	"	"	"	"	"	
Naphthalene	"	ND	*0.00026*	0.0024	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00048*	0.018	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0013*	0.012	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00051*	0.012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0011*	0.0060	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00022*	0.0024	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00085*	0.012	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00050*	0.012	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00019*	0.0024	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00049*	0.012	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00050*	0.012	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00030*	0.012	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00069*	0.012	"	"	"	"	"	
Acenaphthene	"	ND	*0.00019*	0.0024	"	"	"	"	"	
Diethyl phthalate	"	**0.0040**	*0.0018*	0.012	"	"	"	"	"	**J, B**
2,4-Dinitrophenol	"	ND	*0.0017*	0.12	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00068*	0.012	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
4-Nitrophenol	8270C STD Dry	ND	*0.020*	0.12	mg/Kg dry	1x	50242	09/15/09 10:10	09/18/09 16:33	
Fluorene	"	ND	*0.00014*	0.0024	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0017*	0.012	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00018*	0.012	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0022*	0.12	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00039*	0.012	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00045*	0.0060	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00026*	0.0060	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0014*	0.012	"	"	"	"	"	
Pyrene	"	**0.00072**	*0.00017*	0.0024	"	"	"	"	"	**J**
Butyl benzyl phthalate	"	ND	*0.0037*	0.012	"	"	"	"	"	
Phenanthrene	"	**0.00053**	*0.00025*	0.0024	"	"	"	"	"	**J**
3,3'-Dichlorobenzidine	"	ND	*0.00094*	0.024	"	"	"	"	"	
Anthracene	"	**0.00036**	*0.00017*	0.0024	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.00066**	*0.00020*	0.0030	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.015**	*0.0031*	0.024	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.00017*	0.0030	"	"	"	"	"	
Fluoranthene	"	**0.00036**	*0.00014*	0.0024	"	"	"	"	"	**J, ***
Benzo[a]pyrene	"	ND	*0.00025*	0.0036	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0050*	0.18	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00016*	0.024	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.00050*	0.0048	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.00016*	0.0030	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00026*	0.0048	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00080*	0.018	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.00018*	0.0030	"	"	"	"	"	
Carbazole	"	ND	*0.00051*	0.018	"	"	"	"	"	
1-Methylnaphthalene	"	ND	*0.00022*	0.0036	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.00049*	0.0024	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*102%*	*42 - 151 %*	"	"
	2-Fluorophenol	*53%*	*36 - 145 %*	"	"
	Phenol-d5	*70%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*40%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*53%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*70%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
2-Chlorophenol	8270C STD Dry	ND	*0.00094*	0.013	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 14:01	
Phenol	"	**0.0021**	*0.00094*	0.013	"	"	"	"	"	**J**
1,3-Dichlorobenzene	"	ND	*0.00091*	0.0063	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0013*	0.013	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00041*	0.0063	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0012*	0.013	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0012*	0.013	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0014*	0.013	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00081*	0.0063	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0037*	0.013	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00090*	0.013	"	"	"	"	"	
Isophorone	"	ND	*0.00052*	0.013	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00054*	0.013	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00071*	0.025	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00027*	0.013	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00038*	0.013	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00038*	0.013	"	"	"	"	"	
Benzoic acid	"	**0.12**	*0.082*	0.32	"	"	"	"	"	**J**
1,2,4-Trichlorobenzene	"	ND	*0.0015*	0.0063	"	"	"	"	"	
2-Methylnaphthalene	"	**0.011**	*0.00029*	0.0025	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00033*	0.013	"	"	"	"	"	
Naphthalene	"	**0.0050**	*0.00028*	0.0025	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00051*	0.019	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0014*	0.013	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00054*	0.013	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0012*	0.0063	"	"	"	"	"	
2-Chloronaphthalene	"	**0.0037**	*0.00023*	0.0025	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00090*	0.013	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00053*	0.013	"	"	"	"	"	
Acenaphthylene	"	**0.0046**	*0.00020*	0.0025	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00052*	0.013	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00053*	0.013	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00032*	0.013	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00073*	0.013	"	"	"	"	"	
Acenaphthene	"	ND	*0.00020*	0.0025	"	"	"	"	"	
Diethyl phthalate	"	**0.0041**	*0.0019*	0.013	"	"	"	"	"	**J**
2,4-Dinitrophenol	"	ND	*0.0018*	0.13	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00072*	0.013	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
4-Nitrophenol	8270C STD Dry	ND	*0.022*	0.13	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 14:01	
Fluorene	"	ND	*0.00015*	0.0025	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0018*	0.013	"	"	"	"	"	
Dibenzofuran	"	**0.0030**	*0.00019*	0.013	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.0023*	0.13	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00042*	0.013	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00048*	0.0063	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00028*	0.0063	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0015*	0.013	"	"	"	"	"	
Pyrene	"	**0.013**	*0.00018*	0.0025	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0039*	0.013	"	"	"	"	"	
Phenanthrene	"	**0.010**	*0.00027*	0.0025	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0010*	0.025	"	"	"	"	"	
Anthracene	"	**0.0057**	*0.00018*	0.0025	"	"	"	"	"	
Benzo[a]anthracene	"	**0.0029**	*0.00022*	0.0032	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.012**	*0.0033*	0.025	"	"	"	"	"	**J**
Chrysene	"	**0.016**	*0.00018*	0.0032	"	"	"	"	"	
Fluoranthene	"	**0.0045**	*0.00015*	0.0025	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0064**	*0.00027*	0.0038	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	**0.0078**	*0.0053*	0.19	"	"	"	"	"	**J**
Di-n-octyl phthalate	"	ND	*0.00016*	0.025	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0064**	*0.00053*	0.0051	"	"	"	"	"	
Benzo[k]fluoranthene	"	**0.0015**	*0.00016*	0.0032	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	ND	*0.00028*	0.0051	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00085*	0.019	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.015**	*0.00019*	0.0032	"	"	"	"	"	
Carbazole	"	**0.0023**	*0.00054*	0.019	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0056**	*0.00023*	0.0038	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.013**	*0.00052*	0.0025	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*103%*	*42 - 151 %*	"	"
	2-Fluorophenol	*64%*	*36 - 145 %*	"	"
	Phenol-d5	*75%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*51%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*67%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*121%*	*28 - 143 %*	"	"

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
2-Chlorophenol	8270C STD Dry	ND	*0.0010*	0.014	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 14:21	
Phenol	"	**0.0055**	*0.0010*	0.014	"	"	"	"	"	**J**
1,3-Dichlorobenzene	"	ND	*0.0010*	0.0069	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0014*	0.014	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00044*	0.0069	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0013*	0.014	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0013*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0015*	0.014	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00089*	0.0069	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0040*	0.014	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00099*	0.014	"	"	"	"	"	
Isophorone	"	ND	*0.00057*	0.014	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
3 & 4 Methylphenol	"	**0.0023**	*0.00078*	0.028	"	"	"	"	"	**J**
2,4-Dimethylphenol	"	ND	*0.00029*	0.014	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00042*	0.014	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00042*	0.014	"	"	"	"	"	
Benzoic acid	"	**0.099**	*0.090*	0.35	"	"	"	"	"	**J**
1,2,4-Trichlorobenzene	"	ND	*0.0017*	0.0069	"	"	"	"	"	
2-Methylnaphthalene	"	**0.019**	*0.00032*	0.0028	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00036*	0.014	"	"	"	"	"	
Naphthalene	"	**0.0068**	*0.00031*	0.0028	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00056*	0.021	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0015*	0.014	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0069	"	"	"	"	"	
2-Chloronaphthalene	"	**0.0013**	*0.00025*	0.0028	"	"	"	"	"	**J**
4-Chloro-3-methylphenol	"	ND	*0.00099*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00058*	0.014	"	"	"	"	"	
Acenaphthylene	"	**0.0025**	*0.00022*	0.0028	"	"	"	"	"	**J**
2,6-Dinitrotoluene	"	ND	*0.00057*	0.014	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00058*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00035*	0.014	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00080*	0.014	"	"	"	"	"	
Acenaphthene	"	**0.0016**	*0.00022*	0.0028	"	"	"	"	"	**J**
Diethyl phthalate	"	ND	*0.0021*	0.014	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0019*	0.14	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00079*	0.014	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.024*	0.14	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Fluorene	"	ND	*0.00017*	0.0028	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0019*	0.014	"	"	"	"	"	
Dibenzofuran	"	**0.0032**	*0.00021*	0.014	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.0025*	0.14	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00046*	0.014	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00053*	0.0069	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00031*	0.0069	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0017*	0.014	"	"	"	"	"	
Pyrene	"	**0.010**	*0.00019*	0.0028	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0043*	0.014	"	"	"	"	"	
Phenanthrene	"	**0.010**	*0.00029*	0.0028	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0011*	0.028	"	"	"	"	"	
Anthracene	"	**0.0034**	*0.00019*	0.0028	"	"	"	"	"	
Benzo[a]anthracene	"	**0.0034**	*0.00024*	0.0035	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.0099**	*0.0036*	0.028	"	"	"	"	"	**J**
Chrysene	"	**0.0083**	*0.00019*	0.0035	"	"	"	"	"	
Fluoranthene	"	**0.0065**	*0.00017*	0.0028	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0052**	*0.00029*	0.0042	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0058*	0.21	"	"	"	"	"	
Di-n-octyl phthalate	"	**0.0018**	*0.00018*	0.028	"	"	"	"	"	**J**
Indeno[1,2,3-cd]pyrene	"	**0.0043**	*0.00058*	0.0056	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	**0.0016**	*0.00018*	0.0035	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	**0.0017**	*0.00031*	0.0056	"	"	"	"	"	**J**
2,2'-oxybis[1-chloropropane]	"	ND	*0.00093*	0.021	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0074**	*0.00021*	0.0035	"	"	"	"	"	
Carbazole	"	**0.0013**	*0.00060*	0.021	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0098**	*0.00025*	0.0042	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0069**	*0.00057*	0.0028	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*55%*	*42 - 151 %*	"	"	
	2-Fluorophenol	*83%*	*36 - 145 %*	"	"	
	Phenol-d5	*83%*	*38 - 149 %*	"	"	
	Nitrobenzene-d5	*60%*	*38 - 141 %*	"	"	
	2-Fluorobiphenyl	*31%*	*42 - 140 %*	"	"	***X***
	2,4,6-Tribromophenol	*82%*	*28 - 143 %*	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
2-Chlorophenol	8270C STD Dry	ND	*0.0010*	0.014	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 14:42	
Phenol	"	**0.0023**	*0.0010*	0.014	"	"	"	"	"	**J**
1,3-Dichlorobenzene	"	ND	*0.0010*	0.0069	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0014*	0.014	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00044*	0.0069	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0013*	0.014	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0013*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0015*	0.014	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00089*	0.0069	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0040*	0.014	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00099*	0.014	"	"	"	"	"	
Isophorone	"	ND	*0.00057*	0.014	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
3 & 4 Methylphenol	"	**0.0022**	*0.00078*	0.028	"	"	"	"	"	**J**
2,4-Dimethylphenol	"	ND	*0.00029*	0.014	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00042*	0.014	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00042*	0.014	"	"	"	"	"	
Benzoic acid	"	**0.11**	*0.090*	0.35	"	"	"	"	"	**J**
1,2,4-Trichlorobenzene	"	ND	*0.0017*	0.0069	"	"	"	"	"	
2-Methylnaphthalene	"	**0.013**	*0.00032*	0.0028	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00036*	0.014	"	"	"	"	"	
Naphthalene	"	**0.0081**	*0.00031*	0.0028	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00056*	0.021	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0015*	0.014	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0069	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00025*	0.0028	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00099*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00058*	0.014	"	"	"	"	"	
Acenaphthylene	"	**0.0025**	*0.00022*	0.0028	"	"	"	"	"	**J**
2,6-Dinitrotoluene	"	ND	*0.00057*	0.014	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00058*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00035*	0.014	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00081*	0.014	"	"	"	"	"	
Acenaphthene	"	**0.0031**	*0.00022*	0.0028	"	"	"	"	"	
Diethyl phthalate	"	**0.0039**	*0.0021*	0.014	"	"	"	"	"	**J**
2,4-Dinitrophenol	"	ND	*0.0019*	0.14	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00079*	0.014	"	"	"	"	"	
4-Nitrophenol	"	ND	*0.024*	0.14	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
Fluorene	"	**0.0047**	*0.00017*	0.0028	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0019*	0.014	"	"	"	"	"	
Dibenzofuran	"	**0.0064**	*0.00021*	0.014	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.0025*	0.14	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00046*	0.014	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00053*	0.0069	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00031*	0.0069	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0017*	0.014	"	"	"	"	"	
Pyrene	"	**0.017**	*0.00019*	0.0028	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0043*	0.014	"	"	"	"	"	
Phenanthrene	"	**0.015**	*0.00029*	0.0028	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0011*	0.028	"	"	"	"	"	
Anthracene	"	**0.0036**	*0.00019*	0.0028	"	"	"	"	"	
Benzo[a]anthracene	"	**0.0089**	*0.00024*	0.0035	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.011**	*0.0036*	0.028	"	"	"	"	"	**J**
Chrysene	"	**0.021**	*0.00019*	0.0035	"	"	"	"	"	
Fluoranthene	"	**0.013**	*0.00017*	0.0028	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0074**	*0.00029*	0.0042	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	**0.0076**	*0.0058*	0.21	"	"	"	"	"	**J**
Di-n-octyl phthalate	"	**0.0039**	*0.00018*	0.028	"	"	"	"	"	**J**
Indeno[1,2,3-cd]pyrene	"	**0.0053**	*0.00058*	0.0056	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	**0.0037**	*0.00018*	0.0035	"	"	"	"	"	
Dibenz(a,h)anthracene	"	**0.0026**	*0.00031*	0.0056	"	"	"	"	"	**J**
2,2'-oxybis[1-chloropropane]	"	ND	*0.00093*	0.021	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0090**	*0.00021*	0.0035	"	"	"	"	"	
Carbazole	"	**0.0024**	*0.00060*	0.021	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0063**	*0.00025*	0.0042	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.018**	*0.00057*	0.0028	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*100%*	*42 - 151 %*	"	"
	2-Fluorophenol	*57%*	*36 - 145 %*	"	"
	Phenol-d5	*78%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*56%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*70%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*123%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
2-Chlorophenol	8270C STD Dry	ND	*0.0010*	0.014	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:03	
Phenol	"	ND	*0.0010*	0.014	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0010*	0.0069	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0014*	0.014	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00044*	0.0069	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0013*	0.014	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0013*	0.014	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0015*	0.014	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00089*	0.0069	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0040*	0.014	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00098*	0.014	"	"	"	"	"	
Isophorone	"	ND	*0.00057*	0.014	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00078*	0.028	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00029*	0.014	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00042*	0.014	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00042*	0.014	"	"	"	"	"	
Benzoic acid	"	ND	*0.090*	0.35	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0017*	0.0069	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0052**	*0.00032*	0.0028	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00036*	0.014	"	"	"	"	"	
Naphthalene	"	**0.0045**	*0.00030*	0.0028	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00055*	0.021	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0015*	0.014	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00060*	0.014	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0069	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00025*	0.0028	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00098*	0.014	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00058*	0.014	"	"	"	"	"	
Acenaphthylene	"	**0.0017**	*0.00022*	0.0028	"	"	"	"	"	**J**
2,6-Dinitrotoluene	"	ND	*0.00057*	0.014	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00058*	0.014	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00035*	0.014	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00080*	0.014	"	"	"	"	"	
Acenaphthene	"	**0.0044**	*0.00022*	0.0028	"	"	"	"	"	
Diethyl phthalate	"	**0.0043**	*0.0021*	0.014	"	"	"	"	"	**J**
2,4-Dinitrophenol	"	ND	*0.0019*	0.14	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00079*	0.014	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
4-Nitrophenol	8270C STD Dry	ND	*0.024*	0.14	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:03	
Fluorene	"	**0.0052**	*0.00017*	0.0028	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0019*	0.014	"	"	"	"	"	
Dibenzofuran	"	**0.0030**	*0.00021*	0.014	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.0025*	0.14	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00046*	0.014	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00053*	0.0069	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00030*	0.0069	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0017*	0.014	"	"	"	"	"	
Pyrene	"	**0.011**	*0.00019*	0.0028	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0043*	0.014	"	"	"	"	"	
Phenanthrene	"	**0.0084**	*0.00029*	0.0028	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0011*	0.028	"	"	"	"	"	
Anthracene	"	**0.0027**	*0.00019*	0.0028	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.0042**	*0.00024*	0.0035	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.011**	*0.0036*	0.028	"	"	"	"	"	**J**
Chrysene	"	**0.011**	*0.00019*	0.0035	"	"	"	"	"	
Fluoranthene	"	**0.010**	*0.00017*	0.0028	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0056**	*0.00029*	0.0042	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0058*	0.21	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00018*	0.028	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0045**	*0.00058*	0.0055	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	**0.0021**	*0.00018*	0.0035	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	**0.0023**	*0.00030*	0.0055	"	"	"	"	"	**J**
2,2'-oxybis[1-chloropropane]	"	ND	*0.00093*	0.021	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0083**	*0.00021*	0.0035	"	"	"	"	"	
Carbazole	"	ND	*0.00060*	0.021	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0038**	*0.00025*	0.0042	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	**0.0076**	*0.00057*	0.0028	"	"	"	"	"	
Surrogate(s):	*Terphenyl-d14*		*91%*		*42 - 151 %*	"			"	
	2-Fluorophenol		*76%*		*36 - 145 %*	"			"	
	Phenol-d5		*80%*		*38 - 149 %*	"			"	
	Nitrobenzene-d5		*51%*		*38 - 141 %*	"			"	
	2-Fluorobiphenyl		*57%*		*42 - 140 %*	"			"	
	2,4,6-Tribromophenol		*121%*		*28 - 143 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
2-Chlorophenol	8270C STD Dry	ND	*0.00088*	0.012	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:24	
Phenol	"	ND	*0.00088*	0.012	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.00086*	0.0060	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0012*	0.012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00038*	0.0060	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0012*	0.012	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0011*	0.012	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0013*	0.012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00076*	0.0060	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0035*	0.012	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00085*	0.012	"	"	"	"	"	
Isophorone	"	ND	*0.00049*	0.012	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00051*	0.012	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00067*	0.024	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00025*	0.012	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00036*	0.012	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00036*	0.012	"	"	"	"	"	
Benzoic acid	"	ND	*0.078*	0.30	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0014*	0.0060	"	"	"	"	"	
2-Methylnaphthalene	"	ND	*0.00027*	0.0024	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00031*	0.012	"	"	"	"	"	
Naphthalene	"	**0.013**	*0.00026*	0.0024	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00048*	0.018	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0013*	0.012	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00051*	0.012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0011*	0.0060	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00021*	0.0024	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00085*	0.012	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00050*	0.012	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00019*	0.0024	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.00049*	0.012	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00050*	0.012	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00030*	0.012	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00069*	0.012	"	"	"	"	"	
Acenaphthene	"	**0.041**	*0.00019*	0.0024	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.0018*	0.012	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0017*	0.12	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00068*	0.012	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
4-Nitrophenol	8270C STD Dry	ND	*0.020*	0.12	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:24	
Fluorene	"	**0.080**	*0.00014*	0.0024	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0017*	0.012	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00018*	0.012	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0021*	0.12	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00039*	0.012	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00045*	0.0060	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00026*	0.0060	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0014*	0.012	"	"	"	"	"	
Pyrene	"	**0.027**	*0.00017*	0.0024	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0037*	0.012	"	"	"	"	"	
Phenanthrene	"	**0.080**	*0.00025*	0.0024	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.00094*	0.024	"	"	"	"	"	
Anthracene	"	**0.010**	*0.00017*	0.0024	"	"	"	"	"	
Benzo[a]anthracene	"	**0.0059**	*0.00020*	0.0030	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.0031*	0.024	"	"	"	"	"	
Chrysene	"	**0.013**	*0.00017*	0.0030	"	"	"	"	"	
Fluoranthene	"	**0.0078**	*0.00014*	0.0024	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0069**	*0.00025*	0.0036	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.0050*	0.18	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.00016*	0.024	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0023**	*0.00050*	0.0048	"	"	"	"	"	J
Benzo[k]fluoranthene	"	ND	*0.00016*	0.0030	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.00026*	0.0048	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00080*	0.018	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0050**	*0.00018*	0.0030	"	"	"	"	"	
Carbazole	"	ND	*0.00051*	0.018	"	"	"	"	"	
1-Methylnaphthalene	"	**0.087**	*0.00021*	0.0036	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.0052**	*0.00049*	0.0024	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*77%*	*42 - 151 %*	"	"
	2-Fluorophenol	*71%*	*36 - 145 %*	"	"
	Phenol-d5	*79%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*52%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*53%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*103%*	*28 - 143 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
2-Chlorophenol	8270C STD Dry	ND	*0.00098*	0.013	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:45	
Phenol	"	**0.0012**	*0.00098*	0.013	"	"	"	"	"	**J**
1,3-Dichlorobenzene	"	ND	*0.00095*	0.0066	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0013*	0.013	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00042*	0.0066	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0013*	0.013	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0013*	0.013	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0015*	0.013	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00085*	0.0066	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0038*	0.013	"	"	"	"	"	
2-Methylphenol	"	ND	*0.00094*	0.013	"	"	"	"	"	
Isophorone	"	ND	*0.00054*	0.013	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00057*	0.013	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.00074*	0.026	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.00028*	0.013	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00040*	0.013	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00040*	0.013	"	"	"	"	"	
Benzoic acid	"	ND	*0.086*	0.33	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0016*	0.0066	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0028**	*0.00030*	0.0026	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.00034*	0.013	"	"	"	"	"	
Naphthalene	"	**0.0016**	*0.00029*	0.0026	"	"	"	"	"	**J**
2,4,6-Trichlorophenol	"	ND	*0.00053*	0.020	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0015*	0.013	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00057*	0.013	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0012*	0.0066	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00024*	0.0026	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.00094*	0.013	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00056*	0.013	"	"	"	"	"	
Acenaphthylene	"	**0.00098**	*0.00021*	0.0026	"	"	"	"	"	**J**
2,6-Dinitrotoluene	"	ND	*0.00054*	0.013	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.00056*	0.013	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00033*	0.013	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00077*	0.013	"	"	"	"	"	
Acenaphthene	"	ND	*0.00021*	0.0026	"	"	"	"	"	
Diethyl phthalate	"	**0.0049**	*0.0020*	0.013	"	"	"	"	"	**J**
2,4-Dinitrophenol	"	ND	*0.0019*	0.13	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00075*	0.013	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
4-Nitrophenol	8270C STD Dry	ND	*0.022*	0.13	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 15:45	
Fluorene	"	ND	*0.00016*	0.0026	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0019*	0.013	"	"	"	"	"	
Dibenzofuran	"	**0.00093**	*0.00020*	0.013	"	"	"	"	"	**J**
4,6-Dinitro-2-methylphenol	"	ND	*0.0024*	0.13	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00044*	0.013	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00050*	0.0066	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00029*	0.0066	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0016*	0.013	"	"	"	"	"	
Pyrene	"	**0.013**	*0.00019*	0.0026	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0041*	0.013	"	"	"	"	"	
Phenanthrene	"	**0.0043**	*0.00028*	0.0026	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0010*	0.026	"	"	"	"	"	
Anthracene	"	**0.0020**	*0.00019*	0.0026	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.0058**	*0.00022*	0.0033	"	"	"	"	"	
Di-n-butyl phthalate	"	**0.0084**	*0.0034*	0.026	"	"	"	"	"	**J**
Chrysene	"	**0.0085**	*0.00019*	0.0033	"	"	"	"	"	
Fluoranthene	"	**0.014**	*0.00016*	0.0026	"	"	"	"	"	
Benzo[a]pyrene	"	**0.0062**	*0.00028*	0.0040	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	**0.010**	*0.0056*	0.20	"	"	"	"	"	**J**
Di-n-octyl phthalate	"	ND	*0.00017*	0.026	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0040**	*0.00056*	0.0053	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	**0.0022**	*0.00017*	0.0033	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	**0.0017**	*0.00029*	0.0053	"	"	"	"	"	**J**
2,2'-oxybis[1-chloropropane]	"	ND	*0.00089*	0.020	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0049**	*0.00020*	0.0033	"	"	"	"	"	
Carbazole	"	**0.0011**	*0.00057*	0.020	"	"	"	"	"	**J**
1-Methylnaphthalene	"	**0.0015**	*0.00024*	0.0040	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	**0.010**	*0.00054*	0.0026	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*86%*	*42 - 151 %*	"	"
	2-Fluorophenol	*61%*	*36 - 145 %*	"	"
	Phenol-d5	*74%*	*38 - 149 %*	"	"
	Nitrobenzene-d5	*47%*	*38 - 141 %*	"	"
	2-Fluorobiphenyl	*65%*	*42 - 140 %*	"	"
	2,4,6-Tribromophenol	*101%*	*28 - 143 %*	"	"

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
2-Chlorophenol	8270C STD Dry	ND	*0.0011*	0.015	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 16:49	
Phenol	"	ND	*0.0011*	0.015	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0011*	0.0073	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.0015*	0.015	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00047*	0.0073	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.0014*	0.015	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.0014*	0.015	"	"	"	"	"	
Hexachloroethane	"	ND	*0.0016*	0.015	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00094*	0.0073	"	"	"	"	"	
Nitrobenzene	"	ND	*0.0042*	0.015	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0010*	0.015	"	"	"	"	"	
Isophorone	"	ND	*0.00060*	0.015	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.00063*	0.015	"	"	"	"	"	
3 & 4 Methylphenol	"	**0.0020**	*0.00082*	0.029	"	"	"	"	"	**J**
2,4-Dimethylphenol	"	ND	*0.00031*	0.015	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.00044*	0.015	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.00044*	0.015	"	"	"	"	"	
Benzoic acid	"	ND	*0.095*	0.37	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.0018*	0.0073	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0020**	*0.00034*	0.0029	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.00038*	0.015	"	"	"	"	"	
Naphthalene	"	ND	*0.00032*	0.0029	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.00059*	0.022	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.0016*	0.015	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.00063*	0.015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.0013*	0.0073	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.00026*	0.0029	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0010*	0.015	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.00062*	0.015	"	"	"	"	"	
Acenaphthylene	"	ND	*0.00023*	0.0029	"	"	"	"	"	
2,6-Dinitrotoluene	"	**0.0031**	*0.00060*	0.015	"	"	"	"	"	**J**
Dimethyl phthalate	"	ND	*0.00062*	0.015	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.00037*	0.015	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.00085*	0.015	"	"	"	"	"	
Acenaphthene	"	ND	*0.00023*	0.0029	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.0022*	0.015	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.0021*	0.15	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.00084*	0.015	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
4-Nitrophenol	8270C STD Dry	ND	*0.025*	0.15	mg/Kg dry	1x	50242	09/15/09 10:10	09/22/09 16:49	
Fluorene	"	ND	*0.00018*	0.0029	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.0021*	0.015	"	"	"	"	"	
Dibenzofuran	"	ND	*0.00022*	0.015	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.0026*	0.15	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.00048*	0.015	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.00056*	0.0073	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.00032*	0.0073	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.0018*	0.015	"	"	"	"	"	
Pyrene	"	ND	*0.00021*	0.0029	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.0045*	0.015	"	"	"	"	"	
Phenanthrene	"	**0.0014**	*0.00031*	0.0029	"	"	"	"	"	**J**
3,3'-Dichlorobenzidine	"	ND	*0.0012*	0.029	"	"	"	"	"	
Anthracene	"	**0.00081**	*0.00021*	0.0029	"	"	"	"	"	**J**
Benzo[a]anthracene	"	**0.00042**	*0.00025*	0.0037	"	"	"	"	"	**J**
Di-n-butyl phthalate	"	**0.0096**	*0.0038*	0.029	"	"	"	"	"	**J**
Chrysene	"	**0.0033**	*0.00021*	0.0037	"	"	"	"	"	**J**
Fluoranthene	"	**0.0016**	*0.00018*	0.0029	"	"	"	"	"	**J**
Benzo[a]pyrene	"	**0.00098**	*0.00031*	0.0044	"	"	"	"	"	**J**
Bis(2-ethylhexyl) phthalate	"	**0.0068**	*0.0062*	0.22	"	"	"	"	"	**J**
Di-n-octyl phthalate	"	ND	*0.00019*	0.029	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.0016**	*0.00062*	0.0059	"	"	"	"	"	**J**
Benzo[k]fluoranthene	"	**0.00061**	*0.00019*	0.0037	"	"	"	"	"	**J**
Dibenz(a,h)anthracene	"	ND	*0.00032*	0.0059	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.00098*	0.022	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.0023**	*0.00022*	0.0037	"	"	"	"	"	**J**
Carbazole	"	ND	*0.00063*	0.022	"	"	"	"	"	
1-Methylnaphthalene	"	**0.00097**	*0.00026*	0.0044	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	**0.0015**	*0.00060*	0.0029	"	"	"	"	"	**J**
Surrogate(s):	*Terphenyl-d14*		*67%*		*42 - 151 %*	"		"		
	2-Fluorophenol		*51%*		*36 - 145 %*	"		"		
	Phenol-d5		*55%*		*38 - 149 %*	"		"		
	Nitrobenzene-d5		*48%*		*38 - 141 %*	"		"		
	2-Fluorobiphenyl		*31%*		*42 - 140 %*	"		"		***X***
	2,4,6-Tribromophenol		*63%*		*28 - 143 %*	"		"		

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
2-Chlorophenol	8270C STD Dry	ND	*0.0087*	0.12	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 14:50	
Phenol	"	ND	*0.0087*	0.12	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0085*	0.059	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.012*	0.12	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0038*	0.059	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.011*	0.12	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.011*	0.12	"	"	"	"	"	
Hexachloroethane	"	ND	*0.013*	0.12	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0075*	0.059	"	"	"	"	"	
Nitrobenzene	"	ND	*0.034*	0.12	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0083*	0.12	"	"	"	"	"	
Isophorone	"	**0.022**	*0.0048*	0.12	"	"	"	"	"	**J**
2-Nitrophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0066*	0.23	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0025*	0.12	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0035*	0.12	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0035*	0.12	"	"	"	"	"	
Benzoic acid	"	ND	*0.76*	2.9	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.014*	0.059	"	"	"	"	"	
2-Methylnaphthalene	"	**0.016**	*0.0027*	0.023	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.0031*	0.12	"	"	"	"	"	
Naphthalene	"	ND	*0.0026*	0.023	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0047*	0.18	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.013*	0.12	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.011*	0.059	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0021*	0.023	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0083*	0.12	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0049*	0.12	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0019*	0.023	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0048*	0.12	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0049*	0.12	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0029*	0.12	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0068*	0.12	"	"	"	"	"	
Acenaphthene	"	**0.18**	*0.0019*	0.023	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.018*	0.12	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.016*	1.2	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0067*	0.12	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
4-Nitrophenol	8270C STD Dry	ND	*0.20*	1.2	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 14:50	
Fluorene	"	**0.17**	*0.0014*	0.023	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.016*	0.12	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0018*	0.12	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.021*	1.2	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0039*	0.12	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0045*	0.059	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0026*	0.059	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.014*	0.12	"	"	"	"	"	
Pyrene	"	**0.54**	*0.0016*	0.023	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.036*	0.12	"	"	"	"	"	
Phenanthrene	"	**0.48**	*0.0025*	0.023	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0093*	0.23	"	"	"	"	"	
Anthracene	"	**0.10**	*0.0016*	0.023	"	"	"	"	"	
Benzo[a]anthracene	"	**0.10**	*0.0020*	0.029	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.031*	0.23	"	"	"	"	"	
Chrysene	"	**0.29**	*0.0016*	0.029	"	"	"	"	"	
Fluoranthene	"	**0.15**	*0.0014*	0.023	"	"	"	"	"	*
Benzo[a]pyrene	"	**0.097**	*0.0025*	0.035	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.049*	1.8	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0015*	0.23	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	**0.025**	*0.0049*	0.047	"	"	"	"	"	J
Benzo[k]fluoranthene	"	**0.027**	*0.0015*	0.029	"	"	"	"	"	J
Dibenz(a,h)anthracene	"	ND	*0.0026*	0.047	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0079*	0.18	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.038**	*0.0018*	0.029	"	"	"	"	"	
Carbazole	"	ND	*0.0051*	0.18	"	"	"	"	"	
1-Methylnaphthalene	"	**0.11**	*0.0021*	0.035	"	"	"	"	"	
Benzo[b]fluoranthene	"	**0.078**	*0.0048*	0.023	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*0%*	*42 - 151 %*	"	"	***X. D***
	2-Fluorophenol	*0%*	*36 - 145 %*	"	"	***X. D***
	Phenol-d5	*0%*	*38 - 149 %*	"	"	***X. D***
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	***X. D***
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	***X. D***
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	***X. D***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
2-Chlorophenol	8270C STD Dry	ND	*0.010*	0.14	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:11	
Phenol	"	ND	*0.010*	0.14	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0099*	0.068	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.014*	0.14	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0044*	0.068	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.013*	0.14	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.013*	0.14	"	"	"	"	"	
Hexachloroethane	"	ND	*0.015*	0.14	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0088*	0.068	"	"	"	"	"	
Nitrobenzene	"	ND	*0.040*	0.14	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0097*	0.14	"	"	"	"	"	
Isophorone	"	ND	*0.0056*	0.14	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0059*	0.14	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0077*	0.27	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0029*	0.14	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0041*	0.14	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0041*	0.14	"	"	"	"	"	
Benzoic acid	"	ND	*0.89*	3.4	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.016*	0.068	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0055**	*0.0031*	0.027	"	"	"	"	"	J
Hexachlorocyclopentadiene	"	ND	*0.0036*	0.14	"	"	"	"	"	
Naphthalene	"	ND	*0.0030*	0.027	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0055*	0.21	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.015*	0.14	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0059*	0.14	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.012*	0.068	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0025*	0.027	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0097*	0.14	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0057*	0.14	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0022*	0.027	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0056*	0.14	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0057*	0.14	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0034*	0.14	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0079*	0.14	"	"	"	"	"	
Acenaphthene	"	**0.032**	*0.0022*	0.027	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.021*	0.14	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.019*	1.4	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0078*	0.14	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
4-Nitrophenol	8270C STD Dry	ND	*0.23*	1.4	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:11	
Fluorene	"	**0.059**	*0.0016*	0.027	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.019*	0.14	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0021*	0.14	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.025*	1.4	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0045*	0.14	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0052*	0.068	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0030*	0.068	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.016*	0.14	"	"	"	"	"	
Pyrene	"	**0.092**	*0.0019*	0.027	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.042*	0.14	"	"	"	"	"	
Phenanthrene	"	**0.078**	*0.0029*	0.027	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.011*	0.27	"	"	"	"	"	
Anthracene	"	**0.017**	*0.0019*	0.027	"	"	"	"	"	J
Benzo[a]anthracene	"	ND	*0.0023*	0.034	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.036*	0.27	"	"	"	"	"	
Chrysene	"	ND	*0.0019*	0.034	"	"	"	"	"	
Fluoranthene	"	ND	*0.0016*	0.027	"	"	"	"	"	*
Benzo[a]pyrene	"	ND	*0.0029*	0.041	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.057*	2.1	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0018*	0.27	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0057*	0.055	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0018*	0.034	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0030*	0.055	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0092*	0.21	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.028**	*0.0021*	0.034	"	"	"	"	"	J
Carbazole	"	ND	*0.0059*	0.21	"	"	"	"	"	
1-Methylnaphthalene	"	**0.050**	*0.0025*	0.041	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0056*	0.027	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*0%*	*42 - 151 %*	"	"	***X. D***
	2-Fluorophenol	*0%*	*36 - 145 %*	"	"	***X. D***
	Phenol-d5	*0%*	*38 - 149 %*	"	"	***X. D***
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	***X. D***
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	***X. D***
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	***X. D***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
2-Chlorophenol	8270C STD Dry	ND	*0.0087*	0.12	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:31	
Phenol	"	ND	*0.0087*	0.12	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0085*	0.059	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.012*	0.12	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0038*	0.059	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.011*	0.12	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.011*	0.12	"	"	"	"	"	
Hexachloroethane	"	ND	*0.013*	0.12	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0076*	0.059	"	"	"	"	"	
Nitrobenzene	"	ND	*0.034*	0.12	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0084*	0.12	"	"	"	"	"	
Isophorone	"	ND	*0.0048*	0.12	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0066*	0.24	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0025*	0.12	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0035*	0.12	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0035*	0.12	"	"	"	"	"	
Benzoic acid	"	ND	*0.77*	3.0	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.014*	0.059	"	"	"	"	"	
2-Methylnaphthalene	"	**0.47**	*0.0027*	0.024	"	"	"	"	"	
Hexachlorocyclopentadiene	"	ND	*0.0031*	0.12	"	"	"	"	"	
Naphthalene	"	ND	*0.0026*	0.024	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0047*	0.18	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.013*	0.12	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0051*	0.12	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.011*	0.059	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0021*	0.024	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0084*	0.12	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0050*	0.12	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0019*	0.024	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0048*	0.12	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0050*	0.12	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0030*	0.12	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0069*	0.12	"	"	"	"	"	
Acenaphthene	"	**1.9**	*0.0019*	0.024	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.018*	0.12	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.017*	1.2	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0067*	0.12	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
4-Nitrophenol	8270C STD Dry	ND	*0.20*	1.2	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:31	
Fluorene	"	**3.1**	*0.0014*	0.024	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.017*	0.12	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0018*	0.12	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.021*	1.2	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0039*	0.12	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0045*	0.059	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0026*	0.059	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.014*	0.12	"	"	"	"	"	
Pyrene	"	**2.3**	*0.0017*	0.024	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.037*	0.12	"	"	"	"	"	
Phenanthrene	"	**5.0**	*0.0025*	0.024	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0093*	0.24	"	"	"	"	"	
Anthracene	"	**0.23**	*0.0017*	0.024	"	"	"	"	"	
Benzo[a]anthracene	"	**0.48**	*0.0020*	0.030	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.031*	0.24	"	"	"	"	"	
Chrysene	"	**1.0**	*0.0017*	0.030	"	"	"	"	"	
Fluoranthene	"	**0.68**	*0.0014*	0.024	"	"	"	"	"	*
Benzo[a]pyrene	"	ND	*0.0025*	0.035	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.050*	1.8	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0015*	0.24	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0050*	0.047	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0015*	0.030	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0026*	0.047	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0079*	0.18	"	"	"	"	"	
Benzo[g,h,i]perylene	"	**0.12**	*0.0018*	0.030	"	"	"	"	"	
Carbazole	"	ND	*0.0051*	0.18	"	"	"	"	"	
1-Methylnaphthalene	"	**5.0**	*0.0021*	0.035	"	"	"	"	"	
Benzo[b]fluoranthene	"	ND	*0.0048*	0.024	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*0%*	*42 - 151 %*	"	"	***X. D***
	2-Fluorophenol	*0%*	*36 - 145 %*	"	"	***X. D***
	Phenol-d5	*0%*	*38 - 149 %*	"	"	***X. D***
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	***X. D***
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	***X. D***
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	***X. D***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
2-Chlorophenol	8270C STD Dry	ND	*0.0084*	0.11	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:52	
Phenol	"	ND	*0.0084*	0.11	"	"	"	"	"	
1,3-Dichlorobenzene	"	ND	*0.0082*	0.057	"	"	"	"	"	
Bis(2-chloroethyl)ether	"	ND	*0.011*	0.11	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.0036*	0.057	"	"	"	"	"	
N-Nitrosodi-n-propylamine	"	ND	*0.011*	0.11	"	"	"	"	"	
Benzyl alcohol	"	ND	*0.011*	0.11	"	"	"	"	"	
Hexachloroethane	"	ND	*0.013*	0.11	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.0073*	0.057	"	"	"	"	"	
Nitrobenzene	"	ND	*0.033*	0.11	"	"	"	"	"	
2-Methylphenol	"	ND	*0.0081*	0.11	"	"	"	"	"	
Isophorone	"	ND	*0.0047*	0.11	"	"	"	"	"	
2-Nitrophenol	"	ND	*0.0049*	0.11	"	"	"	"	"	
3 & 4 Methylphenol	"	ND	*0.0064*	0.23	"	"	"	"	"	
2,4-Dimethylphenol	"	ND	*0.0024*	0.11	"	"	"	"	"	
Bis(2-chloroethoxy)methane	"	ND	*0.0034*	0.11	"	"	"	"	"	
2,4-Dichlorophenol	"	ND	*0.0034*	0.11	"	"	"	"	"	
Benzoic acid	"	ND	*0.74*	2.8	"	"	"	"	"	
1,2,4-Trichlorobenzene	"	ND	*0.014*	0.057	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0048**	*0.0026*	0.023	"	"	"	"	"	**J**
Hexachlorocyclopentadiene	"	ND	*0.0030*	0.11	"	"	"	"	"	
Naphthalene	"	ND	*0.0025*	0.023	"	"	"	"	"	
2,4,6-Trichlorophenol	"	ND	*0.0046*	0.17	"	"	"	"	"	
4-Chloroaniline	"	ND	*0.013*	0.11	"	"	"	"	"	
2,4,5-Trichlorophenol	"	ND	*0.0049*	0.11	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.010*	0.057	"	"	"	"	"	
2-Chloronaphthalene	"	ND	*0.0020*	0.023	"	"	"	"	"	
4-Chloro-3-methylphenol	"	ND	*0.0081*	0.11	"	"	"	"	"	
2-Nitroaniline	"	ND	*0.0048*	0.11	"	"	"	"	"	
Acenaphthylene	"	ND	*0.0018*	0.023	"	"	"	"	"	
2,6-Dinitrotoluene	"	ND	*0.0047*	0.11	"	"	"	"	"	
Dimethyl phthalate	"	ND	*0.0048*	0.11	"	"	"	"	"	
2,4-Dinitrotoluene	"	ND	*0.0028*	0.11	"	"	"	"	"	
3-Nitroaniline	"	ND	*0.0066*	0.11	"	"	"	"	"	
Acenaphthene	"	ND	*0.0018*	0.023	"	"	"	"	"	
Diethyl phthalate	"	ND	*0.017*	0.11	"	"	"	"	"	
2,4-Dinitrophenol	"	ND	*0.016*	1.1	"	"	"	"	"	
4-Chlorophenyl phenyl ether	"	ND	*0.0065*	0.11	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
4-Nitrophenol	8270C STD Dry	ND	*0.19*	1.1	mg/Kg dry	10x	50242	09/15/09 10:10	09/18/09 15:52	
Fluorene	"	ND	*0.0014*	0.023	"	"	"	"	"	
4-Nitroaniline	"	ND	*0.016*	0.11	"	"	"	"	"	
Dibenzofuran	"	ND	*0.0017*	0.11	"	"	"	"	"	
4,6-Dinitro-2-methylphenol	"	ND	*0.020*	1.1	"	"	"	"	"	
4-Bromophenyl phenyl ether	"	ND	*0.0038*	0.11	"	"	"	"	"	
Hexachlorobenzene	"	ND	*0.0043*	0.057	"	"	"	"	"	
N-Nitrosodiphenylamine	"	ND	*0.0025*	0.057	"	"	"	"	"	
Pentachlorophenol	"	ND	*0.014*	0.11	"	"	"	"	"	
Pyrene	"	**0.023**	*0.0016*	0.023	"	"	"	"	"	
Butyl benzyl phthalate	"	ND	*0.035*	0.11	"	"	"	"	"	
Phenanthrene	"	ND	*0.0024*	0.023	"	"	"	"	"	
3,3'-Dichlorobenzidine	"	ND	*0.0090*	0.23	"	"	"	"	"	
Anthracene	"	ND	*0.0016*	0.023	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0019*	0.028	"	"	"	"	"	
Di-n-butyl phthalate	"	ND	*0.030*	0.23	"	"	"	"	"	
Chrysene	"	**0.0035**	*0.0016*	0.028	"	"	"	"	"	**J**
Fluoranthene	"	**0.0065**	*0.0014*	0.023	"	"	"	"	"	**J, ***
Benzo[a]pyrene	"	ND	*0.0024*	0.034	"	"	"	"	"	
Bis(2-ethylhexyl) phthalate	"	ND	*0.048*	1.7	"	"	"	"	"	
Di-n-octyl phthalate	"	ND	*0.0015*	0.23	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0048*	0.046	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0015*	0.028	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0025*	0.046	"	"	"	"	"	
2,2'-oxybis[1-chloropropane]	"	ND	*0.0076*	0.17	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0017*	0.028	"	"	"	"	"	
Carbazole	"	ND	*0.0049*	0.17	"	"	"	"	"	
1-Methylnaphthalene	"	**0.0033**	*0.0020*	0.034	"	"	"	"	"	**J**
Benzo[b]fluoranthene	"	ND	*0.0047*	0.023	"	"	"	"	"	

Surrogate(s):	*Terphenyl-d14*	*0%*	*42 - 151 %*	"	"	***X. D***
	2-Fluorophenol	*0%*	*36 - 145 %*	"	"	***X. D***
	Phenol-d5	*0%*	*38 - 149 %*	"	"	***X. D***
	Nitrobenzene-d5	*0%*	*38 - 141 %*	"	"	***X. D***
	2-Fluorobiphenyl	*0%*	*42 - 140 %*	"	"	***X. D***
	2,4,6-Tribromophenol	*0%*	*28 - 143 %*	"	"	***X. D***

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Organic Compounds (GC/MS SIM)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-09 (G-EB-090709)		**Water**			**Sampled: 09/07/09 17:00**					
Acenaphthylene	8270C STD	**0.0013**	*0.0010*	0.0094	ug/L	1x	50156	09/14/09 09:08	09/18/09 09:28	**J**
Naphthalene	"	**0.014**	*0.0034*	0.0094	"	"	"	"	"	
2-Methylnaphthalene	"	**0.0079**	*0.0028*	0.012	"	"	"	"	"	**J**
Acenaphthene	"	**0.018**	*0.00094*	0.0094	"	"	"	"	"	**B**
1-Methylnaphthalene	"	**0.0048**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Fluorene	"	**0.0026**	*0.0011*	0.0094	"	"	"	"	"	**J, B**
Chrysene	"	ND	*0.0020*	0.0094	"	"	"	"	"	
Phenanthrene	"	**0.0034**	*0.0010*	0.0094	"	"	"	"	"	**J**
Anthracene	"	**0.0012**	*0.00075*	0.0094	"	"	"	"	"	**J, B**
Benzo[b]fluoranthene	"	ND	*0.0025*	0.0094	"	"	"	"	"	
Benzo[k]fluoranthene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Fluoranthene	"	**0.0026**	*0.0015*	0.0094	"	"	"	"	"	**J, B**
Benzo[a]pyrene	"	ND	*0.0018*	0.019	"	"	"	"	"	
Pyrene	"	ND	*0.0016*	0.0094	"	"	"	"	"	
Benzo[a]anthracene	"	ND	*0.0023*	0.0094	"	"	"	"	"	
Indeno[1,2,3-cd]pyrene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Dibenz(a,h)anthracene	"	ND	*0.0017*	0.0094	"	"	"	"	"	
Benzo[g,h,i]perylene	"	ND	*0.0019*	0.0094	"	"	"	"	"	
Surrogate(s):	*2-Fluorobiphenyl*		*71%*		*50 - 110 %*	"			"	
	Terphenyl-d14		*89%*		*50 - 135 %*	"			"	
	Nitrobenzene-d5		*80%*		*40 - 110 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	**0.00018**	*0.000092*	0.0021	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 18:33	**J**
1,2,3-Trichloropropane	"	ND	*0.00038*	0.0010	"	"	"	"	"	
Naphthalene	"	**0.0030**	*0.00025*	0.0052	"	"	"	"	"	**J, B**
1,2-Dibromo-3-Chloropropane	"	**0.00045**	*0.00019*	0.0021	"	"	"	"	"	**J**
Chloroethane	"	ND	*0.00028*	0.0010	"	"	"	"	"	
Styrene	"	**0.00051**	*0.00033*	0.0010	"	"	"	"	"	**J**
1,2-Dichloroethane	"	ND	*0.00017*	0.0010	"	"	"	"	"	
4-Chlorotoluene	"	**0.00046**	*0.00040*	0.0010	"	"	"	"	"	**J**
Chloroform	"	ND	*0.00015*	0.0010	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00018*	0.0010	"	"	"	"	"	
Chloromethane	"	**0.0032**	*0.00018*	0.0010	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00030*	0.0010	"	"	"	"	"	
Bromobenzene	"	**0.00033**	*0.00016*	0.0010	"	"	"	"	"	**J**
Bromoform	"	ND	*0.000075*	0.0010	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00012*	0.0010	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	**0.0012**	*0.00018*	0.0021	"	"	"	"	"	**J, B**
Bromomethane	"	ND	*0.00040*	0.0010	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000077*	0.0010	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00015*	0.0052	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00039*	0.0010	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00014*	0.0010	"	"	"	"	"	
Hexachlorobutadiene	"	**0.0011**	*0.00035*	0.0010	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00019*	0.0010	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00020*	0.0010	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00011*	0.0010	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0011**	*0.00032*	0.0010	"	"	"	"	"	
Trichloroethene	"	ND	*0.00018*	0.0010	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00040*	0.0010	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.00060**	*0.00037*	0.0021	"	"	"	"	"	**J**
Dichlorodifluoromethane	"	ND	*0.00020*	0.0010	"	"	"	"	"	
Benzene	"	**0.0013**	*0.000083*	0.0010	"	"	"	"	"	**B**
cis-1,2-Dichloroethene	"	ND	*0.00013*	0.0010	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00020*	0.0010	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00026*	0.0010	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00066**	*0.00017*	0.0021	"	"	"	"	"	**J, B**
n-Butylbenzene	"	**0.0012**	*0.00033*	0.0010	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	**0.00077**	*0.00035*	0.0010	"	"	"	"	"	**J**
Tetrachloroethene	"	ND	*0.00011*	0.0010	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00015*	0.0010	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-01 (G-RS1SED-4-090709)		**Soil**			**Sampled: 09/07/09 13:50**					
1,1-Dichloroethane	8260B STD Dry	ND	*0.00041*	0.0010	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 18:33	
2-Chlorotoluene	"	**0.00035**	*0.00015*	0.0010	"	"	"	"	"	**J**
tert-Butylbenzene	"	**0.00082**	*0.00035*	0.0010	"	"	"	"	"	**J**
Chlorodibromomethane	"	ND	*0.00014*	0.0010	"	"	"	"	"	
Dibromomethane	"	ND	*0.00011*	0.0010	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00041*	0.0010	"	"	"	"	"	
Toluene	"	**0.00080**	*0.000089*	0.0010	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	**0.0011**	*0.00040*	0.0021	"	"	"	"	"	**J, B**
o-Xylene	"	**0.00035**	*0.000055*	0.0010	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.0011**	*0.00019*	0.0010	"	"	"	"	"	**B**
1,3-Dichlorobenzene	"	**0.00049**	*0.00040*	0.0010	"	"	"	"	"	**J**
1,2-Dichlorobenzene	"	**0.00059**	*0.00036*	0.0010	"	"	"	"	"	**J**
1,1,1,2-Tetrachloroethane	"	ND	*0.000091*	0.0010	"	"	"	"	"	
sec-Butylbenzene	"	**0.00081**	*0.00036*	0.0010	"	"	"	"	"	**J**
Ethylbenzene	"	**0.00035**	*0.00016*	0.0010	"	"	"	"	"	**J**
Isopropylbenzene	"	**0.00030**	*0.00016*	0.0010	"	"	"	"	"	**J**
2,2-Dichloropropane	"	ND	*0.00040*	0.0010	"	"	"	"	"	
N-Propylbenzene	"	**0.00054**	*0.00015*	0.0010	"	"	"	"	"	**J**
1,4-Dichlorobenzene	"	**0.00065**	*0.00041*	0.0010	"	"	"	"	"	**J, B**
1,3-Dichloropropane	"	ND	*0.00023*	0.0010	"	"	"	"	"	
Surrogate(s):	*4-Bromofluorobenzene (Surr)*		*111%*		*85 - 120 %*	"			"	
	Toluene-d8 (Surr)		*103%*		*85 - 115 %*	"			"	
	Trifluorotoluene (Surr)		*85%*		*75 - 125 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*93%*		*75 - 125 %*	"			"	
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00011*	0.0025	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 18:57	
1,2,3-Trichloropropane	"	ND	*0.00046*	0.0013	"	"	"	"	"	
Naphthalene	"	**0.00067**	*0.00030*	0.0063	"	"	"	"	"	**J, B**
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Chloroethane	"	ND	*0.00034*	0.0013	"	"	"	"	"	
Styrene	"	ND	*0.00040*	0.0013	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0013	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00049*	0.0013	"	"	"	"	"	
Chloroform	"	ND	*0.00019*	0.0013	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00022*	0.0013	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0013	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00036*	0.0013	"	"	"	"	"	
Bromobenzene	"	ND	*0.00020*	0.0013	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
Bromoform	8260B STD Dry	ND	*0.000091*	0.0013	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 18:57	
cis-1,3-Dichloropropene	"	ND	*0.00015*	0.0013	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	**0.00060**	*0.00022*	0.0025	"	"	"	"	"	**J, B**
Bromomethane	"	ND	*0.00049*	0.0013	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000094*	0.0013	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00018*	0.0063	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00047*	0.0013	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00017*	0.0013	"	"	"	"	"	
Hexachlorobutadiene	"	**0.00047**	*0.00043*	0.0013	"	"	"	"	"	**J**
trans-1,3-Dichloropropene	"	ND	*0.00023*	0.0013	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00025*	0.0013	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00013*	0.0013	"	"	"	"	"	
4-Isopropyltoluene	"	**0.00081**	*0.00039*	0.0013	"	"	"	"	"	**J**
Trichloroethene	"	ND	*0.00022*	0.0013	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00049*	0.0013	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00045*	0.0025	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00024*	0.0013	"	"	"	"	"	
Benzene	"	**0.00051**	*0.00010*	0.0013	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00016*	0.0013	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00024*	0.0013	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00032*	0.0013	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00037**	*0.00020*	0.0025	"	"	"	"	"	**J, B**
n-Butylbenzene	"	**0.00052**	*0.00040*	0.0013	"	"	"	"	"	**J**
1,2,4-Trimethylbenzene	"	ND	*0.00042*	0.0013	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00013*	0.0013	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00019*	0.0013	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00050*	0.0013	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00043*	0.0013	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00017*	0.0013	"	"	"	"	"	
Dibromomethane	"	ND	*0.00013*	0.0013	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00049*	0.0013	"	"	"	"	"	
Toluene	"	**0.00079**	*0.00011*	0.0013	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	**0.00054**	*0.00049*	0.0025	"	"	"	"	"	**J, B**
o-Xylene	"	**0.00017**	*0.000067*	0.0013	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.0012**	*0.00023*	0.0013	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00048*	0.0013	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00044*	0.0013	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00011*	0.0013	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-02 (G-RS1SED-0-090709)		**Soil**			**Sampled: 09/07/09 13:55**					
sec-Butylbenzene	8260B STD Dry	ND	*0.00043*	0.0013	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 18:57	
Ethylbenzene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00049*	0.0013	"	"	"	"	"	
N-Propylbenzene	"	**0.00020**	*0.00018*	0.0013	"	"	"	"	"	**J**
1,4-Dichlorobenzene	"	ND	*0.00050*	0.0013	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00028*	0.0013	"	"	"	"	"	
Surrogate(s): *4-Bromofluorobenzene (Surr)*		*112%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*104%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*92%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*95%*			*75 - 125 %*	"			"	
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00014*	0.0031	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 19:21	
1,2,3-Trichloropropane	"	ND	*0.00056*	0.0015	"	"	"	"	"	
Naphthalene	"	ND	*0.00037*	0.0077	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00028*	0.0031	"	"	"	"	"	
Chloroethane	"	ND	*0.00041*	0.0015	"	"	"	"	"	
Styrene	"	ND	*0.00049*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00060*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00023*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00027*	0.0015	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00044*	0.0015	"	"	"	"	"	
Bromobenzene	"	ND	*0.00024*	0.0015	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00018*	0.0015	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	**0.00044**	*0.00027*	0.0031	"	"	"	"	"	**J, B**
Bromomethane	"	ND	*0.00059*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00021*	0.0077	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00057*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00052*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00030*	0.0015	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00016*	0.0015	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-03 (G-RS8SED-3-090709)		**Soil**			**Sampled: 09/07/09 14:45**					
4-Isopropyltoluene	8260B STD Dry	ND	*0.00048*	0.0015	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 19:21	
Trichloroethene	"	ND	*0.00027*	0.0015	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00059*	0.0015	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00054*	0.0031	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00030*	0.0015	"	"	"	"	"	
Benzene	"	**0.00017**	*0.00012*	0.0015	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00020*	0.0015	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00030*	0.0015	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00038*	0.0015	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.00025*	0.0031	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.00048*	0.0015	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00051*	0.0015	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00016*	0.0015	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00023*	0.0015	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00061*	0.0015	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00023*	0.0015	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00052*	0.0015	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00021*	0.0015	"	"	"	"	"	
Dibromomethane	"	ND	*0.00016*	0.0015	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00060*	0.0015	"	"	"	"	"	
Toluene	"	**0.00024**	*0.00013*	0.0015	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00059*	0.0031	"	"	"	"	"	
o-Xylene	"	**0.000098**	*0.000082*	0.0015	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.0011**	*0.00027*	0.0015	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00059*	0.0015	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00054*	0.0015	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00013*	0.0015	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00053*	0.0015	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00023*	0.0015	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00059*	0.0015	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00022*	0.0015	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00061*	0.0015	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00034*	0.0015	"	"	"	"	"	

Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*100%*	*85 - 120 %*	"	"
	Toluene-d8 (Surr)	*101%*	*85 - 115 %*	"	"
	Trifluorotoluene (Surr)	*105%*	*75 - 125 %*	"	"
	1,2-Dichloroethane-d4 (Surr)	*97%*	*75 - 125 %*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00011*	0.0024	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 19:45	
1,2,3-Trichloropropane	"	ND	*0.00043*	0.0012	"	"	"	"	"	
Naphthalene	"	ND	*0.00029*	0.0060	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00022*	0.0024	"	"	"	"	"	
Chloroethane	"	ND	*0.00032*	0.0012	"	"	"	"	"	
Styrene	"	ND	*0.00038*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00019*	0.0012	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00034*	0.0012	"	"	"	"	"	
Bromobenzene	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Bromoform	"	ND	*0.000086*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00021*	0.0024	"	"	"	"	"	
Bromomethane	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000088*	0.0012	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00017*	0.0060	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00044*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00023*	0.0012	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00012*	0.0012	"	"	"	"	"	
4-Isopropyltoluene	"	**0.00078**	*0.00037*	0.0012	"	"	"	"	"	**J**
Trichloroethene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00046*	0.0012	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00042*	0.0024	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00023*	0.0012	"	"	"	"	"	
Benzene	"	**0.00019**	*0.000094*	0.0012	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00015*	0.0012	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00023*	0.0012	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00030*	0.0012	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00020**	*0.00019*	0.0024	"	"	"	"	"	**J, B**
n-Butylbenzene	"	ND	*0.00038*	0.0012	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00012*	0.0012	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-04 (G-RS8SED-0-090709)		**Soil**			**Sampled: 09/07/09 14:50**					
Vinyl chloride	8260B STD Dry	ND	*0.00018*	0.0012	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 19:45	
1,1-Dichloroethane	"	ND	*0.00047*	0.0012	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00016*	0.0012	"	"	"	"	"	
Dibromomethane	"	ND	*0.00013*	0.0012	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Toluene	"	**0.00037**	*0.00010*	0.0012	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00046*	0.0024	"	"	"	"	"	
o-Xylene	"	ND	*0.000063*	0.0012	"	"	"	"	"	
Chlorobenzene	"	**0.00080**	*0.00021*	0.0012	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00045*	0.0012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00010*	0.0012	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00041*	0.0012	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00018*	0.0012	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00046*	0.0012	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00047*	0.0012	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00026*	0.0012	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*105%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*102%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*89%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*96%*			*75 - 125 %*	"			"	
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00013*	0.0028	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:09	
1,2,3-Trichloropropane	"	ND	*0.00051*	0.0014	"	"	"	"	"	
Naphthalene	"	ND	*0.00034*	0.0071	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00026*	0.0028	"	"	"	"	"	
Chloroethane	"	ND	*0.00038*	0.0014	"	"	"	"	"	
Styrene	"	ND	*0.00045*	0.0014	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00023*	0.0014	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00055*	0.0014	"	"	"	"	"	
Chloroform	"	ND	*0.00021*	0.0014	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
Chloromethane	"	ND	*0.00025*	0.0014	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
trans-1,2-Dichloroethene	8260B STD Dry	ND	*0.00041*	0.0014	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:09	
Bromobenzene	"	ND	*0.00022*	0.0014	"	"	"	"	"	
Bromoform	"	ND	*0.00010*	0.0014	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00017*	0.0014	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00024*	0.0028	"	"	"	"	"	
Bromomethane	"	ND	*0.00055*	0.0014	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0014	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00020*	0.0071	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00053*	0.0014	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00019*	0.0014	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00048*	0.0014	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00025*	0.0014	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00028*	0.0014	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00014*	0.0014	"	"	"	"	"	
4-Isopropyltoluene	"	**0.00097**	*0.00044*	0.0014	"	"	"	"	"	**J**
Trichloroethene	"	ND	*0.00025*	0.0014	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00055*	0.0014	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00050*	0.0028	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00027*	0.0014	"	"	"	"	"	
Benzene	"	**0.00033**	*0.00011*	0.0014	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00018*	0.0014	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00027*	0.0014	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00035*	0.0014	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00024**	*0.00023*	0.0028	"	"	"	"	"	**J, B**
n-Butylbenzene	"	ND	*0.00045*	0.0014	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00047*	0.0014	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00015*	0.0014	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00021*	0.0014	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00056*	0.0014	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00021*	0.0014	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00048*	0.0014	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00019*	0.0014	"	"	"	"	"	
Dibromomethane	"	ND	*0.00015*	0.0014	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00055*	0.0014	"	"	"	"	"	
Toluene	"	**0.0018**	*0.00012*	0.0014	"	"	"	"	"	**B**
1,2,4-Trichlorobenzene	"	ND	*0.00055*	0.0028	"	"	"	"	"	
o-Xylene	"	**0.000098**	*0.000075*	0.0014	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.00080**	*0.00025*	0.0014	"	"	"	"	"	**J, B**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-05 (G-RS7SED-0-090709)		**Soil**			**Sampled: 09/07/09 15:30**					
1,3-Dichlorobenzene	8260B STD Dry	ND	*0.00054*	0.0014	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:09	
1,2-Dichlorobenzene	"	ND	*0.00050*	0.0014	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00012*	0.0014	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00049*	0.0014	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00021*	0.0014	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00021*	0.0014	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00055*	0.0014	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00020*	0.0014	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00056*	0.0014	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00031*	0.0014	"	"	"	"	"	
Surrogate(s): *4-Bromofluorobenzene (Surr)*		*103%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*100%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*97%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*95%*			*75 - 125 %*	"			"	
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.000093*	0.0021	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:33	
1,2,3-Trichloropropane	"	ND	*0.00038*	0.0011	"	"	"	"	"	
Naphthalene	"	ND	*0.00025*	0.0053	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00019*	0.0021	"	"	"	"	"	
Chloroethane	"	ND	*0.00028*	0.0011	"	"	"	"	"	
Styrene	"	ND	*0.00033*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00017*	0.0011	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00018*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00030*	0.0011	"	"	"	"	"	
Bromobenzene	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Bromoform	"	ND	*0.000076*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00012*	0.0011	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00018*	0.0021	"	"	"	"	"	
Bromomethane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000078*	0.0011	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00015*	0.0053	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00039*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00014*	0.0011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00035*	0.0011	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
trans-1,3-Dichloropropene	8260B STD Dry	ND	*0.00019*	0.0011	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:33	
Trichlorofluoromethane	"	ND	*0.00021*	0.0011	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00011*	0.0011	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00033*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00019*	0.0011	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00037*	0.0021	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Benzene	"	**0.00024**	*0.000083*	0.0011	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00020*	0.0011	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00026*	0.0011	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00020**	*0.00017*	0.0021	"	"	"	"	"	**J, B**
n-Butylbenzene	"	ND	*0.00033*	0.0011	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00035*	0.0011	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00011*	0.0011	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00016*	0.0011	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00041*	0.0011	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00015*	0.0011	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00035*	0.0011	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00014*	0.0011	"	"	"	"	"	
Dibromomethane	"	ND	*0.00011*	0.0011	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Toluene	"	**0.00034**	*0.000089*	0.0011	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00040*	0.0021	"	"	"	"	"	
o-Xylene	"	**0.000092**	*0.000056*	0.0011	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.00090**	*0.00019*	0.0011	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00040*	0.0011	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.000092*	0.0011	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00036*	0.0011	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00016*	0.0011	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00040*	0.0011	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00015*	0.0011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00042*	0.0011	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00023*	0.0011	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*102%*			*85 - 120 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-06 (G-RS7SED-4-090709)		**Soil**			**Sampled: 09/07/09 15:25**					
Toluene-d8 (Surr)		*101%*			*85 - 115 %*	*1x*			*09/21/09 20:33*	
Trifluorotoluene (Surr)		*130%*			*75 - 125 %*	*"*			*"*	***X***
1,2-Dichloroethane-d4 (Surr)		*103%*			*75 - 125 %*	*"*			*"*	
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00019*	0.0044	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:56	
1,2,3-Trichloropropane	"	ND	*0.00080*	0.0022	"	"	"	"	"	
Naphthalene	"	ND	*0.00053*	0.011	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00040*	0.0044	"	"	"	"	"	
Chloroethane	"	ND	*0.00059*	0.0022	"	"	"	"	"	
Styrene	"	ND	*0.00070*	0.0022	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00035*	0.0022	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00085*	0.0022	"	"	"	"	"	
Chloroform	"	ND	*0.00033*	0.0022	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00038*	0.0022	"	"	"	"	"	
Chloromethane	"	ND	*0.00039*	0.0022	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00063*	0.0022	"	"	"	"	"	
Bromobenzene	"	ND	*0.00035*	0.0022	"	"	"	"	"	
Bromoform	"	ND	*0.00016*	0.0022	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00026*	0.0022	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00038*	0.0044	"	"	"	"	"	
Bromomethane	"	ND	*0.00085*	0.0022	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00016*	0.0022	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00031*	0.011	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00082*	0.0022	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00029*	0.0022	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00074*	0.0022	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00039*	0.0022	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00043*	0.0022	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00022*	0.0022	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0015**	*0.00069*	0.0022	"	"	"	"	"	**J**
Trichloroethene	"	ND	*0.00039*	0.0022	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00085*	0.0022	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00078*	0.0044	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00042*	0.0022	"	"	"	"	"	
Benzene	"	**0.00056**	*0.00017*	0.0022	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00028*	0.0022	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00043*	0.0022	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-07 (G-RS2SED-3-090709)		**Soil**			**Sampled: 09/07/09 16:15**					
Chlorobromomethane	8260B STD Dry	ND	*0.00055*	0.0022	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 20:56	
m-Xylene & p-Xylene	"	ND	*0.00035*	0.0044	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.00069*	0.0022	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00073*	0.0022	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00023*	0.0022	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00033*	0.0022	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00087*	0.0022	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00032*	0.0022	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00074*	0.0022	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00030*	0.0022	"	"	"	"	"	
Dibromomethane	"	ND	*0.00023*	0.0022	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00086*	0.0022	"	"	"	"	"	
Toluene	"	**0.00066**	*0.00019*	0.0022	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00085*	0.0044	"	"	"	"	"	
o-Xylene	"	**0.00017**	*0.00012*	0.0022	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.0014**	*0.00039*	0.0022	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00084*	0.0022	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00077*	0.0022	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00019*	0.0022	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00075*	0.0022	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00033*	0.0022	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00033*	0.0022	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00085*	0.0022	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00032*	0.0022	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00088*	0.0022	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00048*	0.0022	"	"	"	"	"	
Surrogate(s):	*4-Bromofluorobenzene (Surr)*		*106%*		*85 - 120 %*	"			"	
	Toluene-d8 (Surr)		*101%*		*85 - 115 %*	"			"	
	Trifluorotoluene (Surr)		*101%*		*75 - 125 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*98%*		*75 - 125 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00010*	0.0023	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 21:20	
1,2,3-Trichloropropane	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Naphthalene	"	**0.00044**	*0.00028*	0.0058	"	"	"	"	"	**J, B**
1,2-Dibromo-3-Chloropropane	"	ND	*0.00021*	0.0023	"	"	"	"	"	
Chloroethane	"	ND	*0.00031*	0.0012	"	"	"	"	"	
Styrene	"	ND	*0.00036*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00018*	0.0012	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00017*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Chloromethane	"	**0.00080**	*0.00020*	0.0012	"	"	"	"	"	**J**
trans-1,2-Dichloroethene	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Bromobenzene	"	ND	*0.00018*	0.0012	"	"	"	"	"	
Bromoform	"	ND	*0.000083*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00014*	0.0012	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00020*	0.0023	"	"	"	"	"	
Bromomethane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000086*	0.0012	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00016*	0.0058	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00043*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00015*	0.0012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00023*	0.0012	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00012*	0.0012	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0072**	*0.00036*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00020*	0.0012	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00044*	0.0012	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00041*	0.0023	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Benzene	"	**0.00062**	*0.000091*	0.0012	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00015*	0.0012	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00029*	0.0012	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00039**	*0.00018*	0.0023	"	"	"	"	"	**J, B**
n-Butylbenzene	"	ND	*0.00036*	0.0012	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00038*	0.0012	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00012*	0.0012	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-08 (G-RS2SED-0-090709)		**Soil**			**Sampled: 09/07/09 16:20**					
Vinyl chloride	8260B STD Dry	ND	*0.00017*	0.0012	mg/Kg dry	1x	50608	09/21/09 12:40	09/21/09 21:20	
1,1-Dichloroethane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00016*	0.0012	"	"	"	"	"	
Dibromomethane	"	ND	*0.00012*	0.0012	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Toluene	"	**0.00057**	*0.000098*	0.0012	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00044*	0.0023	"	"	"	"	"	
o-Xylene	"	**0.00013**	*0.000061*	0.0012	"	"	"	"	"	**J, B**
Chlorobenzene	"	**0.0030**	*0.00021*	0.0012	"	"	"	"	"	**B**
1,3-Dichlorobenzene	"	ND	*0.00044*	0.0012	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00040*	0.0012	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00010*	0.0012	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00044*	0.0012	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00017*	0.0012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00046*	0.0012	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00025*	0.0012	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*103%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*102%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*166%*			*75 - 125 %*	"			"	***X***
1,2-Dichloroethane-d4 (Surr)		*100%*			*75 - 125 %*	"			"	
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00011*	0.0025	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 15:46	
1,2,3-Trichloropropane	"	ND	*0.00045*	0.0012	"	"	"	"	"	
Naphthalene	"	ND	*0.00030*	0.0062	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00023*	0.0025	"	"	"	"	"	
Chloroethane	"	ND	*0.00033*	0.0012	"	"	"	"	"	
Styrene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00020*	0.0012	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00048*	0.0012	"	"	"	"	"	
Chloroform	"	ND	*0.00018*	0.0012	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00021*	0.0012	"	"	"	"	"	
Chloromethane	"	ND	*0.00022*	0.0012	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
trans-1,2-Dichloroethene	8260B STD Dry	ND	*0.00036*	0.0012	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 15:46	
Bromobenzene	"	ND	*0.00020*	0.0012	"	"	"	"	"	
Bromoform	"	ND	*0.000090*	0.0012	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00015*	0.0012	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00021*	0.0025	"	"	"	"	"	
Bromomethane	"	ND	*0.00048*	0.0012	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000092*	0.0012	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00017*	0.0062	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00046*	0.0012	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00016*	0.0012	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00024*	0.0012	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00013*	0.0012	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
Trichloroethene	"	ND	*0.00022*	0.0012	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00048*	0.0012	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00044*	0.0025	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00024*	0.0012	"	"	"	"	"	
Benzene	"	**0.00025**	*0.000099*	0.0012	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00016*	0.0012	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00024*	0.0012	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00031*	0.0012	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.00020*	0.0025	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.00039*	0.0012	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00041*	0.0012	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00013*	0.0012	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00018*	0.0012	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00049*	0.0012	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00018*	0.0012	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00042*	0.0012	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00017*	0.0012	"	"	"	"	"	
Dibromomethane	"	ND	*0.00013*	0.0012	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00048*	0.0012	"	"	"	"	"	
Toluene	"	**0.00031**	*0.00011*	0.0012	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00048*	0.0025	"	"	"	"	"	
o-Xylene	"	ND	*0.000066*	0.0012	"	"	"	"	"	
Chlorobenzene	"	**0.00046**	*0.00022*	0.0012	"	"	"	"	"	**J, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-10 (G-RS5SED-0-090809)		**Soil**			**Sampled: 09/08/09 08:30**					
1,3-Dichlorobenzene	8260B STD Dry	ND	*0.00047*	0.0012	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 15:46	
1,2-Dichlorobenzene	"	ND	*0.00043*	0.0012	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00011*	0.0012	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00043*	0.0012	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00019*	0.0012	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00019*	0.0012	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00048*	0.0012	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00018*	0.0012	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00050*	0.0012	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00027*	0.0012	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*103%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*99%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*105%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*106%*			*75 - 125 %*	"			"	
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00011*	0.0026	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:10	
1,2,3-Trichloropropane	"	ND	*0.00047*	0.0013	"	"	"	"	"	
Naphthalene	"	ND	*0.00031*	0.0065	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00024*	0.0026	"	"	"	"	"	
Chloroethane	"	ND	*0.00035*	0.0013	"	"	"	"	"	
Styrene	"	ND	*0.00041*	0.0013	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00021*	0.0013	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00050*	0.0013	"	"	"	"	"	
Chloroform	"	ND	*0.00019*	0.0013	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00022*	0.0013	"	"	"	"	"	
Chloromethane	"	ND	*0.00023*	0.0013	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00037*	0.0013	"	"	"	"	"	
Bromobenzene	"	ND	*0.00020*	0.0013	"	"	"	"	"	
Bromoform	"	ND	*0.000094*	0.0013	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00015*	0.0013	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00022*	0.0026	"	"	"	"	"	
Bromomethane	"	ND	*0.00050*	0.0013	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000096*	0.0013	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00018*	0.0065	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00048*	0.0013	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00017*	0.0013	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00044*	0.0013	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
trans-1,3-Dichloropropene	8260B STD Dry	ND	*0.00023*	0.0013	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:10	
Trichlorofluoromethane	"	ND	*0.00025*	0.0013	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00013*	0.0013	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00040*	0.0013	"	"	"	"	"	
Trichloroethene	"	ND	*0.00023*	0.0013	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00050*	0.0013	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00046*	0.0026	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00025*	0.0013	"	"	"	"	"	
Benzene	"	**0.00021**	*0.00010*	0.0013	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00017*	0.0013	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00025*	0.0013	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00032*	0.0013	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00022**	*0.00021*	0.0026	"	"	"	"	"	**J**
n-Butylbenzene	"	ND	*0.00041*	0.0013	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00043*	0.0013	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00013*	0.0013	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00019*	0.0013	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00051*	0.0013	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00044*	0.0013	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00018*	0.0013	"	"	"	"	"	
Dibromomethane	"	ND	*0.00014*	0.0013	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00051*	0.0013	"	"	"	"	"	
Toluene	"	**0.00051**	*0.00011*	0.0013	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00050*	0.0026	"	"	"	"	"	
o-Xylene	"	**0.00018**	*0.000069*	0.0013	"	"	"	"	"	**J**
Chlorobenzene	"	**0.0012**	*0.00023*	0.0013	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00049*	0.0013	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00045*	0.0013	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00011*	0.0013	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00044*	0.0013	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00050*	0.0013	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00019*	0.0013	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00052*	0.0013	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00029*	0.0013	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*103%*			*85 - 120 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-11 (G-RS5DSED-0-090809)		**Soil**			**Sampled: 09/08/09 08:35**					
Toluene-d8 (Surr)		*97%*			*85 - 115 %*	*1x*			*09/22/09 16:10*	
Trifluorotoluene (Surr)		*147%*			*75 - 125 %*	*"*			*"*	***X***
1,2-Dichloroethane-d4 (Surr)		*108%*			*75 - 125 %*	*"*			*"*	
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.000082*	0.0019	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:34	
1,2,3-Trichloropropane	"	ND	*0.00034*	0.00093	"	"	"	"	"	
Naphthalene	"	**0.0034**	*0.00022*	0.0047	"	"	"	"	"	**J**
1,2-Dibromo-3-Chloropropane	"	ND	*0.00017*	0.0019	"	"	"	"	"	
Chloroethane	"	ND	*0.00025*	0.00093	"	"	"	"	"	
Styrene	"	ND	*0.00029*	0.00093	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00015*	0.00093	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00036*	0.00093	"	"	"	"	"	
Chloroform	"	ND	*0.00014*	0.00093	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00016*	0.00093	"	"	"	"	"	
Chloromethane	"	ND	*0.00016*	0.00093	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00027*	0.00093	"	"	"	"	"	
Bromobenzene	"	ND	*0.00015*	0.00093	"	"	"	"	"	
Bromoform	"	ND	*0.000067*	0.00093	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00011*	0.00093	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00016*	0.0019	"	"	"	"	"	
Bromomethane	"	ND	*0.00036*	0.00093	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000069*	0.00093	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00013*	0.0047	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00035*	0.00093	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00012*	0.00093	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00031*	0.00093	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00017*	0.00093	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00018*	0.00093	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.000094*	0.00093	"	"	"	"	"	
4-Isopropyltoluene	"	**0.00045**	*0.00029*	0.00093	"	"	"	"	"	**J**
Trichloroethene	"	ND	*0.00016*	0.00093	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00036*	0.00093	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00033*	0.0019	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00018*	0.00093	"	"	"	"	"	
Benzene	"	**0.00029**	*0.000074*	0.00093	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00012*	0.00093	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00018*	0.00093	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-12 (G-RS5SED-4-090809)		**Soil**			**Sampled: 09/08/09 08:45**					
Chlorobromomethane	8260B STD Dry	ND	*0.00023*	0.00093	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:34	
m-Xylene & p-Xylene	"	**0.00022**	*0.00015*	0.0019	"	"	"	"	"	**J**
n-Butylbenzene	"	ND	*0.00029*	0.00093	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00031*	0.00093	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.000096*	0.00093	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00014*	0.00093	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00037*	0.00093	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00014*	0.00093	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00032*	0.00093	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00013*	0.00093	"	"	"	"	"	
Dibromomethane	"	ND	*0.000098*	0.00093	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00036*	0.00093	"	"	"	"	"	
Toluene	"	**0.00049**	*0.000079*	0.00093	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00036*	0.0019	"	"	"	"	"	
o-Xylene	"	**0.00014**	*0.000050*	0.00093	"	"	"	"	"	**J**
Chlorobenzene	"	**0.0010**	*0.00017*	0.00093	"	"	"	"	"	**B**
1,3-Dichlorobenzene	"	ND	*0.00036*	0.00093	"	"	"	"	"	
1,2-Dichlorobenzene	"	**0.00039**	*0.00033*	0.00093	"	"	"	"	"	**J**
1,1,1,2-Tetrachloroethane	"	ND	*0.000081*	0.00093	"	"	"	"	"	
sec-Butylbenzene	"	**0.0014**	*0.00032*	0.00093	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00014*	0.00093	"	"	"	"	"	
Isopropylbenzene	"	**0.00050**	*0.00014*	0.00093	"	"	"	"	"	**J**
2,2-Dichloropropane	"	ND	*0.00036*	0.00093	"	"	"	"	"	
N-Propylbenzene	"	**0.00045**	*0.00013*	0.00093	"	"	"	"	"	**J**
1,4-Dichlorobenzene	"	ND	*0.00037*	0.00093	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00020*	0.00093	"	"	"	"	"	
Surrogate(s):	*4-Bromofluorobenzene (Surr)*		*104%*		*85 - 120 %*	"			"	
	Toluene-d8 (Surr)		*100%*		*85 - 115 %*	"			"	
	Trifluorotoluene (Surr)		*94%*		*75 - 125 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)		*103%*		*75 - 125 %*	"			"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00013*	0.0030	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:57	
1,2,3-Trichloropropane	"	ND	*0.00054*	0.0015	"	"	"	"	"	
Naphthalene	"	ND	*0.00036*	0.0074	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00027*	0.0030	"	"	"	"	"	
Chloroethane	"	ND	*0.00040*	0.0015	"	"	"	"	"	
Styrene	"	ND	*0.00047*	0.0015	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00024*	0.0015	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00057*	0.0015	"	"	"	"	"	
Chloroform	"	ND	*0.00022*	0.0015	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00025*	0.0015	"	"	"	"	"	
Chloromethane	"	ND	*0.00026*	0.0015	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00043*	0.0015	"	"	"	"	"	
Bromobenzene	"	ND	*0.00023*	0.0015	"	"	"	"	"	
Bromoform	"	ND	*0.00011*	0.0015	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00017*	0.0015	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00026*	0.0030	"	"	"	"	"	
Bromomethane	"	ND	*0.00057*	0.0015	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00011*	0.0015	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00021*	0.0074	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00055*	0.0015	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00020*	0.0015	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00050*	0.0015	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00026*	0.0015	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00029*	0.0015	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00015*	0.0015	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00046*	0.0015	"	"	"	"	"	
Trichloroethene	"	ND	*0.00026*	0.0015	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00057*	0.0015	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00052*	0.0030	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00029*	0.0015	"	"	"	"	"	
Benzene	"	**0.00020**	*0.00012*	0.0015	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00019*	0.0015	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00029*	0.0015	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00037*	0.0015	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00029**	*0.00024*	0.0030	"	"	"	"	"	**J**
n-Butylbenzene	"	ND	*0.00047*	0.0015	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00049*	0.0015	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00015*	0.0015	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-13 (G-RS6SED-0-090809)		**Soil**			**Sampled: 09/08/09 07:40**					
Vinyl chloride	8260B STD Dry	ND	*0.00022*	0.0015	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 16:57	
1,1-Dichloroethane	"	ND	*0.00058*	0.0015	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00022*	0.0015	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00050*	0.0015	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00020*	0.0015	"	"	"	"	"	
Dibromomethane	"	ND	*0.00016*	0.0015	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00058*	0.0015	"	"	"	"	"	
Toluene	"	**0.00029**	*0.00013*	0.0015	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00057*	0.0030	"	"	"	"	"	
o-Xylene	"	**0.00012**	*0.000079*	0.0015	"	"	"	"	"	**J**
Chlorobenzene	"	**0.00035**	*0.00026*	0.0015	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00057*	0.0015	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00052*	0.0015	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00013*	0.0015	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00051*	0.0015	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00022*	0.0015	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00022*	0.0015	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00057*	0.0015	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00021*	0.0015	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00059*	0.0015	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00033*	0.0015	"	"	"	"	"	
Surrogate(s): *4-Bromofluorobenzene (Surr)*		*104%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*98%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*97%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*102%*			*75 - 125 %*	"			"	
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	**0.00027**	*0.00012*	0.0028	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:09	**J**
1,2,3-Trichloropropane	"	ND	*0.00050*	0.0014	"	"	"	"	"	
Naphthalene	"	**0.0018**	*0.00033*	0.0070	"	"	"	"	"	**J**
1,2-Dibromo-3-Chloropropane	"	**0.00054**	*0.00025*	0.0028	"	"	"	"	"	**J**
Chloroethane	"	ND	*0.00037*	0.0014	"	"	"	"	"	
Styrene	"	**0.00049**	*0.00044*	0.0014	"	"	"	"	"	**J**
1,2-Dichloroethane	"	ND	*0.00022*	0.0014	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00054*	0.0014	"	"	"	"	"	
Chloroform	"	ND	*0.00021*	0.0014	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00024*	0.0014	"	"	"	"	"	
Chloromethane	"	ND	*0.00024*	0.0014	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
trans-1,2-Dichloroethene	8260B STD Dry	ND	*0.00040*	0.0014	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:09	
Bromobenzene	"	**0.00035**	*0.00022*	0.0014	"	"	"	"	"	**J**
Bromoform	"	ND	*0.00010*	0.0014	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00016*	0.0014	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	**0.0010**	*0.00024*	0.0028	"	"	"	"	"	**J, B**
Bromomethane	"	ND	*0.00054*	0.0014	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00010*	0.0014	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00019*	0.0070	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00052*	0.0014	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00018*	0.0014	"	"	"	"	"	
Hexachlorobutadiene	"	**0.00093**	*0.00047*	0.0014	"	"	"	"	"	**J**
trans-1,3-Dichloropropene	"	ND	*0.00025*	0.0014	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00027*	0.0014	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00014*	0.0014	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0022**	*0.00043*	0.0014	"	"	"	"	"	
Trichloroethene	"	ND	*0.00024*	0.0014	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00053*	0.0014	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	**0.00054**	*0.00049*	0.0028	"	"	"	"	"	**J**
Dichlorodifluoromethane	"	ND	*0.00027*	0.0014	"	"	"	"	"	
Benzene	"	**0.00063**	*0.00011*	0.0014	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00018*	0.0014	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00027*	0.0014	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00035*	0.0014	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00065**	*0.00022*	0.0028	"	"	"	"	"	**J**
n-Butylbenzene	"	**0.0011**	*0.00044*	0.0014	"	"	"	"	"	**J**
1,2,4-Trimethylbenzene	"	**0.00072**	*0.00046*	0.0014	"	"	"	"	"	**J**
Tetrachloroethene	"	ND	*0.00014*	0.0014	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00021*	0.0014	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00055*	0.0014	"	"	"	"	"	
2-Chlorotoluene	"	**0.00029**	*0.00020*	0.0014	"	"	"	"	"	**J**
tert-Butylbenzene	"	**0.00062**	*0.00047*	0.0014	"	"	"	"	"	**J**
Chlorodibromomethane	"	ND	*0.00019*	0.0014	"	"	"	"	"	
Dibromomethane	"	ND	*0.00015*	0.0014	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00054*	0.0014	"	"	"	"	"	
Toluene	"	**0.0022**	*0.00012*	0.0014	"	"	"	"	"	**B**
1,2,4-Trichlorobenzene	"	**0.00088**	*0.00053*	0.0028	"	"	"	"	"	**J**
o-Xylene	"	**0.00036**	*0.000074*	0.0014	"	"	"	"	"	**J**
Chlorobenzene	"	**0.00058**	*0.00025*	0.0014	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	**0.00054**	*0.00053*	0.0014	"	"	"	"	"	**J**

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-14 (G-RS6SED-3-090809)		**Soil**			**Sampled: 09/08/09 07:35**					
1,2-Dichlorobenzene	8260B STD Dry	**0.00057**	*0.00048*	0.0014	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:09	**J**
1,1,1,2-Tetrachloroethane	"	ND	*0.00012*	0.0014	"	"	"	"	"	
sec-Butylbenzene	"	**0.00072**	*0.00047*	0.0014	"	"	"	"	"	**J**
Ethylbenzene	"	**0.00028**	*0.00021*	0.0014	"	"	"	"	"	**J**
Isopropylbenzene	"	**0.00029**	*0.00021*	0.0014	"	"	"	"	"	**J**
2,2-Dichloropropane	"	ND	*0.00053*	0.0014	"	"	"	"	"	
N-Propylbenzene	"	**0.00088**	*0.00020*	0.0014	"	"	"	"	"	**J**
1,4-Dichlorobenzene	"	**0.00070**	*0.00055*	0.0014	"	"	"	"	"	**J**
1,3-Dichloropropane	"	ND	*0.00030*	0.0014	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*105%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*101%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*89%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*96%*			*75 - 125 %*	"			"	
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.000071*	0.0016	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:33	
1,2,3-Trichloropropane	"	ND	*0.00029*	0.00080	"	"	"	"	"	
Naphthalene	"	ND	*0.00019*	0.0040	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00015*	0.0016	"	"	"	"	"	
Chloroethane	"	ND	*0.00022*	0.00080	"	"	"	"	"	
Styrene	"	ND	*0.00025*	0.00080	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00013*	0.00080	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00031*	0.00080	"	"	"	"	"	
Chloroform	"	ND	*0.00012*	0.00080	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00014*	0.00080	"	"	"	"	"	
Chloromethane	"	ND	*0.00014*	0.00080	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00023*	0.00080	"	"	"	"	"	
Bromobenzene	"	ND	*0.00013*	0.00080	"	"	"	"	"	
Bromoform	"	ND	*0.000058*	0.00080	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000094*	0.00080	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	**0.00021**	*0.00014*	0.0016	"	"	"	"	"	**J, B**
Bromomethane	"	ND	*0.00031*	0.00080	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000059*	0.00080	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00011*	0.0040	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00030*	0.00080	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00011*	0.00080	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00027*	0.00080	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00014*	0.00080	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Trichlorofluoromethane	8260B STD Dry	ND	*0.00016*	0.00080	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:33	
1,1,2-Trichloroethane	"	ND	*0.000081*	0.00080	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00025*	0.00080	"	"	"	"	"	
Trichloroethene	"	ND	*0.00014*	0.00080	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00031*	0.00080	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00028*	0.0016	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00015*	0.00080	"	"	"	"	"	
Benzene	"	**0.00026**	*0.000063*	0.00080	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00010*	0.00080	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00015*	0.00080	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00020*	0.00080	"	"	"	"	"	
m-Xylene & p-Xylene	"	**0.00014**	*0.00013*	0.0016	"	"	"	"	"	**J**
n-Butylbenzene	"	ND	*0.00025*	0.00080	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00027*	0.00080	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.000083*	0.00080	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00012*	0.00080	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00032*	0.00080	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00012*	0.00080	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00027*	0.00080	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00011*	0.00080	"	"	"	"	"	
Dibromomethane	"	ND	*0.000084*	0.00080	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00031*	0.00080	"	"	"	"	"	
Toluene	"	**0.00022**	*0.000068*	0.00080	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00031*	0.0016	"	"	"	"	"	
o-Xylene	"	**0.000077**	*0.000043*	0.00080	"	"	"	"	"	**J**
Chlorobenzene	"	**0.00021**	*0.00014*	0.00080	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00030*	0.00080	"	"	"	"	"	
1,2-Dichlorobenzene	"	ND	*0.00028*	0.00080	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.000070*	0.00080	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00027*	0.00080	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00012*	0.00080	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00012*	0.00080	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00031*	0.00080	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00012*	0.00080	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00032*	0.00080	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00018*	0.00080	"	"	"	"	"	
Surrogate(s):	*4-Bromofluorobenzene (Surr)*		*103%*		*85 - 120 %*	"			"	
	Toluene-d8 (Surr)		*100%*		*85 - 115 %*	"			"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-15 (G-RS3SED-4-090809)		**Soil**			**Sampled: 09/08/09 11:15**					
Trifluorotoluene (Surr)		*88%*			*75 - 125 %*	*1x*			*09/22/09 18:33*	
1,2-Dichloroethane-d4 (Surr)		*101%*			*75 - 125 %*	*"*			*"*	
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.00014*	0.0033	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:57	
1,2,3-Trichloropropane	"	ND	*0.00059*	0.0016	"	"	"	"	"	
Naphthalene	"	**0.0035**	*0.00039*	0.0082	"	"	"	"	"	**J**
1,2-Dibromo-3-Chloropropane	"	ND	*0.00030*	0.0033	"	"	"	"	"	
Chloroethane	"	ND	*0.00044*	0.0016	"	"	"	"	"	
Styrene	"	ND	*0.00052*	0.0016	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00026*	0.0016	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00063*	0.0016	"	"	"	"	"	
Chloroform	"	ND	*0.00024*	0.0016	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00028*	0.0016	"	"	"	"	"	
Chloromethane	"	ND	*0.00029*	0.0016	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00047*	0.0016	"	"	"	"	"	
Bromobenzene	"	ND	*0.00026*	0.0016	"	"	"	"	"	
Bromoform	"	ND	*0.00012*	0.0016	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00019*	0.0016	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00028*	0.0033	"	"	"	"	"	
Bromomethane	"	ND	*0.00063*	0.0016	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.00012*	0.0016	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00023*	0.0082	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00061*	0.0016	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00022*	0.0016	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00055*	0.0016	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00029*	0.0016	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00032*	0.0016	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00017*	0.0016	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0020**	*0.00051*	0.0016	"	"	"	"	"	
Trichloroethene	"	ND	*0.00029*	0.0016	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00063*	0.0016	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00058*	0.0033	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00031*	0.0016	"	"	"	"	"	
Benzene	"	**0.00064**	*0.00013*	0.0016	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00021*	0.0016	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00032*	0.0016	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00041*	0.0016	"	"	"	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-16 (G-RS3SED-0-090809)		**Soil**			**Sampled: 09/08/09 11:10**					
m-Xylene & p-Xylene	8260B STD Dry	**0.00048**	*0.00026*	0.0033	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 18:57	**J**
n-Butylbenzene	"	**0.0092**	*0.00051*	0.0016	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00054*	0.0016	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00017*	0.0016	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00024*	0.0016	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00064*	0.0016	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00024*	0.0016	"	"	"	"	"	
tert-Butylbenzene	"	**0.00089**	*0.00055*	0.0016	"	"	"	"	"	**J**
Chlorodibromomethane	"	ND	*0.00022*	0.0016	"	"	"	"	"	
Dibromomethane	"	ND	*0.00017*	0.0016	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00064*	0.0016	"	"	"	"	"	
Toluene	"	**0.00079**	*0.00014*	0.0016	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00063*	0.0033	"	"	"	"	"	
o-Xylene	"	**0.00097**	*0.000087*	0.0016	"	"	"	"	"	**J**
Chlorobenzene	"	**0.0010**	*0.00029*	0.0016	"	"	"	"	"	**J, B**
1,3-Dichlorobenzene	"	ND	*0.00062*	0.0016	"	"	"	"	"	
1,2-Dichlorobenzene	"	**0.0023**	*0.00057*	0.0016	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.00014*	0.0016	"	"	"	"	"	
sec-Butylbenzene	"	**0.0065**	*0.00056*	0.0016	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00024*	0.0016	"	"	"	"	"	
Isopropylbenzene	"	**0.0028**	*0.00024*	0.0016	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00063*	0.0016	"	"	"	"	"	
N-Propylbenzene	"	**0.00072**	*0.00024*	0.0016	"	"	"	"	"	**J**
1,4-Dichlorobenzene	"	**0.00094**	*0.00065*	0.0016	"	"	"	"	"	**J**
1,3-Dichloropropane	"	ND	*0.00036*	0.0016	"	"	"	"	"	

Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*114%*	*85 - 120 %*	"	"
	Toluene-d8 (Surr)	*104%*	*85 - 115 %*	"	"
	Trifluorotoluene (Surr)	*94%*	*75 - 125 %*	"	"
	1,2-Dichloroethane-d4 (Surr)	*96%*	*75 - 125 %*	"	"

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.000096*	0.0022	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 19:21	
1,2,3-Trichloropropane	"	ND	*0.00039*	0.0011	"	"	"	"	"	
Naphthalene	"	**0.0062**	*0.00026*	0.0055	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00020*	0.0022	"	"	"	"	"	
Chloroethane	"	ND	*0.00029*	0.0011	"	"	"	"	"	
Styrene	"	ND	*0.00034*	0.0011	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00017*	0.0011	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Chloroform	"	ND	*0.00016*	0.0011	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Chloromethane	"	ND	*0.00019*	0.0011	"	"	"	"	"	
trans-1,2-Dichloroethene	"	ND	*0.00031*	0.0011	"	"	"	"	"	
Bromobenzene	"	ND	*0.00017*	0.0011	"	"	"	"	"	
Bromoform	"	ND	*0.000079*	0.0011	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.00013*	0.0011	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00019*	0.0022	"	"	"	"	"	
Bromomethane	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000081*	0.0011	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00015*	0.0055	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00041*	0.0011	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00014*	0.0011	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00019*	0.0011	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00021*	0.0011	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.00011*	0.0011	"	"	"	"	"	
4-Isopropyltoluene	"	**0.0041**	*0.00034*	0.0011	"	"	"	"	"	
Trichloroethene	"	ND	*0.00019*	0.0011	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00042*	0.0011	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00038*	0.0022	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00021*	0.0011	"	"	"	"	"	
Benzene	"	**0.00053**	*0.000086*	0.0011	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.00014*	0.0011	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00021*	0.0011	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00027*	0.0011	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.00017*	0.0022	"	"	"	"	"	
n-Butylbenzene	"	**0.018**	*0.00034*	0.0011	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00036*	0.0011	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.00011*	0.0011	"	"	"	"	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-17 (G-RS4SED-0-090809)		**Soil**			**Sampled: 09/08/09 12:20**					
Vinyl chloride	8260B STD Dry	ND	*0.00016*	0.0011	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 19:21	
1,1-Dichloroethane	"	ND	*0.00043*	0.0011	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00016*	0.0011	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00037*	0.0011	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00015*	0.0011	"	"	"	"	"	
Dibromomethane	"	ND	*0.00011*	0.0011	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00042*	0.0011	"	"	"	"	"	
Toluene	"	**0.0014**	*0.000093*	0.0011	"	"	"	"	"	B
1,2,4-Trichlorobenzene	"	ND	*0.00042*	0.0022	"	"	"	"	"	
o-Xylene	"	ND	*0.000058*	0.0011	"	"	"	"	"	
Chlorobenzene	"	**0.0020**	*0.00019*	0.0011	"	"	"	"	"	B
1,3-Dichlorobenzene	"	ND	*0.00041*	0.0011	"	"	"	"	"	
1,2-Dichlorobenzene	"	**0.0019**	*0.00038*	0.0011	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.000095*	0.0011	"	"	"	"	"	
sec-Butylbenzene	"	**0.010**	*0.00037*	0.0011	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00016*	0.0011	"	"	"	"	"	
Isopropylbenzene	"	**0.0025**	*0.00016*	0.0011	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00042*	0.0011	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00016*	0.0011	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00043*	0.0011	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00024*	0.0011	"	"	"	"	"	
Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*127%*			*85 - 120 %*	"			"	*X*
	Toluene-d8 (Surr)	*109%*			*85 - 115 %*	"			"	
	Trifluorotoluene (Surr)	*95%*			*75 - 125 %*	"			"	
	1,2-Dichloroethane-d4 (Surr)	*98%*			*75 - 125 %*	"			"	
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	*0.000069*	0.0016	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 19:44	
1,2,3-Trichloropropane	"	ND	*0.00028*	0.00078	"	"	"	"	"	
Naphthalene	"	ND	*0.00019*	0.0039	"	"	"	"	"	
1,2-Dibromo-3-Chloropropane	"	ND	*0.00014*	0.0016	"	"	"	"	"	
Chloroethane	"	ND	*0.00021*	0.00078	"	"	"	"	"	
Styrene	"	ND	*0.00025*	0.00078	"	"	"	"	"	
1,2-Dichloroethane	"	ND	*0.00012*	0.00078	"	"	"	"	"	
4-Chlorotoluene	"	ND	*0.00030*	0.00078	"	"	"	"	"	
Chloroform	"	ND	*0.00012*	0.00078	"	"	"	"	"	
1,2-Dichloropropane	"	ND	*0.00013*	0.00078	"	"	"	"	"	
Chloromethane	"	ND	*0.00014*	0.00078	"	"	"	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
trans-1,2-Dichloroethene	8260B STD Dry	ND	*0.00022*	0.00078	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 19:44	
Bromobenzene	"	ND	*0.00012*	0.00078	"	"	"	"	"	
Bromoform	"	ND	*0.000056*	0.00078	"	"	"	"	"	
cis-1,3-Dichloropropene	"	ND	*0.000091*	0.00078	"	"	"	"	"	
1,2,3-Trichlorobenzene	"	ND	*0.00013*	0.0016	"	"	"	"	"	
Bromomethane	"	ND	*0.00030*	0.00078	"	"	"	"	"	
Dichlorobromomethane	"	ND	*0.000058*	0.00078	"	"	"	"	"	
1,1-Dichloroethene	"	ND	*0.00011*	0.0039	"	"	"	"	"	
Carbon tetrachloride	"	ND	*0.00029*	0.00078	"	"	"	"	"	
Ethylene Dibromide	"	ND	*0.00010*	0.00078	"	"	"	"	"	
Hexachlorobutadiene	"	ND	*0.00026*	0.00078	"	"	"	"	"	
trans-1,3-Dichloropropene	"	ND	*0.00014*	0.00078	"	"	"	"	"	
Trichlorofluoromethane	"	ND	*0.00015*	0.00078	"	"	"	"	"	
1,1,2-Trichloroethane	"	ND	*0.000079*	0.00078	"	"	"	"	"	
4-Isopropyltoluene	"	ND	*0.00024*	0.00078	"	"	"	"	"	
Trichloroethene	"	ND	*0.00014*	0.00078	"	"	"	"	"	
1,1,1-Trichloroethane	"	ND	*0.00030*	0.00078	"	"	"	"	"	
1,3,5-Trimethylbenzene	"	ND	*0.00027*	0.0016	"	"	"	"	"	
Dichlorodifluoromethane	"	ND	*0.00015*	0.00078	"	"	"	"	"	
Benzene	"	**0.00011**	*0.000062*	0.00078	"	"	"	"	"	**J, B**
cis-1,2-Dichloroethene	"	ND	*0.000099*	0.00078	"	"	"	"	"	
Methylene Chloride	"	ND	*0.00015*	0.00078	"	"	"	"	"	
Chlorobromomethane	"	ND	*0.00019*	0.00078	"	"	"	"	"	
m-Xylene & p-Xylene	"	ND	*0.00012*	0.0016	"	"	"	"	"	
n-Butylbenzene	"	ND	*0.00025*	0.00078	"	"	"	"	"	
1,2,4-Trimethylbenzene	"	ND	*0.00026*	0.00078	"	"	"	"	"	
Tetrachloroethene	"	ND	*0.000080*	0.00078	"	"	"	"	"	
Vinyl chloride	"	ND	*0.00012*	0.00078	"	"	"	"	"	
1,1-Dichloroethane	"	ND	*0.00031*	0.00078	"	"	"	"	"	
2-Chlorotoluene	"	ND	*0.00011*	0.00078	"	"	"	"	"	
tert-Butylbenzene	"	ND	*0.00026*	0.00078	"	"	"	"	"	
Chlorodibromomethane	"	ND	*0.00011*	0.00078	"	"	"	"	"	
Dibromomethane	"	ND	*0.000082*	0.00078	"	"	"	"	"	
1,1-Dichloropropene	"	ND	*0.00030*	0.00078	"	"	"	"	"	
Toluene	"	**0.00016**	*0.000066*	0.00078	"	"	"	"	"	**J, B**
1,2,4-Trichlorobenzene	"	ND	*0.00030*	0.0016	"	"	"	"	"	
o-Xylene	"	**0.000049**	*0.000041*	0.00078	"	"	"	"	"	**J**
Chlorobenzene	"	**0.00025**	*0.00014*	0.00078	"	"	"	"	"	**J, B**

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-18 (G-RS4SED-4-090809)		**Soil**			**Sampled: 09/08/09 12:25**					
1,3-Dichlorobenzene	8260B STD Dry	ND	*0.00030*	0.00078	mg/Kg dry	1x	50646	09/22/09 07:32	09/22/09 19:44	
1,2-Dichlorobenzene	"	ND	*0.00027*	0.00078	"	"	"	"	"	
1,1,1,2-Tetrachloroethane	"	ND	*0.000068*	0.00078	"	"	"	"	"	
sec-Butylbenzene	"	ND	*0.00027*	0.00078	"	"	"	"	"	
Ethylbenzene	"	ND	*0.00012*	0.00078	"	"	"	"	"	
Isopropylbenzene	"	ND	*0.00012*	0.00078	"	"	"	"	"	
2,2-Dichloropropane	"	ND	*0.00030*	0.00078	"	"	"	"	"	
N-Propylbenzene	"	ND	*0.00011*	0.00078	"	"	"	"	"	
1,4-Dichlorobenzene	"	ND	*0.00031*	0.00078	"	"	"	"	"	
1,3-Dichloropropane	"	ND	*0.00017*	0.00078	"	"	"	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*102%*			*85 - 120 %*	"			"	
Toluene-d8 (Surr)		*101%*			*85 - 115 %*	"			"	
Trifluorotoluene (Surr)		*91%*			*75 - 125 %*	"			"	
1,2-Dichloroethane-d4 (Surr)		*92%*			*75 - 125 %*	"			"	
SSI0049-19 (TRIP BLANK)		**Soil**			**Sampled: 09/08/09 00:00**					
Chloromethane	8260B STD	ND	*60*	400	ug/Kg	1x	51093	09/29/09 14:54	09/29/09 21:21	**H**
Dichlorodifluoromethane	"	ND	*8.0*	40	"	"	"	"	"	**H**
1,1-Dichloroethane	"	ND	*3.8*	40	"	"	"	"	"	**H**
Vinyl chloride	"	ND	*1.7*	8.0	"	"	"	"	"	**H**
2,2-Dichloropropane	"	ND	*3.7*	40	"	"	"	"	"	**H**
Bromomethane	"	ND	*25*	140	"	"	"	"	"	**H**
Chloroethane	"	ND	*23*	400	"	"	"	"	"	**H**
cis-1,2-Dichloroethene	"	ND	*2.4*	40	"	"	"	"	"	**H**
Chlorobromomethane	"	ND	*12*	40	"	"	"	"	"	**H**
Trichlorofluoromethane	"	ND	*5.0*	40	"	"	"	"	"	**H**
1,1-Dichloroethene	"	ND	*5.0*	20	"	"	"	"	"	**H**
Chloroform	"	ND	*2.1*	40	"	"	"	"	"	**H**
1,1,1-Trichloroethane	"	ND	*5.0*	40	"	"	"	"	"	**H**
Methylene Chloride	"	**7.9**	*3.8*	40	"	"	"	"	"	**J, H**
Carbon tetrachloride	"	ND	*3.7*	20	"	"	"	"	"	**H**
trans-1,2-Dichloroethene	"	ND	*3.5*	40	"	"	"	"	"	**H**
1,1-Dichloropropene	"	ND	*1.8*	40	"	"	"	"	"	**H**
Benzene	"	ND	*2.5*	16	"	"	"	"	"	**H**
1,2-Dichloroethane	"	ND	*2.2*	40	"	"	"	"	"	**H**
trans-1,3-Dichloropropene	"	ND	*4.0*	16	"	"	"	"	"	**H**
1,1,2-Trichloroethane	"	ND	*1.8*	12	"	"	"	"	"	**H**
Trichloroethene	"	ND	*3.4*	16	"	"	"	"	"	**H**

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-19 (TRIP BLANK)		**Soil**			**Sampled: 09/08/09 00:00**					
1,2-Dichloropropane	8260B STD	ND	*3.9*	12	ug/Kg	1x	51093	09/29/09 14:54	09/29/09 21:21	**H**
Tetrachloroethene	"	ND	*2.1*	20	"	"	"	"	"	**H**
1,3-Dichloropropane	"	ND	*5.0*	40	"	"	"	"	"	**H**
Dibromomethane	"	ND	*4.0*	40	"	"	"	"	"	**H**
Chlorodibromomethane	"	ND	*8.0*	40	"	"	"	"	"	**H**
Dichlorobromomethane	"	ND	*3.0*	40	"	"	"	"	"	**H**
cis-1,3-Dichloropropene	"	ND	*2.4*	16	"	"	"	"	"	**H**
Ethylene Dibromide	"	ND	*3.2*	40	"	"	"	"	"	**H**
Chlorobenzene	"	ND	*2.3*	40	"	"	"	"	"	**H**
Toluene	"	ND	*2.4*	40	"	"	"	"	"	**H**
1,1,1,2-Tetrachloroethane	"	ND	*4.8*	40	"	"	"	"	"	**H**
Ethylbenzene	"	ND	*3.7*	40	"	"	"	"	"	**H**
1,1,2,2-Tetrachloroethane	"	ND	*3.3*	10	"	"	"	"	"	**H**
N-Propylbenzene	"	ND	*2.8*	40	"	"	"	"	"	**H**
1,2,3-Trichloropropane	"	ND	*12*	40	"	"	"	"	"	**H**
m-Xylene & p-Xylene	"	ND	*7.8*	40	"	"	"	"	"	**H**
2-Chlorotoluene	"	ND	*5.4*	40	"	"	"	"	"	**H**
o-Xylene	"	ND	*2.3*	40	"	"	"	"	"	**H**
1,3,5-Trimethylbenzene	"	**4.4**	*4.2*	40	"	"	"	"	"	**J, H**
Styrene	"	ND	*3.8*	40	"	"	"	"	"	**H**
4-Chlorotoluene	"	ND	*13*	40	"	"	"	"	"	**H**
Bromoform	"	ND	*11*	40	"	"	"	"	"	**H**
Isopropylbenzene	"	ND	*1.8*	40	"	"	"	"	"	**H**
tert-Butylbenzene	"	ND	*3.2*	40	"	"	"	"	"	**H**
1,2,4-Trimethylbenzene	"	ND	*2.1*	40	"	"	"	"	"	**H**
Bromobenzene	"	ND	*2.7*	40	"	"	"	"	"	**H**
1,3-Dichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
sec-Butylbenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
4-Isopropyltoluene	"	ND	*2.8*	40	"	"	"	"	"	**H**
Hexachlorobutadiene	"	**120**	*5.6*	40	"	"	"	"	"	**H**
1,4-Dichlorobenzene	"	ND	*5.0*	40	"	"	"	"	"	**H**
Naphthalene	"	ND	*6.0*	40	"	"	"	"	"	**H**
n-Butylbenzene	"	**21**	*7.3*	40	"	"	"	"	"	**J, H**
1,2-Dichlorobenzene	"	ND	*2.6*	40	"	"	"	"	"	**H**
1,2-Dibromo-3-Chloropropane	"	ND	*66*	200	"	"	"	"	"	**H**
1,2,4-Trichlorobenzene	"	**33**	*5.0*	40	"	"	"	"	"	**J, H**
1,2,3-Trichlorobenzene	"	**73**	*5.0*	40	"	"	"	"	"	**H**
Surrogate(s): Fluorobenzene (Surr)		*105%*			*75 - 125 %*	"			"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS)

TestAmerica Tacoma

Analyte	Method	Result	MDL*	MRL	Units	Dil	Batch	Prepared	Analyzed	Notes
SSI0049-19 (TRIP BLANK)		**Soil**			**Sampled: 09/08/09 00:00**					
Toluene-d8 (Surr)		*99%*			*85 - 115 %*	*1x*			*09/29/09 21:21*	
Ethylbenzene-d10		*105%*			*75 - 125 %*	*"*			*"*	
4-Bromofluorobenzene (Surr)		*100%*			*85 - 120 %*	*"*			*"*	
Trifluorotoluene (Surr)		*88%*			*75 - 125 %*	*"*			*"*	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Petroleum Products by NWTPH-Dx - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090094 **Water Preparation Method: EPA 3510/600 Series**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090094-BLK1)													**Extracted: 09/15/09 07:58**	
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	0.250	mg/l	1x	--	--	--	--	--	--	09/16/09 22:57	
Heavy Oil Range Hydrocarbons	"	ND	---	0.500	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 76.3%*			*Limits: 50-150%*	"							*09/16/09 22:57*	
p-Terphenyl-d14		*96.7%*			*50-150%*	"							"	
LCS (9090094-BS1)													**Extracted: 09/15/09 07:58**	
Diesel Range Hydrocarbons	NWTPH-Dx	1.96	---	0.250	mg/l	1x	--	2.50	78.3%	(54.5-136)	--	--	09/16/09 23:21	
Surrogate(s): 2-FBP		*Recovery: 86.4%*			*Limits: 50-150%*	"							*09/16/09 23:21*	
p-Terphenyl-d14		*99.7%*			*50-150%*	"							"	

QC Batch: 9090105 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090105-BLK1)													**Extracted: 09/16/09 08:11**	
Diesel Range Hydrocarbons	NWTPH-Dx	ND	---	10.0	mg/kg wet	1x	--	--	--	--	--	--	09/17/09 08:21	
Heavy Oil Range Hydrocarbons	"	ND	---	25.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-FBP		*Recovery: 77.3%*			*Limits: 50-150%*	"							*09/17/09 08:21*	
p-Terphenyl-d14		*97.6%*			*50-150%*	"							"	
LCS (9090105-BS1)													**Extracted: 09/16/09 08:11**	
Diesel Range Hydrocarbons	NWTPH-Dx	68.7	---	10.0	mg/kg wet	1x	--	83.3	82.4%	(73-133)	--	--	09/17/09 08:45	
Surrogate(s): 2-FBP		*Recovery: 91.4%*			*Limits: 50-150%*	"							*09/17/09 08:45*	
p-Terphenyl-d14		*103%*			*50-150%*	"							"	
Duplicate (9090105-DUP1)							**QC Source: SSI0049-01**						**Extracted: 09/16/09 08:11**	
Diesel Range Hydrocarbons	NWTPH-Dx	66.8	---	12.8	mg/kg dry	1x	66.3	--	--	--	0.649%	(40)	09/17/09 13:05	
Heavy Oil Range Hydrocarbons	"	485	---	31.9	"	"	464	--	--	--	4.35%	"	"	
Surrogate(s): 2-FBP		*Recovery: 78.5%*			*Limits: 50-150%*	"							*09/17/09 13:05*	
p-Terphenyl-d14		*104%*			*50-150%*	"							"	
Matrix Spike (9090105-MS1)							**QC Source: SSI0049-01**						**Extracted: 09/16/09 08:11**	
Diesel Range Hydrocarbons	NWTPH-Dx	147	---	12.8	mg/kg dry	1x	66.3	106	76.1%	(70.1-139)	--	--	09/17/09 13:28	
Surrogate(s): 2-FBP		*Recovery: 88.4%*			*Limits: 50-150%*	"							*09/17/09 13:28*	
p-Terphenyl-d14		*101%*			*50-150%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls by EPA Method 8082 - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090148 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090148-BLK1)							**Extracted: 09/22/09 15:21**							
PCB-1016	EPA 8082	ND	---	10.0	ug/kg wet	1x	--	--	--	--	--	--	09/24/09 11:34	
PCB-1221	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	---	10.0	"	"	--	--	--	--	--	--	"	
Surrogate(s): TCX		*Recovery: 30.7%*			*Limits: 27.9-154%*	"							*09/24/09 11:34*	
Decachlorobiphenyl		*114%*			*35-157%*	"							"	
LCS (9090148-BS1)							**Extracted: 09/22/09 15:21**							
PCB-1016	EPA 8082	154	---	10.0	ug/kg wet	1x	--	167	92.7%	(63.1-147)	--	--	09/25/09 19:06	
PCB-1260	"	174	---	10.0	"	"	--	"	105%	(74.4-130)	--	--	"	
Surrogate(s): TCX		*Recovery: 86.2%*			*Limits: 27.9-154%*	"							*09/25/09 19:06*	
Decachlorobiphenyl		*94.3%*			*35-157%*	"							"	
Matrix Spike (9090148-MS1)					**QC Source: SSI0049-13**		**Extracted: 09/22/09 15:21**							
PCB-1016	EPA 8082	92.2	---	13.9	ug/kg dry	1x	ND	231	39.9%	(50.6-145)	--	--	09/25/09 20:14	M1
PCB-1260	"	93.4	---	13.9	"	"	4.63	"	38.4%	(57.6-120)	--	--	"	M1
Surrogate(s): TCX		*Recovery: 50.7%*			*Limits: 27.9-154%*	"							*09/25/09 20:14*	
Decachlorobiphenyl		*50.7%*			*35-157%*	"							"	
Matrix Spike Dup (9090148-MSD1)					**QC Source: SSI0049-13**		**Extracted: 09/22/09 15:21**							
PCB-1016	EPA 8082	86.3	---	13.9	ug/kg dry	1x	ND	231	37.4%	(50.6-145)	6.54%	(40)	09/25/09 20:37	M1
PCB-1260	"	86.7	---	13.9	"	"	4.63	"	35.5%	(57.6-120)	7.43%	(27.4)	"	M1
Surrogate(s): TCX		*Recovery: 58.1%*			*Limits: 27.9-154%*	"							*09/25/09 20:37*	
Decachlorobiphenyl		*49.4%*			*35-157%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090116 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (9090116-BLK1)							**Extracted: 09/17/09 12:06**							
1-Methylnapthalene	EPA 8270 mod.	ND	---	0.00333	mg/kg wet	1x	--	--	--	--	--	--	09/18/09 18:12	
2-Methylnaphthalene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Benzo (a) anthracene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Benzo (a) pyrene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Benzo (b) fluoranthene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Benzo (ghi) perylene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Benzo (k) fluoranthene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Dibenzo (a,h) anthracene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Fluorene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Indeno (1,2,3-cd) pyrene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	---	0.00333	"	"	--	--	--	--	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 64.2%*			*Limits: 38.8-139%*	"							*09/18/09 18:12*	
2-FBP		*71.6%*			*40-132%*	"							"	
p-Terphenyl-d14		*72.2%*			*31.7-179%*	"							"	
LCS (9090116-BS1)							**Extracted: 09/17/09 12:06**							
Chrysene	EPA 8270 mod.	0.351	---	0.00667	mg/kg wet	1x	--	0.444	78.9%	(47.8-120)	--	--	09/18/09 18:55	
Fluorene	"	0.334	---	0.00667	"	"	--	"	75.2%	(50.9-120)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.366	---	0.00667	"	"	--	"	82.3%	(39.5-120)	--	--	"	
Naphthalene	"	0.320	---	0.00667	"	"	--	"	71.9%	(39.2-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 79.2%*			*Limits: 38.8-139%*	"							*09/18/09 18:55*	
2-FBP		*82.8%*			*40-132%*	"							"	
p-Terphenyl-d14		*79.6%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Polynuclear Aromatic Compounds by GC/MS with Selected Ion Monitoring - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090116 **Soil Preparation Method: EPA 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (9090116-MS1)					**QC Source: SSI0049-13**				**Extracted: 09/17/09 12:06**					
Chrysene	EPA 8270 mod.	0.322	---	0.00925	mg/kg dry	1x	ND	0.616	52.3%	(31.6-132)	--	--	09/18/09 23:11	
Fluorene	"	0.305	---	0.00925	"	"	ND	"	49.5%	(43.4-123)	--	--	"	
Indeno (1,2,3-cd) pyrene	"	0.278	---	0.00925	"	"	ND	"	45.1%	(28.3-147)	--	--	"	
Naphthalene	"	0.277	---	0.00925	"	"	ND	"	44.9%	(30.9-120)	--	--	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 46.4%*			*Limits: 38.8-139%*	"							*09/18/09 23:11*	
2-FBP		*51.4%*			*40-132%*	"							"	
p-Terphenyl-d14		*55.6%*			*31.7-179%*	"							"	
Matrix Spike Dup (9090116-MSD1)					**QC Source: SSI0049-13**				**Extracted: 09/17/09 12:06**					
Chrysene	EPA 8270 mod.	0.428	---	0.00925	mg/kg dry	1x	ND	0.616	69.4%	(31.6-132)	28.1%	(30.2)	09/18/09 23:32	
Fluorene	"	0.439	---	0.00925	"	"	ND	"	71.2%	(43.4-123)	36.0%	(36)	"	
Indeno (1,2,3-cd) pyrene	"	0.422	---	0.00925	"	"	ND	"	68.5%	(28.3-147)	41.2%	(32.7)	"	R3
Naphthalene	"	0.374	---	0.00925	"	"	ND	"	60.7%	(30.9-120)	29.9%	(35.6)	"	
Surrogate(s): Nitrobenzene-d5		*Recovery: 64.0%*			*Limits: 38.8-139%*	"							*09/18/09 23:32*	
2-FBP		*69.4%*			*40-132%*	"							"	
p-Terphenyl-d14		*74.0%*			*31.7-179%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Conventional Chemistry Parameters by APHA/EPA Methods - Laboratory Quality Control Results

TestAmerica Spokane

QC Batch: 9090117 **Soil Preparation Method: Wet Chem**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (9090117-DUP1)					**QC Source: SSI0049-18**				**Extracted: 09/16/09 16:30**					
% Solids	TA SOP	83.8	---	0.0100	% by Weight	1x	83.8	--	--	--	0.00%	(5)	09/17/09 16:47	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Mercury (CVAA) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50676 **Soil Preparation Method: 7471A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)					**QC Source: SSI0049-13**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	0.254	0.0079	0.025	mg/Kg dry	1x	0.020	0.251	93%	(75-125)	3%	(35)	09/22/09 14:24	
Matrix Spike (1538513S)					**QC Source: SSI0049-13**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	0.261	0.0081	0.026	mg/Kg dry	1x	0.020	0.257	94%	(75-125)	--	--	09/22/09 14:19	
Duplicate (1538513X)					**QC Source: SSI0049-13**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	0.0184	0.0080	0.025	mg/Kg dry	1x	0.020	--	--	--	6%	(35)	09/22/09 14:15	J
Blank (580-50703-23)					**QC Source:**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	ND	0.0063	0.020	mg/Kg dry	1x	--	--	--	--	--	--	09/22/09 13:45	
LCS (580-50703-24)					**QC Source:**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	0.194	0.0063	0.020	mg/Kg dry	1x	--	0.200	97%	(75-125)	--	--	09/22/09 13:49	
LCS Dup (580-50703-25)					**QC Source:**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	0.208	0.0063	0.020	mg/Kg dry	1x	--	0.200	104%	(75-125)	7%	(25)	09/22/09 13:53	
LCS (580-50703-26)					**QC Source:**								**Extracted: 09/22/09 11:48**	
Mercury	7471A Dry	4.72	0.033	0.10	mg/Kg dry	1x	--	4.47	106%	(80-120)	--	--	09/22/09 13:57	

QC Batch: 50776 **Water Preparation Method: 7470A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50788-23)					**QC Source:**								**Extracted: 09/23/09 15:17**	
Mercury	7470A	ND	0.000041	0.00020	mg/L	1x	--	--	--	--	--	--	09/23/09 16:39	
LCS (580-50788-24)					**QC Source:**								**Extracted: 09/23/09 15:17**	
Mercury	7470A	0.00203	0.000041	0.00020	mg/L	1x	--	0.00200	102%	(75-125)	--	--	09/23/09 16:43	
LCS Dup (580-50788-25)					**QC Source:**								**Extracted: 09/23/09 15:17**	
Mercury	7470A	0.00214	0.000041	0.00020	mg/L	1x	--	0.00200	107%	(75-125)	5%	(20)	09/23/09 16:49	
LCS (580-50788-26)					**QC Source:**								**Extracted: 09/23/09 15:17**	
Mercury	7470A	0.00206	0.000041	0.00020	mg/L	1x	--	0.00200	103%	(75-125)	--	--	09/23/09 16:53	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 10:39**					
Calcium	6010B TMP Dry	2140	2.0	72	mg/Kg dry	1x	1000	1300	87%	(75-125)	1%	(35)	09/22/09 20:35	
Iron	"	16400	0.60	13	"	"	16000	1430	45%	"	3%	"	"	4
Magnesium	"	5510	0.86	72	"	"	4300	1300	91%	"	3%	"	"	
Silver	"	33.1	0.059	1.3	"	"	ND	39.1	85%	"	1%	"	"	
Potassium	"	2210	21	220	"	"	1100	1300	87%	"	2%	"	"	
Sodium	"	986	8.9	130	"	"	ND	"	76%	"	1%	"	09/23/09 17:20	
Matrix Spike (1538513S)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 10:39**					
Calcium	6010B TMP Dry	2120	1.9	70	mg/Kg dry	1x	1000	1280	88%	(75-125)	--	--	09/22/09 20:31	
Iron	"	16900	0.59	13	"	"	16000	1410	87%	"	--	--	"	4
Magnesium	"	5700	0.84	70	"	"	4300	1280	108%	"	--	--	"	
Potassium	"	2160	20	210	"	"	1100	"	86%	"	--	--	"	
Silver	"	32.7	0.058	1.3	"	"	ND	38.4	85%	"	--	--	"	
Sodium	"	981	8.7	130	"	"	ND	1280	77%	"	--	--	09/23/09 17:17	
Duplicate (1538513X)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 10:39**					
Calcium	6010B TMP Dry	999	1.9	70	mg/Kg dry	1x	1000	--	--	--	0%	(35)	09/22/09 20:27	
Iron	"	15900	0.59	13	"	"	16000	--	--	--	1%	"	"	
Magnesium	"	4330	0.84	70	"	"	4300	--	--	--	0%	"	"	
Silver	"	ND	0.058	1.3	"	"	ND	--	--	--	NC%	"	"	
Potassium	"	1070	20	210	"	"	1100	--	--	--	1%	"	"	
Sodium	"	ND	8.7	130	"	"	ND	--	--	--	NC%	"	09/23/09 17:14	
Blank (580-50729-14)					**QC Source:**				**Extracted: 09/22/09 10:39**					
Calcium	6010B TMP Dry	ND	1.5	55	mg/Kg dry	1x	--	--	--	--	--	--	09/22/09 20:03	
Iron	"	1.29	0.46	10	"	"	--	--	--	--	--	--	"	J
Magnesium	"	0.764	0.66	55	"	"	--	--	--	--	--	--	"	J
Silver	"	ND	0.045	1.0	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	16	160	"	"	--	--	--	--	--	--	"	
LCS (580-50729-15)					**QC Source:**				**Extracted: 09/22/09 10:39**					
Calcium	6010B TMP Dry	978	1.5	55	mg/Kg dry	1x	--	1000	98%	(80-120)	--	--	09/22/09 20:08	
Iron	"	1100	0.46	10	"	"	--	1100	100%	"	--	--	"	
Magnesium	"	981	0.66	55	"	"	--	1000	98%	"	--	--	"	
Silver	"	26.9	0.045	1.0	"	"	--	30.0	90%	"	--	--	"	
Potassium	"	934	16	160	"	"	--	1000	93%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50729-16)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Calcium	6010B TMP Dry	979	1.5	55	mg/Kg dry	1x	--	1000	98%	(80-120)	0%	(35)	09/22/09 20:11	
Iron	"	1110	0.46	10	"	"	--	1100	101%	"	1%	"	"	
Magnesium	"	982	0.66	55	"	"	--	1000	98%	"	0%	"	"	
Silver	"	27.3	0.045	1.0	"	"	--	30.0	91%	"	2%	"	"	
Potassium	"	936	16	160	"	"	--	1000	94%	"	0%	"	"	
LCS (580-50729-17)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Calcium	6010B TMP Dry	6750	2.9	110	mg/Kg dry	1x	--	7470	90%	(80.6-119.	--	--	09/22/09 20:15	
Iron	"	14400	0.90	20	"	"	--	14600	98%	(30.1-169.	--	--	"	
Magnesium	"	2590	1.3	110	"	"	--	2880	90%	(73.8-126.	--	--	"	
Silver	"	76.2	0.088	2.0	"	"	--	83.8	91%	(46.6-153.	--	--	"	
Potassium	"	2410	31	320	"	"	--	2580	93%	(73.3-127.	--	--	"	
Blank (580-50807-3)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Sodium	6010B TMP Dry	ND	6.8	100	mg/Kg dry	1x	--	--	--	--	--	--	09/23/09 16:57	
LCS (580-50807-4)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Sodium	6010B TMP Dry	870	6.8	100	mg/Kg dry	1x	--	1000	87%	(80-120)	--	--	09/23/09 16:59	
LCS Dup (580-50807-5)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Sodium	6010B TMP Dry	869	6.8	100	mg/Kg dry	1x	--	1000	87%	(80-120)	0%	(35)	09/23/09 17:02	
LCS (580-50807-6)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Sodium	6010B TMP Dry	248	13	200	mg/Kg dry	1x	--	413	60%	(70.1-129.	--	--	09/23/09 17:06	*

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153859D)					**QC Source: SSI0049-09**				**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	3.96	0.31	0.50	mg/L	1x	ND	4.00	99%	(75-125)	1%	(20)	09/23/09 20:36	
Calcium	"	19.3	0.028	1.1	"	"	ND	20.0	97%	"	3%	"	"	
Iron	"	21.3	0.032	0.20	"	"	ND	22.0	97%	"	1%	"	"	
Magnesium	"	19.4	0.23	1.1	"	"	ND	20.0	97%	"	4%	"	"	
Potassium	"	19.1	0.41	3.3	"	"	ND	"	96%	"	1%	"	"	
Sodium	"	17.4	0.18	2.0	"	"	ND	"	87%	"	1%	"	"	
Manganese	"	0.980	0.0017	0.020	"	"	ND	1.00	98%	"	1%	"	"	
Matrix Spike (153859S)					**QC Source: SSI0049-09**				**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	4.01	0.31	0.50	mg/L	1x	ND	4.00	100%	(75-125)	--	--	09/23/09 20:32	
Calcium	"	20.0	0.028	1.1	"	"	ND	20.0	100%	"	--	--	"	
Iron	"	21.5	0.032	0.20	"	"	ND	22.0	98%	"	--	--	"	
Magnesium	"	20.2	0.23	1.1	"	"	ND	20.0	101%	"	--	--	"	
Potassium	"	19.4	0.41	3.3	"	"	ND	"	97%	"	--	--	"	
Sodium	"	17.6	0.18	2.0	"	"	ND	"	88%	"	--	--	"	
Manganese	"	0.989	0.0017	0.020	"	"	ND	1.00	99%	"	--	--	"	
Duplicate (153859X)					**QC Source: SSI0049-09**				**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	ND	0.31	0.50	mg/L	1x	ND	--	--	--	NC%	(20)	09/23/09 20:26	
Calcium	"	ND	0.028	1.1	"	"	ND	--	--	--	NC%	"	"	
Iron	"	ND	0.032	0.20	"	"	ND	--	--	--	NC%	"	"	
Magnesium	"	ND	0.23	1.1	"	"	ND	--	--	--	NC%	"	"	
Potassium	"	ND	0.41	3.3	"	"	ND	--	--	--	NC%	"	"	
Sodium	"	ND	0.18	2.0	"	"	ND	--	--	--	NC%	"	"	
Manganese	"	ND	0.0017	0.020	"	"	ND	--	--	--	NC%	"	"	
Blank (580-50819-13)					**QC Source:**				**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	ND	0.31	0.50	mg/L	1x	--	--	--	--	--	--	09/23/09 19:54	
Calcium	"	ND	0.028	1.1	"	"	--	--	--	--	--	--	"	
Iron	"	0.173	0.032	0.20	"	"	--	--	--	--	--	--	"	J
Magnesium	"	ND	0.23	1.1	"	"	--	--	--	--	--	--	"	
Potassium	"	ND	0.41	3.3	"	"	--	--	--	--	--	--	"	
Sodium	"	ND	0.18	2.0	"	"	--	--	--	--	--	--	"	
Manganese	"	ND	0.0017	0.020	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50819-14)				**QC Source:**					**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	3.86	0.31	0.50	mg/L	1x	--	4.00	97%	(80-120)	--	--	09/23/09 20:01	
Calcium	"	19.3	0.028	1.1	"	"	--	20.0	96%	"	--	--	"	
Iron	"	20.8	0.032	0.20	"	"	--	22.0	95%	"	--	--	"	
Magnesium	"	19.5	0.23	1.1	"	"	--	20.0	97%	"	--	--	"	
Potassium	"	18.4	0.41	3.3	"	"	--	"	92%	"	--	--	"	
Sodium	"	16.9	0.18	2.0	"	"	--	"	84%	"	--	--	"	
Manganese	"	0.956	0.0017	0.020	"	"	--	1.00	96%	"	--	--	"	
LCS Dup (580-50819-15)				**QC Source:**					**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	3.89	0.31	0.50	mg/L	1x	--	4.00	97%	(80-120)	1%	(20)	09/23/09 20:06	
Calcium	"	19.4	0.028	1.1	"	"	--	20.0	97%	"	1%	"	"	
Iron	"	21.1	0.032	0.20	"	"	--	22.0	96%	"	1%	"	"	
Magnesium	"	19.5	0.23	1.1	"	"	--	20.0	97%	"	0%	"	"	
Potassium	"	18.7	0.41	3.3	"	"	--	"	93%	"	1%	"	"	
Sodium	"	17.1	0.18	2.0	"	"	--	"	85%	"	1%	"	"	
Manganese	"	0.964	0.0017	0.020	"	"	--	1.00	96%	"	1%	"	"	
LCS (580-50819-16)				**QC Source:**					**Extracted: 09/23/09 13:31**					
Aluminum	6010B Total Recoverable	3.91	0.31	0.50	mg/L	1x	--	4.00	98%	(80-120)	--	--	09/23/09 20:10	
Calcium	"	19.0	0.028	1.1	"	"	--	20.0	95%	"	--	--	"	
Iron	"	21.1	0.032	0.20	"	"	--	22.0	96%	"	--	--	"	
Magnesium	"	19.2	0.23	1.1	"	"	--	20.0	96%	"	--	--	"	
Potassium	"	19.1	0.41	3.3	"	"	--	"	96%	"	--	--	"	
Sodium	"	17.1	0.18	2.0	"	"	--	"	85%	"	--	--	"	
Manganese	"	0.969	0.0017	0.020	"	"	--	1.00	97%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)					**QC Source: SSI0049-13**					**Extracted: 09/22/09 10:39**				
Arsenic	6020 TMP Dry	267	0.0051	1.3	mg/Kg dry	50x	7.1	261	99%	(75-125)	1%	(35)	09/22/09 13:13	
Aluminum	"	7300	2.0	200	"	"	6900	"	160%	"	1%	"	"	4
Barium	"	321	0.0098	1.3	"	"	36	"	109%	"	1%	"	"	
Antimony	"	193	0.043	1.3	"	"	0.85	196	99%	"	4%	"	"	
Beryllium	"	7.64	0.0045	1.3	"	"	0.27	6.52	113%	"	2%	"	"	
Cadmium	"	6.98	0.0031	1.3	"	"	0.019	"	107%	"	0%	"	"	
Chromium	"	35.4	0.026	1.3	"	"	7.8	26.1	106%	"	1%	"	"	
Cobalt	"	76.2	0.0035	1.3	"	"	6.7	65.2	107%	"	2%	"	"	
Copper	"	58.1	0.021	1.3	"	"	24	32.6	105%	"	2%	"	"	
Lead	"	80.1	0.0065	1.3	"	"	14	65.2	102%	"	1%	"	"	
Manganese	"	226	0.10	3.3	"	"	160	"	99%	"	2%	"	"	
Nickel	"	81.1	0.024	1.3	"	"	12	"	107%	"	3%	"	"	
Selenium	"	266	0.012	3.3	"	"	0.14	261	102%	"	4%	"	"	
Thallium	"	269	0.026	2.6	"	"	0.092	"	103%	"	3%	"	"	
Vanadium	"	86.5	0.018	1.3	"	"	17	65.2	107%	"	4%	"	"	
Zinc	"	96.6	0.098	4.6	"	"	31	"	101%	"	2%	"	"	
Matrix Spike (1538513S)					**QC Source: SSI0049-13**					**Extracted: 09/22/09 10:39**				
Aluminum	6020 TMP Dry	7200	1.9	190	mg/Kg dry	50x	6900	256	126%	(75-125)	--	--	09/22/09 13:08	4
Arsenic	"	264	0.0050	1.3	"	"	7.1	"	100%	"	--	--	"	
Antimony	"	187	0.042	1.3	"	"	0.85	192	97%	"	--	--	"	
Barium	"	319	0.0096	1.3	"	"	36	256	111%	"	--	--	"	
Beryllium	"	7.76	0.0044	1.3	"	"	0.27	6.39	117%	"	--	--	"	
Cadmium	"	6.98	0.0030	1.3	"	"	0.019	"	109%	"	--	--	"	
Chromium	"	35.2	0.026	1.3	"	"	7.8	25.6	107%	"	--	--	"	
Cobalt	"	75.0	0.0035	1.3	"	"	6.7	63.9	107%	"	--	--	"	
Copper	"	56.8	0.020	1.3	"	"	24	32.0	103%	"	--	--	"	
Lead	"	79.0	0.0064	1.3	"	"	14	63.9	102%	"	--	--	"	
Manganese	"	221	0.10	3.2	"	"	160	"	93%	"	--	--	"	
Nickel	"	78.9	0.024	1.3	"	"	12	"	105%	"	--	--	"	
Selenium	"	256	0.012	3.2	"	"	0.14	256	100%	"	--	--	"	
Thallium	"	260	0.026	2.6	"	"	0.092	"	102%	"	--	--	"	
Vanadium	"	83.1	0.017	1.3	"	"	17	63.9	103%	"	--	--	"	
Zinc	"	94.3	0.096	4.5	"	"	31	"	100%	"	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (1538513X)				**QC Source: SSI0049-13**					**Extracted: 09/22/09 10:39**					
Arsenic	6020 TMP Dry	7.06	0.0010	0.26	mg/Kg dry	10x	7.1	--	--	--	1%	(35)	09/22/09 13:02	
Aluminum	"	6830	0.38	38	"	"	6900	--	--	--	1%	"	"	
Barium	"	36.3	0.0019	0.26	"	"	36	--	--	--	2%	"	"	
Antimony	"	0.849	0.0084	0.26	"	"	0.85	--	--	--	0%	"	"	
Beryllium	"	0.268	0.00088	0.26	"	"	0.27	--	--	--	1%	"	"	
Cadmium	"	0.0121	0.00060	0.26	"	"	0.019	--	--	--	44%	"	"	J
Chromium	"	7.41	0.0051	0.26	"	"	7.8	--	--	--	6%	"	"	
Cobalt	"	6.40	0.00069	0.26	"	"	6.7	--	--	--	4%	"	"	
Copper	"	22.7	0.0041	0.26	"	"	24	--	--	--	5%	"	"	
Lead	"	14.1	0.0013	0.26	"	"	14	--	--	--	2%	"	"	
Manganese	"	154	0.020	0.64	"	"	160	--	--	--	5%	"	"	
Nickel	"	11.2	0.0047	0.26	"	"	12	--	--	--	4%	"	"	
Selenium	"	0.106	0.0024	0.64	"	"	0.14	--	--	--	25%	"	"	J
Thallium	"	0.0895	0.0051	0.51	"	"	0.092	--	--	--	3%	"	"	J
Vanadium	"	16.0	0.0035	0.26	"	"	17	--	--	--	6%	"	"	
Zinc	"	29.6	0.019	0.89	"	"	31	--	--	--	3%	"	"	
Blank (580-50722-14)				**QC Source:**					**Extracted: 09/22/09 10:39**					
Arsenic	6020 TMP Dry	0.0580	0.00078	0.20	mg/Kg dry	10x	--	--	--	--	--	--	09/22/09 12:46	J
Barium	"	ND	0.0015	0.20	"	"	--	--	--	--	--	--	"	
Antimony	"	0.00750	0.0066	0.20	"	"	--	--	--	--	--	--	"	J
Beryllium	"	ND	0.00069	0.20	"	"	--	--	--	--	--	--	"	
Cadmium	"	0.000500	0.00047	0.20	"	"	--	--	--	--	--	--	"	J
Chromium	"	ND	0.0040	0.20	"	"	--	--	--	--	--	--	"	
Cobalt	"	ND	0.00054	0.20	"	"	--	--	--	--	--	--	"	
Copper	"	ND	0.0032	0.20	"	"	--	--	--	--	--	--	"	
Lead	"	ND	0.0010	0.20	"	"	--	--	--	--	--	--	"	
Manganese	"	ND	0.016	0.50	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.0037	0.20	"	"	--	--	--	--	--	--	"	
Selenium	"	0.0360	0.0019	0.50	"	"	--	--	--	--	--	--	"	J
Thallium	"	0.0145	0.0040	0.40	"	"	--	--	--	--	--	--	"	J
Vanadium	"	ND	0.0027	0.20	"	"	--	--	--	--	--	--	"	
Zinc	"	ND	0.015	0.70	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50722-21)					**QC Source:**								**Extracted: 09/22/09 10:39**	
Arsenic	6020 TMP Dry	190	0.0039	1.0	mg/Kg dry	50x	--	200	95%	(80-120)	--	--	09/22/09 13:24	
Barium	"	216	0.0075	1.0	"	"	--	"	108%	"	--	--	"	
Antimony	"	149	0.033	1.0	"	"	--	150	99%	"	--	--	"	
Beryllium	"	5.44	0.0034	1.0	"	"	--	5.00	109%	"	--	--	"	
Cadmium	"	5.41	0.0024	1.0	"	"	--	"	108%	"	--	--	"	
Chromium	"	20.1	0.020	1.0	"	"	--	20.0	101%	"	--	--	"	
Cobalt	"	52.3	0.0027	1.0	"	"	--	50.0	105%	"	--	--	"	
Copper	"	26.2	0.016	1.0	"	"	--	25.0	105%	"	--	--	"	
Lead	"	50.6	0.0050	1.0	"	"	--	50.0	101%	"	--	--	"	
Manganese	"	50.5	0.080	2.5	"	"	--	"	101%	"	--	--	"	
Nickel	"	51.5	0.018	1.0	"	"	--	"	103%	"	--	--	"	
Selenium	"	199	0.0094	2.5	"	"	--	200	99%	"	--	--	"	
Thallium	"	199	0.020	2.0	"	"	--	"	100%	"	--	--	"	
Vanadium	"	50.2	0.014	1.0	"	"	--	50.0	100%	"	--	--	"	
Zinc	"	48.3	0.075	3.5	"	"	--	"	97%	"	--	--	"	
LCS Dup (580-50722-22)					**QC Source:**								**Extracted: 09/22/09 10:39**	
Arsenic	6020 TMP Dry	188	0.0039	1.0	mg/Kg dry	50x	--	200	94%	(80-120)	1%	(35)	09/22/09 13:29	
Barium	"	213	0.0075	1.0	"	"	--	"	107%	"	1%	"	"	
Antimony	"	146	0.033	1.0	"	"	--	150	97%	"	2%	"	"	
Beryllium	"	5.50	0.0034	1.0	"	"	--	5.00	110%	"	1%	"	"	
Cadmium	"	5.30	0.0024	1.0	"	"	--	"	106%	"	2%	"	"	
Chromium	"	20.2	0.020	1.0	"	"	--	20.0	101%	"	0%	"	"	
Cobalt	"	51.7	0.0027	1.0	"	"	--	50.0	103%	"	1%	"	"	
Copper	"	25.7	0.016	1.0	"	"	--	25.0	103%	"	2%	"	"	
Lead	"	49.8	0.0050	1.0	"	"	--	50.0	100%	"	2%	"	"	
Manganese	"	50.3	0.080	2.5	"	"	--	"	101%	"	0%	"	"	
Nickel	"	50.3	0.018	1.0	"	"	--	"	101%	"	2%	"	"	
Selenium	"	195	0.0094	2.5	"	"	--	200	97%	"	2%	"	"	
Thallium	"	195	0.020	2.0	"	"	--	"	98%	"	2%	"	"	
Vanadium	"	49.4	0.014	1.0	"	"	--	50.0	99%	"	1%	"	"	
Zinc	"	47.2	0.075	3.5	"	"	--	"	94%	"	2%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50667 **Soil Preparation Method: 3050B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50722-43)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Arsenic	6020 TMP Dry	91.2	0.0031	0.79	mg/Kg dry	20x	--	95.5	95%	(79.2-121.	--	--	09/22/09 15:20	
Barium	"	471	0.0059	0.79	"	"	--	426	111%	(81.5-118.	--	--	"	
Antimony	"	250	0.026	0.79	"	"	--	204	122%	(0.0-263.2	--	--	"	
Beryllium	"	75.2	0.0027	0.79	"	"	--	62.6	120%	(79.6-120.	--	--	"	
Cadmium	"	71.0	0.0018	0.79	"	"	--	63.0	113%	(81.2-118.	--	--	"	
Chromium	"	99.7	0.016	0.79	"	"	--	99.0	101%	(80.1-119.	--	--	"	
Cobalt	"	81.3	0.0021	0.79	"	"	--	76.2	107%	(81.0-119.	--	--	"	
Copper	"	88.5	0.013	0.79	"	"	--	87.8	101%	(78.4-122.	--	--	"	
Lead	"	90.1	0.0039	0.79	"	"	--	92.4	97%	(81.5-118.	--	--	"	
Manganese	"	288	0.063	2.0	"	"	--	292	99%	(76.7-123.	--	--	"	
Nickel	"	119	0.015	0.79	"	"	--	118	101%	(78.5-122.	--	--	"	
Selenium	"	157	0.0074	2.0	"	"	--	161	98%	(76.7-123.	--	--	"	
Thallium	"	133	0.016	1.6	"	"	--	128	104%	(78.1-121.	--	--	"	
Vanadium	"	105	0.011	0.79	"	"	--	106	100%	(77.1-123.	--	--	"	
Zinc	"	214	0.059	2.8	"	"	--	232	92%	(80.4-119.	--	--	"	
Blank (580-50750-14)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Aluminum	6020 TMP Dry	ND	0.30	30	mg/Kg dry	10x	--	--	--	--	--	--	09/22/09 12:46	
LCS (580-50750-21)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Aluminum	6020 TMP Dry	193	1.5	150	mg/Kg dry	50x	--	200	96%	(80-120)	--	--	09/22/09 13:24	
LCS Dup (580-50750-22)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Aluminum	6020 TMP Dry	184	1.5	150	mg/Kg dry	50x	--	200	92%	(80-120)	5%	(35)	09/22/09 13:29	
LCS (580-50750-43)					**QC Source:**					**Extracted: 09/22/09 10:39**				
Aluminum	6020 TMP Dry	6110	1.2	120	mg/Kg dry	20x	--	7010	87%	(51.1-148.	--	--	09/22/09 15:20	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (153859D)				**QC Source: SSI0049-09**					**Extracted: 09/23/09 13:31**					
Arsenic	6020 Total Recoverable	3.86	0.0024	0.020	mg/L	50x	ND	4.00	96%	(75-125)	6%	(20)	09/23/09 22:49	
Antimony	"	2.81	0.0040	0.020	"	"	ND	3.00	94%	"	4%	"	"	
Barium	"	4.37	0.0027	0.060	"	"	ND	4.00	109%	"	4%	"	"	
Nickel	"	0.987	0.0022	0.020	"	"	ND	1.00	99%	"	8%	"	"	^
Beryllium	"	0.112	0.0026	0.020	"	"	ND	0.100	112%	"	1%	"	"	
Selenium	"	3.88	0.0034	0.020	"	"	ND	4.00	97%	"	5%	"	"	
Cadmium	"	0.102	0.0014	0.020	"	"	ND	0.100	102%	"	4%	"	"	
Silver	"	0.704	0.0015	0.020	"	"	ND	0.600	117%	"	8%	"	"	
Chromium	"	0.395	0.0037	0.020	"	"	0.00092	0.400	99%	"	7%	"	"	^
Thallium	"	4.18	0.00060	0.040	"	"	ND	4.00	105%	"	1%	"	"	
Cobalt	"	0.994	0.0016	0.020	"	"	ND	1.00	99%	"	7%	"	"	^
Vanadium	"	0.999	0.0023	0.020	"	"	0.0048	"	99%	"	5%	"	"	^
Copper	"	0.502	0.0015	0.050	"	"	0.00024	0.500	100%	"	4%	"	"	^
Zinc	"	1.09	0.020	0.070	"	"	0.0092	1.00	108%	"	2%	"	"	^
Lead	"	1.10	0.0017	0.020	"	"	ND	"	110%	"	2%	"	"	
Matrix Spike (153859S)				**QC Source: SSI0049-09**					**Extracted: 09/23/09 13:31**					
Antimony	6020 Total Recoverable	2.71	0.0040	0.020	mg/L	50x	ND	3.00	90%	(75-125)	--	--	09/23/09 22:45	
Arsenic	"	3.63	0.0024	0.020	"	"	ND	4.00	91%	"	--	--	"	
Nickel	"	0.910	0.0022	0.020	"	"	ND	1.00	91%	"	--	--	"	^
Barium	"	4.19	0.0027	0.060	"	"	ND	4.00	105%	"	--	--	"	
Beryllium	"	0.113	0.0026	0.020	"	"	ND	0.100	113%	"	--	--	"	
Selenium	"	3.71	0.0034	0.020	"	"	ND	4.00	93%	"	--	--	"	
Silver	"	0.651	0.0015	0.020	"	"	ND	0.600	109%	"	--	--	"	
Cadmium	"	0.0982	0.0014	0.020	"	"	ND	0.100	98%	"	--	--	"	
Thallium	"	4.14	0.00060	0.040	"	"	ND	4.00	103%	"	--	--	"	
Chromium	"	0.369	0.0037	0.020	"	"	0.00092	0.400	92%	"	--	--	"	^
Vanadium	"	0.952	0.0023	0.020	"	"	0.0048	1.00	95%	"	--	--	"	^
Cobalt	"	0.928	0.0016	0.020	"	"	ND	"	93%	"	--	--	"	^
Zinc	"	1.07	0.020	0.070	"	"	0.0092	"	106%	"	--	--	"	^
Copper	"	0.481	0.0015	0.050	"	"	0.00024	0.500	96%	"	--	--	"	^
Lead	"	1.07	0.0017	0.020	"	"	ND	1.00	107%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (153859X)				**QC Source: SSI0049-09**					**Extracted: 09/23/09 13:31**					
Antimony	6020 Total Recoverable	ND	0.00040	0.0020	mg/L	5x	ND	--	--	--	NC%	(20)	09/23/09 22:42	
Arsenic	"	ND	0.00024	0.0020	"	"	ND	--	--	--	NC%	"	"	
Nickel	"	ND	0.00022	0.0020	"	"	ND	--	--	--	NC%	"	"	^
Barium	"	ND	0.00027	0.0060	"	"	ND	--	--	--	NC%	"	"	
Selenium	"	ND	0.00034	0.0020	"	"	ND	--	--	--	NC%	"	"	
Beryllium	"	ND	0.00026	0.0020	"	"	ND	--	--	--	NC%	"	"	
Silver	"	ND	0.00015	0.0020	"	"	ND	--	--	--	NC%	"	"	
Cadmium	"	ND	0.00014	0.0020	"	"	ND	--	--	--	NC%	"	"	
Thallium	"	ND	0.000060	0.0040	"	"	ND	--	--	--	NC%	"	"	
Chromium	"	ND	0.00037	0.0020	"	"	0.00092	--	--	--	NC%	"	"	^
Cobalt	"	ND	0.00016	0.0020	"	"	ND	--	--	--	NC%	"	"	^
Vanadium	"	0.000760	0.00023	0.0020	"	"	0.0048	--	--	--	145%	"	"	J, ^, F
Copper	"	0.000170	0.00015	0.0050	"	"	0.00024	--	--	--	34%	"	"	J, ^
Zinc	"	0.00900	0.0020	0.0070	"	"	0.0092	--	--	--	2%	"	"	^
Lead	"	ND	0.00017	0.0020	"	"	ND	--	--	--	NC%	"	"	
Blank (580-50789-14)				**QC Source:**					**Extracted: 09/23/09 13:31**					
Arsenic	6020 Total Recoverable	ND	0.00024	0.0020	mg/L	5x	--	--	--	--	--	--	09/23/09 22:31	
Antimony	"	ND	0.00040	0.0020	"	"	--	--	--	--	--	--	"	
Nickel	"	ND	0.00022	0.0020	"	"	--	--	--	--	--	--	"	^
Barium	"	ND	0.00027	0.0060	"	"	--	--	--	--	--	--	"	
Beryllium	"	ND	0.00026	0.0020	"	"	--	--	--	--	--	--	"	
Selenium	"	ND	0.00034	0.0020	"	"	--	--	--	--	--	--	"	
Cadmium	"	ND	0.00014	0.0020	"	"	--	--	--	--	--	--	"	
Silver	"	ND	0.00015	0.0020	"	"	--	--	--	--	--	--	"	
Thallium	"	ND	0.000060	0.0040	"	"	--	--	--	--	--	--	"	
Chromium	"	0.000625	0.00037	0.0020	"	"	--	--	--	--	--	--	"	J, ^
Vanadium	"	0.00208	0.00023	0.0020	"	"	--	--	--	--	--	--	"	^
Cobalt	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	^
Zinc	"	ND	0.0020	0.0070	"	"	--	--	--	--	--	--	"	^
Copper	"	ND	0.00015	0.0050	"	"	--	--	--	--	--	--	"	^
Lead	"	ND	0.00017	0.0020	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50789-21)				**QC Source:**						**Extracted: 09/23/09 13:31**				
Arsenic	6020 Total Recoverable	3.81	0.0024	0.020	mg/L	50x	--	4.00	95%	(80-120)	--	--	09/23/09 22:56	
Antimony	"	2.70	0.0040	0.020	"	"	--	3.00	90%	"	--	--	"	
Barium	"	4.20	0.0027	0.060	"	"	--	4.00	105%	"	--	--	"	
Nickel	"	0.975	0.0022	0.020	"	"	--	1.00	98%	"	--	--	"	^
Selenium	"	3.83	0.0034	0.020	"	"	--	4.00	96%	"	--	--	"	
Beryllium	"	0.0983	0.0026	0.020	"	"	--	0.100	98%	"	--	--	"	
Silver	"	0.651	0.0015	0.020	"	"	--	0.600	109%	"	--	--	"	
Cadmium	"	0.101	0.0014	0.020	"	"	--	0.100	101%	"	--	--	"	
Thallium	"	4.12	0.00060	0.040	"	"	--	4.00	103%	"	--	--	"	
Chromium	"	0.376	0.0037	0.020	"	"	--	0.400	94%	"	--	--	"	^
Vanadium	"	0.949	0.0023	0.020	"	"	--	1.00	95%	"	--	--	"	^
Cobalt	"	0.972	0.0016	0.020	"	"	--	"	97%	"	--	--	"	^
Zinc	"	0.978	0.020	0.070	"	"	--	"	98%	"	--	--	"	^
Copper	"	0.490	0.0015	0.050	"	"	--	0.500	98%	"	--	--	"	^
Lead	"	1.07	0.0017	0.020	"	"	--	1.00	107%	"	--	--	"	
LCS Dup (580-50789-22)				**QC Source:**						**Extracted: 09/23/09 13:31**				
Arsenic	6020 Total Recoverable	3.75	0.0024	0.020	mg/L	50x	--	4.00	94%	(80-120)	2%	(20)	09/23/09 22:59	
Antimony	"	2.70	0.0040	0.020	"	"	--	3.00	90%	"	0%	"	"	
Nickel	"	0.954	0.0022	0.020	"	"	--	1.00	95%	"	2%	"	"	^
Barium	"	4.17	0.0027	0.060	"	"	--	4.00	104%	"	1%	"	"	
Beryllium	"	0.106	0.0026	0.020	"	"	--	0.100	106%	"	8%	"	"	
Selenium	"	3.80	0.0034	0.020	"	"	--	4.00	95%	"	1%	"	"	
Silver	"	0.641	0.0015	0.020	"	"	--	0.600	107%	"	2%	"	"	
Cadmium	"	0.0997	0.0014	0.020	"	"	--	0.100	100%	"	1%	"	"	
Chromium	"	0.378	0.0037	0.020	"	"	--	0.400	95%	"	1%	"	"	^
Thallium	"	4.04	0.00060	0.040	"	"	--	4.00	101%	"	2%	"	"	
Cobalt	"	0.963	0.0016	0.020	"	"	--	1.00	96%	"	1%	"	"	^
Vanadium	"	0.975	0.0023	0.020	"	"	--	"	98%	"	3%	"	"	^
Zinc	"	1.02	0.020	0.070	"	"	--	"	102%	"	4%	"	"	^
Copper	"	0.461	0.0015	0.050	"	"	--	0.500	92%	"	6%	"	"	^
Lead	"	1.05	0.0017	0.020	"	"	--	1.00	105%	"	2%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Metals (ICP/MS) Total Recoverable - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50762 **Water Preparation Method: 3005A**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50789-23)				**QC Source:**					**Extracted: 09/23/09 13:31**					
Arsenic	6020 Total Recoverable	3.78	0.0024	0.020	mg/L	50x	--	4.00	94%	(80-120)	--	--	09/23/09 23:03	
Antimony	"	2.71	0.0040	0.020	"	"	--	3.00	90%	"	--	--	"	
Nickel	"	0.932	0.0022	0.020	"	"	--	1.00	93%	"	--	--	"	^
Barium	"	4.22	0.0027	0.060	"	"	--	4.00	106%	"	--	--	"	
Beryllium	"	0.109	0.0026	0.020	"	"	--	0.100	109%	"	--	--	"	
Selenium	"	3.89	0.0034	0.020	"	"	--	4.00	97%	"	--	--	"	
Silver	"	0.640	0.0015	0.020	"	"	--	0.600	107%	"	--	--	"	
Cadmium	"	0.0971	0.0014	0.020	"	"	--	0.100	97%	"	--	--	"	
Chromium	"	0.381	0.0037	0.020	"	"	--	0.400	95%	"	--	--	"	^
Thallium	"	4.00	0.00060	0.040	"	"	--	4.00	100%	"	--	--	"	
Vanadium	"	0.925	0.0023	0.020	"	"	--	1.00	92%	"	--	--	"	^
Cobalt	"	0.961	0.0016	0.020	"	"	--	"	96%	"	--	--	"	^
Zinc	"	0.972	0.020	0.070	"	"	--	"	97%	"	--	--	"	^
Copper	"	0.483	0.0015	0.050	"	"	--	0.500	97%	"	--	--	"	^
Lead	"	1.04	0.0017	0.020	"	"	--	1.00	104%	"	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Percent Moisture - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50245 **Soil Preparation Method: NA**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Duplicate (1538518X)				**QC Source: SSI0049-18**				**Extracted: 09/15/09 10:26**						
Percent Solids	Moisture	85	0.10	0.10	%	1x	87	--	--	--	1%	(20)	09/15/09 10:26	
Percent Moisture	"	15	0.10	0.10	"	"	13	--	--	--	8%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Polychlorinated Biphenyls (PCBs) by Gas Chromatogr - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 52855 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-52626-11)				**QC Source:**					**Extracted: 09/14/09 08:57**					
PCB-1016	8082 STD	ND	0.0045	0.050	ug/L	1x	--	--	--	--	--	--	10/23/09 13:42	
PCB-1221	"	ND	0.0062	0.050	"	"	--	--	--	--	--	--	"	
PCB-1232	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1242	"	ND	0.0041	0.050	"	"	--	--	--	--	--	--	"	
PCB-1248	"	ND	0.0071	0.050	"	"	--	--	--	--	--	--	"	
PCB-1254	"	ND	0.0044	0.050	"	"	--	--	--	--	--	--	"	
PCB-1260	"	ND	0.0039	0.050	"	"	--	--	--	--	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 95%*			*Limits: 60-150%*	"							*10/23/09 13:42*	
DCB Decachlorobiphenyl			*54%*		*40-135%*	"							"	
LCS (580-52626-12)				**QC Source:**					**Extracted: 09/14/09 08:57**					
PCB-1016	8082 STD	0.804	0.0045	0.050	ug/L	1x	--	1.00	80%	(25-145)	--	--	10/23/09 13:57	
PCB-1260	"	0.961	0.0039	0.050	"	"	--	"	96%	(30-145)	--	--	"	
Surrogate(s): Tetrachloro-m-xylene		*Recovery: 79%*			*Limits: 60-150%*	"							*10/23/09 13:57*	
DCB Decachlorobiphenyl			*68%*		*40-135%*	"							"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)				**QC Source: SSI0049-13**				**Extracted: 09/15/09 10:10**						
Phenol	8270C STD Dry	0.0826	0.00096	0.013	mg/Kg dry	1x	0.0012	0.129	63%	(66-126)	17%	(26)	09/22/09 16:27	F
2-Chlorophenol	"	0.125	0.00096	0.013	"	"	ND	"	97%	(65-125)	1%	(27)	"	
Bis(2-chloroethyl)ether	"	0.122	0.0013	0.013	"	"	ND	"	94%	(57-122)	6%	(60)	"	
1,3-Dichlorobenzene	"	0.0518	0.00093	0.0065	"	"	ND	0.127	41%	(64-124)	39%	"	"	F
N-Nitrosodi-n-propylamine	"	0.0966	0.0013	0.013	"	"	ND	0.129	75%	(52-127)	15%	(28)	"	
1,4-Dichlorobenzene	"	0.0656	0.00041	0.0065	"	"	ND	"	51%	(62-132)	34%	(32)	"	F
Hexachloroethane	"	0.0496	0.0014	0.013	"	"	ND	0.130	38%	(56-131)	41%	(60)	"	F
Benzyl alcohol	"	0.116	0.0012	0.013	"	"	ND	0.126	91%	(42-147)	13%	"	"	
Nitrobenzene	"	0.121	0.0037	0.013	"	"	ND	0.129	94%	(59-134)	0%	"	"	
1,2-Dichlorobenzene	"	0.0666	0.00083	0.0065	"	"	ND	"	52%	(68-118)	38%	"	"	F
2-Methylphenol	"	0.122	0.00092	0.013	"	"	ND	0.134	91%	(56-121)	6%	(25)	"	
Isophorone	"	0.130	0.00053	0.013	"	"	ND	0.128	101%	(53-118)	2%	(60)	"	
2-Nitrophenol	"	0.0456	0.00056	0.013	"	"	ND	0.129	35%	(58-128)	6%	"	"	F
3 & 4 Methylphenol	"	0.110	0.00072	0.026	"	"	ND	0.132	84%	(61-126)	15%	(27)	"	
Bis(2-chloroethoxy)methane	"	0.123	0.00039	0.013	"	"	ND	0.129	95%	(63-128)	3%	(60)	"	
2,4-Dimethylphenol	"	0.107	0.00027	0.013	"	"	ND	"	83%	(58-133)	9%	"	"	
2,4-Dichlorophenol	"	0.121	0.00039	0.013	"	"	ND	0.128	95%	(59-124)	2%	"	"	
Benzoic acid	"	0.280	0.084	0.32	"	"	ND	0.645	43%	(10-130)	8%	"	"	J
2-Methylnaphthalene	"	0.139	0.00030	0.0026	"	"	0.0028	0.130	105%	(65-125)	4%	(27)	"	
1,2,4-Trichlorobenzene	"	0.0993	0.0015	0.0065	"	"	ND	"	77%	(63-128)	8%	(28)	"	
Naphthalene	"	0.106	0.00028	0.0026	"	"	0.0016	"	81%	(64-129)	3%	(26)	"	
Hexachlorocyclopentadiene	"	0.0143	0.00034	0.013	"	"	ND	0.129	11%	(30-132)	11%	(60)	"	F
4-Chloroaniline	"	0.0976	0.0014	0.013	"	"	ND	"	76%	(20-181)	6%	"	"	
2,4,6-Trichlorophenol	"	0.109	0.00052	0.019	"	"	ND	0.128	85%	(66-131)	2%	"	"	
Hexachlorobutadiene	"	0.0893	0.0012	0.0065	"	"	ND	0.129	69%	(59-134)	20%	"	"	
2,4,5-Trichlorophenol	"	0.157	0.00056	0.013	"	"	ND	0.127	124%	(64-124)	7%	"	"	
4-Chloro-3-methylphenol	"	0.126	0.00092	0.013	"	"	ND	0.128	98%	(58-128)	7%	(27)	"	
2-Chloronaphthalene	"	0.125	0.00023	0.0026	"	"	ND	0.129	97%	(69-129)	1%	(25)	"	
Acenaphthylene	"	0.127	0.00021	0.0026	"	"	0.00098	0.130	97%	"	2%	(28)	"	
2-Nitroaniline	"	0.156	0.00054	0.013	"	"	ND	0.129	120%	(58-133)	10%	(60)	"	
2,6-Dinitrotoluene	"	0.139	0.00053	0.013	"	"	ND	0.130	107%	(65-125)	11%	"	"	
Dimethyl phthalate	"	0.146	0.00054	0.013	"	"	ND	0.129	113%	"	5%	"	"	
3-Nitroaniline	"	0.184	0.00075	0.013	"	"	ND	"	143%	(80-165)	7%	"	"	
2,4-Dinitrotoluene	"	0.114	0.00032	0.013	"	"	ND	"	88%	(57-122)	3%	(31)	"	
Diethyl phthalate	"	0.159	0.0019	0.013	"	"	0.0049	"	120%	(64-129)	6%	(26)	"	
Acenaphthene	"	0.135	0.00021	0.0026	"	"	ND	0.130	104%	(65-130)	2%	(27)	"	
2,4-Dinitrophenol	"	ND	0.0018	0.13	"	"	ND	0.645	0%	(53-168)	NC%	(60)	"	F
4-Chlorophenyl phenyl ether	"	0.147	0.00074	0.013	"	"	ND	0.129	113%	(65-130)	1%	"	"	
4-Nitrophenol	"	0.540	0.022	0.13	"	"	ND	0.643	84%	(47-172)	3%	(33)	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)				**QC Source: SSI0049-13**				**Extracted: 09/15/09 10:10**						
Fluorene	"	0.146	0.00015	0.0026	"	"	ND	0.129	113%	(68-128)	4%	(31)	"	
Dibenzofuran	"	0.136	0.00019	0.013	"	"	0.00093	0.126	107%	(70-125)	3%	(60)	"	
4-Nitroaniline	"	0.179	0.0018	0.013	"	"	ND	0.129	139%	(70-150)	11%	"	"	
4,6-Dinitro-2-methylphenol	"	ND	0.0023	0.13	"	"	ND	0.648	0%	(38-143)	NC%	"	"	F
4-Bromophenyl phenyl ether	"	0.146	0.00043	0.013	"	"	ND	0.129	113%	(64-134)	2%	"	"	
N-Nitrosodiphenylamine	"	0.137	0.00028	0.0065	"	"	ND	"	106%	(88-153)	3%	"	"	
Hexachlorobenzene	"	0.153	0.00049	0.0065	"	"	ND	"	119%	(61-136)	5%	"	"	
Pentachlorophenol	"	0.104	0.0015	0.013	"	"	ND	"	81%	(29-124)	30%	(68)	"	
Pyrene	"	0.141	0.00018	0.0026	"	"	0.013	"	99%	(54-134)	7%	(31)	"	
Phenanthrene	"	0.136	0.00027	0.0026	"	"	0.0043	0.130	102%	(65-125)	8%	(28)	"	
Butyl benzyl phthalate	"	0.175	0.0040	0.013	"	"	ND	0.129	135%	(65-140)	10%	(60)	"	
3,3'-Dichlorobenzidine	"	0.210	0.0010	0.026	"	"	ND	0.260	81%	(73-163)	3%	"	"	
Anthracene	"	0.137	0.00018	0.0026	"	"	0.0020	0.130	104%	(73-123)	6%	(27)	"	
Di-n-butyl phthalate	"	0.153	0.0034	0.026	"	"	0.0084	0.129	112%	(69-124)	5%	(60)	"	
Benzo[a]anthracene	"	0.141	0.00022	0.0032	"	"	0.0058	0.130	105%	(64-124)	7%	(27)	"	
Chrysene	"	0.153	0.00018	0.0032	"	"	0.0085	0.129	112%	(71-126)	7%	(26)	"	
Fluoranthene	"	0.142	0.00015	0.0026	"	"	0.014	"	99%	(61-121)	3%	(36)	"	
Benzo[a]pyrene	"	0.151	0.00027	0.0039	"	"	0.0062	0.130	111%	(68-128)	6%	(30)	"	
Bis(2-ethylhexyl) phthalate	"	0.163	0.0054	0.19	"	"	0.010	"	118%	(64-144)	5%	(60)	"	J
Di-n-octyl phthalate	"	0.171	0.00017	0.026	"	"	ND	"	131%	(58-148)	3%	(31)	"	
Indeno[1,2,3-cd]pyrene	"	0.137	0.00054	0.0052	"	"	0.0040	"	103%	(59-139)	4%	(29)	"	
Dibenz(a,h)anthracene	"	0.148	0.00028	0.0052	"	"	0.0017	0.129	113%	(57-142)	7%	(30)	"	
Benzo[k]fluoranthene	"	0.149	0.00017	0.0032	"	"	0.0022	"	114%	(63-143)	7%	(31)	"	
Benzo[g,h,i]perylene	"	0.125	0.00019	0.0032	"	"	0.0049	0.130	93%	(57-142)	2%	(28)	"	
2,2'-oxybis[1-chloropropane]	"	0.0832	0.00087	0.019	"	"	ND	0.129	65%	(44-140)	21%	(60)	"	
Carbazole	"	0.143	0.00056	0.019	"	"	0.0011	"	110%	(88-158)	7%	"	"	
1-Methylnaphthalene	"	0.128	0.00023	0.0039	"	"	0.0015	"	97%	(48-148)	5%	(30)	"	
Benzo[b]fluoranthene	"	0.163	0.00053	0.0026	"	"	0.010	"	118%	(66-136)	5%	(31)	"	

Surrogate(s):	*Terphenyl-d14*	*Recovery: 86%*	*Limits: 42-151%*	"	*09/22/09 16:27*
	2-Fluorophenol	*58%*	*36-145%*	"	"
	Phenol-d5	*86%*	*38-149%*	"	"
	Nitrobenzene-d5	*77%*	*38-141%*	"	"
	2-Fluorobiphenyl	*54%*	*42-140%*	"	"
	2,4,6-Tribromophenol	*97%*	*28-143%*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1538513S)				**QC Source: SSI0049-13**					**Extracted: 09/15/09 10:10**					
2-Chlorophenol	8270C STD Dry	0.124	0.00097	0.013	mg/Kg dry	1x	ND	0.131	95%	(65-125)	--	--	09/22/09 16:06	
Phenol	"	0.0977	0.00097	0.013	"	"	0.0012	"	74%	(66-126)	--	--	"	
Bis(2-chloroethyl)ether	"	0.129	0.0013	0.013	"	"	ND	"	99%	(57-122)	--	--	"	
1,3-Dichlorobenzene	"	0.0770	0.00094	0.0065	"	"	ND	0.129	60%	(64-124)	--	--	"	F
1,4-Dichlorobenzene	"	0.0929	0.00042	0.0065	"	"	ND	0.130	71%	(62-132)	--	--	"	
N-Nitrosodi-n-propylamine	"	0.112	0.0013	0.013	"	"	ND	0.131	86%	(52-127)	--	--	"	
Hexachloroethane	"	0.0753	0.0014	0.013	"	"	ND	0.132	57%	(56-131)	--	--	"	
Benzyl alcohol	"	0.131	0.0013	0.013	"	"	ND	0.128	103%	(42-147)	--	--	"	
Nitrobenzene	"	0.122	0.0038	0.013	"	"	ND	0.130	93%	(59-134)	--	--	"	
1,2-Dichlorobenzene	"	0.0976	0.00084	0.0065	"	"	ND	"	75%	(68-118)	--	--	"	
2-Methylphenol	"	0.129	0.00093	0.013	"	"	ND	0.136	95%	(56-121)	--	--	"	
Isophorone	"	0.127	0.00054	0.013	"	"	ND	0.130	98%	(53-118)	--	--	"	
2-Nitrophenol	"	0.0485	0.00056	0.013	"	"	ND	0.131	37%	(58-128)	--	--	"	F
3 & 4 Methylphenol	"	0.128	0.00073	0.026	"	"	ND	0.133	96%	(61-126)	--	--	"	
2,4-Dimethylphenol	"	0.117	0.00027	0.013	"	"	ND	0.131	90%	(58-133)	--	--	"	
Bis(2-chloroethoxy)methane	"	0.119	0.00039	0.013	"	"	ND	"	91%	(63-128)	--	--	"	
Benzoic acid	"	0.259	0.085	0.33	"	"	ND	0.653	40%	(10-130)	--	--	"	J
2,4-Dichlorophenol	"	0.124	0.00039	0.013	"	"	ND	0.130	95%	(59-124)	--	--	"	
2-Methylnaphthalene	"	0.134	0.00030	0.0026	"	"	0.0028	0.131	100%	(65-125)	--	--	"	
1,2,4-Trichlorobenzene	"	0.108	0.0016	0.0065	"	"	ND	"	82%	(63-128)	--	--	"	
Hexachlorocyclopentadiene	"	0.0159	0.00034	0.013	"	"	ND	"	12%	(30-132)	--	--	"	F
Naphthalene	"	0.110	0.00029	0.0026	"	"	0.0016	"	82%	(64-129)	--	--	"	
4-Chloroaniline	"	0.0917	0.0014	0.013	"	"	ND	"	70%	(20-181)	--	--	"	
2,4,6-Trichlorophenol	"	0.107	0.00052	0.020	"	"	ND	0.130	82%	(66-131)	--	--	"	
Hexachlorobutadiene	"	0.109	0.0012	0.0065	"	"	ND	0.131	83%	(59-134)	--	--	"	
2,4,5-Trichlorophenol	"	0.147	0.00056	0.013	"	"	ND	0.128	114%	(64-124)	--	--	"	
4-Chloro-3-methylphenol	"	0.135	0.00093	0.013	"	"	ND	0.130	104%	(58-128)	--	--	"	
2-Chloronaphthalene	"	0.126	0.00024	0.0026	"	"	ND	0.131	97%	(69-129)	--	--	"	
2-Nitroaniline	"	0.141	0.00055	0.013	"	"	ND	"	108%	(58-133)	--	--	"	
Acenaphthylene	"	0.124	0.00021	0.0026	"	"	0.00098	"	94%	(69-129)	--	--	"	
2,6-Dinitrotoluene	"	0.125	0.00054	0.013	"	"	ND	0.132	95%	(65-125)	--	--	"	
Dimethyl phthalate	"	0.138	0.00055	0.013	"	"	ND	0.131	106%	"	--	--	"	
2,4-Dinitrotoluene	"	0.117	0.00033	0.013	"	"	ND	"	90%	(57-122)	--	--	"	
3-Nitroaniline	"	0.172	0.00076	0.013	"	"	ND	"	132%	(80-165)	--	--	"	
Acenaphthene	"	0.132	0.00021	0.0026	"	"	ND	"	100%	(65-130)	--	--	"	
Diethyl phthalate	"	0.150	0.0020	0.013	"	"	0.0049	"	111%	(64-129)	--	--	"	
4-Chlorophenyl phenyl ether	"	0.145	0.00075	0.013	"	"	ND	"	111%	(65-130)	--	--	"	
2,4-Dinitrophenol	"	0.0315	0.0018	0.13	"	"	ND	0.653	5%	(53-168)	--	--	"	J, F
Fluorene	"	0.141	0.00016	0.0026	"	"	ND	0.131	108%	(68-128)	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1538513S)				**QC Source: SSI0049-13**					**Extracted: 09/15/09 10:10**					
4-Nitrophenol	"	0.524	0.022	0.13	"	"	ND	0.652	80%	(47-172)	--	--	"	
4-Nitroaniline	"	0.160	0.0018	0.013	"	"	ND	0.131	122%	(70-150)	--	--	"	
Dibenzofuran	"	0.132	0.00020	0.013	"	"	0.00093	0.128	102%	(70-125)	--	--	"	
4-Bromophenyl phenyl ether	"	0.143	0.00043	0.013	"	"	ND	0.131	110%	(64-134)	--	--	"	
4,6-Dinitro-2-methylphenol	"	ND	0.0024	0.13	"	"	ND	0.656	0%	(38-143)	--	--	"	F
Hexachlorobenzene	"	0.145	0.00050	0.0065	"	"	ND	0.131	111%	(61-136)	--	--	"	
N-Nitrosodiphenylamine	"	0.133	0.00029	0.0065	"	"	ND	"	101%	(88-153)	--	--	"	
Pentachlorophenol	"	0.141	0.0016	0.013	"	"	ND	"	108%	(29-124)	--	--	"	
Pyrene	"	0.132	0.00018	0.0026	"	"	0.013	"	91%	(54-134)	--	--	"	
Butyl benzyl phthalate	"	0.159	0.0041	0.013	"	"	ND	"	121%	(65-140)	--	--	"	
Phenanthrene	"	0.126	0.00027	0.0026	"	"	0.0043	"	93%	(65-125)	--	--	"	
Anthracene	"	0.130	0.00018	0.0026	"	"	0.0020	"	97%	(73-123)	--	--	"	
3,3'-Dichlorobenzidine	"	0.204	0.0010	0.026	"	"	ND	0.264	77%	(73-163)	--	--	"	
Benzo[a]anthracene	"	0.132	0.00022	0.0033	"	"	0.0058	0.131	96%	(64-124)	--	--	"	
Di-n-butyl phthalate	"	0.146	0.0034	0.026	"	"	0.0084	"	105%	(69-124)	--	--	"	
Chrysene	"	0.143	0.00018	0.0033	"	"	0.0085	"	103%	(71-126)	--	--	"	
Fluoranthene	"	0.137	0.00016	0.0026	"	"	0.014	"	94%	(61-121)	--	--	"	
Benzo[a]pyrene	"	0.142	0.00027	0.0039	"	"	0.0062	"	104%	(68-128)	--	--	"	
Bis(2-ethylhexyl) phthalate	"	0.156	0.0055	0.20	"	"	0.010	"	111%	(64-144)	--	--	"	J
Di-n-octyl phthalate	"	0.166	0.00017	0.026	"	"	ND	"	126%	(58-148)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	0.132	0.00055	0.0052	"	"	0.0040	"	97%	(59-139)	--	--	"	
Benzo[k]fluoranthene	"	0.140	0.00017	0.0033	"	"	0.0022	"	105%	(63-143)	--	--	"	
Dibenz(a,h)anthracene	"	0.138	0.00029	0.0052	"	"	0.0017	"	104%	(57-142)	--	--	"	
2,2'-oxybis[1-chloropropane]	"	0.103	0.00088	0.020	"	"	ND	"	79%	(44-140)	--	--	"	
Benzo[g,h,i]perylene	"	0.122	0.00020	0.0033	"	"	0.0049	"	90%	(57-142)	--	--	"	
Carbazole	"	0.134	0.00056	0.020	"	"	0.0011	"	101%	(88-158)	--	--	"	
1-Methylnaphthalene	"	0.121	0.00024	0.0039	"	"	0.0015	"	91%	(48-148)	--	--	"	
Benzo[b]fluoranthene	"	0.154	0.00054	0.0026	"	"	0.010	"	110%	(66-136)	--	--	"	

Surrogate(s):	*Terphenyl-d14*	*Recovery:*	*92%*	*Limits: 42-151%*	*"*	*09/22/09 16:06*
	2-Fluorophenol		*78%*	*36-145%*	*"*	*"*
	Phenol-d5		*67%*	*38-149%*	*"*	*"*
	Nitrobenzene-d5		*66%*	*38-141%*	*"*	*"*
	2-Fluorobiphenyl		*59%*	*42-140%*	*"*	*"*
	2,4,6-Tribromophenol		*113%*	*28-143%*	*"*	*"*

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50472-4)				**QC Source:**						**Extracted: 09/15/09 10:10**				
2-Chlorophenol	8270C STD Dry	ND	0.00074	0.010	mg/Kg dry	1x	--	--	--	--	--	--	09/18/09 09:01	
Phenol	"	ND	0.00074	0.010	"	"	--	--	--	--	--	--	"	
Bis(2-chloroethyl)ether	"	ND	0.00099	0.010	"	"	--	--	--	--	--	--	"	
1,3-Dichlorobenzene	"	ND	0.00072	0.0050	"	"	--	--	--	--	--	--	"	
N-Nitrosodi-n-propylamine	"	ND	0.00097	0.010	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.00032	0.0050	"	"	--	--	--	--	--	--	"	
Benzyl alcohol	"	ND	0.00096	0.010	"	"	--	--	--	--	--	--	"	
Hexachloroethane	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.00064	0.0050	"	"	--	--	--	--	--	--	"	
Nitrobenzene	"	ND	0.0029	0.010	"	"	--	--	--	--	--	--	"	
Isophorone	"	ND	0.00041	0.010	"	"	--	--	--	--	--	--	"	
2-Methylphenol	"	ND	0.00071	0.010	"	"	--	--	--	--	--	--	"	
2-Nitrophenol	"	ND	0.00043	0.010	"	"	--	--	--	--	--	--	"	
3 & 4 Methylphenol	"	ND	0.00056	0.020	"	"	--	--	--	--	--	--	"	
Bis(2-chloroethoxy)methane	"	ND	0.00030	0.010	"	"	--	--	--	--	--	--	"	
2,4-Dimethylphenol	"	ND	0.00021	0.010	"	"	--	--	--	--	--	--	"	
Benzoic acid	"	ND	0.065	0.25	"	"	--	--	--	--	--	--	"	
2,4-Dichlorophenol	"	ND	0.00030	0.010	"	"	--	--	--	--	--	--	"	
2-Methylnaphthalene	"	ND	0.00023	0.0020	"	"	--	--	--	--	--	--	"	
1,2,4-Trichlorobenzene	"	ND	0.0012	0.0050	"	"	--	--	--	--	--	--	"	
Hexachlorocyclopentadiene	"	ND	0.00026	0.010	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00022	0.0020	"	"	--	--	--	--	--	--	"	
2,4,6-Trichlorophenol	"	ND	0.00040	0.015	"	"	--	--	--	--	--	--	"	
4-Chloroaniline	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
2,4,5-Trichlorophenol	"	ND	0.00043	0.010	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00091	0.0050	"	"	--	--	--	--	--	--	"	
2-Chloronaphthalene	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
4-Chloro-3-methylphenol	"	ND	0.00071	0.010	"	"	--	--	--	--	--	--	"	
2-Nitroaniline	"	ND	0.00042	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthylene	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
Dimethyl phthalate	"	ND	0.00042	0.010	"	"	--	--	--	--	--	--	"	
2,6-Dinitrotoluene	"	ND	0.00041	0.010	"	"	--	--	--	--	--	--	"	
2,4-Dinitrotoluene	"	ND	0.00025	0.010	"	"	--	--	--	--	--	--	"	
3-Nitroaniline	"	ND	0.00058	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
Diethyl phthalate	"	0.00703	0.0015	0.010	"	"	--	--	--	--	--	--	"	J
4-Chlorophenyl phenyl ether	"	ND	0.00057	0.010	"	"	--	--	--	--	--	--	"	
2,4-Dinitrophenol	"	ND	0.0014	0.10	"	"	--	--	--	--	--	--	"	
4-Nitrophenol	"	ND	0.017	0.10	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50472-4)				**QC Source:**					**Extracted: 09/15/09 10:10**					
Fluorene	"	ND	0.00012	0.0020	"	"	--	--	--	--	--	--	"	
Dibenzofuran	"	ND	0.00015	0.010	"	"	--	--	--	--	--	--	"	
4-Nitroaniline	"	ND	0.0014	0.010	"	"	--	--	--	--	--	--	"	
4,6-Dinitro-2-methylphenol	"	ND	0.0018	0.10	"	"	--	--	--	--	--	--	"	
4-Bromophenyl phenyl ether	"	ND	0.00033	0.010	"	"	--	--	--	--	--	--	"	
Hexachlorobenzene	"	ND	0.00038	0.0050	"	"	--	--	--	--	--	--	"	
N-Nitrosodiphenylamine	"	ND	0.00022	0.0050	"	"	--	--	--	--	--	--	"	
Pyrene	"	ND	0.00014	0.0020	"	"	--	--	--	--	--	--	"	
Pentachlorophenol	"	ND	0.0012	0.010	"	"	--	--	--	--	--	--	"	
Butyl benzyl phthalate	"	ND	0.0031	0.010	"	"	--	--	--	--	--	--	"	
Phenanthrene	"	ND	0.00021	0.0020	"	"	--	--	--	--	--	--	"	
3,3'-Dichlorobenzidine	"	ND	0.00079	0.020	"	"	--	--	--	--	--	--	"	
Anthracene	"	ND	0.00014	0.0020	"	"	--	--	--	--	--	--	"	
Di-n-butyl phthalate	"	0.00727	0.0026	0.020	"	"	--	--	--	--	--	--	"	J
Benzo[a]anthracene	"	ND	0.00017	0.0025	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	ND	0.00012	0.0020	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.00014	0.0025	"	"	--	--	--	--	--	--	"	
Bis(2-ethylhexyl) phthalate	"	ND	0.0042	0.15	"	"	--	--	--	--	--	--	"	
Benzo[a]pyrene	"	ND	0.00021	0.0030	"	"	--	--	--	--	--	--	"	
Di-n-octyl phthalate	"	ND	0.00013	0.020	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	0.00042	0.0040	"	"	--	--	--	--	--	--	"	
Benzo[k]fluoranthene	"	ND	0.00013	0.0025	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	0.00022	0.0040	"	"	--	--	--	--	--	--	"	
2,2'-oxybis[1-chloropropane]	"	ND	0.00067	0.015	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	0.00015	0.0025	"	"	--	--	--	--	--	--	"	
Carbazole	"	ND	0.00043	0.015	"	"	--	--	--	--	--	--	"	
1-Methylnaphthalene	"	ND	0.00018	0.0030	"	"	--	--	--	--	--	--	"	
Benzo[b]fluoranthene	"	ND	0.00041	0.0020	"	"	--	--	--	--	--	--	"	

Surrogate(s):	*Terphenyl-d14*	*Recovery:*	*117%*	*Limits:*	*42-151%*	*" 09/18/09 09:01*
	2-Fluorophenol		*59%*		*36-145%*	*"*
	Phenol-d5		*70%*		*38-149%*	*"*
	Nitrobenzene-d5		*56%*		*38-141%*	*"*
	2-Fluorobiphenyl		*76%*		*42-140%*	*"*
	2,4,6-Tribromophenol		*74%*		*28-143%*	*"*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50472-5)				**QC Source:**					**Extracted: 09/15/09 10:10**					
2-Chlorophenol	8270C STD Dry	0.0954	0.00074	0.010	mg/Kg dry	1x	--	0.0999	95%	(65-125)	--	--	09/18/09 09:22	
Phenol	"	0.0915	0.00074	0.010	"	"	--	0.100	92%	(66-126)	--	--	"	
1,3-Dichlorobenzene	"	0.0948	0.00072	0.0050	"	"	--	0.0983	96%	(64-124)	--	--	"	
Bis(2-chloroethyl)ether	"	0.0815	0.00099	0.010	"	"	--	0.0998	82%	(57-122)	--	--	"	
N-Nitrosodi-n-propylamine	"	0.0862	0.00097	0.010	"	"	--	0.0999	86%	(52-127)	--	--	"	
1,4-Dichlorobenzene	"	0.0910	0.00032	0.0050	"	"	--	0.0996	91%	(62-132)	--	--	"	
Hexachloroethane	"	0.0896	0.0011	0.010	"	"	--	0.101	89%	(56-131)	--	--	"	
Benzyl alcohol	"	0.0986	0.00096	0.010	"	"	--	0.0978	101%	(42-147)	--	--	"	
Nitrobenzene	"	0.0962	0.0029	0.010	"	"	--	0.0997	96%	(59-134)	--	--	"	
1,2-Dichlorobenzene	"	0.0945	0.00064	0.0050	"	"	--	0.0996	95%	(68-118)	--	--	"	
2-Methylphenol	"	0.0942	0.00071	0.010	"	"	--	0.104	91%	(56-121)	--	--	"	
Isophorone	"	0.0897	0.00041	0.010	"	"	--	0.0992	91%	(53-118)	--	--	"	
3 & 4 Methylphenol	"	0.0951	0.00056	0.020	"	"	--	0.102	93%	(61-126)	--	--	"	
2-Nitrophenol	"	0.0955	0.00043	0.010	"	"	--	0.100	96%	(58-128)	--	--	"	
Bis(2-chloroethoxy)methane	"	0.0910	0.00030	0.010	"	"	--	"	91%	(63-128)	--	--	"	
2,4-Dimethylphenol	"	0.0974	0.00021	0.010	"	"	--	0.0999	97%	(58-133)	--	--	"	
Benzoic acid	"	0.171	0.065	0.25	"	"	--	0.499	34%	(10-130)	--	--	"	J
2,4-Dichlorophenol	"	0.104	0.00030	0.010	"	"	--	0.0993	105%	(59-124)	--	--	"	
2-Methylnaphthalene	"	0.108	0.00023	0.0020	"	"	--	0.100	108%	(65-125)	--	--	"	
1,2,4-Trichlorobenzene	"	0.0963	0.0012	0.0050	"	"	--	"	96%	(63-128)	--	--	"	
Hexachlorocyclopentadiene	"	0.0904	0.00026	0.010	"	"	--	"	90%	(30-132)	--	--	"	
Naphthalene	"	0.0975	0.00022	0.0020	"	"	--	"	97%	(64-129)	--	--	"	
4-Chloroaniline	"	0.0915	0.0011	0.010	"	"	--	"	92%	(20-181)	--	--	"	
2,4,6-Trichlorophenol	"	0.105	0.00040	0.015	"	"	--	0.0993	106%	(66-131)	--	--	"	
Hexachlorobutadiene	"	0.0969	0.00091	0.0050	"	"	--	0.0999	97%	(59-134)	--	--	"	
2,4,5-Trichlorophenol	"	0.109	0.00043	0.010	"	"	--	0.0981	112%	(64-124)	--	--	"	
2-Chloronaphthalene	"	0.107	0.00018	0.0020	"	"	--	0.0999	107%	(69-129)	--	--	"	
4-Chloro-3-methylphenol	"	0.0997	0.00071	0.010	"	"	--	0.0990	101%	(58-128)	--	--	"	
Acenaphthylene	"	0.105	0.00016	0.0020	"	"	--	0.100	105%	(69-129)	--	--	"	
2-Nitroaniline	"	0.0991	0.00042	0.010	"	"	--	"	99%	(58-133)	--	--	"	
Dimethyl phthalate	"	0.103	0.00042	0.010	"	"	--	"	103%	(65-125)	--	--	"	
2,6-Dinitrotoluene	"	0.104	0.00041	0.010	"	"	--	0.101	103%	"	--	--	"	
2,4-Dinitrotoluene	"	0.113	0.00025	0.010	"	"	--	0.100	113%	(57-122)	--	--	"	
3-Nitroaniline	"	0.105	0.00058	0.010	"	"	--	"	104%	(80-165)	--	--	"	
Diethyl phthalate	"	0.102	0.0015	0.010	"	"	--	0.0999	102%	(64-129)	--	--	"	
Acenaphthene	"	0.105	0.00016	0.0020	"	"	--	0.100	105%	(65-130)	--	--	"	
2,4-Dinitrophenol	"	0.385	0.0014	0.10	"	"	--	0.499	77%	(53-168)	--	--	"	
4-Chlorophenyl phenyl ether	"	0.109	0.00057	0.010	"	"	--	0.100	109%	(65-130)	--	--	"	
4-Nitrophenol	"	0.407	0.017	0.10	"	"	--	0.498	82%	(47-172)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Compounds by Gas Chromatography/Mass - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50242 **Soil Preparation Method: 3550B**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50472-5)				**QC Source:**					**Extracted: 09/15/09 10:10**					
Fluorene	"	0.108	0.00012	0.0020	"	"	--	0.100	108%	(68-128)	--	--	"	
4-Nitroaniline	"	0.117	0.0014	0.010	"	"	--	"	117%	(70-150)	--	--	"	
Dibenzofuran	"	0.112	0.00015	0.010	"	"	--	0.0976	115%	(70-125)	--	--	"	
4-Bromophenyl phenyl ether	"	0.109	0.00033	0.010	"	"	--	0.0998	109%	(64-134)	--	--	"	
4,6-Dinitro-2-methylphenol	"	0.504	0.0018	0.10	"	"	--	0.501	100%	(38-143)	--	--	"	
N-Nitrosodiphenylamine	"	0.110	0.00022	0.0050	"	"	--	0.100	110%	(88-153)	--	--	"	
Hexachlorobenzene	"	0.112	0.00038	0.0050	"	"	--	0.0999	112%	(61-136)	--	--	"	
Pentachlorophenol	"	0.110	0.0012	0.010	"	"	--	"	110%	(29-124)	--	--	"	
Pyrene	"	0.118	0.00014	0.0020	"	"	--	0.100	118%	(54-134)	--	--	"	
Butyl benzyl phthalate	"	0.118	0.0031	0.010	"	"	--	"	118%	(65-140)	--	--	"	
Phenanthrene	"	0.107	0.00021	0.0020	"	"	--	"	106%	(65-125)	--	--	"	
3,3'-Dichlorobenzidine	"	0.251	0.00079	0.020	"	"	--	0.202	124%	(73-163)	--	--	"	
Anthracene	"	0.110	0.00014	0.0020	"	"	--	0.100	109%	(73-123)	--	--	"	
Di-n-butyl phthalate	"	0.116	0.0026	0.020	"	"	--	"	116%	(69-124)	--	--	"	
Benzo[a]anthracene	"	0.115	0.00017	0.0025	"	"	--	"	114%	(64-124)	--	--	"	
Fluoranthene	"	0.123	0.00012	0.0020	"	"	--	"	123%	(61-121)	--	--	"	*
Chrysene	"	0.119	0.00014	0.0025	"	"	--	"	119%	(71-126)	--	--	"	
Benzo[a]pyrene	"	0.117	0.00021	0.0030	"	"	--	"	116%	(68-128)	--	--	"	
Bis(2-ethylhexyl) phthalate	"	0.119	0.0042	0.15	"	"	--	"	118%	(64-144)	--	--	"	J
Indeno[1,2,3-cd]pyrene	"	0.105	0.00042	0.0040	"	"	--	"	105%	(59-139)	--	--	"	
Di-n-octyl phthalate	"	0.122	0.00013	0.020	"	"	--	"	121%	(58-148)	--	--	"	
Dibenz(a,h)anthracene	"	0.101	0.00022	0.0040	"	"	--	"	101%	(57-142)	--	--	"	
Benzo[k]fluoranthene	"	0.117	0.00013	0.0025	"	"	--	"	117%	(63-143)	--	--	"	
2,2'-oxybis[1-chloropropane]	"	0.0851	0.00067	0.015	"	"	--	0.0999	85%	(44-140)	--	--	"	
Benzo[g,h,i]perylene	"	0.106	0.00015	0.0025	"	"	--	0.100	106%	(57-142)	--	--	"	
Carbazole	"	0.141	0.00043	0.015	"	"	--	0.0999	141%	(88-158)	--	--	"	
1-Methylnaphthalene	"	0.101	0.00018	0.0030	"	"	--	0.100	101%	(48-148)	--	--	"	
Benzo[b]fluoranthene	"	0.126	0.00041	0.0020	"	"	--	"	126%	(66-136)	--	--	"	

Surrogate(s):	*Terphenyl-d14*	*Recovery:*	*105%*	*Limits:*	*42-151%*	*"*	*09/18/09 09:22*
	2-Fluorophenol		*71%*		*36-145%*	*"*	*"*
	Phenol-d5		*76%*		*38-149%*	*"*	*"*
	Nitrobenzene-d5		*63%*		*38-141%*	*"*	*"*
	2-Fluorobiphenyl		*81%*		*42-140%*	*"*	*"*
	2,4,6-Tribromophenol		*95%*		*28-143%*	*"*	*"*

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50156 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50470-4)				**QC Source:**					**Extracted: 09/14/09 09:08**					
Naphthalene	8270C STD	ND	0.0036	0.010	ug/L	1x	--	--	--	--	--	--	09/18/09 08:48	
Acenaphthylene	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
Acenaphthene	"	0.00107	0.0010	0.010	"	"	--	--	--	--	--	--	"	J
2-Methylnaphthalene	"	ND	0.0030	0.013	"	"	--	--	--	--	--	--	"	
Fluorene	"	0.00129	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
1-Methylnaphthalene	"	0.00131	0.0012	0.010	"	"	--	--	--	--	--	--	"	J
Phenanthrene	"	ND	0.0011	0.010	"	"	--	--	--	--	--	--	"	
Chrysene	"	ND	0.0021	0.010	"	"	--	--	--	--	--	--	"	
Anthracene	"	0.000974	0.00080	0.010	"	"	--	--	--	--	--	--	"	J
Benzo[b]fluoranthene	"	ND	0.0026	0.010	"	"	--	--	--	--	--	--	"	
Benzo[k]fluoranthene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Fluoranthene	"	0.00407	0.0016	0.010	"	"	--	--	--	--	--	--	"	J
Pyrene	"	0.0106	0.0017	0.010	"	"	--	--	--	--	--	--	"	
Benzo[a]pyrene	"	ND	0.0019	0.020	"	"	--	--	--	--	--	--	"	
Indeno[1,2,3-cd]pyrene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Benzo[a]anthracene	"	ND	0.0024	0.010	"	"	--	--	--	--	--	--	"	
Dibenz(a,h)anthracene	"	ND	0.0018	0.010	"	"	--	--	--	--	--	--	"	
Benzo[g,h,i]perylene	"	ND	0.0020	0.010	"	"	--	--	--	--	--	--	"	
Surrogate(s): 2-Fluorobiphenyl		*Recovery: 69%*		*Limits: 50-110%*	"								*09/18/09 08:48*	
Terphenyl-d14		*76%*		*50-135%*	"								"	
Nitrobenzene-d5		*80%*		*40-110%*	"								"	
LCS (580-50470-5)				**QC Source:**					**Extracted: 09/14/09 09:08**					
Acenaphthylene	8270C STD	0.779	0.0011	0.010	ug/L	1x	--	1.00	78%	(50-105)	--	--	09/18/09 09:08	
Naphthalene	"	0.716	0.0036	0.010	"	"	--	"	71%	(40-100)	--	--	"	
2-Methylnaphthalene	"	0.817	0.0030	0.013	"	"	--	"	81%	(45-105)	--	--	"	
Acenaphthene	"	0.732	0.0010	0.010	"	"	--	"	73%	(45-110)	--	--	"	
1-Methylnaphthalene	"	0.728	0.0012	0.010	"	"	--	"	73%	(50-150)	--	--	"	
Fluorene	"	0.832	0.0012	0.010	"	"	--	"	83%	(50-110)	--	--	"	
Phenanthrene	"	0.738	0.0011	0.010	"	"	--	"	74%	(50-115)	--	--	"	
Chrysene	"	0.856	0.0021	0.010	"	"	--	"	86%	(55-110)	--	--	"	
Benzo[b]fluoranthene	"	0.809	0.0026	0.010	"	"	--	"	81%	(45-120)	--	--	"	
Anthracene	"	0.767	0.00080	0.010	"	"	--	"	76%	(55-110)	--	--	"	
Benzo[k]fluoranthene	"	0.825	0.0024	0.010	"	"	--	"	83%	(45-125)	--	--	"	
Fluoranthene	"	0.857	0.0016	0.010	"	"	--	"	86%	(55-115)	--	--	"	
Benzo[a]pyrene	"	0.858	0.0019	0.020	"	"	--	"	85%	(55-110)	--	--	"	
Pyrene	"	0.828	0.0017	0.010	"	"	--	"	83%	(50-130)	--	--	"	
Benzo[a]anthracene	"	0.873	0.0024	0.010	"	"	--	"	87%	(55-110)	--	--	"	
Indeno[1,2,3-cd]pyrene	"	0.762	0.0020	0.010	"	"	--	"	76%	(45-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Semivolatile Organic Compounds (GC/MS SIM) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50156 **Water Preparation Method: 3510C**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50470-5)			**QC Source:**						**Extracted: 09/14/09 09:08**					
Dibenz(a,h)anthracene	8270C STD	0.795	0.0018	0.010	ug/L	1x	--	1.00	79%	(40-125)	--	--	09/18/09 09:08	
Benzo[g,h,i]perylene	"	0.708	0.0020	0.010	"	"	--	"	71%	"	--	--	"	
Surrogate(s): 2-Fluorobiphenyl		*Recovery: 57%*			*Limits: 50-110%*	"							*09/18/09 09:08*	
Terphenyl-d14		*61%*			*50-135%*	"							*"*	
Nitrobenzene-d5		*84%*			*40-110%*	"							*"*	

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50612-4)				**QC Source:**						**Extracted: 09/21/09 12:40**				
Naphthalene	8260B STD Dry	0.00144	0.00024	0.0050	mg/Kg dry	1x	--	--	--	--	--	--	09/21/09 16:10	J
1,2,3-Trichloropropane	"	ND	0.00036	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	0.000088	0.0020	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.00032	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	0.00029	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.00012	0.0010	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.000072	0.0010	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	0.000516	0.00017	0.0020	"	"	--	--	--	--	--	--	"	J
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.00014	0.0050	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.00020	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.00035	0.0020	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Benzene	"	0.000108	0.000079	0.0010	"	"	--	--	--	--	--	--	"	J
m-Xylene & p-Xylene	"	0.000182	0.00016	0.0020	"	"	--	--	--	--	--	--	"	J
Chlorobromomethane	"	ND	0.00025	0.0010	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.00033	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50612-4)				**QC Source:**					**Extracted: 09/21/09 12:40**					
2-Chlorotoluene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Toluene	"	0.000114	0.000085	0.0010	"	"	--	--	--	--	--	--	"	J
1,2,4-Trichlorobenzene	"	0.000396	0.00038	0.0020	"	"	--	--	--	--	--	--	"	J
o-Xylene	"	0.0000859	0.000053	0.0010	"	"	--	--	--	--	--	--	"	J
Chlorobenzene	"	0.000989	0.00018	0.0010	"	"	--	--	--	--	--	--	"	J
1,3-Dichlorobenzene	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.00035	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.000087	0.0010	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.00040	0.0010	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	0.00022	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 100%*		*Limits: 85-120%*	"								*09/21/09 16:10*	
Toluene-d8 (Surr)		*101%*		*85-115%*	"								"	
Trifluorotoluene (Surr)		*99%*		*75-125%*	"								"	
1,2-Dichloroethane-d4 (Surr)		*98%*		*75-125%*	"								"	
Blank (580-50612-5)				**QC Source:**					**Extracted: 09/21/09 12:40**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	0.000088	0.0020	mg/Kg dry	1x	--	--	--	--	--	--	09/21/09 16:34	
1,2,3-Trichloropropane	"	ND	0.00036	0.0010	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00024	0.0050	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.00032	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	0.00029	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.00012	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50612-5)				**QC Source:**									**Extracted: 09/21/09 12:40**	
Bromoform	8260B STD Dry	ND	0.000072	0.0010	mg/Kg dry	1x	--	--	--	--	--	--	09/21/09 16:34	
Bromobenzene	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	ND	0.00017	0.0020	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.00014	0.0050	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.00020	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.00035	0.0020	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	0.000079	0.0010	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	0.00025	0.0010	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.00033	0.0010	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Toluene	"	0.000156	0.000085	0.0010	"	"	--	--	--	--	--	--	"	J
1,2,4-Trichlorobenzene	"	ND	0.00038	0.0020	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	0.000053	0.0010	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	0.000902	0.00018	0.0010	"	"	--	--	--	--	--	--	"	J
1,3-Dichlorobenzene	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.00035	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.000087	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50612-5)				QC Source:					Extracted: 09/21/09 12:40					
sec-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	0.000409	0.00040	0.0010	"	"	--	--	--	--	--	--	"	J
1,3-Dichloropropane	"	ND	0.00022	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 99%*			*Limits: 85-120%*	"							*09/21/09 16:34*	
Toluene-d8 (Surr)		*99%*			*85-115%*	"							"	
Trifluorotoluene (Surr)		*97%*			*75-125%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*98%*			*75-125%*	"							"	
LCS (580-50612-7)				QC Source:					Extracted: 09/21/09 12:40					
1,2,3-Trichloropropane	8260B STD Dry	0.0527	0.00036	0.0010	mg/Kg dry	1x	--	0.0493	107%	(65-130)	--	--	09/21/09 17:22	
Naphthalene	"	0.0573	0.00024	0.0050	"	"	--	0.0500	115%	(40-125)	--	--	"	
1,1,2,2-Tetrachloroethane	"	0.0506	0.000088	0.0020	"	"	--	0.0492	103%	(55-130)	--	--	"	
Styrene	"	0.0505	0.00032	0.0010	"	"	--	0.0499	101%	(75-125)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	0.0541	0.00018	0.0020	"	"	--	0.0500	108%	(40-135)	--	--	"	
Chloroethane	"	0.0444	0.00027	0.0010	"	"	--	0.0501	89%	(40-155)	--	--	"	
4-Chlorotoluene	"	0.0417	0.00039	0.0010	"	"	--	0.0493	85%	(75-125)	--	--	"	
Chloroform	"	0.0486	0.00015	0.0010	"	"	--	0.0499	97%	(70-125)	--	--	"	
1,2-Dichloroethane	"	0.0507	0.00016	0.0010	"	"	--	0.0500	101%	(70-135)	--	--	"	
trans-1,2-Dichloroethene	"	0.0467	0.00029	0.0010	"	"	--	"	93%	(65-135)	--	--	"	
1,2-Dichloropropane	"	0.0500	0.00017	0.0010	"	"	--	"	100%	(70-120)	--	--	"	
Chloromethane	"	0.0517	0.00018	0.0010	"	"	--	"	103%	(50-130)	--	--	"	
cis-1,3-Dichloropropene	"	0.0489	0.00012	0.0010	"	"	--	0.0526	93%	(70-125)	--	--	"	
Bromoform	"	0.0495	0.000072	0.0010	"	"	--	0.0496	100%	(55-135)	--	--	"	
Bromobenzene	"	0.0469	0.00016	0.0010	"	"	--	0.0498	94%	(65-120)	--	--	"	
1,2,3-Trichlorobenzene	"	0.0469	0.00017	0.0020	"	"	--	0.0500	94%	(60-135)	--	--	"	
Dichlorobromomethane	"	0.0504	0.000074	0.0010	"	"	--	"	101%	(70-130)	--	--	"	
Bromomethane	"	0.0514	0.00038	0.0010	"	"	--	"	103%	(30-160)	--	--	"	
Ethylene Dibromide	"	0.0530	0.00013	0.0010	"	"	--	0.0495	107%	(70-125)	--	--	"	
1,1-Dichloroethene	"	0.0435	0.00014	0.0050	"	"	--	"	88%	(65-135)	--	--	"	
Carbon tetrachloride	"	0.0456	0.00037	0.0010	"	"	--	0.0500	91%	"	--	--	"	
trans-1,3-Dichloropropene	"	0.0473	0.00018	0.0010	"	"	--	0.0475	100%	(65-125)	--	--	"	
Trichlorofluoromethane	"	0.0402	0.00020	0.0010	"	"	--	0.0495	81%	(25-185)	--	--	"	
Hexachlorobutadiene	"	0.0413	0.00034	0.0010	"	"	--	0.0490	84%	(55-140)	--	--	"	
1,1,2-Trichloroethane	"	0.0530	0.00010	0.0010	"	"	--	0.0493	107%	(60-125)	--	--	"	
Trichloroethene	"	0.0463	0.00018	0.0010	"	"	--	0.0500	92%	(75-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50612-7)				**QC Source:**					**Extracted: 09/21/09 12:40**					
4-Isopropyltoluene	8260B STD Dry	0.0405	0.00031	0.0010	mg/Kg dry	1x	--	0.0497	81%	(75-135)	--	--	09/21/09 17:22	
Dichlorodifluoromethane	"	0.0480	0.00019	0.0010	"	"	--	0.0492	98%	(35-135)	--	--	"	
1,1,1-Trichloroethane	"	0.0454	0.00038	0.0010	"	"	--	0.0500	91%	(70-135)	--	--	"	
1,3,5-Trimethylbenzene	"	0.0436	0.00035	0.0020	"	"	--	0.0494	88%	(65-135)	--	--	"	
Benzene	"	0.0471	0.000079	0.0010	"	"	--	0.0500	94%	(75-125)	--	--	"	
Methylene Chloride	"	0.0486	0.00019	0.0010	"	"	--	"	97%	(55-140)	--	--	"	
cis-1,2-Dichloroethene	"	0.0518	0.00013	0.0010	"	"	--	"	104%	(65-125)	--	--	"	
m-Xylene & p-Xylene	"	0.0892	0.00016	0.0020	"	"	--	0.100	89%	(80-125)	--	--	"	
Chlorobromomethane	"	0.0530	0.00025	0.0010	"	"	--	0.0496	107%	(70-125)	--	--	"	
n-Butylbenzene	"	0.0415	0.00031	0.0010	"	"	--	0.0497	83%	(65-140)	--	--	"	
Tetrachloroethene	"	0.0385	0.00010	0.0010	"	"	--	0.0500	77%	"	--	--	"	
Vinyl chloride	"	0.0444	0.00015	0.0010	"	"	--	"	89%	(60-125)	--	--	"	
1,2,4-Trimethylbenzene	"	0.0430	0.00033	0.0010	"	"	--	0.0497	86%	(65-135)	--	--	"	
1,1-Dichloroethane	"	0.0472	0.00039	0.0010	"	"	--	0.0498	95%	(75-125)	--	--	"	
2-Chlorotoluene	"	0.0469	0.00015	0.0010	"	"	--	0.0494	95%	(70-130)	--	--	"	
tert-Butylbenzene	"	0.0445	0.00034	0.0010	"	"	--	0.0495	90%	(65-130)	--	--	"	
Chlorodibromomethane	"	0.0531	0.00014	0.0010	"	"	--	0.0490	108%	"	--	--	"	
Dibromomethane	"	0.0549	0.00010	0.0010	"	"	--	0.0493	111%	(75-130)	--	--	"	
1,1-Dichloropropene	"	0.0475	0.00039	0.0010	"	"	--	0.0498	95%	(70-135)	--	--	"	
Toluene	"	0.0471	0.000085	0.0010	"	"	--	0.0500	94%	(70-125)	--	--	"	
1,2,4-Trichlorobenzene	"	0.0429	0.00038	0.0020	"	"	--	0.0497	86%	(65-130)	--	--	"	
o-Xylene	"	0.0446	0.000053	0.0010	"	"	--	0.0495	90%	(75-125)	--	--	"	
Chlorobenzene	"	0.0471	0.00018	0.0010	"	"	--	0.0500	94%	"	--	--	"	
1,3-Dichlorobenzene	"	0.0424	0.00038	0.0010	"	"	--	"	85%	(70-125)	--	--	"	
1,2-Dichlorobenzene	"	0.0451	0.00035	0.0010	"	"	--	0.0499	90%	(75-120)	--	--	"	
1,1,1,2-Tetrachloroethane	"	0.0492	0.000087	0.0010	"	"	--	0.0492	100%	(75-125)	--	--	"	
sec-Butylbenzene	"	0.0425	0.00034	0.0010	"	"	--	0.0500	85%	(65-130)	--	--	"	
Ethylbenzene	"	0.0452	0.00015	0.0010	"	"	--	"	90%	(75-125)	--	--	"	
Isopropylbenzene	"	0.0399	0.00015	0.0010	"	"	--	"	80%	(75-130)	--	--	"	
2,2-Dichloropropane	"	0.0449	0.00038	0.0010	"	"	--	"	90%	(65-135)	--	--	"	
N-Propylbenzene	"	0.0418	0.00014	0.0010	"	"	--	"	84%	"	--	--	"	
1,4-Dichlorobenzene	"	0.0422	0.00040	0.0010	"	"	--	"	84%	(70-125)	--	--	"	
1,3-Dichloropropane	"	0.0525	0.00022	0.0010	"	"	--	0.0498	105%	(75-125)	--	--	"	

Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*Recovery: 101%*	*Limits: 85-120%*	"	*09/21/09 17:22*
	Toluene-d8 (Surr)	*101%*	*85-115%*	"	"
	Trifluorotoluene (Surr)	*100%*	*75-125%*	"	"
	1,2-Dichloroethane-d4 (Surr)	*99%*	*75-125%*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50612-8)				**QC Source:**					**Extracted: 09/21/09 12:40**					
Naphthalene	8260B STD Dry	0.0555	0.00024	0.0050	mg/Kg dry	1x	--	0.0500	111%	(40-125)	2%	(30)	09/21/09 17:46	
1,2,3-Trichloropropane	"	0.0517	0.00036	0.0010	"	"	--	0.0493	105%	(65-130)	1%	"	"	
1,1,2,2-Tetrachloroethane	"	0.0487	0.000088	0.0020	"	"	--	0.0492	99%	(55-130)	4%	"	"	
1,2-Dibromo-3-Chloropropane	"	0.0503	0.00018	0.0020	"	"	--	0.0500	101%	(40-135)	9%	"	"	
Styrene	"	0.0588	0.00032	0.0010	"	"	--	0.0499	118%	(75-125)	1%	"	"	
Chloroethane	"	0.0444	0.00027	0.0010	"	"	--	0.0501	89%	(40-155)	5%	"	"	
1,2-Dichloroethane	"	0.0512	0.00016	0.0010	"	"	--	0.0500	102%	(70-135)	3%	"	"	
Chloroform	"	0.0517	0.00015	0.0010	"	"	--	0.0499	104%	(70-125)	1%	"	"	
4-Chlorotoluene	"	0.0510	0.00039	0.0010	"	"	--	0.0493	103%	(75-125)	7%	"	"	
Chloromethane	"	0.0538	0.00018	0.0010	"	"	--	0.0500	108%	(50-130)	1%	"	"	
1,2-Dichloropropane	"	0.0542	0.00017	0.0010	"	"	--	"	108%	(70-120)	0%	"	"	
trans-1,2-Dichloroethene	"	0.0491	0.00029	0.0010	"	"	--	"	98%	(65-135)	0%	"	"	
cis-1,3-Dichloropropene	"	0.0517	0.00012	0.0010	"	"	--	0.0526	98%	(70-125)	0%	"	"	
Bromoform	"	0.0506	0.000072	0.0010	"	"	--	0.0496	102%	(55-135)	2%	"	"	
Bromobenzene	"	0.0533	0.00016	0.0010	"	"	--	0.0498	107%	(65-120)	0%	"	"	
1,2,3-Trichlorobenzene	"	0.0511	0.00017	0.0020	"	"	--	0.0500	102%	(60-135)	1%	"	"	
Dichlorobromomethane	"	0.0531	0.000074	0.0010	"	"	--	"	106%	(70-130)	1%	"	"	
Bromomethane	"	0.0544	0.00038	0.0010	"	"	--	"	109%	(30-160)	0%	"	"	
1,1-Dichloroethene	"	0.0447	0.00014	0.0050	"	"	--	0.0495	90%	(65-135)	4%	"	"	
Carbon tetrachloride	"	0.0484	0.00037	0.0010	"	"	--	0.0500	97%	"	1%	"	"	
Ethylene Dibromide	"	0.0529	0.00013	0.0010	"	"	--	0.0495	107%	(70-125)	4%	"	"	
Hexachlorobutadiene	"	0.0464	0.00034	0.0010	"	"	--	0.0490	95%	(55-140)	3%	"	"	
trans-1,3-Dichloropropene	"	0.0480	0.00018	0.0010	"	"	--	0.0475	101%	(65-125)	2%	"	"	
Trichlorofluoromethane	"	0.0409	0.00020	0.0010	"	"	--	0.0495	82%	(25-185)	1%	"	"	
4-Isopropyltoluene	"	0.0472	0.00031	0.0010	"	"	--	0.0497	95%	(75-135)	2%	"	"	
1,1,2-Trichloroethane	"	0.0532	0.00010	0.0010	"	"	--	0.0493	108%	(60-125)	2%	"	"	
Trichloroethene	"	0.0516	0.00018	0.0010	"	"	--	0.0500	103%	(75-125)	1%	"	"	
Dichlorodifluoromethane	"	0.0481	0.00019	0.0010	"	"	--	0.0492	98%	(35-135)	1%	"	"	
1,3,5-Trimethylbenzene	"	0.0512	0.00035	0.0020	"	"	--	0.0494	104%	(65-135)	1%	"	"	
1,1,1-Trichloroethane	"	0.0490	0.00038	0.0010	"	"	--	0.0500	98%	(70-135)	2%	"	"	
Benzene	"	0.0514	0.000079	0.0010	"	"	--	"	103%	(75-125)	0%	"	"	
Methylene Chloride	"	0.0498	0.00019	0.0010	"	"	--	"	100%	(55-140)	2%	"	"	
cis-1,2-Dichloroethene	"	0.0548	0.00013	0.0010	"	"	--	"	110%	(65-125)	1%	"	"	
m-Xylene & p-Xylene	"	0.102	0.00016	0.0020	"	"	--	0.100	102%	(80-125)	0%	"	"	
n-Butylbenzene	"	0.0461	0.00031	0.0010	"	"	--	0.0497	93%	(65-140)	1%	"	"	
Chlorobromomethane	"	0.0536	0.00025	0.0010	"	"	--	0.0496	108%	(70-125)	1%	"	"	
Vinyl chloride	"	0.0458	0.00015	0.0010	"	"	--	0.0500	92%	(60-125)	0%	"	"	
1,2,4-Trimethylbenzene	"	0.0514	0.00033	0.0010	"	"	--	0.0497	103%	(65-135)	1%	"	"	
Tetrachloroethene	"	0.0550	0.00010	0.0010	"	"	--	0.0500	110%	(65-140)	3%	"	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50612-8)					**QC Source:**				**Extracted: 09/21/09 12:40**					
1,1-Dichloroethane	"	0.0500	0.00039	0.0010	"	"	--	0.0498	100%	(75-125)	2%	"	"	
2-Chlorotoluene	"	0.0520	0.00015	0.0010	"	"	--	0.0494	105%	(70-130)	1%	"	"	
tert-Butylbenzene	"	0.0516	0.00034	0.0010	"	"	--	0.0495	104%	(65-130)	1%	"	"	
Chlorodibromomethane	"	0.0552	0.00014	0.0010	"	"	--	0.0490	113%	"	2%	"	"	
Dibromomethane	"	0.0555	0.00010	0.0010	"	"	--	0.0493	112%	(75-130)	1%	"	"	
1,1-Dichloropropene	"	0.0496	0.00039	0.0010	"	"	--	0.0498	100%	(70-135)	1%	"	"	
Toluene	"	0.0526	0.000085	0.0010	"	"	--	0.0500	105%	(70-125)	1%	"	"	
1,2,4-Trichlorobenzene	"	0.0477	0.00038	0.0020	"	"	--	0.0497	96%	(65-130)	1%	"	"	
o-Xylene	"	0.0528	0.000053	0.0010	"	"	--	0.0495	107%	(75-125)	2%	"	"	
Chlorobenzene	"	0.0534	0.00018	0.0010	"	"	--	0.0500	107%	"	2%	"	"	
1,3-Dichlorobenzene	"	0.0493	0.00038	0.0010	"	"	--	"	99%	(70-125)	3%	"	"	
1,2-Dichlorobenzene	"	0.0512	0.00035	0.0010	"	"	--	0.0499	103%	(75-120)	2%	"	"	
1,1,1,2-Tetrachloroethane	"	0.0549	0.000087	0.0010	"	"	--	0.0492	112%	(75-125)	3%	"	"	
sec-Butylbenzene	"	0.0498	0.00034	0.0010	"	"	--	0.0500	100%	(65-130)	2%	"	"	
Ethylbenzene	"	0.0520	0.00015	0.0010	"	"	--	"	104%	(75-125)	1%	"	"	
Isopropylbenzene	"	0.0468	0.00015	0.0010	"	"	--	"	94%	(75-130)	3%	"	"	
2,2-Dichloropropane	"	0.0458	0.00038	0.0010	"	"	--	"	92%	(65-135)	1%	"	"	
N-Propylbenzene	"	0.0483	0.00014	0.0010	"	"	--	"	96%	"	1%	"	"	
1,4-Dichlorobenzene	"	0.0483	0.00040	0.0010	"	"	--	"	97%	(70-125)	2%	"	"	
1,3-Dichloropropane	"	0.0527	0.00022	0.0010	"	"	--	0.0498	106%	(75-125)	3%	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 102%*			*Limits: 85-120%*	"							*09/21/09 17:46*	
Toluene-d8 (Surr)		*100%*			*85-115%*	"							"	
Trifluorotoluene (Surr)		*98%*			*75-125%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*94%*			*75-125%*	"							"	
LCS Dup (580-50612-9)					**QC Source:**				**Extracted: 09/21/09 12:40**					
1,2,3-Trichloropropane	8260B STD Dry	0.0524	0.00036	0.0010	mg/Kg dry	1x	--	0.0493	106%	(65-130)	0%	(30)	09/21/09 18:09	
1,1,2,2-Tetrachloroethane	"	0.0509	0.000088	0.0020	"	"	--	0.0492	103%	(55-130)	1%	"	"	
Naphthalene	"	0.0590	0.00024	0.0050	"	"	--	0.0500	118%	(40-125)	3%	"	"	
1,2-Dibromo-3-Chloropropane	"	0.0543	0.00018	0.0020	"	"	--	"	109%	(40-135)	0%	"	"	
Chloroethane	"	0.0460	0.00027	0.0010	"	"	--	0.0501	92%	(40-155)	4%	"	"	
Styrene	"	0.0545	0.00032	0.0010	"	"	--	0.0499	109%	(75-125)	8%	"	"	
Chloroform	"	0.0502	0.00015	0.0010	"	"	--	"	101%	(70-125)	3%	"	"	
1,2-Dichloroethane	"	0.0519	0.00016	0.0010	"	"	--	0.0500	104%	(70-135)	2%	"	"	
4-Chlorotoluene	"	0.0469	0.00039	0.0010	"	"	--	0.0493	95%	(75-125)	12%	"	"	
Chloromethane	"	0.0541	0.00018	0.0010	"	"	--	0.0500	108%	(50-130)	4%	"	"	
trans-1,2-Dichloroethene	"	0.0487	0.00029	0.0010	"	"	--	"	97%	(65-135)	4%	"	"	
1,2-Dichloropropane	"	0.0515	0.00017	0.0010	"	"	--	"	103%	(70-120)	3%	"	"	
Bromoform	"	0.0514	0.000072	0.0010	"	"	--	0.0496	104%	(55-135)	4%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50612-9)				**QC Source:**					**Extracted: 09/21/09 12:40**					
cis-1,3-Dichloropropene	8260B STD Dry	0.0507	0.00012	0.0010	mg/Kg dry	1x	--	0.0526	96%	(70-125)	4%	(30)	09/21/09 18:09	
Bromobenzene	"	0.0500	0.00016	0.0010	"	"	--	0.0498	100%	(65-120)	6%	"	"	
Bromomethane	"	0.0544	0.00038	0.0010	"	"	--	0.0500	109%	(30-160)	6%	"	"	
1,2,3-Trichlorobenzene	"	0.0503	0.00017	0.0020	"	"	--	"	101%	(60-135)	7%	"	"	
Dichlorobromomethane	"	0.0524	0.000074	0.0010	"	"	--	"	105%	(70-130)	4%	"	"	
Carbon tetrachloride	"	0.0465	0.00037	0.0010	"	"	--	"	93%	(65-135)	2%	"	"	
1,1-Dichloroethene	"	0.0439	0.00014	0.0050	"	"	--	0.0495	89%	"	1%	"	"	
Ethylene Dibromide	"	0.0542	0.00013	0.0010	"	"	--	"	109%	(70-125)	2%	"	"	
Hexachlorobutadiene	"	0.0442	0.00034	0.0010	"	"	--	0.0490	90%	(55-140)	7%	"	"	
Trichlorofluoromethane	"	0.0403	0.00020	0.0010	"	"	--	0.0495	81%	(25-185)	0%	"	"	
trans-1,3-Dichloropropene	"	0.0482	0.00018	0.0010	"	"	--	0.0475	101%	(65-125)	2%	"	"	
4-Isopropyltoluene	"	0.0431	0.00031	0.0010	"	"	--	0.0497	87%	(75-135)	6%	"	"	
Trichloroethene	"	0.0476	0.00018	0.0010	"	"	--	0.0500	95%	(75-125)	3%	"	"	
1,1,2-Trichloroethane	"	0.0528	0.00010	0.0010	"	"	--	0.0493	107%	(60-125)	0%	"	"	
1,1,1-Trichloroethane	"	0.0469	0.00038	0.0010	"	"	--	0.0500	94%	(70-135)	3%	"	"	
1,3,5-Trimethylbenzene	"	0.0466	0.00035	0.0020	"	"	--	0.0494	94%	(65-135)	7%	"	"	
Dichlorodifluoromethane	"	0.0497	0.00019	0.0010	"	"	--	0.0492	101%	(35-135)	4%	"	"	
Methylene Chloride	"	0.0505	0.00019	0.0010	"	"	--	0.0500	101%	(55-140)	4%	"	"	
Benzene	"	0.0489	0.000079	0.0010	"	"	--	"	98%	(75-125)	4%	"	"	
cis-1,2-Dichloroethene	"	0.0536	0.00013	0.0010	"	"	--	"	107%	(65-125)	3%	"	"	
n-Butylbenzene	"	0.0436	0.00031	0.0010	"	"	--	0.0497	88%	(65-140)	5%	"	"	
m-Xylene & p-Xylene	"	0.0945	0.00016	0.0020	"	"	--	0.100	94%	(80-125)	6%	"	"	
Chlorobromomethane	"	0.0536	0.00025	0.0010	"	"	--	0.0496	108%	(70-125)	1%	"	"	
1,2,4-Trimethylbenzene	"	0.0465	0.00033	0.0010	"	"	--	0.0497	94%	(65-135)	8%	"	"	
Tetrachloroethene	"	0.0389	0.00010	0.0010	"	"	--	0.0500	78%	(65-140)	1%	"	"	
Vinyl chloride	"	0.0462	0.00015	0.0010	"	"	--	"	92%	(60-125)	4%	"	"	
2-Chlorotoluene	"	0.0472	0.00015	0.0010	"	"	--	0.0494	95%	(70-130)	1%	"	"	
1,1-Dichloroethane	"	0.0492	0.00039	0.0010	"	"	--	0.0498	99%	(75-125)	4%	"	"	
tert-Butylbenzene	"	0.0465	0.00034	0.0010	"	"	--	0.0495	94%	(65-130)	4%	"	"	
Chlorodibromomethane	"	0.0542	0.00014	0.0010	"	"	--	0.0490	111%	"	2%	"	"	
Dibromomethane	"	0.0552	0.00010	0.0010	"	"	--	0.0493	112%	(75-130)	0%	"	"	
1,1-Dichloropropene	"	0.0475	0.00039	0.0010	"	"	--	0.0498	96%	(70-135)	0%	"	"	
Toluene	"	0.0481	0.000085	0.0010	"	"	--	0.0500	96%	(70-125)	2%	"	"	
1,2,4-Trichlorobenzene	"	0.0461	0.00038	0.0020	"	"	--	0.0497	93%	(65-130)	7%	"	"	
o-Xylene	"	0.0480	0.000053	0.0010	"	"	--	0.0495	97%	(75-125)	7%	"	"	
Chlorobenzene	"	0.0495	0.00018	0.0010	"	"	--	0.0500	99%	"	5%	"	"	
1,3-Dichlorobenzene	"	0.0455	0.00038	0.0010	"	"	--	"	91%	(70-125)	7%	"	"	
1,2-Dichlorobenzene	"	0.0487	0.00035	0.0010	"	"	--	0.0499	97%	(75-120)	8%	"	"	
1,1,1,2-Tetrachloroethane	"	0.0516	0.000087	0.0010	"	"	--	0.0492	105%	(75-125)	5%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50608 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS Dup (580-50612-9)					**QC Source:**								**Extracted: 09/21/09 12:40**	
sec-Butylbenzene	"	0.0457	0.00034	0.0010	"	"	--	0.0500	91%	(65-130)	7%	"	"	
Ethylbenzene	"	0.0479	0.00015	0.0010	"	"	--	"	96%	(75-125)	6%	"	"	
Isopropylbenzene	"	0.0419	0.00015	0.0010	"	"	--	"	84%	(75-130)	5%	"	"	
2,2-Dichloropropane	"	0.0443	0.00038	0.0010	"	"	--	"	89%	(65-135)	1%	"	"	
N-Propylbenzene	"	0.0444	0.00014	0.0010	"	"	--	"	89%	"	6%	"	"	
1,4-Dichlorobenzene	"	0.0456	0.00040	0.0010	"	"	--	"	91%	(70-125)	8%	"	"	
1,3-Dichloropropane	"	0.0527	0.00022	0.0010	"	"	--	0.0498	106%	(75-125)	0%	"	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 102%*			*Limits: 85-120%*	"							*09/21/09 18:09*	
Toluene-d8 (Surr)		*100%*			*85-115%*	"							"	
Trifluorotoluene (Surr)		*95%*			*75-125%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*97%*			*75-125%*	"							"	

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)					**QC Source: SSI0049-13**								**Extracted: 09/22/09 07:32**	
Naphthalene	8260B STD Dry	0.0653	0.00033	0.0068	mg/Kg dry	1x	ND	0.0679	96%	(40-125)	12%	(30)	09/22/09 17:45	
1,2,3-Trichloropropane	"	0.0707	0.00049	0.0014	"	"	ND	0.0669	106%	(65-130)	22%	"	"	
1,1,2,2-Tetrachloroethane	"	0.0644	0.00012	0.0027	"	"	ND	0.0668	96%	(55-130)	25%	"	"	
Chloroethane	"	0.0711	0.00036	0.0014	"	"	ND	0.0680	104%	(40-155)	6%	"	"	
1,2-Dibromo-3-Chloropropane	"	0.0711	0.00025	0.0027	"	"	ND	0.0679	105%	(40-135)	24%	"	"	
Styrene	"	0.0684	0.00043	0.0014	"	"	ND	0.0677	101%	(75-125)	11%	"	"	
4-Chlorotoluene	"	0.0575	0.00052	0.0014	"	"	ND	0.0669	86%	"	10%	"	"	
Chloroform	"	0.0670	0.00020	0.0014	"	"	ND	0.0678	99%	(70-125)	21%	"	"	
1,2-Dichloroethane	"	0.0657	0.00022	0.0014	"	"	ND	0.0679	97%	(70-135)	24%	"	"	
Chloromethane	"	0.0725	0.00024	0.0014	"	"	ND	"	107%	(50-130)	25%	"	"	
trans-1,2-Dichloroethene	"	0.0644	0.00039	0.0014	"	"	ND	"	95%	(65-135)	18%	"	"	
1,2-Dichloropropane	"	0.0661	0.00023	0.0014	"	"	ND	"	97%	(70-120)	23%	"	"	
cis-1,3-Dichloropropene	"	0.0622	0.00016	0.0014	"	"	ND	0.0713	87%	(70-125)	19%	"	"	
Bromoform	"	0.0650	0.000098	0.0014	"	"	ND	0.0674	96%	(55-135)	22%	"	"	
Bromobenzene	"	0.0635	0.00021	0.0014	"	"	ND	0.0676	94%	(65-120)	13%	"	"	
Dichlorobromomethane	"	0.0667	0.00010	0.0014	"	"	ND	0.0679	98%	(70-130)	22%	"	"	
Bromomethane	"	0.0723	0.00052	0.0014	"	"	ND	"	107%	(30-160)	23%	"	"	
1,2,3-Trichlorobenzene	"	0.0539	0.00023	0.0027	"	"	ND	"	79%	(60-135)	6%	"	"	
Carbon tetrachloride	"	0.0660	0.00050	0.0014	"	"	ND	"	97%	(65-135)	13%	"	"	
Ethylene Dibromide	"	0.0670	0.00018	0.0014	"	"	ND	0.0672	100%	(70-125)	22%	"	"	
1,1-Dichloroethene	"	0.0648	0.00019	0.0068	"	"	ND	"	96%	(65-135)	8%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)				**QC Source: SSI0049-13**				**Extracted: 09/22/09 07:32**						
Trichlorofluoromethane	8260B STD Dry	0.0621	0.00026	0.0014	mg/Kg dry	1x	ND	0.0672	92%	(25-185)	10%	(30)	09/22/09 17:45	
trans-1,3-Dichloropropene	"	0.0566	0.00024	0.0014	"	"	ND	0.0645	88%	(65-125)	24%	"	"	
Hexachlorobutadiene	"	0.0505	0.00046	0.0014	"	"	ND	0.0666	76%	(55-140)	1%	"	"	
1,1,2-Trichloroethane	"	0.0664	0.00014	0.0014	"	"	ND	0.0670	99%	(60-125)	23%	"	"	
Trichloroethene	"	0.0634	0.00024	0.0014	"	"	ND	0.0679	93%	(75-125)	18%	"	"	
4-Isopropyltoluene	"	0.0566	0.00042	0.0014	"	"	ND	0.0675	84%	(75-135)	1%	"	"	
1,1,1-Trichloroethane	"	0.0659	0.00052	0.0014	"	"	ND	0.0679	97%	(70-135)	16%	"	"	
1,3,5-Trimethylbenzene	"	0.0605	0.00048	0.0027	"	"	ND	0.0671	90%	(65-135)	6%	"	"	
Dichlorodifluoromethane	"	0.0709	0.00026	0.0014	"	"	ND	0.0668	106%	(35-135)	15%	"	"	
cis-1,2-Dichloroethene	"	0.0699	0.00017	0.0014	"	"	ND	0.0679	103%	(65-125)	21%	"	"	
Methylene Chloride	"	0.0671	0.00026	0.0014	"	"	ND	0.0678	99%	(55-140)	24%	"	"	
Benzene	"	0.0629	0.00011	0.0014	"	"	0.00020	0.0679	92%	(75-125)	20%	"	"	
m-Xylene & p-Xylene	"	0.125	0.00022	0.0027	"	"	0.00029	0.136	92%	(80-125)	9%	"	"	
Chlorobromomethane	"	0.0674	0.00034	0.0014	"	"	ND	0.0674	100%	(70-125)	25%	"	"	
n-Butylbenzene	"	0.0564	0.00043	0.0014	"	"	ND	0.0675	84%	(65-140)	2%	"	"	
1,2,4-Trimethylbenzene	"	0.0614	0.00045	0.0014	"	"	ND	"	91%	(65-135)	3%	"	"	
Tetrachloroethene	"	0.0507	0.00014	0.0014	"	"	ND	0.0679	75%	(65-140)	12%	"	"	
Vinyl chloride	"	0.0631	0.00020	0.0014	"	"	ND	"	93%	(60-125)	21%	"	"	
tert-Butylbenzene	"	0.0624	0.00046	0.0014	"	"	ND	0.0672	93%	(65-130)	6%	"	"	
1,1-Dichloroethane	"	0.0650	0.00053	0.0014	"	"	ND	0.0676	96%	(75-125)	21%	"	"	
2-Chlorotoluene	"	0.0632	0.00020	0.0014	"	"	ND	0.0671	94%	(70-130)	5%	"	"	
Chlorodibromomethane	"	0.0684	0.00019	0.0014	"	"	ND	0.0666	103%	(65-130)	22%	"	"	
Dibromomethane	"	0.0703	0.00014	0.0014	"	"	ND	0.0670	105%	(75-130)	23%	"	"	
1,1-Dichloropropene	"	0.0637	0.00053	0.0014	"	"	ND	0.0675	94%	(70-135)	12%	"	"	
Toluene	"	0.0628	0.00012	0.0014	"	"	0.00029	0.0679	92%	(70-125)	17%	"	"	
1,2,4-Trichlorobenzene	"	0.0516	0.00052	0.0027	"	"	ND	0.0674	77%	(65-130)	1%	"	"	
o-Xylene	"	0.0633	0.000072	0.0014	"	"	0.00012	0.0672	94%	(75-125)	12%	"	"	
Chlorobenzene	"	0.0634	0.00024	0.0014	"	"	0.00035	0.0679	93%	"	14%	"	"	
1,3-Dichlorobenzene	"	0.0574	0.00052	0.0014	"	"	ND	0.0678	85%	(70-125)	6%	"	"	
1,2-Dichlorobenzene	"	0.0597	0.00047	0.0014	"	"	ND	"	88%	(75-120)	9%	"	"	
1,1,1,2-Tetrachloroethane	"	0.0678	0.00012	0.0014	"	"	ND	0.0668	102%	(75-125)	19%	"	"	
sec-Butylbenzene	"	0.0597	0.00046	0.0014	"	"	ND	0.0679	88%	(65-130)	5%	"	"	
Ethylbenzene	"	0.0641	0.00020	0.0014	"	"	ND	"	94%	(75-125)	10%	"	"	
Isopropylbenzene	"	0.0565	0.00020	0.0014	"	"	ND	"	83%	(75-130)	9%	"	"	
2,2-Dichloropropane	"	0.0582	0.00052	0.0014	"	"	ND	"	86%	(65-135)	17%	"	"	
N-Propylbenzene	"	0.0583	0.00020	0.0014	"	"	ND	"	86%	"	4%	"	"	
1,4-Dichlorobenzene	"	0.0567	0.00054	0.0014	"	"	ND	"	84%	(70-125)	5%	"	"	
1,3-Dichloropropane	"	0.0657	0.00030	0.0014	"	"	ND	0.0676	97%	(75-125)	25%	"	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike Dup (1538513D)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 07:32**					
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 101%*			*Limits: 85-120%*	*1x*							*09/22/09 17:45*	
Toluene-d8 (Surr)		*100%*			*85-115%*	*"*							*"*	
Trifluorotoluene (Surr)		*98%*			*75-125%*	*"*							*"*	
1,2-Dichloroethane-d4 (Surr)		*95%*			*75-125%*	*"*							*"*	
Matrix Spike (1538513S)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 07:32**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	0.0826	0.00014	0.0032	mg/Kg dry	1x	ND	0.0796	104%	(55-130)	--	--	09/22/09 17:21	
1,2,3-Trichloropropane	"	0.0882	0.00058	0.0016	"	"	ND	0.0797	111%	(65-130)	--	--	"	
Naphthalene	"	0.0736	0.00039	0.0081	"	"	ND	0.0809	91%	(40-125)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	0.0907	0.00029	0.0032	"	"	ND	"	112%	(40-135)	--	--	"	
Styrene	"	0.0763	0.00051	0.0016	"	"	ND	0.0807	95%	(75-125)	--	--	"	
Chloroethane	"	0.0758	0.00043	0.0016	"	"	ND	0.0811	93%	(40-155)	--	--	"	
1,2-Dichloroethane	"	0.0833	0.00026	0.0016	"	"	ND	0.0809	103%	(70-135)	--	--	"	
Chloroform	"	0.0828	0.00024	0.0016	"	"	ND	0.0808	102%	(70-125)	--	--	"	
4-Chlorotoluene	"	0.0633	0.00062	0.0016	"	"	ND	0.0797	79%	(75-125)	--	--	"	
1,2-Dichloropropane	"	0.0834	0.00028	0.0016	"	"	ND	0.0809	103%	(70-120)	--	--	"	
trans-1,2-Dichloroethene	"	0.0769	0.00046	0.0016	"	"	ND	"	95%	(65-135)	--	--	"	
Chloromethane	"	0.0936	0.00028	0.0016	"	"	ND	"	116%	(50-130)	--	--	"	
cis-1,3-Dichloropropene	"	0.0749	0.00019	0.0016	"	"	ND	0.0850	88%	(70-125)	--	--	"	
Bromoform	"	0.0813	0.00012	0.0016	"	"	ND	0.0803	101%	(55-135)	--	--	"	
Bromobenzene	"	0.0722	0.00025	0.0016	"	"	ND	0.0806	90%	(65-120)	--	--	"	
1,2,3-Trichlorobenzene	"	0.0573	0.00028	0.0032	"	"	ND	0.0810	71%	(60-135)	--	--	"	
Dichlorobromomethane	"	0.0831	0.00012	0.0016	"	"	ND	0.0809	103%	(70-130)	--	--	"	
Bromomethane	"	0.0911	0.00062	0.0016	"	"	ND	"	113%	(30-160)	--	--	"	
1,1-Dichloroethene	"	0.0699	0.00022	0.0081	"	"	ND	0.0801	87%	(65-135)	--	--	"	
Ethylene Dibromide	"	0.0840	0.00021	0.0016	"	"	ND	"	105%	(70-125)	--	--	"	
Carbon tetrachloride	"	0.0753	0.00060	0.0016	"	"	ND	0.0809	93%	(65-135)	--	--	"	
Trichlorofluoromethane	"	0.0687	0.00032	0.0016	"	"	ND	0.0801	86%	(25-185)	--	--	"	
trans-1,3-Dichloropropene	"	0.0722	0.00029	0.0016	"	"	ND	0.0768	94%	(65-125)	--	--	"	
Hexachlorobutadiene	"	0.0512	0.00054	0.0016	"	"	ND	0.0794	65%	(55-140)	--	--	"	
4-Isopropyltoluene	"	0.0571	0.00050	0.0016	"	"	ND	0.0805	71%	(75-135)	--	--	"	F
1,1,2-Trichloroethane	"	0.0837	0.00016	0.0016	"	"	ND	0.0798	105%	(60-125)	--	--	"	
Trichloroethene	"	0.0755	0.00028	0.0016	"	"	ND	0.0810	93%	(75-125)	--	--	"	
Dichlorodifluoromethane	"	0.0827	0.00031	0.0016	"	"	ND	0.0796	104%	(35-135)	--	--	"	
1,1,1-Trichloroethane	"	0.0770	0.00062	0.0016	"	"	ND	0.0809	95%	(70-135)	--	--	"	
1,3,5-Trimethylbenzene	"	0.0643	0.00057	0.0032	"	"	ND	0.0800	80%	(65-135)	--	--	"	
Benzene	"	0.0768	0.00013	0.0016	"	"	0.00020	0.0809	95%	(75-125)	--	--	"	
Methylene Chloride	"	0.0856	0.00031	0.0016	"	"	ND	"	106%	(55-140)	--	--	"	
cis-1,2-Dichloroethene	"	0.0864	0.00021	0.0016	"	"	ND	"	107%	(65-125)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Matrix Spike (1538513S)					**QC Source: SSI0049-13**				**Extracted: 09/22/09 07:32**					
Chlorobromomethane	8260B STD Dry	0.0864	0.00040	0.0016	mg/Kg dry	1x	ND	0.0803	108%	(70-125)	--	--	09/22/09 17:21	
m-Xylene & p-Xylene	"	0.137	0.00026	0.0032	"	"	0.00029	0.162	85%	(80-125)	--	--	"	
n-Butylbenzene	"	0.0554	0.00051	0.0016	"	"	ND	0.0805	69%	(65-140)	--	--	"	
1,2,4-Trimethylbenzene	"	0.0630	0.00054	0.0016	"	"	ND	"	78%	(65-135)	--	--	"	
Vinyl chloride	"	0.0777	0.00024	0.0016	"	"	ND	0.0809	96%	(60-125)	--	--	"	
Tetrachloroethene	"	0.0575	0.00017	0.0016	"	"	ND	0.0810	71%	(65-140)	--	--	"	
1,1-Dichloroethane	"	0.0800	0.00064	0.0016	"	"	ND	0.0806	99%	(75-125)	--	--	"	
2-Chlorotoluene	"	0.0662	0.00024	0.0016	"	"	ND	0.0800	83%	(70-130)	--	--	"	
tert-Butylbenzene	"	0.0661	0.00055	0.0016	"	"	ND	0.0801	83%	(65-130)	--	--	"	
Chlorodibromomethane	"	0.0851	0.00022	0.0016	"	"	ND	0.0793	107%	"	--	--	"	
Dibromomethane	"	0.0889	0.00017	0.0016	"	"	ND	0.0798	111%	(75-130)	--	--	"	
1,1-Dichloropropene	"	0.0719	0.00063	0.0016	"	"	ND	0.0805	89%	(70-135)	--	--	"	
Toluene	"	0.0742	0.00014	0.0016	"	"	0.00029	0.0809	91%	(70-125)	--	--	"	
1,2,4-Trichlorobenzene	"	0.0521	0.00062	0.0032	"	"	ND	0.0804	65%	(65-130)	--	--	"	
o-Xylene	"	0.0717	0.000086	0.0016	"	"	0.00012	0.0801	89%	(75-125)	--	--	"	
Chlorobenzene	"	0.0733	0.00029	0.0016	"	"	0.00035	0.0809	90%	"	--	--	"	
1,3-Dichlorobenzene	"	0.0608	0.00061	0.0016	"	"	ND	0.0808	75%	(70-125)	--	--	"	
1,2-Dichlorobenzene	"	0.0655	0.00056	0.0016	"	"	ND	"	81%	(75-120)	--	--	"	
1,1,1,2-Tetrachloroethane	"	0.0820	0.00014	0.0016	"	"	ND	0.0796	103%	(75-125)	--	--	"	
sec-Butylbenzene	"	0.0630	0.00055	0.0016	"	"	ND	0.0810	78%	(65-130)	--	--	"	
Ethylbenzene	"	0.0706	0.00024	0.0016	"	"	ND	0.0809	87%	(75-125)	--	--	"	
Isopropylbenzene	"	0.0616	0.00024	0.0016	"	"	ND	"	76%	(75-130)	--	--	"	
2,2-Dichloropropane	"	0.0692	0.00062	0.0016	"	"	ND	"	86%	(65-135)	--	--	"	
N-Propylbenzene	"	0.0607	0.00023	0.0016	"	"	ND	0.0810	75%	"	--	--	"	
1,4-Dichlorobenzene	"	0.0595	0.00064	0.0016	"	"	ND	0.0809	74%	(70-125)	--	--	"	
1,3-Dichloropropane	"	0.0841	0.00035	0.0016	"	"	ND	0.0805	104%	(75-125)	--	--	"	

Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*Recovery:*	*104%*	*Limits: 85-120%*	"	*09/22/09 17:21*
	Toluene-d8 (Surr)		*99%*	*85-115%*	"	"
	Trifluorotoluene (Surr)		*90%*	*75-125%*	"	"
	1,2-Dichloroethane-d4 (Surr)		*100%*	*75-125%*	"	"

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50716-4)				**QC Source:**						**Extracted: 09/22/09 07:32**				
1,2,3-Trichloropropane	8260B STD Dry	ND	0.00036	0.0010	mg/Kg dry	1x	--	--	--	--	--	--	09/22/09 10:12	
1,1,2,2-Tetrachloroethane	"	ND	0.000088	0.0020	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	0.00024	0.0050	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.00032	0.0010	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	0.00029	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	0.00012	0.0010	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	0.000072	0.0010	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	0.000238	0.00017	0.0020	"	"	--	--	--	--	--	--	"	J
Bromomethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.00014	0.0050	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.00020	0.0010	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.00035	0.0020	"	"	--	--	--	--	--	--	"	
Benzene	"	0.0000982	0.000079	0.0010	"	"	--	--	--	--	--	--	"	J
cis-1,2-Dichloroethene	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	0.00025	0.0010	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.00033	0.0010	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50716-4)				**QC Source:**					**Extracted: 09/22/09 07:32**					
2-Chlorotoluene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Toluene	"	0.0000902	0.000085	0.0010	"	"	--	--	--	--	--	--	"	J
1,2,4-Trichlorobenzene	"	ND	0.00038	0.0020	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	0.000053	0.0010	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	0.000309	0.00018	0.0010	"	"	--	--	--	--	--	--	"	J
1,3-Dichlorobenzene	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.00035	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.000087	0.0010	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.00040	0.0010	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	0.00022	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 100%*		*Limits: 85-120%*	"								*09/22/09 10:12*	
Toluene-d8 (Surr)		*100%*		*85-115%*	"								"	
Trifluorotoluene (Surr)		*99%*		*75-125%*	"								"	
1,2-Dichloroethane-d4 (Surr)		*110%*		*75-125%*	"								"	
Blank (580-50716-5)				**QC Source:**					**Extracted: 09/22/09 07:32**					
1,1,2,2-Tetrachloroethane	8260B STD Dry	ND	0.000088	0.0020	mg/Kg dry	1x	--	--	--	--	--	--	09/22/09 10:36	
Naphthalene	"	ND	0.00024	0.0050	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	0.00036	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	0.00018	0.0020	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	0.00032	0.0010	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	0.00027	0.0010	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	
Chloromethane	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	0.00029	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	0.00017	0.0010	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	0.00016	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50716-5)				**QC Source:**						**Extracted: 09/22/09 07:32**				
cis-1,3-Dichloropropene	8260B STD Dry	ND	0.00012	0.0010	mg/Kg dry	1x	--	--	--	--	--	--	09/22/09 10:36	
Bromoform	"	ND	0.000072	0.0010	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	0.000074	0.0010	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	ND	0.00017	0.0020	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	0.00037	0.0010	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	0.00014	0.0050	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	0.00020	0.0010	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	0.00018	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,3,5-Trimethylbenzene	"	ND	0.00035	0.0020	"	"	--	--	--	--	--	--	"	
Dichlorodifluoromethane	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	0.000079	0.0010	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	0.00019	0.0010	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	0.00013	0.0010	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	0.00016	0.0020	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	0.00025	0.0010	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	0.00031	0.0010	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	0.00033	0.0010	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	0.00010	0.0010	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	0.00039	0.0010	"	"	--	--	--	--	--	--	"	
Toluene	"	0.000125	0.000085	0.0010	"	"	--	--	--	--	--	--	"	J
1,2,4-Trichlorobenzene	"	ND	0.00038	0.0020	"	"	--	--	--	--	--	--	"	
o-Xylene	"	ND	0.000053	0.0010	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	0.000308	0.00018	0.0010	"	"	--	--	--	--	--	--	"	J
1,3-Dichlorobenzene	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	0.00035	0.0010	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	0.000087	0.0010	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-50716-5)				QC Source:					Extracted: 09/22/09 07:32					
sec-Butylbenzene	"	ND	0.00034	0.0010	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	0.00015	0.0010	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	0.00038	0.0010	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	0.00014	0.0010	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	0.00040	0.0010	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	0.00022	0.0010	"	"	--	--	--	--	--	--	"	
Surrogate(s): 4-Bromofluorobenzene (Surr)		*Recovery: 100%*			*Limits: 85-120%*	"							*09/22/09 10:36*	
Toluene-d8 (Surr)		*98%*			*85-115%*	"							"	
Trifluorotoluene (Surr)		*96%*			*75-125%*	"							"	
1,2-Dichloroethane-d4 (Surr)		*105%*			*75-125%*	"							"	
LCS (580-50716-7)				QC Source:					Extracted: 09/22/09 07:32					
1,1,2,2-Tetrachloroethane	8260B STD Dry	0.0509	0.000088	0.0020	mg/Kg dry	1x	--	0.0492	103%	(55-130)	--	--	09/22/09 11:24	
1,2,3-Trichloropropane	"	0.0547	0.00036	0.0010	"	"	--	0.0493	111%	(65-130)	--	--	"	
Naphthalene	"	0.0586	0.00024	0.0050	"	"	--	0.0500	117%	(40-125)	--	--	"	
Chloroethane	"	0.0394	0.00027	0.0010	"	"	--	0.0501	79%	(40-155)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	0.0538	0.00018	0.0020	"	"	--	0.0500	108%	(40-135)	--	--	"	
Styrene	"	0.0528	0.00032	0.0010	"	"	--	0.0499	106%	(75-125)	--	--	"	
4-Chlorotoluene	"	0.0441	0.00039	0.0010	"	"	--	0.0493	89%	"	--	--	"	
Chloroform	"	0.0516	0.00015	0.0010	"	"	--	0.0499	103%	(70-125)	--	--	"	
1,2-Dichloroethane	"	0.0537	0.00016	0.0010	"	"	--	0.0500	107%	(70-135)	--	--	"	
Chloromethane	"	0.0539	0.00018	0.0010	"	"	--	"	108%	(50-130)	--	--	"	
trans-1,2-Dichloroethene	"	0.0475	0.00029	0.0010	"	"	--	"	95%	(65-135)	--	--	"	
1,2-Dichloropropane	"	0.0514	0.00017	0.0010	"	"	--	"	103%	(70-120)	--	--	"	
cis-1,3-Dichloropropene	"	0.0509	0.00012	0.0010	"	"	--	0.0526	97%	(70-125)	--	--	"	
Bromoform	"	0.0520	0.000072	0.0010	"	"	--	0.0496	105%	(55-135)	--	--	"	
Bromobenzene	"	0.0499	0.00016	0.0010	"	"	--	0.0498	100%	(65-120)	--	--	"	
Dichlorobromomethane	"	0.0543	0.000074	0.0010	"	"	--	0.0500	108%	(70-130)	--	--	"	
Bromomethane	"	0.0545	0.00038	0.0010	"	"	--	"	109%	(30-160)	--	--	"	
1,2,3-Trichlorobenzene	"	0.0501	0.00017	0.0020	"	"	--	"	100%	(60-135)	--	--	"	
Ethylene Dibromide	"	0.0547	0.00013	0.0010	"	"	--	0.0495	111%	(70-125)	--	--	"	
1,1-Dichloroethene	"	0.0422	0.00014	0.0050	"	"	--	"	85%	(65-135)	--	--	"	
Carbon tetrachloride	"	0.0484	0.00037	0.0010	"	"	--	0.0500	97%	"	--	--	"	
trans-1,3-Dichloropropene	"	0.0488	0.00018	0.0010	"	"	--	0.0475	103%	(65-125)	--	--	"	
Hexachlorobutadiene	"	0.0438	0.00034	0.0010	"	"	--	0.0490	89%	(55-140)	--	--	"	
Trichlorofluoromethane	"	0.0440	0.00020	0.0010	"	"	--	0.0495	89%	(25-185)	--	--	"	
1,1,2-Trichloroethane	"	0.0536	0.00010	0.0010	"	"	--	0.0493	109%	(60-125)	--	--	"	
4-Isopropyltoluene	"	0.0429	0.00031	0.0010	"	"	--	0.0497	86%	(75-135)	--	--	"	

TestAmerica Spokane

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

Randee Decker, Project Manager

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 50646 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-50716-7)				**QC Source:**					**Extracted: 09/22/09 07:32**					
Trichloroethene	8260B STD Dry	0.0483	0.00018	0.0010	mg/Kg dry	1x	--	0.0500	96%	(75-125)	--	--	09/22/09 11:24	
1,3,5-Trimethylbenzene	"	0.0462	0.00035	0.0020	"	"	--	0.0494	93%	(65-135)	--	--	"	
Dichlorodifluoromethane	"	0.0529	0.00019	0.0010	"	"	--	0.0492	107%	(35-135)	--	--	"	
1,1,1-Trichloroethane	"	0.0479	0.00038	0.0010	"	"	--	0.0500	96%	(70-135)	--	--	"	
Benzene	"	0.0477	0.000079	0.0010	"	"	--	"	95%	(75-125)	--	--	"	
cis-1,2-Dichloroethene	"	0.0546	0.00013	0.0010	"	"	--	"	109%	(65-125)	--	--	"	
Methylene Chloride	"	0.0488	0.00019	0.0010	"	"	--	"	98%	(55-140)	--	--	"	
m-Xylene & p-Xylene	"	0.0940	0.00016	0.0020	"	"	--	0.100	94%	(80-125)	--	--	"	
n-Butylbenzene	"	0.0430	0.00031	0.0010	"	"	--	0.0497	87%	(65-140)	--	--	"	
Chlorobromomethane	"	0.0548	0.00025	0.0010	"	"	--	0.0496	110%	(70-125)	--	--	"	
1,2,4-Trimethylbenzene	"	0.0460	0.00033	0.0010	"	"	--	0.0497	93%	(65-135)	--	--	"	
Vinyl chloride	"	0.0484	0.00015	0.0010	"	"	--	0.0500	97%	(60-125)	--	--	"	
Tetrachloroethene	"	0.0398	0.00010	0.0010	"	"	--	"	79%	(65-140)	--	--	"	
1,1-Dichloroethane	"	0.0488	0.00039	0.0010	"	"	--	0.0498	98%	(75-125)	--	--	"	
tert-Butylbenzene	"	0.0467	0.00034	0.0010	"	"	--	0.0495	94%	(65-130)	--	--	"	
2-Chlorotoluene	"	0.0503	0.00015	0.0010	"	"	--	0.0494	102%	(70-130)	--	--	"	
Chlorodibromomethane	"	0.0566	0.00014	0.0010	"	"	--	0.0490	115%	(65-130)	--	--	"	
Dibromomethane	"	0.0574	0.00010	0.0010	"	"	--	0.0493	116%	(75-130)	--	--	"	
1,1-Dichloropropene	"	0.0475	0.00039	0.0010	"	"	--	0.0498	95%	(70-135)	--	--	"	
Toluene	"	0.0488	0.000085	0.0010	"	"	--	0.0500	98%	(70-125)	--	--	"	
1,2,4-Trichlorobenzene	"	0.0467	0.00038	0.0020	"	"	--	0.0497	94%	(65-130)	--	--	"	
o-Xylene	"	0.0472	0.000053	0.0010	"	"	--	0.0495	95%	(75-125)	--	--	"	
Chlorobenzene	"	0.0486	0.00018	0.0010	"	"	--	0.0500	97%	"	--	--	"	
1,3-Dichlorobenzene	"	0.0460	0.00038	0.0010	"	"	--	"	92%	(70-125)	--	--	"	
1,2-Dichlorobenzene	"	0.0484	0.00035	0.0010	"	"	--	0.0499	97%	(75-120)	--	--	"	
1,1,1,2-Tetrachloroethane	"	0.0530	0.000087	0.0010	"	"	--	0.0492	108%	(75-125)	--	--	"	
sec-Butylbenzene	"	0.0457	0.00034	0.0010	"	"	--	0.0500	91%	(65-130)	--	--	"	
Ethylbenzene	"	0.0474	0.00015	0.0010	"	"	--	"	95%	(75-125)	--	--	"	
Isopropylbenzene	"	0.0417	0.00015	0.0010	"	"	--	"	83%	(75-130)	--	--	"	
2,2-Dichloropropane	"	0.0461	0.00038	0.0010	"	"	--	"	92%	(65-135)	--	--	"	
N-Propylbenzene	"	0.0441	0.00014	0.0010	"	"	--	"	88%	"	--	--	"	
1,4-Dichlorobenzene	"	0.0463	0.00040	0.0010	"	"	--	"	93%	(70-125)	--	--	"	
1,3-Dichloropropane	"	0.0542	0.00022	0.0010	"	"	--	0.0498	109%	(75-125)	--	--	"	

Surrogate(s):	*4-Bromofluorobenzene (Surr)*	*Recovery:*	*101%*	*Limits:*	*85-120%*	*" 09/22/09 11:24*
	Toluene-d8 (Surr)		*99%*		*85-115%*	*"*
	Trifluorotoluene (Surr)		*95%*		*75-125%*	*"*
	1,2-Dichloroethane-d4 (Surr)		*101%*		*75-125%*	*"*

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51093 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-51100-4)				**QC Source:**					**Extracted: 09/29/09 14:54**					
Chloromethane	8260B STD	ND	60	400	ug/Kg	1x	--	--	--	--	--	--	09/29/09 19:20	
Dichlorodifluoromethane	"	ND	8.0	40	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethane	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
Vinyl chloride	"	ND	1.7	8.0	"	"	--	--	--	--	--	--	"	
Bromomethane	"	ND	25	140	"	"	--	--	--	--	--	--	"	
2,2-Dichloropropane	"	ND	3.7	40	"	"	--	--	--	--	--	--	"	
cis-1,2-Dichloroethene	"	ND	2.4	40	"	"	--	--	--	--	--	--	"	
Chloroethane	"	ND	23	400	"	"	--	--	--	--	--	--	"	
Chlorobromomethane	"	ND	12	40	"	"	--	--	--	--	--	--	"	
Trichlorofluoromethane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
1,1-Dichloroethene	"	ND	5.0	20	"	"	--	--	--	--	--	--	"	
Chloroform	"	ND	2.1	40	"	"	--	--	--	--	--	--	"	
1,1,1-Trichloroethane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Methylene Chloride	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
Carbon tetrachloride	"	ND	3.7	20	"	"	--	--	--	--	--	--	"	
trans-1,2-Dichloroethene	"	ND	3.5	40	"	"	--	--	--	--	--	--	"	
Benzene	"	ND	2.5	16	"	"	--	--	--	--	--	--	"	
1,1-Dichloropropene	"	ND	1.8	40	"	"	--	--	--	--	--	--	"	
1,2-Dichloroethane	"	ND	2.2	40	"	"	--	--	--	--	--	--	"	
trans-1,3-Dichloropropene	"	ND	4.0	16	"	"	--	--	--	--	--	--	"	
1,1,2-Trichloroethane	"	ND	1.8	12	"	"	--	--	--	--	--	--	"	
Trichloroethene	"	ND	3.4	16	"	"	--	--	--	--	--	--	"	
1,2-Dichloropropane	"	ND	3.9	12	"	"	--	--	--	--	--	--	"	
Tetrachloroethene	"	ND	2.1	20	"	"	--	--	--	--	--	--	"	
1,3-Dichloropropane	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Dibromomethane	"	ND	4.0	40	"	"	--	--	--	--	--	--	"	
Dichlorobromomethane	"	ND	3.0	40	"	"	--	--	--	--	--	--	"	
Chlorodibromomethane	"	ND	8.0	40	"	"	--	--	--	--	--	--	"	
Ethylene Dibromide	"	ND	3.2	40	"	"	--	--	--	--	--	--	"	
cis-1,3-Dichloropropene	"	ND	2.4	16	"	"	--	--	--	--	--	--	"	
Chlorobenzene	"	ND	2.3	40	"	"	--	--	--	--	--	--	"	
Toluene	"	ND	2.4	40	"	"	--	--	--	--	--	--	"	
1,1,1,2-Tetrachloroethane	"	ND	4.8	40	"	"	--	--	--	--	--	--	"	
Ethylbenzene	"	ND	3.7	40	"	"	--	--	--	--	--	--	"	
1,1,2,2-Tetrachloroethane	"	ND	3.3	10	"	"	--	--	--	--	--	--	"	
N-Propylbenzene	"	ND	2.8	40	"	"	--	--	--	--	--	--	"	
1,2,3-Trichloropropane	"	ND	12	40	"	"	--	--	--	--	--	--	"	
m-Xylene & p-Xylene	"	ND	7.8	40	"	"	--	--	--	--	--	--	"	
2-Chlorotoluene	"	ND	5.4	40	"	"	--	--	--	--	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name: **Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number: 073-93312-03	Report Created:
Redmond, WA 98077	Project Manager: Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51093 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
Blank (580-51100-4)				**QC Source:**					**Extracted: 09/29/09 14:54**					
o-Xylene	8260B STD	ND	2.3	40	ug/Kg	1x	--	--	--	--	--	--	09/29/09 19:20	
1,3,5-Trimethylbenzene	"	ND	4.2	40	"	"	--	--	--	--	--	--	"	
Styrene	"	ND	3.8	40	"	"	--	--	--	--	--	--	"	
Bromoform	"	ND	11	40	"	"	--	--	--	--	--	--	"	
4-Chlorotoluene	"	ND	13	40	"	"	--	--	--	--	--	--	"	
Isopropylbenzene	"	ND	1.8	40	"	"	--	--	--	--	--	--	"	
tert-Butylbenzene	"	ND	3.2	40	"	"	--	--	--	--	--	--	"	
Bromobenzene	"	ND	2.7	40	"	"	--	--	--	--	--	--	"	
1,2,4-Trimethylbenzene	"	ND	2.1	40	"	"	--	--	--	--	--	--	"	
1,3-Dichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
sec-Butylbenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
4-Isopropyltoluene	"	ND	2.8	40	"	"	--	--	--	--	--	--	"	
Hexachlorobutadiene	"	ND	5.6	40	"	"	--	--	--	--	--	--	"	
1,4-Dichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Naphthalene	"	ND	6.0	40	"	"	--	--	--	--	--	--	"	
n-Butylbenzene	"	ND	7.3	40	"	"	--	--	--	--	--	--	"	
1,2-Dichlorobenzene	"	ND	2.6	40	"	"	--	--	--	--	--	--	"	
1,2-Dibromo-3-Chloropropane	"	ND	66	200	"	"	--	--	--	--	--	--	"	
1,2,4-Trichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
1,2,3-Trichlorobenzene	"	ND	5.0	40	"	"	--	--	--	--	--	--	"	
Surrogate(s): Fluorobenzene (Surr)		*Recovery: 103%*			*Limits: 75-125%*	"							*09/29/09 19:20*	
Toluene-d8 (Surr)		*100%*			*85-115%*	"							"	
Ethylbenzene-d10		*107%*			*75-125%*	"							"	
4-Bromofluorobenzene (Surr)		*100%*			*85-120%*	"							"	
Trifluorotoluene (Surr)		*92%*			*75-125%*	"							"	
LCS (580-51100-5)				**QC Source:**					**Extracted: 09/29/09 14:54**					
Chloromethane	8260B STD	684	60	400	ug/Kg	1x	--	800	85%	(50-130)	--	--	09/29/09 19:44	
Dichlorodifluoromethane	"	824	8.0	40	"	"	--	787	105%	(35-135)	--	--	"	
Vinyl chloride	"	794	1.7	8.0	"	"	--	800	99%	(60-125)	--	--	"	
1,1-Dichloroethane	"	864	3.8	40	"	"	--	797	108%	(75-125)	--	--	"	
2,2-Dichloropropane	"	988	3.7	40	"	"	--	800	124%	(65-135)	--	--	"	
Bromomethane	"	486	25	140	"	"	--	"	61%	(30-160)	--	--	"	
Chloroethane	"	451	23	400	"	"	--	802	56%	(40-155)	--	--	"	
cis-1,2-Dichloroethene	"	848	2.4	40	"	"	--	800	106%	(65-125)	--	--	"	
Chlorobromomethane	"	804	12	40	"	"	--	794	101%	(70-125)	--	--	"	
Trichlorofluoromethane	"	809	5.0	40	"	"	--	792	102%	(25-185)	--	--	"	
1,1-Dichloroethene	"	873	5.0	20	"	"	--	"	110%	(65-135)	--	--	"	
Chloroform	"	715	2.1	40	"	"	--	799	89%	(70-125)	--	--	"	
1,1,1-Trichloroethane	"	717	5.0	40	"	"	--	800	90%	(70-135)	--	--	"	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51093 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-51100-5)				**QC Source:**					**Extracted: 09/29/09 14:54**					
Methylene Chloride	"	817	3.8	40	"	"	--	"	102%	(55-140)	--	--	"	
trans-1,2-Dichloroethene	"	833	3.5	40	"	"	--	"	104%	(65-135)	--	--	"	
Carbon tetrachloride	"	703	3.7	20	"	"	--	"	88%	"	--	--	"	
Benzene	"	836	2.5	16	"	"	--	"	104%	(75-125)	--	--	"	
1,1-Dichloropropene	"	831	1.8	40	"	"	--	796	104%	(70-135)	--	--	"	
1,2-Dichloroethane	"	793	2.2	40	"	"	--	800	99%	"	--	--	"	
trans-1,3-Dichloropropene	"	662	4.0	16	"	"	--	760	87%	(65-125)	--	--	"	
Trichloroethene	"	853	3.4	16	"	"	--	801	107%	(75-125)	--	--	"	
1,1,2-Trichloroethane	"	704	1.8	12	"	"	--	789	89%	(60-125)	--	--	"	
Tetrachloroethene	"	1100	2.1	20	"	"	--	801	137%	(65-140)	--	--	"	
1,2-Dichloropropane	"	953	3.9	12	"	"	--	800	119%	(70-120)	--	--	"	
Dibromomethane	"	810	4.0	40	"	"	--	789	103%	(75-130)	--	--	"	
1,3-Dichloropropane	"	806	5.0	40	"	"	--	796	101%	(75-125)	--	--	"	
Dichlorobromomethane	"	642	3.0	40	"	"	--	800	80%	(70-130)	--	--	"	
Chlorodibromomethane	"	597	8.0	40	"	"	--	784	76%	(65-130)	--	--	"	
Ethylene Dibromide	"	698	3.2	40	"	"	--	792	88%	(70-125)	--	--	"	
cis-1,3-Dichloropropene	"	700	2.4	16	"	"	--	841	83%	"	--	--	"	
Toluene	"	795	2.4	40	"	"	--	800	99%	"	--	--	"	
Chlorobenzene	"	739	2.3	40	"	"	--	"	92%	(75-125)	--	--	"	
1,1,1,2-Tetrachloroethane	"	710	4.8	40	"	"	--	787	90%	"	--	--	"	
Ethylbenzene	"	818	3.7	40	"	"	--	800	102%	"	--	--	"	
N-Propylbenzene	"	679	2.8	40	"	"	--	801	85%	(65-135)	--	--	"	
1,1,2,2-Tetrachloroethane	"	669	3.3	10	"	"	--	787	85%	(55-130)	--	--	"	
m-Xylene & p-Xylene	"	1480	7.8	40	"	"	--	1600	93%	(80-125)	--	--	"	
1,2,3-Trichloropropane	"	810	12	40	"	"	--	788	103%	(65-130)	--	--	"	
o-Xylene	"	736	2.3	40	"	"	--	792	93%	(75-125)	--	--	"	
2-Chlorotoluene	"	777	5.4	40	"	"	--	791	98%	(70-130)	--	--	"	
Styrene	"	811	3.8	40	"	"	--	798	102%	(75-125)	--	--	"	
1,3,5-Trimethylbenzene	"	701	4.2	40	"	"	--	791	89%	(65-135)	--	--	"	
4-Chlorotoluene	"	704	13	40	"	"	--	788	89%	(75-125)	--	--	"	
Bromoform	"	594	11	40	"	"	--	794	75%	(55-135)	--	--	"	
Isopropylbenzene	"	640	1.8	40	"	"	--	800	80%	(75-130)	--	--	"	
tert-Butylbenzene	"	680	3.2	40	"	"	--	792	86%	(65-130)	--	--	"	
Bromobenzene	"	812	2.7	40	"	"	--	797	102%	(65-120)	--	--	"	
1,2,4-Trimethylbenzene	"	734	2.1	40	"	"	--	796	92%	(65-135)	--	--	"	
1,3-Dichlorobenzene	"	763	5.0	40	"	"	--	799	95%	(70-125)	--	--	"	
sec-Butylbenzene	"	729	5.0	40	"	"	--	801	91%	(65-130)	--	--	"	
Hexachlorobutadiene	"	763	5.6	40	"	"	--	785	97%	(55-140)	--	--	"	
4-Isopropyltoluene	"	715	2.8	40	"	"	--	796	90%	(75-135)	--	--	"	

TestAmerica Spokane

Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Volatile Organic Compounds (GC/MS) - Laboratory Quality Control Results

TestAmerica Tacoma

QC Batch: 51093 **Soil Preparation Method: 5035**

Analyte	Method	Result	MDL*	MRL	Units	Dil	Source Result	Spike Amt	% REC	(Limits)	% RPD	(Limits)	Analyzed	Notes
LCS (580-51100-5)				**QC Source:**					**Extracted: 09/29/09 14:54**					
1,4-Dichlorobenzene	8260B STD	711	5.0	40	ug/Kg	1x	--	800	89%	(70-125)	--	--	09/29/09 19:44	
Naphthalene	"	722	6.0	40	"	"	--	801	90%	(40-125)	--	--	"	
n-Butylbenzene	"	776	7.3	40	"	"	--	796	97%	(65-140)	--	--	"	
1,2-Dichlorobenzene	"	687	2.6	40	"	"	--	799	86%	(75-120)	--	--	"	
1,2-Dibromo-3-Chloropropane	"	610	66	200	"	"	--	800	76%	(40-135)	--	--	"	
1,2,4-Trichlorobenzene	"	682	5.0	40	"	"	--	795	86%	(65-130)	--	--	"	
1,2,3-Trichlorobenzene	"	669	5.0	40	"	"	--	801	83%	(60-135)	--	--	"	
Surrogate(s):	*Fluorobenzene (Surr)*	*Recovery:*	*100%*		*Limits:*	*75-125%*	*"*						*09/29/09 19:44*	
	Toluene-d8 (Surr)		*102%*			*85-115%*	*"*						*"*	
	Ethylbenzene-d10		*102%*			*75-125%*	*"*						*"*	
	4-Bromofluorobenzene (Surr)		*102%*			*85-120%*	*"*						*"*	
	Trifluorotoluene (Surr)		*90%*			*75-125%*	*"*						*"*	

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Method Performed: 6010B TMP Dry
Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: 6010B Total Recoverable
Samples: SSI0049-09

Method Performed: 6020 TMP Dry
Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: 6020 Total Recoverable
Samples: SSI0049-09

Method Performed: 7470A
Samples: SSI0049-09

Method Performed: 7471A Dry
Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: 8082 STD
Samples: SSI0049-09

Method Performed: 8260B STD
Samples: SSI0049-19

Method Performed: 8260B STD Dry
Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: 8270C STD
Samples: SSI0049-09

Method Performed: 8270C STD Dry

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

CERTIFICATION SUMMARY

Subcontracted Laboratories

TestAmerica Tacoma

5755 8th Street East - Tacoma, WA 98424

Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Method Performed: Moisture

Samples: SSI0049-01, SSI0049-02, SSI0049-03, SSI0049-04, SSI0049-05, SSI0049-06, SSI0049-07, SSI0049-08, SSI0049-10, SSI0049-11, SSI0049-12, SSI0049-13, SSI0049-14, SSI0049-15, SSI0049-16, SSI0049-17, SSI0049-18

Any abnormalities or departures from sample acceptance policy shall be documented on the 'Sample Receipt and Temperature Log Form' and 'Sample Non-conformance Form' (if applicable) included with this report.

For information concerning certifications of this facility or another TestAmerica facility, please visit our website at www.TestAmericaInc.com

Samples collected by TestAmerica Field Services personnel are noted on the Chain of Custody (COC) .

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Notes and Definitions

Report Specific Notes:

*	-	LCS or LCSD exceeds the control limits
^	-	ICV,CCV,ICB,CCB, ISA, ISB, CRI, CRA, DLCK or MRL standard: Instrument related QC exceeds the control limits.
4	-	MS, MSD: The analyte present in the original sample is 4 times greater than the matrix spike concentration; therefore, control limits are not applicable.
B	-	Compound was found in the blank and sample.
C7	-	Calibration Verification recovery was below the method control limit due to matrix interference carried over from analytical samples. The matrix interference was confirmed by reanalysis with the same result.
D	-	Surrogate or matrix spike recoveries were not obtained because the extract was diluted for analysis; also compounds analyzed at a dilution may be flagged with a D.
F	-	Duplicate RPD exceeds the control limit
H	-	Sample was prepped or analyzed beyond the specified holding time
I01	-	Internal Standard recovery was below method limits. Matrix interference was confirmed by reanalysis. A high bias to the analyte result is indicated.
J	-	Result is less than the RL but greater than or equal to the MDL and the concentration is an approximate value.
M1	-	The MS and/or MSD were above the acceptance limits due to sample matrix interference. See Blank Spike (LCS).
R3	-	The RPD exceeded the acceptance limit due to sample matrix effects.
X	-	Surrogate exceeds the control limits
Z	-	Due to sample matrix effects, the surrogate recovery was below the acceptance limits.
Z3	-	The sample required a dilution due to the nature of the sample matrix. Because of this dilution, the surrogate spike concentration in the sample was reduced to a level where the recovery calculation does not provide useful information.
ZX	-	Due to sample matrix effects, the surrogate recovery was outside the acceptance limits.

Laboratory Reporting Conventions:

DET	-	Analyte DETECTED at or above the Reporting Limit. Qualitative Analyses only.
ND	-	Analyte NOT DETECTED at or above the reporting limit (MDL or MRL, as appropriate).
NR/NA	-	Not Reported / Not Available
dry	-	Sample results reported on a Dry Weight Basis. Results and Reporting Limits have been corrected for Percent Dry Weight.
wet	-	Sample results and reporting limits reported on a Wet Weight Basis (as received). Results with neither 'wet' nor 'dry' are reported on a Wet Weight Basis.
RPD	-	RELATIVE PERCENT DIFFERENCE (RPDs calculated using Results, not Percent Recoveries).
MRL	-	METHOD REPORTING LIMIT. Reporting Level at, or above, the lowest level standard of the Calibration Table.
MDL*	-	METHOD DETECTION LIMIT. Reporting Level at, or above, the statistically derived limit based on 40CFR, Part 136, Appendix B. *MDLs are listed on the report only if the data has been evaluated below the MRL. Results between the MDL and MRL are reported as Estimated Results.
Dil	-	Dilutions are calculated based on deviations from the standard dilution performed for an analysis, and may not represent the dilution found on the analytical raw data.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica
THE LEADER IN ENVIRONMENTAL TESTING

SPOKANE, WA 11922 E. 1ST AVENUE
SPOKANE VALLEY, WA 99206-5302
ph: (509) 924.9200 fax: (509) 924.9290

Golder Associates, Inc.	Project Name:	**Avery Landing**	
18300 NE Union Hill Rd. Suite 200	Project Number:	073-93312-03	Report Created:
Redmond, WA 98077	Project Manager:	Doug Morell	10/28/09 14:26

Reporting Limits - Reporting limits (MDLs and MRLs) are adjusted based on variations in sample preparation amounts, analytical dilutions and percent solids, where applicable.

Electronic Signature - Electronic Signature added in accordance with TestAmerica's *Electronic Reporting and Electronic Signatures Policy.* Application of electronic signature indicates that the report has been reviewed and approved for release by the laboratory. Electronic signature is intended to be the legally binding equivalent of a traditionally handwritten signature.

TestAmerica Spokane



Randee Decker, Project Manager

The results in this report apply to the samples analyzed in accordance with the chain of custody document. This analytical report must be reproduced in its entirety.

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290 X
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: 8SI0049

CLIENT: Golder Associates

REPORT TO: Doug Morell cc: Kirsi Longley
ADDRESS: 18300 Union Hill Road, Suite 200
Redmond WA 98052
PHONE: 425-883-0777 FAX:

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: 10 STD. | 7 | 5 | 4 | 3 | 2 | 1 | <1

Petroleum Hydrocarbon Analyses: 5 STD. | 4 | 3 | 2 | 1 | <1

OTHER Specify:

* Turnaround Requests less than standard may incur Rush Charges.

PRESERVATIVE: HCL | — | MeOH Sol. BiSulf. | — | — | Nitric

REQUESTED ANALYSES: TPH-Dx extended | PCB (8082A) low level | TCL VOC's (8260B low) | PAH (8270 SIM) | TCL SVOC (8270C low) | TAL metals

	CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1	G-RS1SED-4-090709	9/7/09 1350	S	5		-01
2	G-RS1SED-0-090709	1355	S	5		-02
3	G-RS8SED-3-090709	1445	S	5		-03
4	G-RS8SED-0-090709	1450	S	5		-04
5	G-RS7SED-0-090709	1530	S	5		-05
6	G-RS7SED-4-090709	1525	S	5		-06
7	G-RS2SED-3-090709	1615	S	5		-07
8	G-RS2SED-0-090709	1620	S	5		-08
9	G-EB-090709	1700	W	6		-09
10	G-RS5SED-0-090809	9/8/09 830	S	5		-10

RELEASED BY: Kirsi Longley DATE: 9/9/09
PRINT NAME: Kirsi Longley FIRM: Golder Assoc. TIME: 704
RECEIVED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzy Bartosik FIRM: Golder TIME: 730

RELEASED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzi Bartosik FIRM: Golder TIME: 930
RECEIVED BY: DATE: 9/9/09
PRINT NAME: Chris Will FIRM: TA-Spokane TIME: 0930

ADDITIONAL REMARKS:

TEMP: 5.3

TAL-1000(0408)

TestAmerica

THE LEADER IN ENVIRONMENTAL TESTING

11720 North Creek Pkwy N Suite 400, Bothell, WA 98011-8244 425-420-9200 FAX 420-9210
11922 E. First Ave, Spokane, WA 99206-5302 509-924-9200 FAX 924-9290
9405 SW Nimbus Ave,Beaverton, OR 97008-7145 503-906-9200 FAX 906-9210
2000 W International Airport Rd Ste A10, Anchorage, AK 99502-1119 907-563-9200 FAX 563-9210

CHAIN OF CUSTODY REPORT

Work Order #: BSI0049

CLIENT: Golder Associates

REPORT TO: Doug Morell & Kirsi Longley
ADDRESS: 18300 NE Union Hill Road

PHONE: 425-883-0777 FAX:

INVOICE TO: Accounting (same address)

P.O. NUMBER:

PROJECT NAME: Avery Landing
PROJECT NUMBER: 073-93312-03
SAMPLED BY: Kirsi Longley

TURNAROUND REQUEST in Business Days *

Organic & Inorganic Analyses: [10 STD.] [7] [5] [4] [3] [2] [1] [<1]

Petroleum Hydrocarbon Analyses: [5 STD.] [4] [3] [2] [1] [<1]

[OTHER] Specify:

* *Turnaround Requests less than standard may incur Rush Charges.*

PRESERVATIVE: — — — MeOH Soil — — — — — — — — —

REQUESTED ANALYSES: TPH-Dx extended | PCB (8082A) low level | PAH (8270 SIM) | TCL SVOC (8270C low) | TCL VOC's (8260B low) | TAL metals

CLIENT SAMPLE IDENTIFICATION	SAMPLING DATE/TIME	MATRIX (W, S, O)	# OF CONT.	LOCATION/ COMMENTS	TA WO ID
1 G-RS5SED-0-090809	9/8/09 835	S	5		-11
2 ~~G-RS6~~					
3 G-RS5SED-4-090809	845	S	5		-12
4 G-RS6SED-0-090809	740	S	15	extra volume ms/msD	-13
5 G-RS6SED-3-090809	735	S	5		-14
6 G-RS3SED-4-090809	1115	S	5		-15
7 G-RS3SED-0-090809	1110	S	5		-16
8 G-RS4SED-0-090809	1220	S	5		-17
9 G-RS4SED-4-090809	1225	S	5		-18
10 Trip Blank	— —	W	3		-19

RELEASED BY: K. Longley DATE: 9/9/09
PRINT NAME: K. Longley FIRM: Golder Assoc. TIME: 704
RECEIVED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzi Bartosik FIRM: Golder TIME: 730

RELEASED BY: L. Bartosik DATE: 9/9/09
PRINT NAME: Lizzi Bartosik FIRM: Golder TIME: 930
RECEIVED BY: Chris William DATE: 9/9/09
PRINT NAME: Chris William FIRM: TA Spokane TIME: 0930

ADDITIONAL REMARKS:

TEMP:

PAGE 2 OF 2

TAL-1000(0408)

Test America Cooler Receipt Form

WORK ORDER # SSI0019 **CLIENT:** Golder **PROJECT:** Avery

Date /Time Cooler Arrived 9/9/09 930 Cooler signed for by: C. Williams (Print name)

Preliminary Examination Phase:

Date cooler opened: ☒ same as date received *or* ____/____/____

Cooler opened by (print) C. Hanson (sign) [signature]

1. Delivered by ☐ ALASKA AIRLINES ☐ Fed-Ex ☐ UPS ☐ NAC ☐ LYNDEN ☐ CLIENT ☒ Other: Pickup

   Shipment Tracking # if applicable _____ (include copy of shipping papers in file)

2. Number of Custody Seals ~~0~~ 3 Signed by See Back Date ___/___/___

   Were custody seals unbroken and intact on arrival? ☒ Yes ☐ No RP 10/22/09

3. Were custody papers sealed in a plastic bag? ☐ Yes ☒ No

4. Were custody papers filled out properly (ink, signed, etc.)? ☒ Yes ☐ No

5. Did you sign the custody papers in the appropriate place? ☒ Yes ☐ No

6. Was ice used? ☒ Yes ☐ No Type of ice: ☐ blue ice ☐ gel ice ☒ real ice ☐ dry ice Condition of Ice: 1/2 melted

   Temperature by IR Gun 5.3 °C Thermometer Serial # 81500

   Acceptance Criteria: 0 - 6°C

7. Packing in Cooler: ☒ bubble wrap ☐ styrofoam ☐ cardboard ☐ Other: Bubble Bags

8. Did samples arrive in plastic bags? ☐ Yes ☒ No

9. Did all bottles arrive unbroken, and with labels in good condition? ☒ Yes ☐ No

10. Are all bottle labels complete (ID, date, time, etc.) ☒ Yes ☐ No

11. Do bottle labels and Chain of Custody agree? ☒ Yes ☐ No

12. Are the containers and preservatives correct for the tests indicated? ☒ Yes ☐ No

13. Is there adequate volume for the tests requested? ☒ Yes ☐ No

14. Were VOA vials free of bubbles? ☒ N/A ☐ Yes ☐ No

    If "No" which containers contained "head space" or bubbles? _____

Log-in Phase:

Date of sample log-in 9/9/09

Samples logged in by (print) C. Hanson (sign) [signature]

1. Was project identifiable from custody papers? ☒ Yes ☐ No

2. Do Turn Around Times and Due Dates agree? ☒ Yes ☐ No

3. Was the Project Manager notified of status? ☒ Yes ☐ No

4. Was the Lab notified of status? ☒ Yes ☐ No

5. Was the COC scanned and copied? ☒ Yes ☐ No

Golder Associates
Seal Number
13023

Sent By: K Langley
Date: 9/9/04