1198881 - R8 SDMS

Asarco

Randy,

Here's you a copy of the slag data that I faxed Rick Wilkin.

Linda Lawler

ANALYTICAL SUMMARY REPORT

May 02, 2005

Iver Johnson
MT DEQ
PO Box 200901
Helena, MT 59620

COPY

RECEIVED
MAY 0 5 2005
Dept. of Enviro. Quality
Waste & Underground
Tank Management Bureau

Workorder No.: H05040130

Project Name: ASARCO Slag Pile

Energy Laboratories Inc received the following 10 samples from MT DEQ on 4/14/2005 for analysis.

Sample ID	Client Sample ID	Collect Date	Receive Date	Matrix	Test
H05040130-001	ASP01-B3	04/14/05 14:15	04/14/05	Solid	Metals by ICP/ICPMS, Total Mercury in Solid By CVAA Digestion, Total Metals Digestion, Mercury by CVAA
H05040130-002	ASP02-B5	04/14/05 14:21	04/14/05	Solid	Same As Above
H05040130-003	ASP03-B14	04/14/05 14:28	04/14/05	Solid	Metals by ICP/ICPMS, Total Chloride, Sulfate Mercury in Solid By CVAA Moisture Moisture Polychlorinated Biphenyls (PCB's) pH Digestion, Total Metals Digestion, Mercury by CVAA Saturated Paste Extraction Sonication Extraction Soil Sonication Extraction Semi-Volatile Organic Compounds, PAHs Volatile Organics, Methanol Extraction 8260-Volatile Organic Compounds - Short List
H05040130-004	ASP04-C4	04/14/05 14:37	04/14/05	Solid	Metals by ICP/ICPMS, Total Mercury in Solid By CVAA Digestion, Total Metals Digestion, Mercury by CVAA
H05040130-005	ASP05-C9	04/14/05 14:44	04/14/05	Solid	Metals by ICP/ICPMS, Total Chloride, Sulfate Mercury in Solid By CVAA Moisture Moisture Polychlorinated Biphenyls (PCB's) pH Digestion, Total Metals Digestion, Mercury by CVAA Saturated Paste Extraction Sonication Extraction Soil Sonication Extraction Semi-Volatile Organic Compounds, PAHs Volatile Organics, Methanol Extraction 8260-Volatile Organic Compounds - Short List

H05040130-006	ASP06-D16	04/14/05 14:50	04/14/05	Solid	Metals by ICP/ICPMS, Total Mercury in Solid By CVAA Digestion, Total Metals Digestion, Mercury by CVAA
H05040130-007	ASP07-F3	04/14/05 14:57	04/14/05	Solid	Same As Above
H05040130-008	ASP08-G2	04/14/05 15:04	04/14/05	Solid	Metals by ICP/ICPMS, Total Chloride, Sulfate Mercury in Solid By CVAA Moisture Moisture Polychlorinated Biphenyls (PCB's) pH Digestion, Total Metals Digestion, Mercury by CVAA Saturated Paste Extraction Sonication Extraction Soil Sonication Extraction Semi-Volatile Organic Compounds, PAHs Volatile Organics, Methanol Extraction 8260-Volatile Organic Compounds - Short List
H05040130-009	ASP09-G4	04/14/05 15:07	04/14/05	Solid	Metals by ICP/ICPMS, Total Mercury in Solid By CVAA Digestion, Total Metals Digestion, Mercury by CVAA
H05040130-010	ASP10-H16	04/14/05 15:15	04/14/05	Solid	Same As Above

There were no problems with the analyses and all data for associated QC met EPA or laboratory specifications except where noted in the Case Narrative or Report.

If you have any questions regarding these tests results, please call.

Report Approved By: Deborah C. Grimm

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-001
Client Sample ID: ASP01-B3

Report Date: 05/02/05
Collection Date: 04/14/05 14:15
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	34.9	mg/kg		5.0		SW6020	04/27/05 00:49 / rlh
Arsenic	130	mg/kg		5.0		SW6020	04/27/05 00:49 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 03:48 / jjw
Cadmium	3.1	mg/kg		1.0		SW6010B	04/20/05 19:24 / jjw
Chromium	60.8	mg/kg		5.0		SW6010B	04/20/05 19:24 / jjw
Cobalt	164	mg/kg		5.0		SW6010B	04/20/05 19:24 / jjw
Iron	196000	mg/kg	D	40		SW6010B	04/20/05 19:28 / jjw
Lead	134	mg/kg		5.0		SW6010B	04/20/05 19:28 / jjw
Manganese	11400	mg/kg		5.0		SW6010B	04/22/05 03:48 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 13:51 / KC
Nickel	8.4	mg/kg		5.0		SW6010B	04/20/05 19:24 / jjw
Phosphorus	652	mg/kg		10		SW6010B	04/22/05 03:48 / jjw
Selenium	6.4	mg/kg		5.0		SW6020	04/27/05 00:49 / rlh
Zinc	13200	mg/kg		5.0		SW6010B	04/20/05 19:28 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-002
Client Sample ID: ASP02-B5

Report Date: 05/02/05
Collection Date: 04/14/05 14:21
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	MCL/ RL QCL	Method	Analysis Date / By
METALS, TOTAL						
Antimony	46.7	mg/kg		5.0	SW6020	04/27/05 00:56 / rlh
Arsenic	135	mg/kg		5.0	SW6020	04/27/05 00:56 / rlh
Beryllium	ND	mg/kg		5.0	SW6010B	04/22/05 03:51 / jjw
Cadmium	4.1	mg/kg		1.0	SW6010B	04/20/05 19:32 / jjw
Chromium	59.4	mg/kg		5.0	SW6010B	04/20/05 19:32 / jjw
Cobalt	207	mg/kg		5.0	SW6010B	04/20/05 19:32 / jjw
Iron	243000	mg/kg	D	80	SW6010B	04/22/05 03:51 / jjw
Lead	140	mg/kg		5.0	SW6010B	04/20/05 19:32 / jjw
Manganese	11700	mg/kg		5.0	SW6010B	04/22/05 03:51 / jjw
Mercury	ND	mg/kg		1.0	SW7471A	04/25/05 13:57 / KC
Nickel	20.4	mg/kg		5.0	SW6020	04/27/05 00:56 / rlh
Phosphorus	584	mg/kg		10	SW6010B	04/22/05 03:51 / jjw
Selenium	8.5	mg/kg		5.0	SW6020	04/27/05 00:56 / rlh
Zinc	16900	mg/kg		5.0	SW6010B	04/22/05 03:51 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-003
Client Sample ID: ASP03-B14

Report Date: 05/02/05
Collection Date: 04/14/05 14:28
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
PHYSICAL CHARACTERISTICS							
Moisture	0.500	wt%		0.0100		SW3550A	04/22/05 08:15 / MC
CHEMICAL CHARACTERISTICS							
pH, 1:2	8.6	s.u.		0.1		ASA10-3	04/25/05 16:18 / srm
Chloride, 1:2	1.99	mg/kg		1.00		ASA10-3	04/26/05 11:49 / qed
METALS, TOTAL							
Antimony	33.7	mg/kg		5.0		SW6020	04/27/05 01:03 / rlh
Arsenic	118	mg/kg		5.0		SW6020	04/27/05 01:03 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:02 / jjw
Cadmium	2.6	mg/kg		1.0		SW6010B	04/20/05 19:35 / jjw
Chromium	67.1	mg/kg		5.0		SW6010B	04/20/05 19:35 / jjw
Cobalt	117	mg/kg		5.0		SW6010B	04/20/05 19:35 / jjw
Iron	264000	mg/kg	D	80		SW6010B	04/22/05 04:02 / jjw
Lead	63.8	mg/kg		5.0		SW6010B	04/20/05 19:35 / jjw
Manganese	13200	mg/kg		5.0		SW6010B	04/22/05 04:02 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 13:59 / KC
Nickel	14.5	mg/kg		5.0		SW6020	04/27/05 01:03 / rlh
Phosphorus	612	mg/kg		10		SW6010B	04/22/05 04:02 / jjw
Selenium	8.4	mg/kg		5.0		SW6020	04/27/05 01:03 / rlh
Zinc	13500	mg/kg		5.0		SW6010B	04/22/05 04:02 / jjw
VOLATILE ORGANIC COMPOUNDS							
Bromoform	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Benzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Bromobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Bromochloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Bromodichloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Bromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Carbon tetrachloride	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Chlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Chloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
2-Chloroethyl vinyl ether	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Chloroform	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Chloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
2-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
4-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Chlorodibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,2-Dibromoethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Dibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,2-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-003
Client Sample ID: ASP03-B14

Report Date: 05/02/05
Collection Date: 04/14/05 14:28
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
VOLATILE ORGANIC COMPOUNDS							
1,3-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,4-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Dichlorodifluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,2-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
cis-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
trans-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,3-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
2,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
cis-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
trans-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Ethylbenzene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Methyl tert-butyl ether (MTBE)	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Methylene chloride	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Methyl ethyl ketone	ND	mg/kg		4.0		SW8260B	04/21/05 16:42 / trr
Styrene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1,1,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1,2,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Tetrachloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Toluene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1,1-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,1,2-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Trichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Trichlorofluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
1,2,3-Trichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Vinyl chloride	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
m+p-Xylenes	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
o-Xylene	ND	mg/kg		0.20		SW8260B	04/21/05 16:42 / trr
Surr: p-Bromofluorobenzene	134	%REC			78-160	SW8260B	04/21/05 16:42 / trr
Surr: Dibromofluoromethane	116	%REC			70-132	SW8260B	04/21/05 16:42 / trr
Surr: 1,2-Dichloroethane-d4	114	%REC			60-136	SW8260B	04/21/05 16:42 / trr
Surr: Toluene-d8	120	%REC			75-138	SW8260B	04/21/05 16:42 / trr
SEMI-VOLATILE ORGANIC COMPOUNDS							
Acenaphthene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Acenaphthylene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Benzo(a)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-003
Client Sample ID: ASP03-B14

Report Date: 05/02/05
Collection Date: 04/14/05 14:28
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
SEMI-VOLATILE ORGANIC COMPOUNDS							
Benzo(a)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Benzo(b)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Benzo(g,h,i)perylene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Benzo(k)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Chrysene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Dibenzo(a,h)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Fluorene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Indeno(1,2,3-cd)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Naphthalene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Phenanthrene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 13:56 / sm
Surr: 2-Fluorobiphenyl	82.5	%REC			30-115	SW8270C	04/21/05 13:56 / sm
Surr: Nitrobenzene-d5	83.7	%REC			23-120	SW8270C	04/21/05 13:56 / sm
Surr: Terphenyl-d14	98.6	%REC			18-137	SW8270C	04/21/05 13:56 / sm
POLYCHLORINATED BIPHENYLS (PCB'S)							
Aroclor 1016	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1221	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1232	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1242	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1248	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1254	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1260	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1262	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Aroclor 1268	ND	mg/kg		0.017		SW8082	04/24/05 03:13 / law
Surr: Decachlorobiphenyl	96.0	%REC			50-126	SW8082	04/24/05 03:13 / law
Surr: Tetrachloro-m-xylene	86.0	%REC			42-115	SW8082	04/24/05 03:13 / law

Sample extract received a Sulfuric Acid Clean-up (EPA Method 3665) and a Sulfur Clean-up (EPA Method 3660) prior to analysis

Report Definitions: RL - Analyte reporting limit. QCL - Quality control limit. MCL - Maximum contaminant level. ND - Not detected at the reporting limit.

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-004
Client Sample ID: ASP04-C4

Report Date: 05/02/05
Collection Date: 04/14/05 14:37
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	43.5	mg/kg		5.0		SW6020	04/27/05 01:10 / rlh
Arsenic	155	mg/kg		5.0		SW6020	04/27/05 01:10 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:06 / jjw
Cadmium	5.1	mg/kg		1.0		SW6010B	04/20/05 19:39 / jjw
Chromium	71.2	mg/kg		5.0		SW6010B	04/20/05 19:39 / jjw
Cobalt	212	mg/kg		5.0		SW6010B	04/20/05 19:39 / jjw
Iron	273000	mg/kg	D	80		SW6010B	04/22/05 04:06 / jjw
Lead	364	mg/kg		5.0		SW6010B	04/20/05 19:39 / jjw
Manganese	12200	mg/kg		5.0		SW6010B	04/22/05 04:06 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:01 / KC
Nickel	22.9	mg/kg		5.0		SW6020	04/27/05 01:10 / rlh
Phosphorus	586	mg/kg		10		SW6010B	04/22/05 04:06 / jjw
Selenium	12.1	mg/kg		5.0		SW6020	04/27/05 01:10 / rlh
Zinc	17900	mg/kg		5.0		SW6010B	04/22/05 04:06 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-005
Client Sample ID: ASP05-C9

Report Date: 05/02/05
Collection Date: 04/14/05 14:44
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
PHYSICAL CHARACTERISTICS							
Moisture	0.800	wt%		0.0100		SW3550A	04/22/05 08:15 / MC
CHEMICAL CHARACTERISTICS							
pH, 1:2	9.0	s.u.		0.1		ASA10-3	04/25/05 16:18 / srm
Chloride, 1:2	2.89	mg/kg		1.00		ASA10-3	04/26/05 12:13 / qsd
METALS, TOTAL							
Antimony	37.1	mg/kg		5.0		SW6020	04/27/05 01:44 / rlh
Arsenic	117	mg/kg		5.0		SW6020	04/27/05 01:44 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:13 / jjw
Cadmium	3.1	mg/kg		1.0		SW6010B	04/20/05 19:42 / jjw
Chromium	74.4	mg/kg		5.0		SW6010B	04/20/05 19:42 / jjw
Cobalt	153	mg/kg		5.0		SW6010B	04/20/05 19:42 / jjw
Iron	282000	mg/kg	D	80		SW6010B	04/22/05 04:13 / jjw
Lead	160	mg/kg		5.0		SW6010B	04/20/05 19:42 / jjw
Manganese	11800	mg/kg		5.0		SW6010B	04/22/05 04:13 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:04 / KC
Nickel	15.9	mg/kg		5.0		SW6020	04/27/05 01:44 / rlh
Phosphorus	707	mg/kg		10		SW6010B	04/22/05 04:13 / jjw
Selenium	12.7	mg/kg		5.0		SW6020	04/27/05 01:44 / rlh
Zinc	18500	mg/kg		5.0		SW6010B	04/22/05 04:13 / jjw
VOLATILE ORGANIC COMPOUNDS							
Bromoform	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Benzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Bromobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Bromochloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Bromodichloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Bromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Carbon tetrachloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Chlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Chloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
2-Chloroethyl vinyl ether	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Chloroform	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Chloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
2-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
4-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Chlorodibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,2-Dibromoethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Dibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,2-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-005
Client Sample ID: ASP05-C9

Report Date: 05/02/05
Collection Date: 04/14/05 14:44
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
VOLATILE ORGANIC COMPOUNDS							
1,3-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,4-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Dichlorodifluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,2-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
cis-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
trans-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,3-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
2,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
cis-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
trans-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Ethylbenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Methyl tert-butyl ether (MTBE)	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Methylene chloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Methyl ethyl ketone	ND	mg/kg		4.0		SW8260B	04/21/05 17:16 / trr
Styrene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1,1,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1,2,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Tetrachloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Toluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1,1-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,1,2-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Trichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Trichlorofluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
1,2,3-Trichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Vinyl chloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
m+p-Xylenes	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
o-Xylene	ND	mg/kg		0.20		SW8260B	04/21/05 17:16 / trr
Surr: p-Bromofluorobenzene	118	%REC			78-160	SW8260B	04/21/05 17:16 / trr
Surr: Dibromofluoromethane	104	%REC			70-132	SW8260B	04/21/05 17:16 / trr
Surr: 1,2-Dichloroethane-d4	104	%REC			60-136	SW8260B	04/21/05 17:16 / trr
Surr: Toluene-d8	104	%REC			75-138	SW8260B	04/21/05 17:16 / trr
SEMI-VOLATILE ORGANIC COMPOUNDS							
Acenaphthene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Acenaphthylene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Benzo(a)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm

Report Definitions: RL - Analyte reporting limit. QCL - Quality control limit. MCL - Maximum contaminant level. ND - Not detected at the reporting limit.

ENERGY LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-005
Client Sample ID: ASP05-C9

Report Date: 05/02/05
Collection Date: 04/14/05 14:44
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
SEMI-VOLATILE ORGANIC COMPOUNDS							
Benzo(a)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Benzo(b)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Benzo(g,h,i)perylene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Benzo(k)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Chrysene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Dibenzo(a,h)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Fluorene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Indeno(1,2,3-cd)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Naphthalene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Phenanthrene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 14:39 / sm
Surr: 2-Fluorobiphenyl	88.6	%REC			30-115	SW8270C	04/21/05 14:39 / sm
Surr: Nitrobenzene-d5	86.9	%REC			23-120	SW8270C	04/21/05 14:39 / sm
Surr: Terphenyl-d14	98.9	%REC			18-137	SW8270C	04/21/05 14:39 / sm
POLYCHLORINATED BIPHENYLS (PCB'S)							
Aroclor 1016	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1221	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1232	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1242	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1248	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1254	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1260	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1262	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Aroclor 1268	ND	mg/kg		0.017		SW8082	04/24/05 03:40 / law
Surr: Decachlorobiphenyl	140	%REC	S		50-126	SW8082	04/24/05 03:40 / law
Surr: Tetrachloro-m-xylene	108	%REC			42-115	SW8082	04/24/05 03:40 / law

Sample extract received a Sulfuric Acid Clean-up (EPA Method 3665) and a Sulfur Clean-up (EPA Method 3660) prior to analysis.

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
S - Spike recovery outside of advisory limits.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES
877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-006
Client Sample ID: ASP06-D16

Report Date: 05/02/05
Collection Date: 04/14/05 14:50
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	42.5	mg/kg		5.0		SW6020	04/27/05 01:51 / rlh
Arsenic	130	mg/kg		5.0		SW6020	04/27/05 01:51 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:17 / jjw
Cadmium	2.2	mg/kg		1.0		SW6010B	04/20/05 19:46 / jjw
Chromium	68.4	mg/kg		5.0		SW6010B	04/20/05 19:46 / jjw
Cobalt	173	mg/kg		5.0		SW6010B	04/20/05 19:46 / jjw
Iron	305000	mg/kg	D	80		SW6010B	04/22/05 04:17 / jjw
Lead	55.5	mg/kg		5.0		SW6010B	04/20/05 19:46 / jjw
Manganese	11800	mg/kg		5.0		SW6010B	04/22/05 04:17 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:06 / KC
Nickel	18.8	mg/kg		5.0		SW6020	04/27/05 01:51 / rlh
Phosphorus	647	mg/kg		10		SW6010B	04/22/05 04:17 / jjw
Selenium	11.0	mg/kg		5.0		SW6020	04/27/05 01:51 / rlh
Zinc	19100	mg/kg		5.0		SW6010B	04/22/05 04:17 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-007
Client Sample ID: ASP07-F3

Report Date: 05/02/05
Collection Date: 04/14/05 14:57
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	42.7	mg/kg		5.0		SW6020	04/27/05 01:58 / rlh
Arsenic	102	mg/kg		5.0		SW6020	04/27/05 01:58 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:20 / jjw
Cadmium	1.9	mg/kg		1.0		SW6010B	04/20/05 19:49 / jjw
Chromium	70.5	mg/kg		5.0		SW6010B	04/20/05 19:49 / jjw
Cobalt	171	mg/kg		5.0		SW6010B	04/20/05 19:49 / jjw
Iron	286000	mg/kg	D	80		SW6010B	04/22/05 04:20 / jjw
Lead	45.3	mg/kg		5.0		SW6010B	04/20/05 19:49 / jjw
Manganese	12100	mg/kg		5.0		SW6010B	04/22/05 04:20 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:10 / KC
Nickel	17.4	mg/kg		5.0		SW6020	04/27/05 01:58 / rlh
Phosphorus	578	mg/kg		10		SW6010B	04/22/05 04:20 / jjw
Selenium	13.8	mg/kg		5.0		SW6020	04/27/05 01:58 / rlh
Zinc	19100	mg/kg		5.0		SW6010B	04/22/05 04:20 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES
877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-008
Client Sample ID: ASP08-G2

Report Date: 05/02/05
Collection Date: 04/14/05 15:04
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
PHYSICAL CHARACTERISTICS							
Moisture	0.800	wt%		0.0100		SW3550A	04/22/05 08:15 / MC
CHEMICAL CHARACTERISTICS							
pH, 1:2	9.2	s.u.		0.1		ASA10-3	04/25/05 16:18 / srm
Chloride, 1:2	1.06	mg/kg		1.00		ASA10-3	04/26/05 12:48 / qed
METALS, TOTAL							
Antimony	43.8	mg/kg		5.0		SW6020	04/27/05 02:05 / rlh
Arsenic	119	mg/kg		5.0		SW6020	04/27/05 02:05 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:24 / jjw
Cadmium	2.5	mg/kg		1.0		SW6010B	04/20/05 20:00 / jjw
Chromium	59.8	mg/kg		5.0		SW6010B	04/20/05 20:00 / jjw
Cobalt	194	mg/kg		5.0		SW6010B	04/20/05 20:00 / jjw
Iron	290000	mg/kg	D	80		SW6010B	04/22/05 04:24 / jjw
Lead	118	mg/kg		5.0		SW6010B	04/20/05 20:00 / jjw
Manganese	13100	mg/kg		5.0		SW6010B	04/22/05 04:24 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:12 / KC
Nickel	17.9	mg/kg		5.0		SW6020	04/27/05 02:05 / rlh
Phosphorus	720	mg/kg		10		SW6010B	04/22/05 04:24 / jjw
Selenium	9.9	mg/kg		5.0		SW6020	04/27/05 02:05 / rlh
Zinc	21100	mg/kg		5.0		SW6010B	04/22/05 04:24 / jjw
VOLATILE ORGANIC COMPOUNDS							
Bromoform	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Benzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Bromobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Bromochloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Bromodichloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Bromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Carbon tetrachloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Chlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Chloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
2-Chloroethyl vinyl ether	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Chloroform	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Chloromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
2-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
4-Chlorotoluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Chlorodibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,2-Dibromoethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Dibromomethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,2-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-008
Client Sample ID: ASP08-G2

Report Date: 05/02/05
Collection Date: 04/14/05 15:04
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
VOLATILE ORGANIC COMPOUNDS							
1,3-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,4-Dichlorobenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Dichlorodifluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,2-Dichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
cis-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
trans-1,2-Dichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,3-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
2,2-Dichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
cis-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
trans-1,3-Dichloropropene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Ethylbenzene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Methyl tert-butyl ether (MTBE)	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Methylene chloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Methyl ethyl ketone	ND	mg/kg		4.0		SW8260B	04/21/05 17:51 / trr
Styrene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1,1,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1,2,2-Tetrachloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Tetrachloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Toluene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1,1-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,1,2-Trichloroethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Trichloroethene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Trichlorofluoromethane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
1,2,3-Trichloropropane	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Vinyl chloride	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
m+p-Xylenes	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
o-Xylene	ND	mg/kg		0.20		SW8260B	04/21/05 17:51 / trr
Surr: p-Bromofluorobenzene	118	%REC			78-160	SW8260B	04/21/05 17:51 / trr
Surr: Dibromofluoromethane	103	%REC			70-132	SW8260B	04/21/05 17:51 / trr
Surr: 1,2-Dichloroethane-d4	102	%REC			60-136	SW8260B	04/21/05 17:51 / trr
Surr: Toluene-d8	108	%REC			75-138	SW8260B	04/21/05 17:51 / trr
SEMI-VOLATILE ORGANIC COMPOUNDS							
Acenaphthene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Acenaphthylene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Benzo(a)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm

Report Definitions: RL - Analyte reporting limit. QCL - Quality control limit. MCL - Maximum contaminant level. ND - Not detected at the reporting limit

ENERGY LABORATORIES 877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-008
Client Sample ID: ASP08-G2

Report Date: 05/02/05
Collection Date: 04/14/05 15:04
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
SEMI-VOLATILE ORGANIC COMPOUNDS							
Benzo(a)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Benzo(b)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Benzo(g,h,i)perylene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Benzo(k)fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Chrysene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Dibenzo(a,h)anthracene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Fluoranthene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Fluorene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Indeno(1,2,3-cd)pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Naphthalene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Phenanthrene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Pyrene	ND	mg/kg		0.33		SW8270C	04/21/05 15:21 / sm
Surr: 2-Fluorobiphenyl	75.9	%REC			30-115	SW8270C	04/21/05 15:21 / sm
Surr: Nitrobenzene-d5	76.0	%REC			23-120	SW8270C	04/21/05 15:21 / sm
Surr: Terphenyl-d14	88.9	%REC			18-137	SW8270C	04/21/05 15:21 / sm
POLYCHLORINATED BIPHENYLS (PCB'S)							
Aroclor 1016	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1221	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1232	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1242	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1248	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1254	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1260	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1262	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Aroclor 1268	ND	mg/kg		0.017		SW8082	04/24/05 04:08 / law
Surr: Decachlorobiphenyl	125	%REC			50-126	SW8082	04/24/05 04:08 / law
Surr: Tetrachloro-m-xylene	90.0	%REC			42-115	SW8082	04/24/05 04:08 / law

Sample extract received a Sulfuric Acid Clean-up (EPA Method 3665) and a Sulfur Clean-up (EPA Method 3660) prior to analysis.

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES
877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-009
Client Sample ID: ASP09-G4

Report Date: 05/02/05
Collection Date: 04/14/05 15:07
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	57.6	mg/kg		5.0		SW6020	04/27/05 02:12 / rlh
Arsenic	109	mg/kg		5.0		SW6020	04/27/05 02:12 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:27 / jjw
Cadmium	1.4	mg/kg		1.0		SW6010B	04/20/05 20:04 / jjw
Chromium	90.0	mg/kg		5.0		SW6010B	04/20/05 20:04 / jjw
Cobalt	204	mg/kg		5.0		SW6010B	04/20/05 20:04 / jjw
Iron	294000	mg/kg	D	80		SW6010B	04/22/05 04:27 / jjw
Lead	64.0	mg/kg		5.0		SW6010B	04/20/05 20:04 / jjw
Manganese	11900	mg/kg		5.0		SW6010B	04/22/05 04:27 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:14 / KC
Nickel	20.6	mg/kg		5.0		SW6020	04/27/05 02:12 / rlh
Phosphorus	562	mg/kg		10		SW6010B	04/22/05 04:27 / jjw
Selenium	12.2	mg/kg		5.0		SW6020	04/27/05 02:12 / rlh
Zinc	20100	mg/kg		5.0		SW6010B	04/22/05 04:27 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

ENERGY LABORATORIES
877-472-0711 • 406-442-0711 • 406-442-0712 fax • helena@energylab.com

LABORATORY ANALYTICAL REPORT

Client: MT DEQ
Project: ASARCO Slag Pile
Lab ID: H05040130-010
Client Sample ID: ASP10-H16

Report Date: 05/02/05
Collection Date: 04/14/05 15:15
Date Received: 04/14/05
Matrix: Solid

Analyses	Result	Units	Qual	RL	MCL/ QCL	Method	Analysis Date / By
METALS, TOTAL							
Antimony	34.1	mg/kg		5.0		SW6020	04/22/05 05:23 / rlh
Arsenic	117	mg/kg		5.0		SW6020	04/22/05 05:23 / rlh
Beryllium	ND	mg/kg		5.0		SW6010B	04/22/05 04:31 / jjw
Cadmium	2.1	mg/kg		1.0		SW6010B	04/20/05 20:07 / jjw
Chromium	59.0	mg/kg		5.0		SW6010B	04/20/05 20:07 / jjw
Cobalt	137	mg/kg		5.0		SW6010B	04/20/05 20:07 / jjw
Iron	305000	mg/kg	D	80		SW6010B	04/22/05 04:31 / jjw
Lead	103	mg/kg		5.0		SW6010B	04/20/05 20:07 / jjw
Manganese	10400	mg/kg		5.0		SW6010B	04/22/05 04:31 / jjw
Mercury	ND	mg/kg		1.0		SW7471A	04/25/05 14:16 / KC
Nickel	14.7	mg/kg		5.0		SW6020	04/22/05 05:23 / rlh
Phosphorus	710	mg/kg		10		SW6010B	04/22/05 04:31 / jjw
Selenium	9.1	mg/kg		5.0		SW6020	04/22/05 05:23 / rlh
Zinc	22200	mg/kg		5.0		SW6010B	04/22/05 04:31 / jjw

Report Definitions:
RL - Analyte reporting limit.
QCL - Quality control limit.
D - RL increased due to sample matrix interference.
MCL - Maximum contaminant level.
ND - Not detected at the reporting limit.

APPENDIX 4-1-2

SUMMARY OF SLAG TESTING ANALYSES INCLUDING TEST BASIN WATER QUALITY, SLAG BOTTLE ROLL TESTS AND EP TOXICITY TESTS

SITE NAME	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG	FUMED SLAG
SAMPLE DATE	12/30/86	04/02/87	04/22/87	04/22/87	05/22/87	05/22/87	05/22/87	05/22/87	07/15/87	07/15/87
LAB	ASARCO	ASARCO	ASARCO	CHMTC	ASARCO	ASARCO	CHMTC	CHMTC	ASARCO	ASARCO
REMARKS	BOTTLE			SPLIT	REPLICATE		SPLIT	REPLICATE	REPLICATE	
REMARKS	ROLL TEST *									
SAMPLE NUMBER		8704-1	8704-20		8705-50	8705-47			8707-02	8707-01
PHYSICAL PARAMETERS										
WATER TEMPERATURE (C)			7.5			9.7				
SPEC. COND. (UMHOS/CM) FIELD			2235		2268	2265			2137	2150
SPEC. COND. (UMHOS/CM) LAB	115	1950	2250			2320				2400
PH FIELD			6.16 *		7.48	7.69				7.46
PH LAB	9.9	7.77	6.81			7.52				7.55
TDS MEAS. @ 180 DEG. C	94	1842	1903 *	993		2086	2227			1912 *
OXYGEN (O) DISS			4.3			4.3				4.1
DEPTH TO SWL BELOW MP (FT)			8.74 *			8.01				
COMMON IONS										
CALCIUM (CA)	12	510	454	449.0		422	417.0	412.0		321
MAGNESIUM (MG)	0.49	20	25.5	27.40		20.2	25.10	24.90		22.9
SODIUM (NA)	5.1	76	71.5	76.6		85	72.5	71.8		74
POTASSIUM (K)	3.9	54	65	60.80		74	136.00	122.00		68
BICARBONATE (HCO3) (LAB)	<1.0	260 *	102			98				84
CARBONATE AS CO3 (LAB)	19	<1	<1			<1				<1.0
SULFATE (SO4)	10	1450	1425	1240.0		1338	1304.0			1200
CHLORIDE (CL)	18	6.0	7.0	10.0		7.0	30.0			4.0
TRACE ELEMENTS										
ARSENIC (AS) DISS	0.19	0.0325	0.0283	0.0198	0.038	0.030	0.0530	0.0320	0.057 *	0.039 *
ARSENIC (AS) +3			0.014						0.0216	0.060 *
ARSENIC (AS) +5			0.010						0.0722 *	0.0268
CADMIUM (CD) DISS	0.003	0.075	0.060	0.0720	0.051	0.051	0.0520	0.0500	0.055	0.049
COPPER (CU) DISS	0.008	0.280 *	0.193	0.2260	0.125	0.128	0.1480	0.1340	0.118	0.110
IRON (FE) DISS	0.11	<0.020	<0.020	<0.100	0.044	0.045	<0.100	<0.100	<0.020	<0.020
IRON (FE II)			0.010 *						0.060	0.080
LEAD (PB) DISS	<0.017	0.045 *	0.030 *	0.0334	0.019	0.020	0.0323	0.0432	0.016	0.021
MANGANESE (MN) DISS	<0.017	1.080	1.440	2.640	1.910	1.930	2.660	2.640	2.930	2.890
ZINC (ZN) DISS	0.023	3.580	3.700	4.450	2.830	2.890	2.860	2.820	2.500	2.300

All quantities in milligrams per liter unless otherwise noted. Blank line indicates parameter not tested.

Output Date: 03-19-1989
HWQ-6/86-R1

...Y OF SLAG WATER QUALITY ANALYSES - ASARCO EAST HELENA

SITE NAME	FUMED SLAG	FUMED SLAG	UNFUMED SLAG	UNFUMED SLAG	UNFUMED SLAG	UNFUMED SLAG	UNFUMED SLAG	UNFUMED SLAG	UNFUMED SLAG
SAMPLE DATE	09/22/87	09/22/87	12/30/86	04/22/87	04/22/87	05/22/87	05/22/87	07/15/87	09/22/87
LAB	ASARCO	ASARCO	ASARCO	ASARCO	CHMTC	CHMTC	ASARCO	ASARCO	ASARCO
REMARKS	REPLICATE		BOTTLE		SPLIT	SPLIT			
REMARKS			ROLL TEST						
SAMPLE NUMBER	8709-06	8709-04		8704-24			8705-48	8707-03	8709-07
PHYSICAL PARAMETERS									
WATER TEMPERATURE (C)		16 *		10.5			10.9		17 *
SPEC. COND. (UMHOS/CM) FIELD	1368	1366		16296 *			19978	19850	
SPEC. COND. (UMHOS/CM) LAB		1350	200	16500			20200	22000	12200
PH FIELD				9.49			9.97 *	9.48	
PH LAB		7.63	10.4	9.25			9.6	9.73	9.69
TDS MEAS. @ 180 DEG. C		1114	206	14183 *	7298	18720	18523	18172 *	10984
OXYGEN (O) DISS		4.0		4.5			3.2	3.0	4.1
DEPTH TO SWL BELOW MP (FT)		7.74		8.83			7.85		7.02
COMMON IONS									
CALCIUM (CA)		126.5	17	371	437.0		361	426	345
MAGNESIUM (MG)		11	0.22	8.5	8.76		6.7	6.4	4.2
SODIUM (NA)		45	19	2900	2960.0		3890	3800	2200
POTASSIUM (K)		65	22	1950	158.00		2650	2550	1540
ALKALINITY AS CACO3 (LAB)							587		
BICARBONATE (HCO3) (LAB)		72	<1.0	486 *			<1	<1.0	<1.0
CARBONATE AS CO3 (LAB)		<1.0	36	<1			284	163	197
HYDROXIDE (OH)							38	46	30
SULFATE (SO4)		480 *	16	9200	2480.0	2463.0	1200	11750	6750
CHLORIDE (CL)		3.0	16	57	63.0	75.0	66	74	35
TRACE ELEMENTS									
ARSENIC (AS) DISS	0.075 *	0.054 *	0.31	0.620	0.5130		0.353	0.590 *	0.553
ARSENIC (AS) +3				0.400				0.550	
ARSENIC (AS) +5				0.030				0.054	
CADMIUM (CD) DISS	0.021	0.021	0.003	0.030 *	0.0063		0.003	0.005	0.003
COPPER (CU) DISS	0.055	0.056	0.008	0.130	0.1190		0.128	0.085	0.043
IRON (FE) DISS	<0.020	<0.020	0.070	0.150	<0.100		0.225 *	<0.020	<0.020
IRON (FE II)	0.02	<0.01		<0.010				0.070	<0.01
LEAD (PB) DISS	0.023	0.026	0.083	0.098 *	0.1430		0.0505	0.021 *	0.094
MANGANESE (MN) DISS	1.590	1.540	<0.017	0.155 *	0.139		0.083	0.090	0.050
ZINC (ZN) DISS	0.813	0.788 *	0.053	0.100 *	0.090		0.048	0.030	0.023

All quantities in milligrams per liter unless otherwise noted. Blank line indicates parameter not tested.

Output Date: 03-19-1989
HWD-6/86-R1

TABLE 1
East Helena

SLAG SAMPLE LEACHATE ANALYSIS

1979

979 SARCO ab No.	Description	(PPM in Leachate) As	Ba	Cd	Cr	Pb	Hg	Se	Ag	(Zn)
3278	Slag 1 (Zn)	.018	.3	.08	<.01	.6	<.001	<.005	<.01	3.5
3279	Slag 2 (Zn)	<.014	.1	.13	<.01	<.1	<.001	<.005	<.01	2.6
3280	Slag 3 (Zn)	.020	.1	.03	<.01	3.4	<.001	<.005	<.01	2.1
3281	Slag 4 (Zn)	<.014	.2	<.01	<.01	<.1	<.001	<.005	<.01	1.0
3282	Slag 5 (Pb)	.032	.2	<.01	<.01	3.3	<.001	<.005	<.01	5.0
3	Slag 6 (Pb)	<.014	.1	.15	<.01	1.0	<.001	<.005	<.01	6.0
aximum Contaminant evels for Non-oxic Leachates		0.5	10.0	0.1	0.5	0.5	.02	0.1	0.5	---*

NOTE →

* Currently unspecified but estimated to be 50 ppm (10 times the Drinking Water Standard).

ASARCO Incorporated
Department of Environmental Sciences
EAST HELENA
Miscellaneous Sample Results

ASARCO LAB #	SAMPLE DESCRIPTION	1985 SAMPLE DATE	As ppm	Cd ppm	Pb ppm
3658 Air Cooled	Blast Furnace Slag	5/ 7	.12	.002	5.3
3659 Granulated	Blast Furnace Slag	5/ 7	.047	<.002	.050

ASARCO Incorporated
Department of Environmental Sciences
EAST HELENA
Miscellaneous Sample Results

ASARCO LAB #	SAMPLE DESCRIPTION	1985 SAMPLE DATE	Ag ppm	As ppm	Ba ppm	Cd ppm	Cr ppm
7860	TCLP-Fumed Blast Furnace Slag	10/21	<.002	.45	4.6	.007	.0
7861	TCLP-Unfumed Blast Furnace Slag	10/21	<.002	1.2	1.6	.25	.0

ASARCO LAB #	SAMPLE DESCRIPTION	1985 SAMPLE DATE	Hg ppb	Pb ppm	Se ppm
7860	TCLP-Fumed Blast Furnace Slag	10/21	<.005	.28	.004
7861	TCLP-Unfumed Blast Furnace Slag	10/21	<.001	10.	.010

ASARCO Incorporated
Department of Environmental Sciences
EAST HELENA
Miscellaneous Sample Results

ASARCO LAB #	SAMPLE DESCRIPTION	1985 SAMPLE DATE	Ag ppm	As ppm	Ba ppm	Cd ppm	Cr ppm
6378	Air Cooled Slag	8/15	<.005	.012	<1.0	.002	<.17
6379	Granulated Slag	8/15	<.005	.010	<1.0	<.002	<.17

ASARCO LAB #	SAMPLE DESCRIPTION	1985 SAMPLE DATE	Hg ppb	Pb ppm	Se ppm	pH
6378	Air Cooled Slag	8/15	<.50	1.1	<.080	9.2
6379	Granulated Slag	8/15	<.50	.050	<.080	8.0

ASARCO Incorporated
Department of Environmental Sciences
EAST HELENA
Miscellaneous Sample Results

ASARCO LAB #	SAMPLE DESCRIPTION	1983 SAMPLE DATE	Pb ppm	Cd ppm	Cr ppm	Ag ppm	Ba ppm
11370 2-4 mo. old	Slag Composite	11/28	9.8	3.9	<.030	<.008	7.2
11371 1 week old	Slag Composite	11/28	3.9	<.004	<.030	<.008	8.7

ASARCO LAB #	SAMPLE DESCRIPTION	1983 SAMPLE DATE	As ppm	Se ppm	Hg ppb	pH
11370 2-4 mo. old	Slag Composite	11/28	.20	.012	<.50	10.
11371 1 week old	Slag Composite	11/28	.35	<.004	<.50	10.

	ppm							
	Ba	Pb	Cd	Cr	Ag	Se	Hg	As
Maximum allowable levels of contaminants in the leachate of a non-toxic material.....	100.	5.0	1.0	5.0	5.0	1.0	.2	5.0

storage area. The sediments are being stored in a protected environment to prevent contamination of the adjacent area from dispersion of the sediments by wind and water. The sediments are located on a concrete pad to prevent contact with adjacent soils. A containment berm around the perimeter of the sediment pile diverts run-on. A geomembrane cover over the sediments prevents wind and water dispersion and eliminates subsequent generation of leachate.

Approximately 31,000 cubic yards of dewatered sediments were transported to the Lower Ore Storage Area. Four thousand cubic yards of these sediments were smelted prior to the stockpile being covered with a geomembrane liner in October 1997. The sediments will remain in this interim storage facility while EPA considers Asarco's request to modify the sediment smelting requirement of the ROD, and instead dispose of these materials in the on-site CAMU.

4.1.4 Slag

The effect of the slag pile on groundwater and surface water was evaluated as part of the 1990 Comprehensive RI/FS. The evaluation was conducted in accordance with procedures presented in the Comprehensive RI/FS Work Plan (Hydrometrics 1987). Based on the results of the evaluation, the RI/FS concluded that the potential for impacts to groundwater and surface water from slag is low and the subsequent ROD did not specify any remedial action for the Slag Pile Operable Unit. Post-RI/FS monitoring at adjacent surface water and groundwater monitoring sites is on-going. A summary of the slag investigation and the findings of the RI relative to slag are presented below.

4.1.4.1 Investigation of Potential Groundwater Impacts

Slag Infiltration Test Basin Construction, Water Level Measurement, Water Quality Sampling and Analysis

Infiltration and percolation of precipitation into the slag pile were directly measured in slag test basins constructed in fumed and unfumed slag. Fumed slag is a by-product of the zinc

recovery process, which consisted of air injection into molten slag to recover zinc oxide. Unfumed slag is a by-product of the blast furnace which has not been further processed through the zinc recovery process. The zinc recovery process was suspended in 1982 and zinc is no longer recovered from the slag. Since 1982, unfumed slag has been placed in an area segregated from fumed slag.

Two slag infiltration catchment basins were constructed; one in a typical location in the fumed slag, and one in a typical location in unfumed slag. Construction of the test basins included removal of a 2 to 3 meter layer of slag, placement of an impervious 36-mil reinforced Hypalon liner in the excavation, installation of a collection sump, and replacement of the slag. Figure 4-1-8 shows the slag test basin design.

Water elevations in the collection sumps were measured periodically, and after rainfall or snowmelt events to determine the actual accumulation of water in the slag basins. Collected water was pumped from the sump, sent to the TSC laboratory, and tested for the parameters listed in Table 3-2-2. Analytical results of water collected in the test basins are summarized in Appendix 4-1-2.

Slag Material Sampling and Analysis

To supplement slag information collected from the test basins, samples of slag were collected from the test basin sites and sent to the TSC lab for "bottle roll" tests. Estimates of slag leachability were obtained by conducting "bottle roll" test on slag samples. Bottle roll tests involved placing samples of slag in bottles in the laboratory, adding deionized water, agitating the bottles for approximately 24 hours, then analyzing the water for concentrations of arsenic and metals. Details of the bottle roll extraction tests are in the Quality Assurance Project Plan (QAPP) Addendum to the Phase II Water Resources Investigation Work Plan (Hydrometrics, 1986). Bottle roll test results are in Appendix 4-1-2.

FIGURE 4-1-8 SLAG TEST BASIN DESIGN

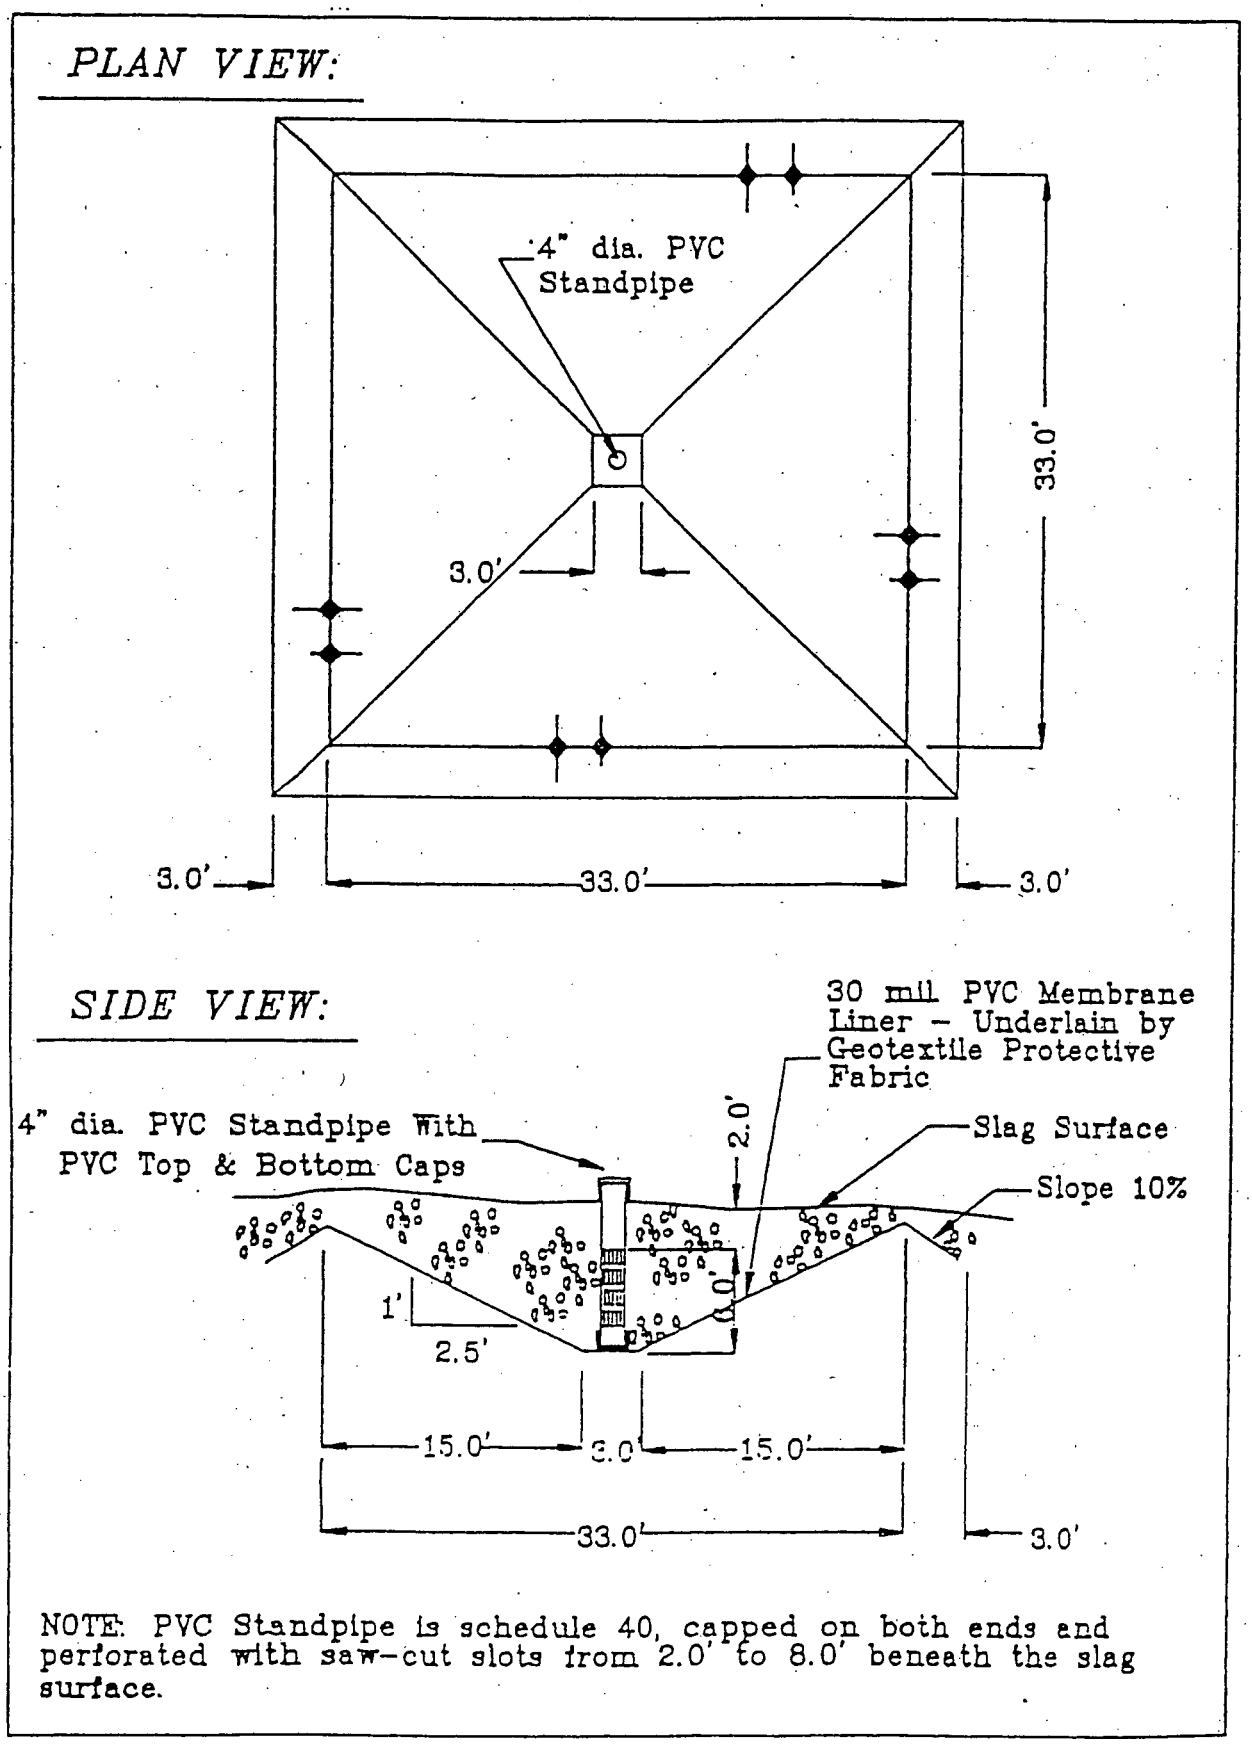

NOTE: PVC Standpipe is schedule 40, capped on both ends and perforated with saw-cut slots from 2.0' to 8.0' beneath the slag surface.

In addition to the slag sampling and bottle roll test performed as part of the East Helena RI activities, additional slag samples were collected and analyzed using the EP toxicity procedure. Results of these analyses are also in Appendix 4-1-2.

Assessment of Groundwater Impacts

In an effort to estimate infiltration rates, the volume of water retained in the slag test basins was calculated for 13 time intervals, beginning December 23, 1986 and ending February 10, 1988. These volumes were compared to the volumes of precipitation during the same periods and converted to percentages, as summarized in Table 4-1-10. The percentage of precipitation retained in the basins varied from -6.7% to 61.9% in the fumed slag, and -45% to 61.8% in the unfumed slag (negative percentages indicate evaporation rates exceed precipitation collected in the test basins). Although there is a relationship of test basin water level fluctuations to precipitation (see Figures 4-1-9 and 4-1-10), the relationship may be complicated by variable evaporation, hence, infiltration rates are variable.

Concentrations of arsenic and metals from test basin water samples (see Appendix 4-1-2) were low compared to plant area groundwater. Dissolved arsenic varied from 0.0198 mg/l to 0.075 mg/l in the fumed slag, and 0.353 to 0.590 mg/l in the unfumed slag during the study period. Dissolved cadmium varied from 0.003 to 0.075 mg/l in the fumed slag, and 0.003 to 0.0063 mg/l in the unfumed slag. Dissolved lead varied from 0.016 to 0.045 mg/l in the fumed slag, and 0.021 to 0.098 mg/l in the unfumed slag.

The concentrations of arsenic and metals from bottle roll testing (See Appendix 4-1-2) were similar to the slag test basin water quality. For the fumed slag, dissolved arsenic was 0.19 mg/l, cadmium was 0.003 mg/l, and lead was less than 0.017 mg/l. For the unfumed slag, dissolved arsenic was 0.31 mg/l, cadmium was 0.003 mg/l and lead was 0.083 mg/l.

EP toxicity tests (see Appendix 4-1-2) indicate that leachable trace element concentrations from the slag are variable. From 18 tests, the results for arsenic varied from below detection level to 1.2 ppm with an average of 0.16 ppm; cadmium varied from below detection level to

TABLE 4-1-10. PRECIPITATION COLLECTED IN SLAG TEST BASINS

FUMED SLAG			
Date	Precipitation (inches)	Precipitation Retained * (Inches)	Percent of Precipitation Retained
12/23/86			
1/22/86	0		
2/23/87	0		
3/26/87	0.75	0.01	1.4
4/21/87	0.23	-0.01	-5.8
5/18/87	0.51	0.32	61.9
6/18/87	2.46	0.49	19.8
7/14/87	0.88	0.25	28.7
8/11/87	1.70	0.36	21.2
9/11/87	0.37	not calculated	
10/14/87	0.65	0.25	38.4
12/7/87	0.45	-0.02	-3.9
1/20/88	0.34	-0.02	-6.7
2/10/88	0.49	-0.01	-1.1
UNFUMED SLAG			
12/23/86			
1/22/87	0		
2/23/87	0		
3/26/87	0.75	0	
4/21/87	0.23	0.12	52.7
5/18/87	0.51	0.27	53.6
6/18/87	2.46	0.73	29.8
7/14/87	0.88	0.28	31.7
8/11/87	1.70	0.12	7.2
9/11/87	0.37	not calculated	
10/14/87	0.65	0.40	61.8
12/7/87	0.45	-0.05	-12.1
1/20/88	0.34	-0.15	-45.0
2/10/88	0.49	0.14	27.6

* Value is calculated based on measured water level changes and test basin geometry (Frustum of a general pyramid). Negative values indicate evaporation exceeds infiltration.

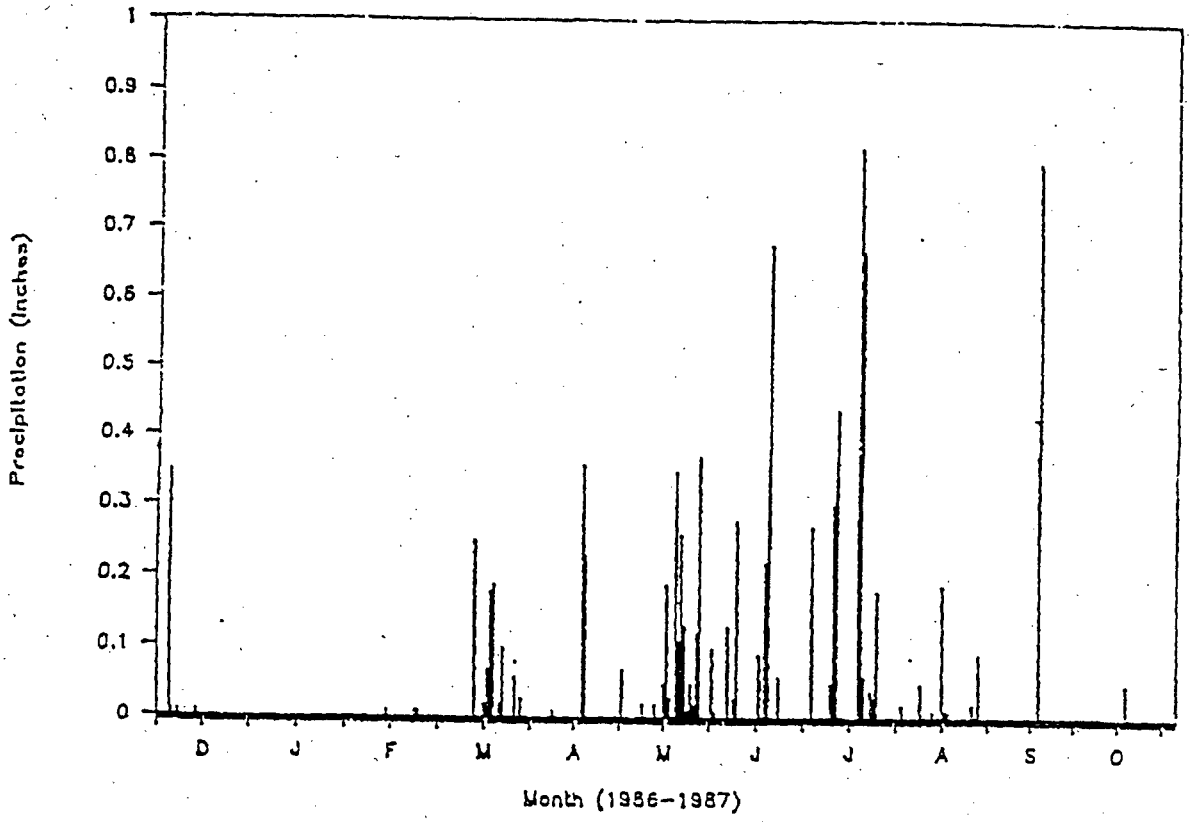

CC/RA REPORT ASARCO EAST HELENA FACILITY	DAILY PRECIPITATION AT HELENA AIRPORT	FIGURE 4-1-9

FIGURE SOURCE: COMPREHENSIVE RI/FS (ASARCO, 1990)

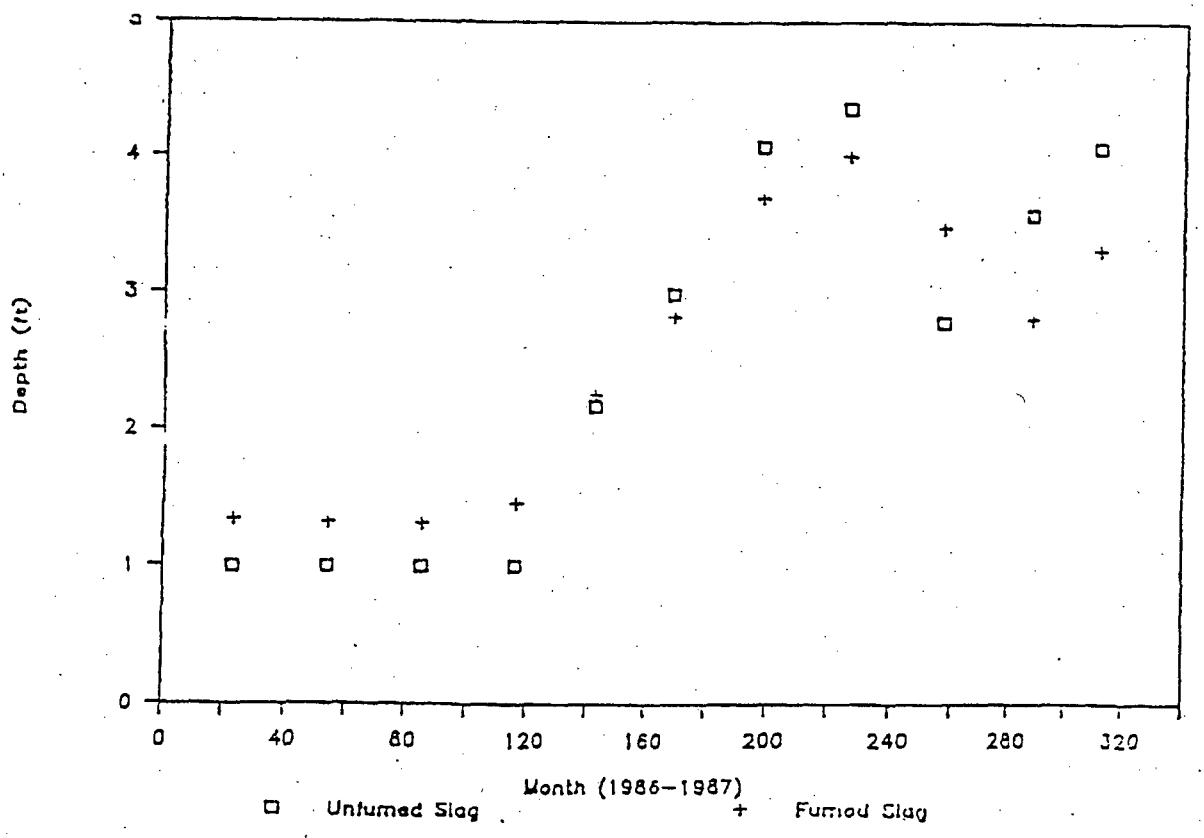

CC/RA REPORT ASARCO EAST HELENA FACILITY	DEPTH OF WATER IN SLAG TEST BASIN	FIGURE 4-1-10

FIGURE SOURCE: COMPREHENSIVE RI/FS (ASARCO, 1990)

3.9 ppm, with an average of 0.26 ppm (only one cadmium value was greater than 0.25 ppm; if the 3.9 ppm value is dropped, the cadmium average concentration is 0.04 ppm); lead values varied from below detection level to 30 ppm, with an average of 5.2 ppm.

The EP Toxicity tests were not conducted as part of the Comprehensive RI/FS activities, but have been included as supplementary data. The EP Toxicity results tend to overpredict the mobility of metals compared to the other test results and observed site conditions due to the low pH of the extractant. In particular, the values for lead appear to be much higher with TCLP than with natural conditions.

Concentrations of arsenic and other metals in the groundwater system are discussed in detail in Section 4.4. In general, results of water quality from the slag basins and bottle roll analyses of slag indicate arsenic concentrations are significantly lower than concentrations observed in monitoring wells both upgradient and downgradient of the slag pile. Figures 4-1-11, 4-1-12, 4-1-13 and 4-1-14 show a comparison to slag test basin water quality, bottle roll test water quality, EP Tox test results, and groundwater quality upgradient and down gradient of the slag pile.

Based on observed recharge rates in the slag test basins and associated water quality data, the slag pile would account for only 1 to 3 percent of the observed arsenic at downgradient monitoring well DH-10 (see Figure 4-1-15). Concentrations of arsenic in these wells are similar to arsenic concentrations in DH-4 near Lower Lake, the apparent source of elevated arsenic in these wells. Based on the results of test basin water quality analyses and bottle roll te2sts, it is unlikely that slag significantly effects observed arsenic concentration trends on the site.

While EP-Toxicity results indicate that there is some potential for mobility of cadmium, lead and zinc from slag, the results of the test basins and bottle roll tests indicate metals concentrations released from slag is low. In addition, concentrations of cadmium, lead and

FIGURE 4-1-11. ARSENIC CONCENTRATION DATA FROM GROUNDWATER MONITORING WELLS IN THE SLAG PILE AREA, AND FROM SLAG TEST BASIN AND SLAG LEACHABILITY TESTING RESULTS

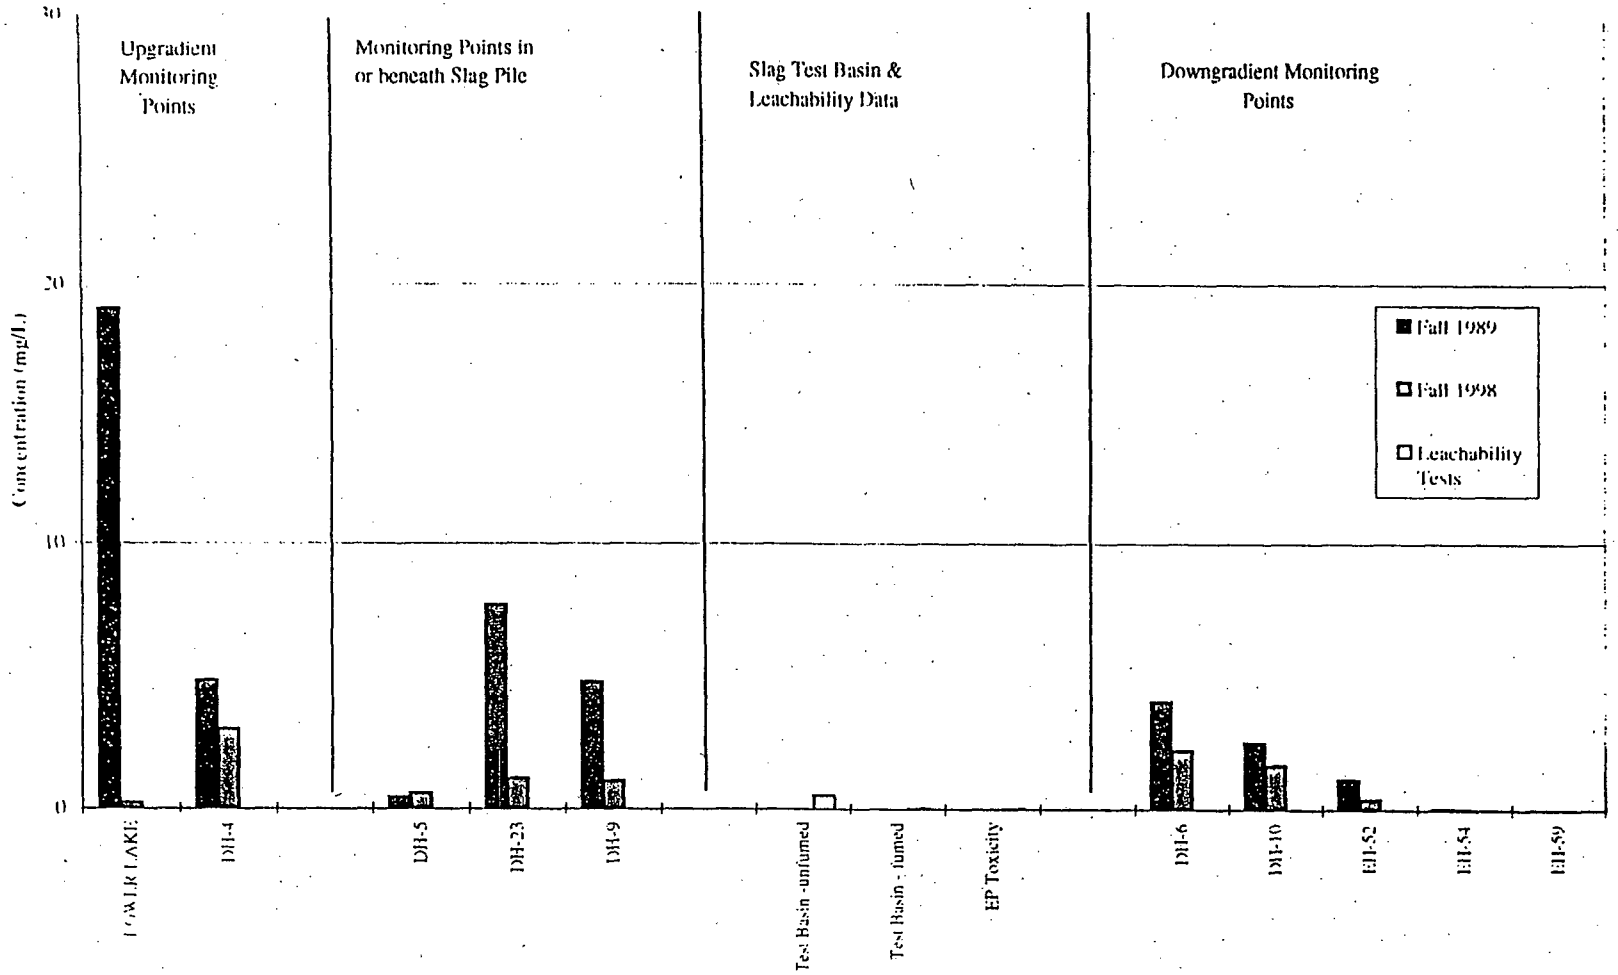

FIGURE 4-1-12. CADMIUM CONCENTRATION DATA FROM GROUNDWATER MONITORING WELLS IN THE SLAG PILE AREA, AND FROM SLAG TEST BASIN AND SLAG LEACHABILITY TESTING RESULTS

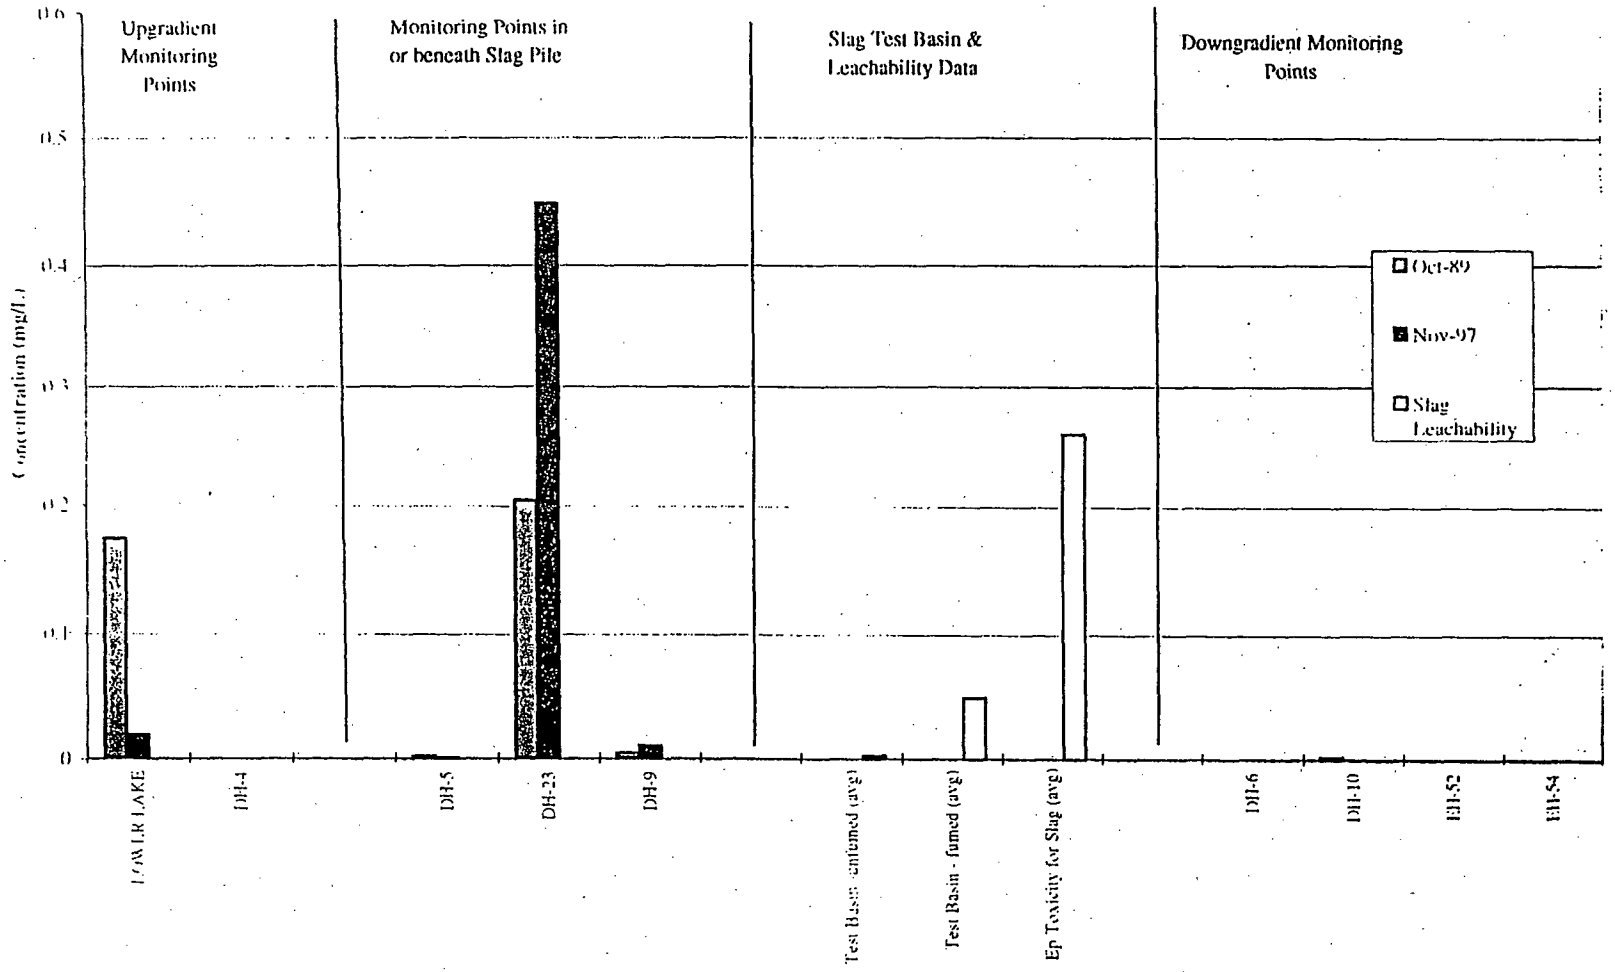

FIGURE 4-1-13. LEAD CONCENTRATION DATA FROM GROUNDWATER MONITORING WELLS IN THE SLAG PILE AREA, AND FROM SLAG TEST BASIN AND SLAG LEACHABILITY TESTING RESULTS

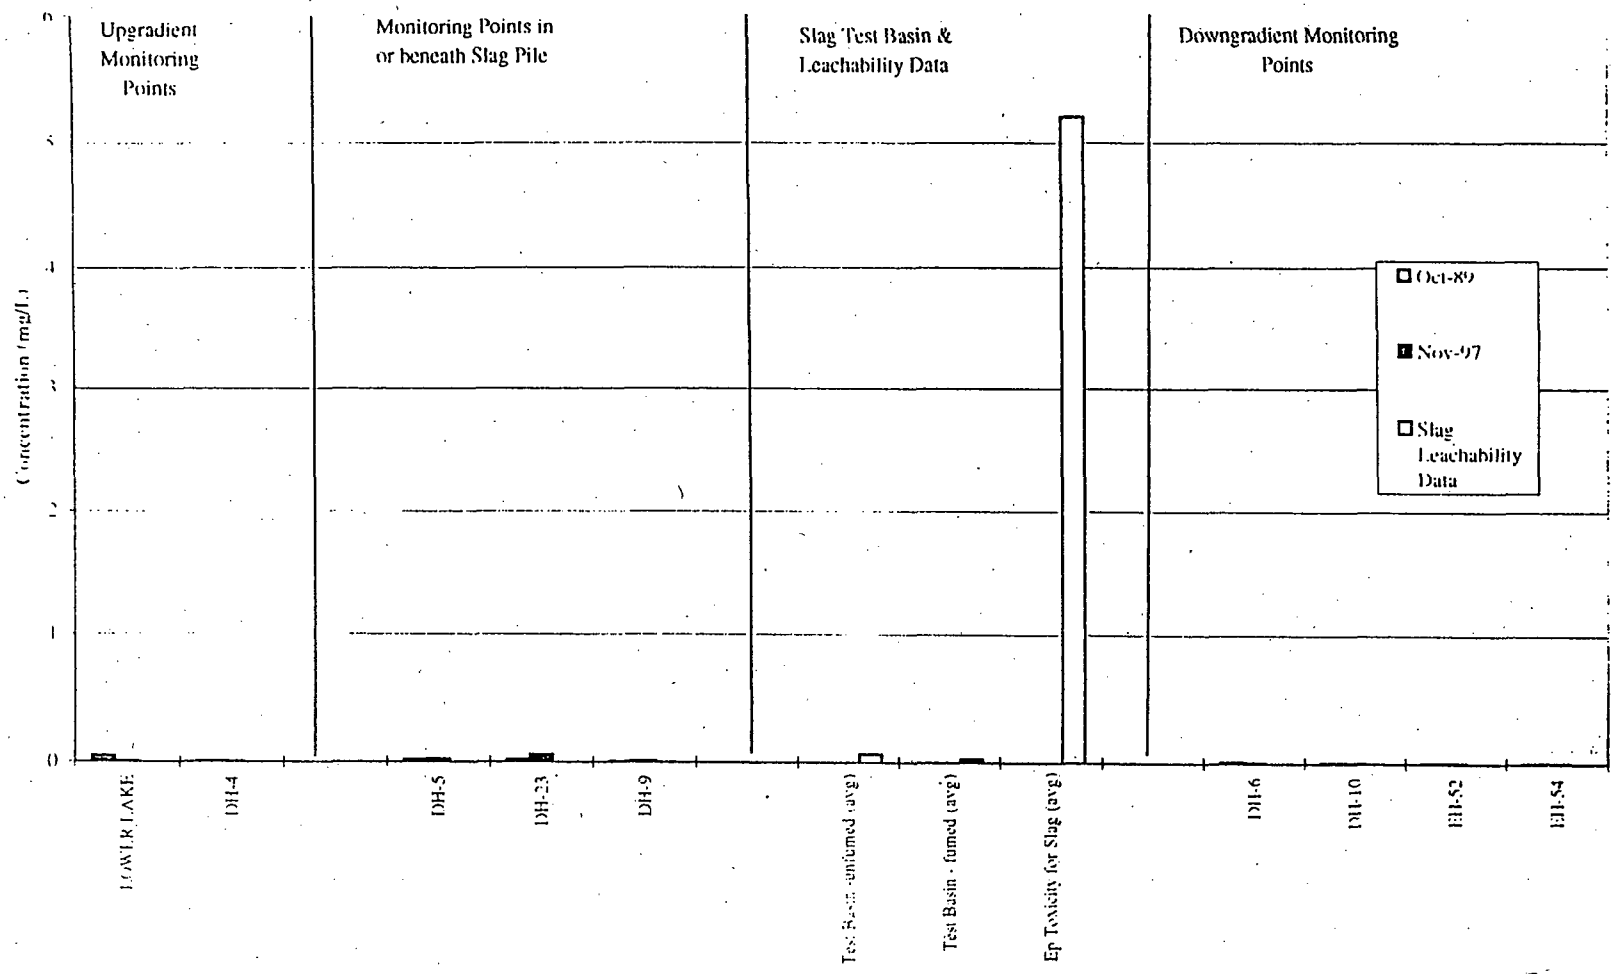

FIGURE 4-1-14. ZINC CONCENTRATION DATA FROM GROUNDWATER MONITORING WELLS IN THE SLAG PILE AREA, AND FROM SLAG TEST BASIN AND SLAG LEACHABILITY TESTING RESULTS

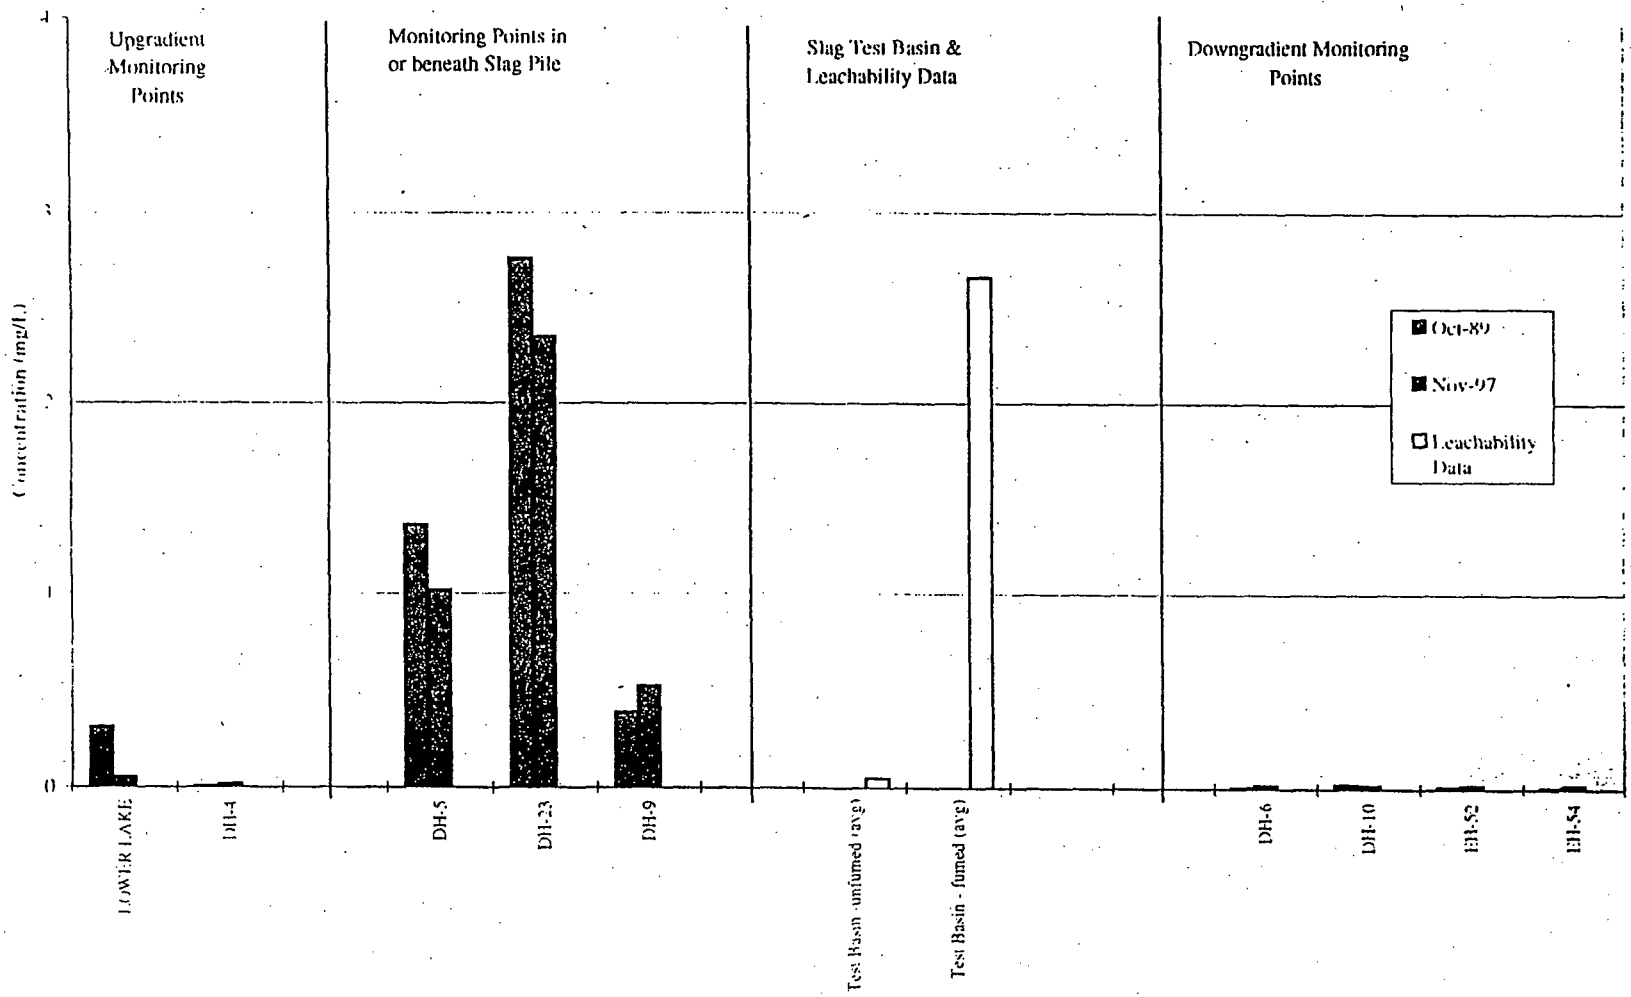

FIGURE 4-1-15. CALCULATED ARSENIC LOADING FROM SLAG VS ARSENIC LOAD IN DOWN-GRADIENT GROUNDWATER

Data Source	Arsenic Conc.(1)	Arsenic Load (2)	% of GW Load (3)
Test Basin Data			
Fumed Slag	0.036 mg/L	0.003 lb/day	0.20%
Unfumed Slag	0.53 mg/L	0.044 lb/day	2.40%
Average	0.28 mg/L	0.022 lb/day	1.30%
Max	0.59 mg/L	0.047 lb/day	2.60%
EP toxicity (avg. of 18 tests)	0.16 mg/L	0.013 lb/day	0.70%
Groundwater Load	2.13 mg/L (4)	1.8 lb/day (4)	

Notes

(1) Source RI/FS Appendix 6-1

(2) Slag load calculations assume:
20% infiltration (slag test basin average)
11.3 in/yr ppt
57 acre slag pile area

(3) Calculations based on 1.8 lb/day GW arsenic load assuming.
east side groundwater flux of 70 gpm
east side groundwater arsenic concentration of 2.13 mg/L

(4) Groundwater Load assumptions
Groundwater As Concetration 2.13 mg/L (avg from DH-10)
Groundwater flux = 70 gpm

(K:DATA\PROJECT\0867\WQ.XLS)

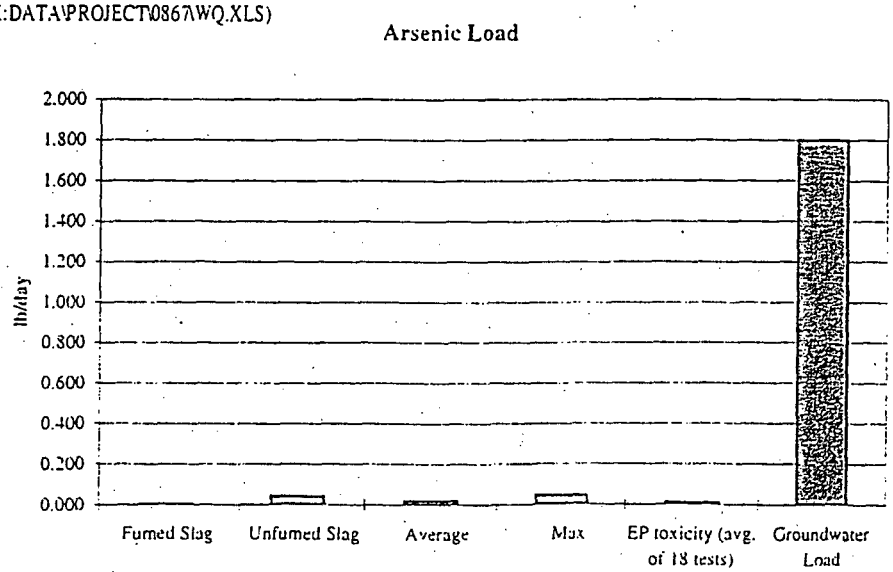

zinc is also very low. Based on the results of test basin water quality analyses, bottle roll tests, and down gradient groundwater quality, it is unlikely that slag effects observed groundwater quality trends on the site.

Stratigraphic cross-sections showing the slag pile and underlying stratigraphy (Figure 4-1-16) shows the relationship of the slag pile and underlying strata, including the perched alluvial horizon and the underlying coarser grained alluvial aquifer. Based on monitoring well stratigraphy, it is likely the perched horizon at least partially underlies the slag pile. However, there is no evidence of the perched horizon in downgradient wells (see DH-6 and DH-10). As a result, direct impacts from the slag pile at these wells is unlikely since the perched horizon is absent, and the wells are completed in the coarse grained alluvium. However, as noted above, test basin and laboratory test results indicate potential water quality impacts from the slag are low and are not responsible for the water quality concentration observed in downgradient wells.

4.1.4.2 Potential Surface Water Impacts

The potential for runoff transport in the slag pile area is very low due to the coarse, granular nature of the slag pile, which allows extremely rapid infiltration. Even during high precipitation events no runoff has been observed from the slag pile. Similarly seeps from the face of the slag pile have not been observed. The potential for impacts to surface water are, therefore, limited to direct contact and erosion of the slag pile where it forms steep sided banks adjacent to Prickly Pear Creek. Prickly Pear Creek is in immediate contact with the slag pile between PPC-5 and PPC-6, and adjacent to the slag pile from PPC-6 to PPC-7 (see Exhibit 3-2-1).

The 1990 Comprehensive RI/FS (Hydrometrics, 1990a) examined water quality data from Prickly Pear Creek to assess the potential impact of the slag pile on the creek. No consistent concentration or load increases were apparent in Prickly Pear Creek adjacent to the slag pile (between PPC-5 and PPC-7). The RI/FS therefore concluded that the contribution of arsenic and metals to surface water from slag is very minor. RI/FS and Post RI/FS water quality data

for Prickly Pear Creek are presented and discussed in Section 4.3 of this report and post-RI/FS water quality data are generally consistent with the RI/FS findings. Average metal concentrations show only small differences between stations PPC 5, PPC 7 and PPC 8 (see Figure 4-1-17). Only one high flow stream event (May 1994) shows a pronounced increase in total arsenic load between PPC-5 and PPC-7 (see Figure 4-3-9 in Section 4.3); however, arsenic concentrations decreased from PPC-5 to PPC-7 in the May 1994 event. The calculated load increase is therefore entirely a function of the flow measurement. Since the accuracy of the flow measurements is poor during higher flow events due to increased velocities and turbulence (particularly at PPC-5 below the dam) the apparent load increase during May 1994 is probably the result of flow measurement error. The conclusion of the surface water analysis is that there is little evidence for transport of arsenic and metals from the slag pile with the possible exception being direct erosion of the slag during infrequent high stream flow events.

~~1.2~~4.2 PROCESS FLUIDS

As part of the Comprehensive RI/FS (Hydrometrics 1990a), the Process Fluids Operable Unit was divided into two sub-units: Process Ponds and Process Fluid Transport Circuits.

~~1.1.1~~4.2.1 Process Ponds

The Process Ponds include:

- Lower Lake,
- Former Thornock Lake, and
- The acid plant water treatment facility.

As described in Sections 1 and 3, the Process Ponds were addressed by the Process Ponds RI/FS (Hydrometrics, 1989), a subsequent Process Ponds ROD (US EPA, 1989), and several RD/RA documents, and remedial actions that consisted primarily of sediment excavation. The 1989 Process Pond RI consisted of:

ASARCO TECHNICAL SERVICES CENTER

ANALYTICAL DATA REPORT

East Helena

Technical Services (Project 3101)

Batch No: L010790

LAB NO	DATE COLLECTED	DESCRIPTION	PARAMETER	VALUE	UNITS	ANALYST	DATE ANALYZED	HOLD DAYS	METHOD
L010790-002	23-MAY-01	FUMED ASARCO SLAG	AG	0.003	%	MJF	18-JUN-01		ICP
			AL	2.32	%	MJF	18-JUN-01		ICP
			AS	0.022	%	MJF	18-JUN-01		ICP
			BA	0.34	%	MJF	18-JUN-01		ICP
			BE	<0.02	%	MJF	18-JUN-01		ICP
			CR	0.036	%	MJF	18-JUN-01		ICP
			CU	0.32	%	MJF	18-JUN-01		ICP
			HG	2.7	ppm	MO	21-JUN-01		COLD VAPOR AA
			MN	1.37	%	MJF	18-JUN-01		ICP
			NI	<0.02	%	MJF	18-JUN-01		ICP
			PB	0.036	%	MJF	18-JUN-01		ICP
			SB	0.026	%	MJF	18-JUN-01		ICP
			SE	<0.02	%	MJF	18-JUN-01		ICP
			TL	<0.02	%	MJF	18-JUN-01		ICP
			V	<0.02	%	MJF	18-JUN-01		ICP
			ZN	1.63	%	MJF	18-JUN-01		ICP

ASARCO TECHNICAL SERVICES CENTER

ANALYTICAL DATA REPORT

East Helena

Technical Services (Project 3101)

Batch No: L010791

LAB NO	DATE COLLECTED	DESCRIPTION	PARAMETER	VALUE	UNITS	ANALYST	DATE ANALYZED	HOLD DAYS	METHOD
L010791-002	23-MAY-01	FUMED ASARCO SLAG (TCLP)	AG	<0.050	ppm	ESH	08-JUN-01		6010
			AS	<0.10	ppm	ESH	08-JUN-01		6010
			BA	1.4	ppm	ESH	08-JUN-01		6010
			BE	<0.005	ppm	ESH	08-JUN-01		6010
			CD	<0.050	ppm	ESH	08-JUN-01		6010
			CR	<0.10	ppm	ESH	08-JUN-01		6010
			HG	<0.50	ppb	MO	07-JUN-01		7470
			NI	<0.10	ppm	ESH	08-JUN-01		6010
			PB	0.23	ppm	ESH	08-JUN-01		6010
			PH	9.2	pH	MO	05-JUN-01		150.1
			SE	<0.10	ppm	ESH	08-JUN-01		6010
			TL	<0.10	ppm	ESH	08-JUN-01		6010
			V	<0.10	ppm	ESH	08-JUN-01		6010
			ZN	17	ppm	ESH	08-JUN-01		6010

Vince Kelly
Approved

Vince Kelly
Reviewer