THARP 44D-14-692

Draft Observations:

1.) There is open bradenhead annulus from 900 ft to 5170 ft. Top of cement and good bond are concurrent.

2.) Bradenhead annulus is open to Williams Fork, Ohio Creek, and Wasatch formations.

3.) Gas shows in the Wasatch and Williams Fork formations are in contact with open bradenhead annulus.

4.) The well is not producing gas shows above the top of cement.

5.) The calculated TDS values in the lower Wasatch formation range from 700 to 9600 mg/l.

6.) The August 2010 drilling completion report specified the 72 hour bradenhead pressure as 0 psig; however, a notice to vent or flare was subsequently submitted in 2010. The 2013 and 2014 bradenhead pressure test reports recorded the final bradenhead pressure as 0 psig.

7.) The 2014 inspection report did not specify if the well was venting or not.

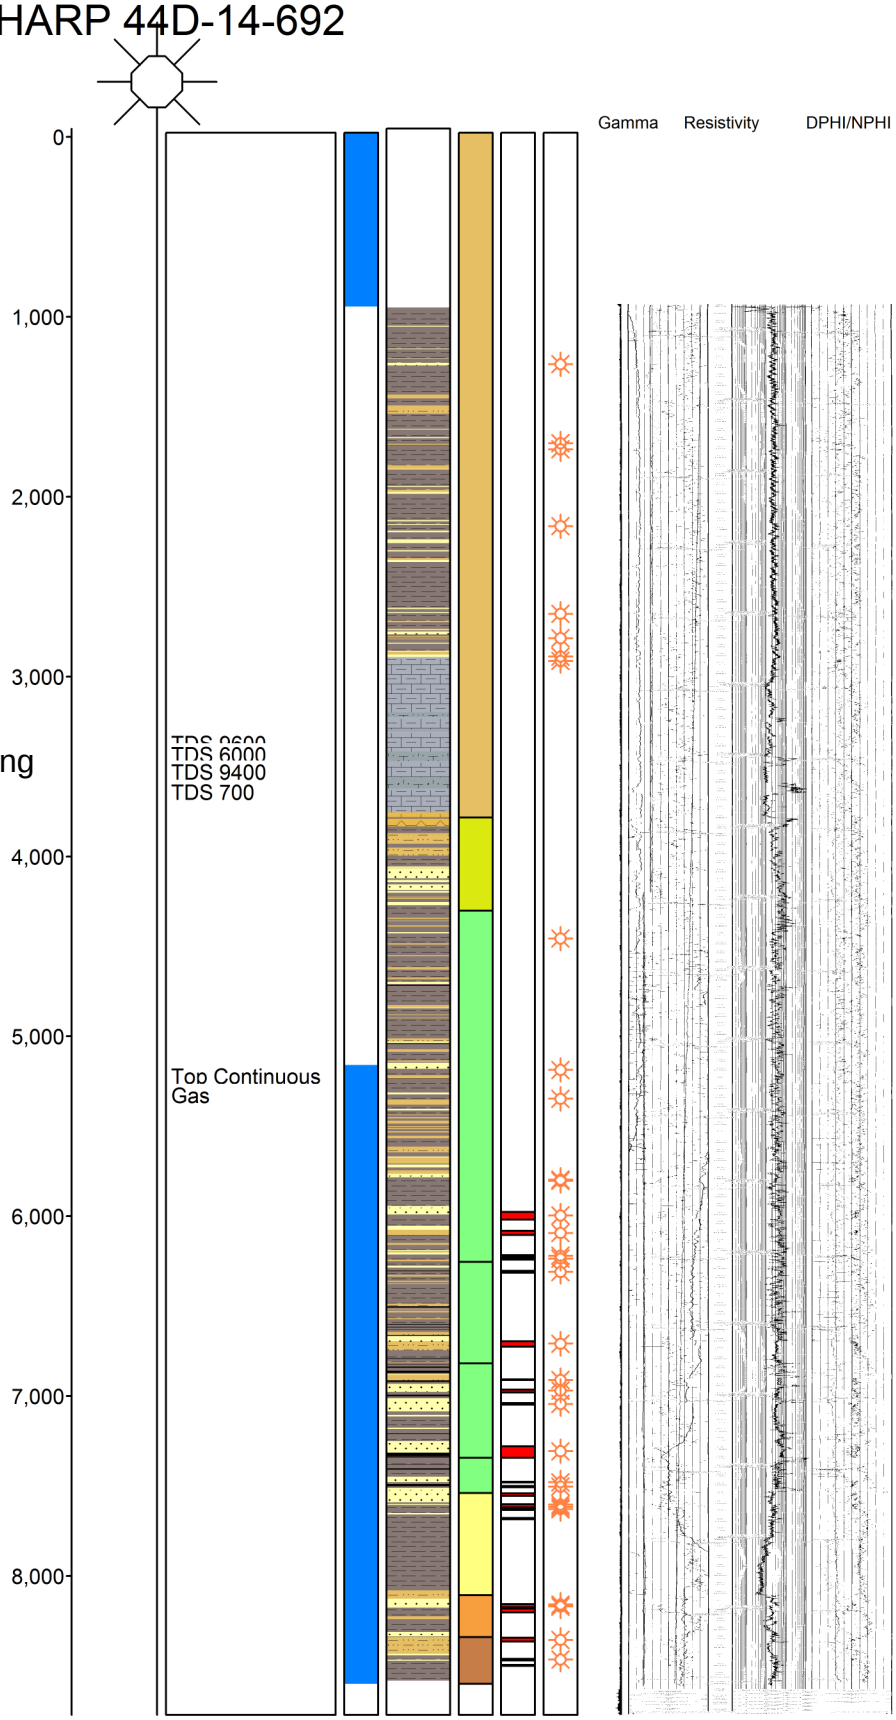

Draft Questions:

Is the well venting?

Why did the operator submit a notice to vent if the bradenhead pressure test recorded a final bradenhead pressure of 0 psig?