PRODUCTS RESOURCES MY ACCOUNT

Search by business, phone, or DUNS Su

TALK TO A D&B ADVISOR
1-800-280-0780

BUSINESS DIRECTORY WV CAMP CREEK BUSINESS SERVICES, NEC
BUSINESS SERVICES AT NON-COM... (b) (6), (b) (7)(C) [redacted]

(b) (6), (b) (7)(C) [redacted]

CLAIM THIS BUSINESS

41° SCATTERED CLOUDS

1103 BOB BYRD RD CAMP CREEK, WV 25820 Get Directions

Business Info

Founded

Incorporated

Annual Rev

Employee C

Industries

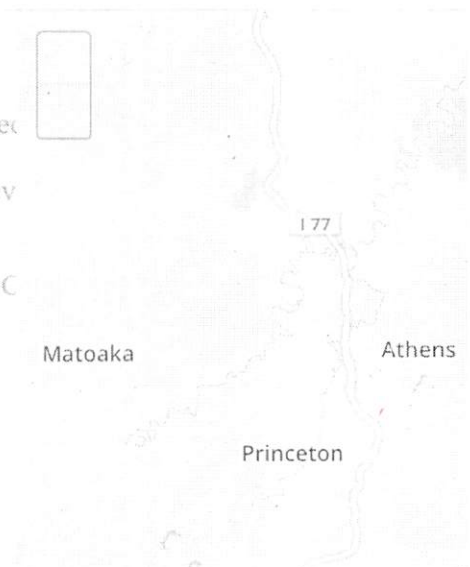

Contacts

Contact Business

MESSAGE

VIEW ADDITIONAL DATA

Credibility

Google

Facebook.c

Yellowboo

Bing.com

Yellowpag

MerchantC

Tele Atlas

Twitter.cor

Photos

Business Credit Report

Receive a one-time comprehensive credit report on this company.

CHAT WITH US LIVE!

EMSL Analytical, Inc.
10768 Baltimore Avenue, Beltsville, MD 20705
Phone/Fax: (301) 937-5700 / (301) 937-5701
http://www.emsl.com beltsvillelab@emsl.com

EMSL Order: 191306658
CustomerID: NPSR34
CustomerPO:
ProjectID:

Attn: [redacted]
National Park Service - NCR
1100 Ohio Drive SW
Washington, DC 20242

Phone: [redacted]
Fax:
Received: 07/23/13 4:20 PM
Analysis Date: 7/24/2013
Collected: 7/23/2013

Project: MANA VISITOR CENTER

Test Report: Fiber Count by Phase Contrast Microscopy (PCM), NIOSH 7400 Method, Revision 3, Issue 2, 8/15/94

Sample	Location	Sample Date	Volume (liters)	Fibers	Fields	LOD (fib/cc)	Fibers/ mm²	Fibers/ cc	Notes
VC-1 191306658-0001	VISITOR CENTER - RECEPTION	7/23/2013	1005.00	<5.5	100	0.003	<7.01	<0.003	
VC-2 191306658-0002	VISITOR CENTER - 2ND FL	7/23/2013	1050.00	<5.5	100	0.003	<7.01	<0.003	
VC-3 191306658-0003	VISITOR CENTER - BSMT HALL	7/23/2013	1245.00	<5.5	100	0.002	<7.01	<0.002	
VC-4 191306658-0004	VISITOR CENTER - BSMT STORAGE	7/23/2013	1020.00	<5.5	100	0.003	<7.01	<0.003	
FB-1 191306658-0005	FIELD BLANK 1	7/23/2013		<5.5	100		<7.01		Field Blank
FB-2 191306658-0006	FIELD BLANK 2	7/23/2013		<5.5	100		<7.01		Field Blank

The results reported have been blank corrected as applicable

Analyst(s)
Elluz Chong Qui (6)

[redacted]
[redacted]
or other approved signatory

Limit of detection is 7 fibers/mm². Intra-laboratory Sr values: 5-20 fibers = 0.33; 21-50 fibers = 0.26; 51-100 fibers = 0.16. Inter-laboratory Sr values (Average of EMSL round robin data) = 0.29. EMSL maintains liability limited to cost of analysis. This report relates only to the samples reported above and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client. EMSL is not responsible for data reported in fibers/cc which is dependent on volume collected by non-laboratory personnel. Results have been blank corrected as applicable. Samples received in good condition unless otherwise noted.
Samples analyzed by EMSL Analytical, Inc. Beltsville, MD AIHA-LAP, LLC - IHLAP Accredited #102891

Initial report from 07/24/2013 08:20:03

THIS IS THE LAST PAGE OF THE REPORT.

EMSL Analytical, Inc.
10768 Baltimore Avenue, Beltsville, MD 20705
Phone/Fax: (301) 937-5700 / (301) 937-5701
http://www.emsl.com beltsvillelab@emsl.com

EMSL Order	191306659
CustomerID	NPSR34
CustomerPO	
ProjectID	

Attn: [redacted]
National Park Service - NCR
1100 Ohio Drive SW
Washington, DC 20242

Phone: [redacted]
Fax:
Received: 07/23/13 4:25 PM
Analysis Date: 7/23/2013
Collected: 7/23/2013

Project: MANA VISITOR CENTER

Test Report: Asbestos Analysis of Bulk Materials via EPA 600/R-93/116 Method using Polarized Light Microscopy

Sample	Description	Appearance	Non-Asbestos %	Fibrous	Non-Asbestos %	Non-Fibrous	Asbestos %	Type
BULK-1-Floor Tile 191306659-0001	BASEMENT HALL	Gray/Tan/Cream Fibrous Homogeneous			45% 52%	Ca Carbonate Non-fibrous (other)	3%	Chrysotile
BULK-1-Mastic 191306659-0001A	BASEMENT HALL	Black Fibrous Heterogeneous	7%	Cellulose	81%	Non-fibrous (other)	12%	Chrysotile

Analyst(s)
George Malone (2)

[redacted]
[redacted] [redacted]
or other approved signatory

EMSL maintains liability limited to cost of analysis. This report relates only to the samples reported and may not be reproduced, except in full, without written approval by EMSL. EMSL bears no responsibility for sample collection activities or analytical method limitations. Interpretation and use of test results are the responsibility of the client. This report must not be used by the client to claim product certification, approval, or endorsement by NVLAP, NIST or any agency of the federal government. Non-friable organically bound materials present a problem matrix and therefore EMSL recommends gravimetric reduction prior to analysis. Samples received in good condition unless otherwise noted. Estimated accuracy, precision and uncertainty data available upon request. Unless requested by the client, building materials manufactured with multiple layers (i.e. linoleum, wallboard, etc.) are reported as a single sample. Reporting limit is 1%.
Samples analyzed by EMSL Analytical, Inc. Beltsville, MD NVLAP Lab Code 200293-0

Initial report from 07/24/2013 06:58:35

THIS IS THE LAST PAGE OF THE REPORT.