United States Environmental Protection Agency

Region 6 Compliance Assurance and Enforcement Division

INSPECTION REPORT

Inspection Date(s):	May 9 – 11, 2016		
Media:	Air (Asbestos)		
Regulatory Program(s)	NESHAP Part 61 Subpart M (Asbestos): TSCA Part 763 Subpart G (Asbestos Worker Protection Rule)		
Company Name:	**City of Pine Bluff**		
Facility Name:	**Various Demolition Sites**		
Facility Physical Location:	217 Laurel (primary)		
(city, state, zip code)	Pine Bluff, Arkansas 71601		
Mailing address:	City of Pine Bluff,		
(city, state, zip code)	200 East Eighth Avenue, Pine Bluff, Arkansas 71601		
County/Parish:	Jefferson		
Facility Contact:	Mr. Jim Smith	Demolition Supervisor	
	105 West Capital, Little Rock, Arkansas 72202		
FRS Number:	N/A		
Identification/Permit Number:	N/A		
Media Number:	Air (Asbestos)		
NAICS:	562910		
SIC:	1799		
Personnel participating in inspection:			
David Eppler	US EPA, 6SF-TE	Enforcement Officer	214-665-6529
Torrence Thrower	ADEQ	Asbestos Program Manager	501-682-0740
Jim Smith	Arkansas Department of Community Corrections	Demolition Supervisor	501-414-4851
EPA Lead Inspector Signature/Date			
	David Eppler		Date
Supervisor Signature/Date			
	Mark Potts		Date

Section I - INTRODUCTION

PURPOSE OF THE INSPECTION

EPA Region 6 Enforcement Officer David Eppler arrived at the City of Pine Bluff demolition site in Pine Bluff at 217 Laurel Street at 10:15 am on May 10, 2016 for an unannounced inspection. I was accompanied by Mr. Torrence Thrower of the Arkansas Department of Environmental Quality. We met with Mr. Jim Smith, demolition Supervisor for the Arkansas Department of Community Corrections. I presented my credentials to Mr. Smith and informed him that this was an EPA inspection to determine compliance of the demolition activities with the National Emissions Standard for Hazardous Air Pollutants (NESHAPS) 40 CFR Part 61 Subpart M and the Toxic Substances Control Act (TSCA) 40 CFR Part 763 Subpart G, Worker Protection Rule. The scope of the inspection is a partial compliance evaluation (PCE) and includes evaluation of the compliance of the facility with asbestos rules in the National Emissions Standard for Hazardous Air Pollutants (NESHAPS) 40 CFR Part 61 Subpart M and the Toxic Substances Control Act (TSCA) 40 CFR Part 763 Subpart G, Worker Protection Rule.

FACILITY DESCRIPTION

The inspection on May 10 took place at 217 Laurel Street in the City of Pine Bluff, a single family residential demolition site owned by the City and under the control of the Arkansas Department of Community Corrections (ADCC) as the demolition contractor. At the time of my visit, the demolition of the residence, as a 'nuisance demolition' for the City, was being accomplished by hand by seven workers supervised by Mr. Jim Smith of ADCC. The hours of work were approximately from 7:00 am to 3:30 pm, Monday through Friday. Demolition consisted of removal by hand of building materials starting from the roof, then moving down and into the structure. Recyclable or reusable materials such as lumber are removed first and piled to one side of the lot for later collection and reuse by the City. After hand demolition of a residence is complete, a small excavator is brought in to complete the demolition and loading into dump trucks which take debris to the Jefferson County Landfill.

Section II – OBSERVATIONS

May 10, 2016

I, David Eppler, arrived at 217 Laurel Street, Pine Bluff, at approximately 10:15 am accompanied by Mr. Torrence Thrower of ADEQ. I met Mr. Jim Smith, the ADCC demolition Supervisor, presented my credentials, and explained the purpose of my visit. Mr. Smith explained that he has seven workers of this crew, made up of parolees from the ADCC, doing the demolition. He explained that he had a second crew made up of inmates from the Arkansas Department of Corrections (ADC) but they were not working today. I asked Mr. Smith about training for himself and the workers, and he explained that a Mr. Norton does a 'safety training' and proceeded to show me a check-off sheet for a particular worker to document attendance. It did not include any asbestos training. Mr. Smith stated that he has no asbestos training certificates for him or his crew.

As I walked up to the job site to meet Mr. Smith, I observed a worker throw an armful of debris from the roof to the ground whereupon a cloud of dust was emitted from the debris as it struck the ground. I also observed that the workers were in street clothes, wearing what appeared to be disposable dust masks, with no wetting for dust suppression, and no demarcated area or asbestos warning signs. No labels were on the unlined waste trucks hauling debris to the landfill, and no wetting of the debris or demolition activity was taking place.

When asked about a written respiratory protection program for workers, Mr. Smith stated that he does not have a written respiratory protection plan as required by 29 CFR 1926.1101(h)(2)(i).

When asked about personal exposure monitoring for asbestos, Mr. Smith stated that no personal air monitoring has been done for the workers to assess asbestos exposure as required by 29 CFR 1926.1101(f)(1)(i).

When asked about the Occupational Safety and Health Act (OSHA) 29 CFR 1926.1101 asbestos in construction rule, Mr. Smith stated that he was not familiar with the OSHA construction standard as it applies to asbestos demolition work. I showed Mr. Smith my copy of the OSHA Construction Standard 29 CFR 1926.1101 and the 40 CFR Part 763 Subpart G Worker Protection Rule, explained EPA's authority regarding the OSHA regulations because the demolition crew was made up of public employees, and asked him if he would go through it with me as I asked him some questions, stating I was concerned about compliance with these rules. He said he would, so I began to ask Mr. Smith some detailed questions regarding the asbestos regulations.

When asked about his training, Mr. Smith stated that he has not had the asbestos Competent Person or asbestos supervisor training required by 29 CFR 1926.1101(o)(1)ff and (k)(9), nor has he had the NESHAP training as required by NESHAP Part 61.145(b)(4)(xiii) and (c)(8).

When asked about securing the asbestos work area, Mr. Smith stated that he has no asbestos warning signs, barrier tape, or any other type of tool for setting up an asbestos specific work area as required by 29 CFR 1926.1101(c)(1) – (c)(6), and as required by 29 CFR 1926.1101(k)(2)(ii)ff.

When asked if any inspection had been done, prior to the commencement of demolition at 217 Laurel, to find out if there were any asbestos containing materials (ACM) present, Mr. Smith stated that he was unaware of any asbestos inspections having been done on the house as required by 29 CFR 1926.1101(k)(2)(i) and as required by 40 CFR Part 61.145(a).

When asked if he had any records to show exposure monitoring or records to support a negative exposure assessment for asbestos for this type of demolition work, Mr. Smith stated that he has no exposure monitoring records, or records to indicate a negative exposure assessment as required by 29 CFR 1926.1101(f)(1)(i), (f)(2)(i) and (f)(2)(ii).

When asked about the respiratory protection equipment offered to the workers conducting the demolition as required by 29 CFR 1926.1101(h)(1), Mr. Smith showed me a box of 'dust masks' that had been issued to the workers. The box has an explicit warning that the disposable masks were not to be used for asbestos work (see photos #26, #27 & #28).

When asked about wetting for dust suppression to prevent visible emissions from the demolition work as required by 29 CFR 1926.1101(g)(1) and 40 CFR Part 61.145(c)(6)(i), Mr. Smith stated wetting is not constantly applied. According to Mr. Smith, some wetting of the demolition activity typically occurs first thing in the morning to minimize dust from the demolition activity, but no application of wetting agent was observed during the my inspection on May 10.

When Mr. Smith was asked about medical monitoring as required by 29 CFR 1926.1101(m)(1)(i), Mr. Smith stated that not to his knowledge had the workers ever had a baseline medical by a licensed physician for asbestos work. He also stated that he, as the competent person and supervisor, had never had a baseline medical exam for asbestos work.

When asked about protective clothing as required by 29 CFR 1926.1101(i)(1), Mr. Smith stated is not providing any protective clothing that is appropriate for asbestos per the OSHA construction standard.

When asked about hygiene facilities for the workers at the demolition site as required by 29 CFR 1926.1101(j)(1), Mr. Smith stated that there were no hygiene facilities per the OSHA standard at the site.

When asked about hazard communication, Mr. Smith stated that there is no hazard communication plan to address asbestos issues at the work site as required by 29 CFR 1926.1101(k)(3) and (k)(9).

When asked about packaging waste materials with asbestos from the demolition site, Mr. Smith stated that he has no asbestos labeled bags for collection of asbestos contaminated materials as required by 29 CFR 1926.1101(j)(1)(i)(A) and as required by 29 CFR 1926.1101(g)(1)(iii).

When asked about creating a demarcated area to secure the demolition site, Mr. Smith stated that he has no asbestos warning signs per the OSHA rules for creating a demarcated area as required by 29 CFR 1926.1101(e)(1) – (e)(6) and as required by 29 CFR 1926.1101(k).

When asked about disposal of the debris according to the asbestos NESHAP as required by 61.150(a), Mr. Smith stated that he gets a dump ticket from the landfill operator that shows the weight of material for each load. He gives them to the ADCC for payment. He further stated that there is no special asbestos waste manifest for the asbestos debris that goes to the landfill (see Appendix 2, ADCC Documents, page 40).

When asked about who owns the residences that he demolishes, Mr. Smith stated that he has no knowledge of who the owners of record are for the houses that are demolished. He gets a list from the City of Pine Bluff Code Enforcement with residences to be demolished. Code Enforcement handles getting the electric, water, gas, etc. taken care of prior to the demolition of the residences.

When asked about final disposition of the waste from the demolition as required by 61.150(b), Mr. Smith stated that all the waste from the demos goes to the Jefferson County Landfill. He doesn't know if the landfill is permitted to handle asbestos or not. He further stated that brick, concrete etc. goes to a different landfill that the City owns.

Mr. Smith also stated that hand demolition is done first at all residences to remove reusable materials like lumber. Reusable materials are cleaned (nails pulled, sheetrock/roofing knocked off, etc.), piled to one side, and later loaded on City trucks. He stated that, in general, these materials, like lumber, are used to board up abandoned houses to prevent unauthorized entry. Mr. Smith stated that he, as supervisor, coordinated the delivery and operation of heavy equipment, the presence of fire trucks at the site for wetting, and dump trucks to haul waste from the site.

I obtained originals of a waste 'dump ticket', a sign-in sheet for the demolition crew from May 9, and a copy of a training check-off form for one of the workers (see Appendix 2, ADCC Documents). I went offsite and made copies of the documents and returned the originals to Mr. Smith. I asked him what he was complying with while conducting the demolitions and he asked me if I had seen the Memorandum of Understanding (MOU) between ADEQ and the City of Pine Bluff which laid out how the City would comply with the ADEQ asbestos regulations. Mr. Smith stated that he thought they were complying with the MOU.

At approximately 2:15 pm I observed another instance of a worker bringing an armload of demolition debris to the edge of the roof and dropping it to the ground, causing a small cloud of dust emission to come up and leave the site. As I did with the previous observance, I mentioned this to Mr. Thrower and Mr. Smith.

I suggested to Mr. Smith that he obtain copies of the EPA NESHAP asbestos rules, and the OSHA construction standard and familiarize himself with them, as these were regulations he needed to comply with.

At about 2:30pm, a City of Pine Bluff fire truck arrived at the site. The driver of the fire truck passed the water hose to a member of the demolition crew and he started wetting the structure from the top down.

At about 3:30 pm, I took several photographs of the site at 217 Laurel.

Mr. Thrower of ADEQ and I left the site at about 3:45 pm.

May 11, 2016

At about 9:50 am on May 11, 2016, Torrence Thrower of ADEQ and I arrived at 1216 West 13th Street, one of four additional addresses, provide to us by Mr. Smith, where recent demolition activities have taken place. At 1216 West 13th, hand demolition had been done, and heavy equipment had been brought in to take the structure down. No activity was occurring at the site at the time of our visit. Suspect ACM was observed on the site (fibrous insulation material, flooring material, roofing material). I took several photos.

At about 10:45, Torrence and I arrived at 1400 South Linden, where I took photos.

At 11:00 we arrived at 712 West 5th Street, where I took photos.

At 11:25 we arrived back at 217 Laurel to observe the excavator tearing the building down and loading debris in a City of Pine Bluff dump truck. The excavator was operated by Mr. Smith, the supervisor. I walked where I could see in the bed of the dump truck the trucks as it waited to receive debris. There was no polyethylene lining in the dump bed, no asbestos signs or labels, no barrier to the site except for pylons at the street corners and the ends of the block to restrict vehicle traffic. I observed the excavator loading debris with the workers walking around the excavator in the site. I observed visible emissions coming from the excavator bucket while it was grabbing a load. I took several photos of the demolition operation.

While observing the work, a second dump truck pulled up and sat at the curb at the site, waiting in line to receive debris when the first truck was full. I inspected this second truck, and observed no polyethylene lining in the dump bed, no asbestos signs or labels, and the driver was not in a respirator or protective clothing, and the windows of the truck were down.

A full dump truck left the site for the landfill at about 1:00 pm. I left the site and followed the truck bound for the Jefferson County Landfill. Along the way, I observed debris blowing from the truck onto the road, as the load was not covered in any way. I observed the truck enter the landfill and getting weighed, then left the landfill at about 1:35 pm to return to 217 Laurel, arriving back there at about 2:20 pm. I observed demolition as it continued, taking several photos. The fire truck had arrived at the site while I was away but no one was spraying water. The second dump truck left for the landfill at about 2:40 pm.

When the demolition was done for the day, in other words the crew was quitting for the day, I went to Mr. Smith and asked him what his thoughts were as to what he was complying with on the demolition sites. He stated that he was complying with the ADEQ 1-1-1 rule. The crew left the site at about 3:30. I left the site at about 3:40.

Section III – AREAS OF CONCERN

Mr. Jim Smith, as competent person and supervisor, was unfamiliar with the OSHA Construction Standard 29 CFR 1926.1101, or EPA's authority to enforce the OSHA standard under 40 CFR Part 763 Subpart G.

Mr. Smith, as competent person and supervisor, was unfamiliar with the NESHAP Subpart M (Asbestos) standard, and he was unaware of his obligations under the OSHA and NESHAP rules.

Neither Mr. Smith as supervisor, nor the members of the demolition crew have received specific training in the OSHA and NESHAP requirements for asbestos demolition activities.

No inspections or surveys for asbestos-containing material had been done prior to inception of demolition activities at 217 Laurel, Pine Bluff.

Asbestos demolition activities were occurring without appropriate demarcation of the work area, asbestos warning signs or labels, and no labeled packaging was provided for contaminated waste such as demolition debris or personal protective clothing and equipment, and no hazard communication related to asbestos work had or was taking place.

No engineering controls were consistently applied to prevent dust from the demolition activity from presenting a worker exposure hazard, from leaving the work area and presenting an exposure hazard to persons outside the work area, or from contaminating the environment outside the work area. Visible emissions leaving the worksite from demolition activities were observed several times by myself.

No personal protective equipment as required for asbestos work was in use anywhere in the demolition site, nor was any provided to the demolition crew or other employees that entered the work area.

No hygiene facilities related to asbestos work were provided for the workers or other personnel entering the work area.

I observed no personal exposure monitoring taking place on any of the personnel entering the work area, and according to Mr. Smith the Supervisor nor was there any historical documentation of a negative exposure assessment ever having taken place related to the demolition activities at 217 Laurel, Pine Bluff.

No information related to medical surveillance for asbestos exposure work for the workers or any other personnel that were entering the work area could be provided or accounted for.

The trucks taking the waste from the site were not lined, labeled, or covered, and debris was falling from the truck in route to the landfill. Mr. Smith was not using an approved type of waste shipment record for asbestos waste transfer. Mr. Smith had no information as to whether or not the landfill was approved to take asbestos waste, or that the landfill knew he was sending them asbestos waste from 217 Laurel.

Mr. Smith was allowing materials removed from the asbestos demolition site to be reused without them being properly decontaminated or proved non-asbestos contaminated.

No provisions were in place to restrict entry by unauthorized persons prior to completion of demolition activities and site cleanup, or off hours where no one was present, at sites where demolition activities had occurred or was occurring.

Section IV – FOLLOW UP

Notices of Non-compliance are being sent to the City of Pine Bluff, and the Arkansas Department of Community Corrections, a warning letter to the Arkansas Department of Corrections, and copies to the Arkansas Department of Environmental Quality.

Section V – LIST OF APPENDICES

Appendix 1 – Photo Log – 28 photos taken 5/10 - 5/11, 2016
Appendix 2 – ADCC Documents (worker sign-in sheet, training check-off sheet, 'dump ticket', ,)

APPENDIX 1

PHOTOGRAPH LOG

Photo ID: #1	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand

Photo ID: #2	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand and Supervisor, Jim Smith

Photo ID: #3	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand

Photo ID: #4	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand

Photo ID: #5	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand, side of house

Photo ID: #6	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel Street
Photographer: David Eppler	Subject: Demolition by Hand, Fire Truck and Wetting Action

Photo ID: #7	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1216 West Thirteenth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #8	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1216 West Thirteenth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #9	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1216 West Thirteenth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #10	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1400 South Linden
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #11	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1400 South Linden
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #12	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 1400 South Linden
Photographer: David Eppler	Subject: Demolition Site

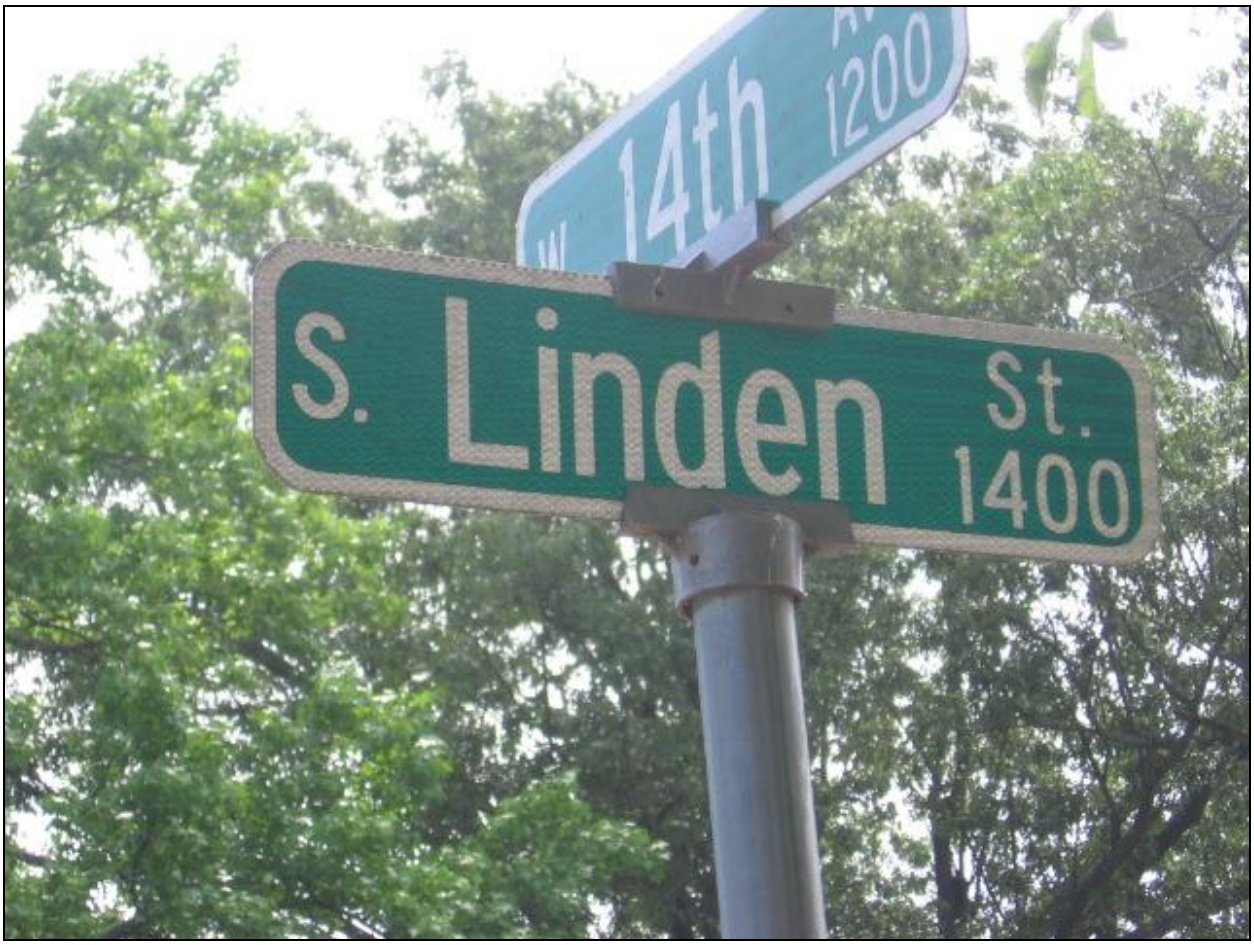

Photo ID: #13	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 712 West Fifth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #14	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 712 West Fifth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #15	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 712 West Fifth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #16	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 712 West Fifth Street
Photographer: David Eppler	Subject: Demolition Site

Photo ID: #17	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator in Use

Photo ID: #18	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator Loading Debris

Photo ID: #19	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator Loading Debris

Photo ID: #20	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator Loading Debris

Photo ID: #21	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator Loading Debris

Photo ID: #22	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Demolition Site, with Excavator Loading Debris

Photo ID: #23	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Debris Truck In Route to Landfill

Photo ID: #24	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Excavator and Demolition Crew

Photo ID: #25	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 11, 2016	Location: 217 Laurel
Photographer: David Eppler	Subject: Excavator and Demolition Crew with Fire Truck for Wetting

Photo ID: #26	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel
Photographer: Torrence Thrower (ADEQ)	Subject: Mr. Smith's Respirator Box

Photo ID: #27	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel
Photographer: Torrence Thrower (ADEQ)	Subject: Mr. Smith's Respirator Box

Photo ID: #28	City/County/State: Pine Bluff, Jefferson, Arkansas
Date: May 10, 2016	Location: 217 Laurel
Photographer: Torrence Thrower (ADEQ)	Subject: Mr. Smith's Respirator Box

APPENDIX 2

ADCC DOCUMENTS

MULLIGAN ROAD
105 W. CAPITOL AVENUE
LITTLE ROCK, AR 72201
CTS
SAFETY MEETING

DATE: 05-09 2016

NAME	HERE	NOT HERE	COMMENTS
Ryan Mullen	✓		
[illegible]	✓		
Cody Kirby	✓		
J Roberts	✓		
R. Rogers	✓		
[illegible]	✓		
David [illegible]	✓		

Original

Fredrick Simmons
4-1-16
PID# 195407

PROJECT SAFETY VIDEO

Initial	
F.S	Behavioral Safety
F.S	Burns
F.S	Chainsaw Maintenance and Safety
F.S	Chainsaw, The Safe Operation of
F.S	Cuts and Bleeding
X	Drills Safety
F.S	Drugs and Alcohol at Work
F.S	Electrical Power Tools
F.S	Falls in the Workplace
F.S	Eye Injuries, The Prevention of
F.S	Fatigue at Work
F.S	Fire Extinguishers
F.S	Foot Safety in the Workplace
F.S	Hand Tools – Safety
F.S	Hazardous Atmospheres and Respirators
F.S	Hazards and Risks, Understanding
F.S	Hazardous Substances
F.S	Head Protection in the Workplace
F.S	Heat Hazards
F.S	Housekeeping, Workplace
X	Identifying Fire Hazards
F.S	Ladders, The Safe Use of
F.S	Lifting and Carrying, Principles of Safe
F.S	Noise Induced Hearing Loss
F.S	PPE-An Introduction
F.S	Safety and Human Factor
F.S	Safety Essentials
F.S	Safety Awareness, Understanding
X	Security and Violence Awareness
X	Slips, Trips and Falls, Preventing
F.S	Unsafe Acts

Signature Fredrick Simmons

13th Linden - mulber,

WASTE MANAGEMENT

Jefferson Co. Landfill
6000 Gravel Pit Rd.
Pine Bluff, AR, 71602
Ph: (870) 247-0068

Original
Ticket# 469806

Customer Name MULLIGANROAD MULLIGAN ROAD
Ticket Date 05/04/2016
Payment Type Credit Account
Manual Ticket#
Hauling Ticket#
Route
State Waste Code
Manifest
Destination
PO
Profile ()
Generator

Carrier JEFFERSONCOSANITIDEP
Vehicle# 200 Volume
Container
Driver
Check#
Billing # 0679584
Gen EPA ID

Grid N3 420485 W92 11410

	Time	Scale	Operator	Inbound		
In	05/04/2016 10:09:06	Scale 1	WFORT		Gross	25960 lb
Out	05/04/2016 10:26:52	Scale 1	WFORT		Tare	23060 lb
					Net	2900 lb
					Tons	1.45

Comments

	Product	LD%	Qty	UOM	Rate	Tax	Amount	Origin
1	2000T-C&D TON	100	1.45	Tons	14.75	1.74	$21.39	IN
2	SEASW-Southeast Ar	100	1.45	Tons	1.25	0.15	$1.81	IN
3	ADEQ-ADEQ Fees	100	1.45	Tons	2.50	0.29	$3.63	IN

Total Tax $2.18
Total Ticket $29.01

Driver's Signature R. Wells 469806

403WM