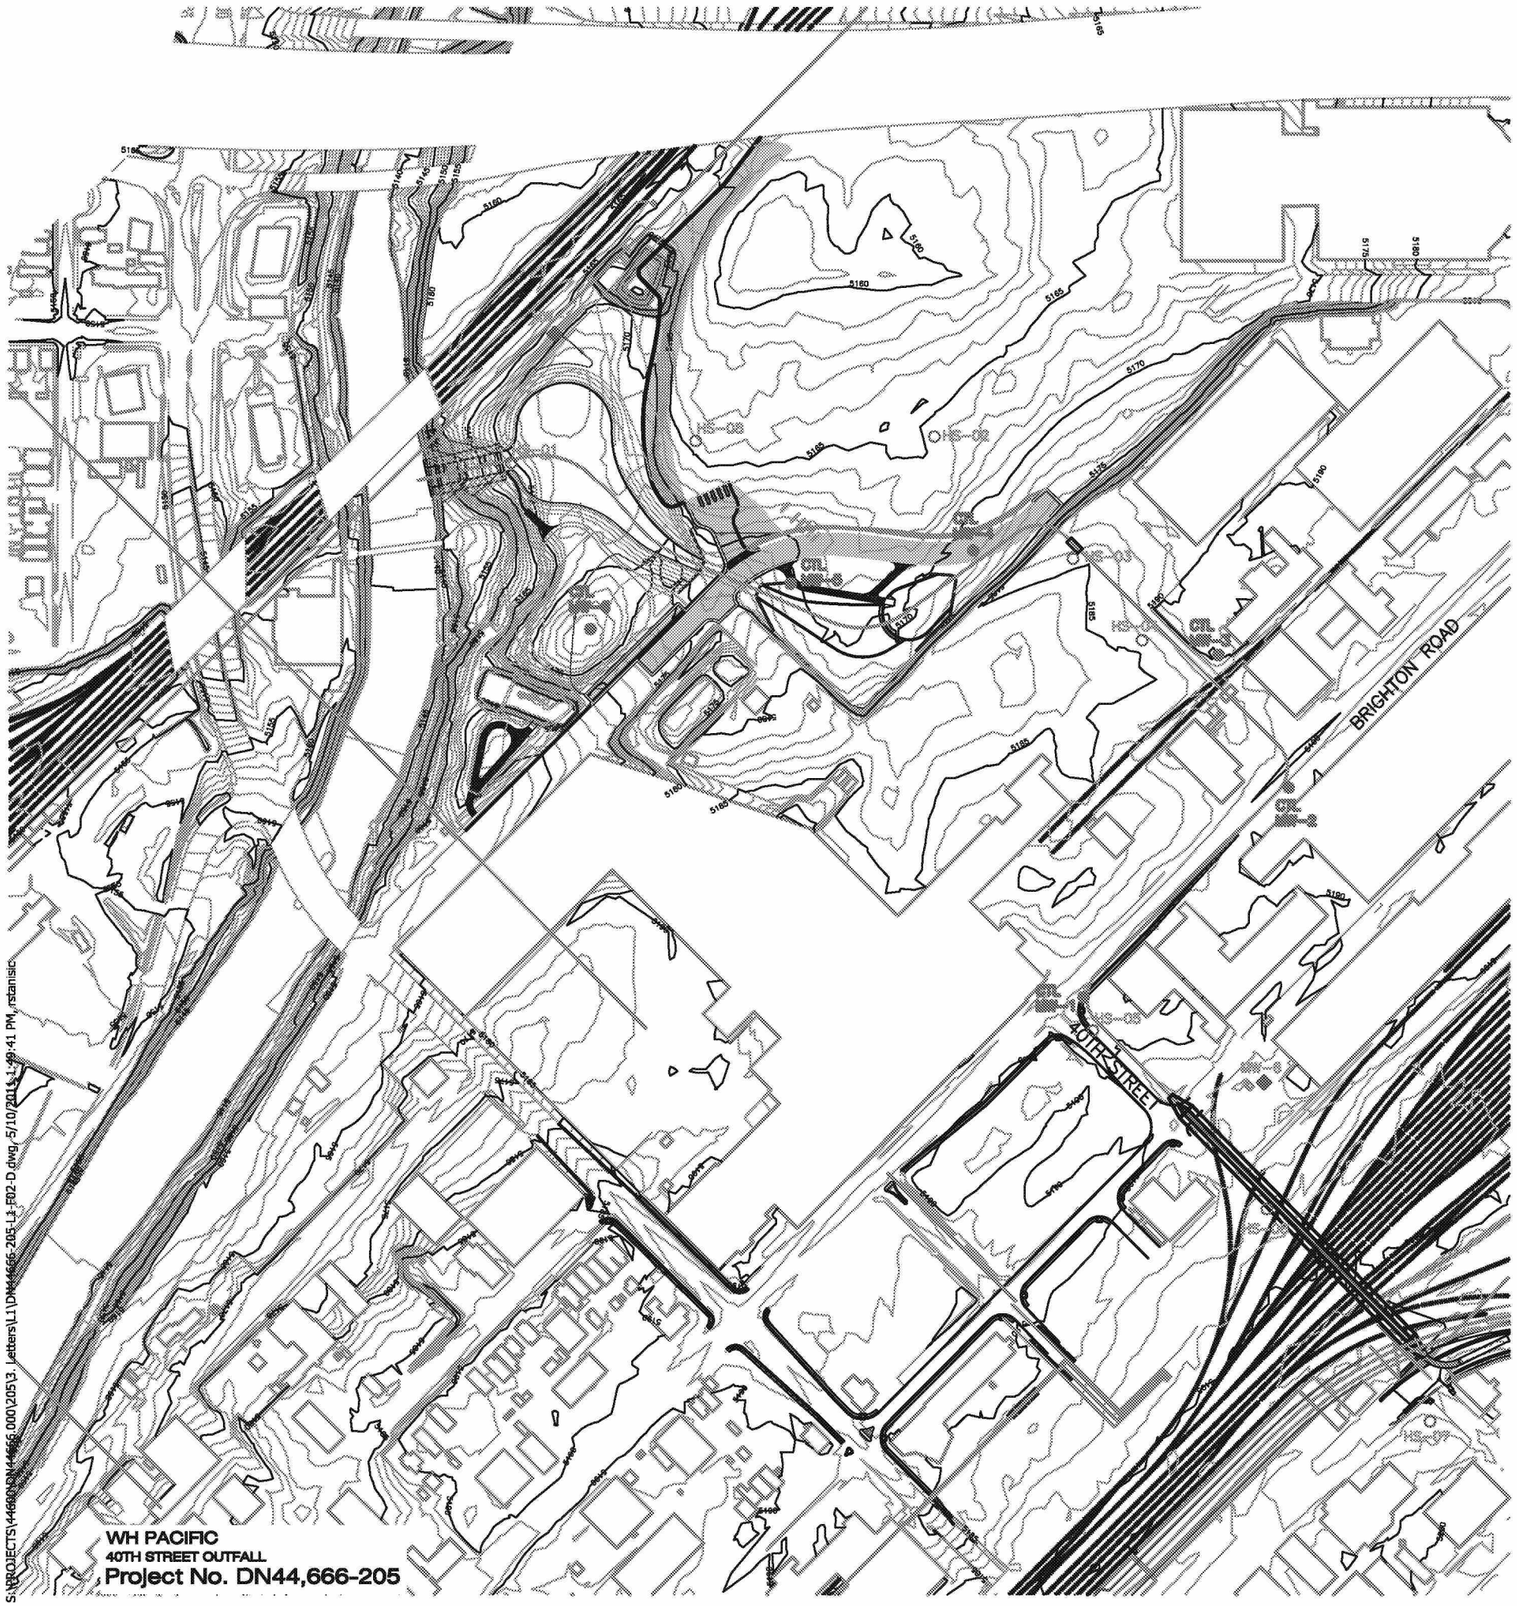

CTL MW-1	
CHLOROFORM	4.1
PCE	1.1
XYLENE	0.99
TOTAL ARSENIC	18.2

CTL MW-2	
CHLOROFORM	1.1
XYLENE	0.81
TOTAL ARSENIC	22.1

CTL MW-3	
CHLOROFORM	2.6
XYLENE	0.73
TOTAL ARSENIC	32.7
DISSOLVED CADMIUM	264
DISSOLVED MANGANESE	92.7

CTL MW-4	
PCE	1.2
CIS-1,2-DCE	0.46
XYLENE	0.75
TOTAL ARSENIC	15.4
DISSOLVED MANGANESE	2140

CTL MW-5	
TOTAL ARSENIC	8.5
DISOLVED IRON	23300
DISSOLVED MANGANESE	775
HEXAVALENT CHROMIUM	<50

CTL MW-6	
PCE	28.3
CIS-1,2-DCE	0.39
TCE	10.0
XELENE	0.71
TOTAL ARSENIC	57.3
DISSOLVED IRON	1900
DISSOLVED MANGANESE	3320
NAPHTHALENE	1.2

HS-01	
CHLOROFORM	<2.0
TETRACHLOROETHYLENE	24.8
TRICHLOROETHYLENE	5.8
CADMIUM	<10

HS-02	
CHLOROFORM	1.1
TETRACHLOROETHYLENE	1.0
TRICHLOROETHYLENE	<2.0
CADMIUM	<10

HS-03	
CHLOROFORM	3.1
TETRACHLOROETHYLENE	2.8
TRICHLOROETHYLENE	<2.0
CADMIUM	18.2

HS-04	
CHLOROFORM	8.0
TETRACHLOROETHYLENE	<2.0
TRICHLOROETHYLENE	<2.0
CADMIUM	109

HS-05	
CHLOROFORM	2.9
TETRACHLOROETHYLENE	<2.0
TRICHLOROETHYLENE	<2.0
CADMIUM	<10

HS-07	
CHLOROFORM	0.73
TETRACHLOROETHYLENE	<2.0
TRICHLOROETHYLENE	<2.0
CADMIUM	<10

HS-08	
CHLOROFORM	<2.0
TETRACHLOROETHYLENE	<2.0
TRICHLOROETHYLENE	<2.0
CADMIUM	<10

MW-1	
CHLOROFORM	<2.0
TETRACHLOROETHYLENE	12.7
TRICHLOROETHYLENE	4.6
CADMIUM	<10

MW-6	
CHLOROFORM	2.1
TETRACHLOROETHYLENE	<2.0
TRICHLOROETHYLENE	<2.0
CADMIUM	<10

N

0 150 300

SCALE: 1" = 300'

LEGEND:

HS-01 SOIL AND GROUNDWATER SAMPLE LOCATION INSTALLED BY BROWN AND CALDWELL 2010

MW-1 SOIL AND GROUNDWATER SAMPLE LOCATION INSTALLED AS PART OF VB/I-70 OU2 ASSESSMENTS

MW-1 CTL MONITORING WELL LOCATION

5170 EXISTING GROUND SURFACE ELEVATION (FEET)

NOTES:

RESULTS PROVIDED IN MICROGRAMS/LITERS (ug/L)
PCE-TETRACHLOROETHENE
TCE-TRICHLOROETHENE
CIS-1,2-DCE-CIS-1,2, DICHLOROETHENE
TOTAL-METAL RESULTS PROVIDED BY 200.8 ANALYSIS
DISOLVED-METAL RESULTS PROVIDED BY 200.7 ANALYSIS
(SAMPLES LAB FILTERED PRIOR TO ANALYSIS)

Summary of Ground Water Results

Fig. 4

S:\PROJECTS\44666\DN44666.000\20513_Letters\L11\DN44666.205-L11-F02-D.dwg,-5/10/2011 1:49:41 PM,rstanisic