Environmental
Resources
Management

350 Eagleview Boulevard
Suite 200
Exton, PA 19341
(610) 524-3500
(610) 524-7796 (fax)
http://www.erm.com

22 July 2014
Reference: 0233146.003

Mr. Paul Hare
General Electric Company
319 Great Oaks Boulevard
Albany, New York 12203-5965

RE: May 2014 Results for Biennial, Annual and Semi-Annual Ground Water Sampling and Analyses for Units 2 and 7, RCRA Corrective Action Permit MDD046279311, Former Appliance Park East Facility, Columbia, Maryland

Dear Mr. Hare:

The purpose of this letter is to provide to the General Electric Company (GE) the results of ground water sampling performed by Environmental Resources Management, Inc. (ERM) in May 2014. The samples were collected and analyzed in accordance with the 4 May 2011 Ground Water Sampling and Analysis Plan (SAP) for Units 2 and 7 at the former Appliance Park East facility in Columbia, Maryland.

The new SAP was originally submitted to the United States Environmental Protection Agency (EPA) on 24 November 2010, and conditionally approved by EPA by letter dated 10 January 2010. However, as requested by EPA, the monitoring program was optimized, as described in ERM's letter to EPA dated 6 April 2011, which was approved by EPA in an email from Mr. Erich Weissbart of EPA to you dated 19 April 2011. The SAP dated 4 May 2011 incorporated the optimized monitoring program approved by EPA, and was formally approved by EPA in a 20 July 2011 letter.

METHODS

The ground water samples were collected following the procedures outlined in the 4 May 2011 SAP. The samples were collected from the wells listed in Table 1 (attached) with a biennial, annual and semi-annual sampling frequency. Figure 1 (attached) is a site map showing the well locations.

ERM collected ground water levels on 12 May 2014 from all of the wells listed in Table 1 prior to the sampling event. ERM collected the ground water samples using passive diffusion bags (PDBs). The PDBs were deployed on 12 May

2014, and retrieved on 27 May 2014. The samples were analyzed for volatile organic compounds (VOCs) as required by the SAP.

RESULTS

The ground water elevation data are summarized in Table 1 for 12 May 2014. Figures 2 and 3 (attached) are ground water elevation contour maps for the saprolite and bedrock units, respectively.

Table 2 (attached) summarizes the ground water analytical results for trichloroethene (TCE) for the May 2014 sampling event, as well as results from prior sampling events from June 2007. The laboratory reporting forms for May 2014 are included as Attachment A.

In addition and consistent with the results from prior ground water sampling events at Units 2 and 7, cis-1,2-dichloroethene (cDCE) and trans-1,2-dichloroethene (tDCE) were also detected above limits of quantitation (LOQs) in a small subset of the monitoring wells. cDCE was detected in monitoring wells 2MW-5, 2MW-8S, 2MW-11, 2TP-5, 2TP-7, 2TP-9, 2TP-14, B-5, and S-4 at concentrations ranging from 7 micrograms per liter (µg/L) to 380 µg/L. tDCE was only detected in monitoring well 2TP-9 at 7 µg/L.

Quality assurance/quality control (QA/QC) samples included a field blank, trip blank, Matrix Spike/Matrix Spike Duplicate (MS/MSD) and a blind duplicate of 2MW-8S (labeled 2MW-8). VOCs were not detected in the field or trip blanks. TCE was the only VOC detected above its LOQ in 2MW-8S and its duplicate, at concentrations of 18,000 µg/L and 18,000 µg/L, respectively.

* * * *

ERM appreciates the opportunity to continue providing GE with our environmental consulting services. The next semi-annual sampling event is scheduled for November/December 2014. The next annual event is scheduled for May/June 2015. The next biennial event is scheduled for May/June 2016. Please call me if questions arise or clarification is needed.

Sincerely,

Leonard G. Rafalko
Principal in Charge
Attachments
cc: file
/LGR

FIGURES

FIGURE 1
GROUND WATER SAMPLING FREQUENCY
PARCELS A-10 AND A-40
FORMER APPLIANCE PARK EAST FACILITY
COLUMBIA, MARYLAND

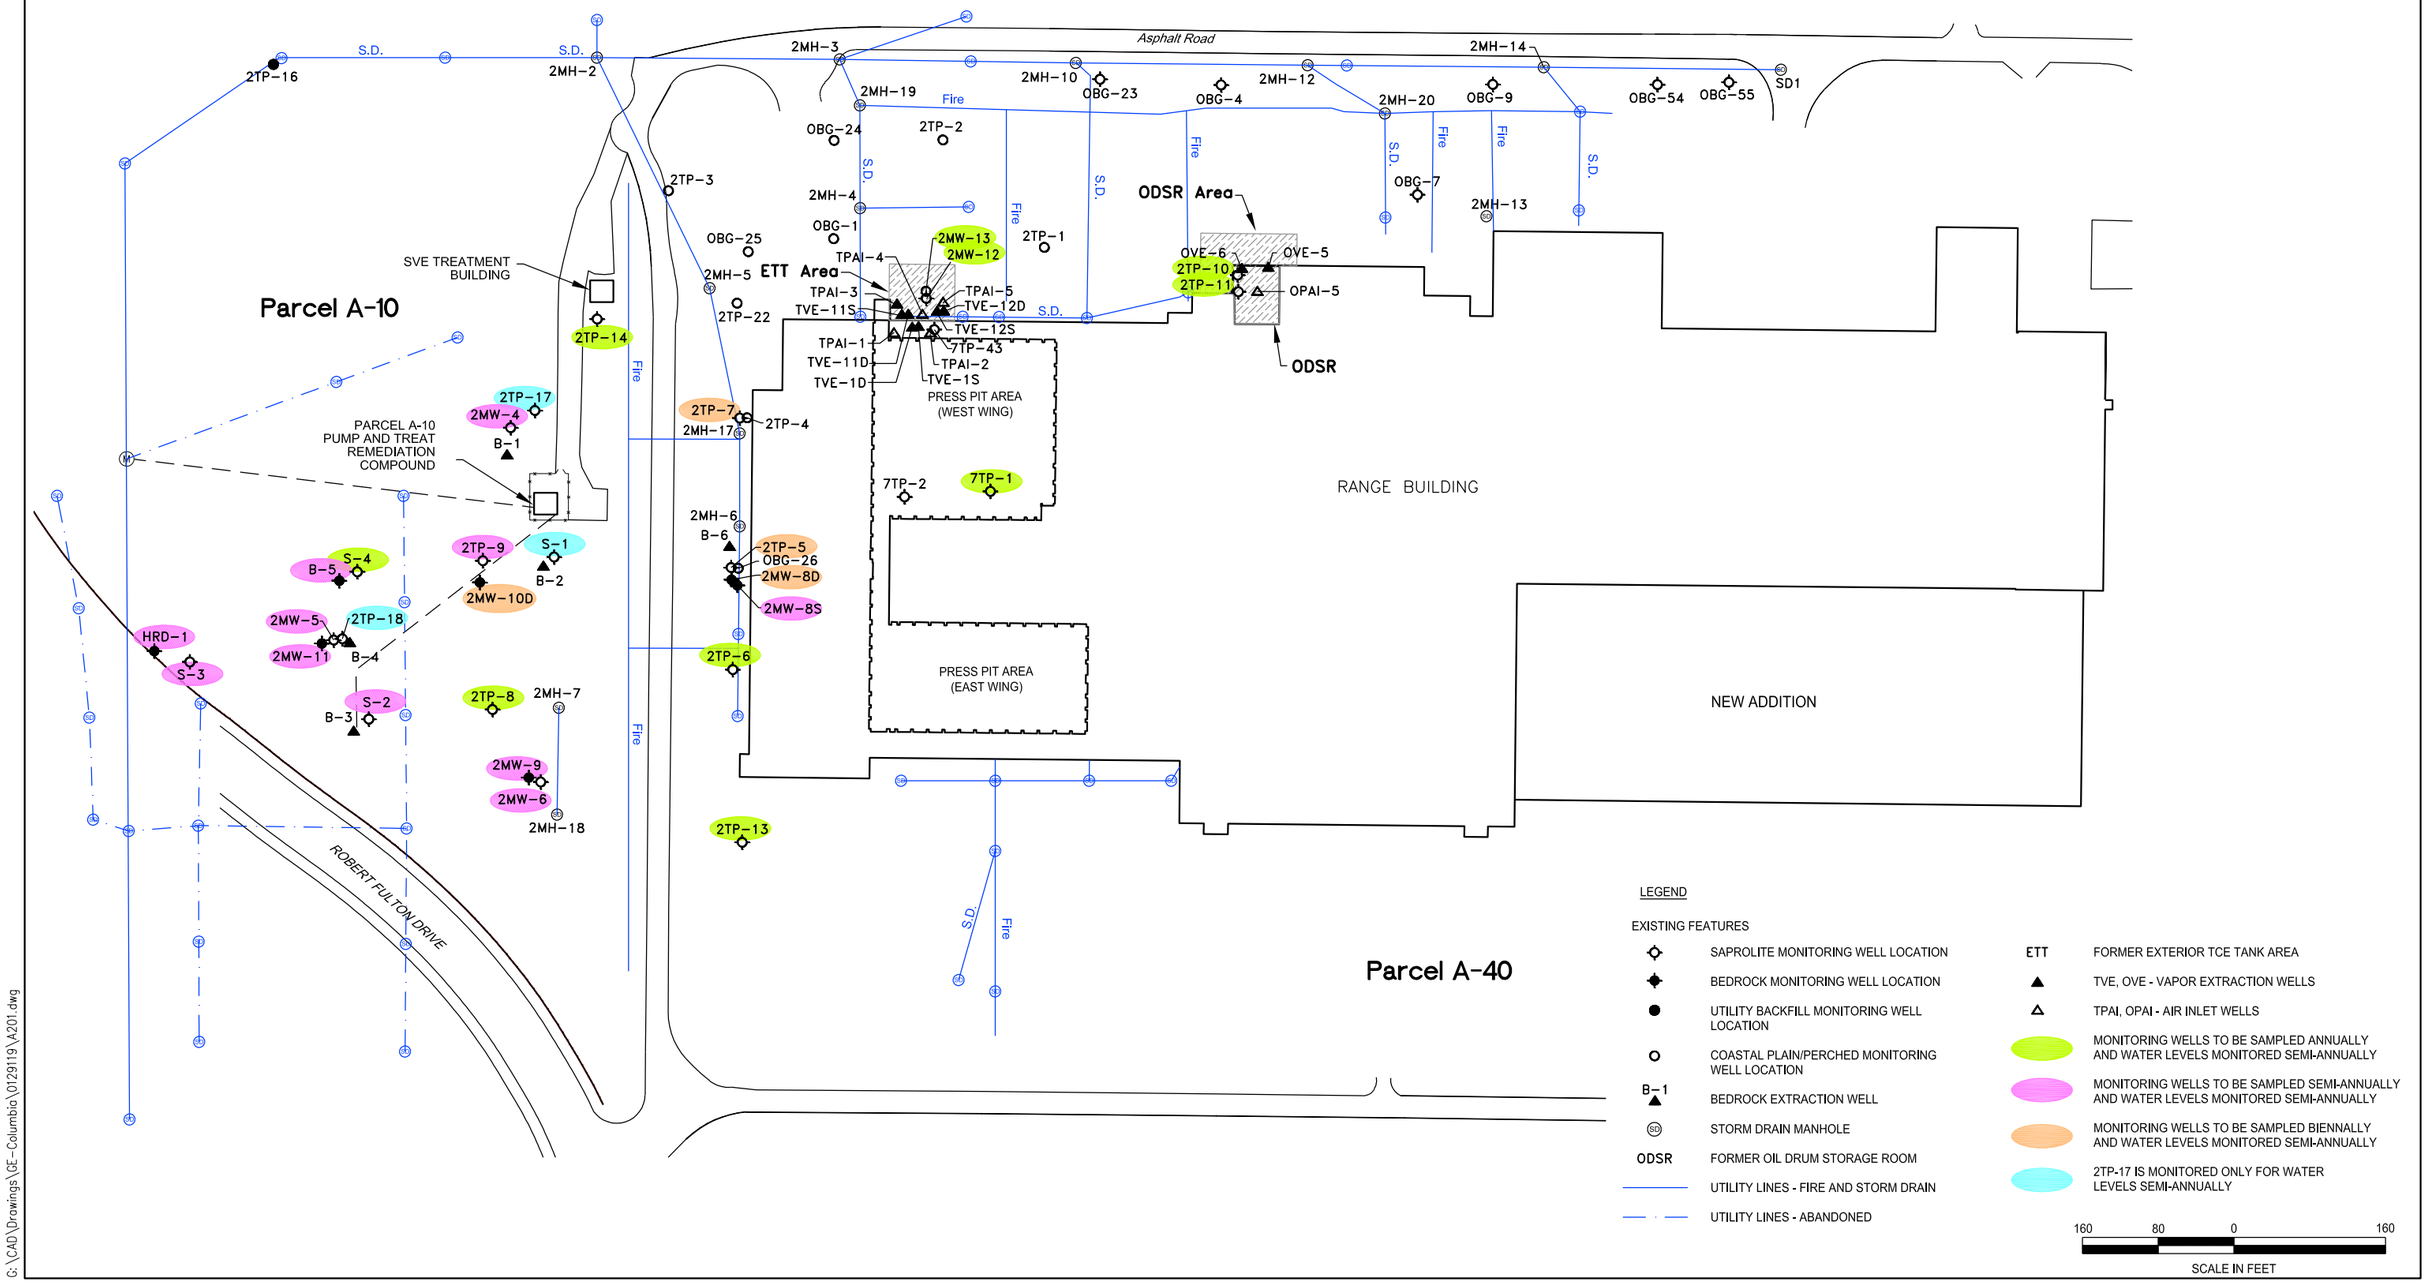

G:\CAD\Drawings\GE-Columbia\0129119\A201.dwg

MLB/1-16-12

ERM, INC.

FIGURE 2
HYDRAULIC HEADS FOR PARCEL A-10 SAPROLITE WELLS
12 MAY 2014
FORMER APPLIANCE PARK EAST FACILITY
COLUMBIA, MARYLAND

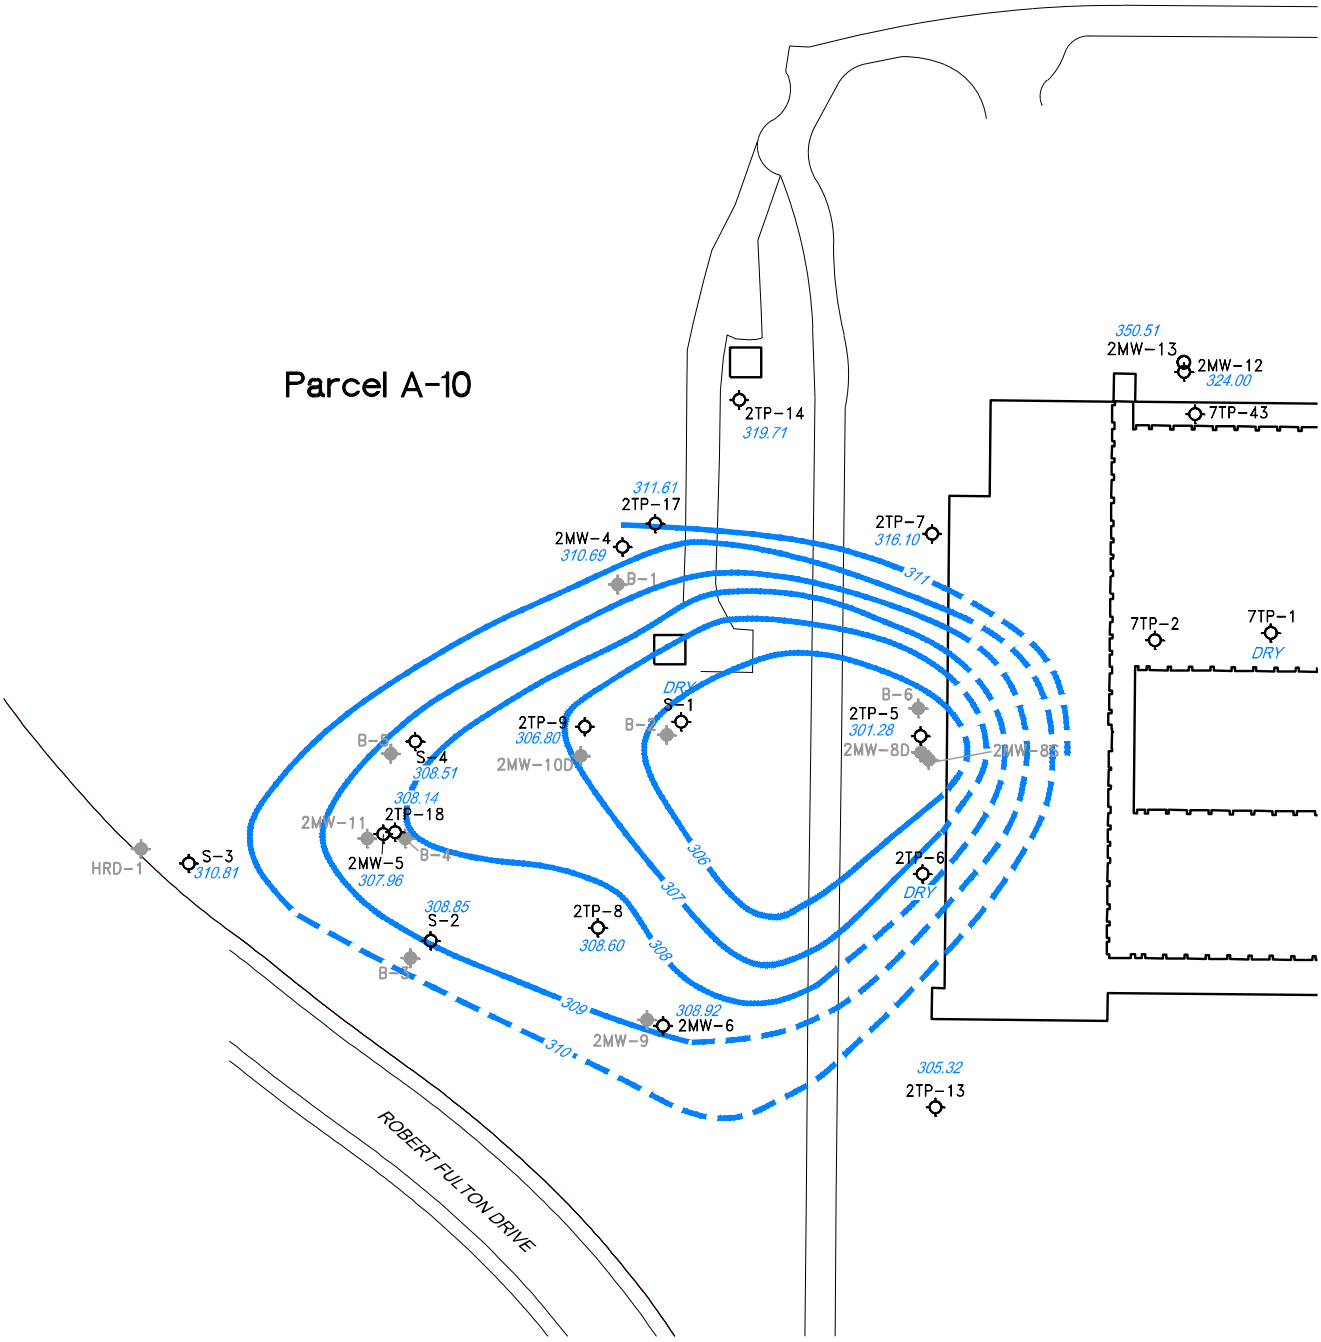

LEGEND

- SAPROLITE MONITORING WELL LOCATION
- BEDROCK MONITORING WELL LOCATION
- 304.83 GROUNDWATER ELEVATION (FEET)
- 309 GROUNDWATER ELEVATION CONTOUR (FEET) (DASHED WHERE INFERRED)

NOTES:
1. 2MW-13 IS A COASTAL PLAIN/PERCHED GROUNDWATER MONITORING WELL.
2. GROUNDWATER ELEVATIONS FOR 2MW-5 AND 2TP-13 WERE NOT USED TO DEVELOP GROUNDWATER ELEVATION CONTOURS.

150 75 0 150
SCALE IN FEET

ERM

G:\CAD\Drawings\GE-Columbia\0233146\A101.dwg

MLB/7-17-14

FIGURE 3
HYDRAULIC HEADS FOR PARCEL A-10 BEDROCK WELLS
12 MAY 2014
FORMER APPLIANCE PARK EAST FACILITY
COLUMBIA, MARYLAND

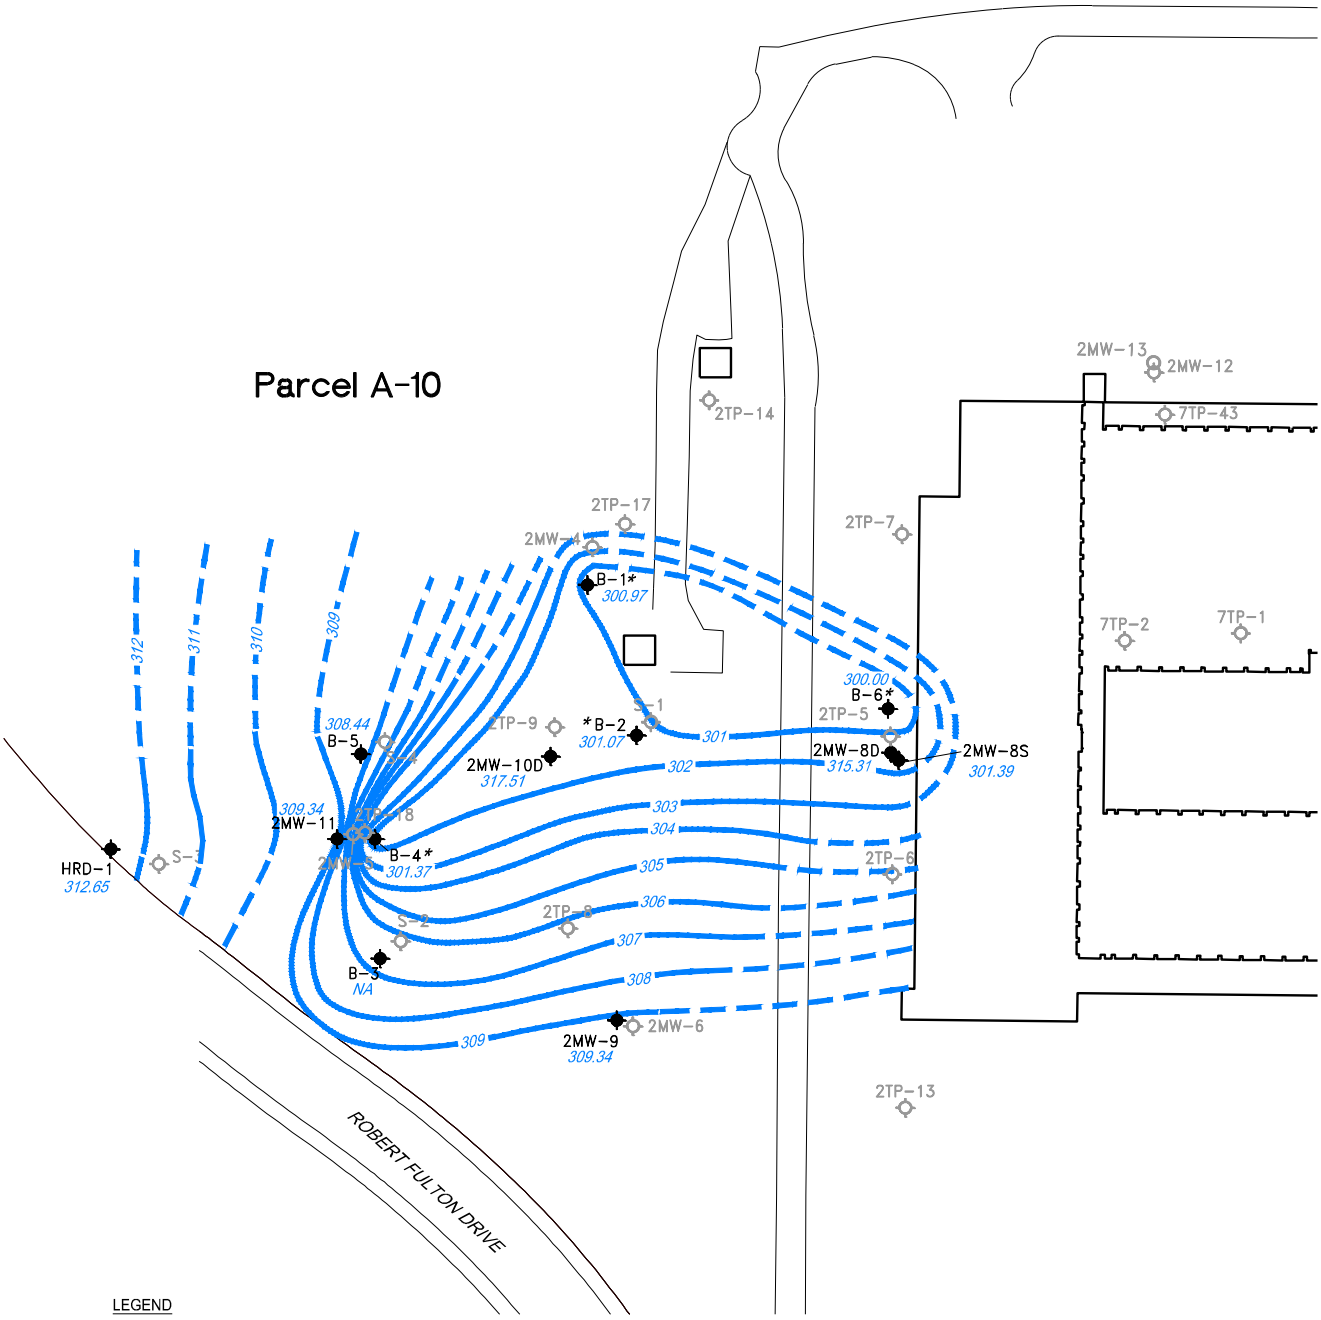

LEGEND

- SAPROLITE MONITORING WELL LOCATION
- BEDROCK MONITORING WELL LOCATION
- 304.83 GROUNDWATER ELEVATION (FEET)
- 309 GROUNDWATER ELEVATION CONTOUR (FEET) (DASHED WHERE INFERRED)
- * HYDRAULIC HEAD IS THE LOWER SET POINT FOR THE EXTRACTION WELLS
- NA GROUNDWATER ELEVATION NOT AVAILABLE; SEE NOTE 3

NOTES:
1. 2MW-13 IS A COASTAL PLAIN/PERCHED GROUNDWATER MONITORING WELL.
2. GROUNDWATER ELEVATIONS FOR 2MW-8D AND 2MW-10D WERE NOT USED TO DEVELOP GROUNDWATER ELEVATION CONTOURS.
3. B-3 WAS TURNED OFF DURING THE WATER LEVEL GAUGING EVENT, AND A WATER LEVEL WAS NOT COLLECTED; THEREFORE, A GROUNDWATER ELEVATION FOR B-3 IS NOT AVAILABLE.

150 75 0 150
SCALE IN FEET

ERM

G:\CAD\Drawings\GE-Columbia\0233146\A101.dwg

MLB/7-22-14

TABLES

Table 1
Ground Water Elevations for Monitoring Wells at Units 2 and 7 on 12 May 2014
Former Appliance Park East Facility, Columbia, Maryland

Well ID	Interpreted Lithology	Reference Point Elevation (ft > MSL)	Well Depth (ft BGS)	Well Screen Length (ft)	Well Screen Top (ft BGS)	Well Screen Bottom (ft BGS)	Screen Top Elevation (ft > MSL)	Screen Bottom Elevation (ft > MSL)	Sampling Frequency**	Water Level Monitoring Frequency	Depth to Water Measurement on 12 May 2014 (ft BRE)	Ground Water Elevation on 12 May 2014 (ft > MSL)
SAPROLITE / WATER TABLE												
7TP-1	Saprolite	345.76	24	20	4	24	342	322	Annually	Semi-Annually	Dry	Dry
2TP-5	Saprolite	358.02	63	15	48	63	308.38	293.38	Biennially***	Semi-Annually	56.74	301.28
2TP-6	Saprolite	358.79	50	15	35	50	321.41	306.41	Annually	Semi-Annually	Dry	Dry
2TP-7	Saprolite	358.76	59	15	44	59	313.16	298.16	Biennially***	Semi-Annually	42.66	316.10
2TP-8	Saprolite	348.67	62	15	47	62	299.11	284.11	Annually	Semi-Annually	40.07	308.60
2TP-9	Saprolite	348.85	55	15	40	55	305.95	290.95	Semi-Annually	Semi-Annually	42.05	306.80
2TP-10	Coastal Plain & Saprolite	358.95	23	10	13	23	345	335	Annually	Semi-Annually	18.32	340.63
2TP-11	Coastal Plain & Saprolite	357.57	30	10	20	30	338	328	Annually	Semi-Annually	19.74	337.83
2TP-13	Saprolite	362.11	59	15	44	59	315.58	300.58	Annually	Semi-Annually	56.79	305.32
2TP-14	Saprolite	348.85	48	15	33	48	314.77	299.77	Annually	Semi-Annually	29.14	319.71
2TP-17	Saprolite	349.29	47	15	32	47	314.8	299.8	None	Semi-Annually	37.68	311.61
2TP-18	Saprolite	346.42	43	15	28	43	316.02	301.02	None	Semi-Annually	38.28	308.14
2MW-4	Saprolite	348.8	46	20	26	46	320.31	300.31	Semi-Annually	Semi-Annually	38.11	310.69
2MW-5	Saprolite	346.06	68	15	53	68	290.87	275.87	Semi-Annually	Semi-Annually	38.10	307.96
2MW-6	Saprolite	350.13	44	15	29	44	318.6	303.6	Semi-Annually	Semi-Annually	41.21	308.92
2MW-12	Saprolite	353.61	36	15.0	21.0	36.0	332.57	317.57	Annually	Semi-Annually	29.61	324.00
2MW-13	Coastal Plain/Perched	353.42	11	8	3	11	350.69	342.69	Annually	Semi-Annually	2.91	350.51
S-1	Saprolite	349.94	41	30	11	41	336.9	306.9	None	Semi-Annually	Dry	Dry
S-2	Saprolite	346.89	50	30	20	50	325.06	295.06	Semi-Annually	Semi-Annually	38.04	308.85
S-3	Saprolite	347.69	50	30	20	50	325.78	295.78	Semi-Annually	Semi-Annually	36.88	310.81
S-4	Saprolite	346.14	50	30	19	49	325.23	295.23	Annually	Semi-Annually	37.63	308.51
BEDROCK												
2MW-8S	Bedrock	359.24	128	20	108	128	248.8	228.8	Semi-Annually	Semi-Annually	57.85	301.39
2MW-9	Bedrock	349.45	93	20	73	93	274.47	254.47	Semi-Annually	Semi-Annually	40.11	309.34
2MW-11	Bedrock	345.54	120	20	100	120	243.61	223.61	Semi-Annually	Semi-Annually	36.20	309.34
2MW-8D	Bedrock	359.09	208	15	193	208	163.43	148.43	Biennially***	Semi-Annually	43.78	315.31
2MW-10D	Bedrock	348.56	200	24	176	200	170.08	146.08	Biennially***	Semi-Annually	31.05	317.51
HRD-1	Bedrock	341.11	140	20	120	140	221.11	201.11	Semi-Annually	Semi-Annually	28.46	312.65
B-5	Bedrock	345.99	140	86	54	140	290.08	204.08	Semi-Annually	Semi-Annually	37.55	308.44

NOTES:

** Semi-annual frequency is twice per year in May/June and November/December time frames. Annual frequency is May/June time frame.

*** Biennial sampling is proposed for even years, starting in 2012.

BGS = below ground surface.

BRE = below referece elevation.

ft = feet.

> MSL = above mean sea level.

The low set points for the extraction wells are: B-1 300.97; B-2 301.07; B-3 306.43; B-4 301.37; B-6 300.00.

Table 2 TCE Analytical Results for Units 2 and 7 Ground Water Monitoring May 2014
Former Appliance Park East Facility, Columbia, Maryland

Well - Sample ID	Well Depth (ft BGS)	Well Screen Top	Well Screen Bottom	6/14/2007 TCE (ug/L)	12/20/2007 TCE (ug/L)	1/2008 TCE (ug/L)	5/16/2008 TCE (ug/L)	11/20/2008 TCE (ug/L)	5/29/2009 TCE (ug/L)	11/3/2009 TCE (ug/L)	5/21/2010 TCE (ug/L)
Saprolite / Water Table											
7TP-1	24	4.0	24.0	NC	NC	NC	NC	NC	NC	NC	NC
2TP-5	63.0	48.0	63.0	30,000	NR	NC	32,000	NR	36,000	NR	33,000
2TP-6	50.0	35.0	50.0	NSD	<2.0	NC	NSD	NSD	NSD	NSD	NSD
2TP-7	59.0	44.0	59.0	4,500	3,600	NC	3,800	3,200	4,200	3,200	2,800
2TP-8	62.0	47.0	62.0	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0
2TP-9	55.0	40.0	55.0	890	920	NC	930	820	940	760	690
2TP-10[CS]	21.9	13.0	23.0	NC	50,000	NC	NC	NC	NC	NC	NC
2TP-11[CS]	30.0	19.2	30.0	NC	3,200	NC	NC	NC	NC	NC	NC
2TP-13	59.0	44.0	59.0	<2.0	<2.0	NC	<2.0	0.7	0.5	<1.0	<1.0
2TP-14	58.0	43.0	58.0	5.4	4.6	NC	4.4	3.6	3.1	2.0 J	3.0 J
2MW-4	46.0	26.0	46.0	6.1	8.7	NC	10.0	9.4	13.0	11.0	14.0
2MW-5	68.0	53.0	68.0	76	69	NC	66	47	53	45	42
2MW-6	44.0	29.0	44.0	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0
2MW-12	34.9	19.9	34.9	NA	NC	890	NC	NC	NC	NC	NC
2MW-13[CP]	11.0	3.0	11.0	NA	NC	8.1	NC	NC	NC	NC	NC
S-2	50.0	20.0	50.0	4	10	NC	9	7	6	5.0 J	5.0 J
S-3	50.0	20.0	50.0	3.2	3.0	NC	2.7	2.1	1.5	2.0 J	1.0 J
S-4	50.0	20.0	50.0	530	NR	NC	410	NR	330	NR	240
Bedrock											
2MW-8S	128.0	108.0	128.0	16,000	19,000	NC	13,000	12,000	11,000	13,000	6,500
2MW-9	93.0	73.0	93.0	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0
2MW-11	120.0	100.0	120.0	160	130	NC	140	110	130	160	120
2MW-8D	208.0	193.0	208.0	130	120	NC	120	89	84	90	88
2MW-10D	200.0	176.0	200.0	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0
HRD-1	140.0	120.0	140.0	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0
B-5	140.0	54.0	140.0	190	160	NC	NS	160 E	100	120	100
Field Blank	-	-	-	<2.0	<2.0	NC	<2.0	<0.5	<0.5	<1.0	<1.0

NOTES:

NC = Not collected

NS = Not sampled due to inability to retrieve passive bag sampler

NR = Not required for this sampling event.

NSD = Not sampled due to insufficient volume of water in well

NA = Not avaliable

MW-12, MW-13, 2TP-10, and 2TP-11 added to semi-annual sampling in June 2011.

< - result is less than or not detected at this limit of quantitation.

Staring in November 2009, samples analyzed using EPA Method 8260.

[CP] Coastal Plain/Perched Well

[CS] Costal Plain & Saprolite

/ - Duplicate samples

Table 2 TCE Analytical Results for Units 2 and 7 Ground Water Monitoring May 2014
Former Appliance Park East Facility, Columbia, Maryland

Well - Sample ID	Well Depth (ft BGS)	Well Screen Top	Well Screen Bottom	11/19/2010 TCE (ug/L)	6/6/2011 TCE (ug/L)	11/18/2011 TCE (ug/L)	5/21/2012 TCE (ug/L)	11/16/2012 TCE (ug/L)	5/30/2013 TCE (ug/L)	11/25/2013 TCE (ug/L)	5/27/2014 TCE (ug/L)
Saprolite / Water Table											
7TP-1	24	4.0	24.0	NC	NSD	NR	NSD	NR	NSD	NR	NSD
2TP-5	63.0	48.0	63.0	NR	NR	NR	25,000	NR	NR	NR	20,000
2TP-6	50.0	35.0	50.0	<1.0	NSD	NR	NSD	NR	NSD	NR	NSD
2TP-7	59.0	44.0	59.0	2,300	NR	NR	2,200	NR	NR	NR	1,600
2TP-8	62.0	47.0	62.0	<1.0	<5.0	NR	<5.0	NR	<5.0	NR	<5.0
2TP-9	55.0	40.0	55.0	570	450	240	220	270	240	240	190
2TP-10[CS]	21.9	13.0	23.0	NC	68,000	NR	58,000	NR	53,000	NR	54,000
2TP-11[CS]	30.0	19.2	30.0	NC	5,400	NR	7,800	NR	6,400	NR	7,000
2TP-13	59.0	44.0	59.0	<1.0	7.0	NR	10	NR	10	NR	9
2TP-14	58.0	43.0	58.0	4.0 J	<5.0	NR	<5.0	NR	<5.0	NR	<5.0
2MW-4	46.0	26.0	46.0	16	22/22	20	30	<5.0	33	33	29
2MW-5	68.0	53.0	68.0	35	35	29	32	28	25	22	22
2MW-6	44.0	29.0	44.0	<1.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
2MW-12	34.9	19.9	34.9	NC	1,900	NR	2,000	NR	1,200	NR	1,000
2MW-13[CP]	11.0	3.0	11.0	NC	21	NR	9	NR	13	NR	11
S-2	50.0	20.0	50.0	3.0 J	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
S-3	50.0	20.0	50.0	1.0 J	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
S-4	50.0	20.0	50.0	NR	<5.0	NR	280	NR	220	NR	150
Bedrock											
2MW-8S	128.0	108.0	128.0	11,000	37,000	34,000/33,000	29,000/30,000	30,000/32,000	28,000/30,000	23,000/23,000	18,000/18,000
2MW-9	93.0	73.0	93.0	<1.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
2MW-11	120.0	100.0	120.0	90	11	<5.0	<5.0	15	11	8	11
2MW-8D	208.0	193.0	208.0	75	NR	NR	71	NR	NR	NR	53
2MW-10D	200.0	176.0	200.0	<1.0	NR	NR	<5.0	NR	NR	NR	<5.0
HRD-1	140.0	120.0	140.0	<1.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0
B-5	140.0	54.0	140.0	25	6	6	7	14	6	9	9
Field Blank	-	-	-	<1.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0	<5.0

NOTES:

NC = Not collected

NS = Not sampled due to inability to retrieve passive bag sampler

NR = Not required for this sampling event.

NSD = Not sampled due to insufficient volume of water in well

NA = Not avaliable

MW-12, MW-13, 2TP-10, and 2TP-11 added to semi-annual sampling in June 2011.

< - result is less than or not detected at this limit of quantitation.

Staring in November 2009, samples analyzed using EPA Method 8260.

[CP] Coastal Plain/Perched Well

[CS] Costal Plain & Saprolite

/ - Duplicate samples

ATTACHMENT A

Environmental Analysis Request/Chain of Custody

eurofins | Lancaster Laboratories

Acct. # 8846 For Eurofins Lancaster Laboratories use only Group # 1472612 Sample # 7439691-11 Pg 1 of 3
Instructions on reverse side correspond with circled numbers.

COC # 319759

1 Client Information

Client: ERM Annapolis
Acct. #:
Project Name/#: GE GW Parcel A-10 CMS217
PWSID #:
Project Manager: Lenny Rafalko
P.O. #: 233146.003
Sampler: Tracy Poremski
Quote #:
Name of state where samples were collected: MD

4 Matrix: Soil ☐ Sediment ☐ Water: Ground ☒ Potable ☐ Surface ☐ NPDES ☐ Other: ____

5 Analysis Requested — Preservation Codes

For Lab Use Only
FSC: ____
SCR#: 130163

Preservation Codes
H=HCl T=Thiosulfate
N=HNO_3 B=NaOH
S=H_2SO_4 O=Other

2 Sample Identification	Collected Date	Collected Time	3 Grab	Composite	Total # of Containers	VOCs 8260B	6 Remarks
TB-1 (052714)	5/27/14	1012	X		2	X	GE Data Pkg on CD
FB-1 (052714)		1420			2		
2MW-4 MS/MSD		1020			6		7-Day Hold Time
2TP-5		1308			2		
2MW-8S		1318					Full CLP Type
2MW-8D		1339					Data Pkg
2MW-8		1325					
~~2TP-6~~ tbp 5/27/14		—					VOCs NP
2TP-13		1302					
2TP-7		1348					

7 Turnaround Time (TAT) Requested (please circle)
Standard Rush
(Rush TAT is subject to Lancaster Laboratories approval and surcharge.)

Date results are needed: ____

E-mail address: ____

8 Data Package Options (circle if required)
Type I (Validation/non-CLP) Type VI (Raw Data Only)
Type III (Reduced non-CLP) TX TRRP-13
Type IV (CLP SOW) MA MCP CT RCP

9

Relinquished by	Date	Time	Received by	Date	Time
Bottle Storage					
Tracy Poremski					
			[signature]	5/28/14	1715

EDD Required? Yes No
If yes, format: ____

Site-Specific QC (MS/MSD/Dup)? Yes No
(If yes, indicate QC sample and submit triplicate sample volume.)

Relinquished by Commercial Carrier:
UPS ____ FedEx ____ Other ____

Temperature upon receipt 0.3 °C

Environmental Analysis Request/Chain of Custody

eurofins | Lancaster Laboratories Environmental

Acct. # 88446 For Eurofins Lancaster Laboratories Environmental use only Group # 1477612 Sample # 7479691-11 pg 2 & 3
Instructions on reverse side correspond with circled numbers.

COC # 341896

1 Client Information

Client: ERM Annapolis
Acct. #:
Project Name/#: GE GW Parcel A-10 chs 2/7
PWSID #:
Project Manager: Lenny Rafalko
P.O. #: 233146.003
Sampler: Tracy Poremski
Quote #:
Name of state where samples were collected: MD

4 Matrix: Sediment ☐ Soil ☐ Water: ☒ Ground ☐ Potable ☐ Surface ☐ NPDES ☐ Other: ____

5 Analysis Requested — Preservation Codes

For Lab Use Only
FSC:
SCR#:

Preservation Codes
H=HCl T=Thiosulfate
N=HNO_3 B=NaOH
S=H_2SO_4 O=Other

2 Sample Identification	Collected Date	Collected Time	3 Grab	Composite	Total # of Containers	VOCs 8260B	6 Remarks
2TP-10	5/27/14	1155	X		2	X	See pg 7
2TP-11		1208					
2MW-12		1220					
2MW-13		1231					
HRD-1		1411					
S-3		1400					
2TP-14		1142					
2TP-9		1125					
2MW-100		1135					
2TP-8		1120					

7 Turnaround Time (TAT) Requested (please circle)
Standard Rush
(Rush TAT is subject to laboratory approval and surcharge.)

Date results are needed: _____

E-mail address: _____

8 Data Package Options (circle if required)
Type I (Validation/non-CLP) Type VI (Raw Data Only)
Type III (Reduced non-CLP) TX TRRP-13
Type IV (CLP SOW) MA MCP CT RCP

9

Relinquished by	Date	Time	Received by	Date	Time
Tracy Poremski	5/27/14	0800			
			[illegible]	5/28/14	1715

EDD Required? Yes No
If yes, format: _____

Site-specific QC (MS/MSD/Dup)? Yes No
(If yes, indicate QC sample and submit triplicate sample volume.)

Relinquished by Commercial Carrier:
UPS _____ FedEx _____ Other _____

Temperature upon receipt 0.3 °C

Environmental Analysis Request/Chain of Custody

eurofins | Lancaster Laboratories Environmental

Acct. # 88446 For Eurofins Lancaster Laboratories Environmental use only Group # 1477613 Sample # 1477712-18 pg 3 of 3
Instructions on reverse side correspond with circled numbers.

COC # 341895

1 Client Information

Client: ERM Annapolis
Acct. #:
Project Name/#: GE GW Parcel A-10 CMS 2/7
PWSID #:
Project Manager: Lenny Rafalko
P.O. #: 233146.003
Sampler: Tracy Poremski
Quote #:
Name of state where samples were collected: MD

4 Matrix: Sediment ☐ Soil ☐ Water: Ground ☒ Surface ☐ Potable ☐ NPDES ☐ Other: ____

5 Analysis Requested — Preservation Codes: 1 = VOCs 8260B

For Lab Use Only
FSC:
SCR#: 147295

Preservation Codes
H=HCl T=Thiosulfate
N=HNO_3 B=NaOH
S=H_2SO_4 O=Other

2 Sample Identification	Collected Date	Collected Time	3 Grab	Composite	Sediment	Soil	Ground	Surface	Potable	NPDES	Water	Other	Total # of Containers	1 VOCs 8260B	6 Remarks
2MW-9	5/27/14	1110	X								X		2	X	See Pg 7
2MW-6		1115									X				
S-2		1058									X				
2MW-11		1050									X				
2MW-5		1044									X				
B-5		1035									X				
S-4		1030									X				

7 Turnaround Time (TAT) Requested (please circle)
Standard Rush
(Rush TAT is subject to laboratory approval and surcharge.)

Date results are needed: ____

E-mail address: ____

8 Data Package Options (circle if required)
Type I (Validation/non-CLP) Type VI (Raw Data Only)
Type III (Reduced non-CLP) TX TRRP-13
Type IV (CLP SOW) MA MCP CT RCP

9

Relinquished by	Date	Time	Received by	Date	Time
Brett Strange					
Tracy Poremski	5/27/14	0800			
			Brett Sa	5/28/14	1715

EDD Required? Yes No
If yes, format: ____

Site-Specific QC (MS/MSD/Dup)? Yes No
(If yes, indicate QC sample and submit triplicate sample volume.)

Relinquished by Commercial Carrier:
UPS ____ FedEx ____ Other ____

Temperature upon receipt 0.3 °C

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: TB-1 (052714) Water Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479691
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:12

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

T2710 SDG#: GEF25-01TB

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 12:39	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 12:39	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: FB-1 (052714) Grab Water Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479692
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 14:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

F2710 SDG#: GEF25-02FB

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		**ug/l**	**ug/l**	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 13:03	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 13:03	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-4 Unspiked Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479693
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW410 SDG#: GEF25-03BKG

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	29	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 13:27	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 13:27	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-4 MS Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479694
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW410 SDG#: GEF25-03MS

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	20	5	1
10335	Bromoform	75-25-2	20	5	1
10335	Bromomethane	74-83-9	20	5	1
10335	Carbon Tetrachloride	56-23-5	22	5	1
10335	Chlorobenzene	108-90-7	21	5	1
10335	Chloroethane	75-00-3	18	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	20	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	22	5	1
10335	Chloromethane	74-87-3	19	5	1
10335	Dibromochloromethane	124-48-1	21	5	1
10335	1,2-Dichlorobenzene	95-50-1	21	5	1
10335	1,3-Dichlorobenzene	541-73-1	21	5	1
10335	1,4-Dichlorobenzene	106-46-7	20	5	1
10335	Dichlorodifluoromethane	75-71-8	23	5	1
10335	1,1-Dichloroethane	75-34-3	21	5	1
10335	1,2-Dichloroethane	107-06-2	20	5	1
10335	1,1-Dichloroethene	75-35-4	24	5	1
10335	cis-1,2-Dichloroethene	156-59-2	23	5	1
10335	trans-1,2-Dichloroethene	156-60-5	23	5	1
10335	1,2-Dichloropropane	78-87-5	22	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	20	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	18	5	1
10335	Methylene Chloride	75-09-2	22	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	20	5	1
10335	Tetrachloroethene	127-18-4	25	5	1
10335	1,1,1-Trichloroethane	71-55-6	21	5	1
10335	1,1,2-Trichloroethane	79-00-5	21	5	1
10335	Trichloroethene	79-01-6	50	5	1
10335	Trichlorofluoromethane	75-69-4	23	5	1
10335	Vinyl Chloride	75-01-4	20	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 13:51	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 13:51	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-4 MSD Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479695
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW410 SDG#: GEF25-03MSD

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	20	5	1
10335	Bromoform	75-25-2	19	5	1
10335	Bromomethane	74-83-9	18	5	1
10335	Carbon Tetrachloride	56-23-5	21	5	1
10335	Chlorobenzene	108-90-7	22	5	1
10335	Chloroethane	75-00-3	17	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	19	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	21	5	1
10335	Chloromethane	74-87-3	19	5	1
10335	Dibromochloromethane	124-48-1	22	5	1
10335	1,2-Dichlorobenzene	95-50-1	21	5	1
10335	1,3-Dichlorobenzene	541-73-1	20	5	1
10335	1,4-Dichlorobenzene	106-46-7	19	5	1
10335	Dichlorodifluoromethane	75-71-8	22	5	1
10335	1,1-Dichloroethane	75-34-3	21	5	1
10335	1,2-Dichloroethane	107-06-2	20	5	1
10335	1,1-Dichloroethene	75-35-4	23	5	1
10335	cis-1,2-Dichloroethene	156-59-2	23	5	1
10335	trans-1,2-Dichloroethene	156-60-5	22	5	1
10335	1,2-Dichloropropane	78-87-5	21	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	19	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	19	5	1
10335	Methylene Chloride	75-09-2	21	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	20	5	1
10335	Tetrachloroethene	127-18-4	25	5	1
10335	1,1,1-Trichloroethane	71-55-6	20	5	1
10335	1,1,2-Trichloroethane	79-00-5	21	5	1
10335	Trichloroethene	79-01-6	51	5	1
10335	Trichlorofluoromethane	75-69-4	22	5	1
10335	Vinyl Chloride	75-01-4	20	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 14:15	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 14:15	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-5 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479696
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:08 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

TP510 SDG#: GEF25-04

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	250	50
10335	Bromoform	75-25-2	N.D.	250	50
10335	Bromomethane	74-83-9	N.D.	250	50
10335	Carbon Tetrachloride	56-23-5	N.D.	250	50
10335	Chlorobenzene	108-90-7	N.D.	250	50
10335	Chloroethane	75-00-3	N.D.	250	50
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	500	50
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	250	50
10335	Chloromethane	74-87-3	N.D.	250	50
10335	Dibromochloromethane	124-48-1	N.D.	250	50
10335	1,2-Dichlorobenzene	95-50-1	N.D.	250	50
10335	1,3-Dichlorobenzene	541-73-1	N.D.	250	50
10335	1,4-Dichlorobenzene	106-46-7	N.D.	250	50
10335	Dichlorodifluoromethane	75-71-8	N.D.	250	50
10335	1,1-Dichloroethane	75-34-3	N.D.	250	50
10335	1,2-Dichloroethane	107-06-2	N.D.	250	50
10335	1,1-Dichloroethene	75-35-4	N.D.	250	50
10335	cis-1,2-Dichloroethene	156-59-2	290	250	50
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	250	50
10335	1,2-Dichloropropane	78-87-5	N.D.	250	50
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	250	50
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	250	50
10335	Methylene Chloride	75-09-2	N.D.	250	50
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	250	50
10335	Tetrachloroethene	127-18-4	N.D.	250	50
10335	1,1,1-Trichloroethane	71-55-6	N.D.	250	50
10335	1,1,2-Trichloroethane	79-00-5	N.D.	250	50
10335	Trichloroethene	79-01-6	20,000	2,500	500
10335	Trichlorofluoromethane	75-69-4	N.D.	250	50
10335	Vinyl Chloride	75-01-4	N.D.	250	50

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 14:38	Chelsea B Stong	50
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 15:02	Chelsea B Stong	500
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 14:38	Chelsea B Stong	50
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 15:02	Chelsea B Stong	500

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-8S Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479697
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:18 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

M8S10 SDG#: GEF25-05

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	100	20
10335	Bromoform	75-25-2	N.D.	100	20
10335	Bromomethane	74-83-9	N.D.	100	20
10335	Carbon Tetrachloride	56-23-5	N.D.	100	20
10335	Chlorobenzene	108-90-7	N.D.	100	20
10335	Chloroethane	75-00-3	N.D.	100	20
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	200	20
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	100	20
10335	Chloromethane	74-87-3	N.D.	100	20
10335	Dibromochloromethane	124-48-1	N.D.	100	20
10335	1,2-Dichlorobenzene	95-50-1	N.D.	100	20
10335	1,3-Dichlorobenzene	541-73-1	N.D.	100	20
10335	1,4-Dichlorobenzene	106-46-7	N.D.	100	20
10335	Dichlorodifluoromethane	75-71-8	N.D.	100	20
10335	1,1-Dichloroethane	75-34-3	N.D.	100	20
10335	1,2-Dichloroethane	107-06-2	N.D.	100	20
10335	1,1-Dichloroethene	75-35-4	N.D.	100	20
10335	cis-1,2-Dichloroethene	156-59-2	370	100	20
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	100	20
10335	1,2-Dichloropropane	78-87-5	N.D.	100	20
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	100	20
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	100	20
10335	Methylene Chloride	75-09-2	N.D.	100	20
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	100	20
10335	Tetrachloroethene	127-18-4	N.D.	100	20
10335	1,1,1-Trichloroethane	71-55-6	N.D.	100	20
10335	1,1,2-Trichloroethane	79-00-5	N.D.	100	20
10335	Trichloroethene	79-01-6	18,000	1,000	200
10335	Trichlorofluoromethane	75-69-4	N.D.	100	20
10335	Vinyl Chloride	75-01-4	N.D.	100	20

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 15:26	Chelsea B Stong	20
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 15:50	Chelsea B Stong	200
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 15:26	Chelsea B Stong	20
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 15:50	Chelsea B Stong	200

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-8D Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479698
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:39 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

M8D10 SDG#: GEF25-06

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	53	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 16:14	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 16:14	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-8 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479699
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:25 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW810 SDG#: GEF25-07

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	250	50
10335	Bromoform	75-25-2	N.D.	250	50
10335	Bromomethane	74-83-9	N.D.	250	50
10335	Carbon Tetrachloride	56-23-5	N.D.	250	50
10335	Chlorobenzene	108-90-7	N.D.	250	50
10335	Chloroethane	75-00-3	N.D.	250	50
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	500	50
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	250	50
10335	Chloromethane	74-87-3	N.D.	250	50
10335	Dibromochloromethane	124-48-1	N.D.	250	50
10335	1,2-Dichlorobenzene	95-50-1	N.D.	250	50
10335	1,3-Dichlorobenzene	541-73-1	N.D.	250	50
10335	1,4-Dichlorobenzene	106-46-7	N.D.	250	50
10335	Dichlorodifluoromethane	75-71-8	N.D.	250	50
10335	1,1-Dichloroethane	75-34-3	N.D.	250	50
10335	1,2-Dichloroethane	107-06-2	N.D.	250	50
10335	1,1-Dichloroethene	75-35-4	N.D.	250	50
10335	cis-1,2-Dichloroethene	156-59-2	380	250	50
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	250	50
10335	1,2-Dichloropropane	78-87-5	N.D.	250	50
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	250	50
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	250	50
10335	Methylene Chloride	75-09-2	N.D.	250	50
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	250	50
10335	Tetrachloroethene	127-18-4	N.D.	250	50
10335	1,1,1-Trichloroethane	71-55-6	N.D.	250	50
10335	1,1,2-Trichloroethane	79-00-5	N.D.	250	50
10335	Trichloroethene	79-01-6	18,000	2,500	500
10335	Trichlorofluoromethane	75-69-4	N.D.	250	50
10335	Vinyl Chloride	75-01-4	N.D.	250	50

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 16:38	Chelsea B Stong	50
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 17:01	Chelsea B Stong	500
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 16:38	Chelsea B Stong	50
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 17:01	Chelsea B Stong	500

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-13 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479700
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:02 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

T1310 SDG#: GEF25-08

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	9	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 17:25	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 17:25	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-7 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479701
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 13:48 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

TP710 SDG#: GEF25-09

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	25	5
10335	Bromoform	75-25-2	N.D.	25	5
10335	Bromomethane	74-83-9	N.D.	25	5
10335	Carbon Tetrachloride	56-23-5	N.D.	25	5
10335	Chlorobenzene	108-90-7	N.D.	25	5
10335	Chloroethane	75-00-3	N.D.	25	5
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	50	5
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	25	5
10335	Chloromethane	74-87-3	N.D.	25	5
10335	Dibromochloromethane	124-48-1	N.D.	25	5
10335	1,2-Dichlorobenzene	95-50-1	N.D.	25	5
10335	1,3-Dichlorobenzene	541-73-1	N.D.	25	5
10335	1,4-Dichlorobenzene	106-46-7	N.D.	25	5
10335	Dichlorodifluoromethane	75-71-8	N.D.	25	5
10335	1,1-Dichloroethane	75-34-3	N.D.	25	5
10335	1,2-Dichloroethane	107-06-2	N.D.	25	5
10335	1,1-Dichloroethene	75-35-4	N.D.	25	5
10335	cis-1,2-Dichloroethene	156-59-2	63	25	5
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	25	5
10335	1,2-Dichloropropane	78-87-5	N.D.	25	5
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	25	5
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	25	5
10335	Methylene Chloride	75-09-2	N.D.	25	5
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	25	5
10335	Tetrachloroethene	127-18-4	N.D.	25	5
10335	1,1,1-Trichloroethane	71-55-6	N.D.	25	5
10335	1,1,2-Trichloroethane	79-00-5	N.D.	25	5
10335	Trichloroethene	79-01-6	1,600	250	50
10335	Trichlorofluoromethane	75-69-4	N.D.	25	5
10335	Vinyl Chloride	75-01-4	N.D.	25	5

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 17:49	Chelsea B Stong	5
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 18:13	Chelsea B Stong	50
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 17:49	Chelsea B Stong	5
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 18:13	Chelsea B Stong	50

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-10 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479702
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:55 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

T1010 SDG#: GEF25-10

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	500	100
10335	Bromoform	75-25-2	N.D.	500	100
10335	Bromomethane	74-83-9	N.D.	500	100
10335	Carbon Tetrachloride	56-23-5	N.D.	500	100
10335	Chlorobenzene	108-90-7	N.D.	500	100
10335	Chloroethane	75-00-3	N.D.	500	100
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	1,000	100
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	500	100
10335	Chloromethane	74-87-3	N.D.	500	100
10335	Dibromochloromethane	124-48-1	N.D.	500	100
10335	1,2-Dichlorobenzene	95-50-1	N.D.	500	100
10335	1,3-Dichlorobenzene	541-73-1	N.D.	500	100
10335	1,4-Dichlorobenzene	106-46-7	N.D.	500	100
10335	Dichlorodifluoromethane	75-71-8	N.D.	500	100
10335	1,1-Dichloroethane	75-34-3	N.D.	500	100
10335	1,2-Dichloroethane	107-06-2	N.D.	500	100
10335	1,1-Dichloroethene	75-35-4	N.D.	500	100
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	500	100
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	500	100
10335	1,2-Dichloropropane	78-87-5	N.D.	500	100
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	500	100
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	500	100
10335	Methylene Chloride	75-09-2	N.D.	500	100
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	500	100
10335	Tetrachloroethene	127-18-4	N.D.	500	100
10335	1,1,1-Trichloroethane	71-55-6	N.D.	500	100
10335	1,1,2-Trichloroethane	79-00-5	N.D.	500	100
10335	Trichloroethene	79-01-6	54,000	5,000	1000
10335	Trichlorofluoromethane	75-69-4	N.D.	500	100
10335	Vinyl Chloride	75-01-4	N.D.	500	100

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 18:37	Chelsea B Stong	100
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 19:01	Chelsea B Stong	1000
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 18:37	Chelsea B Stong	100
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 19:01	Chelsea B Stong	1000

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-11 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479703
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 12:08 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

T1110 SDG#: GEF25-11

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	50	10
10335	Bromoform	75-25-2	N.D.	50	10
10335	Bromomethane	74-83-9	N.D.	50	10
10335	Carbon Tetrachloride	56-23-5	N.D.	50	10
10335	Chlorobenzene	108-90-7	N.D.	50	10
10335	Chloroethane	75-00-3	N.D.	50	10
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	100	10
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	50	10
10335	Chloromethane	74-87-3	N.D.	50	10
10335	Dibromochloromethane	124-48-1	N.D.	50	10
10335	1,2-Dichlorobenzene	95-50-1	N.D.	50	10
10335	1,3-Dichlorobenzene	541-73-1	N.D.	50	10
10335	1,4-Dichlorobenzene	106-46-7	N.D.	50	10
10335	Dichlorodifluoromethane	75-71-8	N.D.	50	10
10335	1,1-Dichloroethane	75-34-3	N.D.	50	10
10335	1,2-Dichloroethane	107-06-2	N.D.	50	10
10335	1,1-Dichloroethene	75-35-4	N.D.	50	10
10335	cis-1,2-Dichloroethene	156-59-2	< 50	50	10
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	50	10
10335	1,2-Dichloropropane	78-87-5	N.D.	50	10
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	50	10
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	50	10
10335	Methylene Chloride	75-09-2	N.D.	50	10
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	50	10
10335	Tetrachloroethene	127-18-4	N.D.	50	10
10335	1,1,1-Trichloroethane	71-55-6	N.D.	50	10
10335	1,1,2-Trichloroethane	79-00-5	N.D.	50	10
10335	Trichloroethene	79-01-6	7,000	500	100
10335	Trichlorofluoromethane	75-69-4	N.D.	50	10
10335	Vinyl Chloride	75-01-4	N.D.	50	10

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 19:25	Chelsea B Stong	10
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 19:49	Chelsea B Stong	100
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 19:25	Chelsea B Stong	10
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 19:49	Chelsea B Stong	100

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-12 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479704
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 12:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

M1210 SDG#: GEF25-12

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	10	2
10335	Bromoform	75-25-2	N.D.	10	2
10335	Bromomethane	74-83-9	N.D.	10	2
10335	Carbon Tetrachloride	56-23-5	N.D.	10	2
10335	Chlorobenzene	108-90-7	N.D.	10	2
10335	Chloroethane	75-00-3	N.D.	10	2
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	20	2
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	10	2
10335	Chloromethane	74-87-3	N.D.	10	2
10335	Dibromochloromethane	124-48-1	N.D.	10	2
10335	1,2-Dichlorobenzene	95-50-1	N.D.	10	2
10335	1,3-Dichlorobenzene	541-73-1	N.D.	10	2
10335	1,4-Dichlorobenzene	106-46-7	N.D.	10	2
10335	Dichlorodifluoromethane	75-71-8	N.D.	10	2
10335	1,1-Dichloroethane	75-34-3	N.D.	10	2
10335	1,2-Dichloroethane	107-06-2	N.D.	10	2
10335	1,1-Dichloroethene	75-35-4	N.D.	10	2
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	10	2
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	10	2
10335	1,2-Dichloropropane	78-87-5	N.D.	10	2
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	10	2
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	10	2
10335	Methylene Chloride	75-09-2	N.D.	10	2
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	10	2
10335	Tetrachloroethene	127-18-4	N.D.	10	2
10335	1,1,1-Trichloroethane	71-55-6	N.D.	10	2
10335	1,1,2-Trichloroethane	79-00-5	N.D.	10	2
10335	Trichloroethene	79-01-6	1,000	100	20
10335	Trichlorofluoromethane	75-69-4	N.D.	10	2
10335	Vinyl Chloride	75-01-4	N.D.	10	2

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 20:12	Chelsea B Stong	2
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 20:36	Chelsea B Stong	20
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 20:12	Chelsea B Stong	2
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141511AA	05/31/2014 20:36	Chelsea B Stong	20

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-13 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479705
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 12:31 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

M1310 SDG#: GEF25-13

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	< 5	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	11	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 21:00	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 21:00	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: HRD-1 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479706
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 14:11 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

HR110 SDG#: GEF25-14

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 21:24	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 21:24	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: S-3 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479707
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 14:00 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

S-310 SDG#: GEF25-15

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141511AA	05/31/2014 21:48	Chelsea B Stong	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141511AA	05/31/2014 21:48	Chelsea B Stong	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-14 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479708
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:42 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

T1410 SDG#: GEF25-16

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	37	5	1
10335	trans-1,2-Dichloroethene	156-60-5	< 5	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	< 5	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 12:35	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 12:35	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-9 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479709
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:25 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

TP910 SDG#: GEF25-17

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	< 5	5	1
10335	cis-1,2-Dichloroethene	156-59-2	290	50	10
10335	trans-1,2-Dichloroethene	156-60-5	7	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	190	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 12:59	Linda C Pape	1
10335	GE VOCs by 8260	SW-846 8260B	1	T141532AA	06/03/2014 04:38	Amanda K Richards	10
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 12:59	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	2	T141532AA	06/03/2014 04:38	Amanda K Richards	10

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-10D Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479710
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:35 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

10D10 SDG#: GEF25-18

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 13:23	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 13:23	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2TP-8 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479711
LL Group # 1477612
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:20 by TP

Submitted: 05/28/2014 17:15
Reported: 07/01/2014 13:01

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

TP810 SDG#: GEF25-19*

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 13:46	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 13:46	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-9 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479712
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:10 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW910 SDG#: GEF26-01

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 14:10	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 14:10	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-6 Grab Groundwater SamplE
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479713
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 11:15 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW610 SDG#: GEF26-02

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	N.D.	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	N.D.	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 14:34	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 14:34	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: S-2 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479714
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:58 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

S-210 SDG#: GEF26-03

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	< 5	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	< 5	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 14:58	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 14:58	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-11 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479715
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:50 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

M1110 SDG#: GEF26-04

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	61	5	1
10335	trans-1,2-Dichloroethene	156-60-5	< 5	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	11	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 15:22	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 15:22	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: 2MW-5 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479716
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:44 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

MW510 SDG#: GEF26-05

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	7	5	1
10335	trans-1,2-Dichloroethene	156-60-5	N.D.	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	22	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 15:46	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 15:46	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: B-5 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479717
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:35 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

B-510 SDG#: GEF26-06

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	41	5	1
10335	trans-1,2-Dichloroethene	156-60-5	< 5	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	9	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 16:10	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 16:10	Linda C Pape	1

eurofins
Lancaster Laboratories Environmental
2425 New Holland Pike, Lancaster, PA 17601 • 717-656-2300 • Fax: 717-656-2681 • www.LancasterLabs.com

Analysis Report

REVISED

Sample Description: S-4 Grab Groundwater Sample
WO# 129119.3
GE - Parcel A10 GW

LL Sample # WW 7479718
LL Group # 1477613
Account # 08846

Project Name: GE GW Parcel A-10 CMS2/7

Collected: 05/27/2014 10:30 by TP

Submitted: 05/28/2014 17:15
Reported: 07/09/2014 15:48

General Electric Company
Corporate Env. Programs
319 Great Oaks Office Park
Albany NY 12203

S-410 SDG#: GEF26-07*

CAT No.	Analysis Name	CAS Number	As Received Result	As Received Limit of Quantitation	Dilution Factor
GC/MS Volatiles	**SW-846 8260B**		ug/l	ug/l	
10335	Bromodichloromethane	75-27-4	N.D.	5	1
10335	Bromoform	75-25-2	N.D.	5	1
10335	Bromomethane	74-83-9	N.D.	5	1
10335	Carbon Tetrachloride	56-23-5	N.D.	5	1
10335	Chlorobenzene	108-90-7	N.D.	5	1
10335	Chloroethane	75-00-3	N.D.	5	1
10335	2-Chloroethyl Vinyl Ether	110-75-8	N.D.	10	1
	2-Chloroethyl vinyl ether may not be recovered if acid was used to preserve this sample.				
10335	Chloroform	67-66-3	N.D.	5	1
10335	Chloromethane	74-87-3	N.D.	5	1
10335	Dibromochloromethane	124-48-1	N.D.	5	1
10335	1,2-Dichlorobenzene	95-50-1	N.D.	5	1
10335	1,3-Dichlorobenzene	541-73-1	N.D.	5	1
10335	1,4-Dichlorobenzene	106-46-7	N.D.	5	1
10335	Dichlorodifluoromethane	75-71-8	N.D.	5	1
10335	1,1-Dichloroethane	75-34-3	N.D.	5	1
10335	1,2-Dichloroethane	107-06-2	N.D.	5	1
10335	1,1-Dichloroethene	75-35-4	N.D.	5	1
10335	cis-1,2-Dichloroethene	156-59-2	41	5	1
10335	trans-1,2-Dichloroethene	156-60-5	< 5	5	1
10335	1,2-Dichloropropane	78-87-5	N.D.	5	1
10335	cis-1,3-Dichloropropene	10061-01-5	N.D.	5	1
10335	trans-1,3-Dichloropropene	10061-02-6	N.D.	5	1
10335	Methylene Chloride	75-09-2	N.D.	5	1
10335	1,1,2,2-Tetrachloroethane	79-34-5	N.D.	5	1
10335	Tetrachloroethene	127-18-4	N.D.	5	1
10335	1,1,1-Trichloroethane	71-55-6	N.D.	5	1
10335	1,1,2-Trichloroethane	79-00-5	N.D.	5	1
10335	Trichloroethene	79-01-6	150	5	1
10335	Trichlorofluoromethane	75-69-4	N.D.	5	1
10335	Vinyl Chloride	75-01-4	N.D.	5	1

General Sample Comments

All QC is compliant unless otherwise noted. Please refer to the Quality Control Summary for overall QC performance data and associated samples.

Laboratory Sample Analysis Record

CAT No.	Analysis Name	Method	Trial#	Batch#	Analysis Date and Time	Analyst	Dilution Factor
10335	GE VOCs by 8260	SW-846 8260B	1	T141531AA	06/02/2014 16:34	Linda C Pape	1
01163	GC/MS VOA Water Prep	SW-846 5030B	1	T141531AA	06/02/2014 16:34	Linda C Pape	1